




Length 长度 (mm)	Width 宽度 (mm)	Part 件号	Line 行号	Qty 数量	Unit 单位	Sub Unit 子件号	Description 描述	Material 材料	Length 长度 (mm)	Finish 表面处理	AFM 材料行号	Weight 重量 (kg)	REMARK 备注
390	905	1 390											
		付件表											
			1	1		BE020	Beam						
1810.02.10.03.12			2	1		BE020	HW00030010x15	0308	3148	G		282.27	
1810.02.10.03.12			3	2		p52	PL10x10	0308	140	G		1.46	
1810.02.10.03.12			4	1		p118	PL10x20	0308	326	G		12.28	
1810.02.10.03.12			5	2		p175	PL10x45.3	0308	580	G		43.16	
											TOTAL	336.18	

ASSEMBLY BOLT LIST (FOR 1 ASSEMBLY)					
Dia.	Grade	Pay Code	Length	No.	Site/Shop
20	A325M	G	C1	55	6 Site

(Mechanical galvanized only for DTI washer)

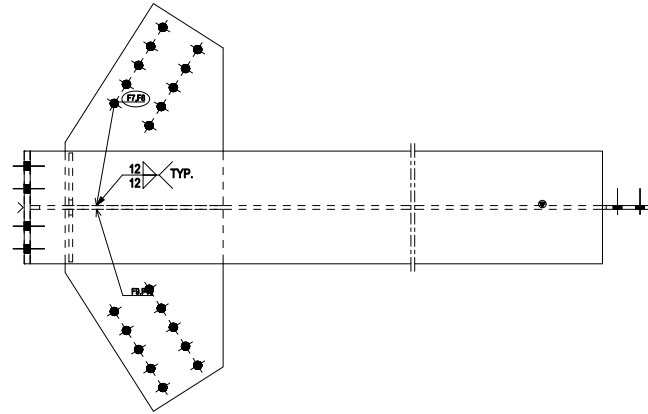

A - A
1:10

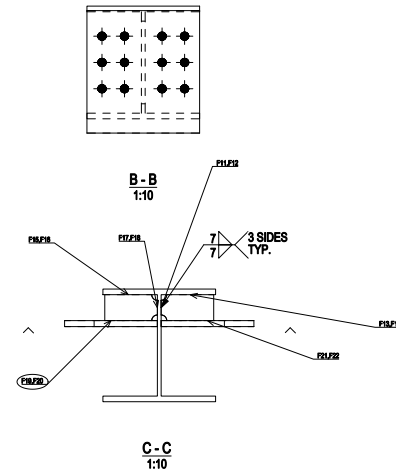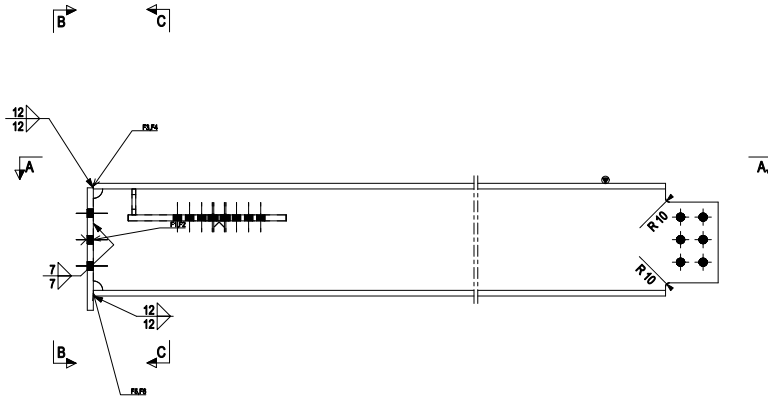

1	A-B/1-2/QNHD +17.200
QTY	MEMBERS LOCATION

1 Beam BE020

1. ACCUMULATIVE DIMENSIONS ARE TAKEN FROM THE "100" LINE. 累积尺寸须参照“100”线标注。
2. ALL GAS-ON-OUTWENT CUTS WILL HAVE A RADIUS OF 3mm UNLESS. 除非另有标注, 所有气焊外口切口须有 3mm 圆角。
3. ALL BURNUPS THIS SHEET HAVE TO BE PREPARED (001-AC202-0-01) 所有本图上的堆焊须按 001-AC202-0-01 进行。
4. ASSEMBLY MARK TO BE STRAINED ON THE FACE WHERE INDICATED THEREIN. 零件编号须按图面标注。
5. "X" DENOTES THE TOUCH FACE OF MEMBERS, SHOP MARK OFF THEM. "X" 标注处为零件接触面, 工厂需标注面。
6. ALL THE DIAMETER OF BOLLAR IS 25mm UNLESS. 除非另有标注, 所有螺栓直径均为 25mm。
7. ALL WELDS SHALL BE CONTINUOUS, UNLESS. 除非另有标注, 所有焊缝须连续。
8. WELD HEADS OF 3MM FILLET WELD SHALL BE PROVIDED BY WELDED CONNECTIONS. 所有 3mm 角焊缝须由熔接接头提供。
9. TYPICAL VIEWS OF BOLT ARE NOT REQUIRED TO ORIGINATE FROM THE PERMANENT BOLT. 螺栓典型视图不必从永久螺栓上标注。

[illegible]