



6				7				8							
Length 长度 (mm)	Width 宽度 (mm)	Thickness 厚度 (mm)	Part Cat. 材料分类	Line 行号	Qty 数量	Mat. 材料号	Description 描述	Material 材料	Length 长度 (mm)	Width 宽度	Thickness 厚度	Part Cat. 材料分类	Weight 重量 (kg)	REMARK 备注	
1810.02.10.03.12	94	30		1	1	BE023									
1810.02.10.03.12				1	1	BE023	HW0000000010r15	Q235B	9820	G			865.53		
1810.02.10.03.12				3	1	p42	FL10r73	Q235B	140	G			0.75		
1810.02.10.03.12				4	1	p43	FL10r73	Q235B	440	G			13.16		
1810.02.10.03.12				5	1	p45	FL10r73	Q235B	140	G			1.04		
1810.02.10.03.12				8	2	p200	FL10r40	Q235B	288	G			5.51		
													TOTAL	916.00	

ASSEMBLY BOLT LIST (FOR 1 ASSEMBLY)					
Dia.	Grade	Pay Code	Length	No.	Site/Shop
20	A325M	G	C1	55	12
Site					

(Mechanical galvanized only for DTI washer)

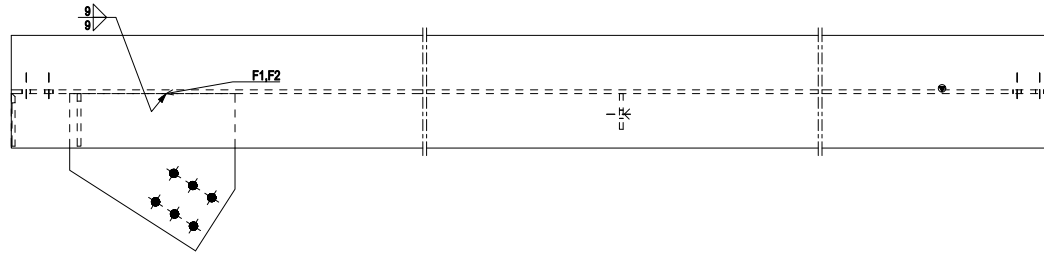

A - A
1:10

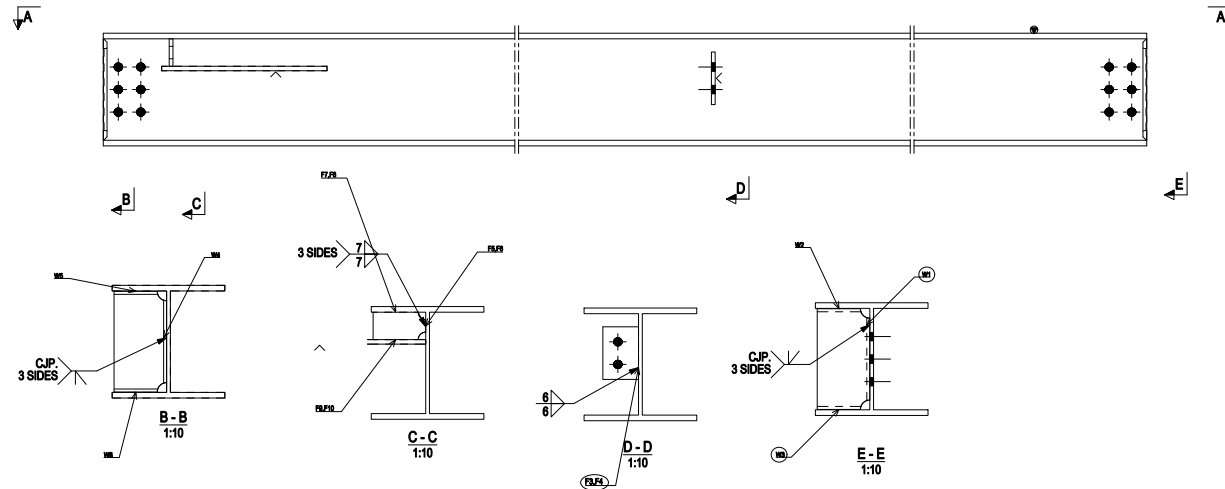

1	A-B/1-2/QNHD +13.800
QTY	MEMBERS LOCATION

1 Beam BE023

1. ACCUMULATIVE DIMENSIONS ARE TAKEN FROM THE "0" LINE. 累积尺寸均须标注到“0”标注处。
2. ALL GDS OR GDS+TOUT MUST HAVE A HOLE OF 0.004 U.S.G. 所有GDS或GDS+TOUT必须有0.004英寸的孔。
3. ALL DIMENSIONS THAT MEET TO BE PREPARED TO ACC20-0-41. 达到规格要求的所有尺寸均须按照ACC20-0-41。
4. ASSEMBLY MUST BE TO GRAMPS ON THE FACE WHEN INDICATED THERE. 装配时必须按照面指示。
5. "X" DENOTES THE TOUCH FACE OF MEMBERS, AND MUST NOT BE THERE. "X"为接触面指示，不可有接触面。
6. ALL THE DIAMETER OF SCALLOP IS 0.004 U.S.G. 所有凹形圆角尺寸均为0.004英寸。
7. ALL WELDS SHALL BE CONTINUOUS U.S.G. 所有焊缝必须是连续焊缝。
8. ALL WELDS OF 3MM FILL WELDS SHALL BE PROVIDED BY WELDED CONNECTIONS. 所有3毫米填充焊缝必须由焊接连接提供。
9. TIGHTENING TORQUE SHALL BE SET CONFORM TO STANDARD OF THE PERMANENT JOINT. 紧固力矩必须符合永久接头的标准。

[illegible]