



6			7					8						
Length 长度(mm)	Width 宽度(mm)	Height 高度(mm)	Pay Cat. 付款单号	Line 行	Qty 数量	Mark 构件号	Sub Mat 次构件号	Description 描述	Material 材质	Length 长度(mm)	Finish 面	ARM 材料订单号	Weight 重量(kg)	REMARKS 备注
				1		BE018		Beam						
				2		BE018		HEX30x500x10x15	Q235B	3621	G		371.65	
1810.02.10.03.12				3	1	FL100		FL100	Q235B	140	G		0.75	
1810.02.10.03.12				4	1	p53		FL100x11.4	Q235B	589	G		22.38	
1810.02.10.03.12				5	1		p118	FL100	Q235B	328	G		12.28	
												TOTAL	383.03	


ASSEMBLY BOLT LIST (FOR 1 ASSEMBLY)					
Dia.	Grade	Pay Code	Length	No.	Site/Shop
20	A325M	G	C1	55	6
(Mechanical galvanized only for DT1 washer)					

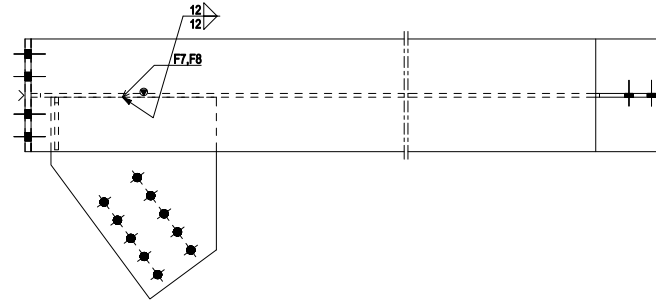


A - A
1:10



B - E
1:10

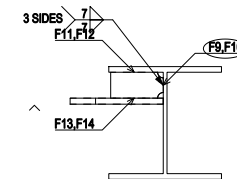

C - C
1:10

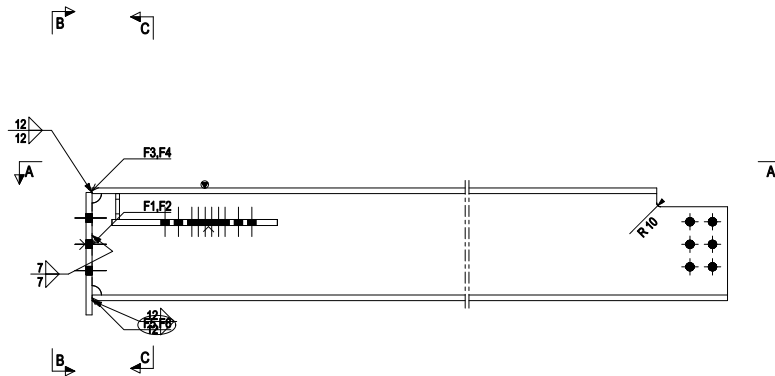

1	A-B/1-2/QNHD +17.200
QTY	MEMBERS LOCATION

1 Beam BE018

1. ACCUMULATIVE DIMENSIONS ARE TAKEN FROM THE "TOP" LINE. 累积尺寸必须取自“顶”开始测量。
2. ALL GROUND SURFACES CUT/TO BE HAVING A FINISH OF 3mm UNGO. 所有地面必须切/至 3mm 粗糙度。
3. ALL DIMENSIONS THIS SHEET TO BE PROVIDED (DIM+/-0.025/0.01) 尺寸必须提供此图 (DIM+/-0.025/0.01)
4. ASSEMBLY MARKS TO BE STAMPED ON THE FACE WHEN REQUIRED TO 100%. 零件号必须 打上 100%。
5. "X" DENOTES THE TOUCH FACE OF MEMBERS, SHOP MARK IF NOT. "X" 符号代表接触面, 工厂面内。
6. ALL THE DIAMETER OF SCROLLS > 25mm UNGO. 所有直径大于 25mm 的, 必须打粗糙度。
7. ALL WELDS SHALL BE CONTINUOUS UNGO. 所有焊接必须连续, 必须打粗糙度。
8. SMALL WELDS OF SMALL PIPES SHALL BE PROVIDED BY WELDED CONNECTIONS. 小管的小焊缝必须用焊接连接。
9. TOP SURFACE CUT SHALL BE RE-FOUR TO OVERSHOOT FROM THE FURNACE CUT. 顶面切面必须用炉面切面再切。

[illegible]