
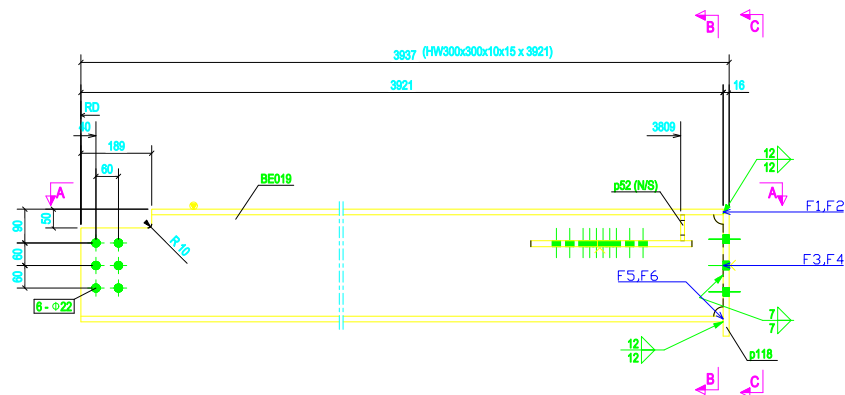
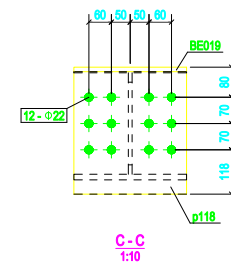
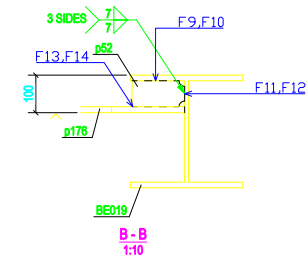


6				7				8					
Length L5 (mm)	Width W5 (mm)	Height H5 (mm)	Pay Cat. 付款条件	Line 行号	Qty. 数量	Mark 材料号	Description 零件描述	Material 材质	Length L6 (mm)	Finish 表面处理	Weight 重量 (kg)	REMARK 备注	
507	62	38		1		BEO19							
1810.02.10.03.12				2	1	BEO19	H1000x300x10x15	C250B	3621	G	357.65		
1810.02.10.03.12				3	1		p52 FL15x50	C250B	140	G	0.73		
1810.02.10.03.12				4	1		p118 FL15x50	C250B	306	G	12.28		
1810.02.10.03.12				5	1		p176 FL15x39.5	C250B	537	G	22.08		
											TOTAL	382.74	

ASSEMBLY BOLT LIST (FOR 1 ASSEMBLY)					
Dis.	Grade	Pay Code	Length	No.	Site/Shop
20	A325M	G	C1	55	6 Site

(Mechanical galvanized only for DTI washer)

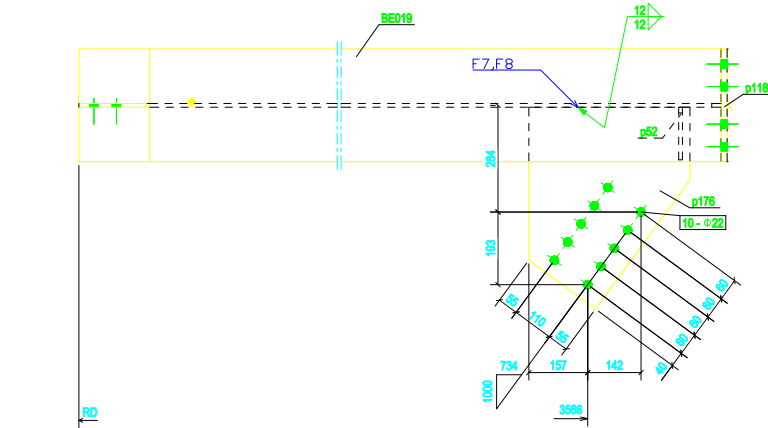

1	A-B/1-2/QNHD +17.200
QTY	MEMBERS LOCATION

1 Beam BE019

1. ACCUMULATIVE DIMENSIONS ARE TAKEN FROM THE "100" LINE. 累积尺寸均参照累积“100”开始计算。
2. ALL GAS-ON CONTACT CUTS WILL HAVE A RADIUS OF 3mm (R3). 所有气割切口均要有3mm圆角。圆角半径。
3. ALL DIMENSIONS THIS DRAFT TO BE PREPARED (附图尺寸) 均按此图样要求。 (附图尺寸) 均按此图样要求。
4. ASSEMBLY MARKS TO BE STAMPED ON THE FACE WHERE INDICATED THEREIN. 零件号均打 在表面上。
5. "X" DENOTES THE TOUCH FACE OF MEMBERS, SHOP MUST SPOT THEM. "X" 为外触面符号。工厂打点外触面。
6. ALL THE DIAMETER OF BOLLAR IS 25mm (R3). 所有螺栓杆径均为25mm。统一为25mm。
7. ALL WELDS SHALL BE CONTINUOUS, N.B.G. 所有焊缝均须连续。连续焊缝。
8. SMALL WELDS OF 3MM FILLET WELD SHALL BE PROVIDED IN WELDED CONNECTIONS. 所有管与管连接处要有3mm角焊。
9. TUBES/WELLS WILL BE FILL-COVED TO OVERFLOW FROM THE PERMANENT BOLL. 管与管连接处须有永久螺栓。
10. TUBES/WELLS WILL BE FILL-COVED TO OVERFLOW FROM THE PERMANENT BOLL. 管与管连接处须有永久螺栓。

[illegible]