

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 1

P-180 (Avanti II)

N490JD

S/N: 1128

N493JD

S/N: 1150

TABLE OF CONTENTS

System ATA NO.	System Title	Page
---	Table of Contents	1
---	Revision Record	3
---	Control Pages	5
---	Definitions	7
---	Preamble	11
---	Company Procedures	13
21	Air Conditioning	21-1
22	Autopilot	22-1
23	Communications	23-1
24	Electrical	24-1
25	Equipment / Furnishings	25-1
26	Fire Protection	26-1
27	Flight Controls	27-1
28	Fuel	28-1
29	Hydraulic Power	29-1
30	Ice and Rain Protection	30-1
31	Indicating / Recording Systems	31-1
32	Landing Gear	32-1
33	Lights	33-1
34	Navigation	34-1
35	Oxygen	35-1
45	Central Maintenance Computer	45-1
46	Information Systems	46-1
52	Doors	52-1
61	Propellers	61-1
73	Engine Fuel & Control	73-1
79	Engine Oil	79-1
---	MEL Index	IND-1

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 2

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 3

REVISION RECORD

Highlights of Change

Revision #	Date	Summary of Changes
Original	09-11-18	Initial issue.

Revision Log

Revision #	Date	Affected pages	Initials
Original	09-11-18	All	---

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 4

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 5

This manual is applicable to Brazos Valley Air Charter, LLC Piaggio P-180 (Avanti II) series aircraft and is no less restrictive than revision 4 of the FAA approved Piaggio P-180 (Avanti II) Series MMEL dated 07/26/2010.

CONTROL PAGES



Page	Rev #	Date	Page	Rev #	Date	Page	Rev #	Date
1	Original	09-11-18	23-2	Original	09-11-18	27-4	Original	09-11-18
2	Original	09-11-18	23-3	Original	09-11-18	28 Fuel		
3	Original	09-11-18	23-4	Original	09-11-18	28-1	Original	09-11-18
4	Original	09-11-18	23-5	Original	09-11-18	28-2	Original	09-11-18
5	Original	09-11-18	23-6	Original	09-11-18	28-3	Original	09-11-18
6	Original	09-11-18	23-7	Original	09-11-18	28-4	Original	09-11-18
7	Original	09-11-18	23-8	Original	09-11-18	28-5	Original	09-11-18
8	Original	09-11-18	23-9	Original	09-11-18	28-6	Original	09-11-18
9	Original	09-11-18	23-10	Original	09-11-18	29 Hydraulic Power		
10	Original	09-11-18	24 Electrical Power			29-1	Original	09-11-18
11	Original	09-11-18	24-1	Original	09-11-18	29-2	Original	09-11-18
12	Original	09-11-18	24-2	Original	09-11-18	29-3	Original	09-11-18
13	Original	09-11-18	24-3	Original	09-11-18	29-4	Original	09-11-18
14	Original	09-11-18	24-4	Original	09-11-18	30 Ice and Rain Protection		
21 Air Conditioning			24-5	Original	09-11-18	30-1	Original	09-11-18
21-1	Original	09-11-18	24-6	Original	09-11-18	30-2	Original	09-11-18
21-2	Original	09-11-18	25 Equipment / Furnishings			30-3	Original	09-11-18
21-3	Original	09-11-18	25-1	Original	09-11-18	30-4	Original	09-11-18
21-4	Original	09-11-18	25-2	Original	09-11-18	30-5	Original	09-11-18
21-5	Original	09-11-18	25-3	Original	09-11-18	30-6	Original	09-11-18
21-6	Original	09-11-18	25-4	Original	09-11-18	30-7	Original	09-11-18
21-7	Original	09-11-18	25-5	Original	09-11-18	30-8	Original	09-11-18
21-8	Original	09-11-18	25-6	Original	09-11-18	30-9	Original	09-11-18
21-9	Original	09-11-18	25-7	Original	09-11-18	30-10	Original	09-11-18
21-10	Original	09-11-18	25-8	Original	09-11-18	30-11	Original	09-11-18
21-11	Original	09-11-18	25-9	Original	09-11-18	30-12	Original	09-11-18
21-12	Original	09-11-18	25-10	Original	09-11-18	31 Indicating / Recording Systems		
22 Auto Flight			26 Fire Protection			31-1	Original	09-11-18
22-1	Original	09-11-18	26-1	Original	09-11-18	31-2	Original	09-11-18
22-2	Original	09-11-18	26-2	Original	09-11-18	31-3	Original	09-11-18
22-3	Original	09-11-18	26-3	Original	09-11-18	31-4	Original	09-11-18
22-4	Original	09-11-18	26-4	Original	09-11-18	32 Landing Gear		
22-5	Original	09-11-18	27 Flight Controls			32-1	Original	09-11-18
22-6	Original	09-11-18	27-1	Original	09-11-18	32-2	Original	09-11-18
23 Communications			27-2	Original	09-11-18	32-3	Original	09-11-18
23-1	Original	09-11-18	27-3	Original	09-11-18	32-4	Original	09-11-18

FAA Approved	POI Signature:	Date:
--------------	----------------	-------

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 6

This manual is applicable to Brazos Valley Air Charter, LLC Piaggio P-180 (Avanti II) series aircraft and is no less restrictive than revision 4 of the FAA approved Piaggio P-180 (Avanti II) Series MMEL dated 07/26/2010.

CONTROL PAGES

Page	Rev #	Date	Page	Rev #	Date
33 Lights			45 Central Maintenance Computer		
33-1	Original	09-11-18	35-4	Original	09-11-18
33-2	Original	09-11-18	46 Information Systems		
33-3	Original	09-11-18	45-1	Original	09-11-18
33-4	Original	09-11-18	45-2	Original	09-11-18
33-5	Original	09-11-18	52 Doors		
33-6	Original	09-11-18	46-1	Original	09-11-18
33-7	Original	09-11-18	46-2	Original	09-11-18
33-8	Original	09-11-18	46-3	Original	09-11-18
33-9	Original	09-11-18	46-4	Original	09-11-18
33-10	Original	09-11-18	61 Propellers		
33-11	Original	09-11-18	52-1	Original	09-11-18
33-12	Original	09-11-18	52-2	Original	09-11-18
34 Navigation			52-3	Original	09-11-18
34-1	Original	09-11-18	52-4	Original	09-11-18
34-2	Original	09-11-18	73 Engine Fuel & Control		
34-3	Original	09-11-18	61-1	Original	09-11-18
34-4	Original	09-11-18	61-2	Original	09-11-18
34-5	Original	09-11-18	79 Engine Oil		
34-6	Original	09-11-18	73-1	Original	09-11-18
34-7	Original	09-11-18	73-2	Original	09-11-18
34-8	Original	09-11-18	Index		
34-9	Original	09-11-18	79-1	Original	09-11-18
34-10	Original	09-11-18	79-2	Original	09-11-18
34-11	Original	09-11-18	79-3	Original	09-11-18
34-12	Original	09-11-18	79-4	Original	09-11-18
34-13	Original	09-11-18	FAA Approved - HOU FSDO		
34-14	Original	09-11-18	Signature		
34-15	Original	09-11-18	Date		
34-16	Original	09-11-18	POI		02/14/2019
34-17	Original	09-11-18	PMI		02/14/2019
34-18	Original	09-11-18	PAI		2/19/2019
35 Oxygen					
35-1	Original	09-11-18			
35-2	Original	09-11-18			
35-3	Original	09-11-18			

FAA Approved	POI Signature:	Date:
--------------	----------------	-------

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-4

Intentionally Left Blank

FAA Approved - HOF E2DO
Signature
Date
10/11/18
10/11/18
10/11/18

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program		
	Revision No: Original	Date: 09-11-18	Page N-3

Control Pages

Page #	Revision #	Date
N-1	Original	09-11-18
N-2	Original	09-11-18
N-3	Original	09-11-18
N-4	Original	09-11-18
N-5	Original	09-11-18
N-6	Original	09-11-18
N-7	Original	09-11-18
N-8	Original	09-11-18
N-9	Original	09-11-18
N-10	Original	09-11-18
N-11	Original	09-11-18
N-12	Original	09-11-18
N-13	Original	09-11-18
N-14	Original	09-11-18
N-15	Original	09-11-18
N-16	Original	09-11-18
N-17	Original	09-11-18
N-18	Original	09-11-18
N-19	Original	09-11-18
N-20	Original	09-11-18
N-21	Original	09-11-18
N-22	Original	09-11-18
N-23	Original	09-11-18
N-24	Original	09-11-18

FAA Approved - HOU FSDO

	Signature	Date
POI	<u>[Signature]</u>	<u>02/14/2019</u>
PMI	<u>[Signature]</u>	<u>02/14/2019</u>
PAI	<u>Thomas C Fowler</u>	<u>2/19/2019</u>

NEF

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 7

DEFINITIONS

1. **Administrative Control Item (ACI).** An ACI is listed by the aircraft operator in the MEL for tracking and informational purposes. As an example, ACI may be used to track ETOPS accomplishment of required APU cold-soak, or in-flight verification starts. An ACI may be added to an aircraft operator's MEL by approval of the POI provided no relief is granted, or provided conditions and limitations are contained in an approved document (e.g., Structural Repair Manual (SRM) or Airworthiness Directive (AD)). If relief other than that granted by an approved document is sought for an ACI, a request must be submitted to the Administrator. If the request results in review and approval by the FOEB, the item becomes an MMEL item rather than an ACI.
2. **ATA System Page.** The ATA system page is divided into six (6) columns (A thru F) and contains: item and repair category; number installed; number required for dispatch; and remarks or exceptions. Standard ATA categories are used. Items are numbered sequentially.
 - A. **Item.** Item is the sequence number.
 - B. **Name/Description.** Name/Description depicts the equipment, system, component, or function.
 - C. **Repair Category.** Repair Category describes the time interval to repair MEL items.
 - D. **Number Installed.** This column depicts the number (quantity) of instrument and equipment items normally installed in the aircraft. This number represents the aircraft configuration considered in developing this MEL. Should the number be a variable (e.g., fleet configuration differences, cockpit lighting items, cabin lighting items, cargo restraint components) a number is not required and the "-" symbol is used.
 - E. **Number Required for Dispatch.** This column depicts the minimum number (quantity) of instrument and equipment items required for operation provided the conditions specified in the "Remarks or Exceptions" column are met. Where the MMEL shows a variable number required for dispatch, the MEL must reflect the actual number required for dispatch or an alternate means of configuration control approved by the Administrator.
 - F. **Remarks or Exceptions.** This column may include a statement(s) either prohibiting or permitting operation with a specific number of instrument and equipment items inoperative, provisos (conditions and limitations) for such operation, and appropriate notes.
 - G. **Provisos.** Provisos are indicated by a number or a lower case letter in "Remarks or Exceptions". Provisos are conditions or limitations that must be complied with for operation with the listed instrument or equipment item inoperative.
 - H. **Notes.** Notes provide additional information for crewmember or maintenance consideration. Notes are used to identify applicable material, which is intended to assist with compliance, but do not relieve the aircraft operator of the responsibility for compliance with all applicable requirements. Additional notes may be amended, deleted, or added to the MEL by the aircraft operator, as appropriate. Notes are not a part of the provisos.
 - I. **Vertical Bar (change bar).** A vertical bar indicates a change, addition, or deletion in the adjacent text for the current revision of that page only. All change bars applicable to the previous revision of the MEL are removed prior to the release of the next revision.
3. **Airplane Flight Manual (AFM).** The FAA approved AFM is the document approved by the responsible FAA Aircraft Certification Office (ACO) during type certification. The approved flight manual for the specific aircraft is listed on the applicable Type Certificate Data Sheet (TCDS). The approved flight manual is the source document for operational limitations and performance parameters for an aircraft. The FAA requires an approved flight manual for aircraft type certification.
4. **Code of Federal Regulations (CFR) and Federal Aviation Regulations (FAR).** CFR, the current term, and FAR both refer to the applicable portions of the Federal Aviation Act and Code of Federal Regulations.

Definitions

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 8

5. Considered Inoperative. The phrase, "Considered Inoperative", as used in the provisos, means that an instrument and equipment item must be treated for dispatch, taxi and flight purposes as though it were inoperative. The item will not be used or operated until the original deferred item is repaired. Additional actions include: documenting the item on the dispatch release (if applicable), placarding, and complying with all remarks, exceptions, and related MMEL provisions, including any (M) and (O) procedures and observing the repair category.
6. Continuing Authorization – Single Extension. An aircraft operator who has the authorization to use an FAA approved MEL may also have the authority to use a continuing authorization to approve a single (one-time) extension to the repair interval for category B or C items in accordance with Operations Specification D095. Continuing Authorization – Single Extension is not authorized for repair category A and D items.
7. Dash (-). Indicates a variable number (quantity) of the instrument and equipment items may be installed or required for dispatch. This is common when a fleet MEL is used since aircraft of the same make and model may have differing numbers of specific instrument and/or equipment items installed.
8. Day of Discovery. This is the calendar day an equipment/instrument malfunction was recorded in the aircraft maintenance record/logbook. This day is excluded from the calendar days or flight days specified in the MEL for the repair interval of an inoperative instrument and/or equipment item. This provision is applicable to all MEL items; i.e., categories A, B, C, and D.
9. Deactivated and/or Secured. When the MEL refers to an instrument and/or equipment item as deactivated and/or secured, the specified component must be put into an acceptable condition for safe flight. An acceptable method of deactivating and/or securing will be established by the aircraft operator.
10. Flight Day. A flight day is a 24 hour period (from midnight to midnight) universal coordinated time (UTC) during which at least one flight is initiated for the affected aircraft.
11. Heavy Maintenance Visit (HMV). HMV is a scheduled C-check/D-check or airworthiness maintenance program inspection where the aircraft is scheduled to be out of service for 4 or more days.
12. Icing Conditions. An atmospheric environment that may cause ice to form on the aircraft (structural) or in the engine(s) (induction).
13. Inoperative. A system and/or component malfunction to the extent that it does not accomplish its intended purpose and/or is not consistently functioning normally within its approved operating limit(s) and/or tolerance(s).
14. Inoperative Components of an Inoperative System. Inoperative instrument and equipment items, which are components of a system that is inoperative, are usually considered components directly associated with and having no other function than to support that system (warning/caution systems associated with the inoperative system must be operative unless relief is specifically authorized per the MEL).
15. Is Not Used. The phrase "Is Not Used" in the provisos, remarks or exceptions for an MEL instrument or equipment item may specify that another item in the MEL "is not used". In such cases, crewmembers must not activate, actuate, or otherwise utilize that item under normal operations. It is not necessary for aircraft operators to accomplish the (M) procedure(s) associated with the item. However, operational requirements must be complied with, and an additional placard must be affixed, to the extent practical, adjacent to the control or indicator for the item that is not used. This informs crewmembers that an instrument or equipment item is not to be used under normal operations.
16. Nonessential Equipment and Furnishings (NEF). NEFs are those items installed on the aircraft as part of the original type certification, STC, or other form of alteration that have no effect on the safe operation of flight and would not be required by the applicable certification rules or operational rules. They are those items that, if inoperative, damaged, or missing, have no effect on the aircraft's ability to be operated safely under all operational conditions. NEF items are not instrument and equipment items already identified in the MEL or CDL of the applicable aircraft. They do not include instrument and equipment items that are functionally required to meet the certification rule or for compliance with any operational rule.

Definitions

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 9

17. **Operative.** An operative system and/or component will accomplish its intended purpose and is consistently functioning normally within its design operating limit(s) and tolerance(s). When an MMEL item specifies that an item of equipment must be operative, it does not mean that its operational status must be verified; it's to be considered operative unless reported or known to be malfunctioning. When an MMEL item specifies that an item of equipment must be verified operative, it means that it must be checked and confirmed operative at the interval(s) specified for that MMEL item. When an MMEL item specifies that an item of equipment must be verified but no interval is specified, verification is required only at the time of deferral.
- Other terminology sometimes used interchangeably with "operative" within the MMEL is "operates normally", "fully operative", and "considered operative". The aircraft operator's MEL may incorporate standardized terminology of the aircraft operator's choice to specify that an item of equipment must be operative, provided the aircraft operator's MEL definitions indicate that the selected "operative" terminology means that the required item of equipment will accomplish its intended purpose and is consistently functioning normally within its design operating limit(s) and tolerance(s).
18. **Placarding.** Each inoperative instrument or equipment item must be placarded to inform and remind the crewmembers and maintenance personnel of the item condition. To the extent practical, placards should be located adjacent to the control or indicator for the item affected; however, unless otherwise specified (i.e. AFM), placard wording and location will be determined by the aircraft operator.
19. **Repair Category.** All users of an MEL approved under parts 91K, 121, 125, 129, 135 and 142 must effect repairs of inoperative instrument and equipment items, deferred in accordance with the MEL, at or prior to the repair times established by the following letter designators:
- A. **Repair Category A.** This category item must be repaired within the time interval specified in the "Remarks or Exceptions" column of the aircraft operator's approved MEL. For time intervals specified in "calendar days" or "flight days", the day the malfunction was recorded in the aircraft maintenance record/logbook is excluded. For all other time intervals (i.e., flights, flight legs, cycles, hours, etc.), repair tracking begins at the point when the malfunction is deferred in accordance with the operator's approved MEL.
 - B. **Repair Category B.** This category item must be repaired within 3 consecutive calendar days (72 hours) excluding the day the malfunction was recorded in the aircraft maintenance record/logbook. For example, if it were recorded at 10 a.m. on January 26th, the 3 day interval would begin at midnight the 26th and end at midnight the 29th.
 - C. **Repair Category C.** This category item must be repaired within 10 consecutive calendar days (240 hours) excluding the day the malfunction was recorded in the aircraft maintenance record/logbook. For example, if it were recorded at 10 a.m. on January 26th, the 10 day interval would begin at midnight the 26th and end at midnight February 5th.
 - D. **Repair Category D.** This category item must be repaired within 120 consecutive calendar days (2880 hours) excluding the day the malfunction was recorded in the aircraft maintenance record/logbook.
20. **Takeoff.** Takeoff is the act of beginning a flight in which an aircraft is accelerated from a state of rest to that of flight. For the purposes of MEL relief, this translates to the point at which the pilot physically begins to apply power to initiate the takeoff from the runway or takeoff surface.
21. **Visible Moisture.** An atmospheric environment containing water, in any form, that can be seen in natural or artificial light; for example, clouds, fog, rain, sleet, hail, or snow.
22. **Visual Flight Rules (VFR).** VFR is as defined in 14 CFR Part 91. This precludes a pilot from filing an Instrument Flight Rules (IFR) flight plan.
23. **Visual Meteorological Conditions (VMC).** VMC means the atmospheric environment is such that would allow a flight to proceed under the visual flight rules applicable to the flight. This does not preclude operating under Instrument Flight Rules.

Definitions

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 10

24. (M). This symbol indicates a requirement for a specific maintenance procedure which must be accomplished prior to operation with the listed item inoperative. Normally, these procedures are accomplished by maintenance personnel; however, other personnel may be qualified and authorized to perform certain functions. Procedures requiring specialized knowledge or skill, or requiring the use of tools or test equipment, should be accomplished by maintenance personnel. The satisfactory accomplishment of all maintenance procedures, regardless of who performs them, is the responsibility of the aircraft operator. Appropriate procedures are required to be produced as part of the aircraft operator's manual or MEL.
25. (O). This symbol indicates a requirement for a specific operations procedure which must be accomplished in planning for and/or operating with the listed item inoperative. Normally, these procedures are accomplished by the flightcrew; however, other personnel may be qualified and authorized to perform certain functions. The satisfactory accomplishment of all procedures, regardless of who performs them, is the responsibility of the aircraft operator. Appropriate procedures are required to be produced as a part of the aircraft operator's manual or MEL.

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 11

PREAMBLE

(Effective 6/14/89)

The following is applicable for authorized certificate holders operating under Title 14 Code of Federal Regulations (14 CFR) Parts 121, 125, 129, 135: 14 CFR require that all equipment installed on an aircraft in compliance with the Airworthiness Standards and the Operating Rules must be operative. However, the Rules also permit the publication of a Minimum Equipment List (MEL) where compliance with certain equipment requirements is not necessary in the interests of safety under all operating conditions. Experience has shown that with the various levels of redundancy designed into aircraft, operation of every system or installed component may not be necessary when the remaining operative equipment can provide an acceptable level of safety.

A Master Minimum Equipment List (MMEL) is developed by the FAA, with participation by the aviation industry, to improve aircraft utilization and thereby provide more convenient and economic air transportation for the public. The FAA approved MMEL includes those items of equipment related to airworthiness and operating regulations and other items of equipment which the Administrator finds may be inoperative and yet maintain an acceptable level of safety by appropriate conditions and limitations; it does not contain obviously required items such as wings, flaps, and rudders. The MMEL is the basis for development of individual operator MELs which take into consideration the operator's particular aircraft equipment configuration and operational conditions. Operator MELs, for administrative control, may include items not contained in the MMEL; however, relief for administrative control items must be approved by the Administrator. An operator's MEL may differ in format from the MMEL, but cannot be less restrictive than the MMEL. The individual operator's MEL, when approved and authorized, permits operation of the aircraft with inoperative equipment. Equipment not required by the operation being conducted and equipment in excess of 14 CFR requirements are included in the MEL with appropriate conditions and limitations. The MEL must not deviate from the Aircraft Flight Manual Limitations, Emergency Procedures or with Airworthiness Directives. It is important to remember that all equipment related to the airworthiness and the operating regulations of the aircraft not listed on the MMEL must be operative.

Suitable conditions and limitations in the form of placards, maintenance procedures, crew operating procedures and other restrictions as necessary are specified in the MEL to ensure that an acceptable level of safety is maintained.

The MEL is intended to permit operation with inoperative items of equipment for a period of time until repairs can be accomplished. It is important that repairs be accomplished at the earliest opportunity. In order to maintain an acceptable level of safety and reliability the MMEL establishes limitations on the duration of and conditions for operation with inoperative equipment.

The MEL provides for release of the aircraft for flight with inoperative equipment. When an item of equipment is discovered to be inoperative, it is reported by making an entry in the Aircraft Maintenance Record/Logbook as prescribed by 14 CFR. The item is then either repaired or may be deferred per the MEL or other approved means acceptable to the Administrator prior to further operation. MEL conditions and limitations do not relieve the operator from determining that the aircraft is in condition for safe operation with items of equipment inoperative. When these requirements are met, an Airworthiness Release, Aircraft Maintenance Record/Logbook entry, or other approved documentation is issued as prescribed by 14 CFR. Such documentation is required prior to operation with any item of equipment inoperative.

Operators are responsible for exercising the necessary operational control to ensure that an acceptable level of safety is maintained. When operating with multiple inoperative items, the interrelationships between those items and the effect on aircraft operation and crew workload will be considered. Operators are to establish a controlled and sound repair program including the parts, personnel, facilities, procedures, and schedules to ensure timely repair.

WHEN USING THE MEL, COMPLIANCE WITH THE STATED INTENT OF THE PREAMBLE, DEFINITIONS, AND THE CONDITIONS AND LIMITATIONS SPECIFIED IN THE MEL IS REQUIRED.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 12

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 13

COMPANY PROCEDURES

The following Policy and Procedures will be adhered to by Brazos Valley Air Charter, LLC in the use of this MEL:

1. It is the Pilot-in-Command's responsibility to become thoroughly familiar with the policy and procedures concerning the use of the MEL. These may be found in this policy statement, Notes and Definitions section of the MEL, Preamble, and FAR Sections 91.213, 21.197, and 21.199.
2. All items related to the airworthiness of the aircraft and not included on the MEL are required to be fully and properly operative.
3. If an inoperative item requires a maintenance procedure, that procedure must be accomplished and recorded in accordance with FAR Sections 43.9 and 91.405 prior to flight.
4. When the discrepancy is corrected, the maintenance person performing the maintenance will record it in accordance with FAR Section 43.9.
5. Inoperative items allowed by the MEL must be repaired, or inspected and deferred, by qualified maintenance personnel at the next required inspection.
6. An item, which is inoperative, but required by special flight conditions, will be repaired before operating in those conditions.
7. The Pilot-in-Command will ensure that all discrepancies are recorded in the Aircraft Discrepancy Log Sheet.
8. The portion of the record containing the discrepancy records must be on board the aircraft during operation so that the Pilot-in-Command may be aware of any inoperative instruments or equipment.
9. Required (M) Maintenance, (O) Operational and Placarding Procedures are indicated in the respective sections of the MEL. The procedures defined must be followed in the event MEL authority is exercised. (M) and (O) Procedures are tasks that must be accomplished in addition to satisfying all provisos in the MEL Remarks or Exceptions column. Normally (M) procedures are accomplished by maintenance personnel; however, Flight Crewmembers may be qualified and authorized to perform certain functions (i.e., pulling & collaring circuit breakers, or other routine procedures that can be accomplished from the cockpit or during preflight checks/inspections). Procedures requiring specialized knowledge or skill, or requiring the use of tools or test equipment must be accomplished by maintenance personnel. The Pilot-in-Command is responsible for ensuring all (M) and/or (O) Procedures are accomplished, regardless of who performs them.
10. Many MMEL items contain the verbiage, "May be inoperative provided XXX system is operative." Unless the MMEL Remarks or Exceptions specifically states that a system must be verified to operate normally, except when the item includes (M) and/or (O) Procedures that give instructions for checking system status, a component or system is considered operative if there are no current reported or deferred write-ups on that system. In the case where the MMEL Remarks or Exceptions simply states, "May be inoperative provided XXX system is operative", it is NOT required to operate the system to verify its status. The absence of open logbook write-ups or current deferrals on that system satisfies all requirements for that MMEL proviso. However, if there is an open logbook write-up or current deferral on that item, then all MMEL requirements are not satisfied and dispatch is prohibited until that system is repaired and is operative.
11. The flight crew is responsible for exercising the necessary operational control to ensure that an acceptable level of safety is maintained. When operating with multiple inoperative items, the interrelationship between those items, and the effect on aircraft operation and crew workload, must be considered.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 14

Flight Crew Deferral Procedures:

Flight Crew Deferral Item column found in each MEL item indicates whether or not Flight Crews may accomplish the deferral process. For items with a "YES", Flight Crews have been qualified and authorized to perform all procedures associated with the MEL item. Normally, (M) Maintenance procedures are accomplished by maintenance personnel; however, if the "Flight Crew Deferral Item" column indicates "YES", Flight Crews may perform (M) Maintenance procedures. For MEL items with a "NO" in the Flight Crew Deferral Item column, then Maintenance will be required to defer the item. At any time, the Flight Crew may request Maintenance to defer any MEL item.

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 21-1

Chapter 21

Air Conditioning

Page Number

21-01	Cabin Air Outlets (Overhead).....	21-2
21-02	Pressurization System	21-3
21-03	Cabin Altitude Annunciator (CAB PRESS)	21-4
21-07	Differential Pressure / Cabin Altitude Indicator	21-5
21-08	Pressurization Control	21-6
21-09	Cabin Rate Of Climb Indicator	21-7
21-10	Electric Cockpit Heater (Auxiliary).....	21-8
21-11	Bleed Air Valve.....	21-9
21-12	Vapor Cycle Air Conditioning System	21-10
21-13	Temperature Controller	21-11

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 21-2

21-01 Cabin Air Outlets (Overhead)						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
-01	Cabin Air Outlets (Overhead)	C	8	5	Remarks Or Exceptions May be inoperative, damaged or missing.	

Item	MEL Sticker Location	Flight Crew Deferral Item
21-01-01	Near Captains Instrument Panel	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 21-3

21-02 Pressurization System					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
	Pressurization System	B	1	0	(O) May be inoperative provided: a) Cabin Dump is operative and selected to DUMP, b) Bleed Air System must be operative, and c) Aircraft remains at or below 10,000 feet MSL.
	Pressurization System	B	1	0	(M)(O) May be inoperative provided: a) Outflow Valve is secured open, b) Bleed Air System must be operative, and c) Aircraft remains at or below 10,000 feet MSL.

Item	MEL Sticker Location	Flight Crew Deferral Item
21-02 (First Item)	Near Pressurization Panel	YES
21-02(Second Item)	Near Pressurization Panel	NO

Maintenance (M)

21-02 (First Item)

Refer to AMM Chapter 21-00-00 and secure the Outflow Valve in the open position.

Operations (O)

21-02 (First Item)

Ensure the following:

1. Bleed is ON and dump switch is set to DUMP.
2. Aircraft remains at or below 10,000 feet MSL.

21-02 (Second Item)

Ensure aircraft remains at or below 10,000 feet MSL.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 21-4

21-03 Cabin Altitude Annunciator (CAB PRESS)					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Cabin Altitude Annunciator (CAB PRESS)	C	1	0	May be inoperative provided: a) Aircraft remains at or below 10,000 feet MSL, and b) Differential Pressure/Cabin Altitude Indicator is operative and monitored.

Item	MEL Sticker Location	Flight Crew Deferral Item
21-03-01	Near Cabin Altitude Annunciator	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 21-5

21-07 Differential Pressure / Cabin Altitude Indicator					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
-01	Differential Pressure / Cabin Altitude Indicator	B	1	0	Remarks Or Exceptions May be inoperative provided: a) Autoschedule Mode is selected and operative, b) Cabin Altitude/Differential Pressure Annunciator (CAB PRESS) is operative, and c) Aircraft remains at or below 25,000 feet MSL.

Item	MEL Sticker Location	Flight Crew Deferral Item
21-07-01	Near Indicator	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 21-6

21-08 Pressurization Control					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Pressurization Control (Auto Schedule Mode)	C	1	0	May be inoperative provided Cabin Select Mode is operative.
-02	Pressurization Control (Auto Pressurization Mode) (AUTO SCHED & CAB SEL)	B	1	0	(O) May be inoperative provided: a) Manual Pressurization Mode is operative, b) Cabin DUMP Mode is operative, and c) Aircraft is operated with a SIC pilot.

Item	MEL Sticker Location	Flight Crew Deferral Item
21-08-01 21-08-02	Near Pressurization Panel	YES

Operations (O)

21-08-02

Ensure there are no current logbook entries or deferrals related to the following items:

- Manual Pressurization Mode
- Cabin DUMP Mode

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 21-7

21-09 Cabin Rate Of Climb Indicator					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Cabin Rate Of Climb Indicator	C	1	0	May be inoperative provided: a) Cabin Altitude/Differential Pressure Indicator is operative, and b) Auto Schedule Mode is operative and used.

Item	MEL Sticker Location	Flight Crew Deferral Item
21-09-01	Near Cabin Rate Of Climb Indicator	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 21-8

21-10 Electric Cockpit Heater (Auxiliary)					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
-01	Electric Cockpit Heater (Auxiliary)	C	1	0	Remarks Or Exceptions (M) May be inoperative.

Item	MEL Sticker Location	Flight Crew Deferral Item
21-10-01	Near Heater Switch	YES

Maintenance (M)

Pull and secure the Electric Cockpit Heater circuit breakers.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 21-9

21-11 Bleed Air Valve						
Repair Category			Number Installed			
Item	Name/Description				Number Required For Dispatch	Remarks Or Exceptions
-01	Bleed Air Valve	B	2	1		(O) One may be inoperative provided: a) Affected Bleed Air Valve is selected OFF, b) Affected Bleed Air Valve is verified closed prior to departure, and c) Aircraft is not operated in known or forecast icing conditions.
-02	Bleed Air Valve	B	2	1		(M) One may be inoperative provided: a) Affected Bleed Air Valve is secured closed, and b) Aircraft is not operated in known or forecast icing conditions.

Item	MEL Sticker Location	Flight Crew Deferral Item
21-11-01 21-11-02	Near Bleed Switch	YES

Maintenance (M)

21-11-02

Refer to AMM Chapter 21-00-00 and secure the associated Bleed Air Valve in the open position.

Operations (O)

21-11-01

Select the Bleed switch to OFF.

Ensure there is no bleed air pressure indication.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 21-10

21-12 Vapor Cycle Air Conditioning System					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Vapor Cycle Air Conditioning System	C	1	0	(M) May be inoperative.

Item	MEL Sticker Location	Flight Crew Deferral Item
21-12-01	Near AC Switch	NO

Maintenance (M)

1. Refer to AMM Chapter 21-00-00 to deactivate the Vapor Cycle Air Conditioning System.
2. Perform a visual inspection of the associated area to ensure no adverse condition exists which could effect aircraft operations.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 21-11

21-13 Temperature Controller					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Temperature Controller (AUTO Temperature Control Mode)	C	1	0	May be inoperative provided Manual Temperature Mode is operative.
-02	Temperature Controller (Manual Temperature Control Mode)	C	1	0	May be inoperative provided AUTO Temperature Mode is operative.

Item	MEL Sticker Location	Flight Crew Deferral Item
21-13-01 21-13-02	Near Associated Temp Control	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 21-12

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 22-1

Chapter 22	Auto Flight	Page Number
22-01	Flight Guidance Panel Button Annunciation	22-2
22-02	Autopilot System	22-3
22-03	Autopilot Disconnect (Control Wheel Master Switch (MSW))	22-4
22-04	Yaw Damper.....	22-5
22-05	Flight Director	22-6

Brazos Valley Air Charter, LLC					Minimum Equipment List			
Aircraft: Avanti II					Revision No: Original		Date: 09-11-18	Page 22-2
22-01 Flight Guidance Panel Button Annunciation								
Repair Category			Number Installed					
Item	Name/Description				Number Required For Dispatch			
					Remarks Or Exceptions			
-01	Flight Guidance Panel Button Annunciation (Proline 21)	C	12	0	May be inoperative provided: a) Associated Button is operative, and b) Associated Mode is annunciated on the PFD.			
Item		MEL Sticker Location				Flight Crew Deferral Item		
22-01-01		Near Flight Guidance Panel				YES		

Brazos Valley Air Charter, LLC				Minimum Equipment List		
Aircraft: Avanti II				Revision No: Original	Date: 09-11-18	Page 22-3
22-02 Autopilot System						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
-01	Autopilot System	C	-	0	Remarks Or Exceptions (M) May be inoperative provided operations do not require its use.	
					NOTE 1: RVSM is not authorized.	
					NOTE 2: Category II operations are not authorized.	
					RVSM Operations Not Authorized.	
Item		MEL Sticker Location			Flight Crew Deferral Item	
22-02-01		Near AP Panel			NO	

Maintenance (M)

To ensure that the autopilot is fully disengaged and no electrical or mechanical fault exists that will have an adverse effect on any flight control function.

1. Pull out the circuit breakers labeled "AP SERVO ELEV" and "A/P SERVO AIL/RUD" located on the flight compartment LH CB panel (pilot) and apply respectively a tie-rop each.
2. With the electrical /avionics system powered and trim surfaces at the neutral position, verify that the primary flight controls (all three axes) are free to move over their complete travel without exhibiting any roughness or abnormal stops.
3. Perform a complete movement of the longitudinal trim surface by selecting the PITCH TRIM switch to SEC in order to verify its proper operation.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 22-4

22-03 Autopilot Disconnect (Control Wheel Master Switch (MSW))						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
-01	Autopilot Disconnect (Control Wheel Master Switch (MSW))	C	2	1	Remarks Or Exceptions One may be inoperative provided: a) Trim Inhibit and Nose Steering Release MSW functions are verified operative, b) Autopilot is not used below 1,500 feet AGL, and c) Approach minimums do not require the use of the Autopilot.	

Item	MEL Sticker Location	Flight Crew Deferral Item
22-03-01	Near AP Panel	YES

Brazos Valley Air Charter, LLC				Minimum Equipment List			
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18	Page 22-5
22-04 Yaw Damper							
Repair Category			Number Installed				
Item	Name/Description			Number Required For Dispatch			
				Remarks Or Exceptions			
				(M) May be inoperative except for Category II operations.			
-01	Yaw Damper	C	1	0			
Item		MEL Sticker Location				Flight Crew Deferral Item	
22-04-01		Near AP Panel				NO	

Maintenance (M)

To ensure that the Yaw Damper can be disengaged and no fault exists that will have an adverse effect on Yaw flight control function.

1. Apply a label "AT ANY AP ENGAGE, YD MUST BE DISENGAGED",
2. Perform the following procedure before Taxi, after the Approach Mode Checks [AFM – Section 4 – § 4.2.4 point 39.(h)]:
 - A. Engage the Autopilot and disengage the Yaw Damper
 - B. Check that green YD annunciation on PFDs turns yellow flashing for 5 seconds and then OFF.
 - C. Verify that Elevator and Aileron Primary Flight Controls are controlled by the relevant Autopilot servos.
 - D. Verify that Rudder pedals are free to move on their complete travel without exhibiting any roughness or abnormal stops.
 - E. Disengage the Autopilot.

Brazos Valley Air Charter, LLC					Minimum Equipment List					
Aircraft: Avanti II					Revision No: Original		Date: 09-11-18		Page 22-6	
22-05 Flight Director										
Repair Category			Number Installed							
Item	Name/Description			Number Required For Dispatch						
				Remarks Or Exceptions						
-01	Flight Director	C	1	0	May be inoperative provided approach procedures do not require its use.					
Item		MEL Sticker Location					Flight Crew Deferral Item			
22-05-01		Near AP Panel					YES			

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 23-1

Chapter 23	Communications	Page Number
23-01	Communications System (VHF).....	23-2
23-03	Flight Phone	23-3
23-04	Passenger Address System (PA).....	23-4
23-05	Cockpit Speaker	23-5
23-06	Pilot Headset	23-6
23-07	Handheld Microphone	23-7
23-08	Static Wicks	23-8
23-09	Cockpit Voice Recorder (CVR)	23-9
23-10	Boom Microphones	23-10

Brazos Valley Air Charter, LLC				Minimum Equipment List		
Aircraft: Avanti II				Revision No: Original	Date: 09-11-18	Page 23-2
23-01 Communications System (VHF)						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
-01	Communications System (VHF)	D	2	1	Remarks Or Exceptions Any in excess of those required by FAR may be inoperative provided it is not powered by the Emergency Power Source and not required for emergency procedures. 14 CFR REFERENCE: 14 CFR 135.161, 135.165	
Item		MEL Sticker Location			Flight Crew Deferral Item	
23-01-01		Near COMM Panel			NO	

Brazos Valley Air Charter, LLC				Minimum Equipment List			
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18	Page 23-3
23-03 Flight Phone							
Repair Category			Number Installed				
Item	Name/Description			Number Required For Dispatch			
				Remarks Or Exceptions			
-01	Flight Phone	D	1	0			
Item		MEL Sticker Location				Flight Crew Deferral Item	
23-03-01		Near COMM Panel				YES	

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 23-4

23-04 Passenger Address System (PA)						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
-01	Passenger Address System (PA)	C	1	0	Remarks Or Exceptions (O) May be inoperative provided alternate normal and emergency procedures, and/or operating restrictions as noted in the Operations procedure are followed.	
					NOTE: Any station function(s) that operate normally may be used.	

Item	MEL Sticker Location	Flight Crew Deferral Item
23-04-01	Near Captains Audio Panel	YES

Operations (O)

1. PRIOR TO EACH DEPARTURE, ensure all passengers have been orally briefed on normal and emergency procedures.
2. Orally brief passengers during flight any time additional normal or emergency procedures are required.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 23-5

23-05 Cockpit Speaker					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
-01	Cockpit Speaker	C	2	0	Remarks Or Exceptions May be inoperative provided: a) Procedures do not require the use of cockpit speakers, and b) Headsets are installed and are operative. 14 CFR REFERENCE: 14 CFR 135.165

Item	MEL Sticker Location	Flight Crew Deferral Item
23-05-01	Near Associated Speaker	YES

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 23-6	
23-06 Pilot Headset									
Repair Category			Number Installed						
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
					May be inoperative provided associated flight deck speaker operates normally.				
-01	Pilot Headset	C	2	0	14 CFR REFERENCE: 14 CFR 135.175				
Item		MEL Sticker Location				Flight Crew Deferral Item			
23-06-01		Near Associated Audio Panel				YES			

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 23-7

23-07 Handheld Microphone						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
				Remarks Or Exceptions		
-01	Handheld Microphone	C	2	1	Right side may be inoperative.	

Item	MEL Sticker Location	Flight Crew Deferral Item
23-07-01	Near Right Side Audio Panel	YES

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 23-8	
23-08 Static Wicks									
Repair Category			Number Installed						
Item	Name/Description			Number Required For Dispatch					
				Remarks Or Exceptions					
				May be damaged or missing provided one serviceable Static Wick remains at the outboard end of each control surface. (Reference AFM Limitations)					
-01	Static Wicks	C	16	7					
Item		MEL Sticker Location				Flight Crew Deferral Item			
23-08-01		Near Captains Audio Panel				YES			

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 23-9

23-09 Cockpit Voice Recorder (CVR)					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-02	Cockpit Voice Recorder (CVR) (Without Flight Data Recorder (FDR) Installed)	A	1	0	May be inoperative provided repairs are made within three flight days.

Item	MEL Sticker Location	Flight Crew Deferral Item
23-09-02	Near CVR Panel	YES

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 23-10	
23-10 Boom Microphones									
Repair Category			Number Installed						
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
-1)	Headset Boom Microphones (Cockpit Voice Recorder Equipped To Record Boom Microphone Per 14 CFR 135.151(d))	A	2	0	May be inoperative provided: a) Flight Data Recorder (FDR) operates normally, and b) Repairs are made within three flight days.				
Item		MEL Sticker Location				Flight Crew Deferral Item			
23-10-1)		Near Associated Audio Panel				YES			

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 24-1

Chapter 24	Electrical	Page Number
24-02	D.C. Generator Annunciators	24-2
24-03	Battery Temperature Caution Annunciator (BAT TEMP).....	24-3
24-04	Battery Overheat Warning Annunciator (BAT OVHT).....	24-4
24-05	Battery Temperature Indicator	24-5
24-06	External Power	24-6

Brazos Valley Air Charter, LLC				Minimum Equipment List						
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 24-2		
24-02 D.C. Generator Annunciators										
Repair Category			Number Installed							
Item	Name/Description				Number Required For Dispatch					
	-01	D.C. Generator Annunciators			B	2	1	Remarks Or Exceptions		
								(O) One may be inoperative provided both DC Loadmeters are operative and monitored.		
Item		MEL Sticker Location					Flight Crew Deferral Item			
24-02-01		Near MFDI					YES			

Operations (O)

1. Ensure there are no current logbook entries or deferrals related to either DC Loadmeter.
2. During flight, monitor the MFDI for affected Generator load.

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 24-3	
24-03 Battery Temperature Caution Annunciator (BAT TEMP)									
Repair Category				Number Installed					
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
-01	Battery Temperature Caution Annunciator (BAT TEMP)	B	1	0	May be inoperative provided: a) Battery Temperature Indicator is operative and monitored, and b) BAT OVHT Warning Annunciator is operative.				
Item		MEL Sticker Location				Flight Crew Deferral Item			
24-03-01		Near Caution Annunciator				YES			

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 24-4	
24-04 Battery Overheat Warning Annunciator (BAT OVHT)									
Repair Category			Number Installed						
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
-01	Battery Overheat Warning Annunciator (BAT OVHT)	B	1	0	May be inoperative provided: a) Battery Temperature Indicator is operative and monitored, and b) BAT TEMP Caution Annunciator is operative.				
Item		MEL Sticker Location				Flight Crew Deferral Item			
24-04-01		Near Annunciator				YES			

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 24-5	
24-05 Battery Temperature Indicator									
Repair Category			Number Installed						
Item	Name/Description			Number Required For Dispatch					
				Remarks Or Exceptions					
				May be inoperative for Lead-Acid Batteries only provided: a) BAT TEMP Caution Annunciator is operative, and b) BAT OVHT Warning Annunciator is operative.					
-01	Battery Temperature Indicator	B	1	0					
Item		MEL Sticker Location					Flight Crew Deferral Item		
24-05-01		Near Battery Temperature Indicator					YES		

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 24-6

24-06 External Power					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
				Remarks Or Exceptions	
-01	External Power	C	1	0	May be inoperative provided ground procedures do not require the use of External Power.

Item	MEL Sticker Location	Flight Crew Deferral Item
24-06-01	Near External Power Switch	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 25-1

Chapter 25	Equipment / Furnishings	Page Number
25-01	Pilot(s) Seat Adjustment.....	25-2
25-02	Passenger Seat(s)	25-3
25-03	Non-Essential Equipment & Furnishings (NEF).....	25-4
25-04	Cargo Restraint Systems	25-5
25-06	Emergency Locator Transmitter (ELT).....	25-6
25-08	“Fasten Seat Belt” / “Fasten Seat Belt While Seated” Sign Or Placard	25-7
25-09	Waste Receptacles Access Doors/Covers	25-8
25-10	Cabin Storage Compartments / Closets	25-9

Brazos Valley Air Charter, LLC				Minimum Equipment List			
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18	Page 25-2
25-01 Pilot(s) Seat Adjustment							
Repair Category			Number Installed				
Item	Name/Description			Number Required For Dispatch			
				Remarks Or Exceptions			
-01	Pilot(s) Seat Adjustment	C	2	0	May be inoperative provided seat is secure in a position that has normal pilot visibility and flight control movement.		
Item		MEL Sticker Location				Flight Crew Deferral Item	
25-01-01		Near Associated Instrument Panel				YES	

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 25-3

25-02 Passenger Seat(s)						
Repair Category			Number Installed			
Item	Name/Description				Number Required For Dispatch	
	Passenger Seat(s)	D	7	0	Remarks Or Exceptions May be inoperative provided: a) Seat does not block an Emergency Exit, b) Seat does not restrict any passenger from access to the main aircraft aisle, and c) Affected seat(s) are blocked and placarded "DO NOT OCCUPY".	
					NOTE 1: A seat with an inoperative Seat Belt is considered inoperative. NOTE 2: Affected seat(s) may include the seat(s) behind and/or adjacent seats.	
-1)	Recline Mechanism	D	6	0	(M) May be inoperative and seat occupied provided seat back is secured in the full upright position.	
-1)	Recline Mechanism	D	6	0	May be inoperative and seat occupied provided seat back is immovable in the full upright position.	
-02	Armrest	D	6	0	May be inoperative or missing and Seat occupied provided: a) Armrest does not block an Emergency Exit, b) Armrest does not restrict any passenger from access to the main aircraft aisle, and c) For an Armrest with a recline mechanism, seat back is secure in the full upright position.	

Item	MEL Sticker Location	Flight Crew Deferral Item
25-02-01 25-02-01) 25-02-02	Near Captains Instrument Panel	YES
25-02-1) (first item)	Near Captains Instrument Panel	NO

Maintenance (M)

25-02-1) (First Item)

Ensure seat back is secured in full upright position.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 25-4

25-03 Non-Essential Equipment & Furnishings (NEF)				
Repair Category			Number Installed	
Item	Name/Description		Number Required For Dispatch	Remarks Or Exceptions
-01	Non-Essential Equipment & Furnishings (NEF)	-	0	May be inoperative, damaged, or missing provided that the item(s) is deferred in accordance with the Brazos Valley Air Charter NEF deferral program. The NEF program, procedures, and processes are outlined in the NEF Program Manual. (M) and (O) procedures, if required, must be available to the flight crew and included in the Brazos Valley Air Charter appropriate document.
				NOTE: Exterior Lavatory Door Ash Trays are not considered NEF Items.

Item	MEL Sticker Location	Flight Crew Deferral Item
25-03-01	N/A	YES

NOTE: Refer to [NEF Program Manual](#) for associated procedures.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 25-5

25-04 Cargo Restraint Systems					
Repair Category			Number Installed		
Item	Name/Description				Number Required For Dispatch
					Remarks Or Exceptions
-01	Cargo Restraint Systems	C	1	0	May be inoperative or missing provided Cargo Area remains empty.

Item	MEL Sticker Location	Flight Crew Deferral Item
25-04-01	Near Captains Instrument Panel	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 25-6

25-06 Emergency Locator Transmitter (ELT)					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-2)	Fixed ELTs	A	-	0	May be inoperative or missing provided repairs are made within 90 days.
-a)	Remote Switch	D	1	0	(M) May be inoperative provided: a) Remote switch is disconnected from the ELT, and b) ELT switch is placed in the ARM position.

Item	MEL Sticker Location	Flight Crew Deferral Item
25-06-2) 25-06-a)	Near Captains Instrument Panel	YES

Maintenance (M)

25-06-a)

1. Remove the remote switch from ELT.
2. Place ELT switch in the ARM position.

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 25-7	
25-08 “Fasten Seat Belt” / “Fasten Seat Belt While Seated” Sign Or Placard									
Repair Category			Number Installed						
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
-01	“Fasten Seat Belt” / “Fasten Seat Belt While Seated” Sign Or Placard	C	2	0	One or more Signs or Placards may be illegible or missing provided a legible Sign or Placard is visible from each occupied Passenger Seat.				
Item		MEL Sticker Location				Flight Crew Deferral Item			
25-08-01		Near Captains Instrument Panel				YES			

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 25-8

25-09 Waste Receptacles Access Doors/Covers					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Waste Receptacles Access Doors/Covers	C	1	0	(M)(O) May be inoperative provided: a) The Container is empty and the access is secured to prevent waste introduction into the Compartment, and b) Procedures are established to ensure that sufficient Galley Waste Receptacles are available to accommodate all waste that may be generated on a flight.

Item	MEL Sticker Location	Flight Crew Deferral Item
25-09-01	Near Captains Instrument Panel	YES

Maintenance (M)

Ensure container is empty and the access is secured to prevent waste introduction into the compartment.

Operations (O)

Ensure procedures are established to ensure that sufficient waste receptacles (trash bags are considered receptacles) are available to accommodate all waste that may be generated.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 25-9

25-10 Cabin Storage Compartments / Closets						
Repair Category			Number Installed			
Item	Name/Description				Number Required For Dispatch	Remarks Or Exceptions
-01	Cabin Storage Compartments / Closets	C	2	0		(M) May be inoperative provided: a) Procedures are established to secure compartment closed, b) Associated compartment is placarded "DO NOT USE", c) Any emergency equipment located in affected Compartment is considered inoperative and d) Affected compartment is not used for storage of any item(s) except for those permanently affixed
-02	Cabin Storage Compartments / Closets	C	2	0		(M)(O) May be inoperative provided: a) Affected door is removed, b) Associated compartment is not used for storage of any items, except those permanently affixed, c) Associated compartment is placarded "DO NOT USE", d) Passengers are briefed that associated compartment is not used.
						NOTE: Any permanently affixed Emergency Equipment located in the associated storage compartment is available for use.

Item	MEL Sticker Location	Flight Crew Deferral Item
25-10-01 25-10-02	Near Captains Instrument Panel	YES

Maintenance (M)

25-10-01

1. Verify that no emergency equipment is stored in the compartment,
2. Secure the compartment CLOSED and placard it against use for storage of any equipment.
3. Placard associated compartment "DO NOT USE".

25-10-02

1. Remove the associated door.
2. Secure inoperative compartments closed using remaining operative latches, tape or other suitable means.
3. Placard associated compartment "DO NOT USE".

Operations (O)

25-10-02

Prior to departure, inform passengers of inoperative compartments.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 25-10

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 26-1

Chapter 26

Fire Protection

Page Number

26-01	Portable Fire Extinguisher	26-2
26-02	Rear Baggage Compartment Smoke / Fire Detection Systems	26-3

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 26-2

26-01 Portable Fire Extinguisher					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
				Remarks Or Exceptions	
-01	Portable Fire Extinguisher	D	1	1	MUST BE OPERATIVE.

Item	MEL Sticker Location	Flight Crew Deferral Item
26-01-01	N/A	N/A

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 26-3

26-02 Rear Baggage Compartment Smoke / Fire Detection Systems						
Repair Category			Number Installed			
Item	Name/Description				Number Required For Dispatch	
					Remarks Or Exceptions	
-01	Rear Baggage Compartment Smoke / Fire Detection Systems	C	1	0	May be inoperative provided Rear Baggage Compartment remains empty.	

Item	MEL Sticker Location	Flight Crew Deferral Item
26-02-01	Near Captains Instrument Panel	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 26-4

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 27-1

Chapter 27	Flight Controls	Page Number
27-01	Trim Tab Indicator (Roll And Yaw)	27-2
27-02	Pitch Trim Indicator.....	27-3
27-03	Control Wheel Trim Switches (CWTS).....	27-4

Brazos Valley Air Charter, LLC				Minimum Equipment List		
Aircraft: Avanti II				Revision No: Original	Date: 09-11-18	Page 27-2
27-01 Trim Tab Indicator (Roll And Yaw)						
Repair Category			Number Installed			
Item	Name/Description				Number Required For Dispatch	
					Remarks Or Exceptions	
-01	Trim Tab Indicator (Roll And Yaw)	C	2	0	May be inoperative provided: a) Tab is visually checked for full range of operation, b) Tab operation is not restricted, and c) Tab is positioned to neutral prior to each departure and neutral position is verified by visual inspection.	
					NOTE: Flight controls must be held in neutral position to determine trim tab settings.	
Item		MEL Sticker Location			Flight Crew Deferral Item	
27-01-01		Near Trim Tab Indicator			YES	

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 27-3

27-02 Pitch Trim Indicator					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
-01	Pitch Trim Indicator	C	1	0	Remarks Or Exceptions May be inoperative provided: a) Trim is visually checked for full range of operation, b) Trim operation is not restricted, and c) Trim is positioned to TAKE OFF position prior to each departure and verified by visual inspection.

Item	MEL Sticker Location	Flight Crew Deferral Item
27-02-01	Near Pitch Trim Indicator	YES

Brazos Valley Air Charter, LLC					Minimum Equipment List			
Aircraft: Avanti II					Revision No: Original		Date: 09-11-18	Page 27-4
27-03 Control Wheel Trim Switches (CWTS)								
Repair Category				Number Installed				
Item	Name/Description			Number Required For Dispatch				
				Remarks Or Exceptions				
-01	Control Wheel Trim Switches (CWTS)	B	2	1	Right side may be inoperative.			
-02	Control Wheel Trim Switches (CWTS)	B	2	1	Left side may be inoperative provided the aircraft is operated with a SIC pilot.			
Item		MEL Sticker Location				Flight Crew Deferral Item		
27-03-01 27-03-02		Near CWTS				YES		

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 28-1

Chapter 28

Fuel

Page Number

28-01	Single Point Pressure Refueling System	28-2
28-02	Fuel Crossfeed Annunciator (FUEL XFEED)	28-3
28-03	Low Fuel Caution Annunciator	28-4
28-04	Fuel Quantity Indicator	28-5

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 28-2

28-01 Single Point Pressure Refueling System						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
-01	Single Point Pressure Refueling System	C	1	0	Remarks Or Exceptions May be inoperative provided Single Point Gravity Refueling is used.	
-02	Single Point Pressure Refueling Test System	C	1	0	(O) May be inoperative provided applicable refueling procedures are available and used.	

Item	MEL Sticker Location	Flight Crew Deferral Item
28-01-01 28-01-02	Near Fuel Panel	YES

Operations (O)

28-01-02

Refuel using AFM fueling procedures are used to monitor fueling accuracy.

Brazos Valley Air Charter, LLC				Minimum Equipment List		
Aircraft: Avanti II				Revision No: Original	Date: 09-11-18	Page 28-3
28-02 Fuel Crossfeed Annunciator (FUEL XFEED)						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
				Remarks Or Exceptions		
-01	Fuel Crossfeed Annunciator (FUEL XFEED)	C	1	0	(O) May be inoperative provided: a) Proper operation of Cross Feed System is checked prior to takeoff, b) Crossfeed is confirmed OFF for takeoff, and c) Both Fuel Pressure Annunciator Lights are operative.	
Item		MEL Sticker Location			Flight Crew Deferral Item	
28-02-01		Near Annunciator			YES	

Operations (O)

To verify that the fuel crossfeed system is operative

Starting condition: MAIN and ST BY PUMPS ON on each side;

Perform the following procedure:

1. Switch OFF the Right MAIN and ST BY pumps.
2. Verify that R FUEL PRESS light located on the Annunciator panel lits on.
3. Open the CROSSFEED valve (CROSSFEED switch in horizontal position).
4. Verify that R FUEL PRESS light located on the Annunciator panel comes off.
5. Close the CROSSFEED valve (CROSSFEED switch in vertical position).
6. Verify that R FUEL PRESS light located on the Annunciator panel lits on again.
7. Switch ON the Right MAIN and ST BY pumps.
8. Verify that R FUEL PRESS light located on the Annunciator panel comes off.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 28-4

28-03 Low Fuel Caution Annunciator					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
				Remarks Or Exceptions	
-01	Low Fuel Caution Annunciator	C	2	1	One may be inoperative provided both Fuel Quantity Indicators are operative.

Item	MEL Sticker Location	Flight Crew Deferral Item
28-03-01	Near Annunciator	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 28-5

28-04 Fuel Quantity Indicator						
Repair Category			Number Installed			
Item	Name/Description				Number Required For Dispatch	
					Remarks Or Exceptions	
	Fuel Quantity Indicator	C	2	1	(O) One may be inoperative provided: a) Procedures are established to ensure fuel balance remains within AFM Limitations, b) Fuel Used Indication is operative, c) Associated Low Fuel Caution Annunciator is operative, and d) Both Fuel Flow Indicators are operative.	
-01	Digital Fuel Quantity Indication	C	2	0	May be inoperative provided the associated Analog Indication is operative.	
-02	Analog Fuel Quantity Indication	C	2	0	May be inoperative provided the associated Digital Indication is operative.	

Item	MEL Sticker Location	Flight Crew Deferral Item
28-04 28-04-01 28-04-02	Near Associated Fuel Quantity Indicator	YES

Operations (O)

28-04

- Ensure there are no current logbook entries or deferrals related to the following items:
 - Fuel Used Indication
 - Associated Low Fuel Caution Annunciator
 - Both Fuel Flow Indicators
- Refer to AFM to ensure fuel balance remains within AFM Limitations during flight.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 28-6

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 29-1

Chapter 29

Hydraulic Power

Page Number

29-01	Hydraulic Fluid Low Light	29-2
29-02	Hydraulic Pressure Caution Annunciator	29-3

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 29-2

29-01 Hydraulic Fluid Low Light					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Hydraulic Fluid Low Light (HYD LEVEL Light On Ground Test/Refuel)	C	1	0	(M) May be inoperative provided hydraulic fluid level is verified prior to each departure.

Item	MEL Sticker Location	Flight Crew Deferral Item
29-01-01	Near Light	NO

Maintenance (M)

To verify the proper hydraulic fluid level.

Refer to AMM Chapter 12-10-01 Page Block 300 and perform the Hydraulic Package filling procedure.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 29-3

29-02 Hydraulic Pressure Caution Annunciator					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
-01	Hydraulic Pressure Caution Annunciator	B	1	0	Remarks Or Exceptions (O) May be inoperative provided Hydraulic Pressure Gauge is operative and monitored during aircraft operation.

Item	MEL Sticker Location	Flight Crew Deferral Item
29-02-01	Near Annunciator	YES

Operations (O)

1. Ensure there are no current logbook entries or deferrals related to the Hydraulic Pressure Gauge.
2. Monitor the Hydraulic Pressure Gauge during flight and verified normal as part of Before Landing Check.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 29-4

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 30-1

Chapter 30	Ice and Rain Protection	Page Number
30-01	Angle Of Attack Transducer Heater	30-2
30-02	Surface Deice System (Forward And Main Wing).....	30-3
30-03	Engine Ice Vanes	30-4
30-04	Engine Inlet Deicing System	30-5
30-05	Oil Inlet Heating System	30-6
30-06	Pitot Heaters	30-7
30-07	Static Port Heaters	30-8
30-08	Alternate Static Port Heater.....	30-9
30-09	Windshield Heat	30-10
30-10	Ice Detector	30-11

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 30-2

30-01 Angle Of Attack Transducer Heater					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Angle Of Attack Transducer Heater	B	1	0	May be inoperative provided: a) Aircraft is not operated in visible moisture below +4 degrees Celsius, b) Aircraft is not operated in known or forecast icing conditions, and c) Aircraft is operated VFR only.

Item	MEL Sticker Location	Flight Crew Deferral Item
30-01-01	Near Pitot Heat Switch	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 30-3

30-02 Surface Deice System (Forward And Main Wing)						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
					Remarks Or Exceptions	
	Surface Deice System (Forward And Main Wing)	C	1	0	May be inoperative provided: a) Aircraft is not operated in visible moisture below +4 degrees Celsius, and b) Aircraft is not operated in known or forecast icing conditions.	
-01	Main Wing Automatic Control	B	1	0	May be inoperative provided: a) Ice Detector is operative, and b) Aircraft is operated with a SIC pilot.	

Item	MEL Sticker Location	Flight Crew Deferral Item
30-02 30-02-01	Near Pitot Heat Switch	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 30-4

30-03 Engine Ice Vanes					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
-01	Engine Ice Vanes	B	2	1	Remarks Or Exceptions One may be inoperative provided: a) Aircraft is not operated in visible moisture below +4 degrees Celsius, and b) Aircraft is not operated in known or forecast icing conditions.

Item	MEL Sticker Location	Flight Crew Deferral Item
30-03-01	Near Engine Ice Switch	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 30-5

30-04 Engine Inlet Deicing System						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
-01	Engine Inlet Deicing System	B	2	1	Remarks Or Exceptions	
					One may be inoperative provided:	
					a) Aircraft is not operated in visible moisture below +4 degrees Celsius, and	
					b) Aircraft is not operated in known or forecast icing conditions.	
-02	Engine Inlet Deicing System (Automatic Control)	C	1	0	May be inoperative provided Timer Mode Control is operative and used.	

Item	MEL Sticker Location	Flight Crew Deferral Item
30-04-01 30-04-02	Near Engine Ice Switch	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 30-6

30-05 Oil Inlet Heating System					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Oil Inlet Heating System	B	2	1	One may be inoperative provided: a) Aircraft is not operated in visible moisture below +4 degrees Celsius, and b) Aircraft is not operated in known or forecast icing conditions.

Item	MEL Sticker Location	Flight Crew Deferral Item
30-05-01	Near Engine Ice Switch	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 30-7

30-06 Pitot Heaters						
Repair Category			Number Installed			
Item	Name/Description				Number Required For Dispatch	
-01	Pitot Heaters	B	2	1	Remarks Or Exceptions One may be inoperative provided: a) Aircraft is not operated in visible moisture below +4 degrees Celsius, b) Aircraft is not operated in known or forecast icing conditions, and c) IFR passenger carrying operations are not conducted.	
-02	Pitot Heat Annunciator (L PITOT HTR) (R PITOT HTR)	B	2	1	(O) One may be inoperative provided: a) Associated Pitot Heater is operative, and b) Aircraft is not operated in known or forecast icing conditions.	

Item	MEL Sticker Location	Flight Crew Deferral Item
30-06-01 30-06-02	Near Pitot Heat Switch	YES

Operations (O)

30-06-02

Ensure there are no current logbook entries or deferrals related to the associated Pitot Heater.

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 30-8	
30-07 Static Port Heaters									
Repair Category			Number Installed						
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
-01	Static Port Heaters	B	2	1	One may be inoperative provided: a) Aircraft is not operated in visible moisture below +4 degrees Celsius, b) Aircraft is not operated in known or forecast icing conditions, and c) IFR passenger carrying operations are not conducted.				
Item		MEL Sticker Location				Flight Crew Deferral Item			
30-07-01		Near Pitot Heat Switch				YES			

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 30-9

30-08 Alternate Static Port Heater					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
-01	Alternate Static Port Heater	B	1	0	Remarks Or Exceptions May be inoperative provided: a) Aircraft is not operated in visible moisture below +4 degrees Celsius, b) Aircraft is not operated in known or forecast icing conditions, and c) IFR passenger carrying operations are not conducted.

Item	MEL Sticker Location	Flight Crew Deferral Item
30-08-01	Near Pitot Heat Switch	YES

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 30-10	
30-09 Windshield Heat									
Repair Category			Number Installed						
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
-01	Windshield Heat (Primary And Secondary System)	C	2	1	One may be inoperative provided: a) Windshield Demist Diffuser is operative, and b) Aircraft is not operated in known or forecast icing conditions.				
-02	Windshield Heat (High Position)	C	2	0	May be inoperative in High position provided aircraft is not operated in known or forecast icing conditions.				
Item		MEL Sticker Location				Flight Crew Deferral Item			
30-09-01 30-09-02		Near Windshield Heat Switch				YES			

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 30-11

30-10 Ice Detector					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
-01	Ice Detector	B	1	0	Remarks Or Exceptions May be inoperative provided: a) Aircraft is not operated in visible moisture below +4 degrees Celsius, and b) Aircraft is not operated in known or forecast icing conditions.

Item	MEL Sticker Location	Flight Crew Deferral Item
30-10-01	Near Pitot Heat Switch	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 30-12

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 31-1

Chapter 31	Indicating / Recording Systems	Page Number
-------------------	---------------------------------------	--------------------

31-01	Clock (Sweep Second Hand Or Digital).....	31-2
31-03	Flight Hour Recorder.....	31-3

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 31-2

31-01 Clock (Sweep Second Hand Or Digital)						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions	
-01	Clock (Sweep Second Hand Or Digital)	C	2	0	May be inoperative for VFR operation.	
-02	Clock (Sweep Second Hand Or Digital)	C	2	1	Right side Clock may be inoperative for single pilot operations.	
-03	Clock (Sweep Second Hand Or Digital)	C	2	1	Left side Clock may be inoperative for operations with a SIC pilot.	

Item	MEL Sticker Location	Flight Crew Deferral Item
31-01-01 31-01-02 31-01-03	Near Clock	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 31-3

31-03 Flight Hour Recorder					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
				Remarks Or Exceptions	
-01	Flight Hour Recorder	C	1	0	(O) May be inoperative.

Item	MEL Sticker Location	Flight Crew Deferral Item
31-03-01	Near Hour Meter	YES

Operations (O)

Record aircraft times in aircraft log.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 31-4

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 32-1

Chapter 32

Landing Gear

Page Number

32-02	Parking Brake.....	32-2
32-04	Steering System.....	32-3

Brazos Valley Air Charter, LLC					Minimum Equipment List					
Aircraft: Avanti II					Revision No: Original		Date: 09-11-18		Page 32-2	
32-02 Parking Brake										
Repair Category				Number Installed						
Item	Name/Description			Number Required For Dispatch						
				Remarks Or Exceptions						
-01	Parking Brake	C	1	0	(O) May be inoperative.					
Item			MEL Sticker Location					Flight Crew Deferral Item		
32-02-01			Near Parking Break Control					YES		

Operations (O)

1. Parked aircraft must be chocked at all times.
2. During engine start, PIC will apply normal braking and take precautions that all persons are clear of the aircraft.
3. Do not stop aircraft on a sloping ramp unless there is someone there to chock the airplane while the PIC is holding the brakes, after engine shutdown.

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 32-3	
32-04 Steering System									
Repair Category			Number Installed						
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
					(M) May be inoperative provided: a) Aircraft is not operated on a contaminated runway, and b) Maximum Demonstrated Crosswind Velocity is not exceeded.				
-01	Steering System	B	1	0	NOTE: Maximum Crosswind Limit is to mitigate effects of differential braking on Takeoff Performance and brake temperatures After Landing during Taxi operations.				
Item		MEL Sticker Location				Flight Crew Deferral Item			
32-04-01		Near Captains Instrument Panel				YES			

Maintenance (M)

Procedure to make sure that the steering is fully disengaged.

1. Verify that the steering disconnecting lever is connected.
2. Verify that the steering system is switched OFF.
3. Remove the CB NOSE STRG located on the LH CB PANEL (pilot).
4. Switch ON the hydraulic power and verify that the steering is at neutral position (Anti-Shimmy) and that it isn't possible to steer the nose wheels.
5. Connect the tow bar to the nose landing gear.
6. With rudder pedals centered, slightly moving the tow bar by hand, verify that it is possible to move the nose wheels to the left side and to the right side (the steering system is in anti-shimmy condition).

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 32-4

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 33-1

Chapter 33	Lights	Page Number
33-01	Cabin Lights	33-2
33-02	Cockpit And Instrument Lighting System	33-3
33-03	Taxi Light.....	33-4
33-04	Landing Lights.....	33-5
33-05	Position Lights.....	33-6
33-06	Anti-Collision Beacon Light System (Ground & Air).....	33-7
33-07	Recognition Light	33-8
33-08	Wing Ice Lights.....	33-9
33-09	Baggage Compartment Lights	33-10
33-10	Lighted Passenger Information Signs (Fasten Seatbelt)	33-11

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 33-2

33-01 Cabin Lights					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
-01	Cabin Lights	C	8	-	Remarks Or Exceptions (O) May be partially inoperative provided: a) Cabin Emergency Lighting is operative, b) Sufficient Lighting is available for crew to perform required duties and c) Sufficient Lighting is operative for passenger carrying operations at night.

Item	MEL Sticker Location	Flight Crew Deferral Item
33-01-01	Near Captains Instrument Panel	YES

Operations (O)

Ensure there is sufficient lighting available for the crew to perform their required duties, and for passengers to see adequately during night operations.

Brazos Valley Air Charter, LLC			Minimum Equipment List		
Aircraft: Avanti II			Revision No: Original	Date: 09-11-18	Page 33-3
33-02 Cockpit And Instrument Lighting System					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
-01	Cockpit And Instrument Lighting System	C	2	-	Remarks Or Exceptions Individual Lights or panels may be inoperative provided remaining Lights are: a) Sufficient to clearly illuminate all required instruments, controls, and other devices for which it is provided, b) Positioned so that direct rays are shielded from flight crewmembers eyes, and c) Lighting configuration and intensity is acceptable to the flight crew.
Item		MEL Sticker Location		Flight Crew Deferral Item	
33-02-01		Near Associated Light Control		YES	

Brazos Valley Air Charter, LLC					Minimum Equipment List					
Aircraft: Avanti II					Revision No: Original		Date: 09-11-18		Page 33-4	
33-03 Taxi Light										
Repair Category					Number Installed					
Item	Name/Description				Number Required For Dispatch					
					Remarks Or Exceptions					
-01	Taxi Light	C	1	0						
Item			MEL Sticker Location					Flight Crew Deferral Item		
33-03-01			Near Taxi Light Switch					YES		

Brazos Valley Air Charter, LLC					Minimum Equipment List			
Aircraft: Avanti II					Revision No: Original		Date: 09-11-18	Page 33-5
33-04 Landing Lights								
Repair Category			Number Installed					
Item	Name/Description			Number Required For Dispatch				
				Remarks Or Exceptions				
-01	Landing Lights	C	2	0	Both may be inoperative for day operations.			
-02	Landing Lights	C	2	1	One may be inoperative for night operations provided Taxi Light is operative.			

Item	MEL Sticker Location	Flight Crew Deferral Item
33-04-01 33-04-02	Near Landing Light Switch	YES

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 33-6	
33-05 Position Lights									
Repair Category			Number Installed						
Item	Name/Description		C	3	0	Number Required For Dispatch			
	Position Lights					Remarks Or Exceptions			
						May be inoperative for day operations.			
Item		MEL Sticker Location					Flight Crew Deferral Item		
33-05-01		Near Position Light Switch					YES		

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 33-7	
33-06 Anti-Collision Beacon Light System (Ground & Air)									
Repair Category			Number Installed						
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
-01	Anti-Collision Beacon Light System (Ground & Air)	A	1	0	May be inoperative provided: a) Aircraft is not operated at night, and b) Repairs are made within three (3) flight days.				
Item			MEL Sticker Location				Flight Crew Deferral Item		
33-06-01			Near Anti-Collision Beacon Light Switch				YES		

Brazos Valley Air Charter, LLC					Minimum Equipment List					
Aircraft: Avanti II					Revision No: Original		Date: 09-11-18		Page 33-8	
33-07 Recognition Light										
Repair Category			Number Installed							
Item	Name/Description			Number Required For Dispatch						
				Remarks Or Exceptions						
-01	Recognition Light	C	1	0						
Item			MEL Sticker Location					Flight Crew Deferral Item		
33-07-01			Near Recognition Light Switch					YES		

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 33-9	
33-08 Wing Ice Lights									
Repair Category			Number Installed						
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
-01	Wing Ice Lights	C	1	0	May be inoperative provided aircraft is not operated in known or forecast icing conditions at night.				
-02	Wing Ice Lights	C	1	0	May be inoperative provided: a) Ice Detection System is operative, and b) Ground deicing procedures do not require use of Wing Ice Lights.				
Item		MEL Sticker Location				Flight Crew Deferral Item			
33-08-01 33-08-02		Near Wing Ice Light Switch				YES			

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 33-10	
33-09 Baggage Compartment Lights									
Repair Category			Number Installed						
Item	Name/Description			Number Required For Dispatch					
				Remarks Or Exceptions					
-01	Baggage Compartment Lights	D	1	0					
Item		MEL Sticker Location					Flight Crew Deferral Item		
33-09-01		Near Baggage Compartment Light Switch					YES		

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 33-11	
33-10 Lighted Passenger Information Signs (Fasten Seatbelt)									
Repair Category			Number Installed						
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
-01	Lighted Passenger Information Signs (Fasten Seatbelt)	C	1	0	(O) May be inoperative provided procedures as noted in the Operations procedure are followed to notify Cabin occupants.				

Item	MEL Sticker Location	Flight Crew Deferral Item
33-10-01	Near Light Switch	YES

Operations (O)

Flight crew will verbally notify passengers when the seat belts must be fastened.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 33-12

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 34-1

Chapter 34	Navigation	Page Number
34-01	Vertical Speed Indicator.....	34-2
34-02	Weather Radar/ Thunderstorm Detection Equipment	34-3
34-03	Navigation Equipment.....	34-4
34-04	ATC Transponders And Automatic Altitude Reporting Systems	34-6
34-05	Radar Altimeter	34-7
34-06	Altitude Alerting System.....	34-8
34-08	Traffic Alert And Collision Avoidance System (TCAS I)	34-9
34-09	Non-Stabilized Magnetic Compass	34-10
34-10	Terrain Awareness & Warning System (TAWS) Ground Proximity Warning System (GPWS)	34-11
34-12	Standby Attitude Indicator.....	34-13
34-13	Primary Flight Display (DMT 80-0587 Only).....	34-14
34-14	Display Control Panel (DCP)	34-15
34-15	Air Data Computer (DMT 80-0587 Only)	34-16
34-16	Attitude & Heading Reference System (DMT 80-0587 Only)	34-17
34-17	Automatic Dependent Surveillance Broadcast (ADS-B) System.....	34-18

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 34-2

34-01 Vertical Speed Indicator					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Vertical Speed Indicator	B	2	1	May be inoperative on the right side provided a SIC is not required.
-02	Vertical Speed Indicator	B	2	0	May be inoperative provided aircraft is operated Day VFR.

Item	MEL Sticker Location	Flight Crew Deferral Item
34-01-01 34-01-02	Near Vertical Speed Indicator	YES

Brazos Valley Air Charter, LLC				Minimum Equipment List		
Aircraft: Avanti II				Revision No: Original	Date: 09-11-18	Page 34-3
34-02 Weather Radar/ Thunderstorm Detection Equipment						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
				Remarks Or Exceptions		
-01	Weather Radar/ Thunderstorm Detection Equipment	C	1	0	May be inoperative provided flight is not operated under IFR or night VFR conditions when current weather reports indicate that thunderstorms, or other potentially hazardous weather conditions that can be detected with airborne weather radar, may reasonably be expected along the route to be flown. 14 CFR REFERENCE: 14 CFR 135.175	
Item		MEL Sticker Location			Flight Crew Deferral Item	
34-02-01		Near WR Control			YES	

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 34-4	
34-03 Navigation Equipment									
Repair Category			Number Installed						
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
-01	VOR/ILS System	D	2	1	One may be inoperative provided approach procedures or enroute navigation do not require use of VOR/ILS. 14 CFR REFERENCE: 14 CFR 135.161, 135.165				
-a	Glide Slope	C	2	1	One may be inoperative provided approach procedures do not require use of Glide Slope. 14 CFR REFERENCE: 14 CFR 135.161, 135.165				
-b	Marker Beacon	C	1	0	One may be inoperative provided approach procedure does not require the use of Marker Beacon. 14 CFR REFERENCE: 14 CFR 135.165				
-02	Distance Measuring Equipment (DME) Systems	C	1	0	May be inoperative provided a suitable operative RNAV system is available.				
-02	Distance Measuring Equipment (DME) Systems	C	1	0	May be inoperative provided operations do not require the use of DME				
-03	Area Navigation (RNAV) (Multi-Sensor, GPS)	C	2	1	One may be inoperative provided: a) Not required by FAR, and b) Operations do not require its use				
					NOTE: Systems identified as FMS may have a variety of navigation signal sources. Relief for RNAV functions and/or associated signal sources of an FMS must be applied only to FMS functions limited to navigation and not affecting operation of other aircraft systems.				
-04	Automatic Direction Finder (ADF)	D	1	0	May be inoperative provided operations do not require the use of ADF.				
-06	Flight Management System (FMS) (Proline 21 only) (S/N 1105 and after)	A	1	0	May be inoperative provided: c) Operations do not require its use, d) Affected systems are considered inoperative, and e) Repairs are made within two flight cycles.				
					NOTE: Systems identified as FMS that provide only navigation functions are deferred with Area Navigation.				

(Continued)

Brazos Valley Air Charter, LLC		Minimum Equipment List		
Aircraft: Avanti II		Revision No: Original	Date: 09-11-18	Page 34-5
Item	MEL Sticker Location	Flight Crew Deferral Item		
34-03-01 thru 34-03-06	Near NAV Panel	YES		

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 34-6

34-04 ATC Transponders And Automatic Altitude Reporting Systems						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions	
-01	ATC Transponders And Automatic Altitude Reporting Systems	B	2	0	May be inoperative provided: a) Operations do not require its use, and b) Prior to flight, approval is obtained from ATC facilities having jurisdiction over the planned route of flight.	
					NOTE: RVSM is not authorized.	
					RVSM Operations Not Authorized	
-02	ATC Transponders And Automatic Altitude Reporting Systems	D	2	1	One may be inoperative. 14 CFR REFERENCE: 14 CFR 91.215	

Item	MEL Sticker Location	Flight Crew Deferral Item
34-04-01 34-04-02	Near Transponder Control	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 34-7

34-05 Radar Altimeter					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
-01	Radar Altimeter	C	1	0	Remarks Or Exceptions (M)(O) May be inoperative provided: a) Approach procedures do not require its use, and b) Alternate procedures are established and used. NOTE: Inoperative Radar Altimeter may affect TAWS/GPWS or TCAS equipment.

Item	MEL Sticker Location	Flight Crew Deferral Item
34-05-01	Near RA Indication	YES

Maintenance (M)

Pull and secure the RA circuit breaker.

Operations (O)

Prior to departure, ensure operations do not require the use of Radar Altimeter.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 34-8

34-06 Altitude Alerting System					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Altitude Alerting System	A	1	0	(O) May be inoperative provided: a) Autopilot with Altitude Hold is operative, b) Operations do not require the use of the Altitude Alert, and c) Repairs are made within three flight days. NOTE: RVSM is not authorized. RVSM Operations Not Authorized
-02	Altitude Alerting System	A	1	0	(O) May be inoperative provided: a) Aircraft is operated with a Second in Command, b) Operations do not require the use of the Altitude Alert, and c) Repairs are made within three flight days. NOTE: RVSM is not authorized. RVSM Operations Not Authorized

Item	MEL Sticker Location	Flight Crew Deferral Item
34-06-01 34-06-02	Near Captains Instrument Panel	YES

Operations (O)

34-06-01

1. Ensure there are no current logbook entries or deferrals related to Altitude Hold.
2. Crew briefings must include a reminder that the altitude alerting system is inoperative.
3. The flight crew will use aural callouts pertaining to approach target altitudes as assigned by ATC or depicted on approach charts.

34-06-02

1. Crew briefings will make reference to inoperative altitude alerting system.
2. When flying with an inoperative altitude alerting system be especially careful of flying through assigned altitudes (climbing or descending) or drifting off of an assigned altitude. To avoid such:
3. When within 1,000 feet of an assigned altitude the pilot not flying will announce:
"Out of xxxx feet (or FL) for xxx feet (or FL)"
4. When within 300 feet of an assigned altitude either climbing, descending or drifting off of an assigned altitude the pilot not flying would state:
"Altitude - Altitude"

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 34-9

34-08 Traffic Alert And Collision Avoidance System (TCAS I)					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Traffic Alert And Collision Avoidance System (TCAS I)	C	1	0	(M) May be inoperative provided: a) System is deactivated and secured, and b) Enroute or approach procedures do not require the use of TCAS.
					NOTE: Per 14 CFR 135.180 TCAS not required for aircraft with less than 10 seat.
					14 CFR REFERENCE: 14 CFR 135.180

Item	MEL Sticker Location	Flight Crew Deferral Item
34-08-01	Near Captains Instrument Panel	YES

Maintenance (M)

Pull and secure the TCAS circuit breaker.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 34-10

34-09 Non-Stabilized Magnetic Compass					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Non-Stabilized Magnetic Compass	B	1	0	(O) May be inoperative provided: a) Any combination of two Gyro, AHC or INS (IRU) Stabilized Compass Systems are operative, and b) Aircraft is operated with dual independent navigation capability and under positive radar control by ATC on the enroute portion of the flight.

Item	MEL Sticker Location	Flight Crew Deferral Item
34-09-01	Near Compass	YES

Operations (O)

Comply with the remarks or exceptions, no additional procedures are required.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 34-11

34-10 Terrain Awareness & Warning System (TAWS) Ground Proximity Warning System (GPWS) (Class B TAWS required by FAR: 14 CFR 135.154)					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
	Terrain Awareness & Warning System (TAWS) Ground Proximity Warning System (GPWS) (Class B TAWS required by FAR)	A	1	0	(O) May be inoperative provided: a) Alternate procedures are established and used, and b) Repairs are made within two flight days.
-01a	Modes 1 & 3	A	2	0	(O) May be inoperative provided: a) Alternate procedures are established and used, and b) Repairs are made within two flight days.
-01b	Test Mode	A	1	0	May be inoperative provided: a) GPWS is considered inoperative, and b) Repairs are made within two flight days.
-01c	Modes 2, 4 & 5	C	3	0	
-01d	Advisory Callouts	B	1	0	(O) May be inoperative provided procedures as noted in the Operations procedure are followed.
-02	Terrain System-Forward Looking Terrain Avoidance (FLTA) And Premature Descent Alert (PDA) Functions	B	1	0	
-03	Terrain Displays	C	2	0	

Item	MEL Sticker Location	Flight Crew Deferral Item
34-10 thru 34-10-03	Near GPWS Indication	YES

Operations (O)

34-10, 34-10-01a

1. Crew briefings will include aural callouts through use of appropriate aircraft equipment to ensure obstacle and terrain clearance.
2. Flight crew will review MEA, MSA, DH, MDA, as appropriate of the route being flown.
3. Flight manual and operating manual can be consulted for climb gradients available for the phase of flight being approached, and the ambient conditions (weight, temp, altitude).

(Continued)

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 34-12

34-10-01d

Crew briefings must include aural callouts during approach through the use of appropriate aircraft equipment to make sure obstacle and terrain clearance. Briefing must include MDA or DH and a procedure for a crew member to call out 500 feet above airport elevation, and any other agreed upon by the flight crew.

Brazos Valley Air Charter, LLC					Minimum Equipment List			
Aircraft: Avanti II					Revision No: Original		Date: 09-11-18	Page 34-13
34-12 Standby Attitude Indicator								
Repair Category			Number Installed					
Item	Name/Description			Number Required For Dispatch				
				Remarks Or Exceptions				
-01	Standby Attitude Indicator	B	1	0	May be inoperative provided: a) Operations are conducted in day VMC only, and b) Operations are not conducted into known or forecast over-the-top conditions.			
Item		MEL Sticker Location				Flight Crew Deferral Item		
34-12-01		Near Standby Attitude Indicator				YES		

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 34-14

34-13 Primary Flight Display (DMT 80-0587 Only)					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
-01	Primary Flight Display (DMT 80-0587 Only) (AVANTI II Proline 21)	B	2	1	Remarks Or Exceptions Right side may be inoperative for day VMC operations provided a SIC is not required.

Item	MEL Sticker Location	Flight Crew Deferral Item
34-13-01	Near Captains Instrument Panel	YES

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 34-15	
34-14 Display Control Panel (DCP)									
Repair Category			Number Installed						
Item	Name/Description				Number Required For Dispatch				
					Remarks Or Exceptions				
-01	Display Control Panel (DCP) (DMT 80-0587 Only) (AVANTI II Proline 21)	B	2	1	Right side may be inoperative for day VMC operations provided a SIC is not required.				
Item		MEL Sticker Location				Flight Crew Deferral Item			
34-14-01		Near Captains Instrument Panel				YES			

Brazos Valley Air Charter, LLC				Minimum Equipment List			
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18	Page 34-16
34-15 Air Data Computer (DMT 80-0587 Only)							
Repair Category			Number Installed				
Item	Name/Description			Number Required For Dispatch			
				Remarks Or Exceptions			
-01	Air Data Computer (DMT 80-0587 Only) (AVANTI II Proline 21)	B	2	1	One may be inoperative for day VMC operations.		
Item		MEL Sticker Location			Flight Crew Deferral Item		
34-15-01		Near Captains Instrument Panel			YES		

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 34-17

34-16 Attitude & Heading Reference System (DMT 80-0587 Only)					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Attitude & Heading Reference System (DMT 80-0587 Only) (AVANTI II Proline 21)	B	2	1	One may be inoperative for day VMC operations provided Magnetic Compass is operative.

Item	MEL Sticker Location	Flight Crew Deferral Item
34-16-01	Near Captains Instrument Panel	YES

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 34-18	
34-17 Automatic Dependent Surveillance Broadcast (ADS-B) System									
Repair Category			Number Installed						
Item -01	Name/Description Automatic Dependent Surveillance Broadcast (ADS-B) System	D	2	0	Number Required For Dispatch				
					Remarks Or Exceptions May be inoperative.				
					NOTE: ADS-B not required until January 1, 2020, after that date required in Class A-E airspace.				
					14 CFR REFERENCE: 14 CFR 91.225				
Item		MEL Sticker Location				Flight Crew Deferral Item			
34-17-01		Near Transponder Panel				YES			

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 35-1

Chapter 35	Oxygen	Page Number
35-01	Passenger Oxygen Mask(s)	35-2
35-02	External Oxygen Pressure Gauge	35-3

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 35-2

35-01 Passenger Oxygen Mask(s)						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
-01	Cabin Oxygen Mask(s)	C	8	0	Remarks Or Exceptions	
					May be inoperative provided:	
					a) Associated Seat is considered inoperative, and	
					b) Associated Seat is placarded "DO NOT OCCUPY".	
-02	Lavatory Compartment Mask	C	1	0	(O) May be inoperative provided:	
					a) Lavatory Compartment is not occupied in flight, and	
					b) Lavatory Compartment Door remains closed, and	
					c) Lavatory Compartment Door is placarded "INOPERATIVE – DO NOT USE".	

Item	MEL Sticker Location	Flight Crew Deferral Item
35-01-01 35-01-02	Near Captains Instrument Panel	YES

Operations (O)

35-01-02

1. Placard Compartment Door, "INOPERATIVE – DO NOT USE".
2. Brief passengers that the Lavatory is inoperative and not to be used.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 35-3

35-02 External Oxygen Pressure Gauge					
Repair Category			Number Installed		
Item	Name/Description				Number Required For Dispatch
					Remarks Or Exceptions
-01	External Oxygen Pressure Gauge	B	1	0	May be inoperative provided Cockpit Oxygen Pressure Gauge is operative.

Item	MEL Sticker Location	Flight Crew Deferral Item
35-02-01	Near Cockpit Oxygen Pressure Gauge	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 35-4

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 45-1

Chapter 45

Central Maintenance Computer

Page Number

45-01	Maintenance Diagnostic Computer	45-2
-------	---------------------------------------	------

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 45-2	
45-01 Maintenance Diagnostic Computer									
Repair Category			Number Installed						
Item	Name/Description			Number Required For Dispatch					
				Remarks Or Exceptions					
-01	Maintenance Diagnostic Computer	C	1	0	(M) May be inoperative.				

Item	MEL Sticker Location	Flight Crew Deferral Item
45-01-01	Near Captains Instrument Panel	YES

Maintenance (M)

Ensure all required information normally obtained by the MDC is recorded in aircraft log as required.

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 46-1

Chapter 46	Information Systems	Page Number
-------------------	----------------------------	--------------------

46-01	Electronic Flight Bag Systems (EFBs).....	46-2
46-02	Integrated Flight Information System (IFIS-5000 Only).....	46-3

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 46-2

46-01 Electronic Flight Bag Systems (EFBs)					
Category			Number Installed		
Item	Name / Description			Number Required For Dispatch	Remarks Or Exceptions
-01	Electronic Flight Bag Systems (EFBs)	C	2	0	(O) May be inoperative provided procedures as noted in the Operations procedure are followed. NOTE: Any function, program or document which operates normally may be used.
-02	Data Connectivity (Class 2)	C	2	0	(O) May be inoperative provided procedures as noted in the Operations procedure are followed.
-03	Power Connection (Class 1 & 2)	C	2	0	(O) May be inoperative provided procedures as noted in the Operations procedure are followed.
-04	Mounting Device (Class 2)	C	2	0	(M)(O) May be inoperative provided: a) The associated EFB and hardware is secured by an alternate means or removed from the aircraft, and b) Procedures as noted in the Maintenance and Operations procedures are followed.

Item	MEL Sticker Location	Flight Crew Deferral Item
46-01-01 thru 46-01-04	Adjacent To The EFB	YES

Maintenance (M)

46-01-04

Secure EFB and hardware by alternate means or remove from aircraft.

Operations (O)

46-01-01, 46-01-02, 46-01-03, 46-01-04

As an alternative to electronic charts (File Server Units), a current (paper or electronic) copy of navigational en route, terminal area, and instrument approach procedure charts applicable to the route being flown will be onboard prior to departure.

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 46-3

46-02 Integrated Flight Information System (IFIS-5000 Only)					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	Remarks Or Exceptions
-01	File Server Unit (FSU INOP Message)	C	1	0	(O) May be inoperative provided procedures as noted in the Operations procedure are used to ensure all information associated with the flight is available in a current and appropriate form.
					NOTE: If alternate source is electronic, dual redundancy is required for operation.
-02	Cursor Control Panel (CCP)	C	1	0	(O) May be inoperative provided procedures as noted in the Operations procedure are used to ensure all information associated with the flight is available in a current and appropriate form.
-03	Communications Management Unit (CMU)	C	1	0	(O) May be inoperative provided procedures as noted in the Operations procedure are used for ACARS and Universal WX inoperative.

Item	MEL Sticker Location	Flight Crew Deferral Item
46-02-01 46-02-02 46-02-03	Near Associated MFD	YES

Operations (O)

46-02-01, 46-02-02

As an alternative to electronic charts (File Server Units), a current (paper or electronic) copy of navigational en route, terminal area, and instrument approach procedure charts applicable to the route being flown will be onboard prior to departure.

46-02-03

Flight crew will utilize the VHF radio communication system or any other communication system within attainable range to monitor/send/receive pertinent information to/from the air traffic management system.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 46-4

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 52-1

Chapter 52	Doors	Page Number
52-01	Cabin Door Seal Single Seal Failure	52-2
52-02	Cabin Door Seal Dual Seal Failure	52-3
52-03	Cabin Door Cable.....	52-4

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 52-2	
52-01 Cabin Door Seal Single Seal Failure									
Repair Category			Number Installed						
Item	Name/Description			Number Required For Dispatch					
				Remarks Or Exceptions					
-01	Cabin Door Seal Single Seal Failure	C	2	1	(M) May be inoperative for pressurized flight up to and including 30,000 feet MSL.				
Item		MEL Sticker Location					Flight Crew Deferral Item		
52-01-01		Near Captains Instrument Panel					NO		

Maintenance (M)

To ensure that the failure is limited to seals and that it does not affect other equipment which could affect the aeroplanes operations.

1. Refer to AMM Chapter 52-00-00 and remove the trim panel which covers the door seal inflation system. Inspect the inflating valves for general condition and proper installation.
2. Refer to AMM Chapter 71-00-00 and perform a one-engine ground run at F.I.
3. Refer to AMM Chapter 36-11-00 Page Block 200 Figure 201 (Sheet 1) and verify that the air flows through the door inflation hoses (identified with "OUTLET" in Figure 200). If this test is positive shut down the engine and skip to step (6).
4. Shut down the engine.
5. If no airflow passes through both the door inflating hoses, a damage of the door inflation system is assumed and no flight is permitted until its identification and rectification.
6. Install the previously removed trim panel.
7. Apply a tag to the door internal handle to remind the operator the applicable limitations.

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 52-3	
52-02 Cabin Door Seal Dual Seal Failure									
Repair Category			Number Installed						
Item	Name/Description			Number Required For Dispatch					
				Remarks Or Exceptions					
-01	Cabin Door Seal Dual Seal Failure	C	2	0	(M)(O) May be inoperative for unpressurized flight.				
Item		MEL Sticker Location					Flight Crew Deferral Item		
52-02-01		Near Captains Instrument Panel					NO		

Maintenance (M)

To ensure that the failure is limited to seals and that it does not affect other equipment which could affect the aeroplanes operations.

1. Refer to AMM Chapter 52-00-00 and remove the trim panel which covers the door seal inflation system. Inspect the inflating valves for general condition and proper installation.
2. Refer to AMM Chapter 71-00-00 and perform a one-engine ground run at F.I.
3. Refer to AMM Chapter 36-11-00 Page Block 200 Figure 201 (Sheet 1) and verify that the air flows through the door inflation hoses (identified with "OUTLET" in Figure 200). If this test is positive shut down the engine and skip to step (6).
4. Shut down the engine.
5. If no airflow passes through both the door inflating hoses, a damage of the door inflation system is assumed and no flight is permitted until its identification and rectification.
6. Install the previously removed trim panel.
7. Apply a tag to the door internal handle to remind the operator the applicable limitations.

Operations (O)

Ensure aircraft remains at or below 10,000 feet MSL.

Brazos Valley Air Charter, LLC				Minimum Equipment List			
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18	Page 52-4
52-03 Cabin Door Cable							
Repair Category			Number Installed				
Item	Name/Description				Number Required For Dispatch		
					Remarks Or Exceptions		
-01	Cabin Door Cable	C	2	1	(O) One may be damaged provided affected Door Cable performs its intended function.		
-02	Cabin Door Cable	B	2	1	(M)(O) One may be inoperative, broken or missing provided: a) Affected Cable does not interfere with Door operation, b) Procedures are established to preclude damage to Cabin Door from passenger use, and c) Passengers are briefed.		
Item		MEL Sticker Location				Flight Crew Deferral Item	
52-03-01		Near Captains Instrument Panel				YES	
52-03-02		Near Captains Instrument Panel				NO	

Maintenance (M)

52-03-02

Remove or secure broken Door Cable so it does not interfere with Door operation.

Operations (O)

52-03-01

Open and close Cabin Door to ensure proper operation of the door.

52-03-02

Verify affected Door Cable does not interfere with Cabin Door operation and brief passengers accordingly.

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 61-1

Chapter 61

Propellers

Page Number

61-01	Propeller Syncrophaser System.....	61-2
-------	------------------------------------	------

Brazos Valley Air Charter, LLC				Minimum Equipment List		
Aircraft: Avanti II				Revision No: Original	Date: 09-11-18	Page 61-2
61-01 Propeller Syncrophaser System						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
				Remarks Or Exceptions		
-01	Propeller Syncrophaser System	C	1	0		
Item		MEL Sticker Location			Flight Crew Deferral Item	
61-01-01		Near Captains Instrument Panel			YES	

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 73-1

Chapter 73

Engine Fuel & Control

Page Number

73-01	Fuel Flow Indicator.....	73-2
-------	--------------------------	------

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 73-2

73-01 Fuel Flow Indicator					
Repair Category			Number Installed		
Item	Name/Description			Number Required For Dispatch	
				Remarks Or Exceptions	
-01	Fuel Flow Indicator	C	2	1	(M) One may be inoperative provided both Fuel Quantity Indicators are operative.

Item	MEL Sticker Location	Flight Crew Deferral Item
73-01-01	Near Associated Fuel Flow Indicator	YES

Maintenance (M)

Visually verify no fuel leak or other adverse condition exists.

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page 79-1

Chapter 79	Engine Oil	Page Number
-------------------	-------------------	--------------------

79-01	Oil Pressure Warning Annunciator.....	79-2
79-02	Oil Temperature Warning Annunciator	79-3

Brazos Valley Air Charter, LLC				Minimum Equipment List		
Aircraft: Avanti II				Revision No: Original	Date: 09-11-18	Page 79-2
79-01 Oil Pressure Warning Annunciator						
Repair Category			Number Installed			
Item	Name/Description			Number Required For Dispatch		
				Remarks Or Exceptions		
-01	Oil Pressure Warning Annunciator (L Or R OIL PRESS)	C	2	1	One may be inoperative provided corresponding Oil Pressure Gauge is operative and monitored.	
Item		MEL Sticker Location			Flight Crew Deferral Item	
79-01-01		Near Annunciator			YES	

Brazos Valley Air Charter, LLC				Minimum Equipment List					
Aircraft: Avanti II				Revision No: Original		Date: 09-11-18		Page 79-3	
79-02 Oil Temperature Warning Annunciator									
Repair Category			Number Installed						
Item	Name/Description			Number Required For Dispatch					
				Remarks Or Exceptions					
				One may be inoperative provided corresponding Oil Temperature Gauge is operative and monitored.					
-01	Oil Temperature Warning Annunciator	C	2	1					

Item	MEL Sticker Location	Flight Crew Deferral Item
79-02-01	Near Annunciator	YES

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page 79-4

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page IND-1

Index

A

Air Data Computer (DMT 80-0587 Only)	34-16
Alternate Static Port Heater	30-9
Altitude Alerting System	34-8
Angle Of Attack Transducer Heater	30-2
ATC Transponders And Automatic Altitude Reporting Systems	34-6
Attitude & Heading Reference System	34-17
Automatic Dependent Surveillance Broadcast (ADS-B) System	34-18
Autopilot Disconnect	22-4
Autopilot System	22-3

B

Battery Overheat Warning Annunciator (BAT OVHT)	24-4
Battery Temperature Caution Annunciator (BAT TEMP)	24-3
Battery Temperature Indicator	24-5
Bleed Air Valve	21-9
Boom Microphones	23-10

C

Cabin Air Outlets	21-2
Cabin Altitude Annunciator (CAB PRESS)	21-4
Cabin Door Cable	52-4
Cabin Door Seal Dual Seal Failure	52-3
Cabin Rate Of Climb Indicator	21-7
Cabin Storage Compartments / Closets	25-9
Cargo Restraint Systems	25-5
Cockpit Speaker	23-5
Cockpit Voice Recorder (CVR)	23-9
Communications System (VHF, UHF)	23-2
Control Wheel Trim Switches (CWTS)	27-4

D

D.C. Generator Annunciators	24-2
Differential Pressure / Cabin Altitude Indicator	21-5
Display Control Panel (DCP)	34-15

E

Electric Cockpit Heater (Auxiliary)	21-8
Electronic Flight Bag System (EFB)	46-2
Emergency Locator Transmitter (ELT)	25-6
Engine Ice Vanes	30-4
Engine Inlet Deicing System	30-5
External Oxygen Pressure Gauge	35-3
External Power	24-6

Brazos Valley Air Charter, LLC	Minimum Equipment List		
Aircraft: Avanti II	Revision No: Original	Date: 09-11-18	Page IND-2

F

Fasten Seat Belt / Fasten Seat Belt While Seated” Sign Or Placard	25-7
Flight Director	22-6
Flight Guidance Panel Button Annunciation	22-2
Flight Phone	23-3
Fuel Crossfeed Annunciator (FUEL XFEED)	28-4
Fuel Flow Indicator	73-2
Fuel Quantity Indicator	28-6

H

Handheld Microphone	23-7
Hydraulic Fluid Low Light	29-2

I

Ice Detector	30-11
Integrated Flight Information System (IFIS)	46-3

L

Low Fuel Caution Annunciator	28-5
------------------------------------	------

M

Maintenance Diagnostic Computer	45-2
---------------------------------------	------

N

Navigation Equipment	34-4
Non-Essential Equipment & Furnishings (NEF)	25-4
Non-Stabilized Magnetic Compass	34-10

O

Oil Inlet Heating System	30-6
Oil Pressure Warning Annunciator	79-2
Oil Temperature Warning Annunciator	79-3

P

Passenger Address System (PA)	23-4
Passenger Oxygen Mask(s)	35-2
Passenger Seat(s)	25-3
Pilot Headset	23-6
Pilot(s) Seat Adjustment	25-2
Pitch Trim Indicator	27-3
Pitot Heaters	30-7
Portable Fire Extinguisher	26-2
Pressurization Control	21-6

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page IND-3

Pressurization System.....	21-3
Primary Flight Display	34-14
Propeller Syncrophaser System	61-2

R

Radar Altimeter	34-7
Rear Baggage Compartment Smoke / Fire Detection Systems	26-3

S

Single Point Pressure Refueling System	28-3
Standby Attitude Indicator	34-13
Static Port Heaters	30-8
Static Wicks.....	23-8
Surface Deice System (Forward And Main Wing).....	30-3

T

Temperature Controller	21-11
Terrain Awareness & Warning System (TAWS) Ground Proximity Warning System (GPWS) ..	34-11
Traffic Alert And Collision Avoidance System (TCAS I)	34-9
Trim Tab Indicator (Roll And Yaw).....	27-2

V

Vapor Cycle Air Conditioning System	21-10
Vertical Speed Indicator	34-2

W

Waste Receptacles Access Doors/Covers	25-8
Weather Radar/ Thunderstorm Detection Equipment	34-3
Windshield Heat	30-10

Y

Yaw Damper	22-5
------------------	------

Brazos Valley Air Charter, LLC	Minimum Equipment List
Aircraft: Avanti II	Revision No: Original Date: 09-11-18 Page IND-4

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-1

Table of Contents

Section	Page
Control Pages	N-3
General	N-5
Overall NEF Deferral Program Responsibility.....	N-5
NEF Definition:	N-5
Evaluating NEF Items	N-6
NEF Checklist (for items NOT on NEF Deferral List).....	N-8
Adding Items to the NEF List Flow Chart.....	N-9
NEF Checklist Reporting.....	N-11
NEF Item Repair Requirements:	N-12
NEF Deferral List	N-13
NEF Index	N-21

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-2

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-3

Control Pages

Page #	Revision #	Date
N-1	Original	09-11-18
N-2	Original	09-11-18
N-3	Original	09-11-18
N-4	Original	09-11-18
N-5	Original	09-11-18
N-6	Original	09-11-18
N-7	Original	09-11-18
N-8	Original	09-11-18
N-9	Original	09-11-18
N-10	Original	09-11-18
N-11	Original	09-11-18
N-12	Original	09-11-18
N-13	Original	09-11-18
N-14	Original	09-11-18
N-15	Original	09-11-18
N-16	Original	09-11-18
N-17	Original	09-11-18
N-18	Original	09-11-18
N-19	Original	09-11-18
N-20	Original	09-11-18
N-21	Original	09-11-18
N-22	Original	09-11-18
N-23	Original	09-11-18
N-24	Original	09-11-18

NEF

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-4

Intentionally Left Blank

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-5

General

1. NEF is an FAA approved standardized method for deferring inoperative, damaged or missing non-essential, non-safety items located throughout the airplane.
2. The Brazos Valley Air Charter, LLC NEF Program provides the authority to defer non-essential items installed in areas including, but not limited to, the flight deck, passenger cabin, crew rest area, galley, lavatory, cargo bin and maintenance service areas.
3. FAA approval of Brazos Valley Air Charter, LLC NEF Program is granted via the appropriate MMEL NEF item. This MEL item provides the authority to defer NEF items and refers to Brazos Valley Air Charter, LLC NEF Manual as the location of their NEF Program.
4. An NEF Deferral List is provided to identify items eligible for deferral under Brazos Valley Air Charter, LLC NEF program. The list is located in Brazos Valley Air Charter, LLC NEF Manual.
5. For items being considered for deferral under Brazos Valley Air Charter, LLC NEF Program, but not yet added to the NEF Deferral List, a standardized method to determine eligibility is provided in the NEF Checklist section below.

Overall NEF Deferral Program Responsibility

1. The Director of Maintenance has overall responsibility for Brazos Valley Air Charter, LLC NEF Program.
 - A. The Director of Maintenance:
 - 1) Must have a thorough understanding of FAA Order 8900.1, Flight Standards Information Management System (FSIMS), Volume 4, Chapter 4, Section 4, Non-Essential Equipment and Furnishings (NEF) Program.
 - 2) Is responsible for activities related to creation and revision of Brazos Valley Air Charter, LLC NEF Program.
 - 3) Has final authority to add items or make changes to Brazos Valley Air Charter, LLC NEF Program.
 - 4) Is responsible for the quality and performance of the NEF Program, including reporting requirements (see NEF Checklist Reporting below).

NEF Definition:

1. Non-essential equipment and furnishings (NEF) are those items installed on the aircraft as part of the original certification, supplemental type certificate (STC), or engineering order that have no effect on the safe operation of flight and would not be required by the applicable certification rules (14 CFR Part 25) or operational rules (14 CFR Parts 91 and 135).
2. NEF items are those items that if inoperative, damaged or missing have no effect on the aircraft's ability to be operated safely under all operational conditions.
3. NEF items may be installed in areas including, but not limited to the flight deck, passenger cabin, crew rest area, galley, lavatory, cargo bin and maintenance service areas.
4. NEF does NOT include items already identified in any other MEL or CDL item.
5. NEF does NOT include items that are functionally required to meet the certification rule (14 CFR Part 25) or for compliance with any operational rule (14 CFR Part 91 and 135).

NEF

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-6

6. The NEF process does not provide for deferral of items within serviceable limits identified in the manufacturer's maintenance manual or Brazos Valley Air Charter, LLC maintenance program, such as wear limits, fuel/hydraulic leak rates, oil consumption, etc.

Evaluating NEF Items

1. Items being considered for inclusion in the NEF program, or items undergoing revision, must be evaluated to ensure the item meets criteria set by FAA NEF Guidance (ref. NEF Definition above).
 - A. Director of Maintenance or his designee will evaluate NEF items.
 - B. Director of Maintenance or his designee will coordinate with maintenance and flight operations department for the item under consideration.
 - C. Approval from Director of Maintenance must be obtained before any new or revised NEF item is added to the NEF Deferral List.
2. Before being deemed eligible for inclusion in the NEF program, item(s) will be evaluated by the Director of Maintenance or his designee to determine:
 - A. 14 CFR Requirements.
 - 1) Item must not be functionally required to meet certification rules (14 CFR Part 23 or 25, as applicable) or for compliance with operational rules (14 CFR Part 135).
 - B. Serviceability of the item.
 - 1) The system and/or component in question may be inoperative, damaged or missing. Cosmetic items that are fully serviceable but worn may be deferred under an operators NEF process
 - C. Eligibility for deferral.
 - 1) An MEL or CDL item must not exist for the inoperative, damaged or missing item.
 - 2) If the item under consideration is a subcomponent of a primary system identified in an MEL or CDL item, where no relief is authorized by the MMEL or AFM Appendix CDL, the subcomponent is not eligible for deferral under the NEF Program.
 - 3) Items within serviceable limits identified in the manufacturer's maintenance manual or Brazos Valley Air Charter, LLC maintenance program, such as wear limits, fuel/hydraulic leak rates, oil consumption, etc. may not be deferred under the NEF Program.
 - D. Safety impact. The inoperative, damaged or missing item must not:
 - 1) Have an adverse effect, or potential adverse effect, on the safe conduct of flight.
 - 2) Adversely affect or jeopardize the safety of flight crew, flight attendants, passengers or service personnel.
 - 3) Create the potential for fire/smoke or other hazardous condition.
 - 4) Be required emergency equipment or be needed to accomplish emergency or irregular procedures.
 - E. Relation of failure to other systems.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-7

- 1) The inoperative, damaged or missing item must not have an adverse affect on other required systems or components.

F. Affect on crew workload.

- 1) The inoperative, damaged or missing item must not create additional workload for the flight crew or flight attendants at critical times of flight or flight preparation.

G. Additional procedures (M & O).

- 1) Maintenance, Flight Crew or Ramp Services procedures may be required depending on the deferred item and the impact it may have on the safe operation of the airplane.
- 2) Electrically operated NEF items are prime candidates for maintenance deactivation procedures. Anticipated failure modes and the underlying source of the failure must be considered when determining the need for deactivation procedures.
- 3) Procedures to remove or secure the NEF item must be developed if it may adversely affect or jeopardize the safety of flight crew, flight attendants, maintenance or service personnel.
- 4) Certain cockpit items may require procedures to ensure the deferred NEF item will have no adverse effect on the safe conduct of the intended flight.
- 5) For inoperative galley or lavatory NEF items, procedures may be necessary in order to minimize operational impact or customer service.
- 6) Procedures may be required to provide alternate methods for accomplishing routine tasks (maintenance, flight attendants, ramp services personnel).
- 7) The Director of Maintenance or his designee will coordinate with maintenance and flight operations department to ensure procedures appropriate for the deferred item are developed.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-8

NEF Checklist (for items NOT on NEF Deferral List)

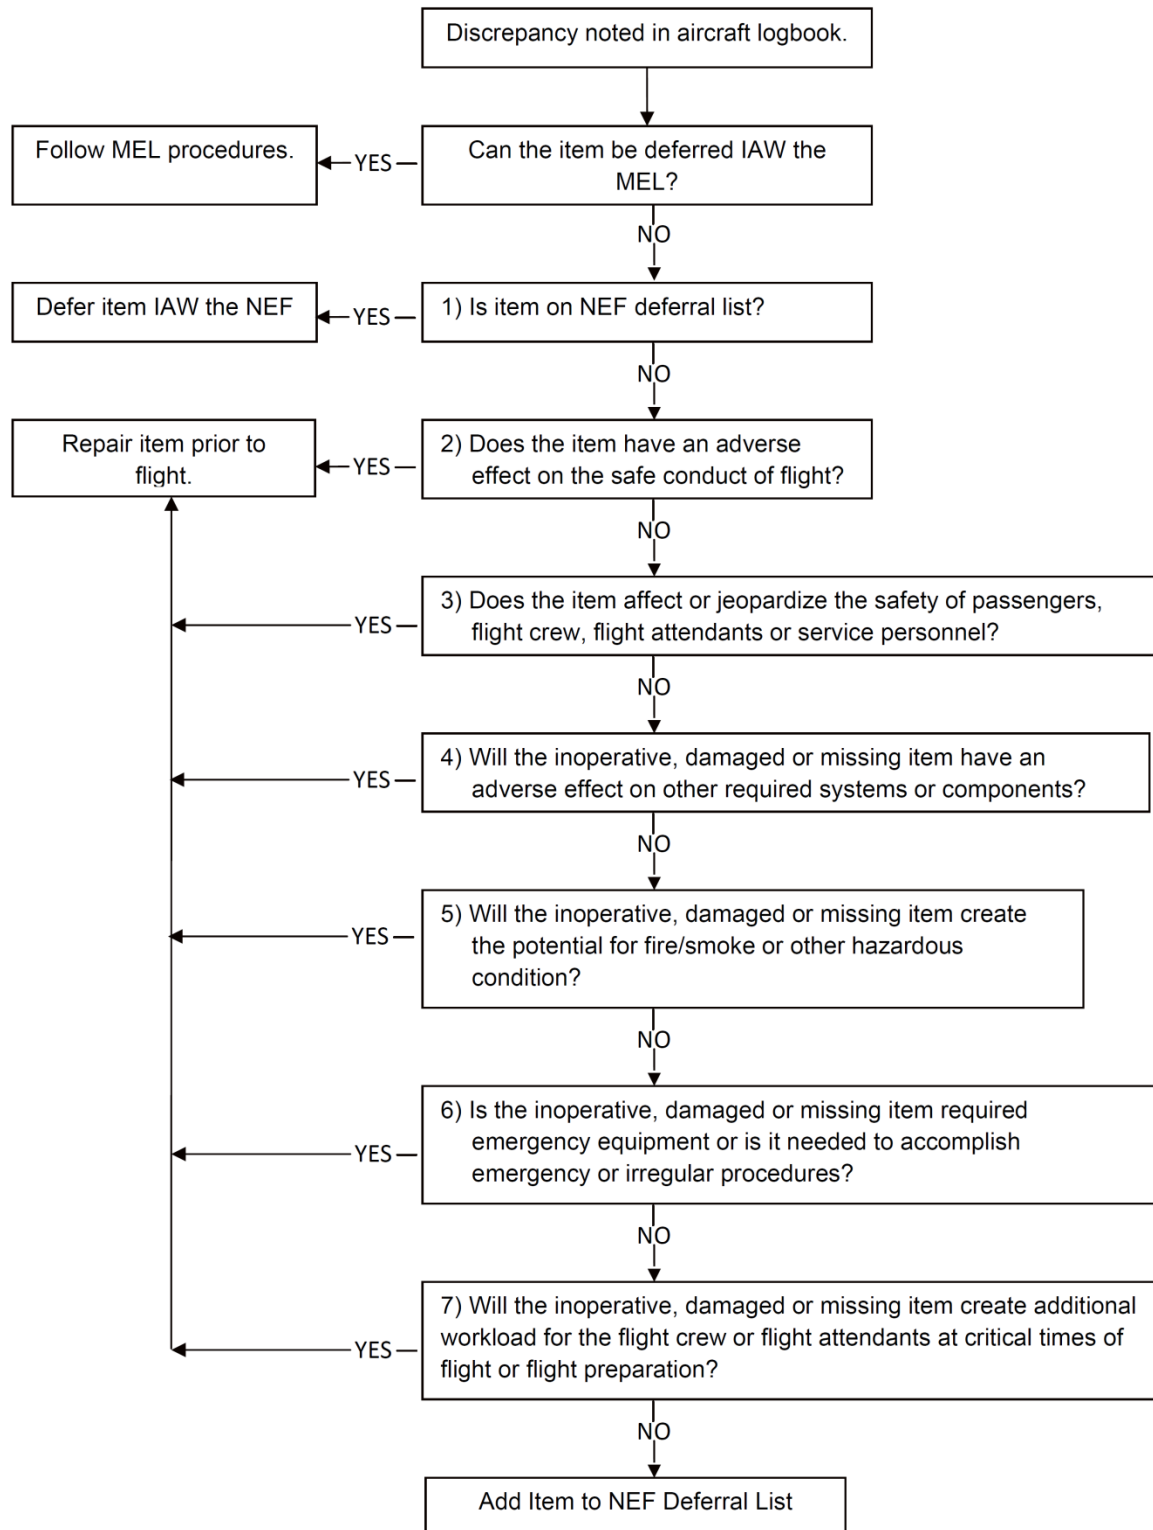
1. The NEF Checklist below provides a standardized method to determine eligibility to defer items that are NOT yet included on the NEF Deferral List.
2. The NEF Checklist includes an evaluative process that ensures flight safety and compliance with NEF Program requirements. Refer to Evaluating NEF Items above for additional details of this process.
3. Run the Checklist below for each item being considered for deferral under NEF (only if not already on the NEF Deferral List).

CHECKLIST

- A. Review NEF Definition above.
- B. Evaluate item being considered for deferral under NEF using the Flow Chart on the following page.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program		
	Revision No: Original	Date: 09-11-18	Page N-9

Adding Items to the NEF List Flow Chart



NEF

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-10

C. After completing evaluation, maintenance personnel will:

- 1) Obtain approval to defer item from the Director of Maintenance, or Acting Supervisor on duty utilizing the NEF Checklist Usage Report.
- 2) Deactivate affected item as required. Record action taken in log book.
 - a. For NEF items that are powered or receive electrical power, and if the reported discrepancy could adversely affect airworthiness of the airplane and/or the safety of flight crew, flight attendants or service personnel, the source of the failure must be identified and isolated to alleviate any safety concern (e.g. pull and safety circuit breakers, disconnect and cap electrical connectors, etc.).

NOTE: Maintenance personnel must exercise sound judgment in deciding whether or not the reported discrepancy adversely affects the airworthiness of the airplane and/or the safety of flight crew, flight attendants or service personnel.
- 3) Secure affected item as required. Record action taken in log book.
 - a. For mechanical-type NEF items, secure or remove the item as required to ensure no hazards are present that could adversely affect the airworthiness of the airplane and/or the safety of flight crew, flight attendants or service personnel.

NOTE: Maintenance personnel must exercise sound judgment in deciding whether or not the affected item must be secured. The dispatch configuration must not adversely affect the airworthiness of the airplane and/or the safety of flight crew, flight attendants or service personnel.
- 4) Coordinate with flight crew to ensure the deferred item will have no adverse effect on the safe conduct of the intended flight.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-11

NEF Checklist Reporting

1. Items deferred using the NEF Checklist must be reported to the FAA (local FSDO):
 - A. Director of Maintenance or his designee will query deferral records monthly to determine NEF Checklist usage.
 - B. Director of Maintenance or his designee will compile the results of the query and submit a report electronically to Brazos Valley Air Charter, LLC Principal Maintenance Inspector (PMI) by the 15th of each month.
 - C. NEF Checklist usage reports (by fleet type) include:
 - 1) Airplane identification number (tail and/or serial number).
 - 2) Date and location of deferral
 - 3) Deferral number.
 - 4) Text of reported defect.
 - 5) Director of Maintenance or his designee.
2. Items deferred using the NEF Checklist will be added to the NEF Deferral List unless Brazos Valley Air Charter, LLC PMI notifies Director of Maintenance or his designee that a specific item has been rejected and is not eligible for deferral under the NEF Program.
 - A. The NEF Deferral List may not be revised sooner than 30 days after NEF Checklist is used.
3. For any NEF Checklist deferral rejected by Brazos Valley Air Charter, LLC Principal Maintenance Inspector (PMI):
 - A. Director of Maintenance or his designee will discuss rejection with the PMI as necessary to reach final determination that rejection is valid.
 - B. Immediately upon receipt of notification of valid rejected item by the PMI, Director of Maintenance or his designee will determine if the rejected item has been repaired or is still an open deferred item.
 - C. Director of Maintenance or his designee will provide written notification of the rejected item and its deferral status to the Director of Maintenance or his designee.
 - 1) If the rejected item has yet to be repaired (open deferral), Director of Maintenance or his designee will coordinate with appropriate organizations to ensure repairs are made within 24 hours after receiving notice from the Director of Maintenance or his designee.
 - D. To prevent reoccurrence:
 - 1) Director of Maintenance or his designee will discontinue authorizing NEF Checklist deferral of the rejected item.
 - 2) Director of Maintenance or his designee will instruct maintenance personnel to discontinue deferral NEF Checklist of the rejected item.
 - E. To measure overall performance of the NEF Checklist portion of the NEF program, the Director of Maintenance or his designee will track the number of times the Checklist is used vs. the number of FAA rejections.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-12

- 1) Rejection rate will be calculated and updated monthly.
- 2) All rejections will be analyzed to determine root cause.
- 3) Corrective action will be developed and implemented as required.

NEF Item Repair Requirements:

NEF items will be scheduled for repair and tracked in the same manner as any other MEL deferral.

- A. Items deferred using the NEF Checklist must be repaired within 30 calendar days after the discrepancy is reported, not counting the day of discovery.
- B. All other NEF items must be repaired prior to next Maintenance Inspection.
- C. Deferred NEF items should be repaired within the specified time limit when parts, manpower, equipment and sufficient airplane downtime are available. Due consideration should be given to operational impact and customer service when scheduling repairs.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-13

NEF Deferral List

- ⇒ **The items listed below may be inoperative, damaged or missing.**
- ⇒ **Place MEL Placard in a Prominent Location Visible by the Flight Crew**
- ⇒ **For all listed NEF items, the condition of the deferred item must be such that no hazard to flight crews, flight attendants, passengers, maintenance technicians or service personnel is present.**
- ⇒ **If the item under consideration for deferral is not on the list below, refer to NEF Checklist section for instructions.**

Item #	Item Name	(M)(O) Procedures
FLIGHT DECK ITEMS (100)		
N100-1	Ashtrays	(M) None. (O) None.
N100-2	Carpet	May be worn, torn, frayed or stained as long as the item is otherwise serviceable. (M) None. (O) None.
N100-3	Coat and / or Hat Hooks	(M) None. (O) None.
N100-4	Cup Holders	(M) None. (O) None.
N100-5	Curtains	(M) None. (O) None.
N100-6	Cushions	May be worn, torn, frayed or stained as long as the item is otherwise serviceable. (M) None. (O) None.
N100-7	Decorative Trim / Trim Strips	(M) None. (O) None.
N100-8	Electrical Outlet	(M) Pull and secure circuit breaker(s) as required. (O) None.
N100-9	Electrical Outlet Covers	(M) None. (O) None.
N100-10	Seat Belt Tidy Clips	(M) None. (O) None.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-14

Item #	Item Name	(M)(O) Procedures
N100-11	Logbook Holder	(M) None. (O) None.
N100-12	Spare Bulb Kit and Contents	(M) None. (O) None.
N100-13	Spring Clips	(M) None. (O) None.
N100-14	Sunshades	(M) None. (O) None.
N100-15	Trim	(M) None. (O) None.
N100-16	Upholstery	May be worn, torn, frayed or stained as long as the item is otherwise serviceable. (M) None. (O) None.
N100-17	Windshield / Side Window Heat Contact Covers	(M) Cover the contacts in a way to eliminate electrical shock. (O) None.
N100-18	Yoke Clips	(M) None. (O) None.
CABIN ITEMS (200)		
N200-1	Acoustic Doors / Curtains	(M) None. (O) None.
N200-2	Appearance Items	(M) None. (O) None.
N200-3	Ash Trays (Except Exterior Lavatory Door)	(M) None. (O) None.
N200-4	Braille Book	(M) None. (O) None.
N200-5	Cabin Divider Panels	(M) None. (O) None.
N200-6	Cabin Mirrors	(M) None. (O) None.
N200-7	Cabin Step Stool	(M) None. (O) None.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-15

Item #	Item Name	(M)(O) Procedures
N200-8	Cushions / Upholstery / Carpet	(M) None. (O) None.
N200-9	Decorative Trim / Trim Strips	(M) None. (O) None.
N200-10	Doors (Compartment/Storage)	(M) None. (O) Ensure the associated storage compartment is emptied and secured in the closed position.
N200-11	Drawer Locks	(M) None. (O) Ensure the associated drawer is emptied and secured in the closed position.
N200-12	Electrical Outlet	(M) Pull and secure circuit breaker(s) as required. (O) None.
N200-13	Electrical Outlet Covers	(M) None. (O) None.
N200-14	Emergency Aisle Light Covers	(M) Verify the associated light operates normally. (O) Ensure item does not present hazard to passengers or crew or impede emergency egress.
N200-15	Gasper Outlets (Passenger)	(M) None. (O) None.
N200-16	Headphones / Headphone Outlets	(M) None. (O) None.
N200-17	Magazine Rack / Restraint	(M) None. (O) None.
N200-18	Main Door Acoustic Cover	(M) None. (O) None.
N200-19	Miscellaneous Cabin Forms	(M) None. (O) None.
N200-20	Passenger Reading Light	(M) None. (O) None.
N200-21	Passenger Seat Tray Table Assembly (& Latch)	(M) Stow or remove from aircraft. (O) None.
N200-22	Passenger Seat Trim	(M) None. (O) None.
N200-23	Placards (Required by FAR)	(M) May be degraded but must be legible. (O) None.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-16

Item #	Item Name	(M)(O) Procedures
N200-24	Placards (Not Required by FAR)	(M) None. (O) None.
N200-25	Seat Belt Extensions	(M) None. (O) None.
N200-26	Seat Track Covers	(M) None. (O) None.
N200-27	Seatback / Bulkhead / Sidewall Literature Pockets	(M) None. (O) None.
N200-28	Tables (Console)	(M) None. (O) Ensure the table is stored during takeoff and landing.
GALLEY ITEMS (300)		
N300-1	Catering Containers	(M) None. (O) None.
N300-2	Chillers	(M) Pull and secure circuit breaker(s) as required. (O) Advise passengers equipment is inoperative.
N300-3	Coat Hanger Clips	(M) None. (O) None.
N300-4	Coffee / Tea / Brewing Pots	(M) None. (O) None.
N300-5	Electrical Outlet	(M) Pull and secure circuit breaker(s) as required. (O) None.
N300-6	Electrical Outlet Covers	(M) None. (O) None.
N300-7	Galley Heating and Controls	(M) None. (O) None.
N300-8	Hot Cup and Controls	(M) Pull and secure circuit breaker(s) as required. (O) Advise passengers equipment is inoperative.
N300-9	Hot Water Dispenser	(M) Pull and secure circuit breaker(s) as required. (O) Advise passengers equipment is inoperative.
N300-10	Ice Container	(M) None. (O) None.
N300-11	Mirrors	(M) None. (O) None.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-17

Item #	Item Name	(M)(O) Procedures
N300-12	Paper Clips	(M) None. (O) None.
N300-13	Plate Warmers	(M) Pull and secure circuit breaker(s) as required. (O) Advise passengers equipment is inoperative.
N300-14	Pots, Pans, Utensils	(M) None. (O) None.
N300-15	Refrigeration System	(M) Pull and secure circuit breaker(s) as required. (O) Advise passengers equipment is inoperative.
N300-16	Thermos Units	(M) None. (O) None.
N300-17	Waste Containers	(M) None. (O) None.
N300-18	Work Lights	(M) None. (O) None.
N300-19	Work Tables	(M) Stow or remove from aircraft. (O) None.
LAVATORIES, CLOSETS, VESTIBULE AND CREW REST AREAS (400)		
Lavatories		
N400-1	Air Grill Covers	(M) None. (O) None.
N400-2	Assist Handles	(M) None. (O) None.
N400-3	Bio Hazard Disposal Container	(M) None. (O) None.
N400-4	Coat Hook	(M) None. (O) None.
N400-5	Coat Rods / Hangers	(M) None. (O) None.
N400-6	Cup Holder	(M) None. (O) None.
N400-7	Deodorizer Holder	(M) None. (O) None.
N400-8	Electrical Outlet	(M) Pull and secure circuit breaker(s) as required. (O) None.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-18

Item #	Item Name	(M)(O) Procedures
N400-9	Electrical Outlet Covers	(M) None. (O) None.
N400-10	Interior Wall Trim / Coverings	(M) None. (O) None.
N400-11	Lavatory Door Latch	(M) None. (O) Set latch to closed position for takeoff, approach, landing and flight into turbulence.
N400-12	Lavatory Seat Cover Holder	(M) None. (O) None.
N400-13	Mirror Lights	(M) None. (O) None.
N400-14	Paper Towels / Holder	(M) None. (O) None.
N400-15	Privacy Stop on Lavatory Door	(M) None. (O) None.
N400-16	Tissue Dispenser	(M) None. (O) None.
N400-17	Toilet Paper / Roller	(M) None. (O) None.
N400-18	Toilet Seat Lid	(M) None. (O) None.
N400-19	Towel Rods / Towels	(M) None. (O) None.
N400-20	Upholstery	May be worn, torn, frayed or stained as long as the item is otherwise serviceable. (M) None. (O) None.
BAGGAGE COMPARTMENT (500)		
N500-1	Carpet	(M) None. (O) None.
N500-2	Closet Doors/Curtains	(M) None. (O) None.
N500-3	Coat Hangers	(M) None. (O) None.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-19

Item #	Item Name	(M)(O) Procedures
N500-4	Coat Rods	(M) None. (O) None.
N500-5	Decorative Trim / Trim Strips	(M) None. (O) None.
N500-6	Exterior Door Protective Mat	(M) None. (O) None.
N500-7	Exterior Door Cable	(M) None. (O) Ensure the baggage door is secured in the closed position.
N500-8	Interior Wall Trim / Coverings	(M) None. (O) None.
N500-9	Lights / Lighting System	(M) None. (O) None.
N500-10	Manual Storage Compartments	(M) None. (O) None.
N500-11	Umbrellas	(M) None. (O) None.
SERVICE BAY AREAS (600)		
N600-1	Compartment lighting lenses	(M) None. (O) None.
N600-2	Compartment lighting switches	(M) None. (O) None.
N600-3	Dust cover cap chains or lanyards	(M) None. (O) None.
N600-4	Dust cover caps for service ports	(M) None. (O) None.
N600-5	Hold open rods or lanyards	(M) None. (O) None.
N600-6	Water quantity indication	(M) None. (O) None.

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-20

Additional Items Added Upon Completion of NEF Check List (Initial And Date Each Item)		
N900-1		
N900-2		
N900-3		
N900-4		
N900-5		
N900-6		
N900-7		
N900-8		

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-21

NEF Index

BAGGAGE COMPARTMENT

Carpet	N-18
Closet Doors/Curtains.....	N-18
Coat Rods	N-19
Decorative Trim / Trim Strips	N-19
Exterior Door Cable	N-19
Exterior Door Protective Mat	N-19
Interior Wall Trim / Coverings	N-19
Lights / Lighting System.....	N-19
Manual Storage Compartments.....	N-19
Umbrellas.....	N-19

CABIN ITEMS

Acoustic Doors / Curtains	N-14
Appearance Items.....	N-14
Ash Trays (Except Exterior Lavatory Door).....	N-14
Braille Book.....	N-14
Cabin Divider Panels	N-14
Cabin Mirrors	N-14
Cabin Step Stool.....	N-14
Cushions / Upholstery / Carpet.....	N-15
Decorative Trim / Trim Strips	N-15
Doors (Compartment/Storage	N-15
Drawer Locks	N-15
Electrical Outlet.....	N-15
Electrical Outlet Covers	N-15
Emergency Aisle Light Covers	N-15
Gasper Outlets (Passenger).....	N-15
Headphones / Headphone Outlets	N-15
Magazine Rack / Restraint.....	N-15
Main Door Acoustic Cover	N-15
Miscellaneous Cabin Forms	N-15
Passenger Reading Ligh	N-15
Passenger Seat Tray Table Assembly	N-15
Passenger Seat Trim	N-15
Placards (Not Required by FAR).....	N-16
Placards (Required by FAR).....	N-15
Seat Belt Extensions.....	N-16
Seat Track Covers	N-16

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-22

Seatback / Bulkhead / Sidewall Literature Pockets	N-16
Tables (Console)	N-16

FLIGHT DECK ITEMS

Ashtrays	N-13
Carpet	N-13
Coat and / or Hat Hooks	N-13
Cup Holders	N-13
Curtains	N-13
Cushions	N-13
Decorative Trim / Trim Strips	N-13
Electrical Outlet	N-13
Electrical Outlet Covers	N-13
Logbook Holde	N-14
Seat Belt Tidy Clips	N-13
Spare Bulb Kit and Contents	N-14
Spring Clips	N-14
Sunshades	N-14
Trim	N-14
Upholstery	N-14
Windshield / Side Window Heat Contact Covers	N-14
Yoke Clips	N-14

GALLEY ITEMS

Catering Containers	N-16
Chillers	N-16
Coat Hanger Clips	N-16
Coffee / Tea / Brewing Pots	N-16
Electrical Outlet	N-16
Electrical Outlet Covers	N-16
Galley Heating and Controls	N-16
Hot Cup and Controls	N-16
Hot Water Dispenser	N-16
Ice Container	N-16
Mirrors	N-16
Paper Clips	N-17
Plate Warmers	N-17
Pots, Pans, Utensils	N-17
Refrigeration System	N-17
Thermos Units	N-17
Waste Containers	N-17
Work Lights	N-17

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-23

Work Tables..... N-17

LAVATORIES, CLOSETS, VESTIBULE AND CREW REST AREAS

Air Grill Covers.....	N-17
Assist Handles	N-17
Bio Hazard Disposal Container	N-17
Coat Hook.....	N-17
Coat Rods / Hangers	N-17
Cup Holder.....	N-17
Deodorizer Holder.....	N-17
Electrical Outlet.....	N-17
Electrical Outlet Covers	N-18
Interior Wall Trim / Coverings	N-18
Lavatory Door Latch	N-18
Lavatory Seat Cover Holder	N-18
Mirror Lights.....	N-18
Paper Towels / Holder	N-18
Privacy Stop on Lavatory Door.....	N-18
Tissue Dispenser	N-18
Toilet Paper / Roller	N-18
Toilet Seat Lid.....	N-18
Towel Rods / Towels	N-18
Upholstery.....	N-18

SERVICE BAY AREAS

Compartment lighting lenses	N-19
Compartment lighting switches.....	N-19
Dust cover cap chains or lanyards	N-19
Dust cover caps for service ports	N-19
Hold open rods or lanyards.....	N-19
Water quantity indication	N-19

Brazos Valley Air Charter, LLC	Non-Essential Equipment and Furnishings (NEF) Program
	Revision No: Original Date: 09-11-18 Page N-24

Intentionally Left Blank