File Export using Command Prompt


Windows DOS command prompt exports desired KPI and messages as separate files.

- Favorite List should be pre-created from XCAP using the messages you want to export before using this function.
- For details, refer to *Chapter 4_Usage of Favorite Info.pdf.*

How to Use


1. Execute the command prompt.

   In window explorer, go to XCAP program folder. Right-click in the program folder while pressing Shift key on keyboard, and select [Open Command Window Here].

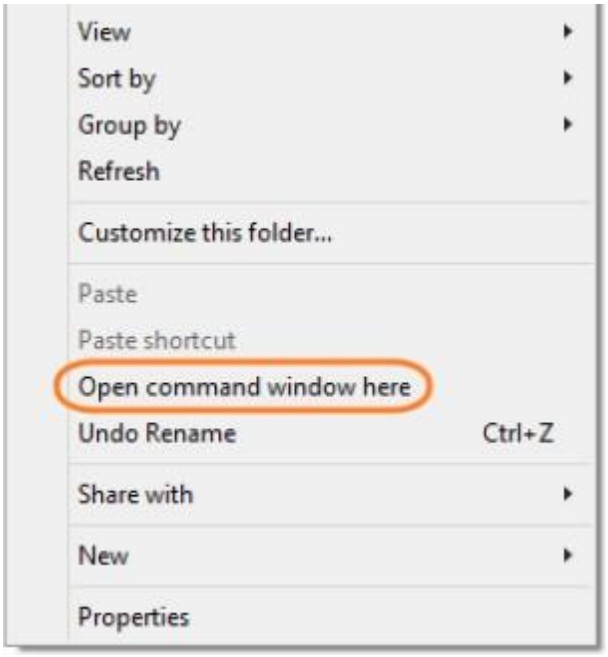

   - For details of how to execute the command prompt per Window OS version, see the following link: https://www.lifewire.com/how-to-open-command-prompt-2618089.

2. Windows DOS command prompt window appears.

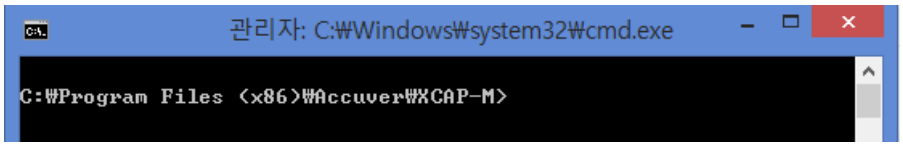

© Copyright by Accuver Co., Ltd.

3. Input desired DOS command. You can create a model and export desired messages in desired directory.

   ✓ Example of Exporting Signaling Message

   "XCAP-M.exe" -CM "**logging file folder path**" "**output path**" -MEP MBS "**fav file path**+**File name.mes**" L3

   ✓ Example of Exporting Favorite List

   "XCAP-M.exe" -CM "**logging file folder path**" "**output path**" -FEP "**fav file path**+**File name.fav**" -MG

   ✓ Example of Exporting User Defined Report

   "XCAP-M.exe" -CM "**logging file folder path**" "**output path**" -MG -UDREP "**UDR File name1; UDR file name2**"

   ✓ Example of Exporting Multiple Functions

   "XCAP-M.exe" -CM "**logging file folder path**" "**output path**" -FEP "**fav file path**+**File name1.fav**; **fav file path**+**File name2.fav**"

   ✓ Example of Exporting Combination Functions

   "XCAP-M.exe" -CM "**logging file folder path**" "**output path**" -FEP "**fav file path**+**File name.fav**" –MG -UDREP "**UDR File name1; UDR file name2**"

   ✓ Example of Exporting Multiple Log Sets

   "XCAP-M.exe" -CM "**Log Set1**" "**output path**" -FEP "**fav file path**+**File name.fav**" –MG -UDREP "**UDR File name1; UDR file name2**" -CM "**Log Set2**" "**output path**" -FEP "**fav file path**+**File name.fav**" –MG -UDREP "**UDR File name1; UDR file name2**"

Function		Command	Prerequisite
Run	Run program	INI	
	Close program	FIN	
	Kill program	KX	
Model Creation	Create Model	CM	CM "logging file folder path" "Output file path"
	Merge/Separate	MG	Log File Merge, If it is not set, Separate

© Copyright by Accuver Co., Ltd.

Function			Command	Prerequisite
	Sampling Rate		All 10ms 100ms,200ms 500ms,1000ms, 2000ms, 3000ms, 4000ms,5000ms, 10000ms	Sampling Rate All, If it is not set, 1s
	Process as a file		PAF	If it is set, Process as a file option
	Open Model		MOP	MOP "Model file path"
	Delete Model		MDEL	
	Timezone Option		UTC	CM "logging file folder path" "Output file path" UTC
Batch Export	Favorite Export		FEP	FEP "Favorite List Path+ File name.fav" (NOTE2) Multiple Commands
	Logging Message Export		MEP	Message Viewer(All Msg), Same as the old commands of "MB"
	Logging Message Subordination Option (NOTE1)	Detail	D	
		Hex	H	
		Packet Message	PK	
		L3 Message	L3	
		Favorite Message	MBS	MEP MBS "Favorite List path+ file name.mes"
		Part of ueCapabilityInformation	PU	only file index 1 and 3 messages for ueCapabilityInformation

© Copyright by Accuver Co., Ltd.

		A brace format	BRC	MEP BRC
Function			**Command**	**Prerequisite**
	PostgreSQL Data DB		PGEP	Should be set the PostgreSQL database server in XCAP
	User Defined Report		UDREP	UDREP "UDR file name" (NOTE2) Multiple Commands

- NOTE1: Do not include hyphen (-) in the command for Logging Message.
- NOTE2: You can use separator (;) to set up multiple reports at once.

4. XCAP will be executed automatically, and it creates a model and exports csv file in the designated directory automatically. Then XCAP will be terminated automatically.

How to Use Old Command

- The old commands does not compatible with the new commands.

[Usage Example]

1. Execute DOS command prompt and input desired DOS command.

   "XCAP-M.exe" –EXPORT "drm folder path" "csv file path to be exported" "fav file path" –all

   - "-all" sets the sampling interval to "all"; without "-all" the sampling interval is "1sec"
   - DRM Folder: if there are multiple log files, they will be merged
   - CSV file path: use absolute path(c:\..) including file name
   - Fav file path: use absolute path(c:\..) including file name


   - The parameter "-all" is applied for XCAP version after 5.9.149. In older XCAP version, "-all" does not work.

2. XCAP will be executed automatically, and it creates a model and exports csv file in the

© Copyright by Accuver Co., Ltd.

designated directory automatically. Then XCAP will be terminated automatically.

© Copyright by Accuver Co., Ltd.

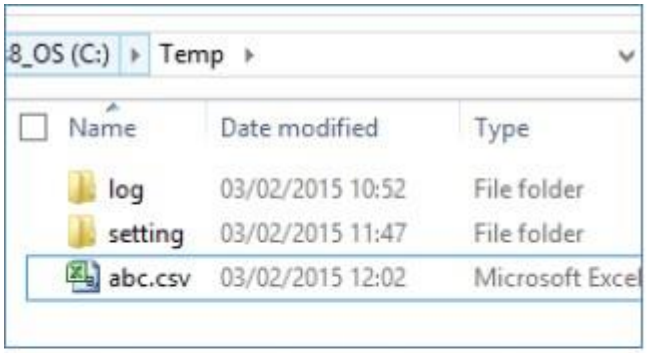

A	B	C	D	E	F
TIME_ST	LTE KPI Se	LTE KPI Se	LTE KPI Se	LTE KPI Se	LTE KPI SINF
21:20.0	184	Band 20	-71.86	-6.84	20.6
21:21.0	184	Band 20	-71.51	-6.89	21.25
21:26.0	184	Band 20	-57.53	-6.65	25.62
21:27.0	184	Band 20	-59.37	-6.06	23.42
21:28.0	184	Band 20	-57.95	-5.92	24.91
21:29.0	184	Band 20	-61.13	-6.92	24.27
21:30.0	184	Band 20	-62.81	-6.02	21
21:31.0	184	Band 20	-51.99	-6.17	27.1
21:32.0	184	Band 20	-55.63	-7.85	16.97
21:33.0	184	Band 20	-64.43	-11.16	9.48

DOS Commands for Exporting Favorite File

No.	Command	Example	Description	Basic option
1	-EXPORT	"XCAP-M.exe" –EXPORT "drm folder path" "csv file path to be exported" "fav file path"	Batch Export after Model Creation (Favorite)	Model Creation - Separate, output format - csv
2	-EXPORT	"XCAP-M.exe" –EXPORT "drm folder path" "csv file path+file name.csv" "fav file path"	Name of Output file can be edited while using DOS Prompt for exporting Favorite file. When there are multiple log files to process, output files are overwritten in order. To avoid this phenomenon, output file is created after merging log files.	Model Creation - Merge
3	-MB	"XCAP-M.exe" –EXPORT "Logging File Path" "Export Path" -MB	Model creation adding **–MB** in the end, Message viewer (All msg) is exported.	
4	-TXT	"XCAP-M.exe" –EXPORT "Logging File Path" "Export Path" -MB -TXT	Support Output Format - TXT	

© Copyright by Accuver Co., Ltd.

No.	Command	Example	Description	Basic option
5	-all	"XCAP-M.exe" –EXPORT "drm folder path" "csv file path to be exported" "fav file path" -all	Sampling interval - All, 1 sec all the times when Sampling Interval is not set.	
6	-L3 -D -H	"XCAP-M.exe" –EXPORT "Logging File Path" "Export Path" -MB -L3 -D -H	-L3: only for L3 // New -D: Detail Message //New (For the case when 'Include Detail Message' is cheched.) -H: Hex Data //New (For the case when 'Include Hexa Code' is checked)	
7	-MG	"XCAP-M.exe" –EXPORT **-mg** "drm folder path" "exported csv path" "fav file path"	In case when adding –mg for fav format, export after merging log files.	
8	-?	"OPTis Analyzer.exe" -?	Print out Help file.	
9	Wildcard character	"C₩temp₩log₩DR24*.drx": File name starting with DR24 and the file extension of drx only. "C₩temp₩log₩DR24*.scn": file name starting with DR24 and the file extension of scn only. "C₩temp₩log₩*Test.drx": file name ending with Test and the file extension of drx only. "C₩temp₩log₩DR24*Test.scn": file name starting with DR24 and the file extension of scn only. "C₩temp₩log₩DR2412508.drm": The particular file name (DR2412508) to process.	Support wildcard characters in file extension and name. (Utilizing when particular file extension to process.)	drm, drx, scn, scx, ISF/DLF

© Copyright by Accuver Co., Ltd.