

FORD TRANSIT CUSTOM LWB - 2 DOOR KITCHEN - CRX50 FRIDGE

MANUAL CUTTING PLANS - 18 mm PLYWOOD

Coordinate system

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Example: X100 / Y50 = 100 mm right from the left edge, then 50 mm up from the bottom.

Rules

- 18 mm plywood
- Dia 5 = 11 mm deep; nominal 4.8/5.2 mm source holes are shown as Dia 5
- Dia 15 = 14 mm deep
- Dia 20 = THROUGH
- Dia 35 = 13 mm deep
- Radius of a rounded slot/cut-out = half its narrow width unless separately shown
- Door cut-outs use R20 where shown in the supplied DXF
- 5 mm / 15 mm fixing holes may be omitted when using L-brackets or timber blocks.

8 mm cam-fitting edge holes

Where a 15 mm cam-lock hole is shown, drill an 8 mm hole centrally through the edge of the mating side panel.

Align the 8 mm edge hole with the centre of the 15 mm cam-lock bore.

Sheet structure

Sheet 1: 7 panels

Sheet 2: 8 panels

Sheet 3: 9 panels

Sheet 4: 7 panels

Total: 31 panels

Important

All measurements are taken directly from the supplied DXF.


Check critical appliance and vehicle dimensions before cutting.

P1 on each part is chosen at the profile point closest to local 0,0.

For curved profiles, radii are stated where the DXF geometry supports a simple radius.


Sheet 1 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages that follow.

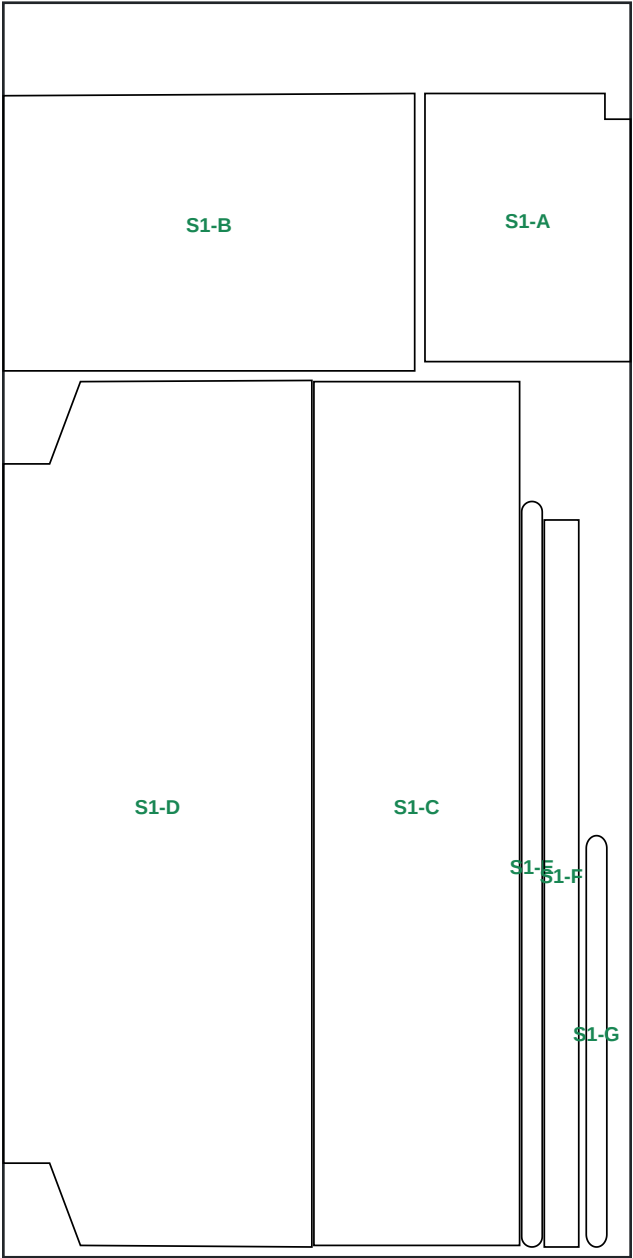

Sheet 2 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages that follow.

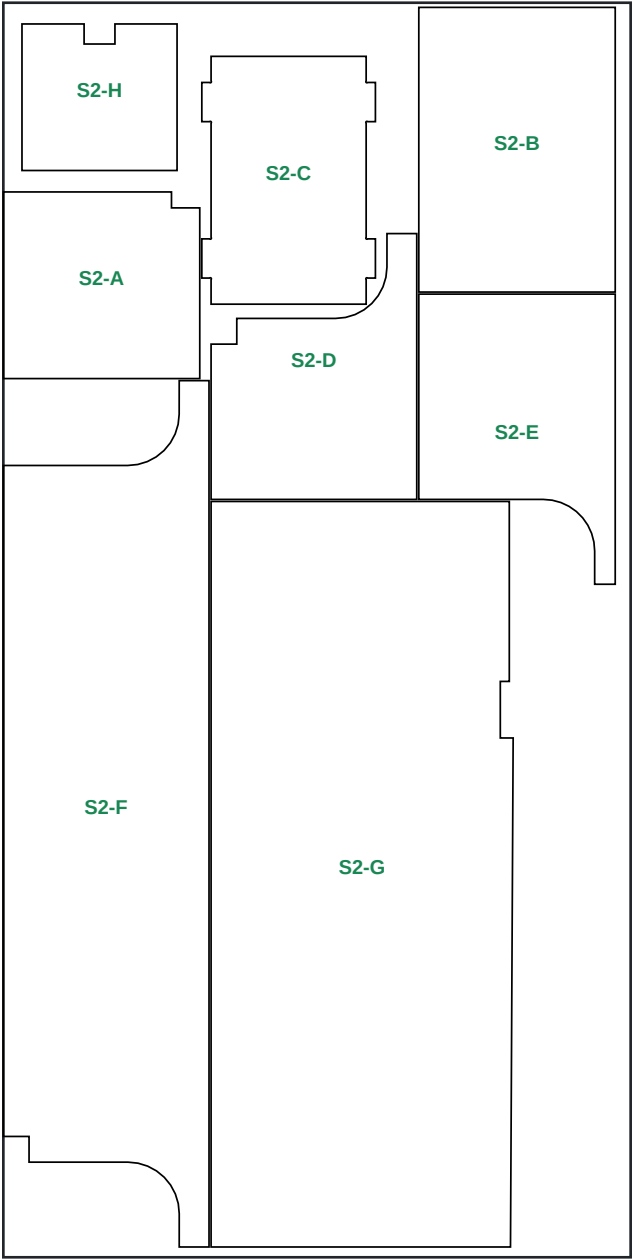


Sheet 3 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages that follow.




Sheet 4 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages that follow.

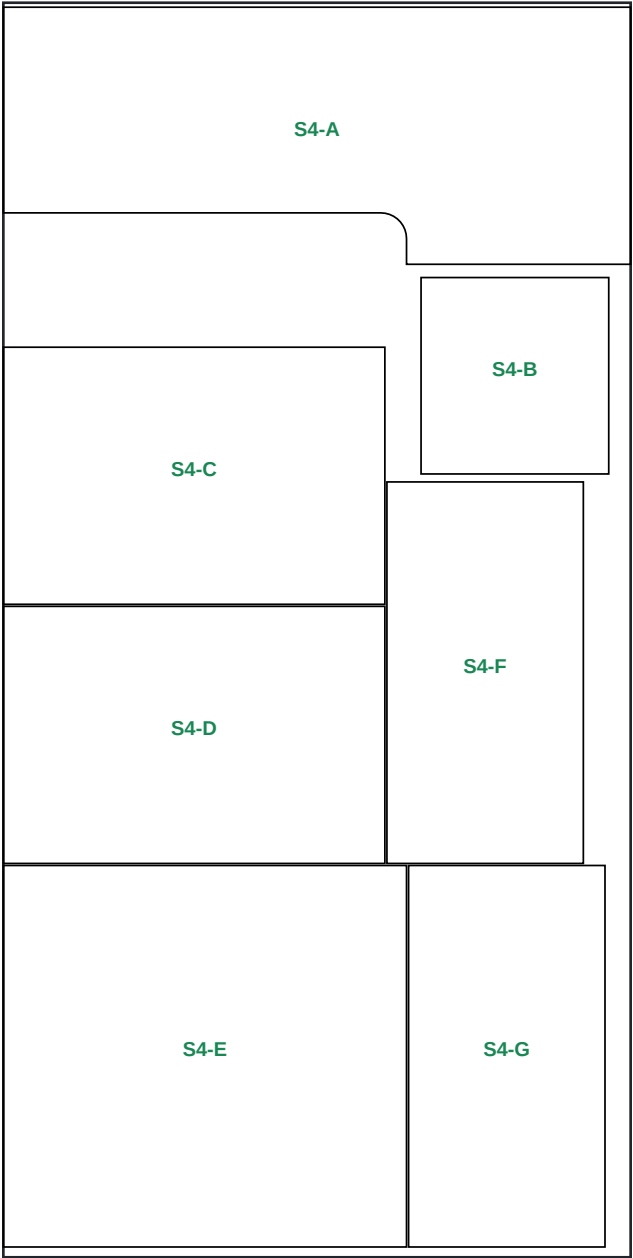

S1-A - Part detail

Overall 400.0 x 521.5 mm | 18 mm plywood | datum lower-left = X0 Y0

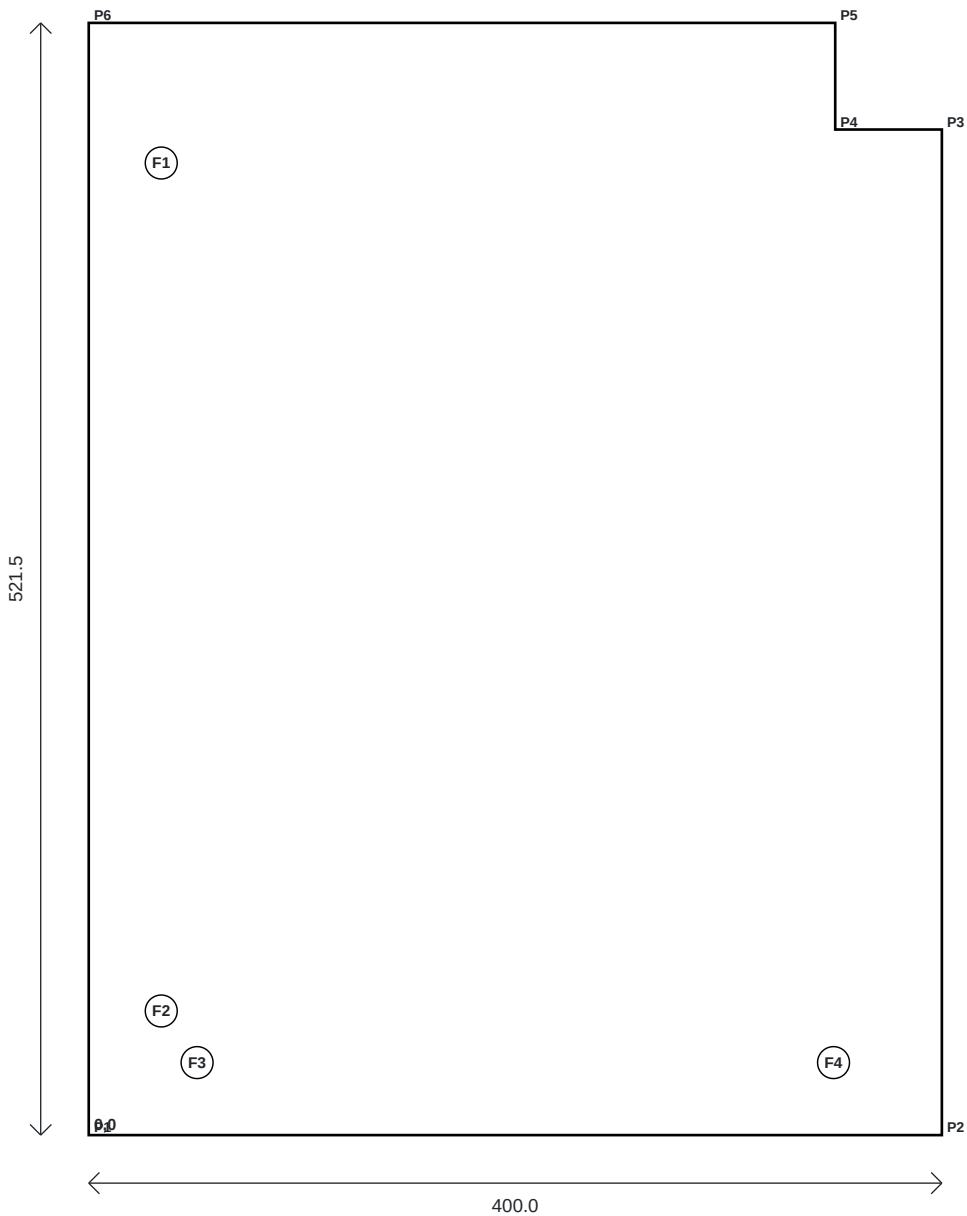

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 34.0 Y 455.8
- F2 Dia 15 x 14 deep X 34.0 Y 58.2
- F3 Dia 15 x 14 deep X 50.8 Y 34.0
- F4 Dia 15 x 14 deep X 349.2 Y 34.0

Outer profile cuts


P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X400.0 Y0.0 LINE
- P3 X400.0 Y471.5 LINE
- P4 X350.0 Y471.5 LINE
- P5 X350.0 Y521.5 LINE
- P6 X0.0 Y521.5 LINE

S1-B - Part detail

Overall 800.0 x 539.5 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

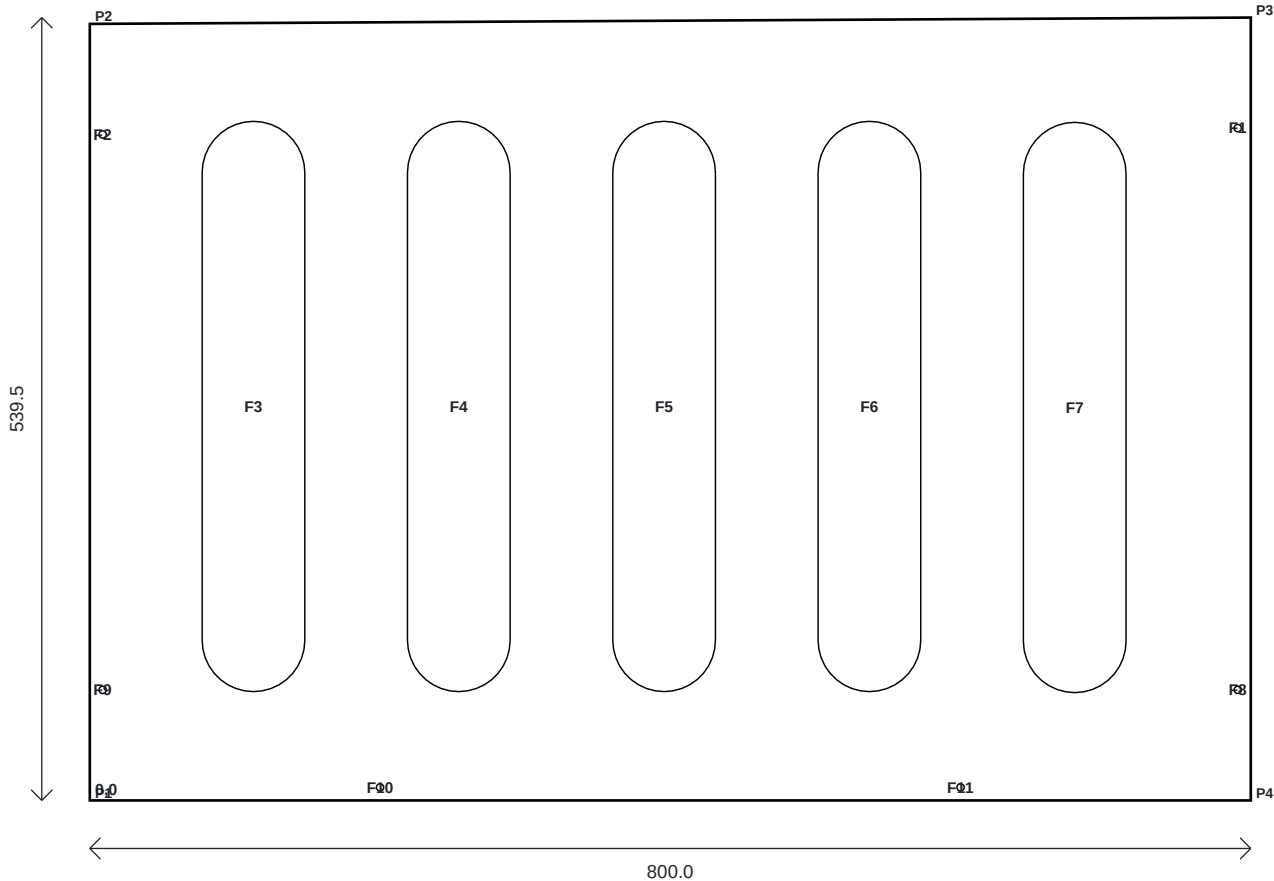

Machining features

- F1 Dia 5 x 11 deep X 791.0 Y 463.3
- F2 Dia 5 x 11 deep X 8.8 Y 458.9
- F3 slot 70.7 x 393.0, R35.4 X 112.8 Y 271.5
- F4 slot 70.7 x 393.0, R35.4 X 254.3 Y 271.5
- F5 slot 70.7 x 393.0, R35.4 X 395.7 Y 271.5
- F6 slot 70.7 x 393.0, R35.4 X 537.2 Y 271.5
- F7 slot 70.7 x 393.0, R35.4 X 678.7 Y 270.8
- F8 Dia 5 x 11 deep X 791.0 Y 76.2
- F9 Dia 5 x 11 deep X 8.8 Y 76.2
- F10 Dia 5 x 11 deep X 200.0 Y 9.0
- F11 Dia 5 x 11 deep X 600.0 Y 9.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X0.0 Y535.1 LINE
- P3 X800.0 Y539.5 LINE
- P4 X800.0 Y0.0 LINE

S1-C - Part detail

Overall 400.1 x 1680.0 mm | 18 mm plywood | datum lower-left = X0 Y0

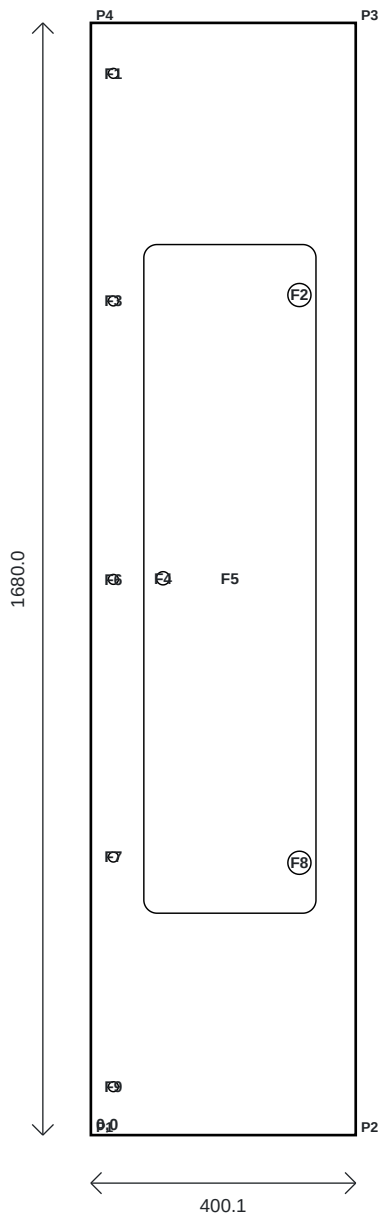

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 34.0 Y 1603.8
- F2 Dia 35 x 13 deep X 315.0 Y 1268.9
- F3 Dia 15 x 14 deep X 34.0 Y 1260.0
- F4 Dia 20 THROUGH X 109.0 Y 841.1
- F5 door cut-out 260.0 x 1010.0, R20.0 X 210.0 Y 840.2
- F6 Dia 15 x 14 deep X 34.0 Y 839.4
- F7 Dia 15 x 14 deep X 34.0 Y 420.0
- F8 Dia 35 x 13 deep X 315.0 Y 411.3
- F9 Dia 15 x 14 deep X 34.0 Y 73.1


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X400.0 Y0.0 LINE
- P3 X400.1 Y1680.0 LINE
- P4 X0.0 Y1680.0 LINE

S1-D - Part detail

Overall 600.0 x 1685.4 mm | 18 mm plywood | datum lower-left = X0 Y0

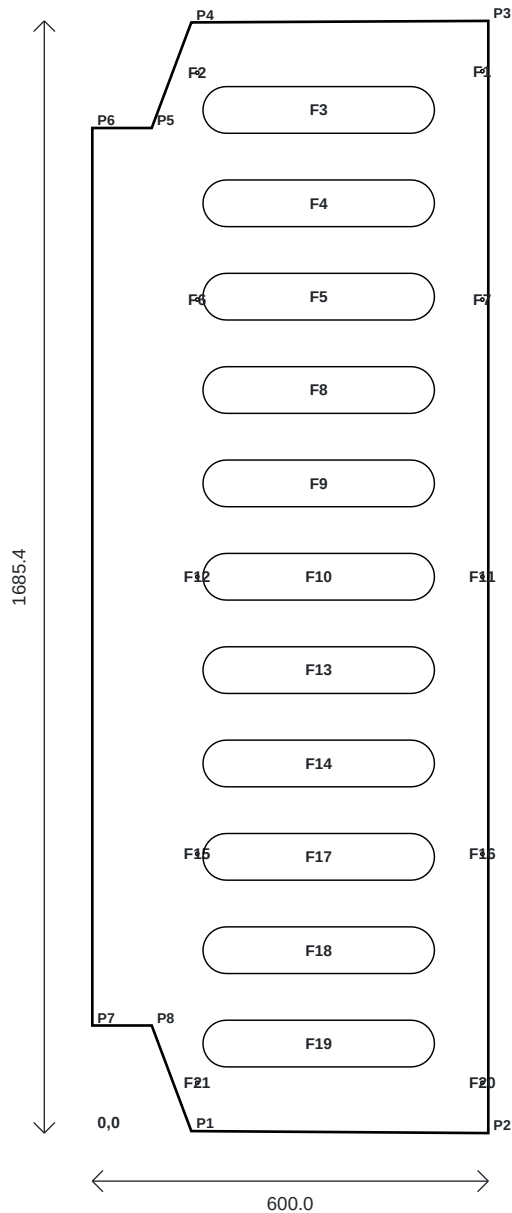

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 591.0 Y 1609.2
- F2 Dia 5 x 11 deep X 159.0 Y 1606.9
- F3 slot 350.7 x 70.7, R35.4 X 343.1 Y 1550.4
- F4 slot 350.7 x 70.7, R35.4 X 343.1 Y 1409.0
- F5 slot 350.7 x 70.7, R35.4 X 343.1 Y 1267.5
- F6 Dia 5 x 11 deep X 159.0 Y 1263.1
- F7 Dia 5 x 11 deep X 591.0 Y 1263.1
- F8 slot 350.7 x 70.7, R35.4 X 343.1 Y 1126.0
- F9 slot 350.7 x 70.7, R35.4 X 343.1 Y 984.5
- F10 slot 350.7 x 70.7, R35.4 X 343.1 Y 843.1
- F11 Dia 5 x 11 deep X 591.0 Y 843.1
- F12 Dia 5 x 11 deep X 159.0 Y 843.1
- F13 slot 350.7 x 70.7, R35.4 X 343.1 Y 701.6
- F14 slot 350.7 x 70.7, R35.4 X 343.1 Y 560.1
- F15 Dia 5 x 11 deep X 159.0 Y 423.1
- F16 Dia 5 x 11 deep X 591.0 Y 423.1
- F17 slot 350.7 x 70.7, R35.4 X 343.1 Y 418.6
- F18 slot 350.7 x 70.7, R35.4 X 343.1 Y 277.2
- F19 slot 350.7 x 70.7, R35.4 X 343.1 Y 135.7
- F20 Dia 5 x 11 deep X 591.0 Y 76.2
- F21 Dia 5 x 11 deep X 159.0 Y 76.2

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X150.0 Y3.1 LINE
- P2 X600.0 Y0.0 LINE
- P3 X600.0 Y1685.4 LINE
- P4 X150.0 Y1683.1 LINE
- P5 X90.0 Y1523.1 LINE
- P6 X0.0 Y1523.1 LINE
- P7 X0.0 Y163.1 LINE
- P8 X90.0 Y163.1 LINE

S1-E - Part detail

Overall 40.0 x 1450.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y20.0 ARC R20.0 CCW
- P2 X20.0 Y0.0 ARC R20.0 CCW
- P3 X40.0 Y20.0 LINE
- P4 X40.0 Y1430.0 ARC R20.0 CCW
- P5 X20.0 Y1450.0 ARC R20.0 CCW
- P6 X0.0 Y1430.0 LINE

S1-F - Part detail

Overall 67.0 x 1414.0 mm | 18 mm plywood | datum lower-left = X0 Y0

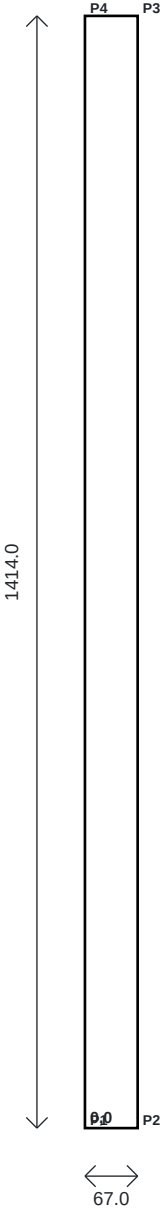

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features
- No internal cut features

Outer profile cuts
P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0	Y0.0	LINE
P2	X67.0	Y0.0	LINE
P3	X67.0	Y1414.0	LINE
P4	X0.0	Y1414.0	LINE

S1-G - Part detail

Overall 40.0 x 800.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y20.0 ARC R20 CCW
- P2 X20.0 Y0.0 ARC R20 CCW
- P3 X40.0 Y20.0 LINE
- P4 X40.0 Y780.0 ARC R20 CCW
- P5 X20.0 Y800.0 ARC R20 CCW
- P6 X0.0 Y780.0 LINE

S2-A - Part detail

Overall 382.0 x 363.0 mm | 18 mm plywood | datum lower-left = X0 Y0

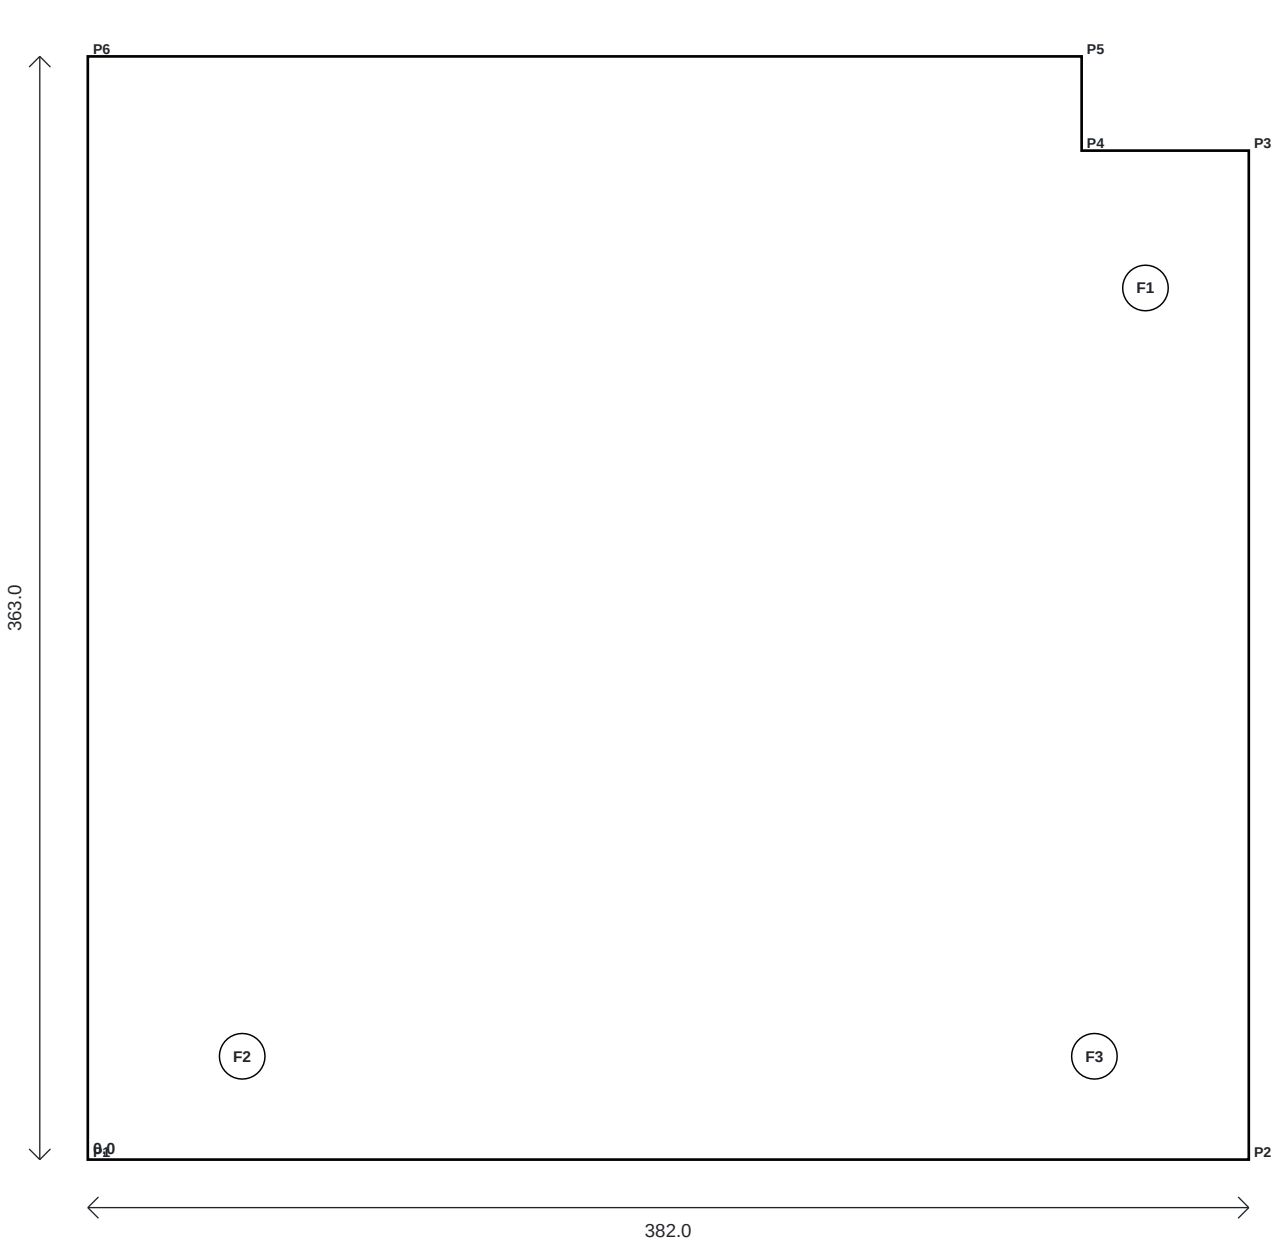

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 348.0 Y 286.8
F2 Dia 15 x 14 deep X 50.8 Y 34.0
F3 Dia 15 x 14 deep X 331.2 Y 34.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE
P2 X382.0 Y0.0 LINE
P3 X382.0 Y332.0 LINE
P4 X327.0 Y332.0 LINE
P5 X327.0 Y363.0 LINE
P6 X0.0 Y363.0 LINE

S2-B - Part detail

Overall 382.0 x 553.6 mm | 18 mm plywood | datum lower-left = X0 Y0

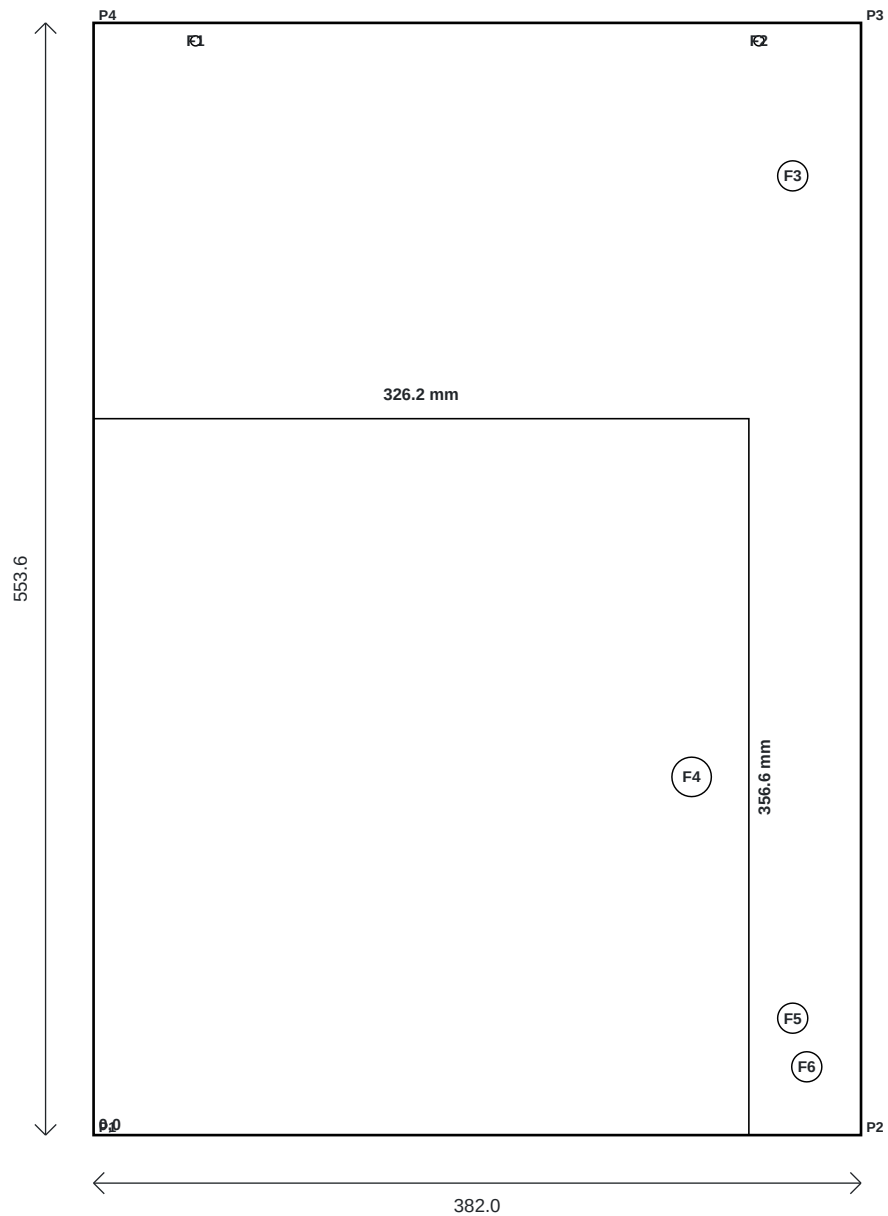

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 50.8 Y 544.7
- F2 Dia 5 x 11 deep X 331.2 Y 544.7
- F3 Dia 15 x 14 deep X 348.0 Y 477.5
- F4 Dia 20 THROUGH X 297.7 Y 178.3
- F5 Dia 15 x 14 deep X 348.0 Y 58.2
- F6 Dia 15 x 14 deep X 355.0 Y 34.0
- Open cut C1: X0.0 Y356.6 -> X326.2 Y356.6 -> X326.2 Y0.0
- Segment lengths: 326.2 mm / 356.6 mm


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X382.0 Y0.0 LINE
- P3 X382.0 Y553.6 LINE
- P4 X0.0 Y553.6 LINE

S2-C - Part detail

Overall 337.6 x 482.0 mm | 18 mm plywood | datum lower-left = X0 Y0

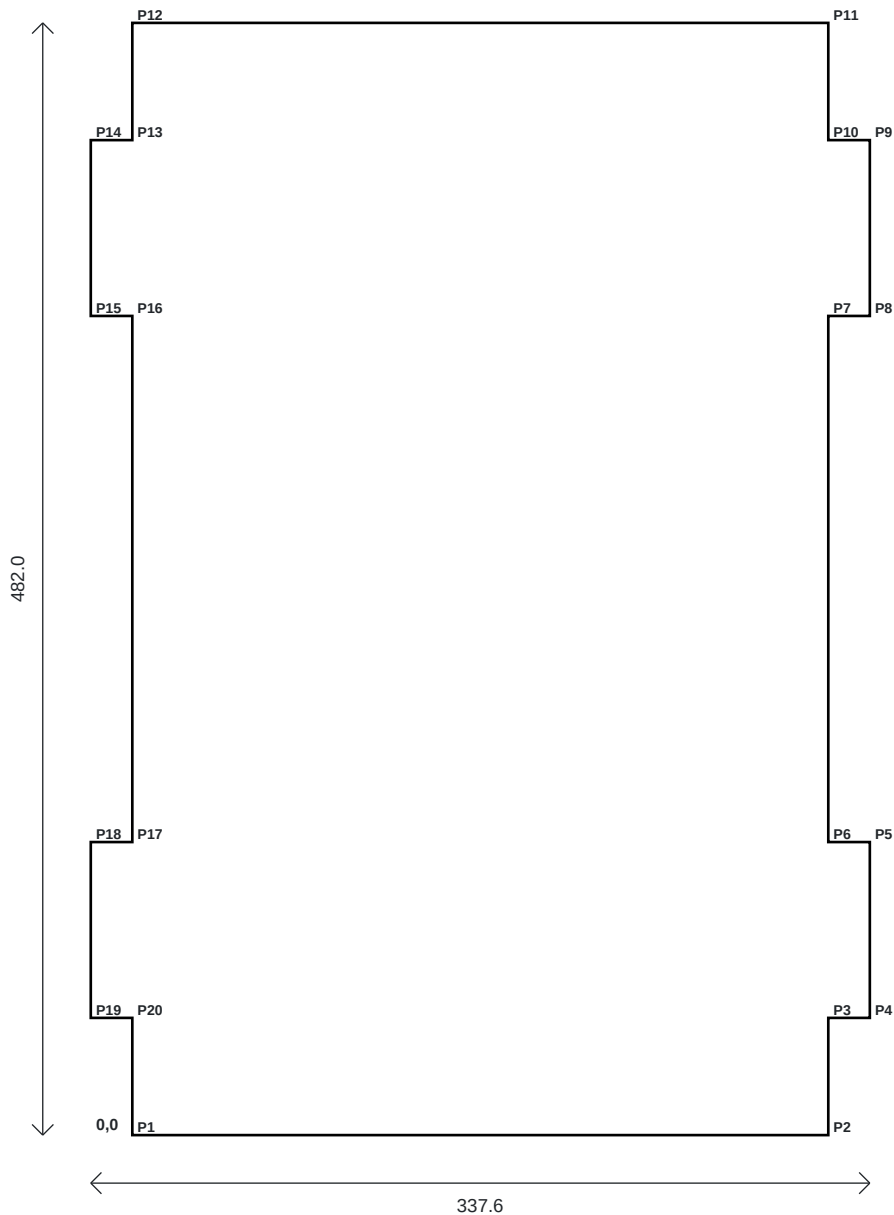

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X18.0 Y0.0 LINE
- P2 X319.6 Y0.0 LINE
- P3 X319.6 Y50.8 LINE
- P4 X337.6 Y50.8 LINE
- P5 X337.6 Y127.0 LINE
- P6 X319.6 Y127.0 LINE
- P7 X319.6 Y355.0 LINE
- P8 X337.6 Y355.0 LINE
- P9 X337.6 Y431.2 LINE
- P10 X319.6 Y431.2 LINE
- P11 X319.6 Y482.0 LINE
- P12 X18.0 Y482.0 LINE
- P13 X18.0 Y431.2 LINE
- P14 X0.0 Y431.2 LINE
- P15 X0.0 Y355.0 LINE
- P16 X18.0 Y355.0 LINE
- P17 X18.0 Y127.0 LINE
- P18 X0.0 Y127.0 LINE
- P19 X0.0 Y50.8 LINE
- P20 X18.0 Y50.8 LINE

S2-D - Part detail

Overall 400.0 x 517.0 mm | 18 mm plywood | datum lower-left = X0 Y0

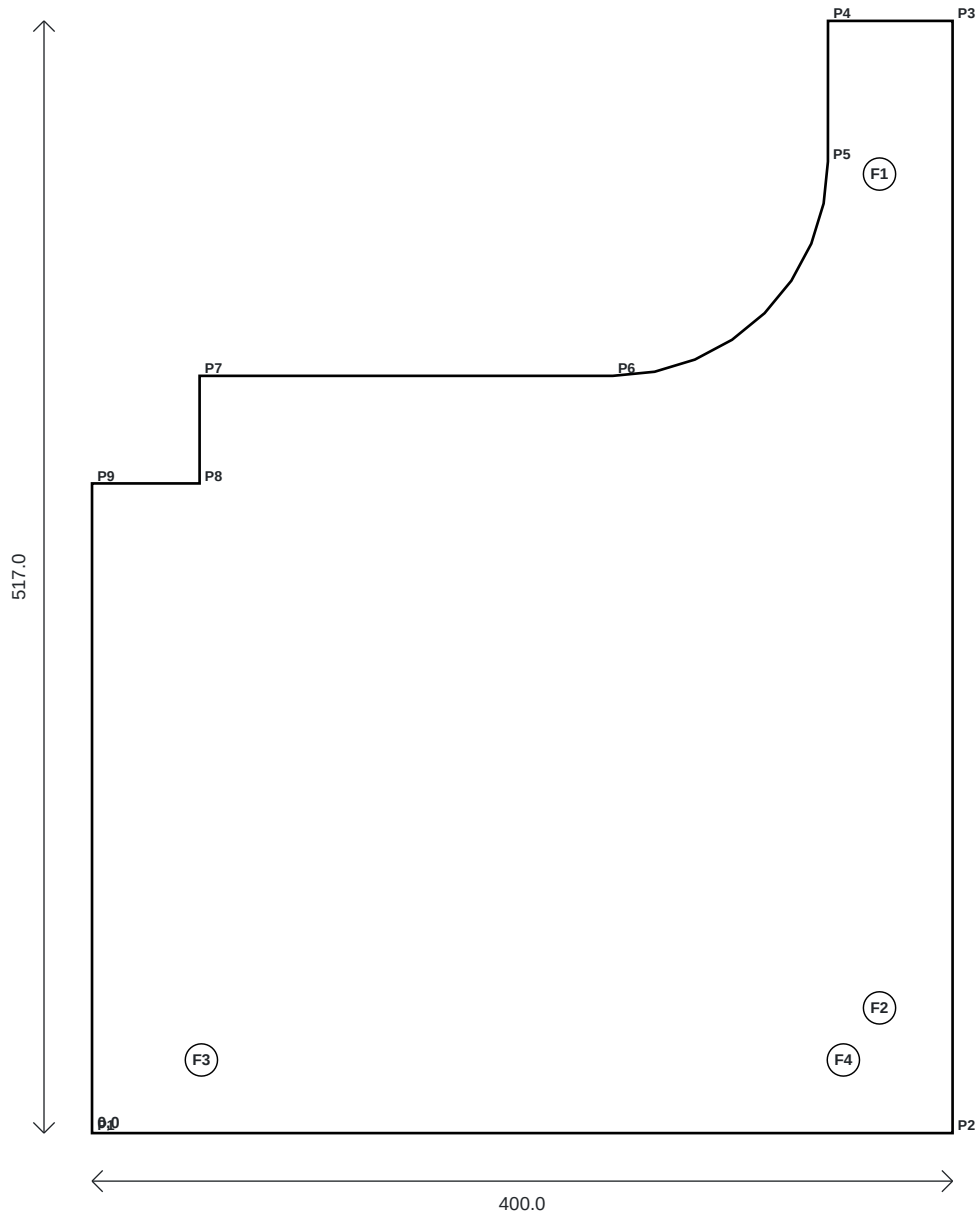

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 366.0 Y 445.8
- F2 Dia 15 x 14 deep X 366.0 Y 58.2
- F3 Dia 15 x 14 deep X 50.8 Y 34.0
- F4 Dia 15 x 14 deep X 349.2 Y 34.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X400.0 Y0.0 LINE
- P3 X400.0 Y517.0 LINE
- P4 X342.1 Y517.0 LINE
- P5 X342.1 Y451.6 ARC R100.0 CW
- P6 X242.1 Y352.0 LINE
- P7 X50.0 Y352.0 LINE
- P8 X50.0 Y302.0 LINE
- P9 X0.0 Y302.0 LINE

S2-E - Part detail

Overall 382.0 x 564.3 mm | 18 mm plywood | datum lower-left = X0 Y0

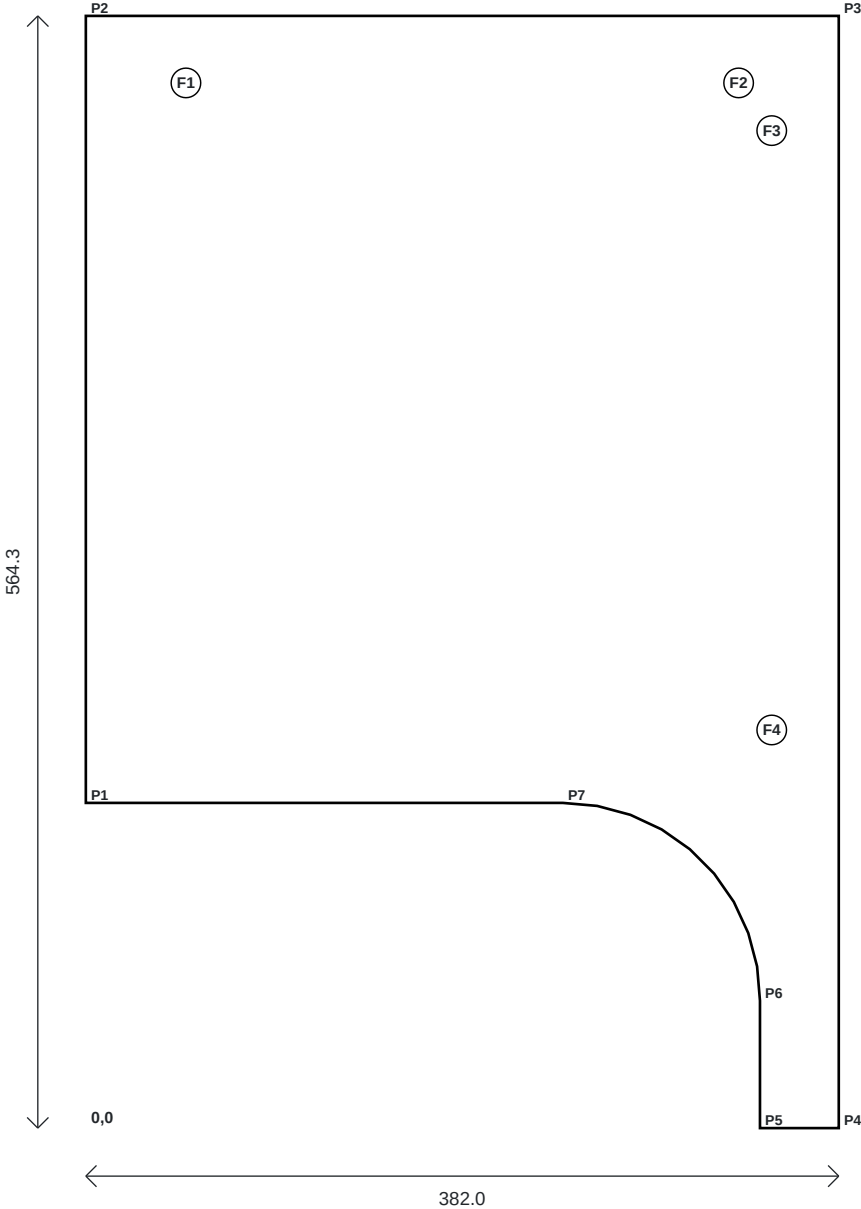

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 50.8 Y 530.3
- F2 Dia 15 x 14 deep X 331.2 Y 530.3
- F3 Dia 15 x 14 deep X 348.0 Y 506.1
- F4 Dia 15 x 14 deep X 348.0 Y 202.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y165.0 LINE
- P2 X0.0 Y564.3 LINE
- P3 X382.0 Y564.3 LINE
- P4 X382.0 Y0.0 LINE
- P5 X342.0 Y0.0 LINE
- P6 X342.0 Y64.6 ARC R100.0 CCW
- P7 X242.0 Y165.0 LINE

S2-F - Part detail

Overall 400.0 x 1685.0 mm | 18 mm plywood | datum lower-left = X0 Y0

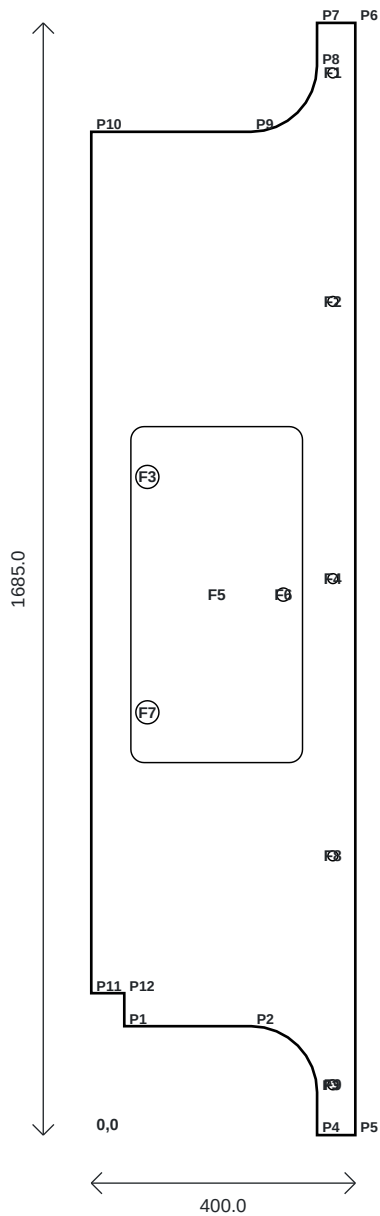

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 366.0 Y 1609.2
- F2 Dia 15 x 14 deep X 366.0 Y 1263.1
- F3 Dia 35 x 13 deep X 85.0 Y 997.1
- F4 Dia 15 x 14 deep X 366.0 Y 843.1
- F5 door cut-out 260.0 x 509.0, R20.0 X 190.0 Y 818.8
- F6 Dia 20 THROUGH X 291.0 Y 818.8
- F7 Dia 35 x 13 deep X 85.0 Y 640.5
- F8 Dia 15 x 14 deep X 366.0 Y 423.1
- F9 Dia 15 x 14 deep X 366.0 Y 76.2


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X50.0 Y165.0 LINE
- P2 X242.5 Y165.0 ARC R100.0 CW
- P3 X342.1 Y64.9 LINE
- P4 X342.0 Y0.0 LINE
- P5 X400.0 Y0.0 LINE
- P6 X400.0 Y1685.0 LINE
- P7 X342.0 Y1685.0 LINE
- P8 X342.0 Y1619.4 ARC R100.0 CW
- P9 X242.0 Y1520.0 LINE
- P10 X0.0 Y1520.0 LINE
- P11 X0.0 Y215.0 LINE
- P12 X50.0 Y215.0 LINE

S2-G - Part detail

Overall 587.5 x 1450.0 mm | 18 mm plywood | datum lower-left = X0 Y0

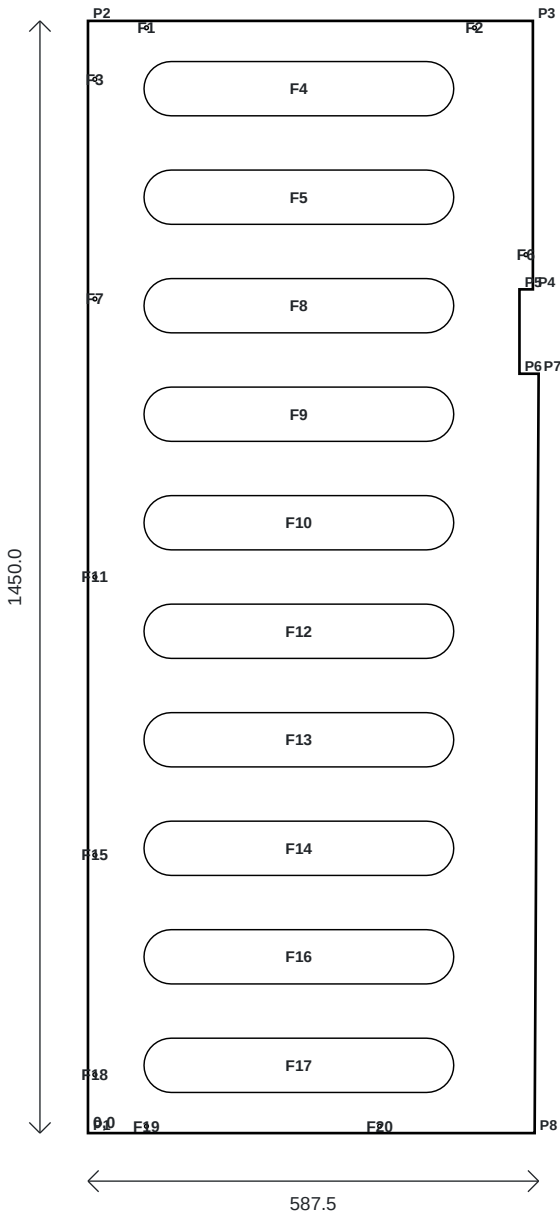

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 76.2 Y 1441.0
- F2 Dia 5 x 11 deep X 503.8 Y 1441.0
- F3 Dia 5 x 11 deep X 9.0 Y 1373.8
- F4 slot 403.8 x 70.7, R35.4 X 275.0 Y 1361.6
- F5 slot 403.8 x 70.7, R35.4 X 275.0 Y 1220.2
- F6 Dia 5 x 11 deep X 571.0 Y 1145.2
- F7 Dia 5 x 11 deep X 9.0 Y 1087.5
- F8 slot 403.8 x 70.7, R35.4 X 274.9 Y 1078.7
- F9 slot 403.8 x 70.7, R35.4 X 274.9 Y 937.2
- F10 slot 403.8 x 70.7, R35.4 X 274.9 Y 795.7
- F11 Dia 5 x 11 deep X 9.0 Y 725.0
- F12 slot 403.8 x 70.7, R35.4 X 274.9 Y 654.3
- F13 slot 403.8 x 70.7, R35.4 X 274.9 Y 512.8
- F14 slot 403.8 x 70.7, R35.4 X 274.9 Y 371.3
- F15 Dia 5 x 11 deep X 9.0 Y 362.5
- F16 slot 403.8 x 70.7, R35.4 X 274.9 Y 229.8
- F17 slot 403.8 x 70.7, R35.4 X 274.9 Y 88.4
- F18 Dia 5 x 11 deep X 9.0 Y 76.2
- F19 Dia 5 x 11 deep X 76.2 Y 9.0
- F20 Dia 5 x 11 deep X 380.3 Y 9.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X0.0 Y1450.0 LINE
- P3 X580.0 Y1450.0 LINE
- P4 X580.0 Y1100.0 LINE
- P5 X562.5 Y1100.0 LINE
- P6 X562.5 Y990.0 LINE
- P7 X587.5 Y990.0 LINE
- P8 X582.3 Y0.0 LINE

S2-H - Part detail

Overall 301.6 x 285.0 mm | 18 mm plywood | datum lower-left = X0 Y0

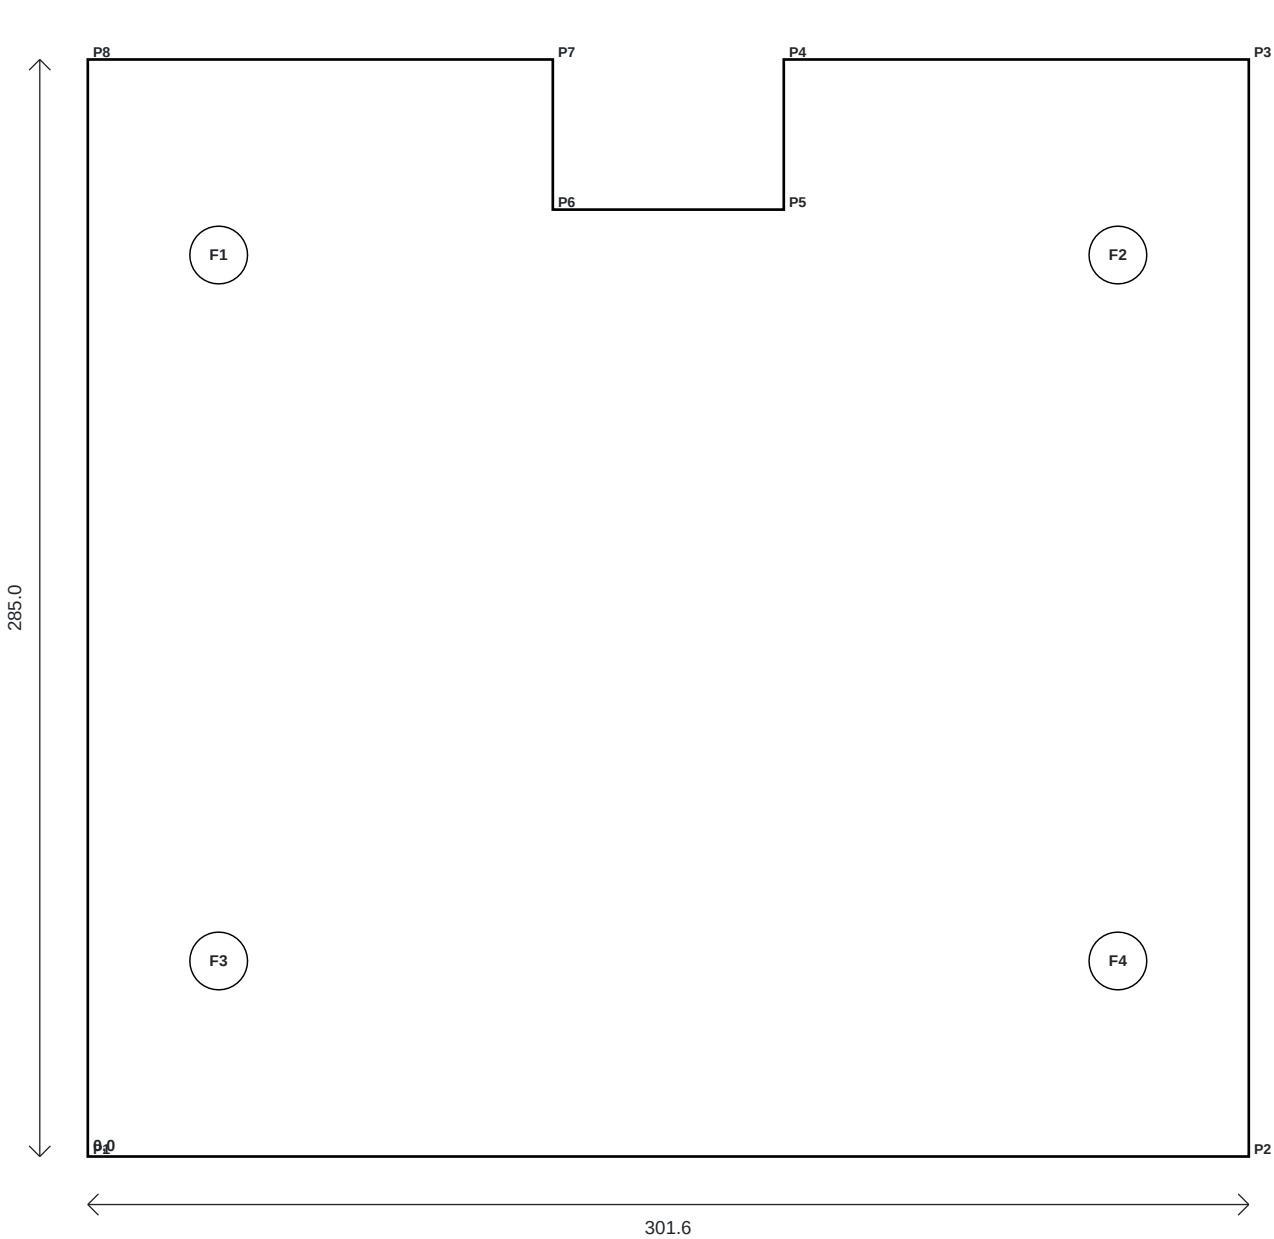

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 34.0 Y 234.2
- F2 Dia 15 x 14 deep X 267.6 Y 234.2
- F3 Dia 15 x 14 deep X 34.0 Y 50.8
- F4 Dia 15 x 14 deep X 267.6 Y 50.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X301.6 Y0.0 LINE
- P3 X301.6 Y285.0 LINE
- P4 X180.8 Y285.0 LINE
- P5 X180.8 Y246.0 LINE
- P6 X120.8 Y246.0 LINE
- P7 X120.8 Y285.0 LINE
- P8 X0.0 Y285.0 LINE

S3-A - Part detail

Overall 258.0 x 337.6 mm | 18 mm plywood | datum lower-left = X0 Y0

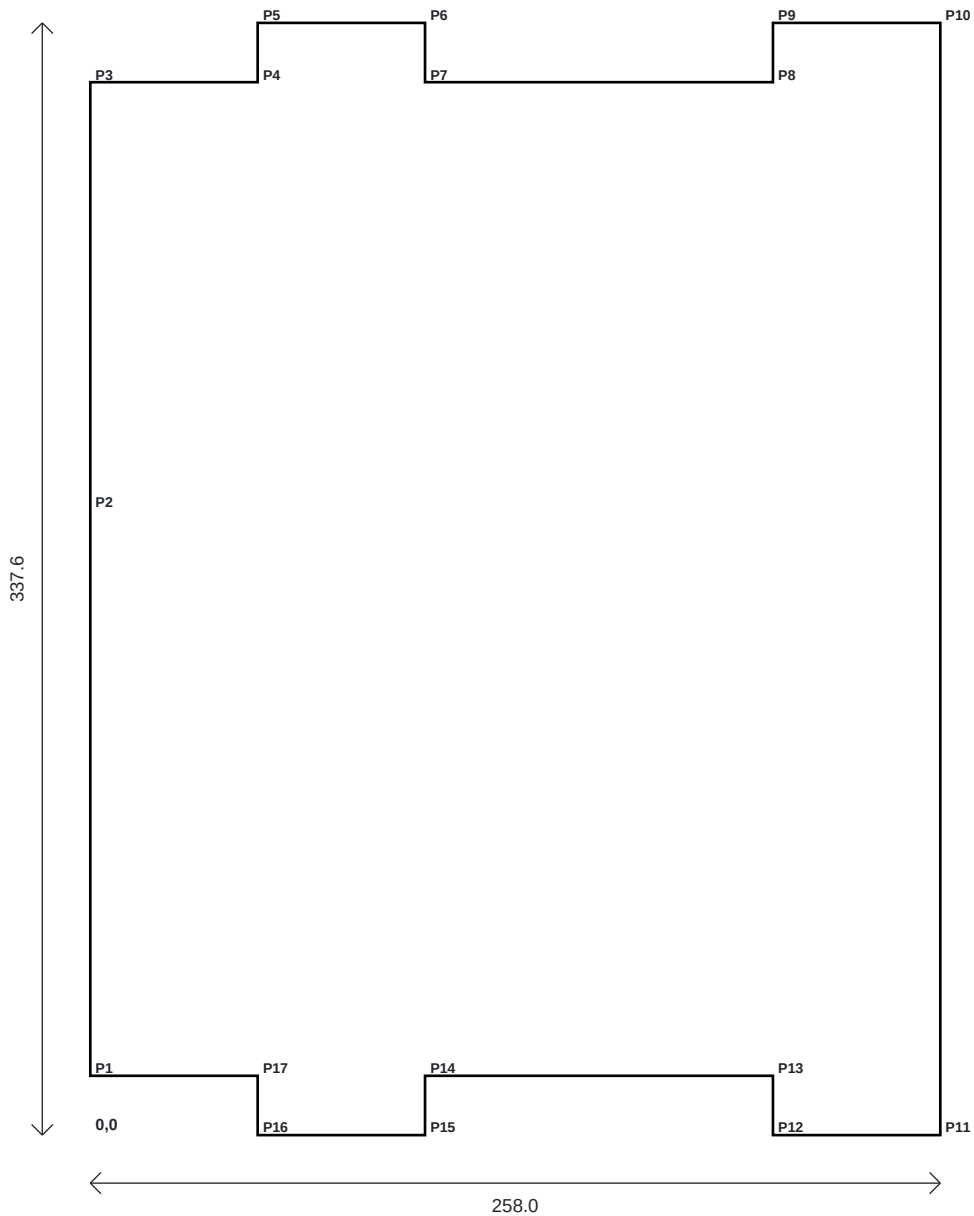

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y18.0 LINE
- P2 X0.0 Y189.8 LINE
- P3 X0.0 Y319.6 LINE
- P4 X50.8 Y319.6 LINE
- P5 X50.8 Y337.6 LINE
- P6 X101.6 Y337.6 LINE
- P7 X101.6 Y319.6 LINE
- P8 X207.2 Y319.6 LINE
- P9 X207.2 Y337.6 LINE
- P10 X258.0 Y337.6 LINE
- P11 X258.0 Y0.0 LINE
- P12 X207.2 Y0.0 LINE
- P13 X207.2 Y18.0 LINE
- P14 X101.6 Y18.0 LINE
- P15 X101.6 Y0.0 LINE
- P16 X50.8 Y0.0 LINE
- P17 X50.8 Y18.0 LINE

S3-B - Part detail

Overall 600.0 x 500.0 mm | 18 mm plywood | datum lower-left = X0 Y0

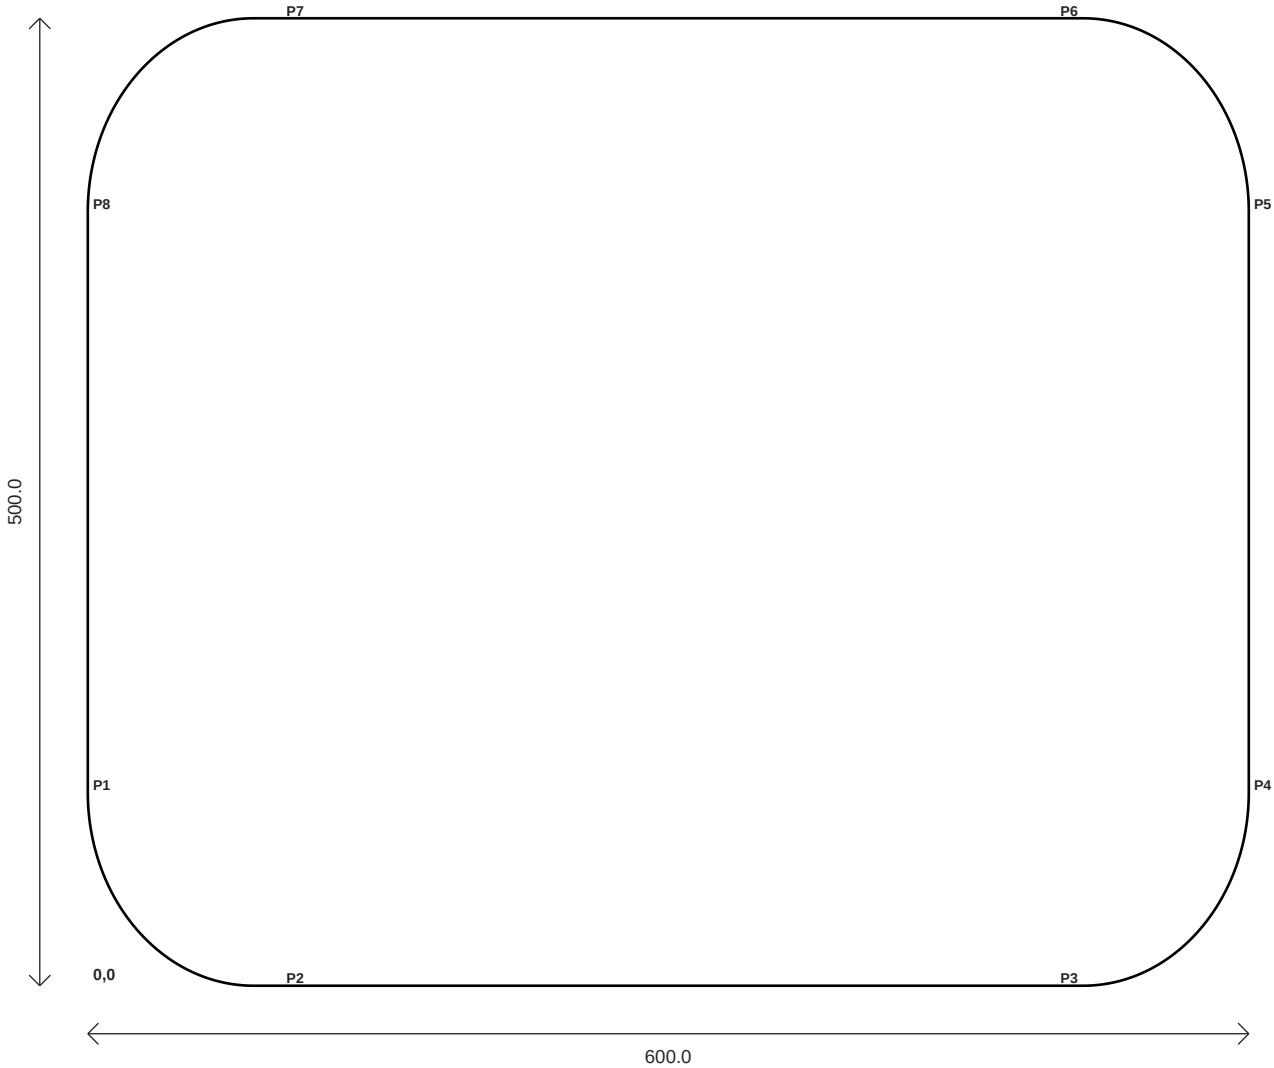

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y100.0 ARC R100
- P2 X100.0 Y0.0 LINE
- P3 X500.0 Y0.0 ARC R100
- P4 X600.0 Y100.0 LINE
- P5 X600.0 Y400.0 ARC R100
- P6 X500.0 Y500.0 LINE
- P7 X100.0 Y500.0 ARC R100
- P8 X0.0 Y400.0 LINE

S3-C - Part detail

Overall 285.0 x 500.0 mm | 18 mm plywood | datum lower-left = X0 Y0

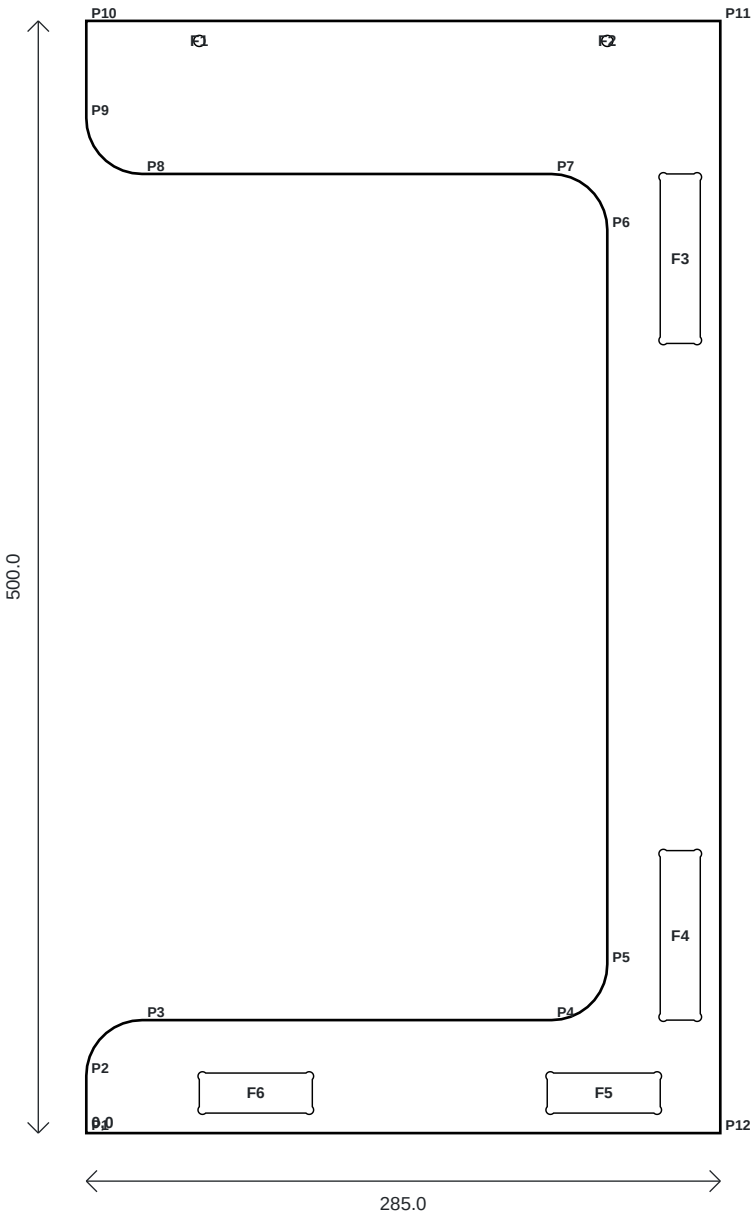

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 50.8 Y 491.0
- F2 Dia 5 x 11 deep X 234.2 Y 491.0
- F3 cut-out 18.5 x 77.4, R2.0 X 267.0 Y 393.1
- F4 cut-out 18.5 x 77.4, R2.0 X 267.0 Y 88.9
- F5 cut-out 52.0 x 18.5, R2.0 X 232.6 Y 18.0
- F6 cut-out 52.0 x 18.5, R2.0 X 76.2 Y 18.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X0.0 Y25.8 ARC R25.0 CW
- P3 X25.1 Y50.8 LINE
- P4 X209.2 Y50.8 ARC R25.0 CCW
- P5 X234.2 Y75.9 LINE
- P6 X234.2 Y406.2 ARC R25.0 CCW
- P7 X209.2 Y431.2 LINE
- P8 X25.0 Y431.2 ARC R25.0 CW
- P9 X0.0 Y456.3 LINE
- P10 X0.0 Y500.0 LINE
- P11 X285.0 Y500.0 LINE
- P12 X285.0 Y0.0 LINE

S3-D - Part detail

Overall 285.0 x 500.0 mm | 18 mm plywood | datum lower-left = X0 Y0

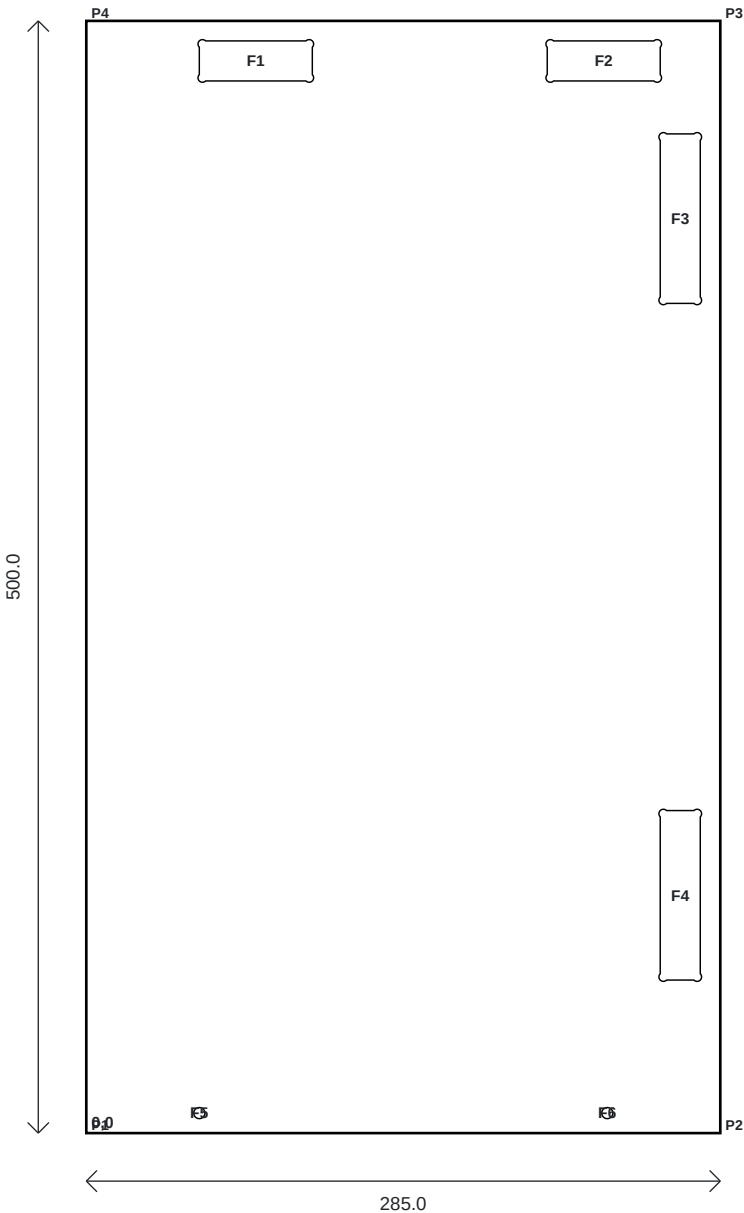

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 cut-out 52.0 x 18.5, R2.0 X 76.2 Y 482.0
- F2 cut-out 52.0 x 18.5, R2.0 X 232.6 Y 482.0
- F3 cut-out 18.5 x 77.4, R2.0 X 267.0 Y 411.1
- F4 cut-out 18.5 x 77.4, R2.0 X 267.0 Y 106.9
- F5 Dia 5 x 11 deep X 50.8 Y 9.0
- F6 Dia 5 x 11 deep X 234.2 Y 9.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X285.0 Y0.0 LINE
- P3 X285.0 Y500.0 LINE
- P4 X0.0 Y500.0 LINE

S3-E - Part detail

Overall 202.0 x 400.0 mm | 18 mm plywood | datum lower-left = X0 Y0

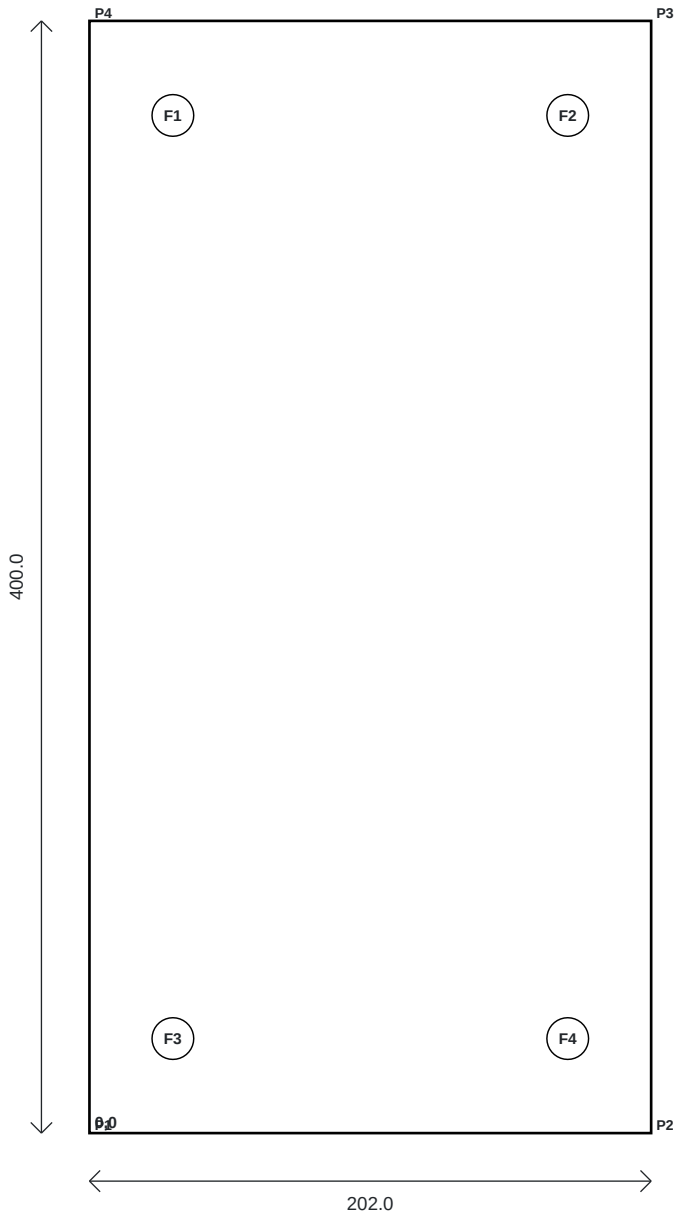

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 30.0 Y 366.0
- F2 Dia 15 x 14 deep X 172.0 Y 366.0
- F3 Dia 15 x 14 deep X 30.0 Y 34.0
- F4 Dia 15 x 14 deep X 172.0 Y 34.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X202.0 Y0.0 LINE
- P3 X202.0 Y400.0 LINE
- P4 X0.0 Y400.0 LINE

S3-F - Part detail

Overall 800.0 x 400.0 mm | 18 mm plywood | datum lower-left = X0 Y0

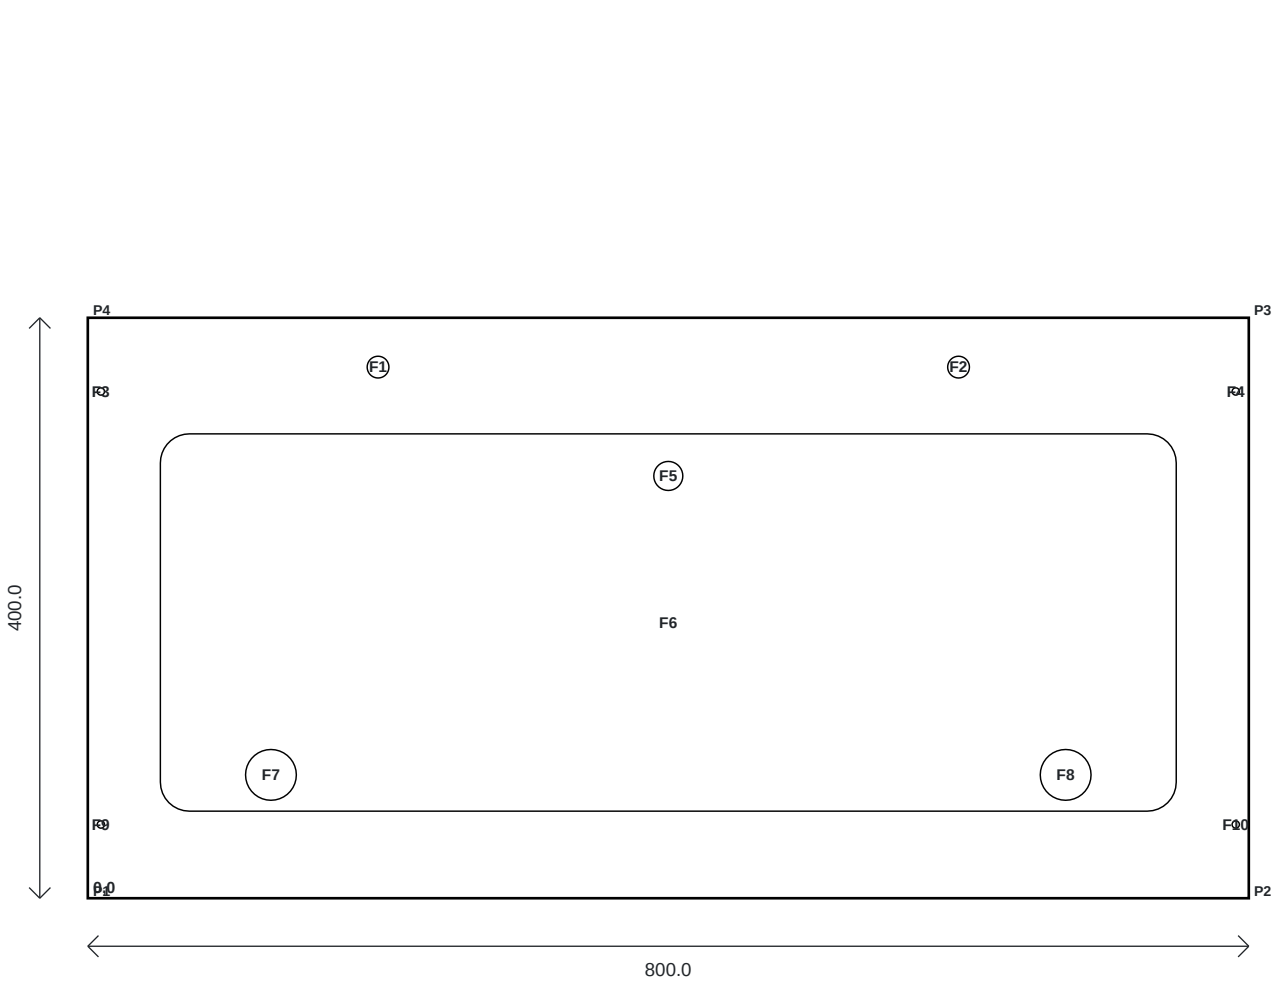

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 200.0 Y 366.0
- F2 Dia 15 x 14 deep X 600.0 Y 366.0
- F3 Dia 5 x 11 deep X 9.0 Y 349.2
- F4 Dia 5 x 11 deep X 791.0 Y 349.2
- F5 Dia 20 THROUGH X 400.0 Y 291.0
- F6 cut-out 700.0 x 260.0, R20.0 X 400.0 Y 190.0
- F7 Dia 35 x 13 deep X 126.2 Y 85.0
- F8 Dia 35 x 13 deep X 673.8 Y 85.0
- F9 Dia 5 x 11 deep X 9.0 Y 50.8
- F10 Dia 5 x 11 deep X 791.0 Y 50.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X800.0 Y0.0 LINE
- P3 X800.0 Y400.0 LINE
- P4 X0.0 Y400.0 LINE

S3-G - Part detail

Overall 560.0 x 1448.1 mm | 18 mm plywood | datum lower-left = X0 Y0

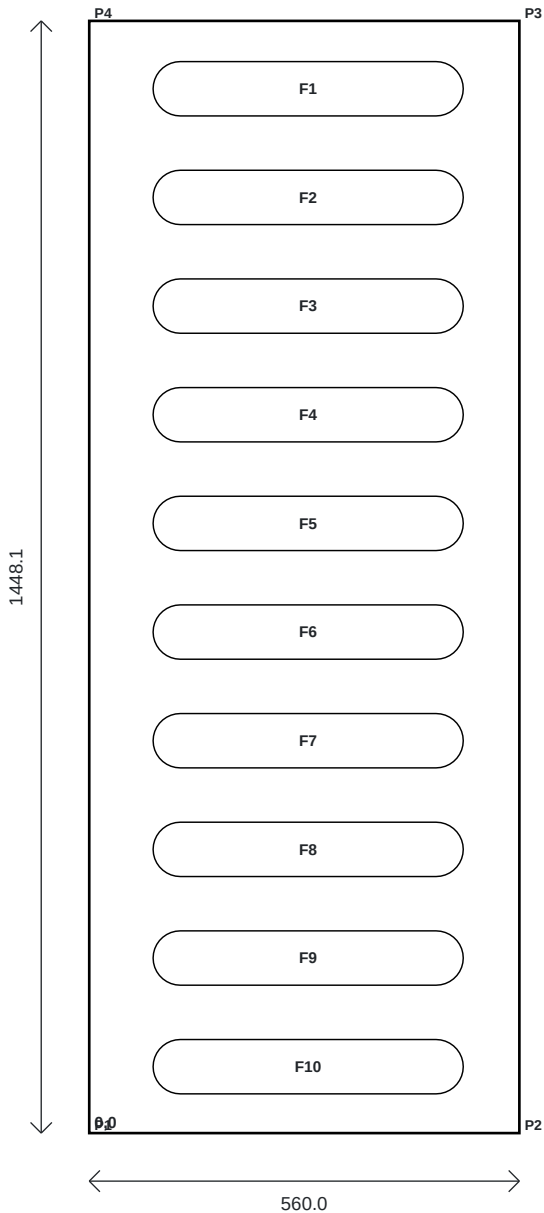

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 slot 403.8 x 70.7, R35.4 X 285.0 Y 1359.7
- F2 slot 403.8 x 70.7, R35.4 X 285.0 Y 1218.3
- F3 slot 403.8 x 70.7, R35.4 X 285.1 Y 1076.8
- F4 slot 403.8 x 70.7, R35.4 X 285.1 Y 935.3
- F5 slot 403.8 x 70.7, R35.4 X 285.1 Y 793.8
- F6 slot 403.8 x 70.7, R35.4 X 285.1 Y 652.4
- F7 slot 403.8 x 70.7, R35.4 X 285.1 Y 510.9
- F8 slot 403.8 x 70.7, R35.4 X 285.1 Y 369.4
- F9 slot 403.8 x 70.7, R35.4 X 285.1 Y 227.9
- F10 slot 403.8 x 70.7, R35.4 X 285.1 Y 86.5


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X560.0 Y0.0 LINE
- P3 X560.0 Y1448.1 LINE
- P4 X0.0 Y1448.1 LINE

S3-H - Part detail

Overall 382.0 x 1450.0 mm | 18 mm plywood | datum lower-left = X0 Y0

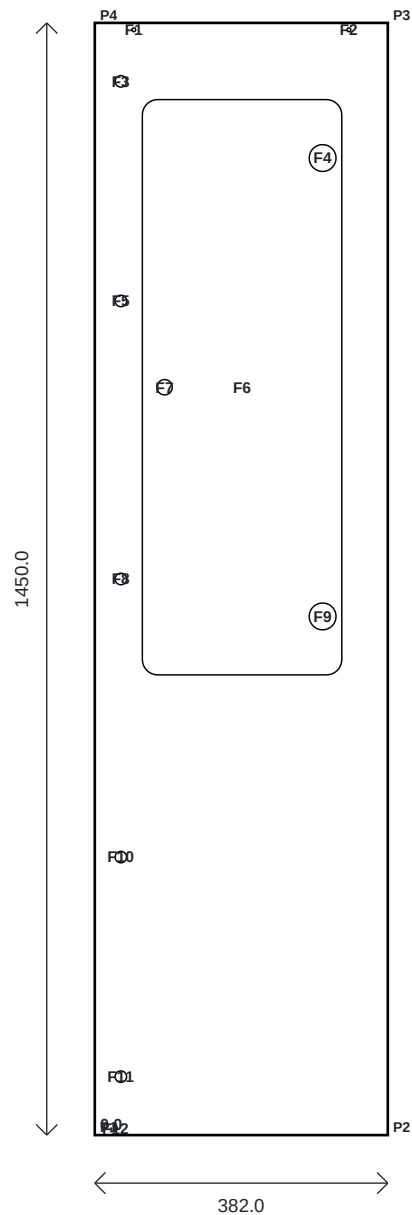

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 50.8 Y 1441.0
- F2 Dia 5 x 11 deep X 331.2 Y 1441.0
- F3 Dia 15 x 14 deep X 34.0 Y 1373.8
- F4 Dia 35 x 13 deep X 297.0 Y 1273.8
- F5 Dia 15 x 14 deep X 34.0 Y 1087.5
- F6 door cut-out 260.0 x 750.0, R20.0 X 192.0 Y 975.0
- F7 Dia 20 THROUGH X 91.0 Y 975.0
- F8 Dia 15 x 14 deep X 34.0 Y 725.0
- F9 Dia 35 x 13 deep X 297.0 Y 676.2
- F10 Dia 15 x 14 deep X 34.0 Y 362.5
- F11 Dia 15 x 14 deep X 34.0 Y 76.2
- F12 Dia 5 x 11 deep X 27.0 Y 9.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X382.0 Y0.0 LINE
- P3 X382.0 Y1450.0 LINE
- P4 X0.0 Y1450.0 LINE

S3-I - Part detail

Overall 383.0 x 382.0 mm | 18 mm plywood | datum lower-left = X0 Y0

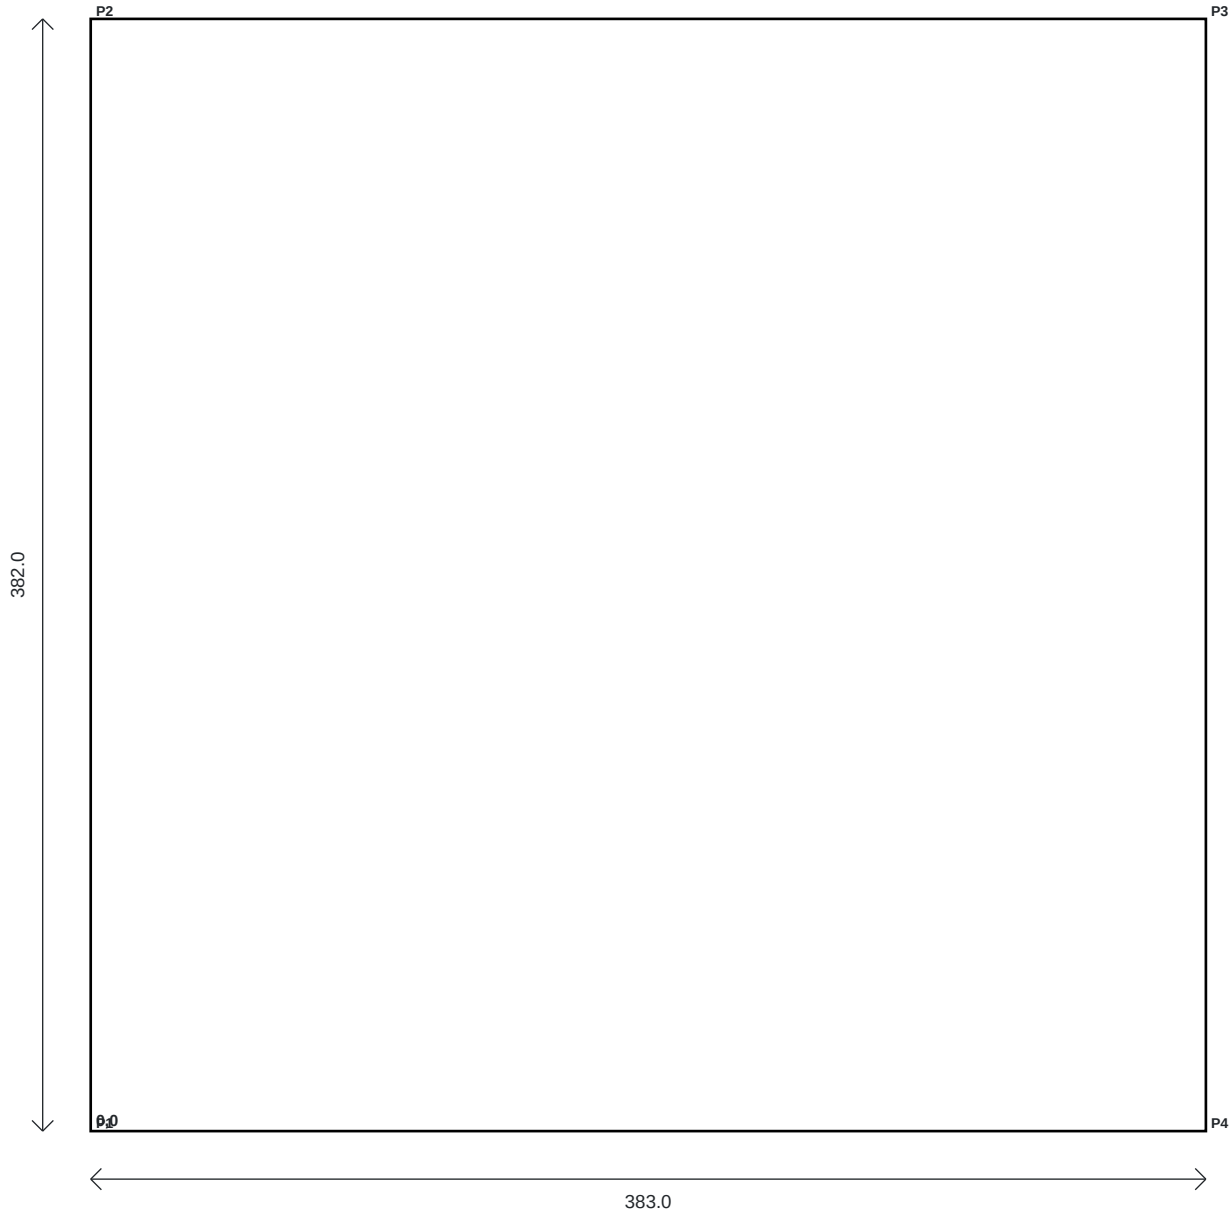

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X0.0 Y382.0 LINE
- P3 X383.0 Y382.0 LINE
- P4 X383.0 Y0.0 LINE

S4-A - Part detail

Overall 1220.0 x 500.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge


Machining features

- F1 Dia 5 x 11 deep X 793.1 Y 423.8
- F2 Dia 5 x 11 deep X 392.1 Y 423.8
- F3 Dia 5 x 11 deep X 1211.0 Y 423.8
- F4 Dia 5 x 11 deep X 9.0 Y 176.4
- F5 Dia 5 x 11 deep X 392.1 Y 176.2
- F6 Dia 5 x 11 deep X 261.4 Y 109.0
- F7 Dia 5 x 11 deep X 522.7 Y 109.0

Outer profile cuts


P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y100.0 LINE
- P2 X0.0 Y500.0 LINE
- P3 X1220.0 Y500.0 LINE
- P4 X1220.0 Y0.0 LINE
- P5 X784.1 Y0.0 LINE
- P6 X784.1 Y50.0 ARC R50.0 CCW
- P7 X733.9 Y100.0 LINE

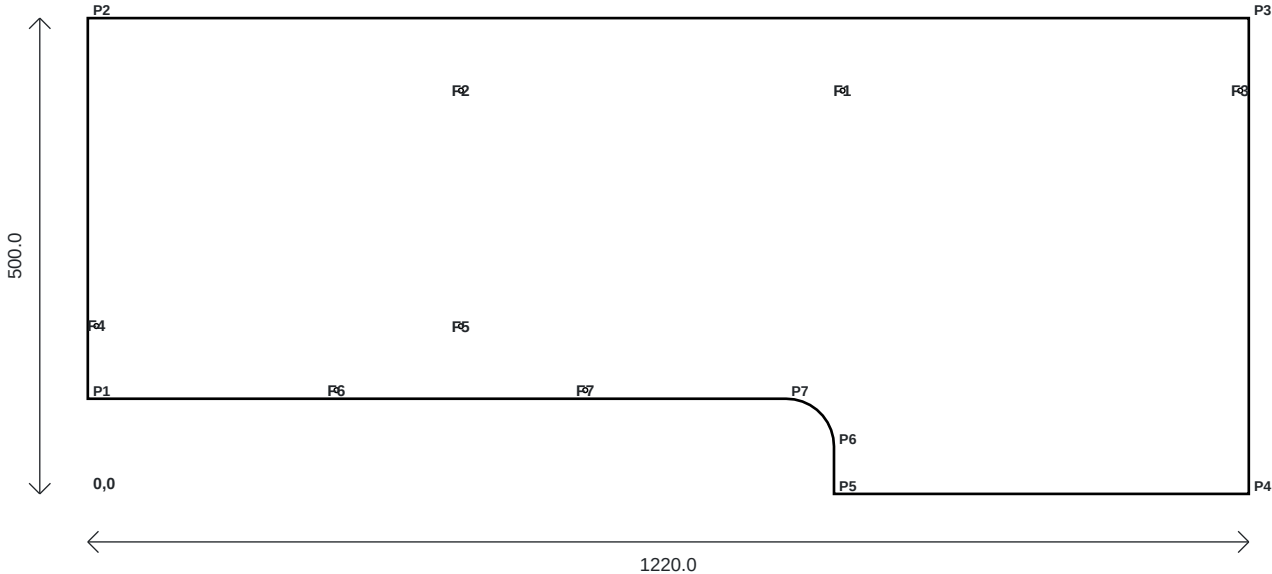

S4-B - Part detail

Overall 365.0 x 382.0 mm | 18 mm plywood | datum lower-left = X0 Y0

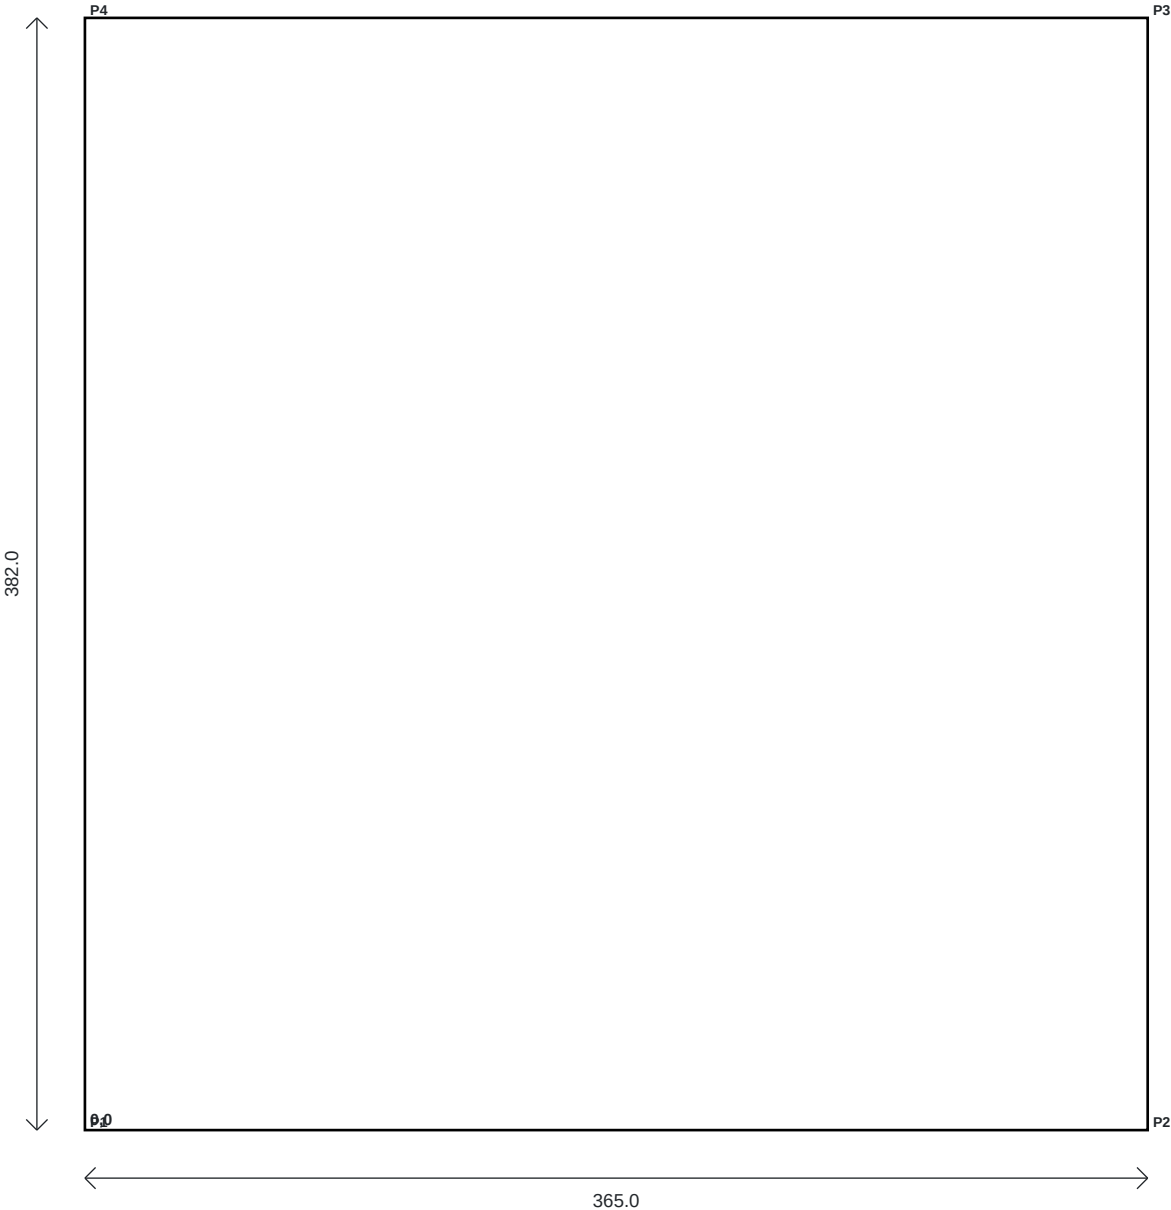

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts


P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X365.0 Y0.0 LINE
- P3 X365.0 Y382.0 LINE
- P4 X0.0 Y382.0 LINE

S4-C - Part detail

Overall 742.0 x 500.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

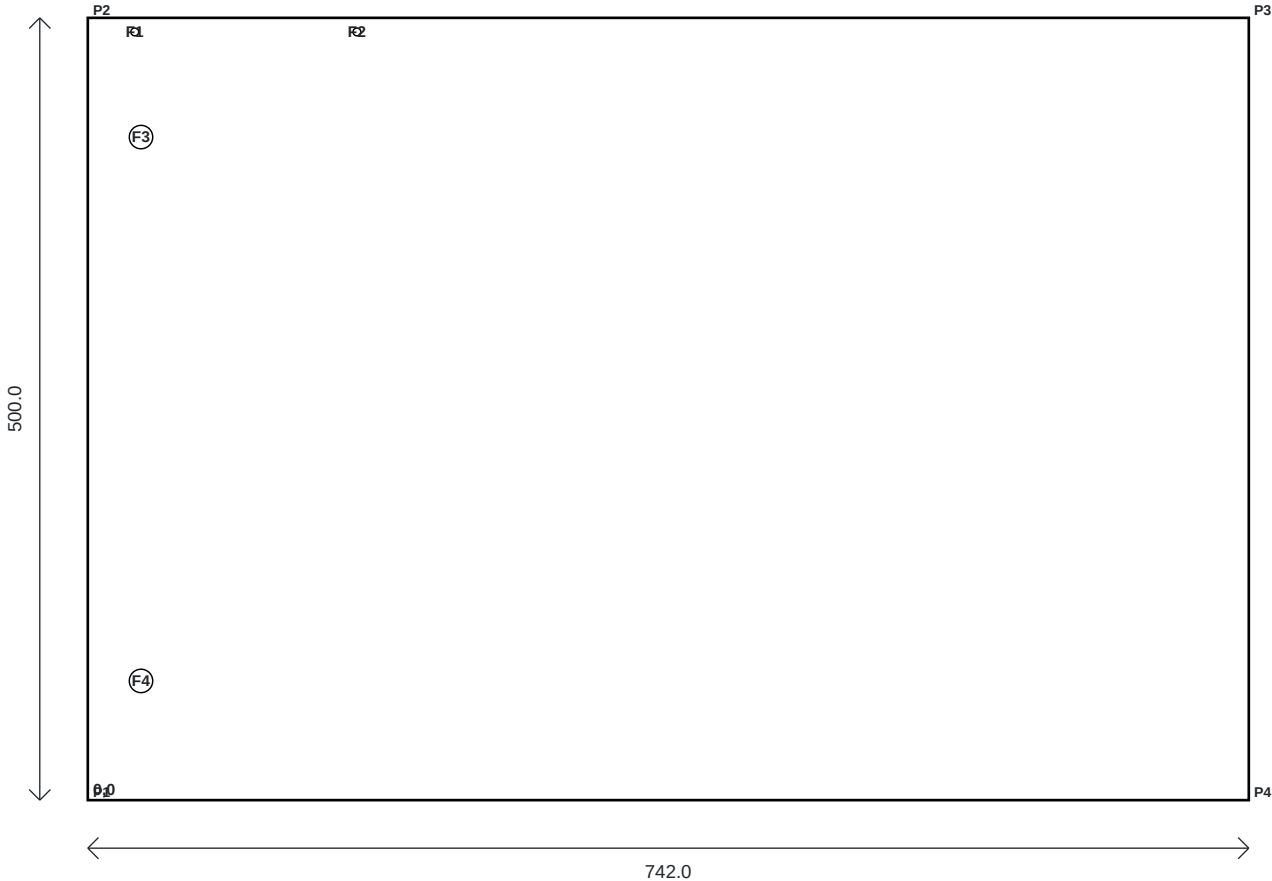

Machining features

- F1 Dia 5 x 11 deep X 30.0 Y 491.0
- F2 Dia 5 x 11 deep X 172.0 Y 491.0
- F3 Dia 15 x 14 deep X 34.0 Y 423.8
- F4 Dia 15 x 14 deep X 34.0 Y 76.2

Outer profile cuts


P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X0.0 Y500.0 LINE
- P3 X742.0 Y500.0 LINE
- P4 X742.0 Y0.0 LINE

S4-D - Part detail

Overall 742.0 x 500.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

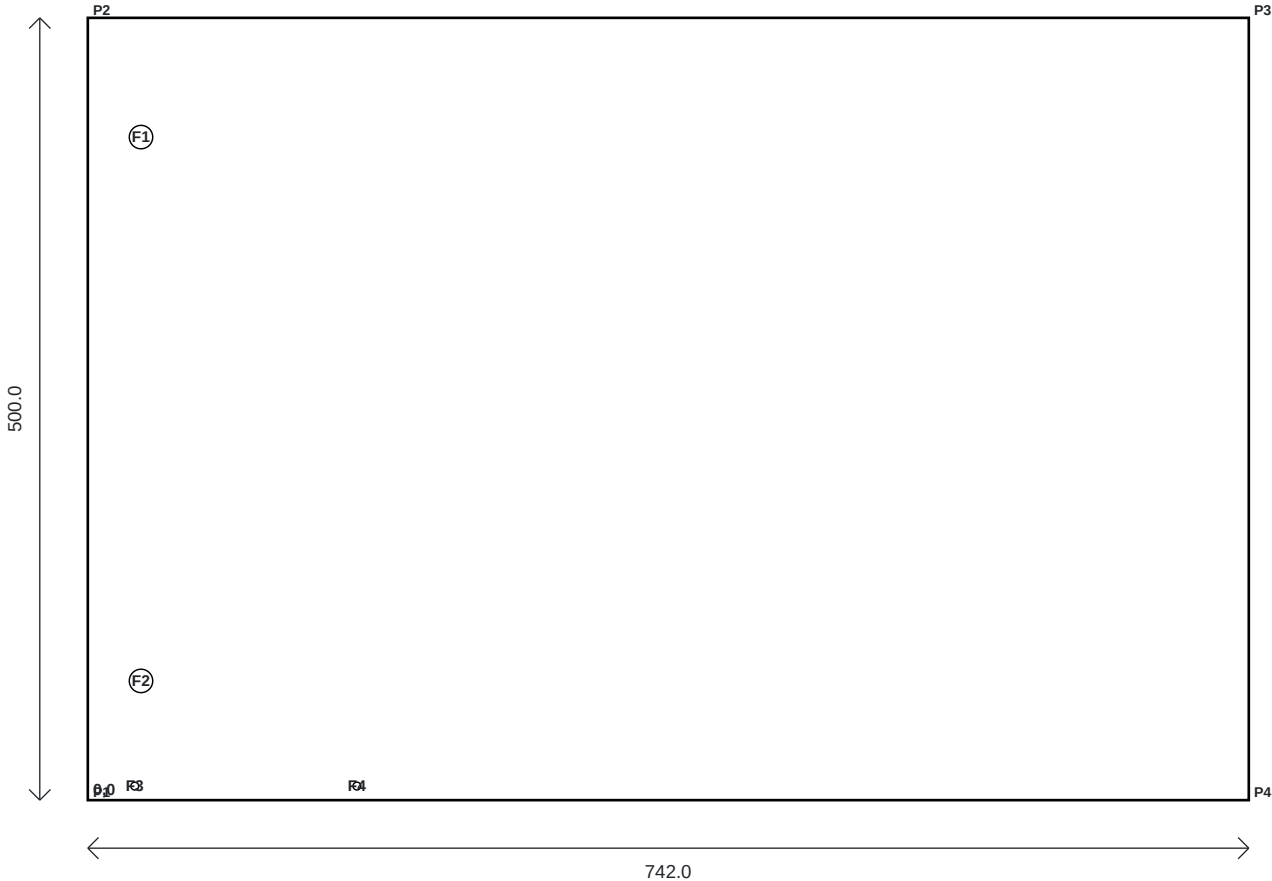

Machining features

- F1 Dia 15 x 14 deep X 34.0 Y 423.8
- F2 Dia 15 x 14 deep X 34.0 Y 76.2
- F3 Dia 5 x 11 deep X 30.0 Y 9.0
- F4 Dia 5 x 11 deep X 172.0 Y 9.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X0.0 Y500.0 LINE
- P3 X742.0 Y500.0 LINE
- P4 X742.0 Y0.0 LINE

S4-E - Part detail

Overall 784.1 x 742.0 mm | 18 mm plywood | datum lower-left = X0 Y0

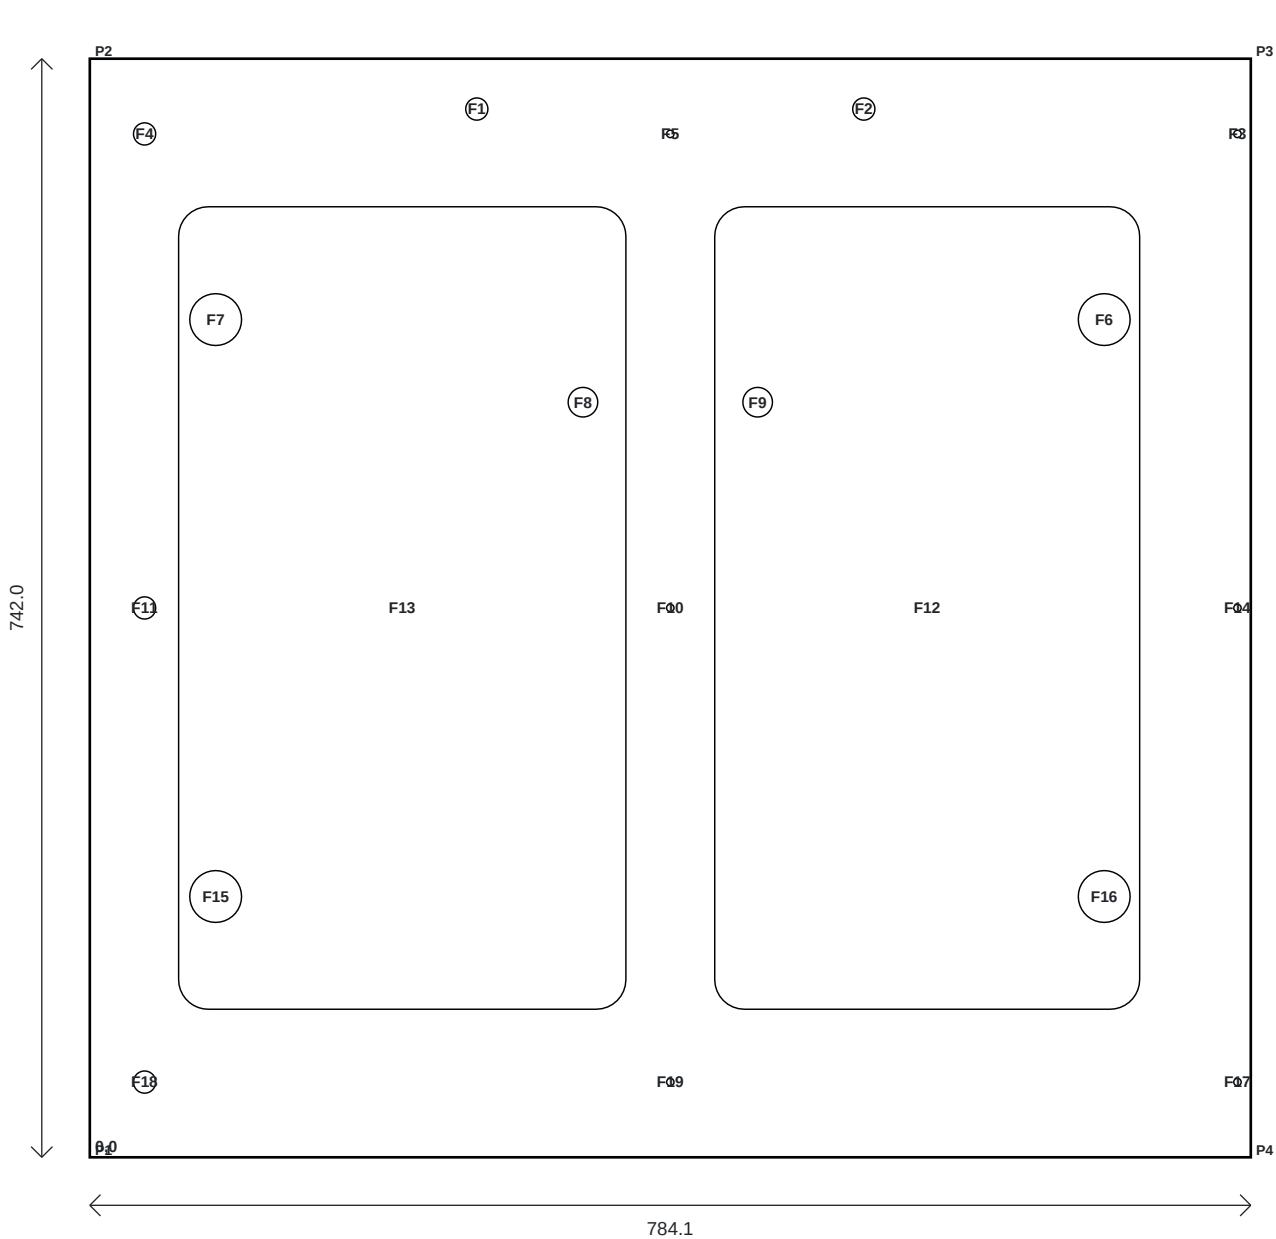

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 261.4 Y 708.0
- F2 Dia 15 x 14 deep X 522.7 Y 708.0
- F3 Dia 5 x 11 deep X 775.1 Y 691.2
- F4 Dia 15 x 14 deep X 37.0 Y 691.2
- F5 Dia 5 x 11 deep X 392.1 Y 691.2
- F6 Dia 35 x 13 deep X 685.1 Y 565.8
- F7 Dia 35 x 13 deep X 85.0 Y 565.8
- F8 Dia 20 THROUGH X 333.1 Y 510.0
- F9 Dia 20 THROUGH X 451.1 Y 510.0
- F10 Dia 5 x 11 deep X 392.1 Y 371.0
- F11 Dia 15 x 14 deep X 37.0 Y 371.0
- F12 cut-out 287.0 x 542.0, R20.0 X 565.6 Y 371.0
- F13 cut-out 302.1 x 542.0, R20.0 X 211.0 Y 371.0
- F14 Dia 5 x 11 deep X 775.1 Y 371.0
- F15 Dia 35 x 13 deep X 85.0 Y 176.1
- F16 Dia 35 x 13 deep X 685.1 Y 176.1
- F17 Dia 5 x 11 deep X 775.1 Y 50.8
- F18 Dia 15 x 14 deep X 37.0 Y 50.8
- F19 Dia 5 x 11 deep X 392.1 Y 50.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X0.0 Y742.0 LINE
- P3 X784.1 Y742.0 LINE
- P4 X784.1 Y0.0 LINE

S4-F - Part detail

Overall 382.0 x 742.0 mm | 18 mm plywood | datum lower-left = X0 Y0

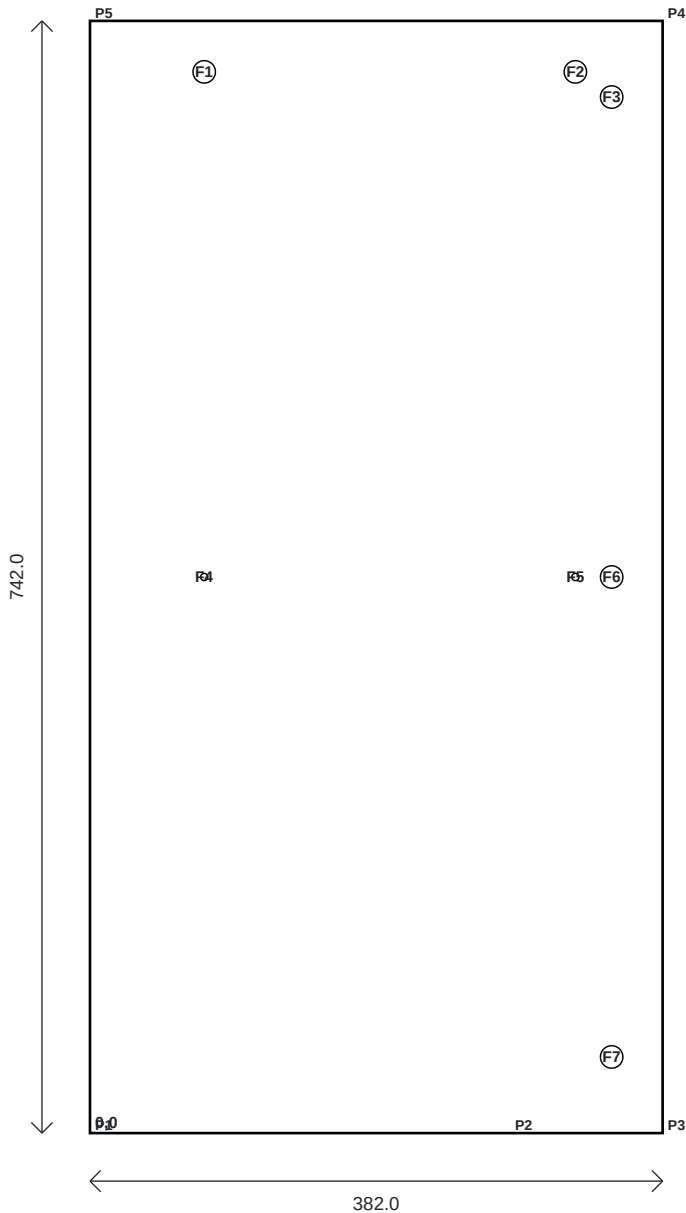

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 76.2 Y 708.0
- F2 Dia 15 x 14 deep X 323.8 Y 708.0
- F3 Dia 15 x 14 deep X 348.0 Y 691.2
- F4 Dia 5 x 11 deep X 76.2 Y 371.0
- F5 Dia 5 x 11 deep X 323.8 Y 371.0
- F6 Dia 15 x 14 deep X 348.0 Y 371.0
- F7 Dia 15 x 14 deep X 348.0 Y 50.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X280.0 Y0.0 LINE
- P3 X382.0 Y0.0 LINE
- P4 X382.0 Y742.0 LINE
- P5 X0.0 Y742.0 LINE

S4-G - Part detail

Overall 382.0 x 742.0 mm | 18 mm plywood | datum lower-left = X0 Y0

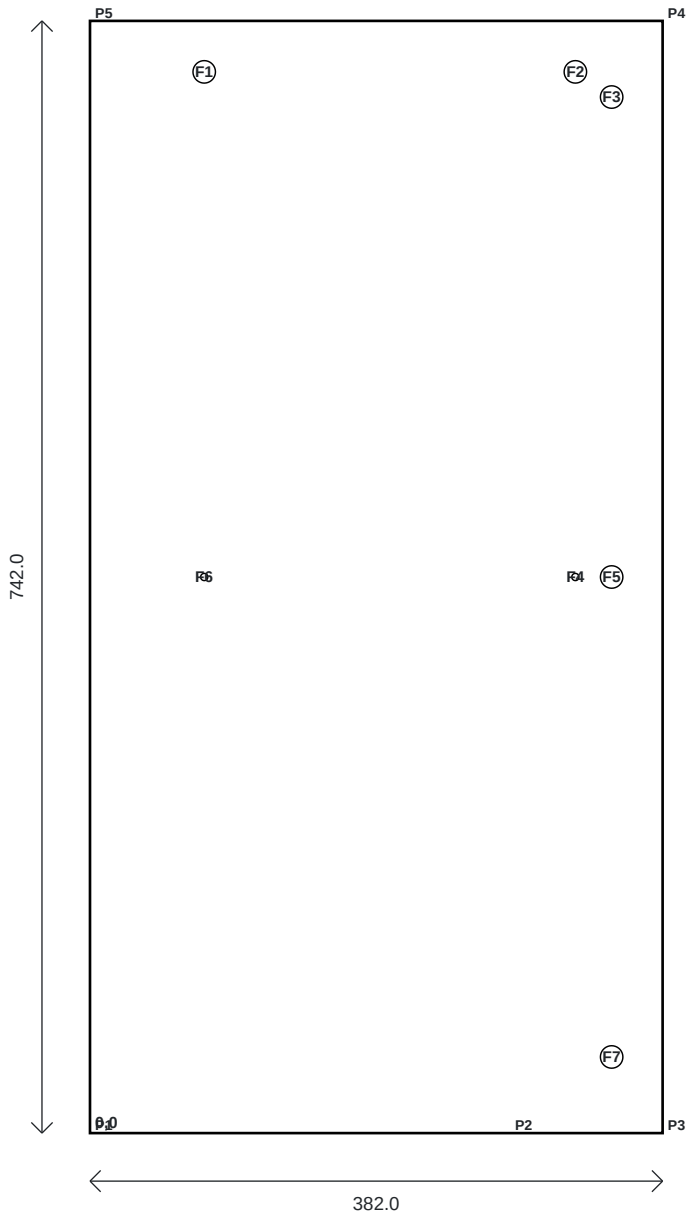

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 76.2 Y 708.0
- F2 Dia 15 x 14 deep X 323.8 Y 708.0
- F3 Dia 15 x 14 deep X 348.0 Y 691.2
- F4 Dia 5 x 11 deep X 323.8 Y 371.0
- F5 Dia 15 x 14 deep X 348.0 Y 371.0
- F6 Dia 5 x 11 deep X 76.2 Y 371.0
- F7 Dia 15 x 14 deep X 348.0 Y 50.8

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X280.0 Y0.0 LINE
- P3 X382.0 Y0.0 LINE
- P4 X382.0 Y742.0 LINE
- P5 X0.0 Y742.0 LINE