

FORD-TRANSIT-CUSTOM-LWB-2-DOOR-KITCHEN

Coordinate system

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Example: X100 / Y50 = 100 mm right from the left edge, then 50 mm up from the bottom.

Sheet structure

Sheet 1: 7 panels

Sheet 2: 7 panels

Sheet 3: 8 panels

Sheet 4: 7 panels

Total: 29 panels

Rules

- 18 mm plywood
- Dia 5 = 11 mm deep; nominal 8.8/8.9 edge positions shown as 9 mm
- Dia 15 = 14 mm deep
- Dia 20 = THROUGH
- Dia 35 = 13 mm deep
- Radius of a rounded slot/cut-out = half its narrow width
- Door cut-outs use R20
- 5 mm / 15 mm fixing holes may be omitted when using L-brackets or timber blocks.


8 mm cam-fitting edge holes

Where a 15 mm cam-lock hole is shown, drill an 8 mm hole centrally through the edge of the mating side panel using a self-centring jig with an 8 mm guide.

Align the 8 mm hole with the centre of the 15 mm cam-lock bore.


Sheet 1 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

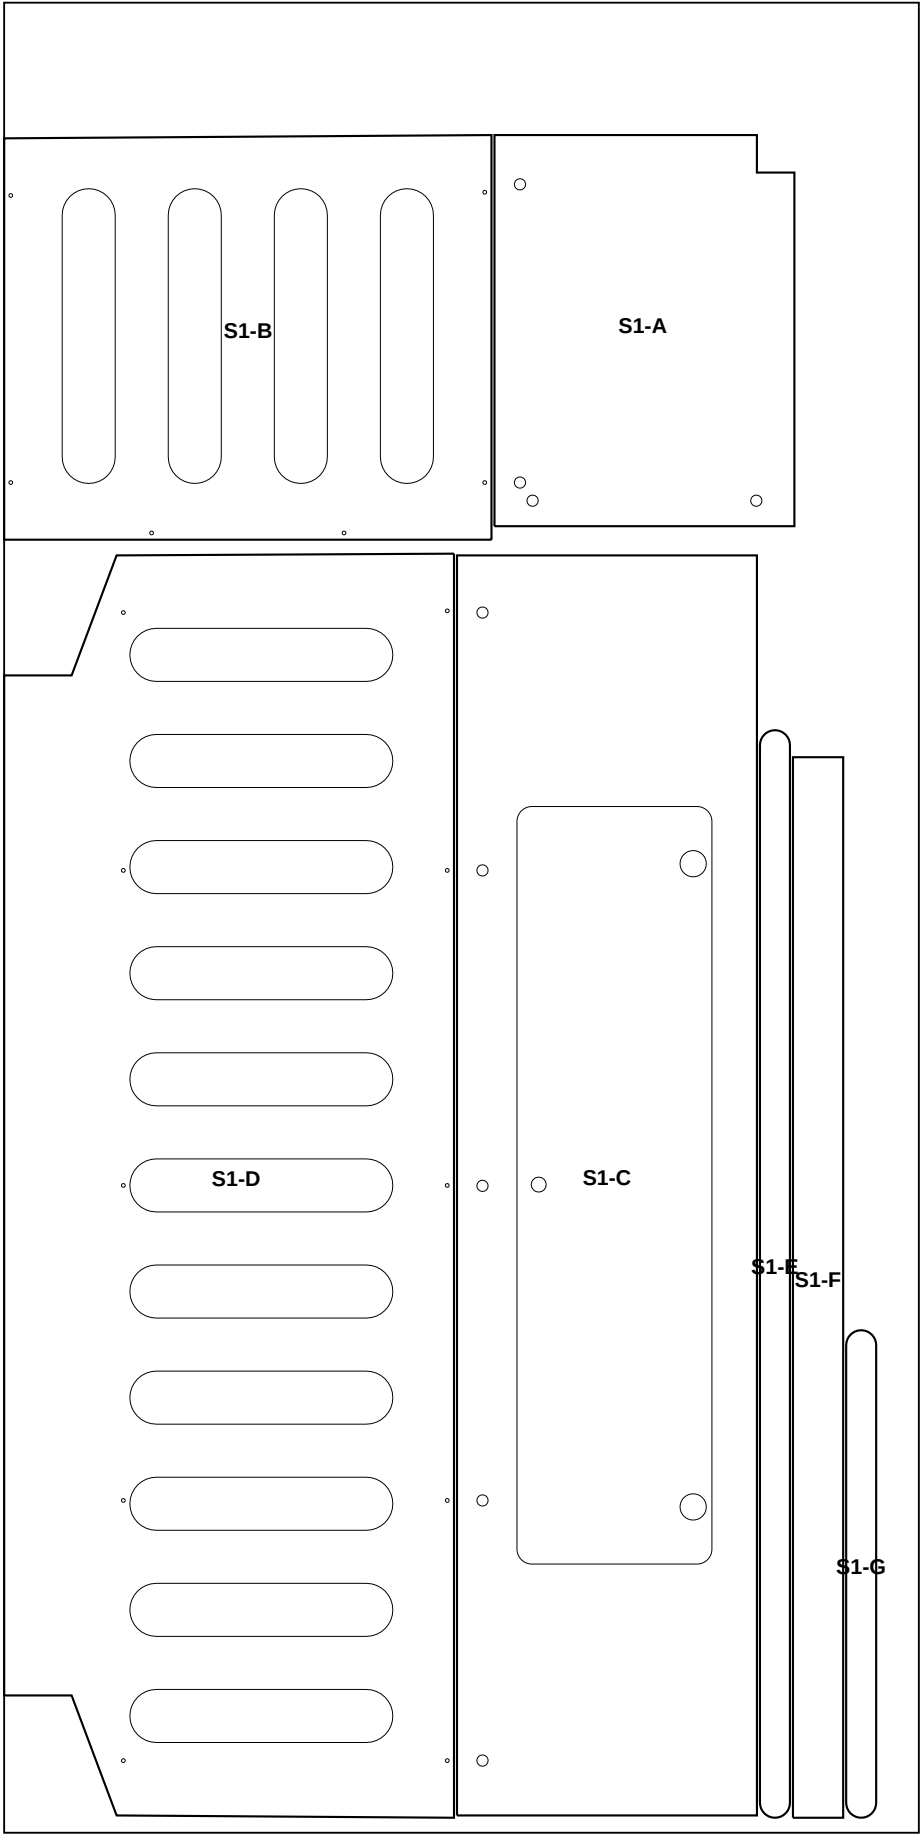


Sheet 2 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

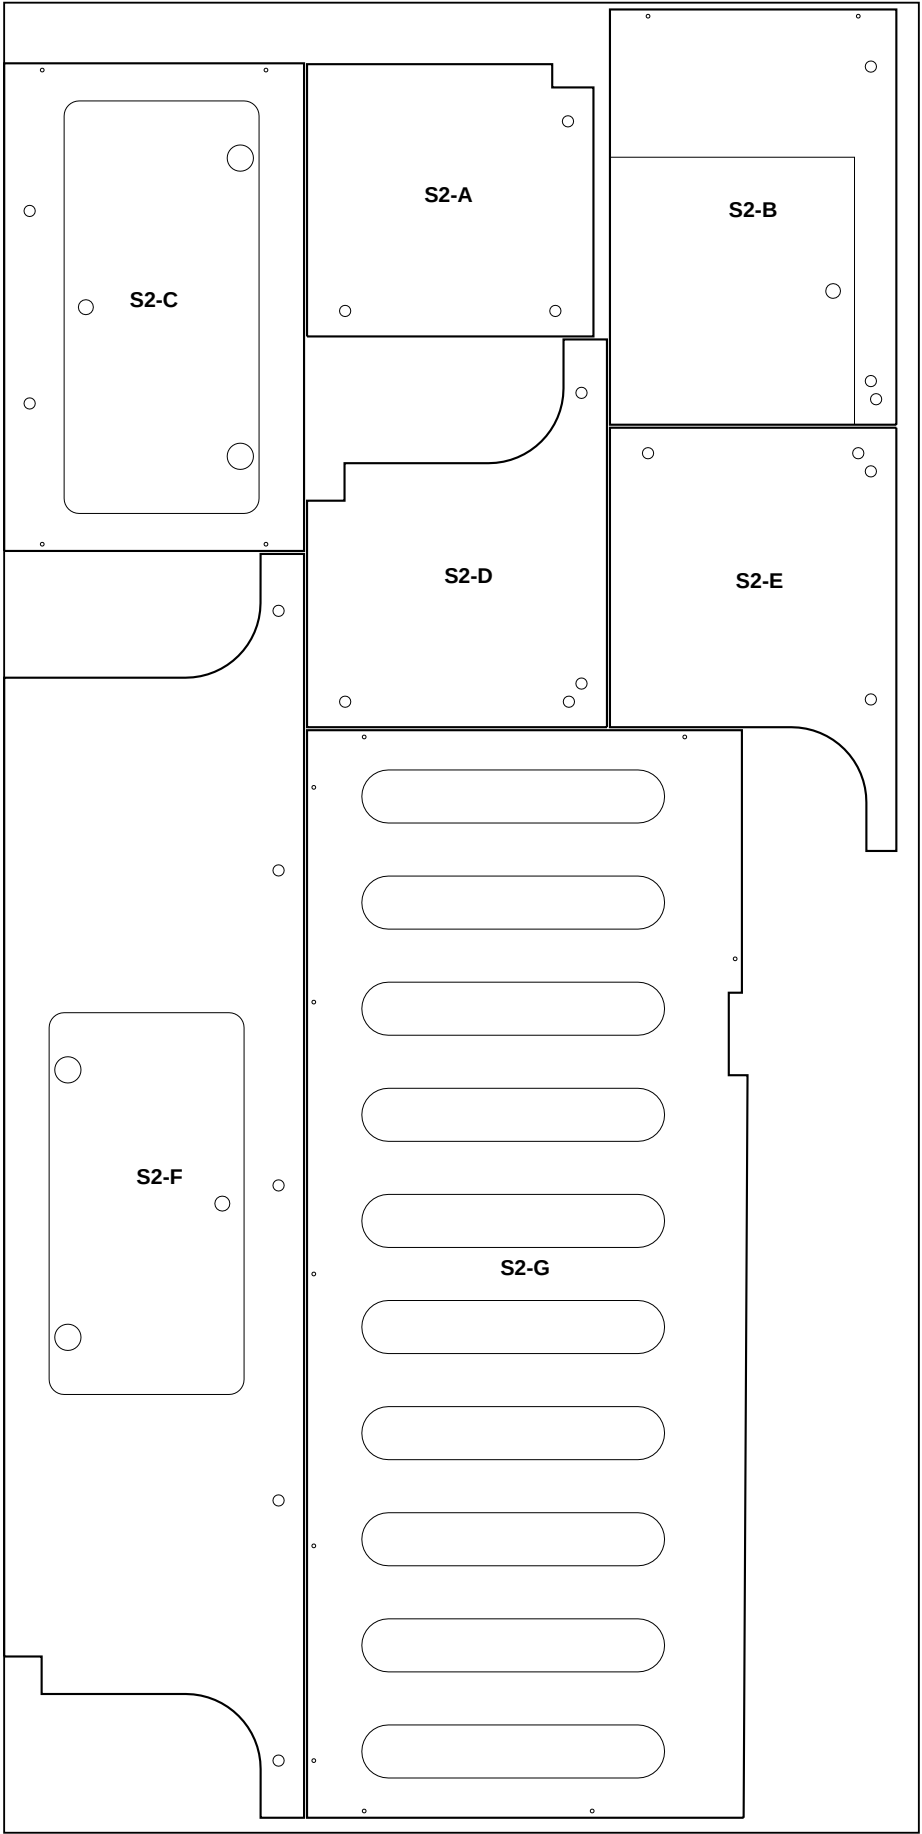


Sheet 3 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

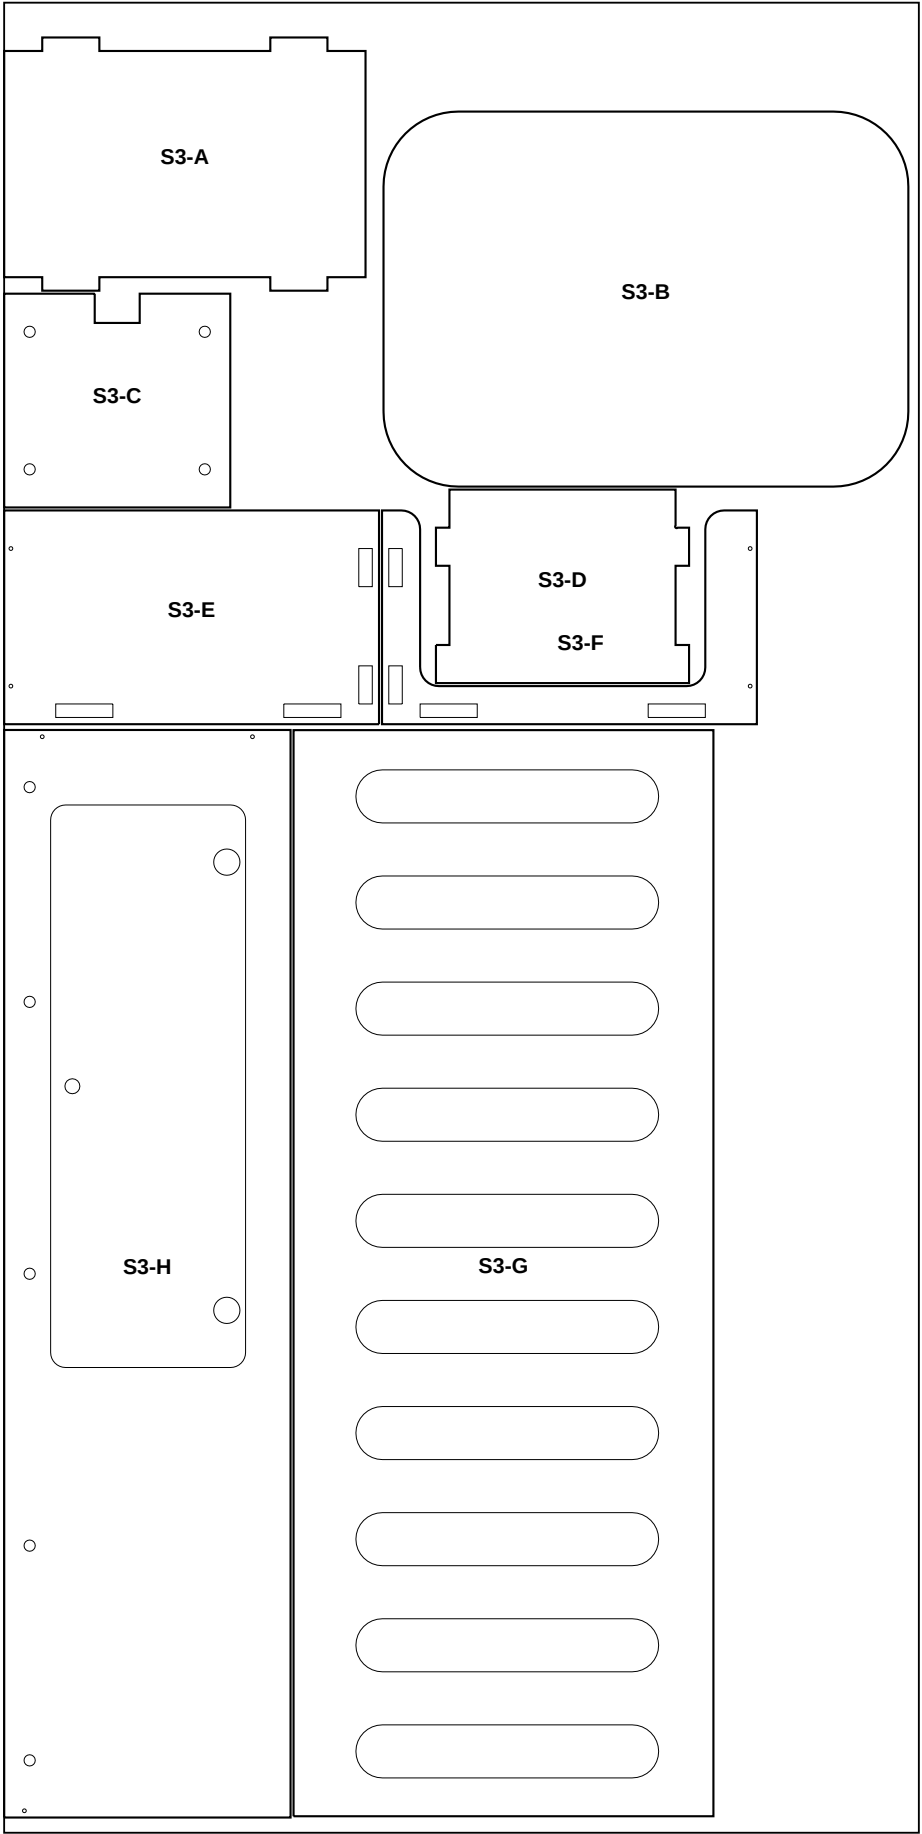


Sheet 4 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

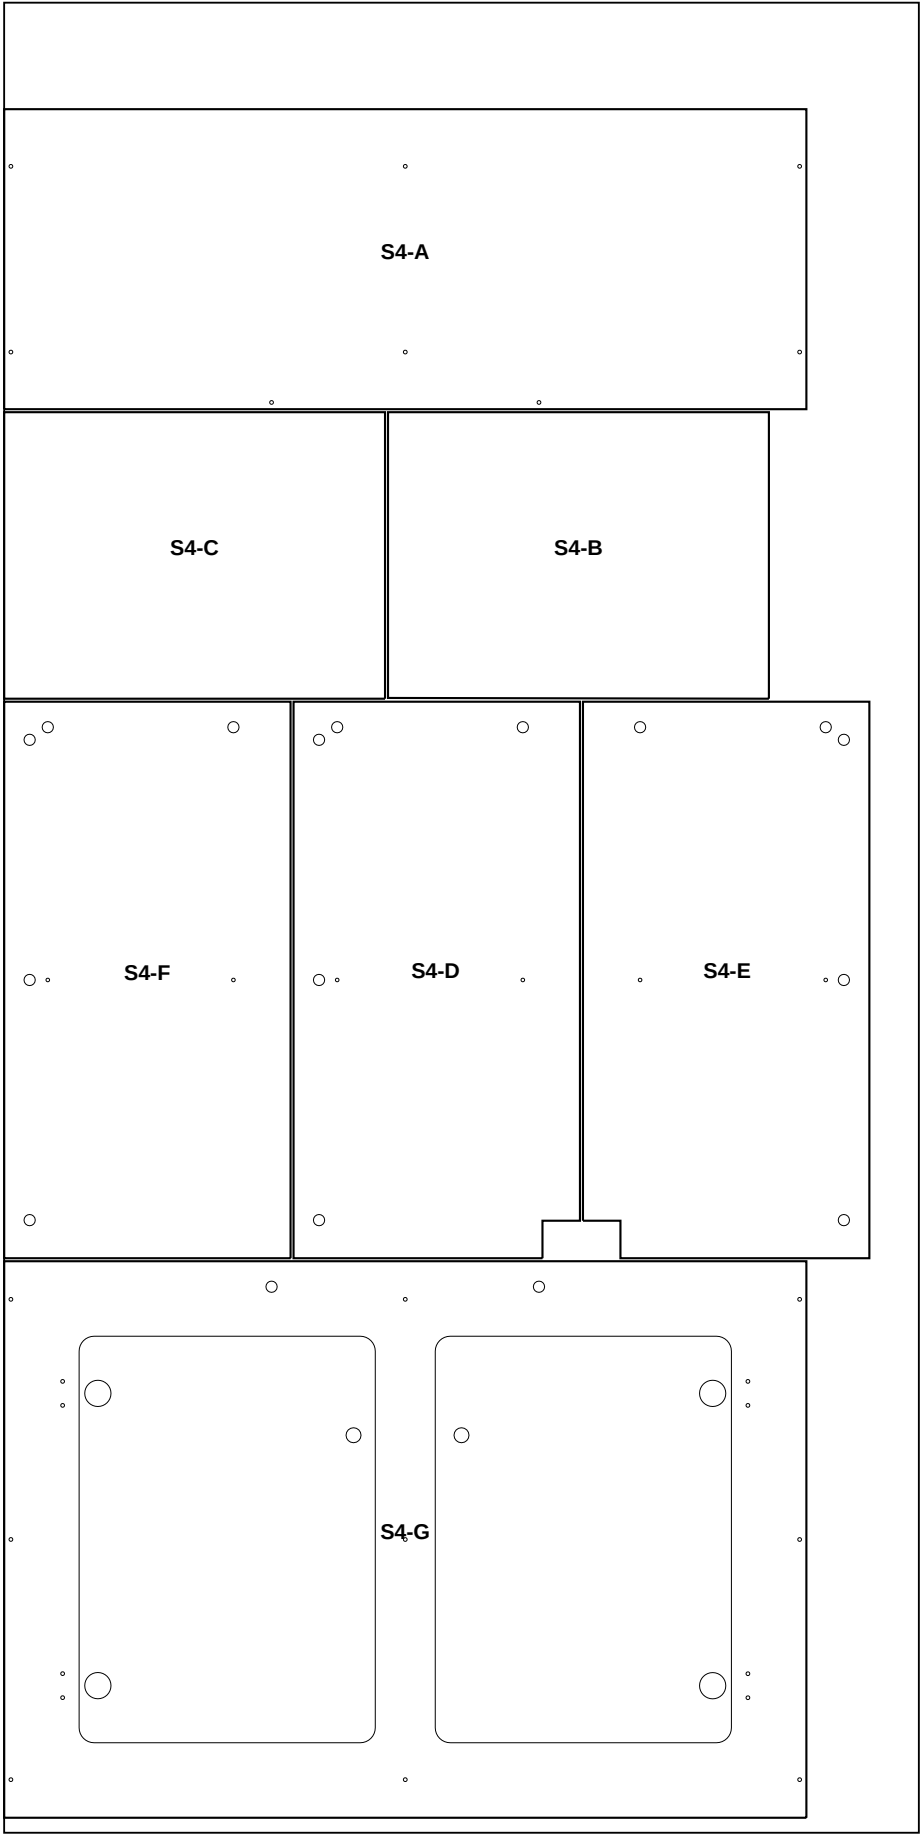

S1-A - Part detail

Overall 400.0 x 521.5 mm | 18 mm plywood | datum lower-left = X0 Y0

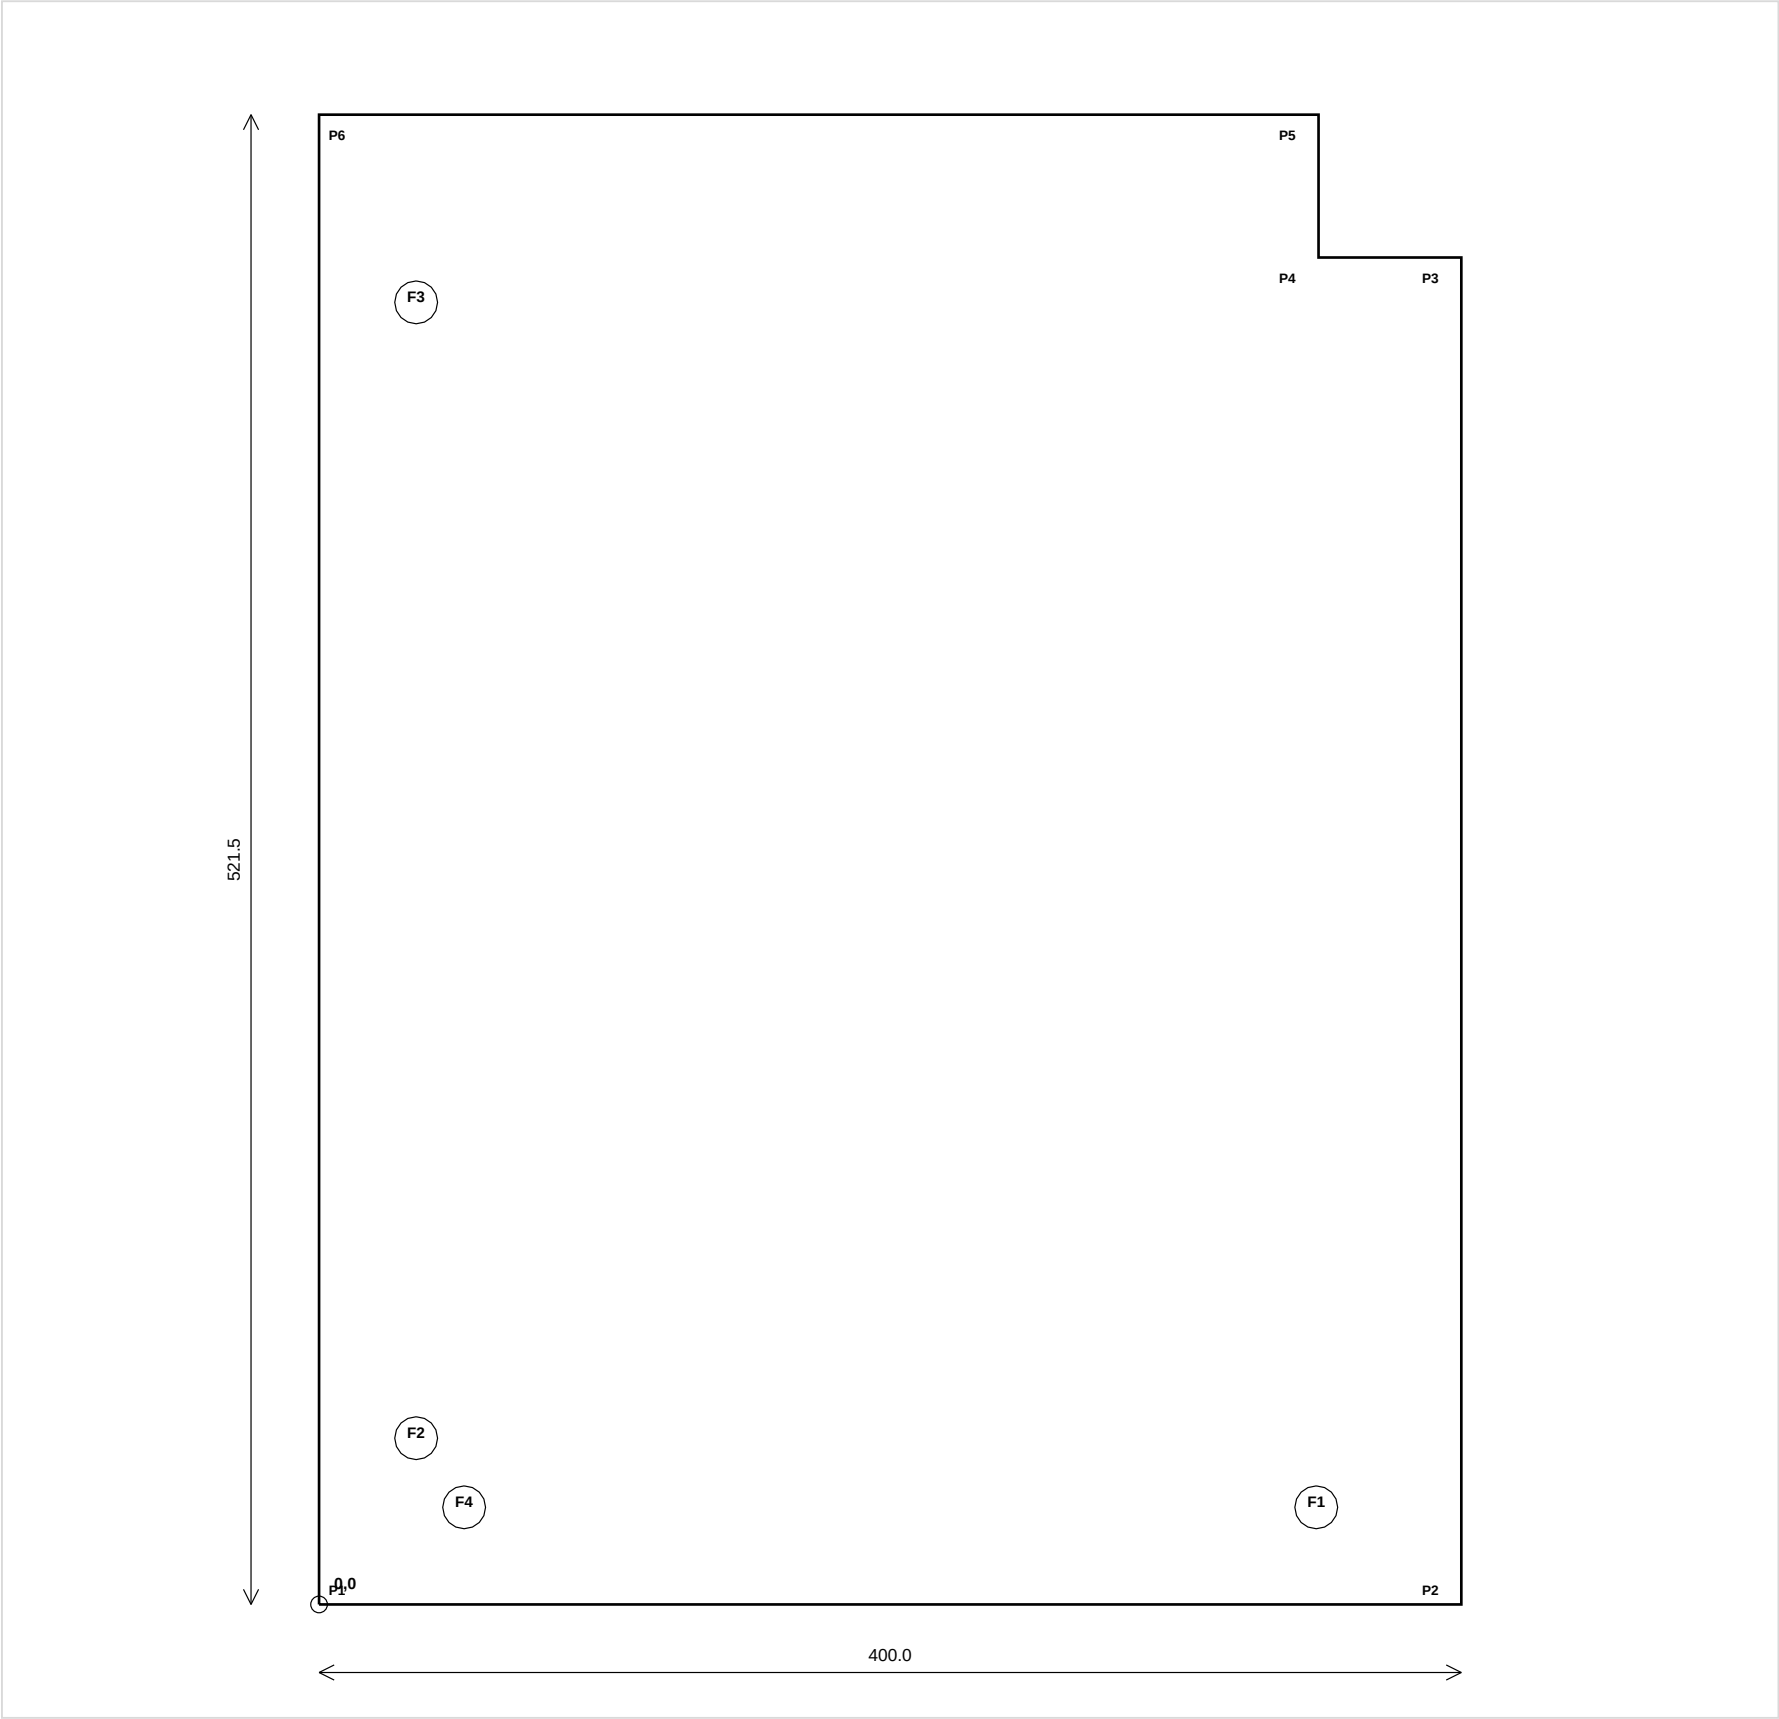

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 349.2 Y 34.0
F2	Dia 15 x 14 deep	X 34.0 Y 58.2
F3	Dia 15 x 14 deep	X 34.0 Y 455.8
F4	Dia 15 x 14 deep	X 50.8 Y 34.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X400.0 Y0.0	LINE
P3	X400.0 Y471.5	LINE
P4	X350.0 Y471.5	LINE
P5	X350.0 Y521.5	LINE
P6	X0.0 Y521.5	LINE

S1-B - Part detail

Overall 650.0 x 539.5 mm | 18 mm plywood | datum lower-left = X0 Y0

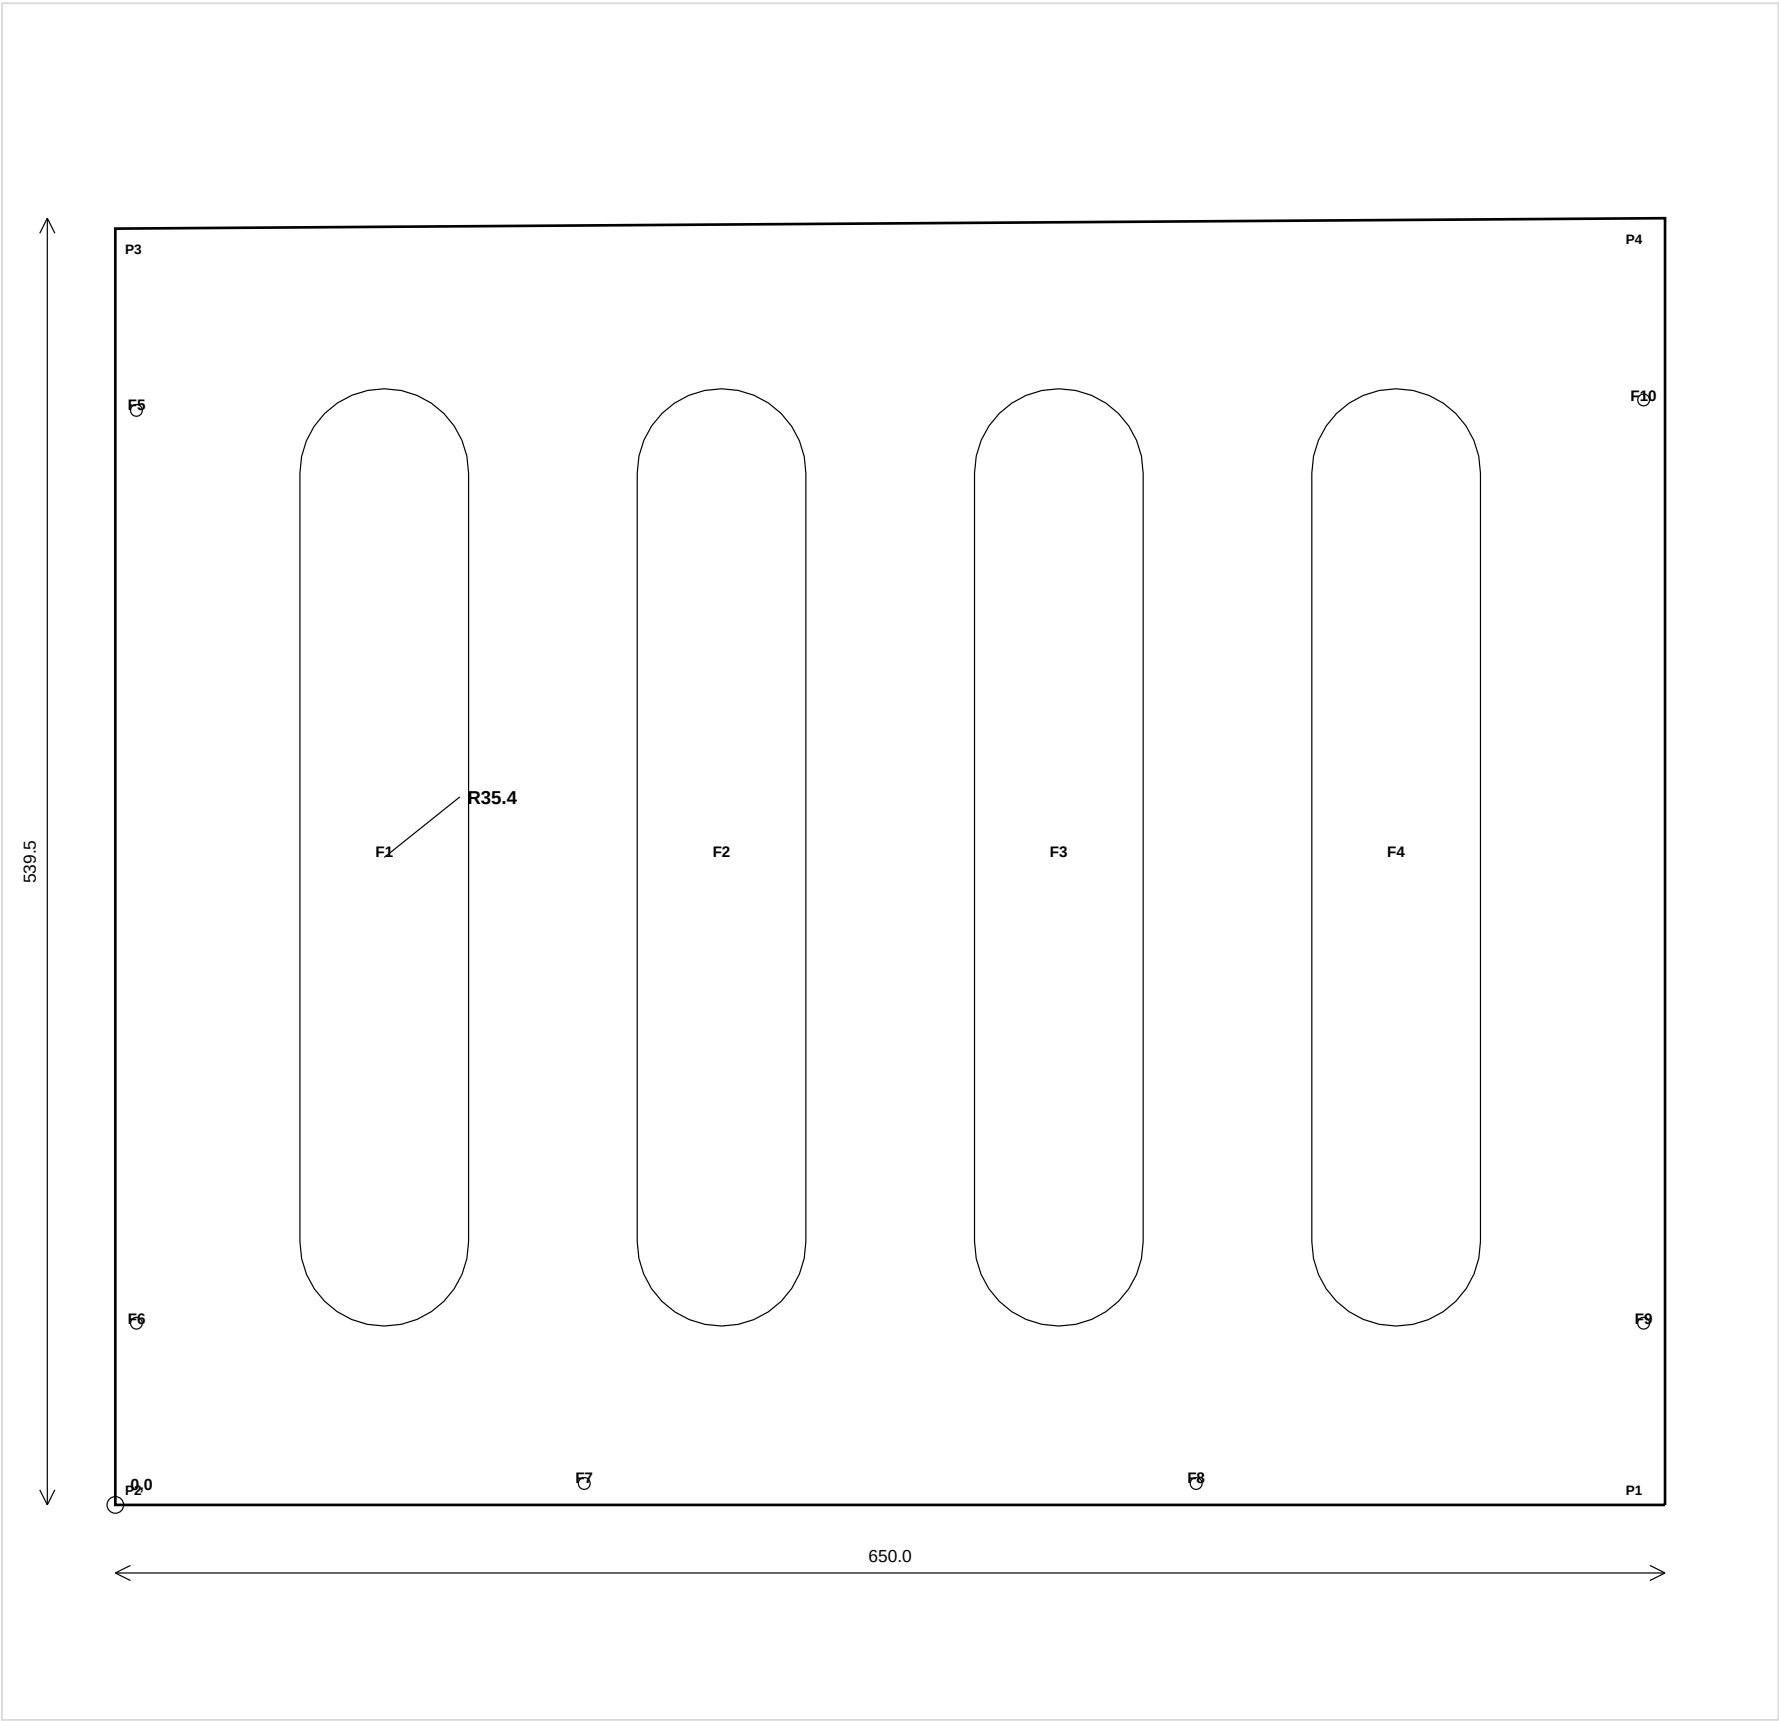

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	slot 70.7 x 393.0, R35.4	X 112.8 Y 271.5
F2	slot 70.7 x 393.0, R35.4	X 254.3 Y 271.5
F3	slot 70.7 x 393.0, R35.4	X 395.7 Y 271.5
F4	slot 70.7 x 393.0, R35.4	X 537.2 Y 271.5
F5	Dia 5 x 11 deep	X 9.0 Y 459.0
F6	Dia 5 x 11 deep	X 9.0 Y 76.0
F7	Dia 5 x 11 deep	X 196.7 Y 9.0
F8	Dia 5 x 11 deep	X 453.4 Y 9.0
F9	Dia 5 x 11 deep	X 641.0 Y 76.0
F10	Dia 5 x 11 deep	X 641.0 Y 463.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X650.0 Y0.0	LINE
P2	X0.0 Y0.0	LINE
P3	X0.0 Y535.1	LINE
P4	X650.0 Y539.5	LINE

S1-C - Part detail

Overall 400.1 x 1680.0 mm | 18 mm plywood | datum lower-left = X0 Y0

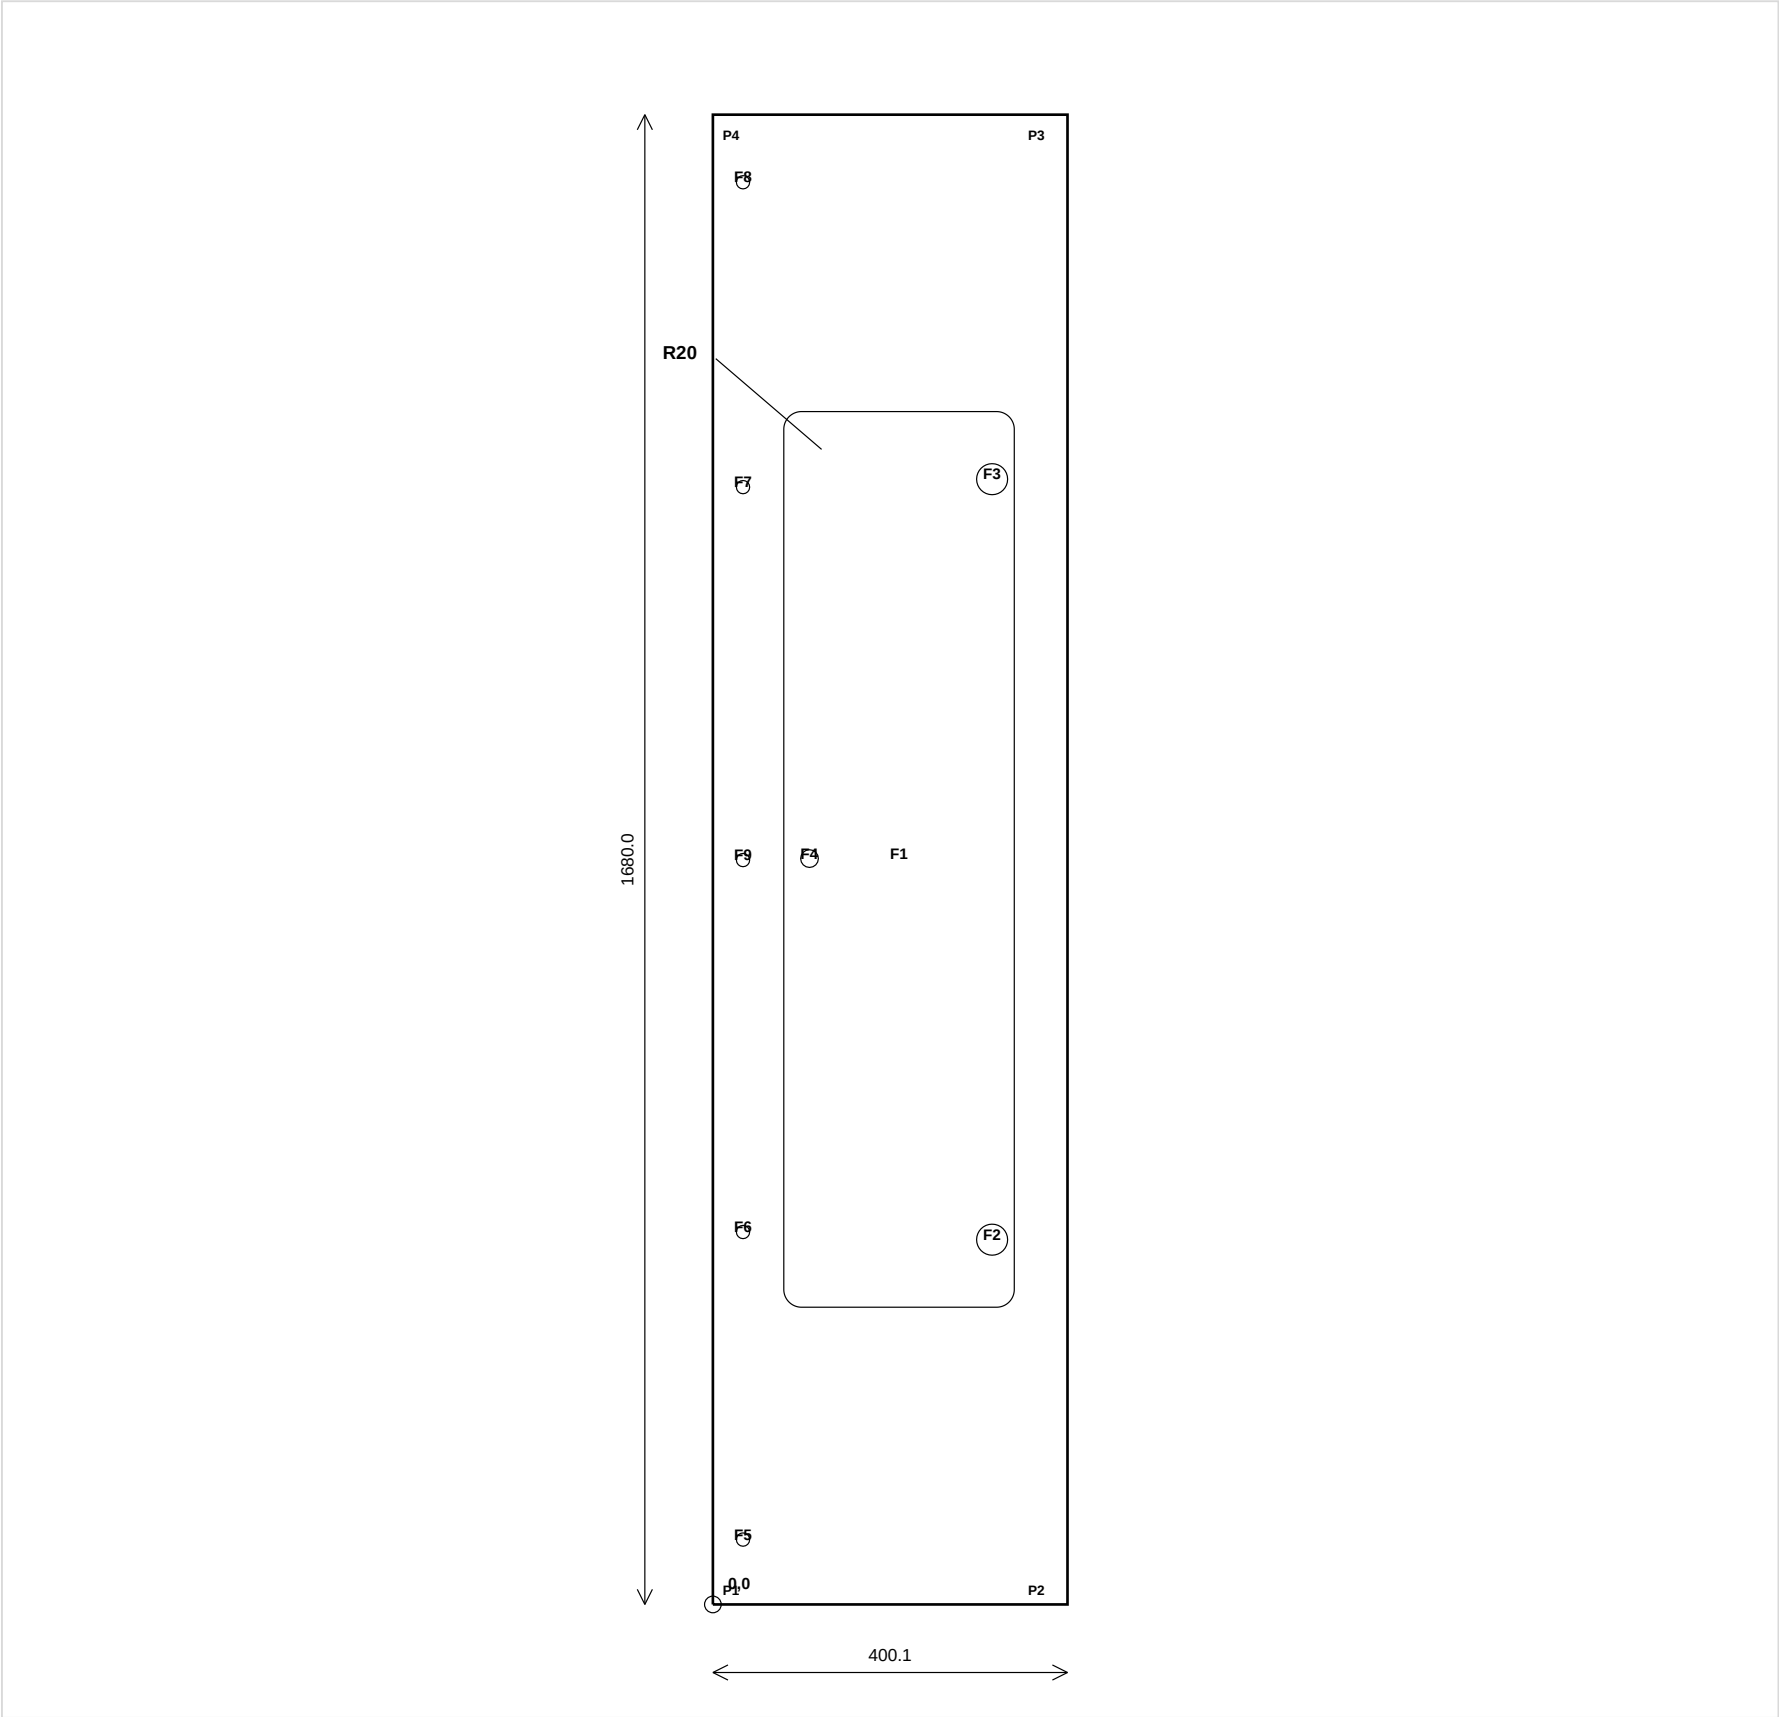

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	door cut-out 260.0 x 1010.0, R20	X 210.0 Y 840.2
F2	Dia 35 x 13 deep	X 315.0 Y 411.3
F3	Dia 35 x 13 deep	X 315.0 Y 1268.9
F4	Dia 20 THROUGH	X 109.0 Y 841.1
F5	Dia 15 x 14 deep	X 34.0 Y 73.1
F6	Dia 15 x 14 deep	X 34.0 Y 420.0
F7	Dia 15 x 14 deep	X 34.0 Y 1260.0
F8	Dia 15 x 14 deep	X 34.0 Y 1603.8
F9	Dia 15 x 14 deep	X 34.0 Y 839.4


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X400.0 Y0.0	LINE
P3	X400.1 Y1680.0	LINE
P4	X0.0 Y1680.0	LINE

S1-D - Part detail

Overall 600.0 x 1685.4 mm | 18 mm plywood | datum lower-left = X0 Y0

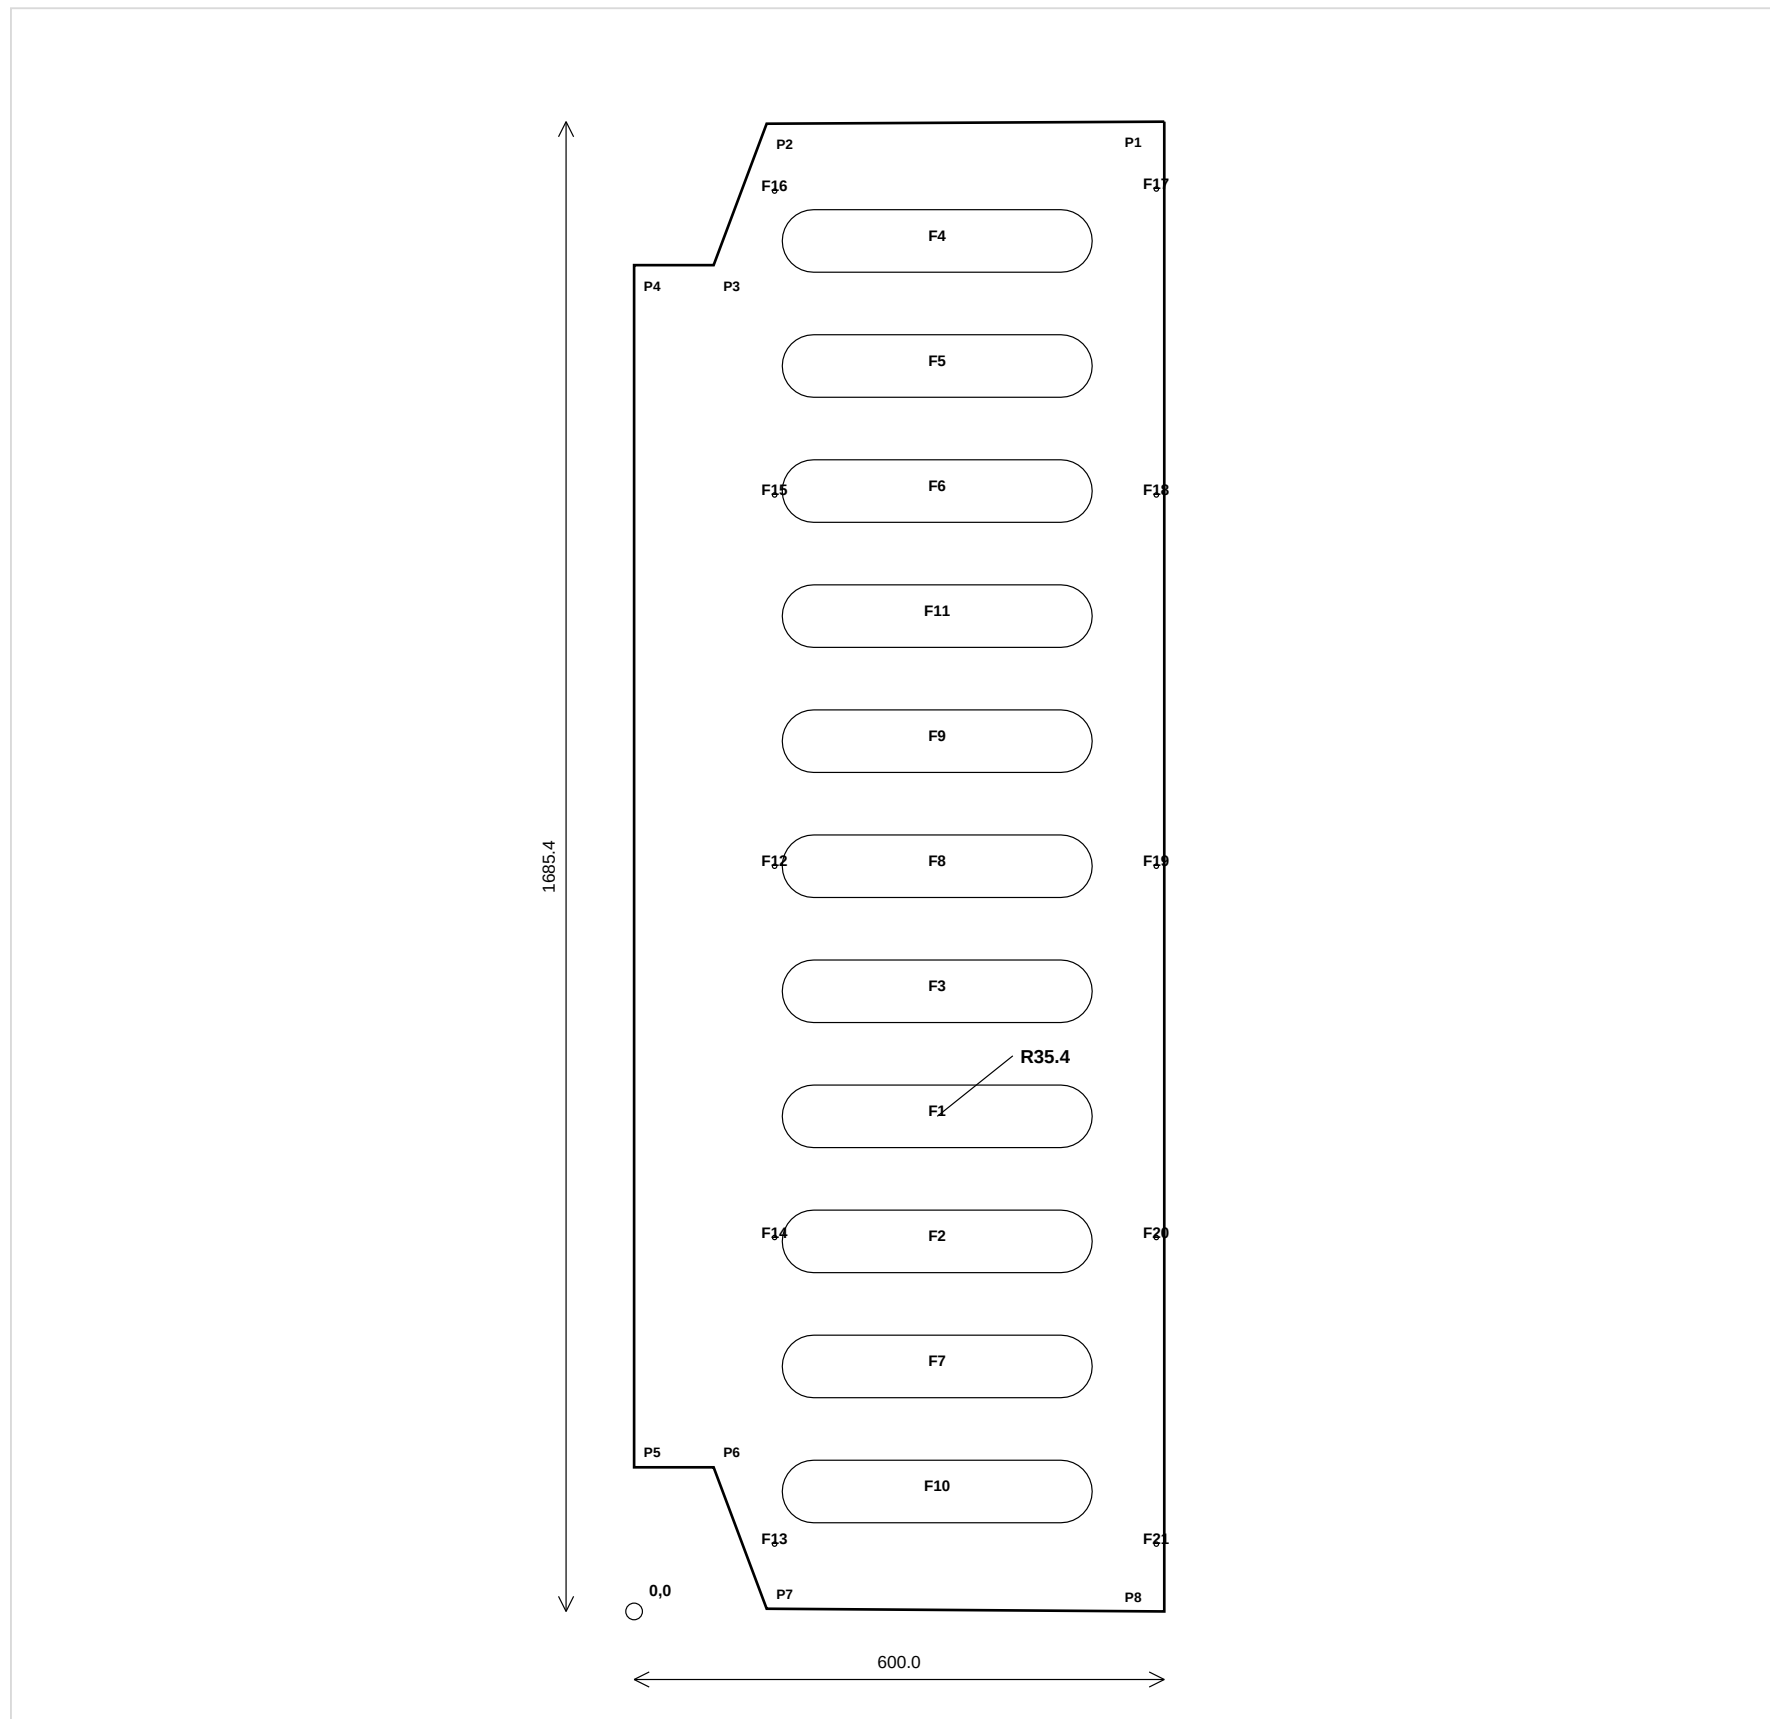

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1	slot 350.7 x 70.7, R35.4	X 343.1 Y 560.1
F2	slot 350.7 x 70.7, R35.4	X 343.1 Y 418.6
F3	slot 350.7 x 70.7, R35.4	X 343.1 Y 701.6
F4	slot 350.7 x 70.7, R35.4	X 343.1 Y 1550.4
F5	slot 350.7 x 70.7, R35.4	X 343.1 Y 1409.0
F6	slot 350.7 x 70.7, R35.4	X 343.1 Y 1267.5
F7	slot 350.7 x 70.7, R35.4	X 343.1 Y 277.2
F8	slot 350.7 x 70.7, R35.4	X 343.1 Y 843.1
F9	slot 350.7 x 70.7, R35.4	X 343.1 Y 984.5
F10	slot 350.7 x 70.7, R35.4	X 343.1 Y 135.7
F11	slot 350.7 x 70.7, R35.4	X 343.1 Y 1126.0
F12	Dia 5 x 11 deep	X 159.0 Y 843.0
F13	Dia 5 x 11 deep	X 159.0 Y 76.0
F14	Dia 5 x 11 deep	X 159.0 Y 423.0
F15	Dia 5 x 11 deep	X 159.0 Y 1263.0
F16	Dia 5 x 11 deep	X 159.0 Y 1607.0
F17	Dia 5 x 11 deep	X 591.0 Y 1609.0
F18	Dia 5 x 11 deep	X 591.0 Y 1263.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.


P1	X600.0 Y1685.4	LINE
P2	X150.0 Y1683.1	LINE
P3	X90.0 Y1523.1	LINE
P4	X0.0 Y1523.1	LINE
P5	X0.0 Y163.1	LINE
P6	X90.0 Y163.1	LINE
P7	X150.0 Y3.1	LINE
P8	X600.0 Y0.0	LINE

Machining features - continued

F19	Dia 5 x 11 deep	X 591.0 Y 843.0
F20	Dia 5 x 11 deep	X 591.0 Y 423.0
F21	Dia 5 x 11 deep	X 591.0 Y 76.0

S1-E - Part detail

Overall 40.0 x 1450.0 mm | 18 mm plywood | datum lower-left = X0 Y0

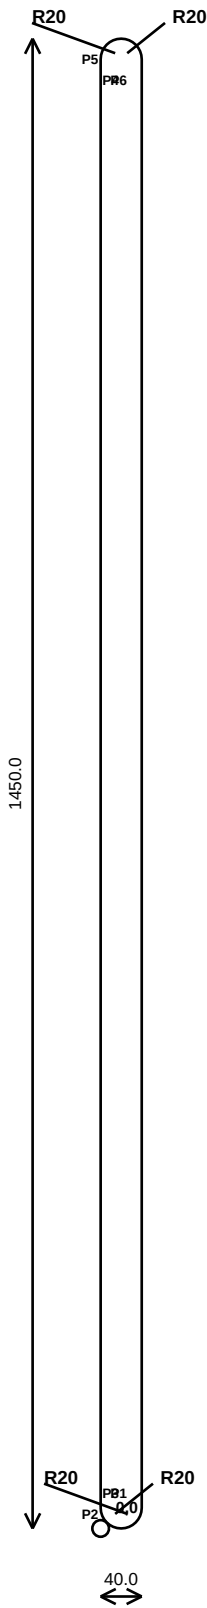

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y20.0	ARC R20 CCW
P2	X20.0 Y0.0	ARC R20 CCW
P3	X40.0 Y20.0	LINE
P4	X40.0 Y1430.0	ARC R20 CCW
P5	X20.0 Y1450.0	ARC R20 CCW
P6	X0.0 Y1430.0	LINE

S1-F - Part detail

Overall 67.0 x 1414.0 mm | 18 mm plywood | datum lower-left = X0 Y0

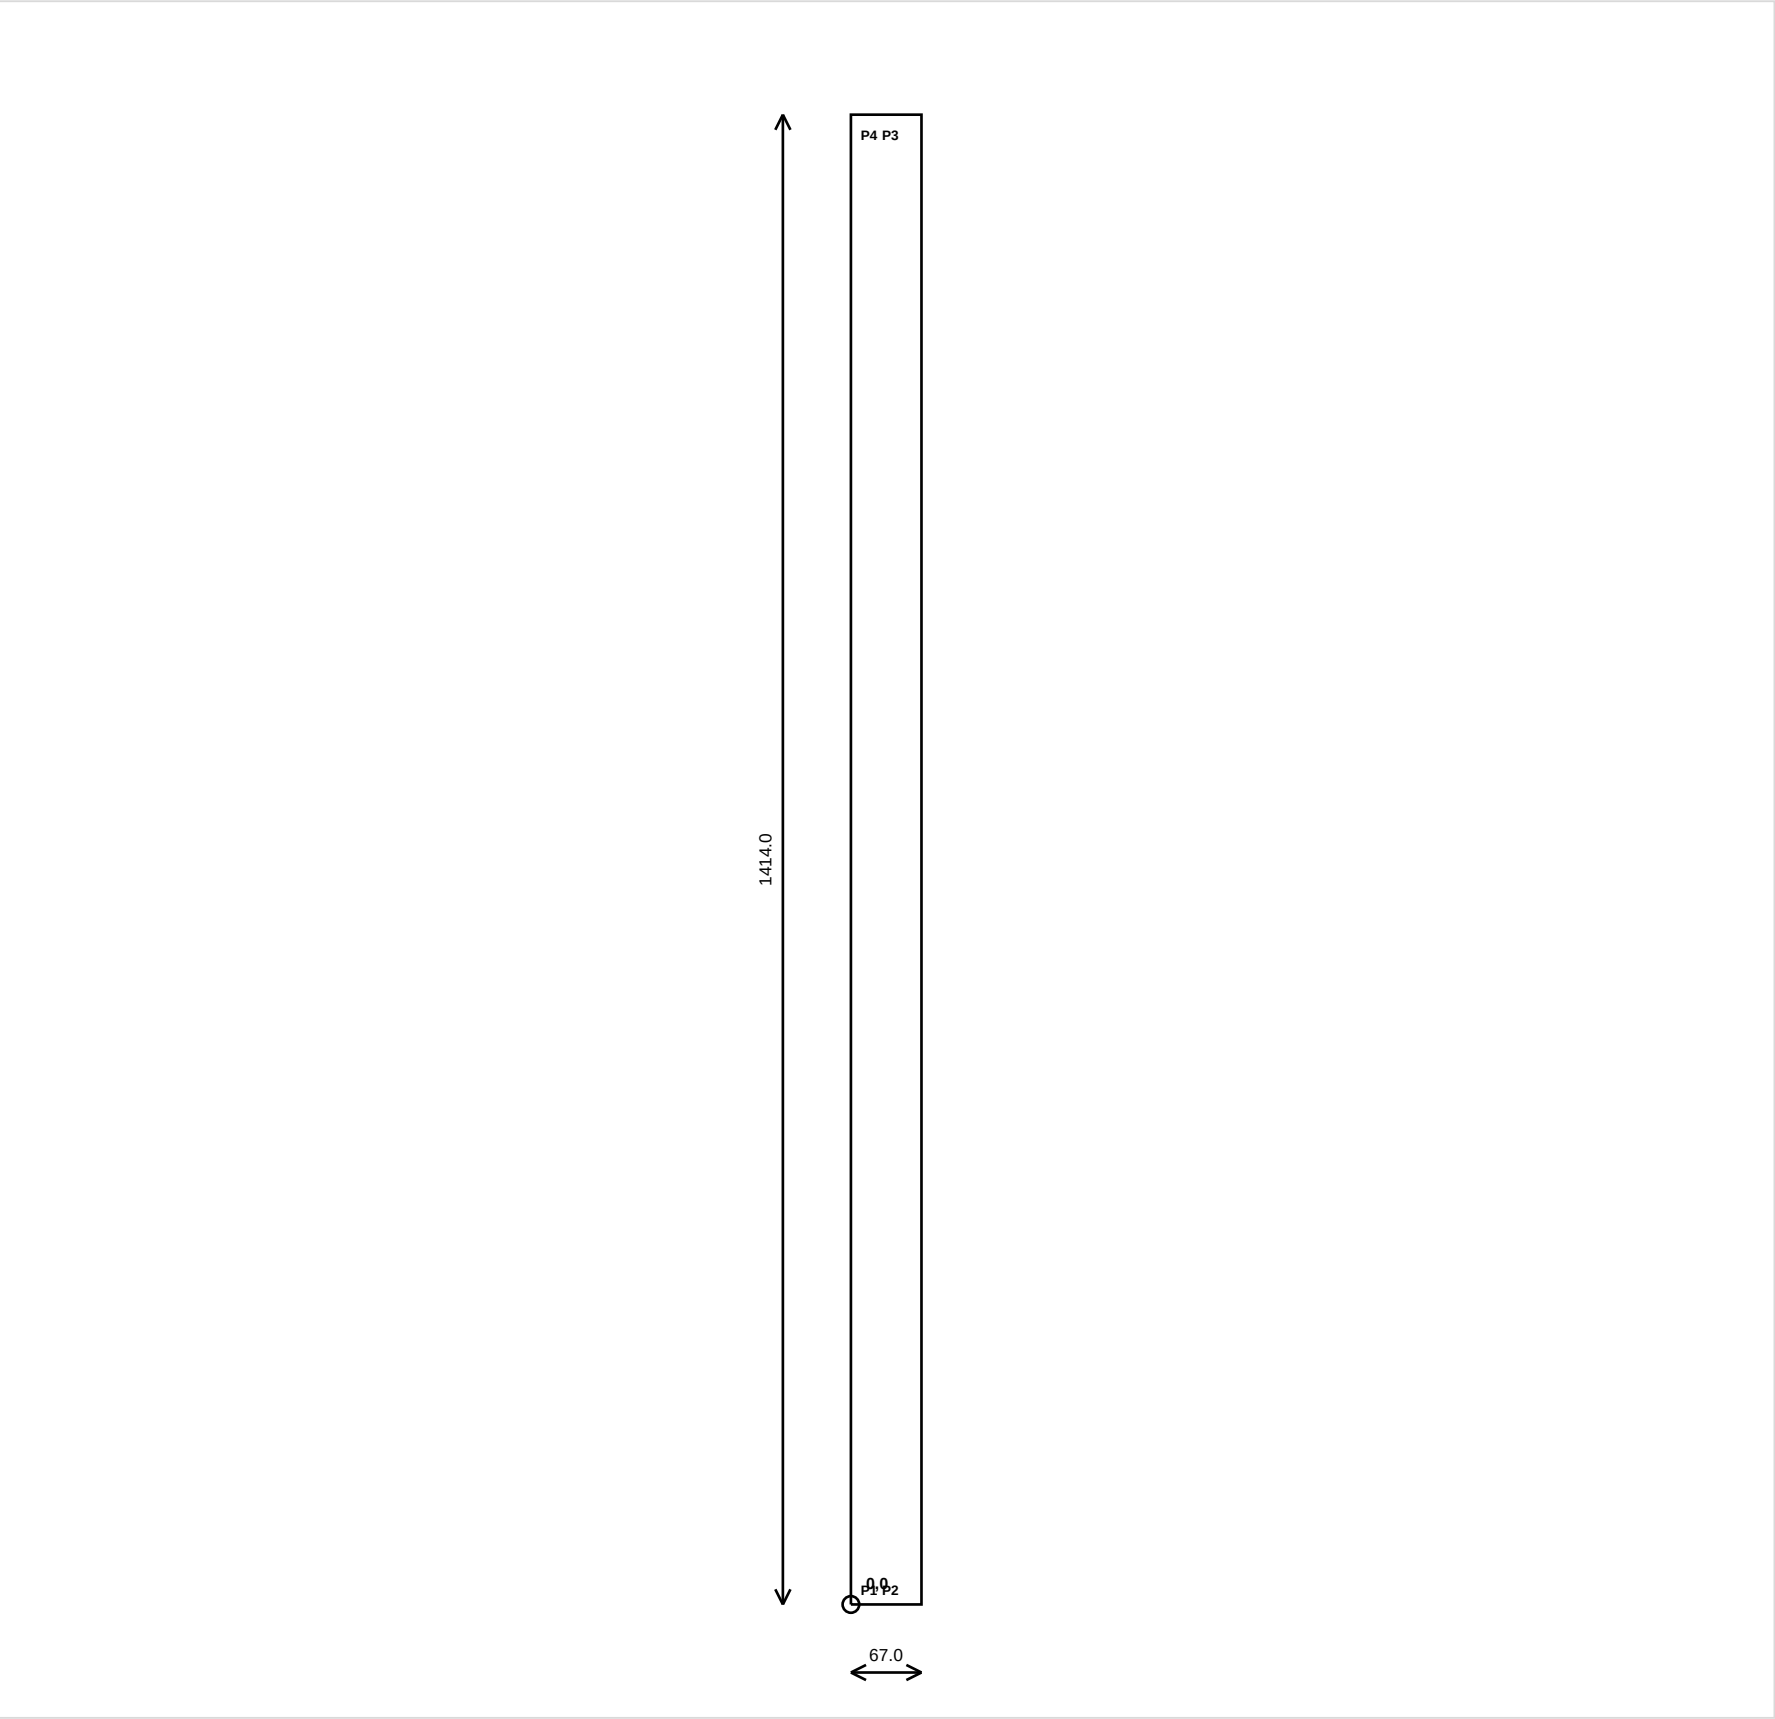

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X67.0 Y0.0	LINE
P3	X67.0 Y1414.0	LINE
P4	X0.0 Y1414.0	LINE

S1-G - Part detail

Overall 40.0 x 650.0 mm | 18 mm plywood | datum lower-left = X0 Y0

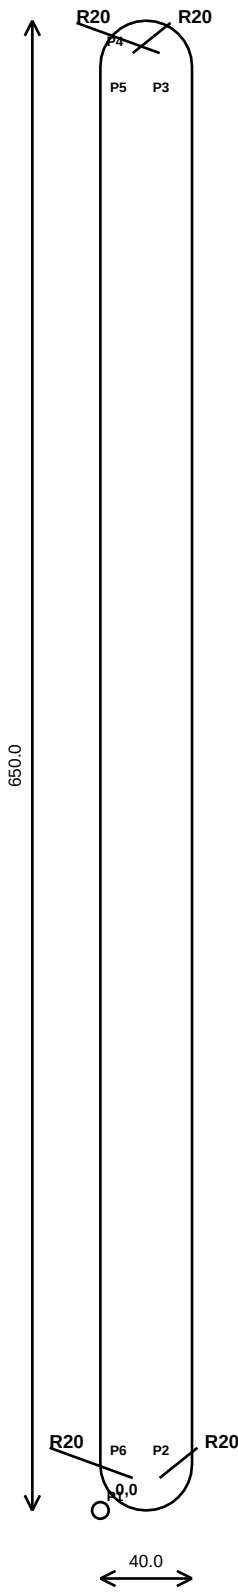

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X20.0 Y0.0	ARC R20 CCW
P2	X40.0 Y20.0	LINE
P3	X40.0 Y630.0	ARC R20 CCW
P4	X20.0 Y650.0	ARC R20 CCW
P5	X0.0 Y630.0	LINE
P6	X0.0 Y20.0	ARC R20 CCW

S2-A - Part detail

Overall 382.0 x 363.0 mm | 18 mm plywood | datum lower-left = X0 Y0

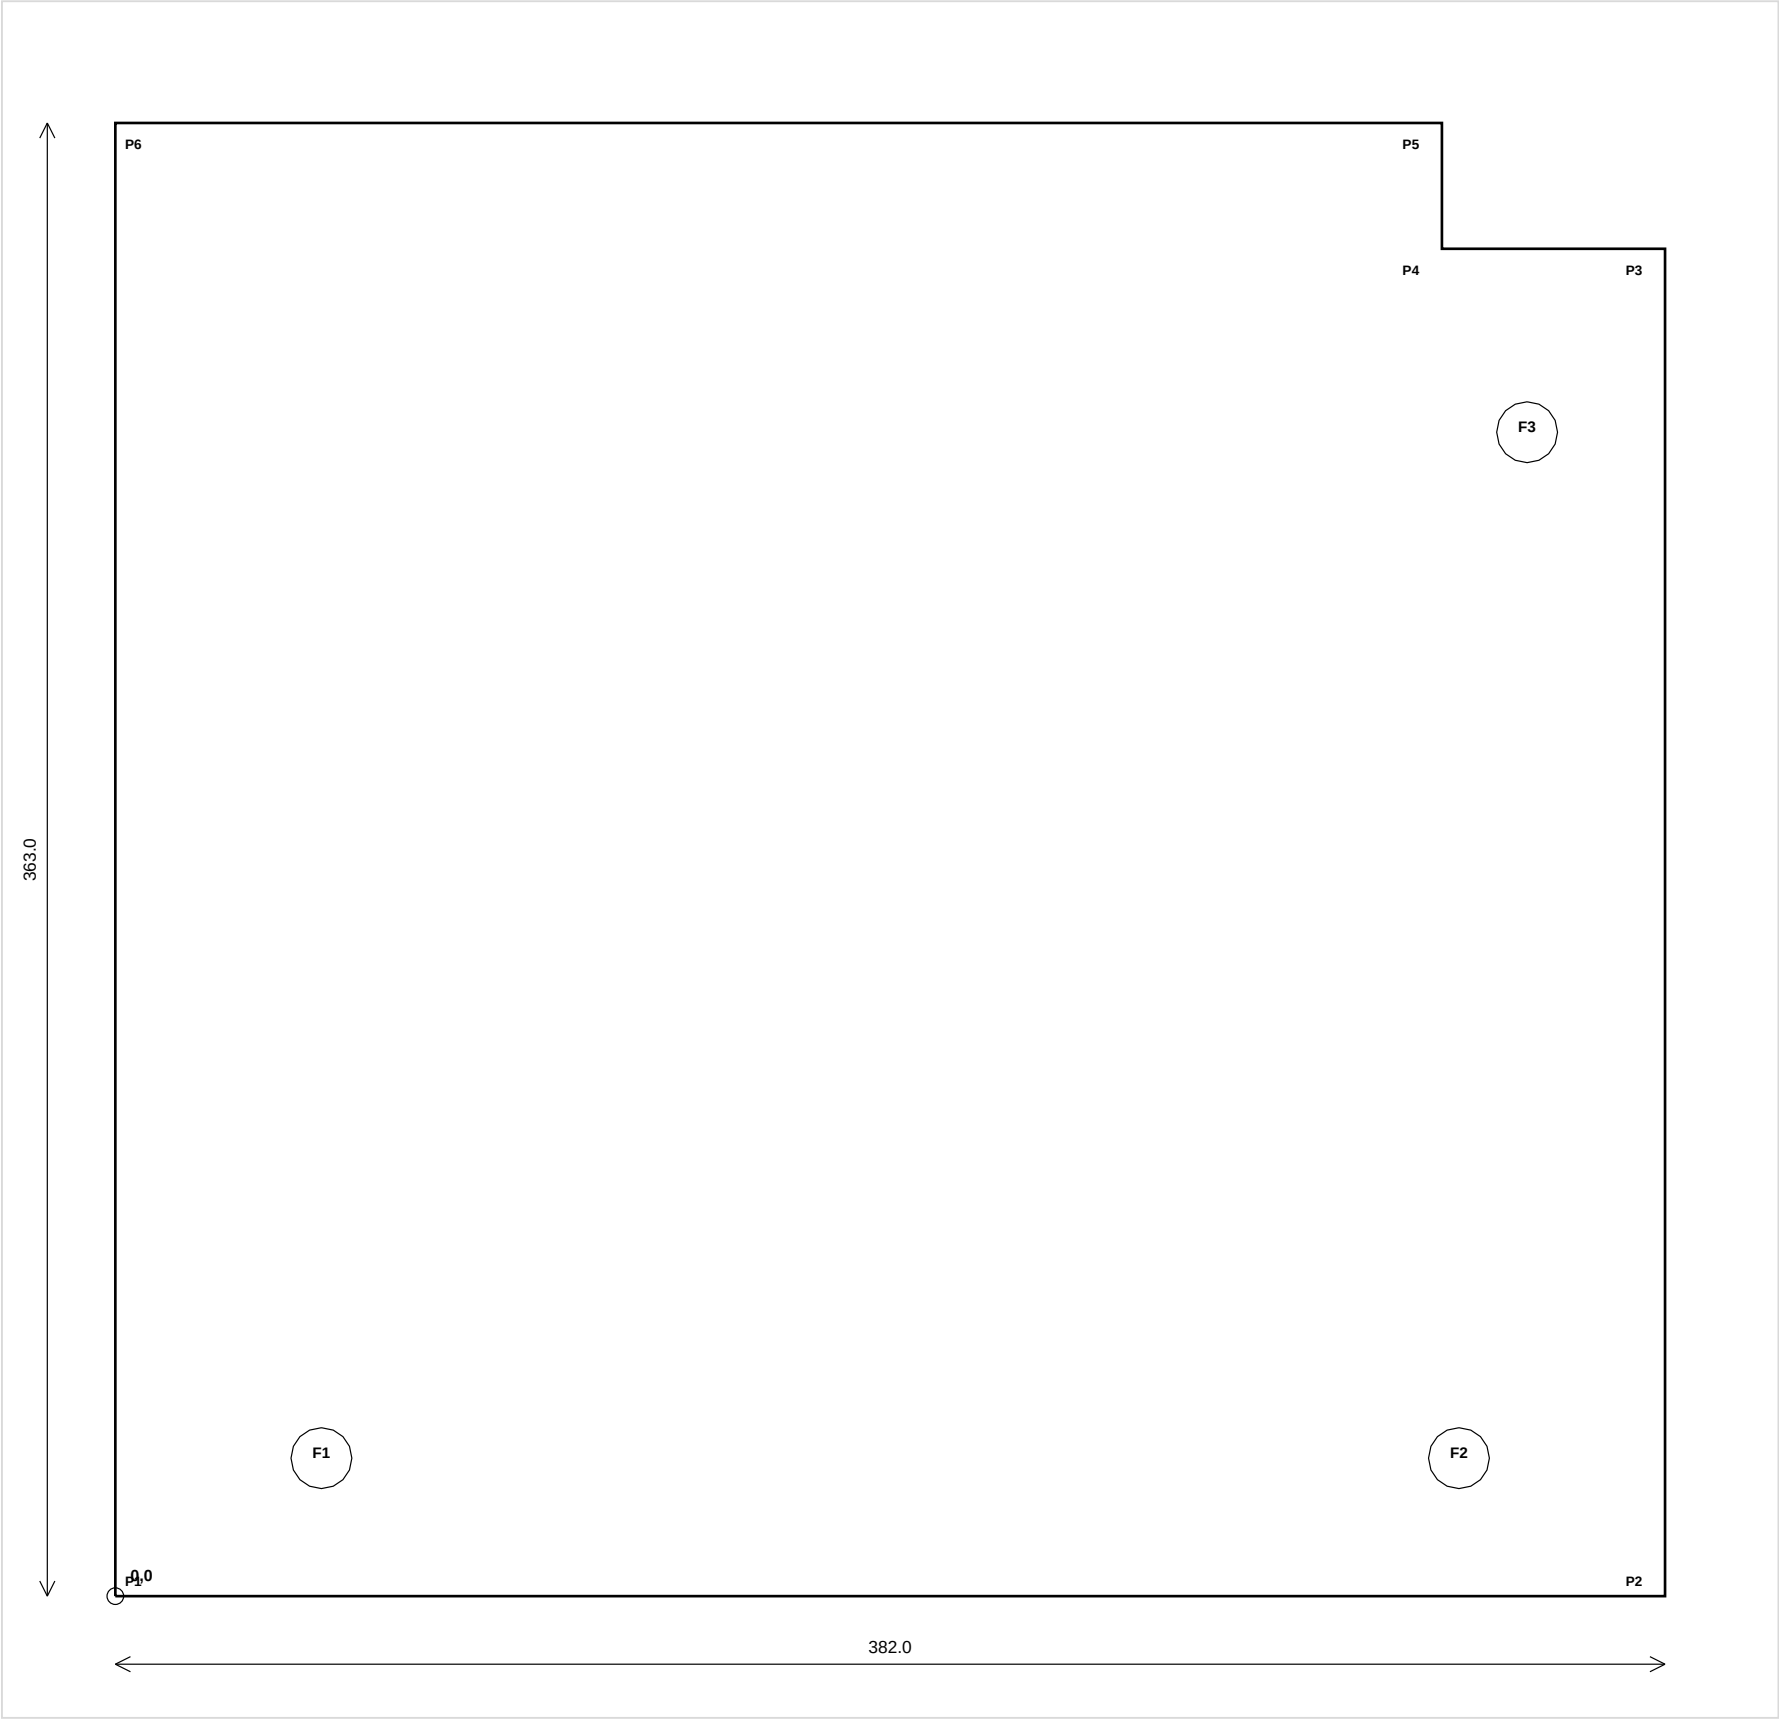

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 50.8 Y 34.0
F2	Dia 15 x 14 deep	X 331.2 Y 34.0
F3	Dia 15 x 14 deep	X 348.0 Y 286.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X382.0 Y0.0	LINE
P3	X382.0 Y332.0	LINE
P4	X327.0 Y332.0	LINE
P5	X327.0 Y363.0	LINE
P6	X0.0 Y363.0	LINE

S2-B - Part detail

Overall 382.0 x 553.6 mm | 18 mm plywood | datum lower-left = X0 Y0

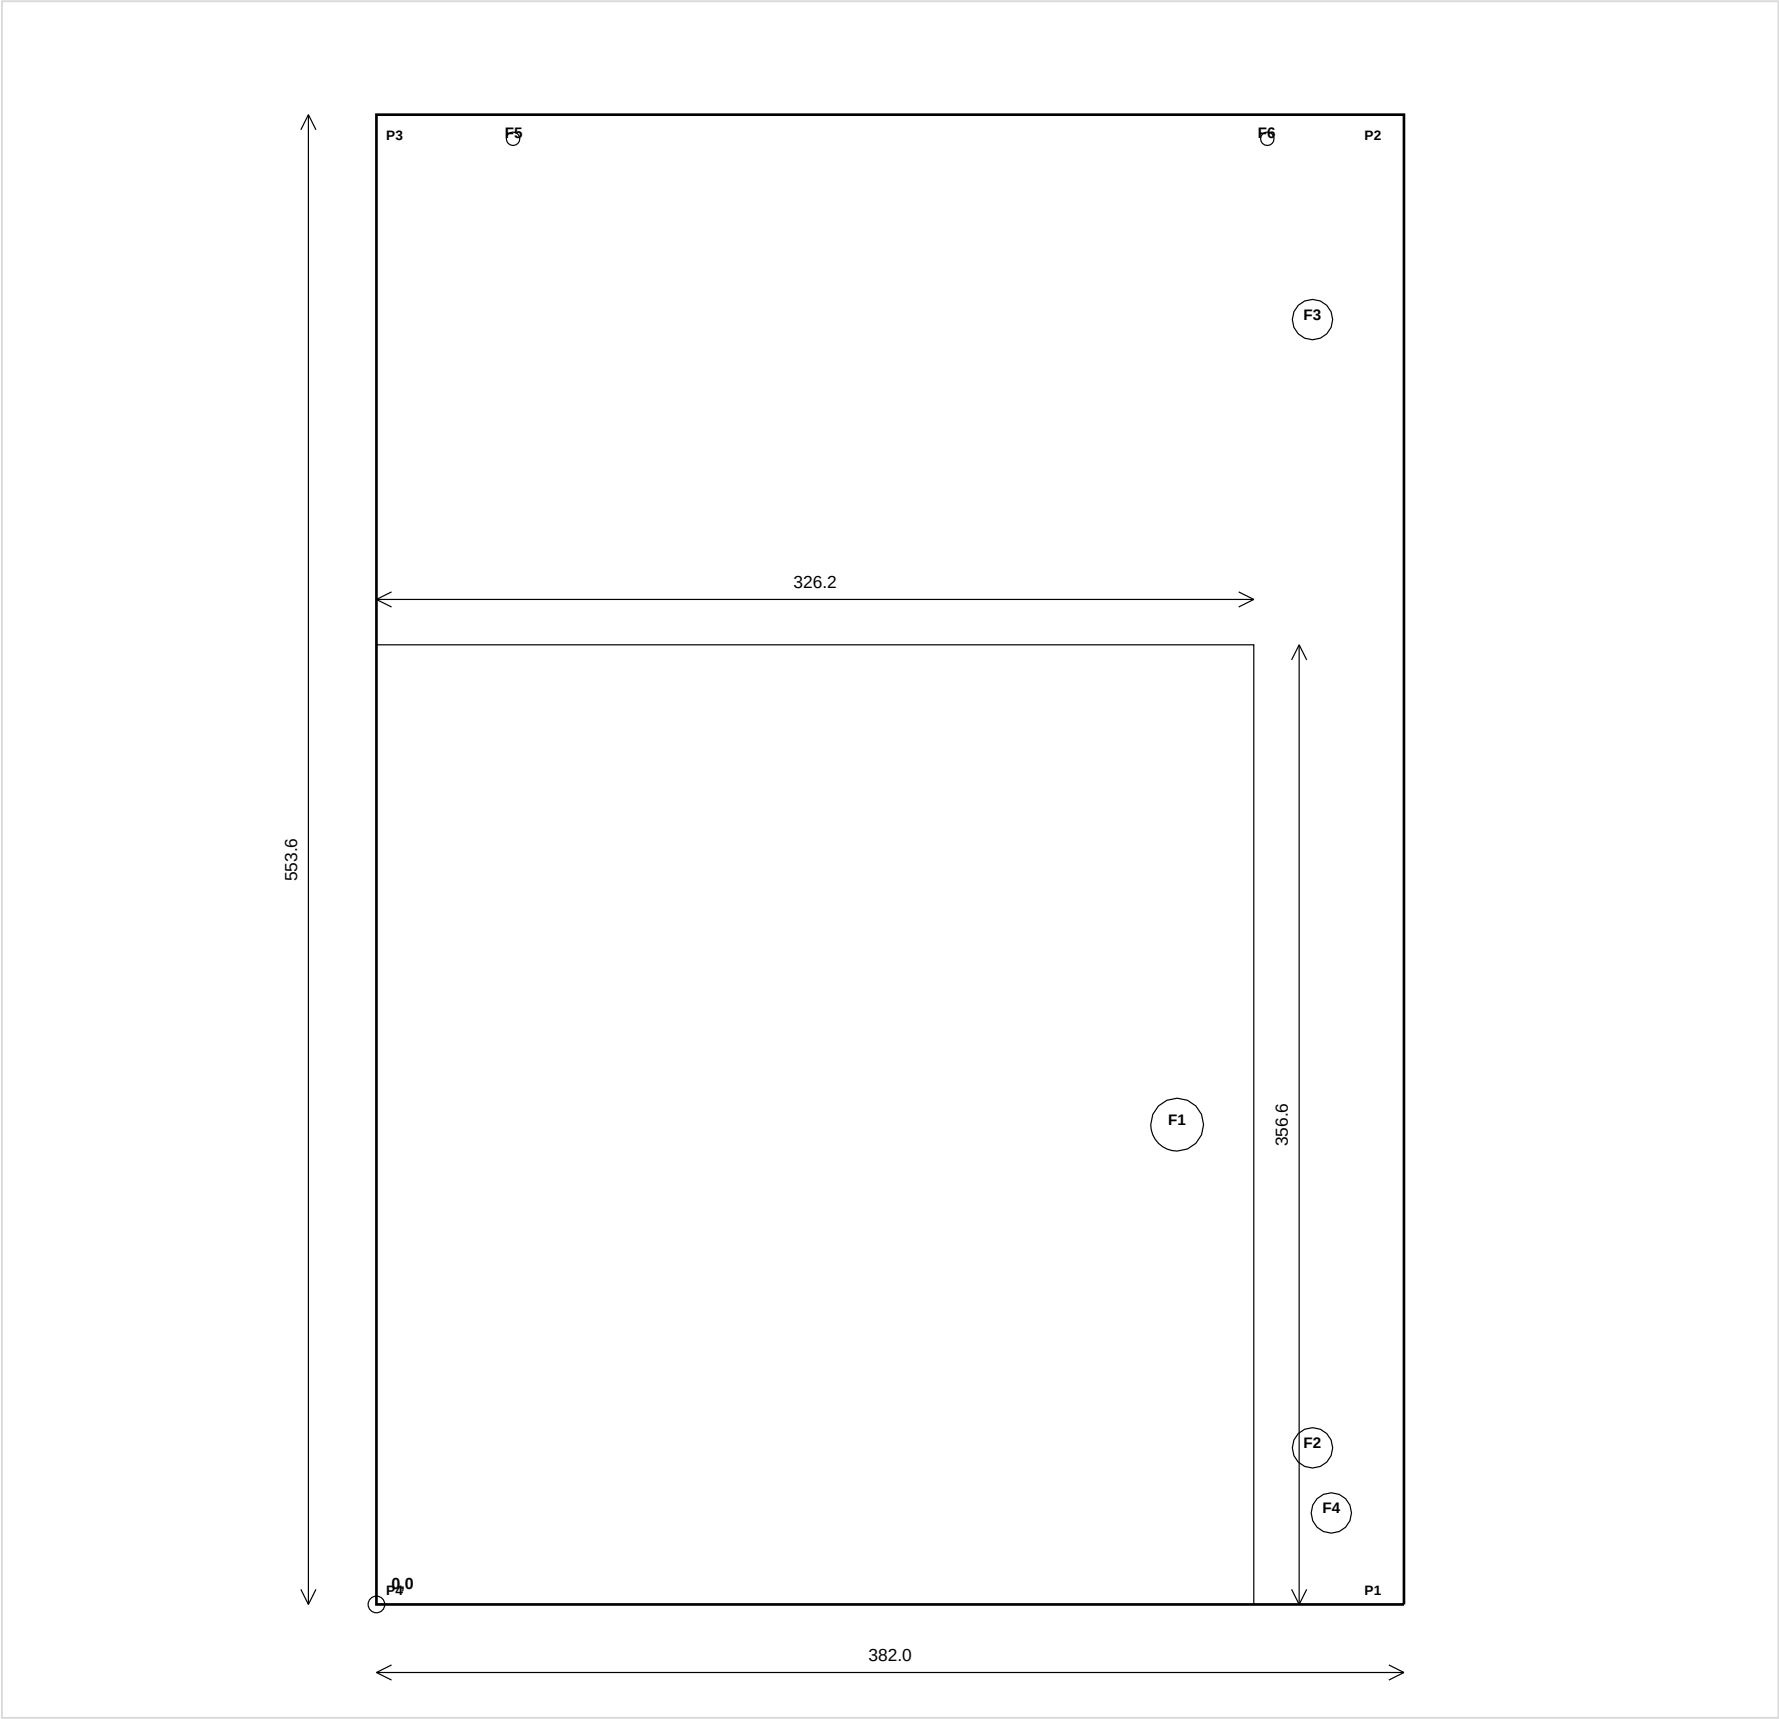

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 20 THROUGH	X 297.7 Y 178.3
F2	Dia 15 x 14 deep	X 348.0 Y 58.2
F3	Dia 15 x 14 deep	X 348.0 Y 477.5
F4	Dia 15 x 14 deep	X 355.0 Y 34.0
F5	Dia 5 x 11 deep	X 51.0 Y 545.0
F6	Dia 5 x 11 deep	X 331.0 Y 545.0
F7	drawer/door cut: horizontal 326.2 mm, then vertical 356.6 mm	


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X382.0 Y0.0	LINE
P2	X382.0 Y553.6	LINE
P3	X0.0 Y553.6	LINE
P4	X0.0 Y0.0	LINE

S2-C - Part detail

Overall 400.0 x 650.2 mm | 18 mm plywood | datum lower-left = X0 Y0

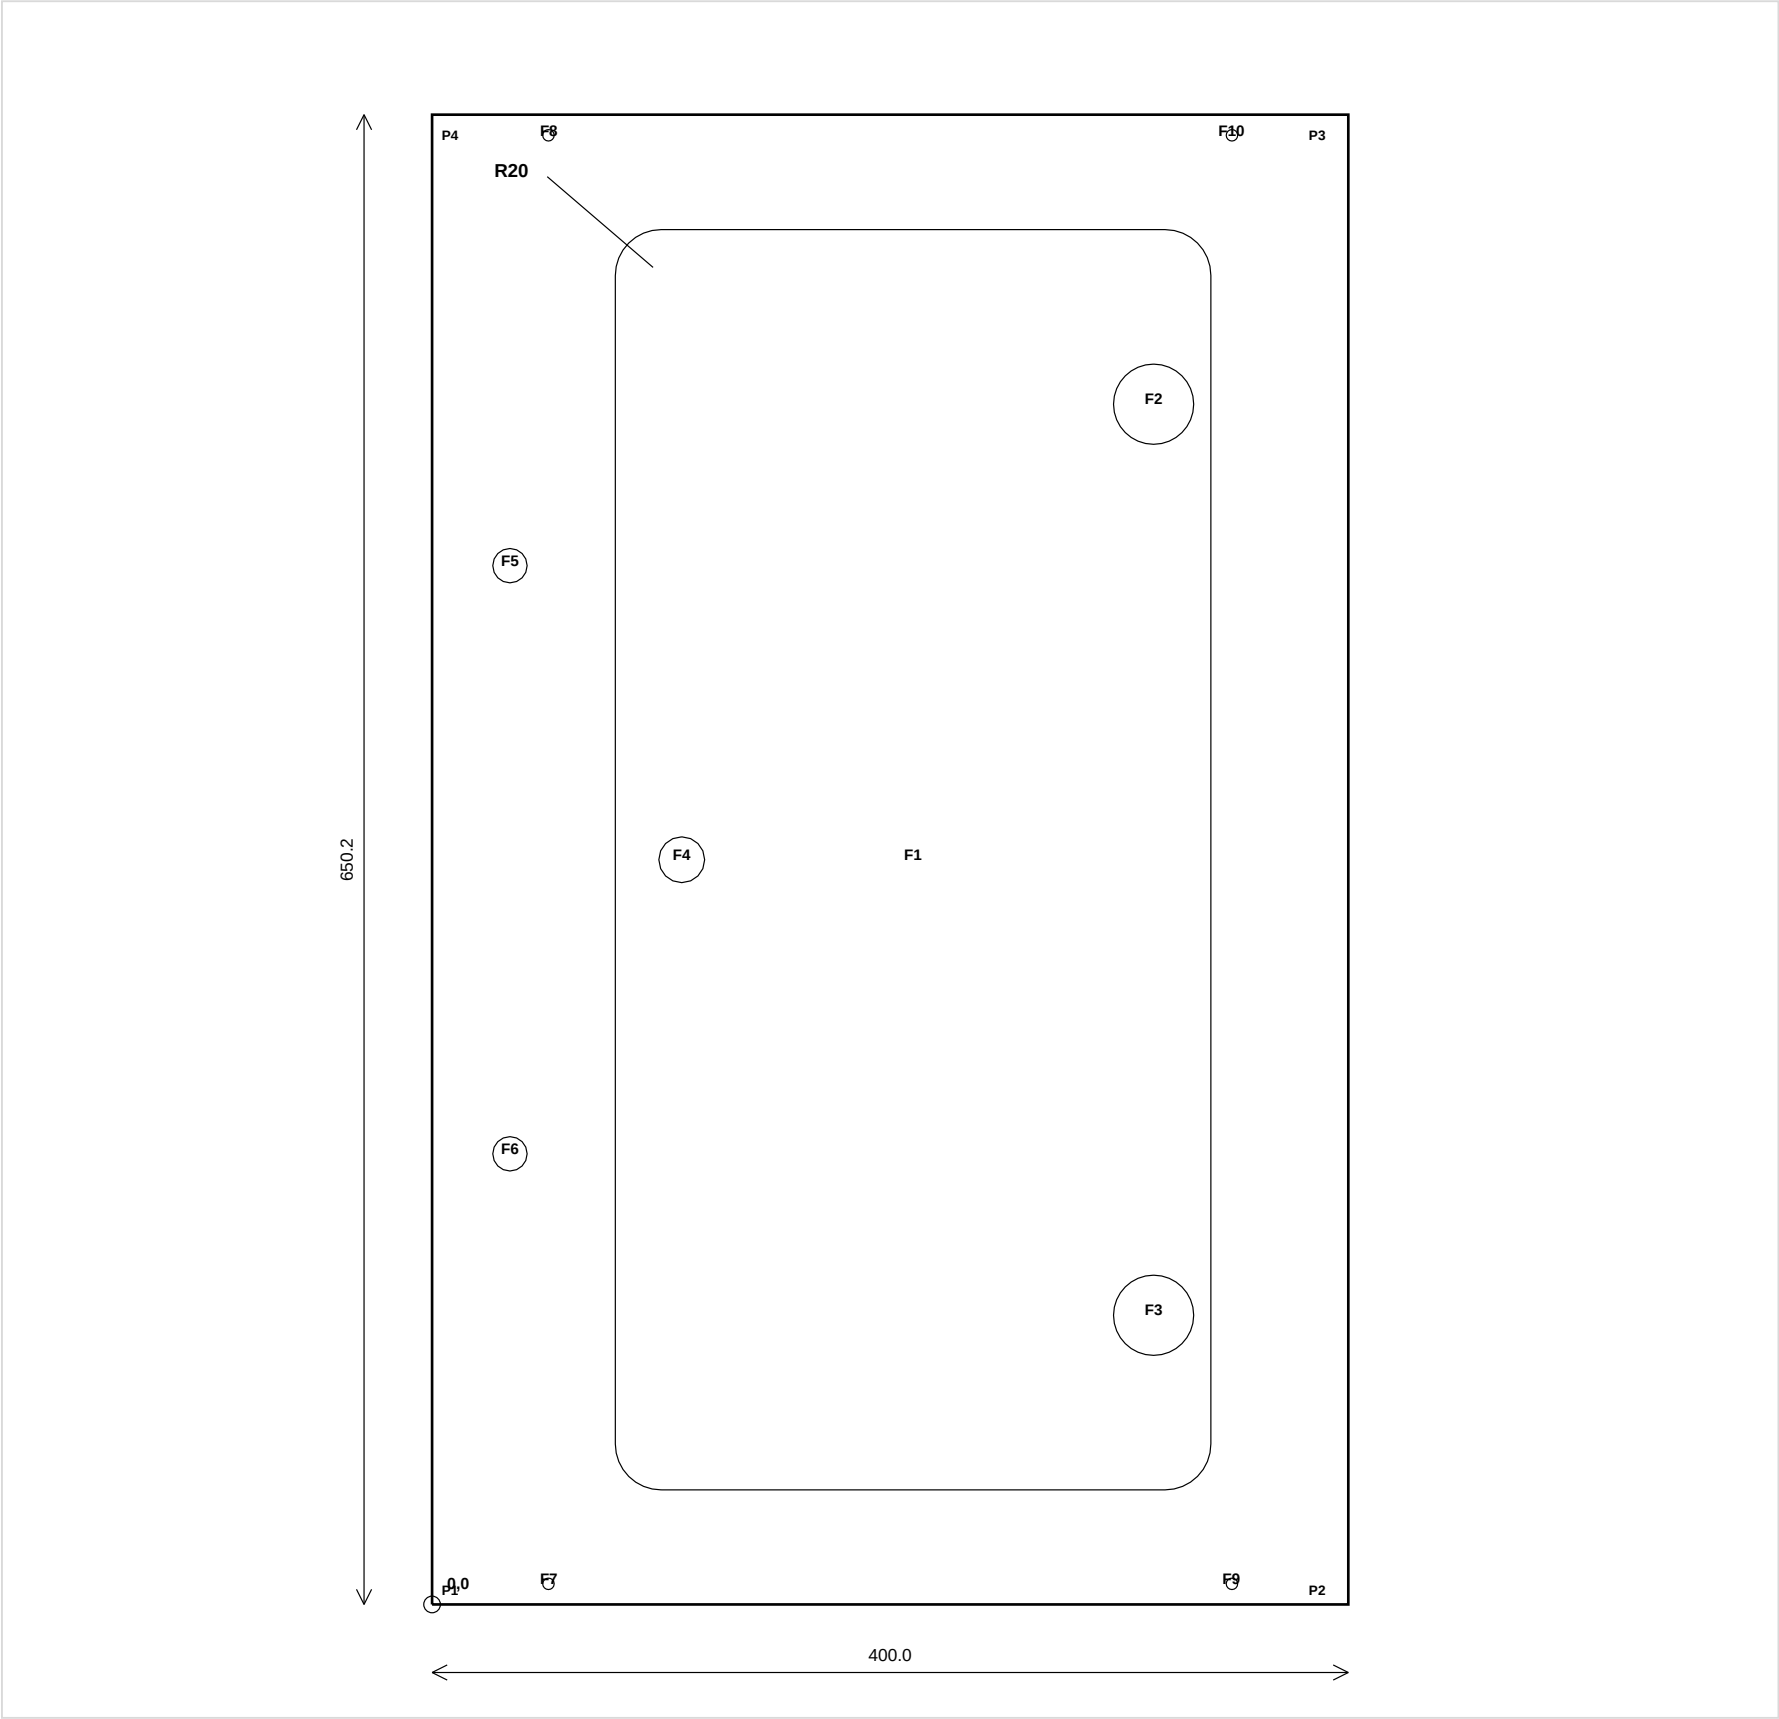

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	door cut-out 260.0 x 550.0, R20	X 210.0 Y 325.0
F2	Dia 35 x 13 deep	X 315.0 Y 523.8
F3	Dia 35 x 13 deep	X 315.0 Y 126.2
F4	Dia 20 THROUGH	X 109.0 Y 325.0
F5	Dia 15 x 14 deep	X 34.0 Y 453.3
F6	Dia 15 x 14 deep	X 34.0 Y 196.7
F7	Dia 5 x 11 deep	X 51.0 Y 9.0
F8	Dia 5 x 11 deep	X 51.0 Y 641.0
F9	Dia 5 x 11 deep	X 349.0 Y 9.0
F10	Dia 5 x 11 deep	X 349.0 Y 641.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X400.0 Y0.0	LINE
P3	X400.0 Y650.2	LINE
P4	X0.0 Y650.2	LINE

S2-D - Part detail

Overall 400.0 x 517.0 mm | 18 mm plywood | datum lower-left = X0 Y0

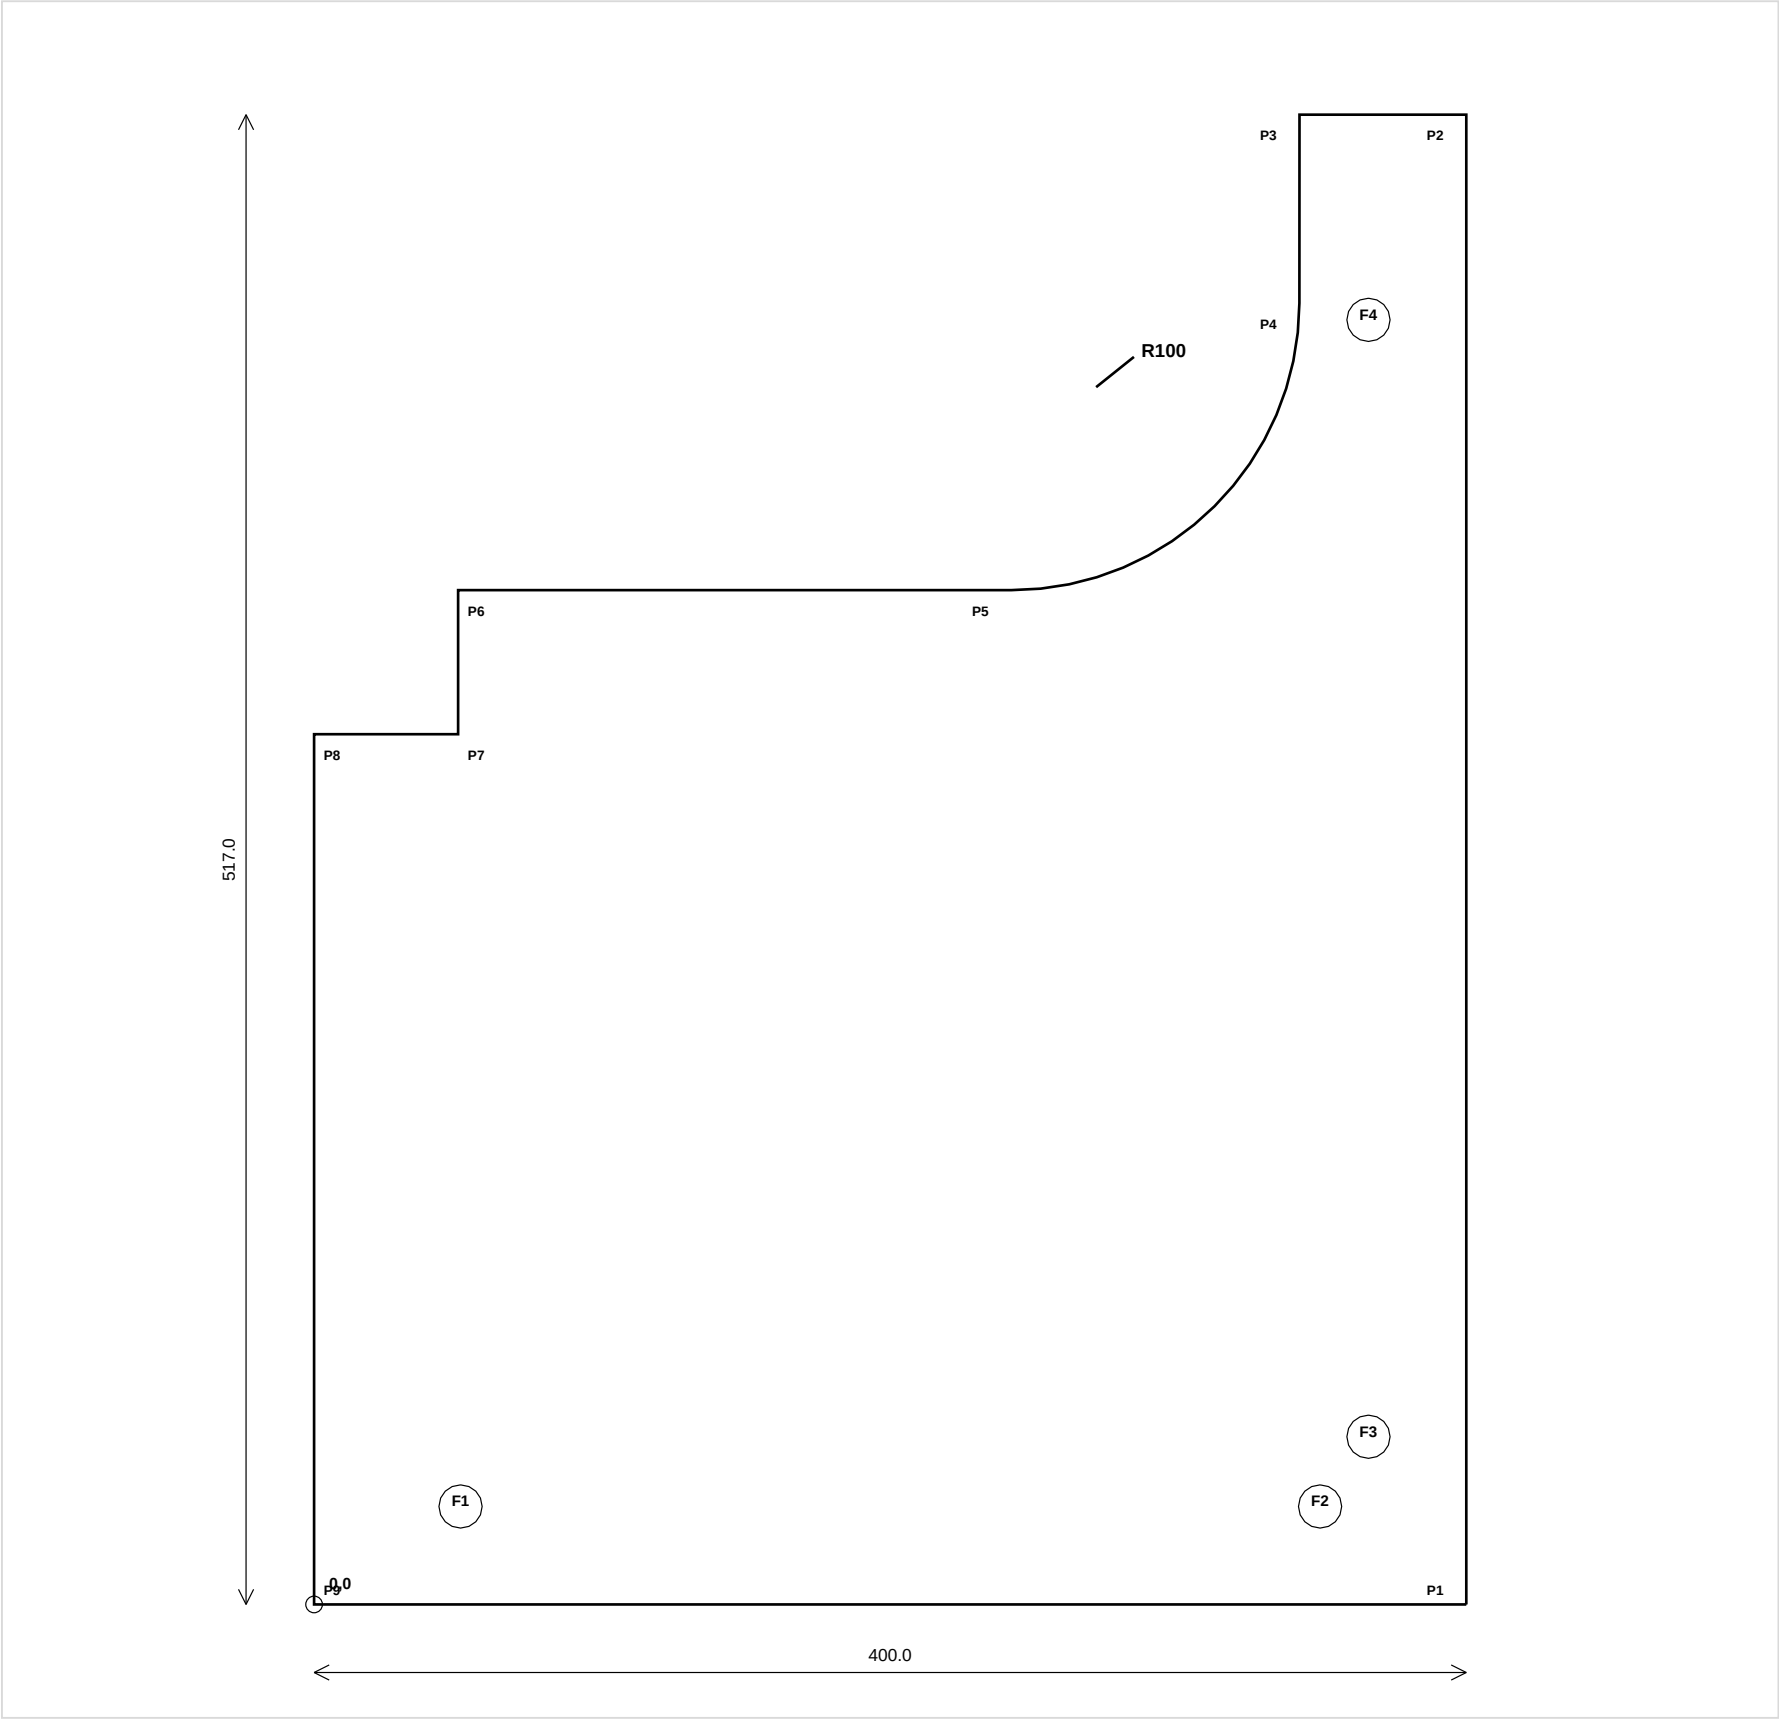

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 50.8 Y 34.0
F2	Dia 15 x 14 deep	X 349.2 Y 34.0
F3	Dia 15 x 14 deep	X 366.0 Y 58.2
F4	Dia 15 x 14 deep	X 366.0 Y 445.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X400.0 Y0.0	LINE
P2	X400.0 Y517.0	LINE
P3	X342.1 Y517.0	LINE
P4	X342.1 Y451.6	ARC R100 CW
P5	X242.1 Y352.0	LINE
P6	X50.0 Y352.0	LINE
P7	X50.0 Y302.0	LINE
P8	X0.0 Y302.0	LINE
P9	X0.0 Y0.0	LINE

S2-E - Part detail

Overall 382.0 x 564.3 mm | 18 mm plywood | datum lower-left = X0 Y0

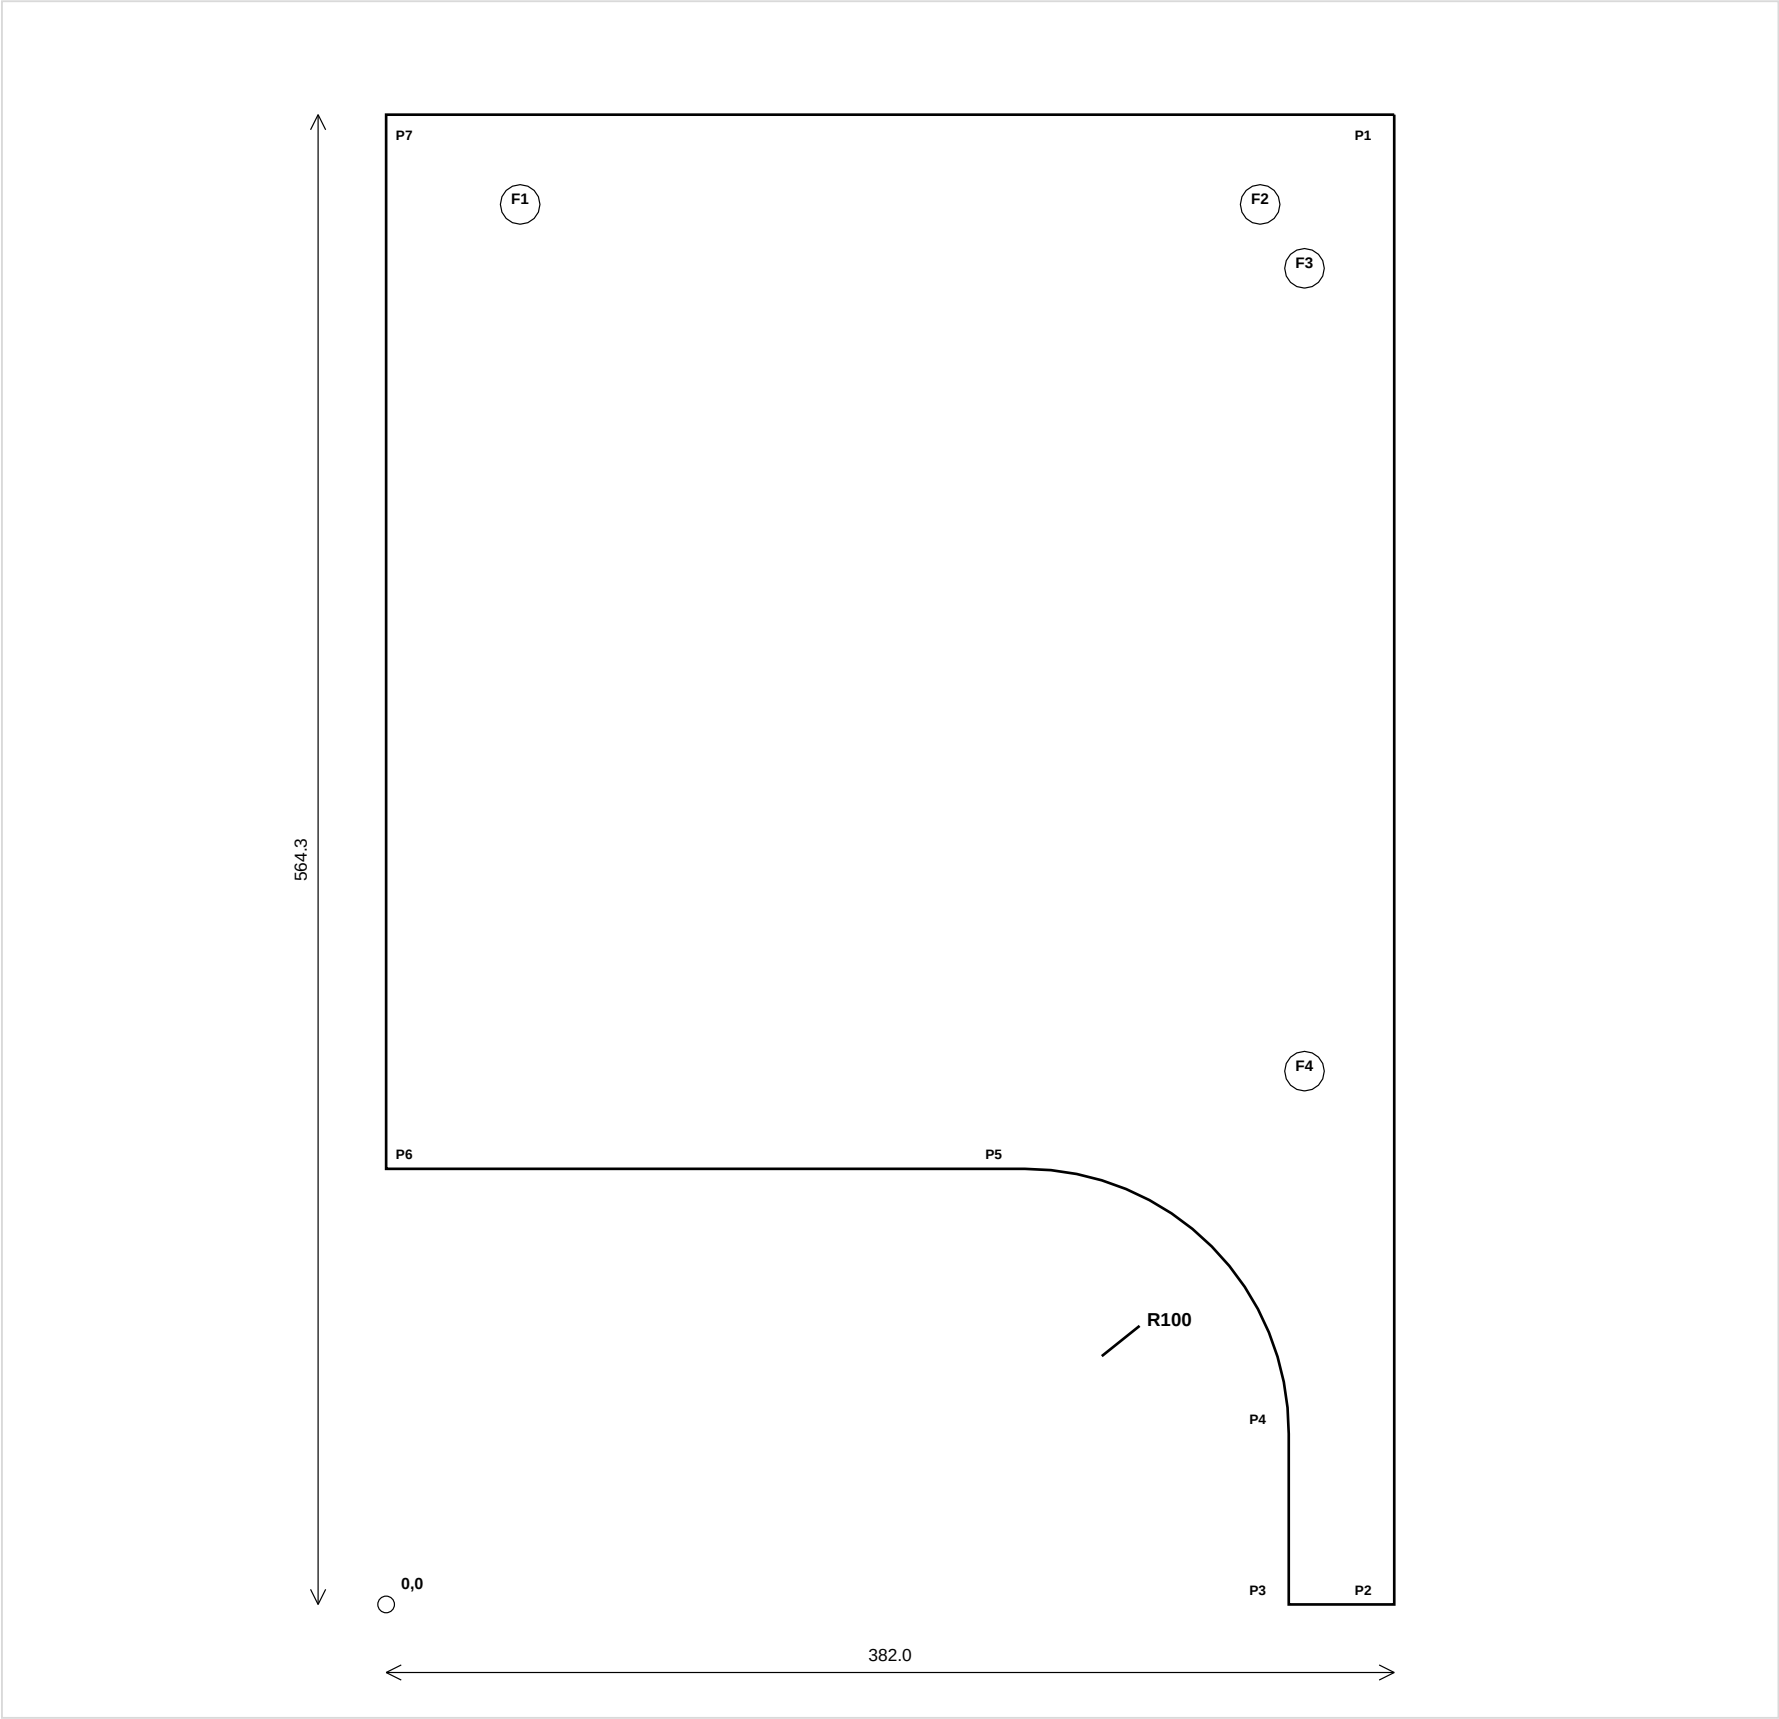

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 50.8 Y 530.3
F2	Dia 15 x 14 deep	X 331.2 Y 530.3
F3	Dia 15 x 14 deep	X 348.0 Y 506.1
F4	Dia 15 x 14 deep	X 348.0 Y 202.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X382.0 Y564.3	LINE
P2	X382.0 Y0.0	LINE
P3	X342.0 Y0.0	LINE
P4	X342.0 Y64.6	ARC R100 CCW
P5	X242.0 Y165.0	LINE
P6	X0.0 Y165.0	LINE
P7	X0.0 Y564.3	LINE

S2-F - Part detail

Overall 400.0 x 1685.0 mm | 18 mm plywood | datum lower-left = X0 Y0

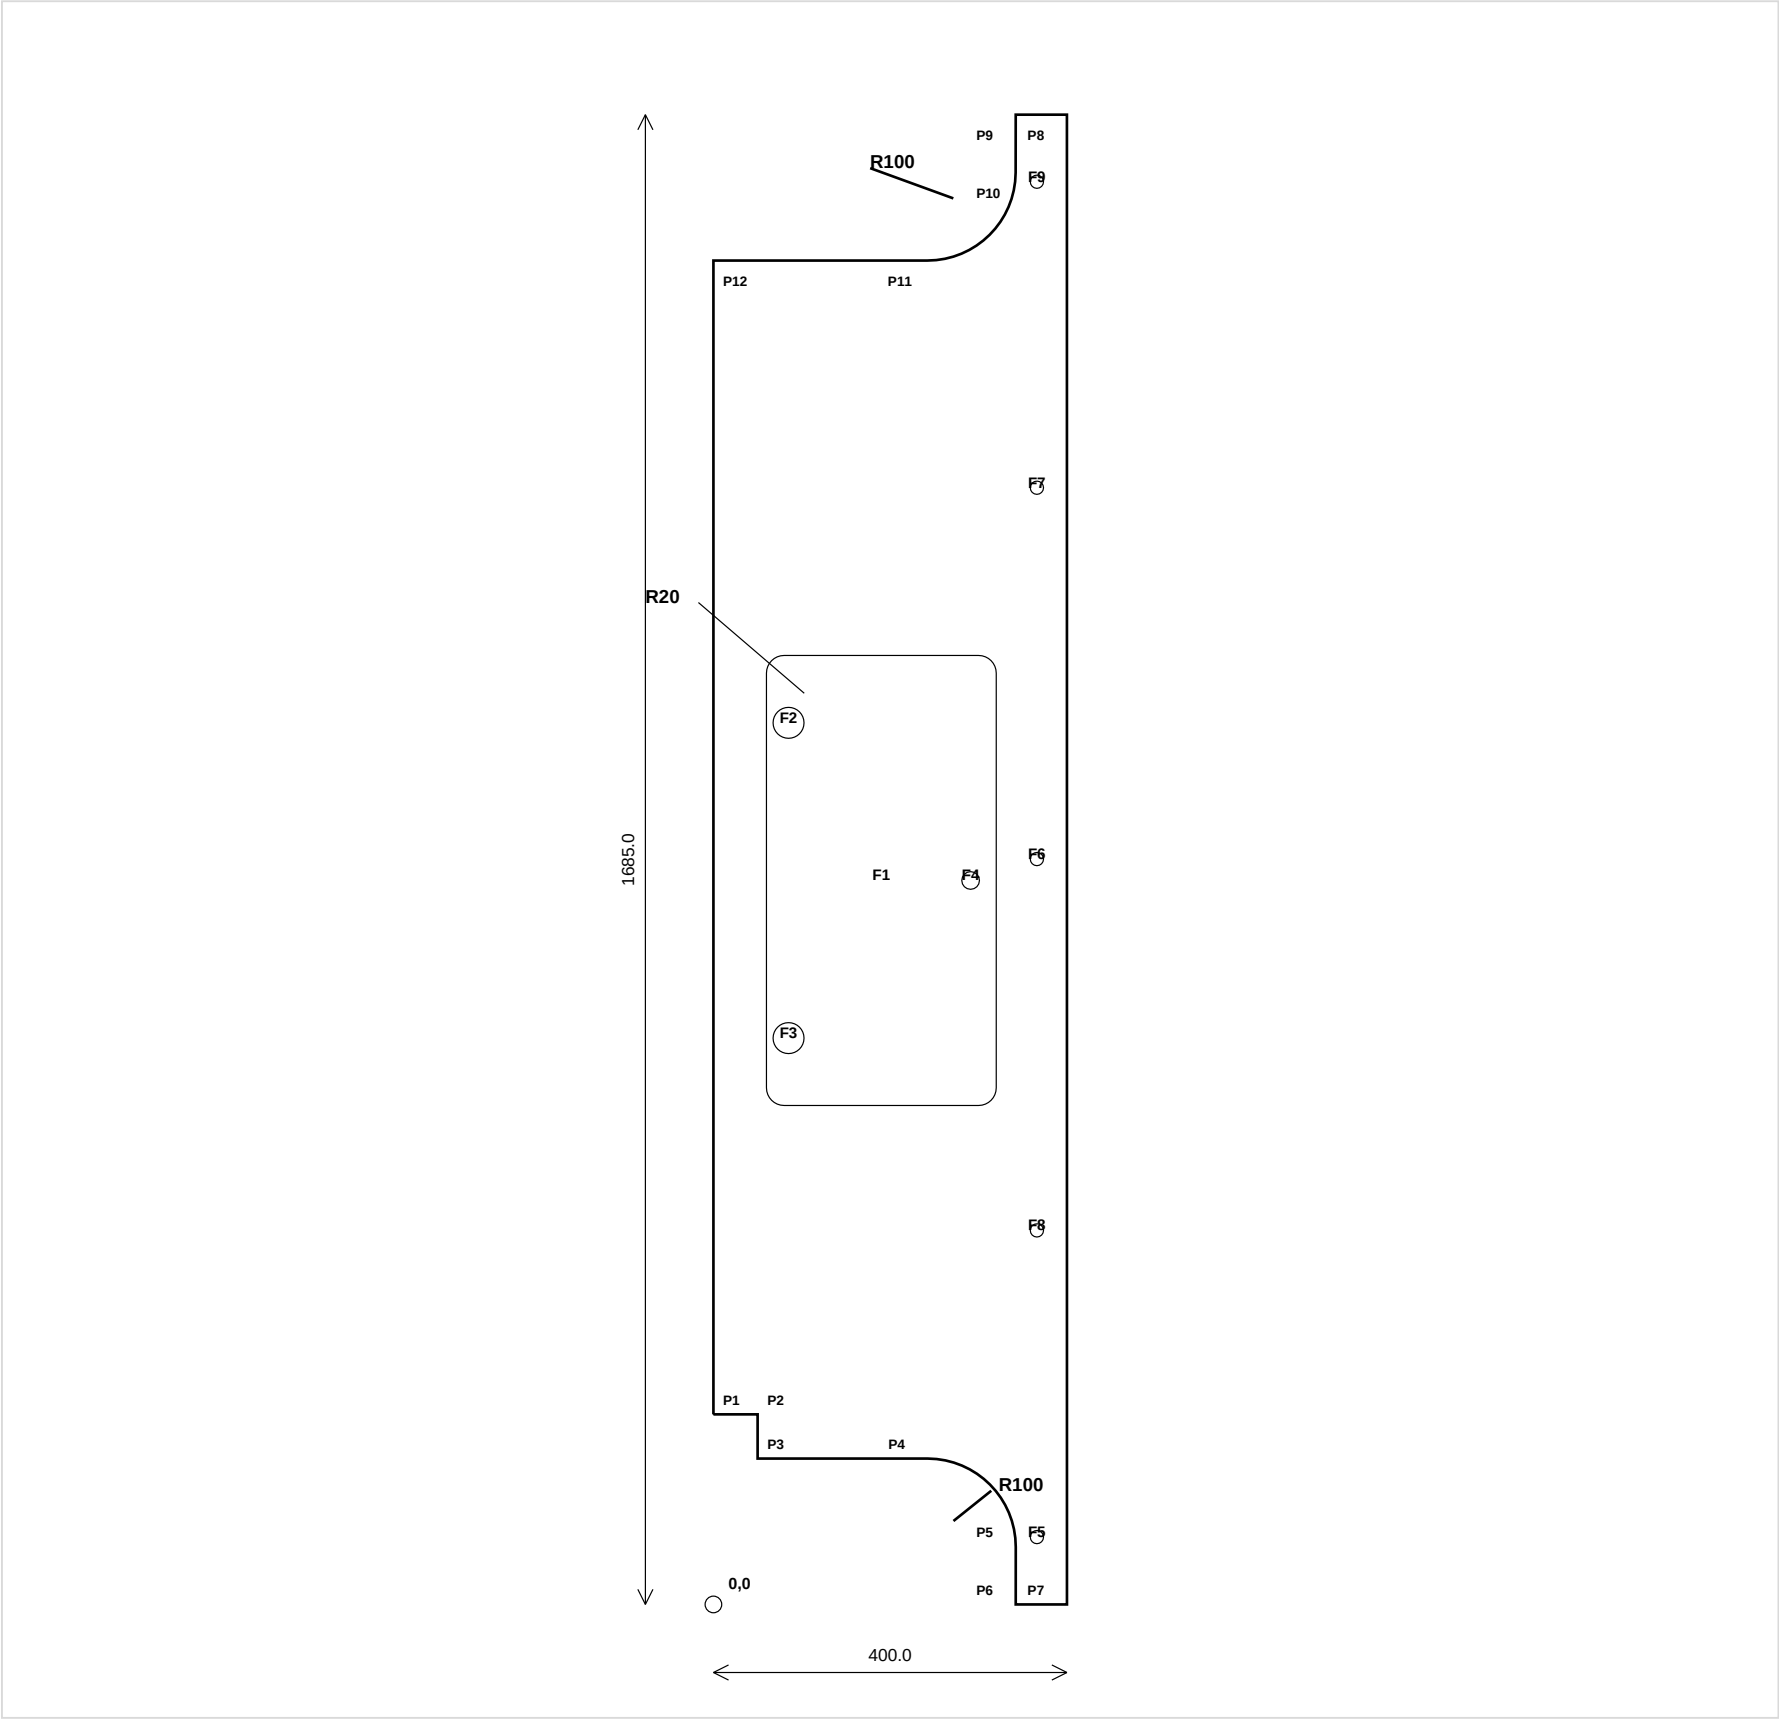

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	door cut-out 260.0 x 509.0, R20	X 190.0 Y 818.8
F2	Dia 35 x 13 deep	X 85.0 Y 997.1
F3	Dia 35 x 13 deep	X 85.0 Y 640.5
F4	Dia 20 THROUGH	X 291.0 Y 818.8
F5	Dia 15 x 14 deep	X 366.0 Y 76.2
F6	Dia 15 x 14 deep	X 366.0 Y 843.1
F7	Dia 15 x 14 deep	X 366.0 Y 1263.1
F8	Dia 15 x 14 deep	X 366.0 Y 423.1
F9	Dia 15 x 14 deep	X 366.0 Y 1609.2


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y215.0	LINE
P2	X50.0 Y215.0	LINE
P3	X50.0 Y165.0	LINE
P4	X242.5 Y165.0	ARC R100 CW
P5	X342.1 Y64.9	LINE
P6	X342.0 Y0.0	LINE
P7	X400.0 Y0.0	LINE
P8	X400.0 Y1685.0	LINE
P9	X342.0 Y1685.0	LINE
P10	X342.0 Y1619.4	ARC R100 CW
P11	X242.0 Y1520.0	LINE
P12	X0.0 Y1520.0	LINE

S2-G - Part detail

Overall 587.5 x 1450.0 mm | 18 mm plywood | datum lower-left = X0 Y0

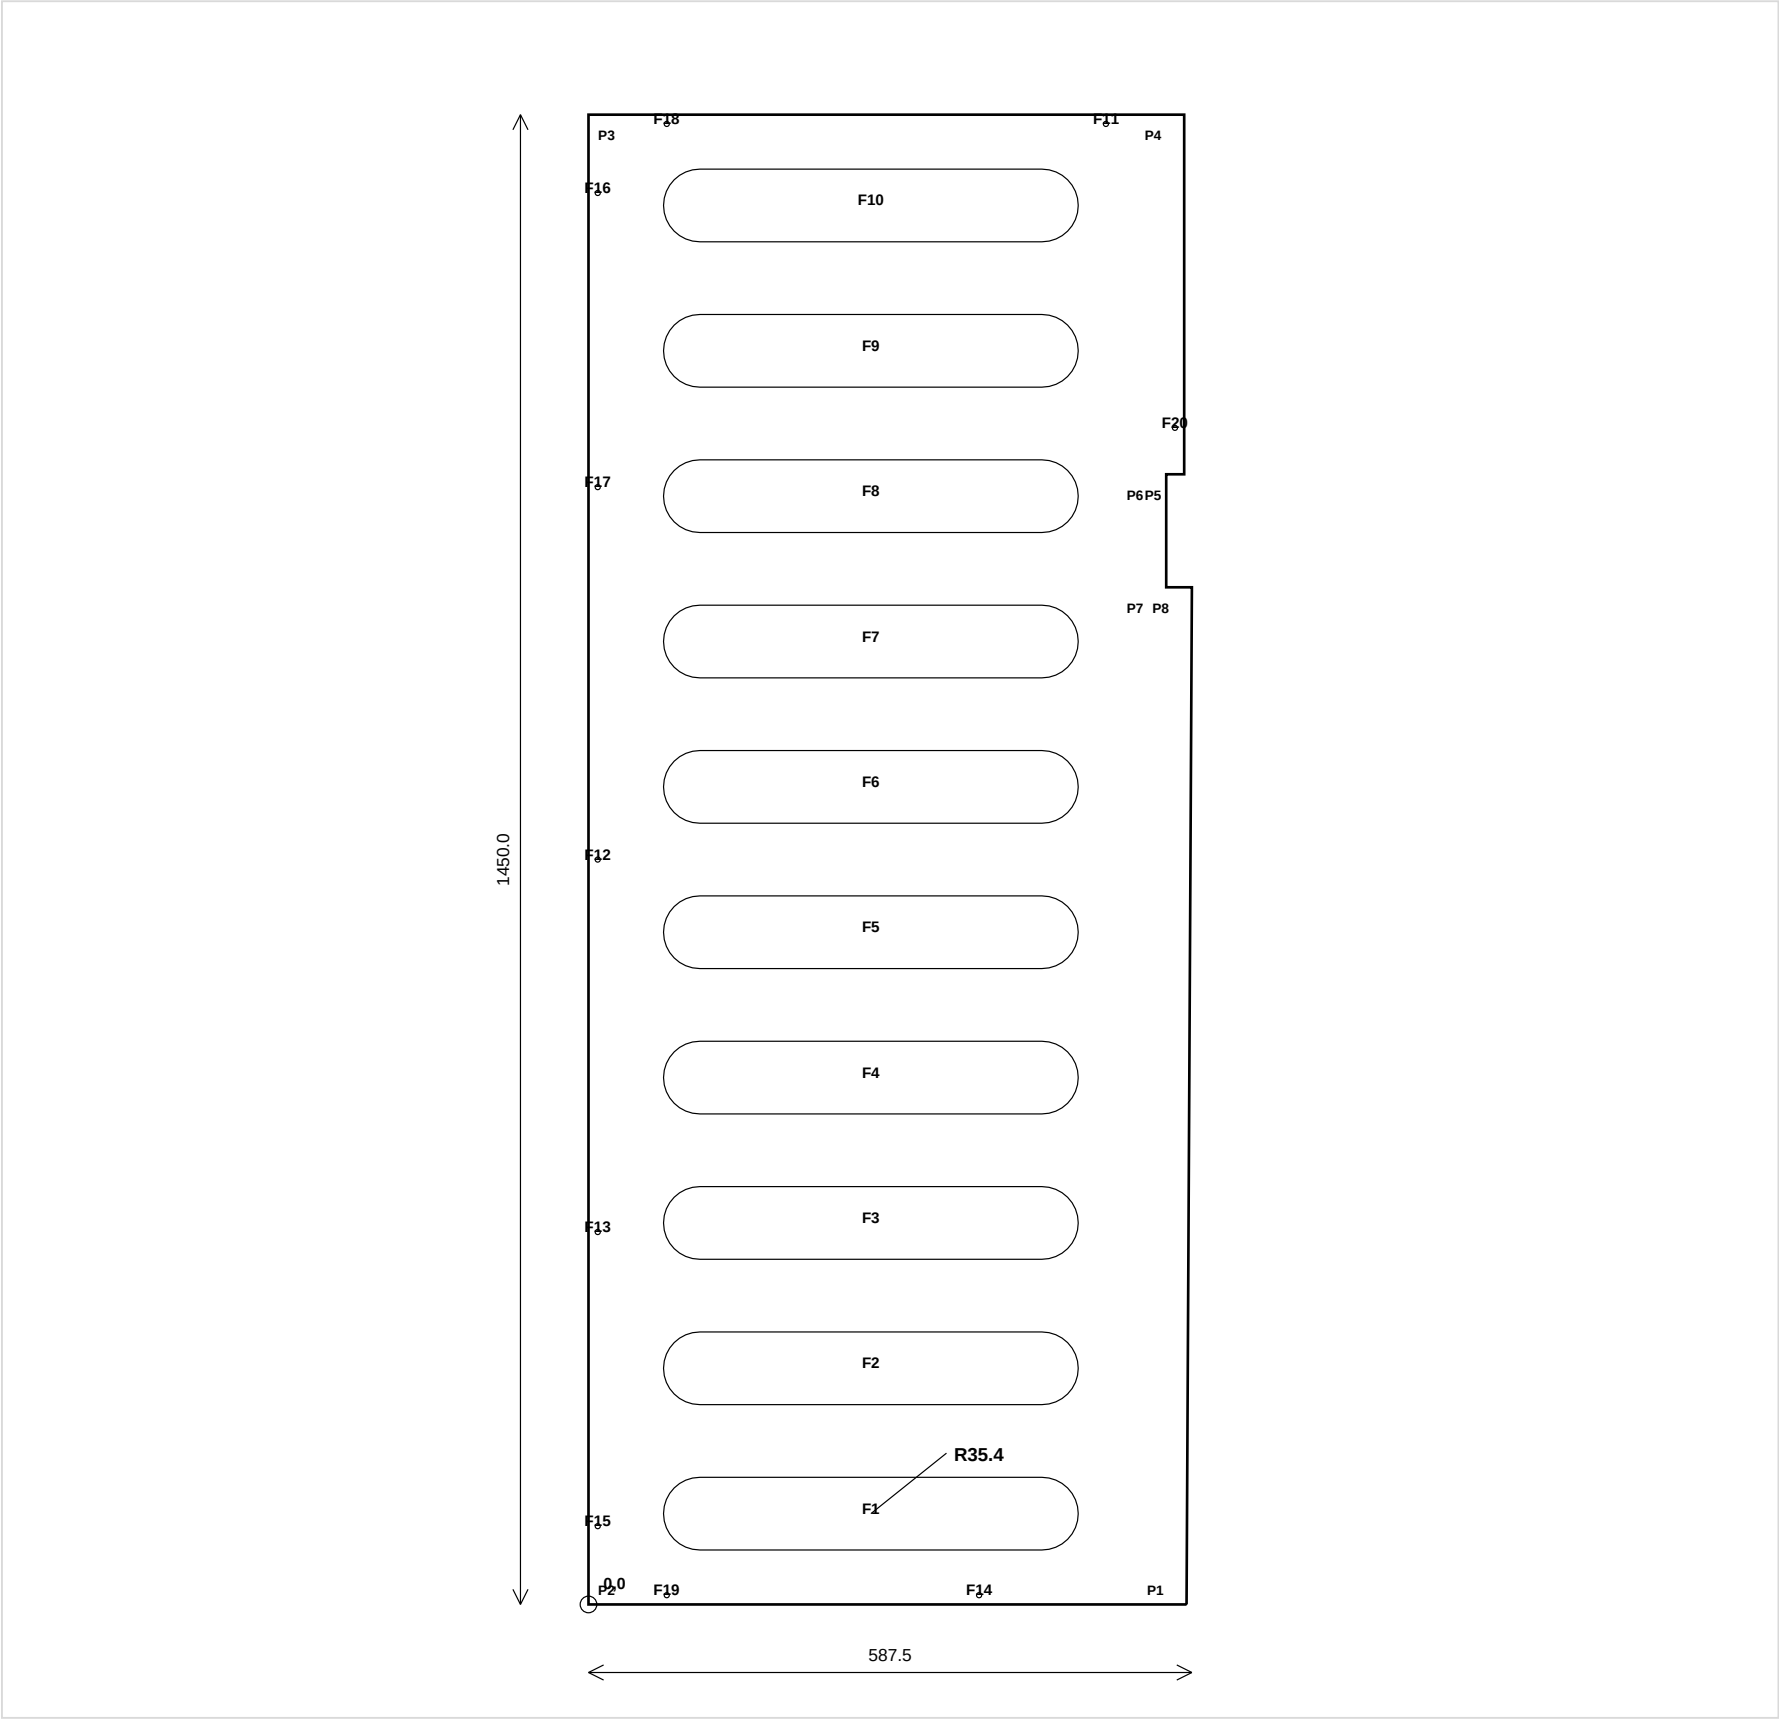

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	slot 403.8 x 70.7, R35.4	X 274.9 Y 88.4
F2	slot 403.8 x 70.7, R35.4	X 274.9 Y 229.8
F3	slot 403.8 x 70.7, R35.4	X 274.9 Y 371.3
F4	slot 403.8 x 70.7, R35.4	X 274.9 Y 512.8
F5	slot 403.8 x 70.7, R35.4	X 274.9 Y 654.3
F6	slot 403.8 x 70.7, R35.4	X 274.9 Y 795.7
F7	slot 403.8 x 70.7, R35.4	X 274.9 Y 937.2
F8	slot 403.8 x 70.7, R35.4	X 274.9 Y 1078.7
F9	slot 403.8 x 70.7, R35.4	X 275.0 Y 1220.2
F10	slot 403.8 x 70.7, R35.4	X 275.0 Y 1361.6
F11	Dia 5 x 11 deep	X 504.0 Y 1441.0
F12	Dia 5 x 11 deep	X 9.0 Y 725.0
F13	Dia 5 x 11 deep	X 9.0 Y 362.5
F14	Dia 5 x 11 deep	X 380.5 Y 9.0
F15	Dia 5 x 11 deep	X 9.0 Y 76.0
F16	Dia 5 x 11 deep	X 9.0 Y 1374.0
F17	Dia 5 x 11 deep	X 9.0 Y 1087.5
F18	Dia 5 x 11 deep	X 76.0 Y 1441.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X582.3 Y0.0	LINE	
P2	X0.0 Y0.0	LINE	
P3	X0.0 Y1450.0	LINE	
P4	X580.0 Y1450.0	LINE	
P5	X580.0 Y1100.0	LINE	
Machining features, continued			
P6	X582.3 Y1100.0	LINE	
F19 P7	Dia 5 x 11 deep X582.5 Y990.0	LINE	X 76.0 Y 9.0
F20 P8	Dia 5 x 11 deep X587.5 Y990.0	LINE	X 571.0 Y 1145.0

S3-A - Part detail

Overall 482.0 x 337.6 mm | 18 mm plywood | datum lower-left = X0 Y0

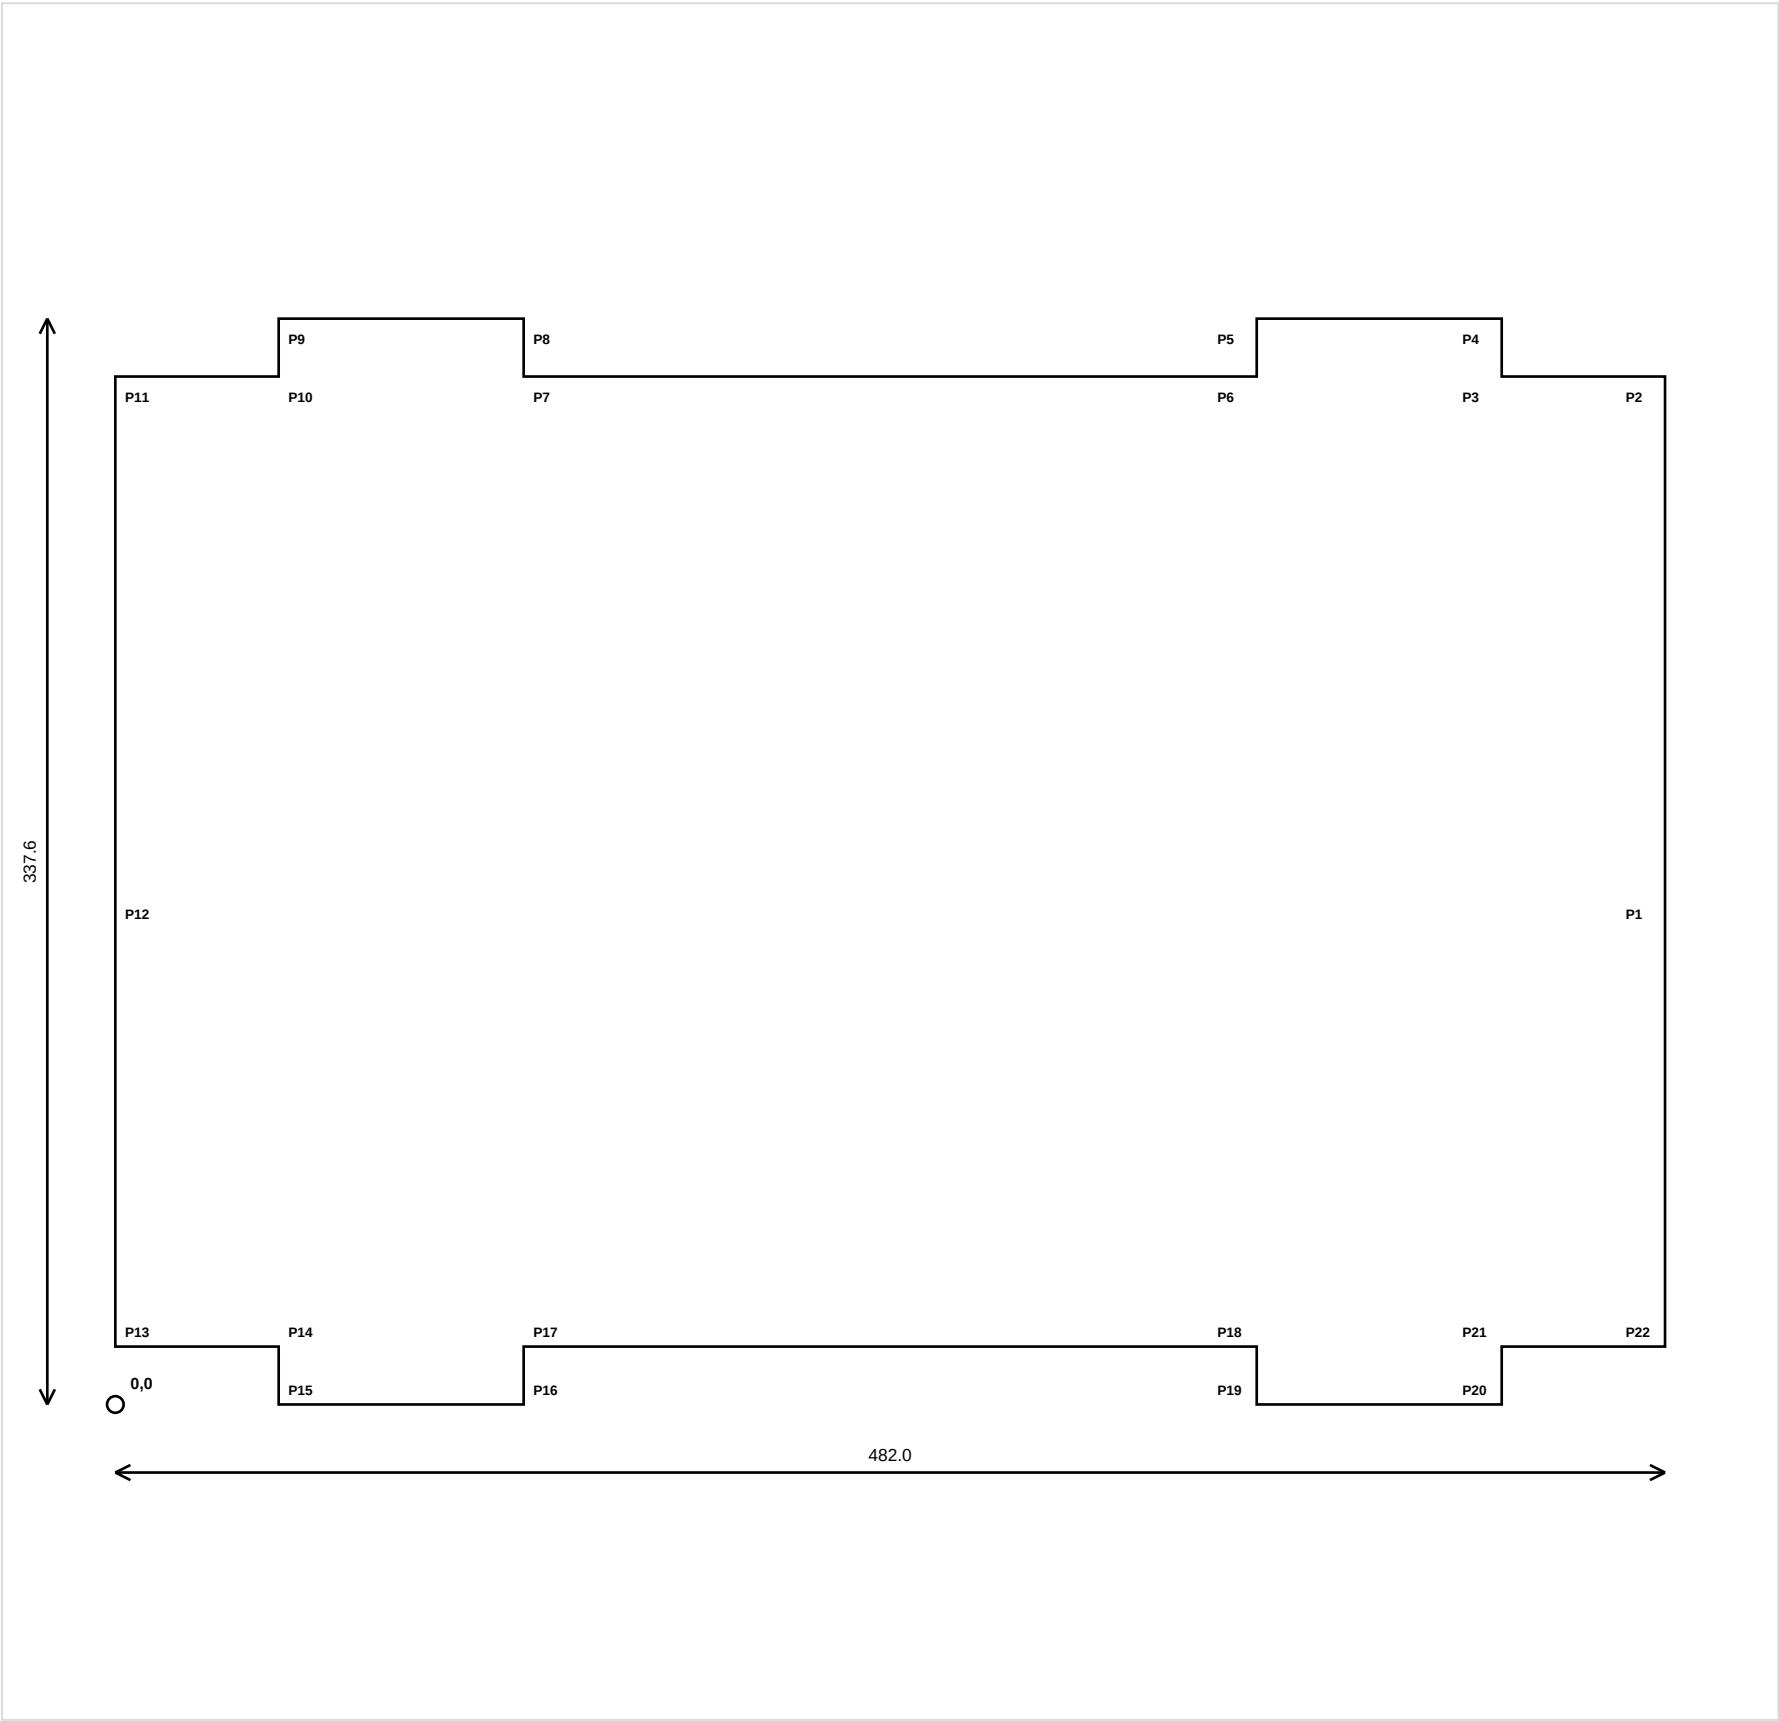

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X482.0 Y147.8	LINE	P17	X127.0 Y18.0	LINE
P2	X482.0 Y319.6	LINE	P18	X355.0 Y18.0	LINE
P3	X431.2 Y319.6	LINE	P19	X355.0 Y0.0	LINE
P4	X431.2 Y337.6	LINE	P20	X431.2 Y0.0	LINE
P5	X355.0 Y337.6	LINE	P21	X431.2 Y18.0	LINE
P6	X355.0 Y319.6	LINE	P22	X482.0 Y18.0	LINE
P7	X127.0 Y319.6	LINE			
P8	X127.0 Y337.6	LINE			
P9	X50.8 Y337.6	LINE			
P10	X50.8 Y319.6	LINE			
P11	X0.0 Y319.6	LINE			
P12	X0.0 Y147.8	LINE			
P13	X0.0 Y18.0	LINE			
P14	X50.8 Y18.0	LINE			
P15	X50.8 Y0.0	LINE			
P16	X127.0 Y0.0	LINE			

S3-B - Part detail

Overall 700.0 x 500.0 mm | 18 mm plywood | datum lower-left = X0 Y0

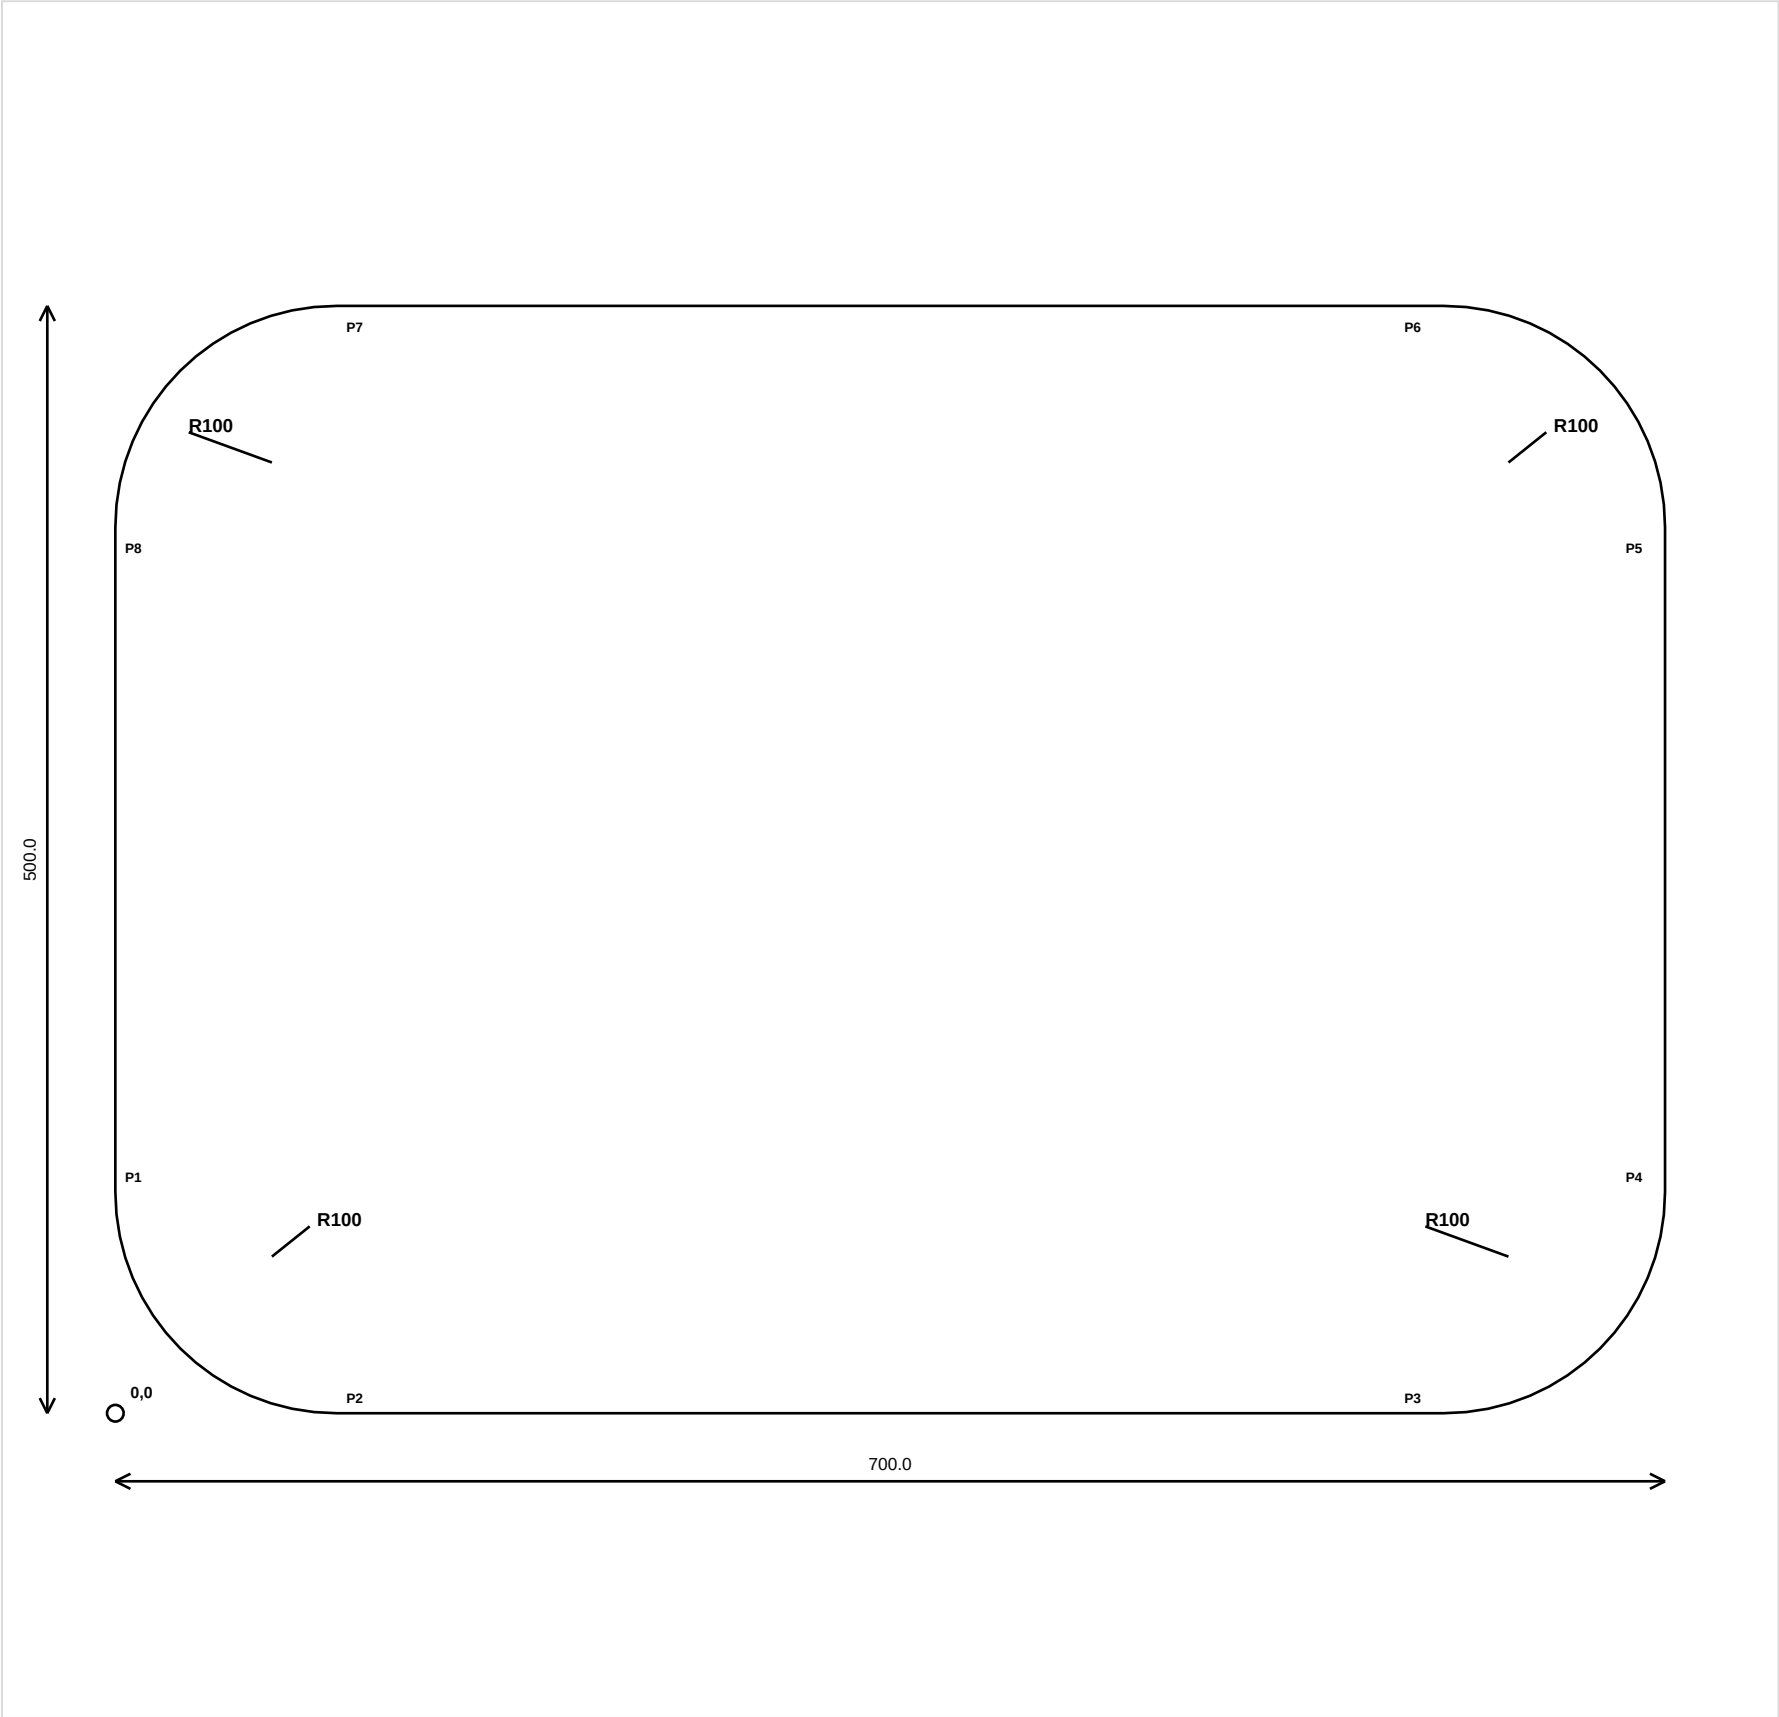

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y100.0	ARC R100 CCW
P2	X100.0 Y0.0	LINE
P3	X600.0 Y0.0	ARC R100 CCW
P4	X700.0 Y100.0	LINE
P5	X700.0 Y400.0	ARC R100 CCW
P6	X600.0 Y500.0	LINE
P7	X100.0 Y500.0	ARC R100 CCW
P8	X0.0 Y400.0	LINE

S3-C - Part detail

Overall 301.6 x 285.0 mm | 18 mm plywood | datum lower-left = X0 Y0

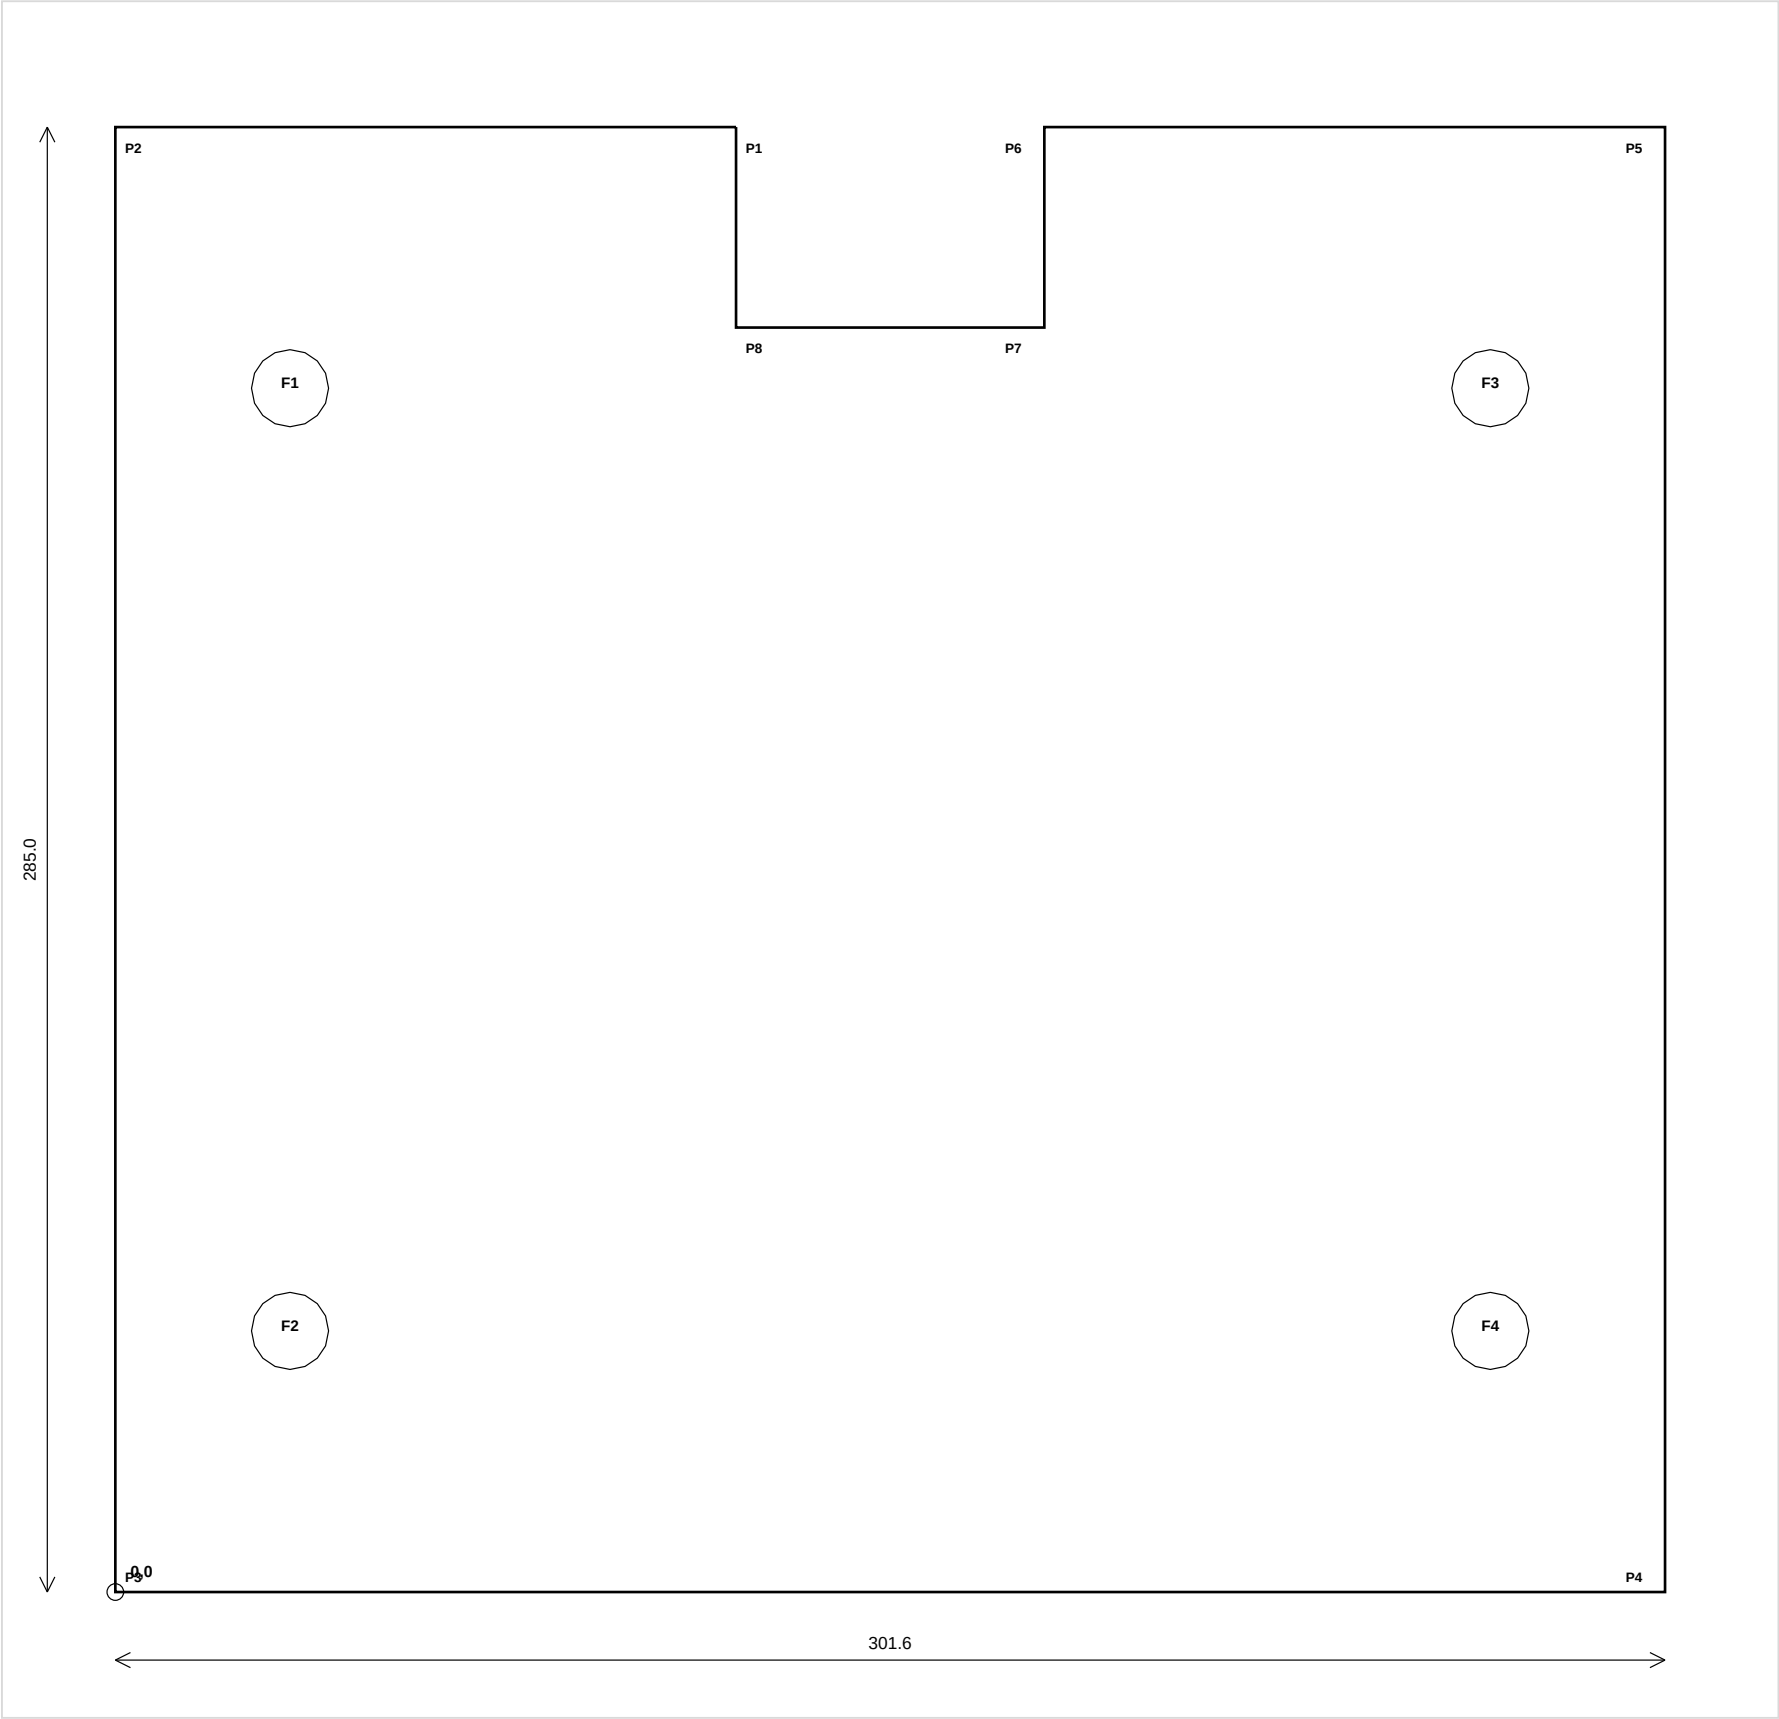

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 34.0 Y 234.2
F2	Dia 15 x 14 deep	X 34.0 Y 50.8
F3	Dia 15 x 14 deep	X 267.6 Y 234.2
F4	Dia 15 x 14 deep	X 267.6 Y 50.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X120.8 Y285.0	LINE
P2	X0.0 Y285.0	LINE
P3	X0.0 Y0.0	LINE
P4	X301.6 Y0.0	LINE
P5	X301.6 Y285.0	LINE
P6	X180.8 Y285.0	LINE
P7	X180.8 Y246.0	LINE
P8	X120.8 Y246.0	LINE

S3-D - Part detail

Overall 337.6 x 258.0 mm | 18 mm plywood | datum lower-left = X0 Y0

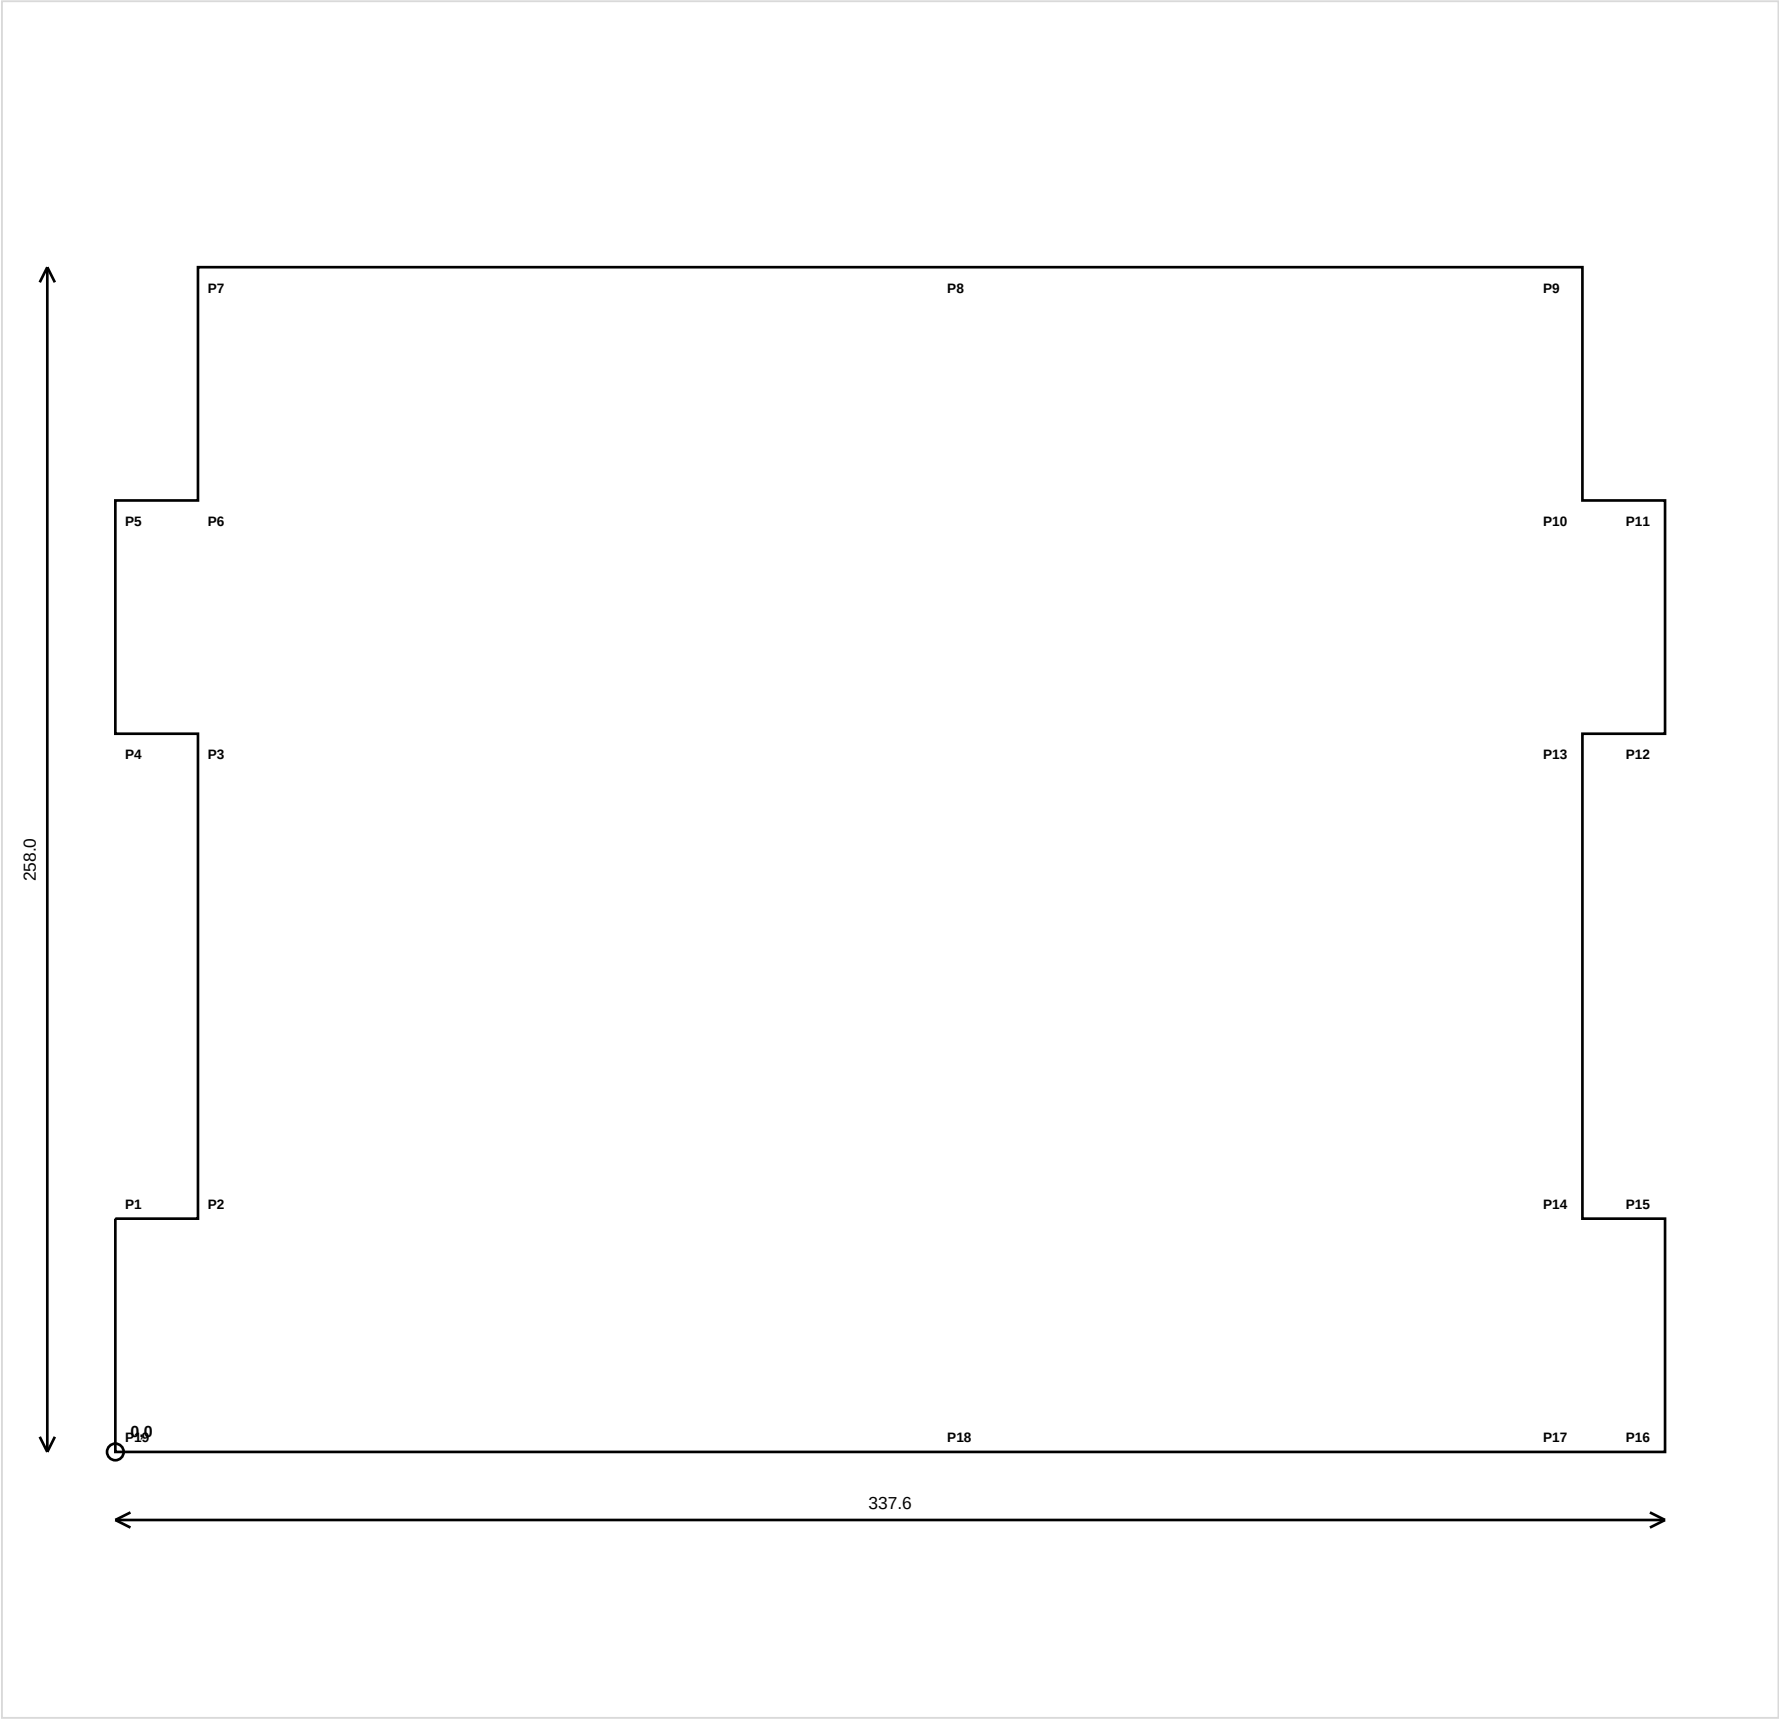

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts


P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y50.8	LINE	P17	X319.6 Y0.0	LINE
P2	X18.0 Y50.8	LINE	P18	X189.8 Y0.0	LINE
P3	X18.0 Y156.4	LINE	P19	X0.0 Y0.0	LINE
P4	X0.0 Y156.4	LINE			
P5	X0.0 Y207.2	LINE			
P6	X18.0 Y207.2	LINE			
P7	X18.0 Y258.0	LINE			
P8	X189.8 Y258.0	LINE			
P9	X319.6 Y258.0	LINE			
P10	X319.6 Y207.2	LINE			
P11	X337.6 Y207.2	LINE			
P12	X337.6 Y156.4	LINE			
P13	X319.6 Y156.4	LINE			
P14	X319.6 Y50.8	LINE			
P15	X337.6 Y50.8	LINE			
P16	X337.6 Y0.0	LINE			

Right-hand notch is a 90 degree square corner - no R2 radius.

S3-E - Part detail

Overall 500.0 x 285.0 mm | 18 mm plywood | datum lower-left = X0 Y0

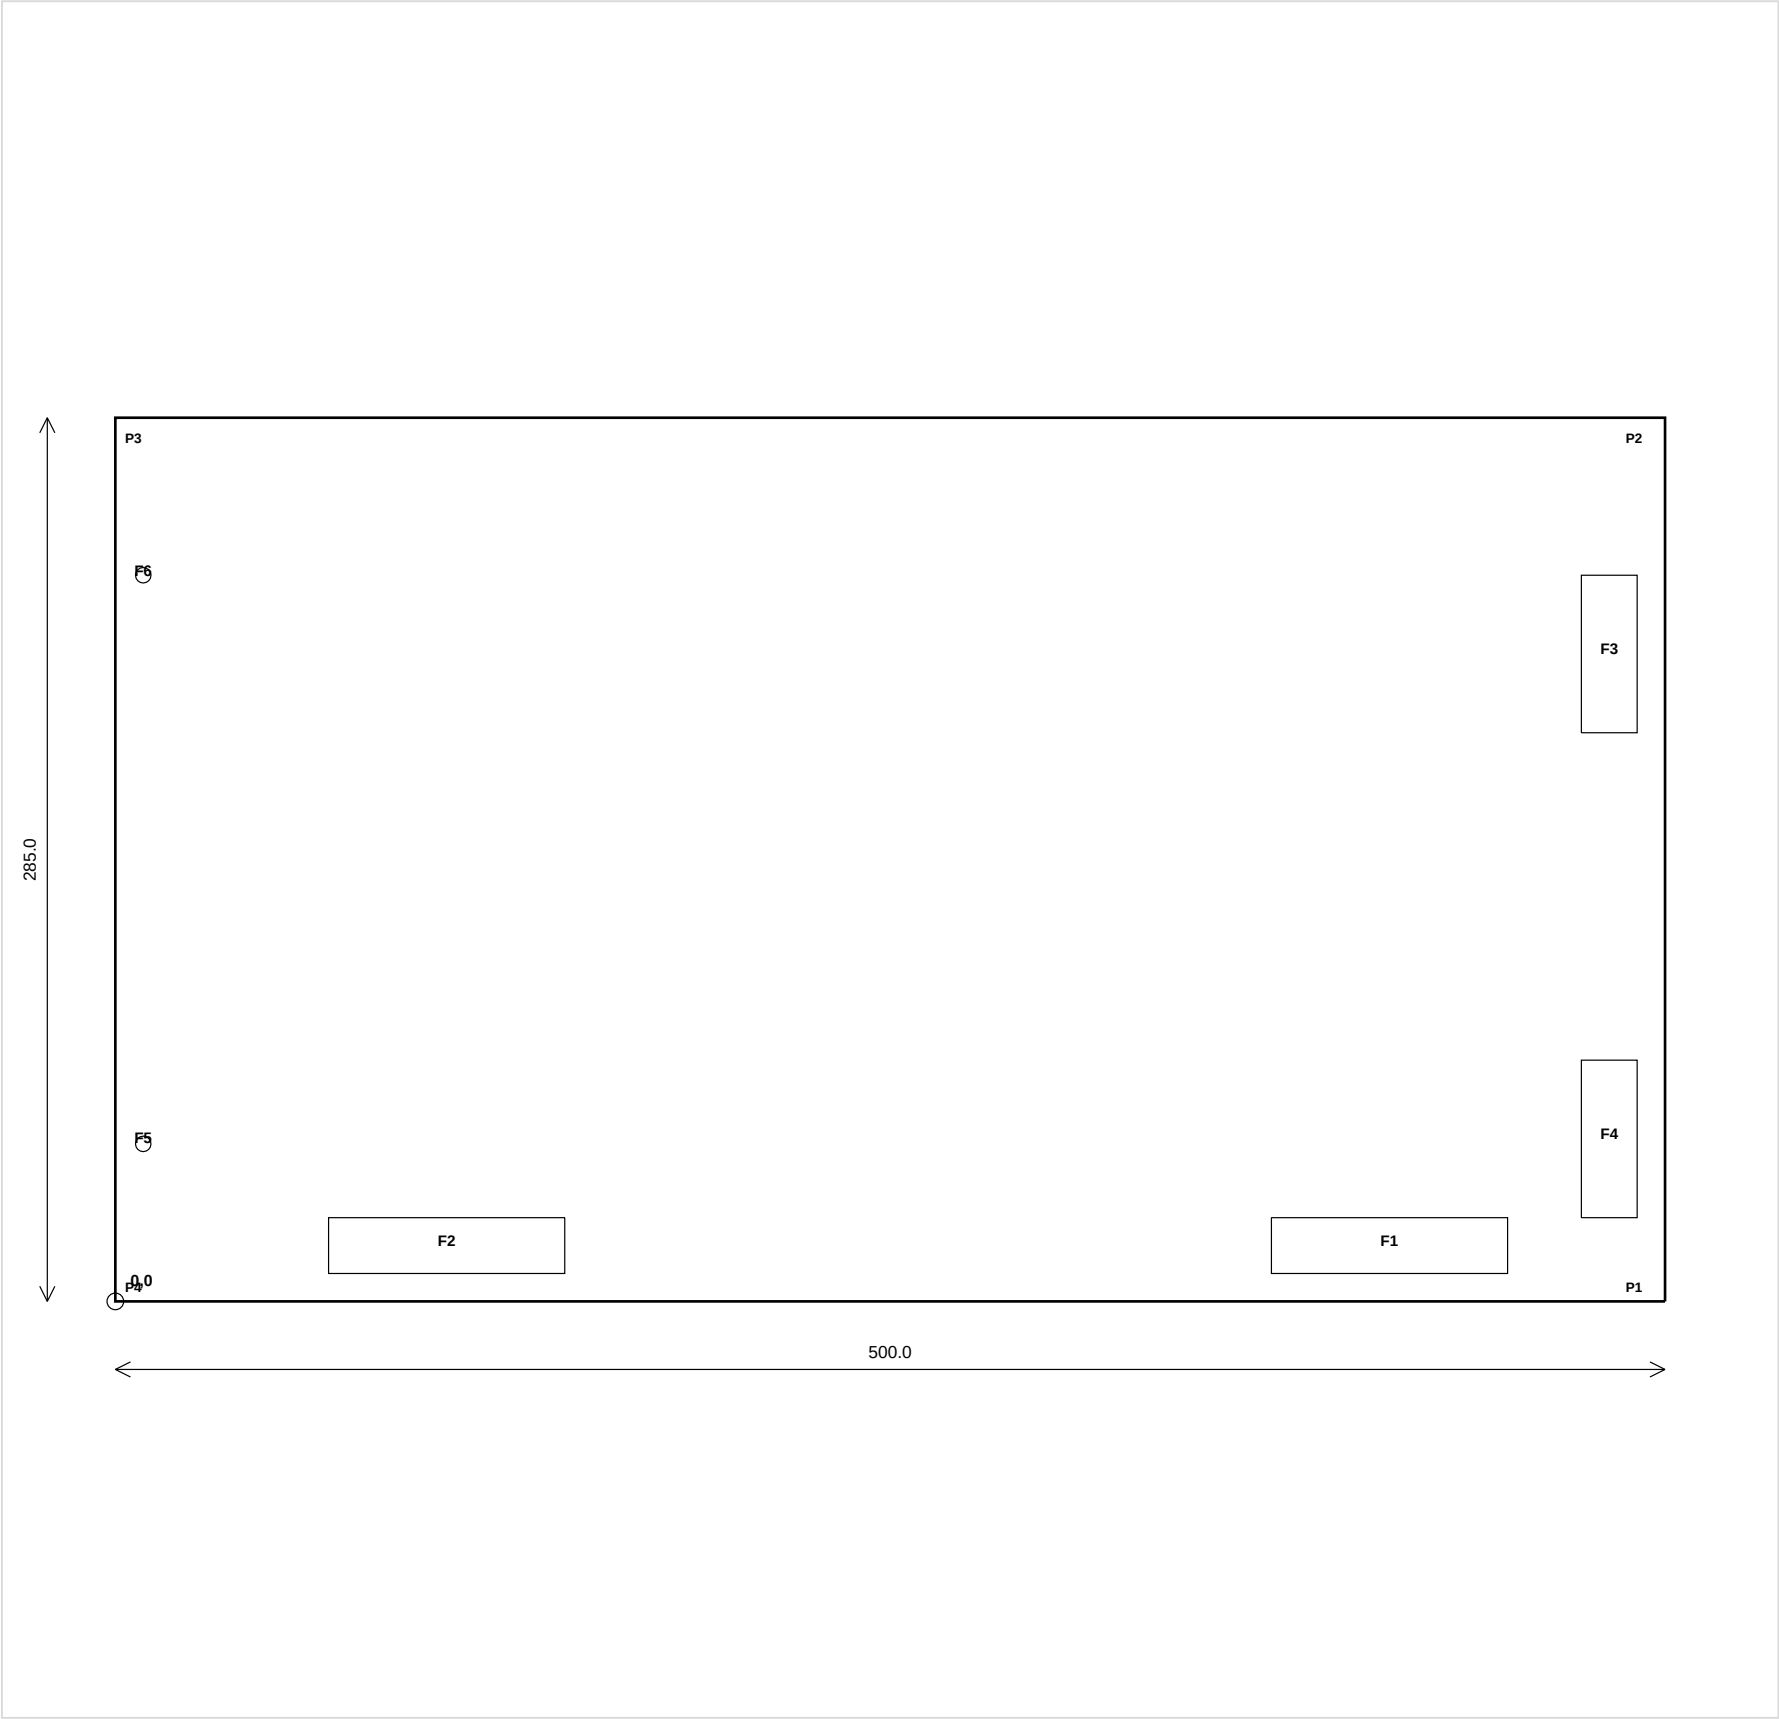

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	rectangular cut-out 76.2 x 18.0	X 411.1 Y 18.0
F2	rectangular cut-out 76.2 x 18.0	X 106.9 Y 18.0
F3	rectangular cut-out 18.0 x 50.8	X 482.0 Y 208.8
F4	rectangular cut-out 18.0 x 50.8	X 482.0 Y 52.4
F5	Dia 5 x 11 deep	X 9.0 Y 51.0
F6	Dia 5 x 11 deep	X 9.0 Y 234.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X500.0 Y0.0	LINE
P2	X500.0 Y285.0	LINE
P3	X0.0 Y285.0	LINE
P4	X0.0 Y0.0	LINE

S3-F - Part detail

Overall 500.0 x 285.0 mm | 18 mm plywood | datum lower-left = X0 Y0

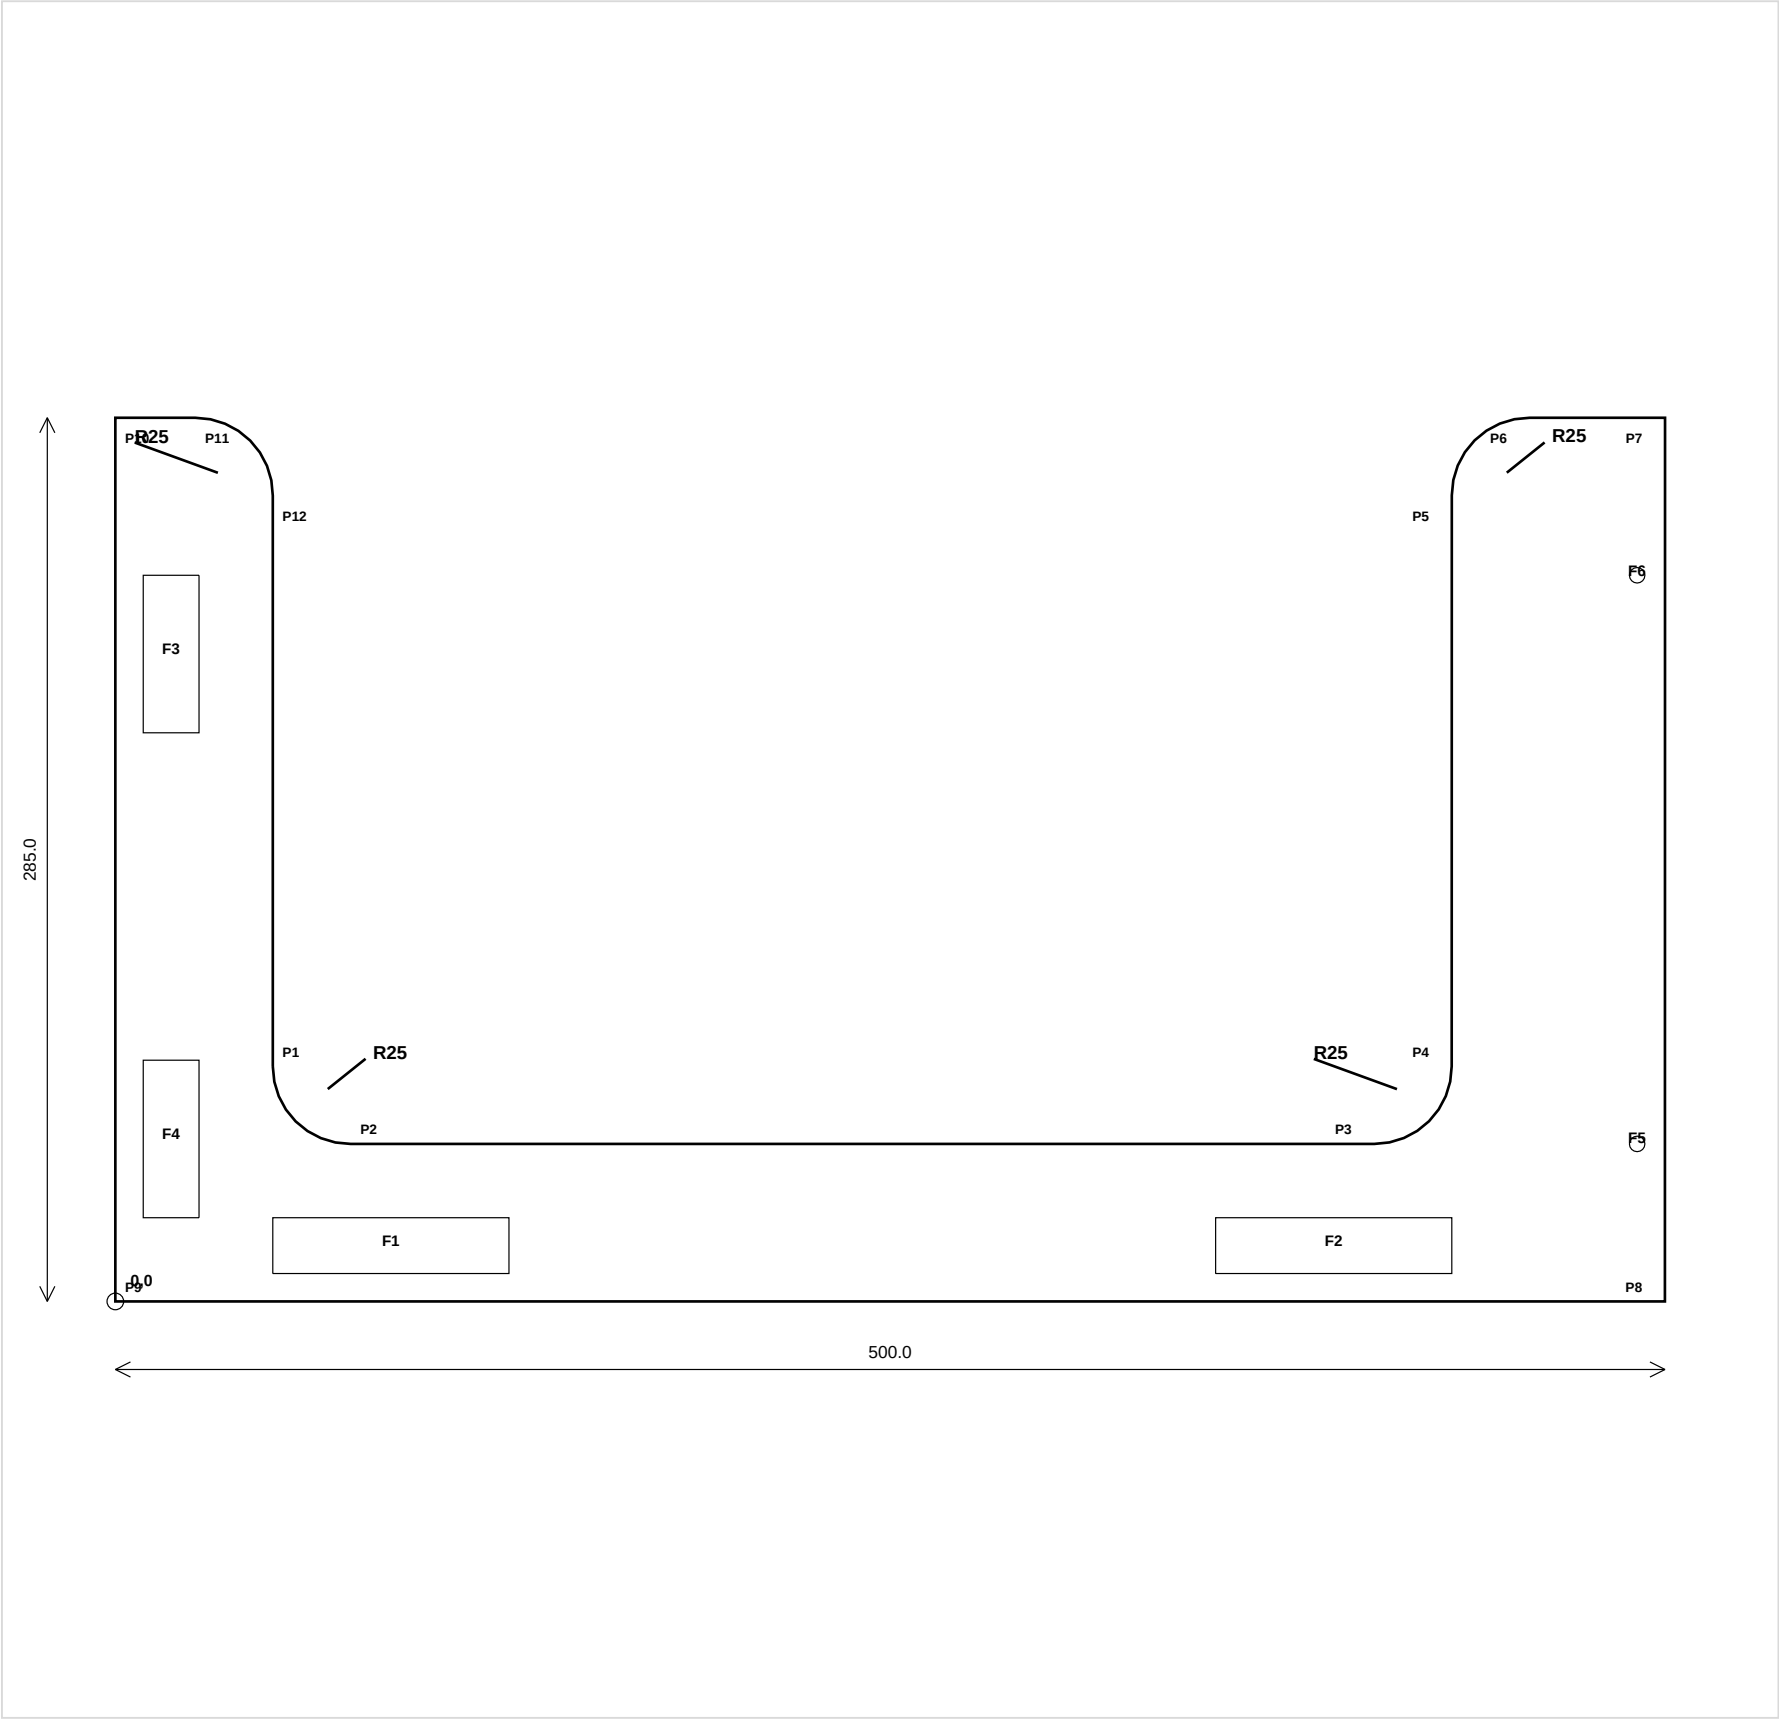

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	rectangular cut-out 76.2 x 18.0	X 88.9 Y 18.0
F2	rectangular cut-out 76.2 x 18.0	X 393.1 Y 18.0
F3	rectangular cut-out 18.0 x 50.8	X 18.0 Y 208.8
F4	rectangular cut-out 18.0 x 50.8	X 18.0 Y 52.4
F5	Dia 5 x 11 deep	X 491.0 Y 51.0
F6	Dia 5 x 11 deep	X 491.0 Y 234.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X50.8 Y75.8	ARC R25 CCW
P2	X75.9 Y50.8	LINE
P3	X406.2 Y50.8	ARC R25 CCW
P4	X431.2 Y75.8	LINE
P5	X431.2 Y260.0	ARC R25 CW
P6	X456.3 Y285.0	LINE
P7	X500.0 Y285.0	LINE
P8	X500.0 Y0.0	LINE
P9	X0.0 Y0.0	LINE
P10	X0.0 Y285.0	LINE
P11	X25.8 Y285.0	ARC R25 CW
P12	X50.8 Y259.9	LINE

S3-G - Part detail

Overall 560.0 x 1448.1 mm | 18 mm plywood | datum lower-left = X0 Y0

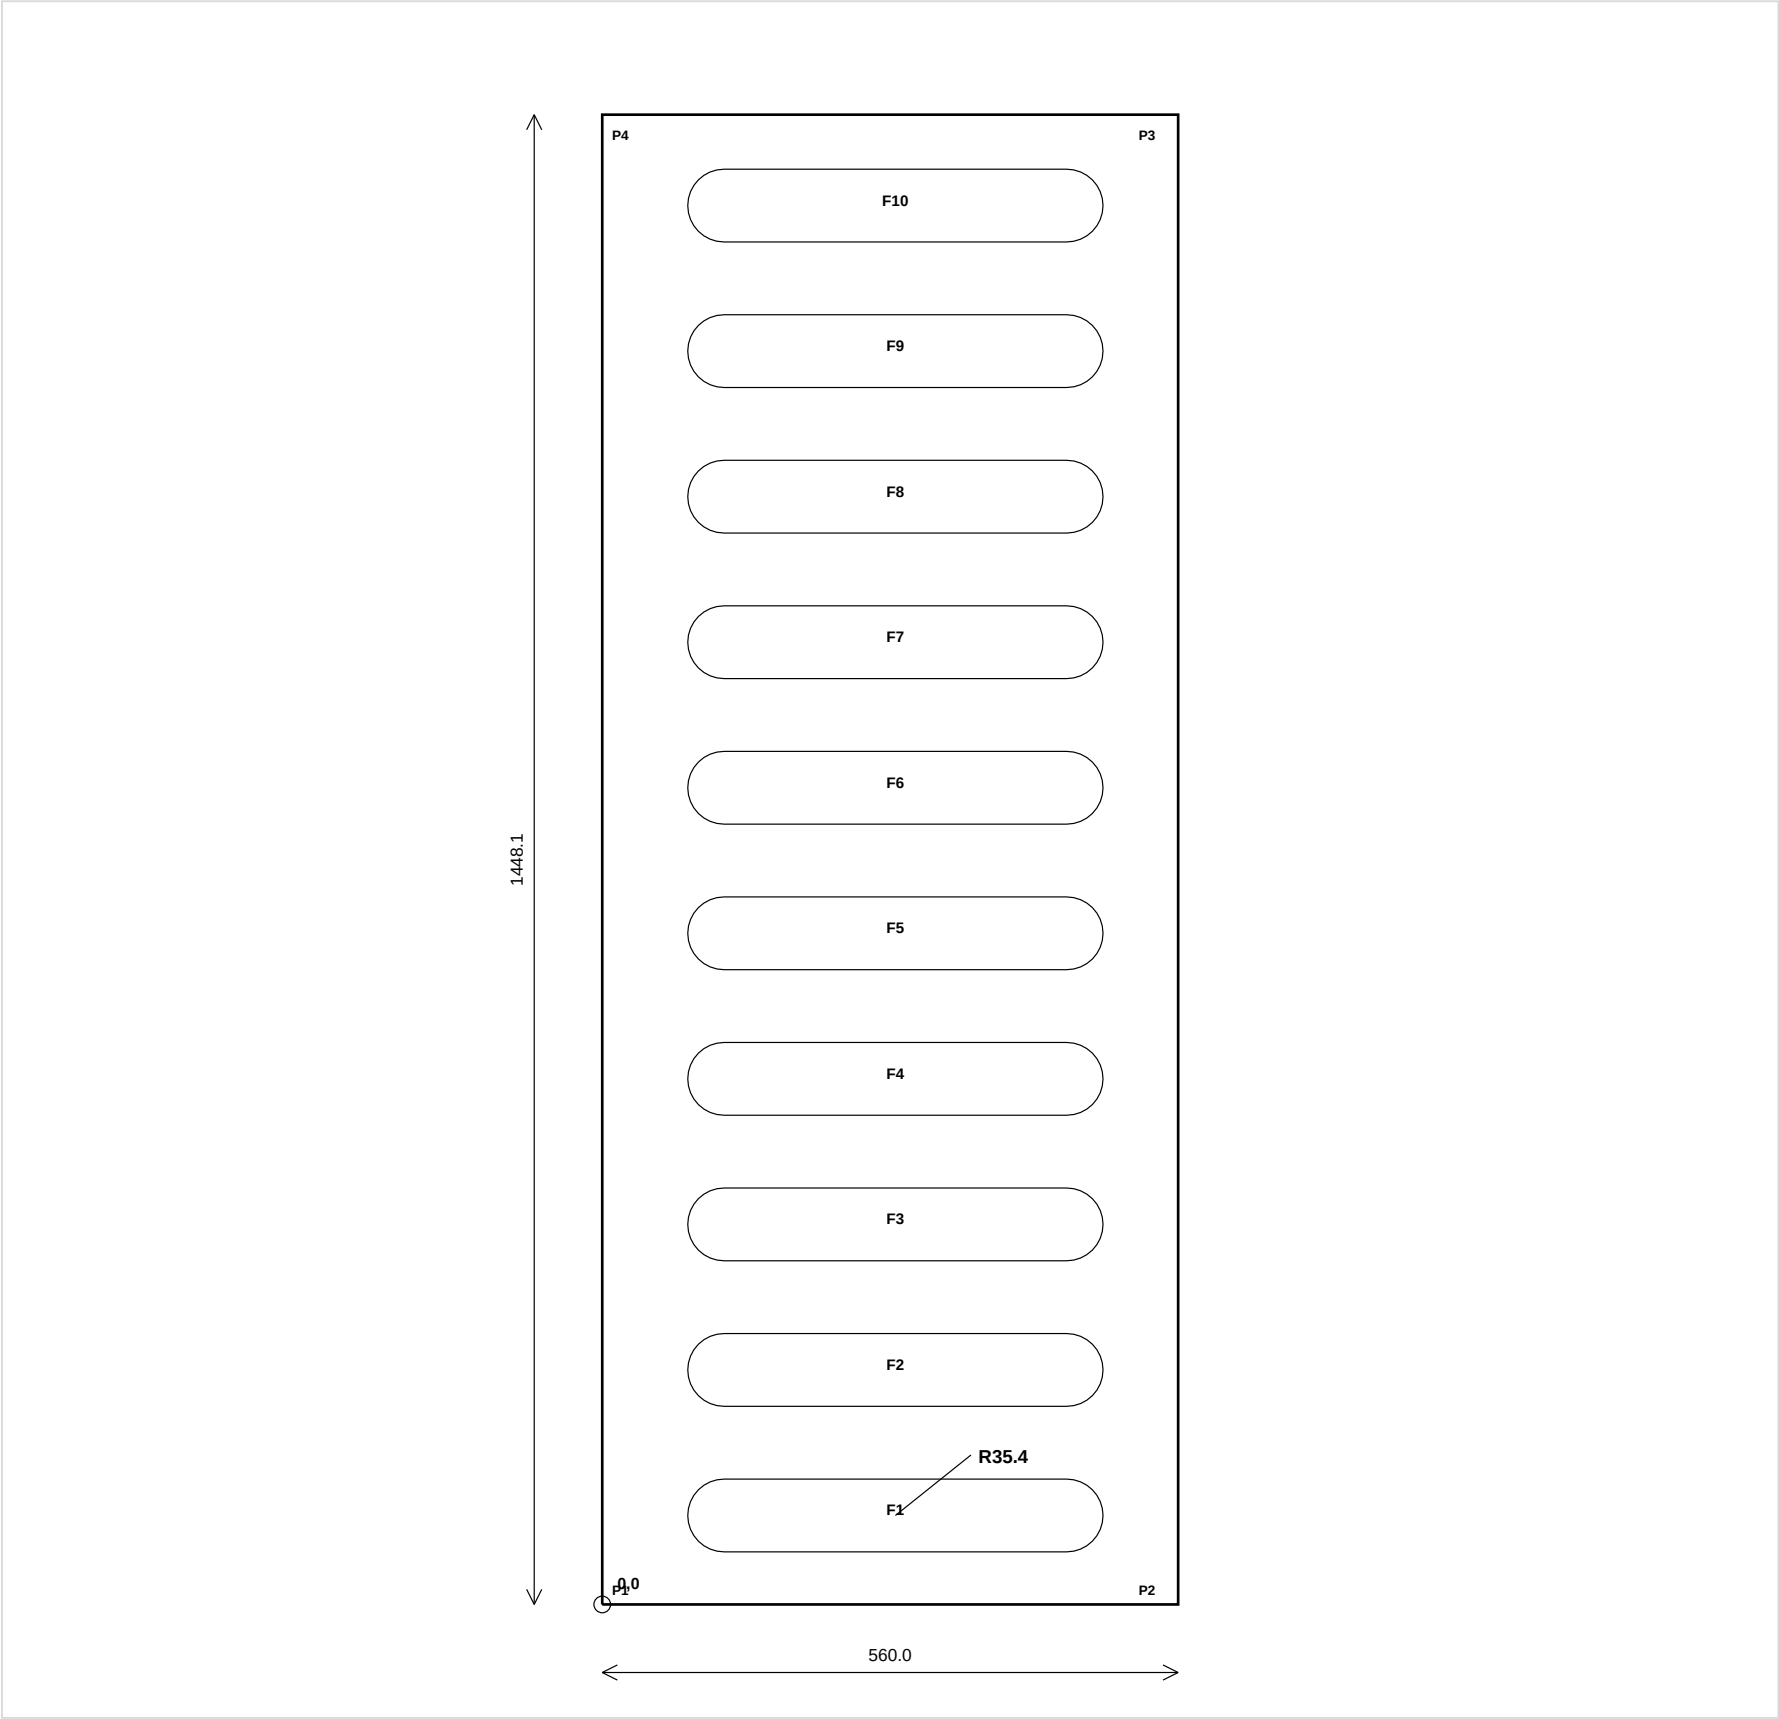

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	slot 403.8 x 70.7, R35.4	X 285.1 Y 86.5
F2	slot 403.8 x 70.7, R35.4	X 285.1 Y 227.9
F3	slot 403.8 x 70.7, R35.4	X 285.1 Y 369.4
F4	slot 403.8 x 70.7, R35.4	X 285.1 Y 510.9
F5	slot 403.8 x 70.7, R35.4	X 285.1 Y 652.4
F6	slot 403.8 x 70.7, R35.4	X 285.1 Y 793.8
F7	slot 403.8 x 70.7, R35.4	X 285.1 Y 935.3
F8	slot 403.8 x 70.7, R35.4	X 285.1 Y 1076.8
F9	slot 403.8 x 70.7, R35.4	X 285.0 Y 1218.3
F10	slot 403.8 x 70.7, R35.4	X 285.0 Y 1359.7


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X560.0 Y0.0	LINE
P3	X560.0 Y1448.1	LINE
P4	X0.0 Y1448.1	LINE

S3-H - Part detail

Overall 382.0 x 1450.0 mm | 18 mm plywood | datum lower-left = X0 Y0

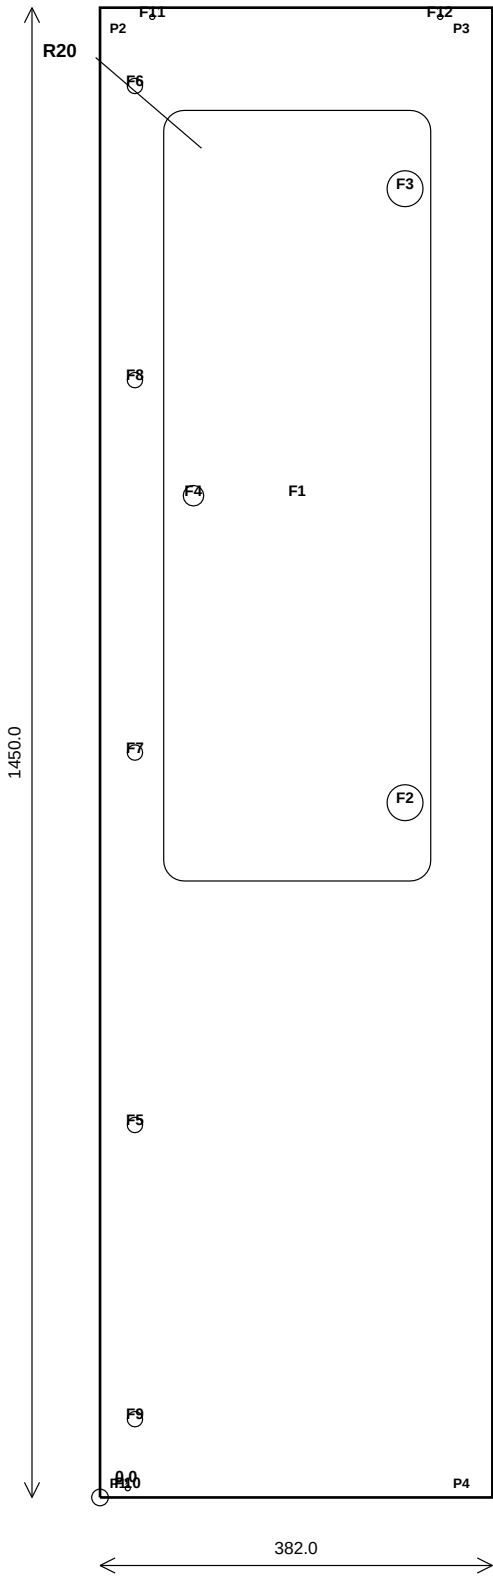

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	door cut-out 260.0 x 750.0, R20	X 192.0 Y 975.0
F2	Dia 35 x 13 deep	X 297.0 Y 676.2
F3	Dia 35 x 13 deep	X 297.0 Y 1273.8
F4	Dia 20 THROUGH	X 91.0 Y 975.0
F5	Dia 15 x 14 deep	X 34.0 Y 362.5
F6	Dia 15 x 14 deep	X 34.0 Y 1373.8
F7	Dia 15 x 14 deep	X 34.0 Y 725.0
F8	Dia 15 x 14 deep	X 34.0 Y 1087.5
F9	Dia 15 x 14 deep	X 34.0 Y 76.2
F10	Dia 5 x 11 deep	X 27.0 Y 9.0
F11	Dia 5 x 11 deep	X 51.0 Y 1441.0
F12	Dia 5 x 11 deep	X 331.0 Y 1441.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X0.0 Y1450.0	LINE
P3	X382.0 Y1450.0	LINE
P4	X382.0 Y0.0	LINE

S4-A - Part detail

Overall 1070.0 x 400.0 mm | 18 mm plywood | datum lower-left = X0 Y0

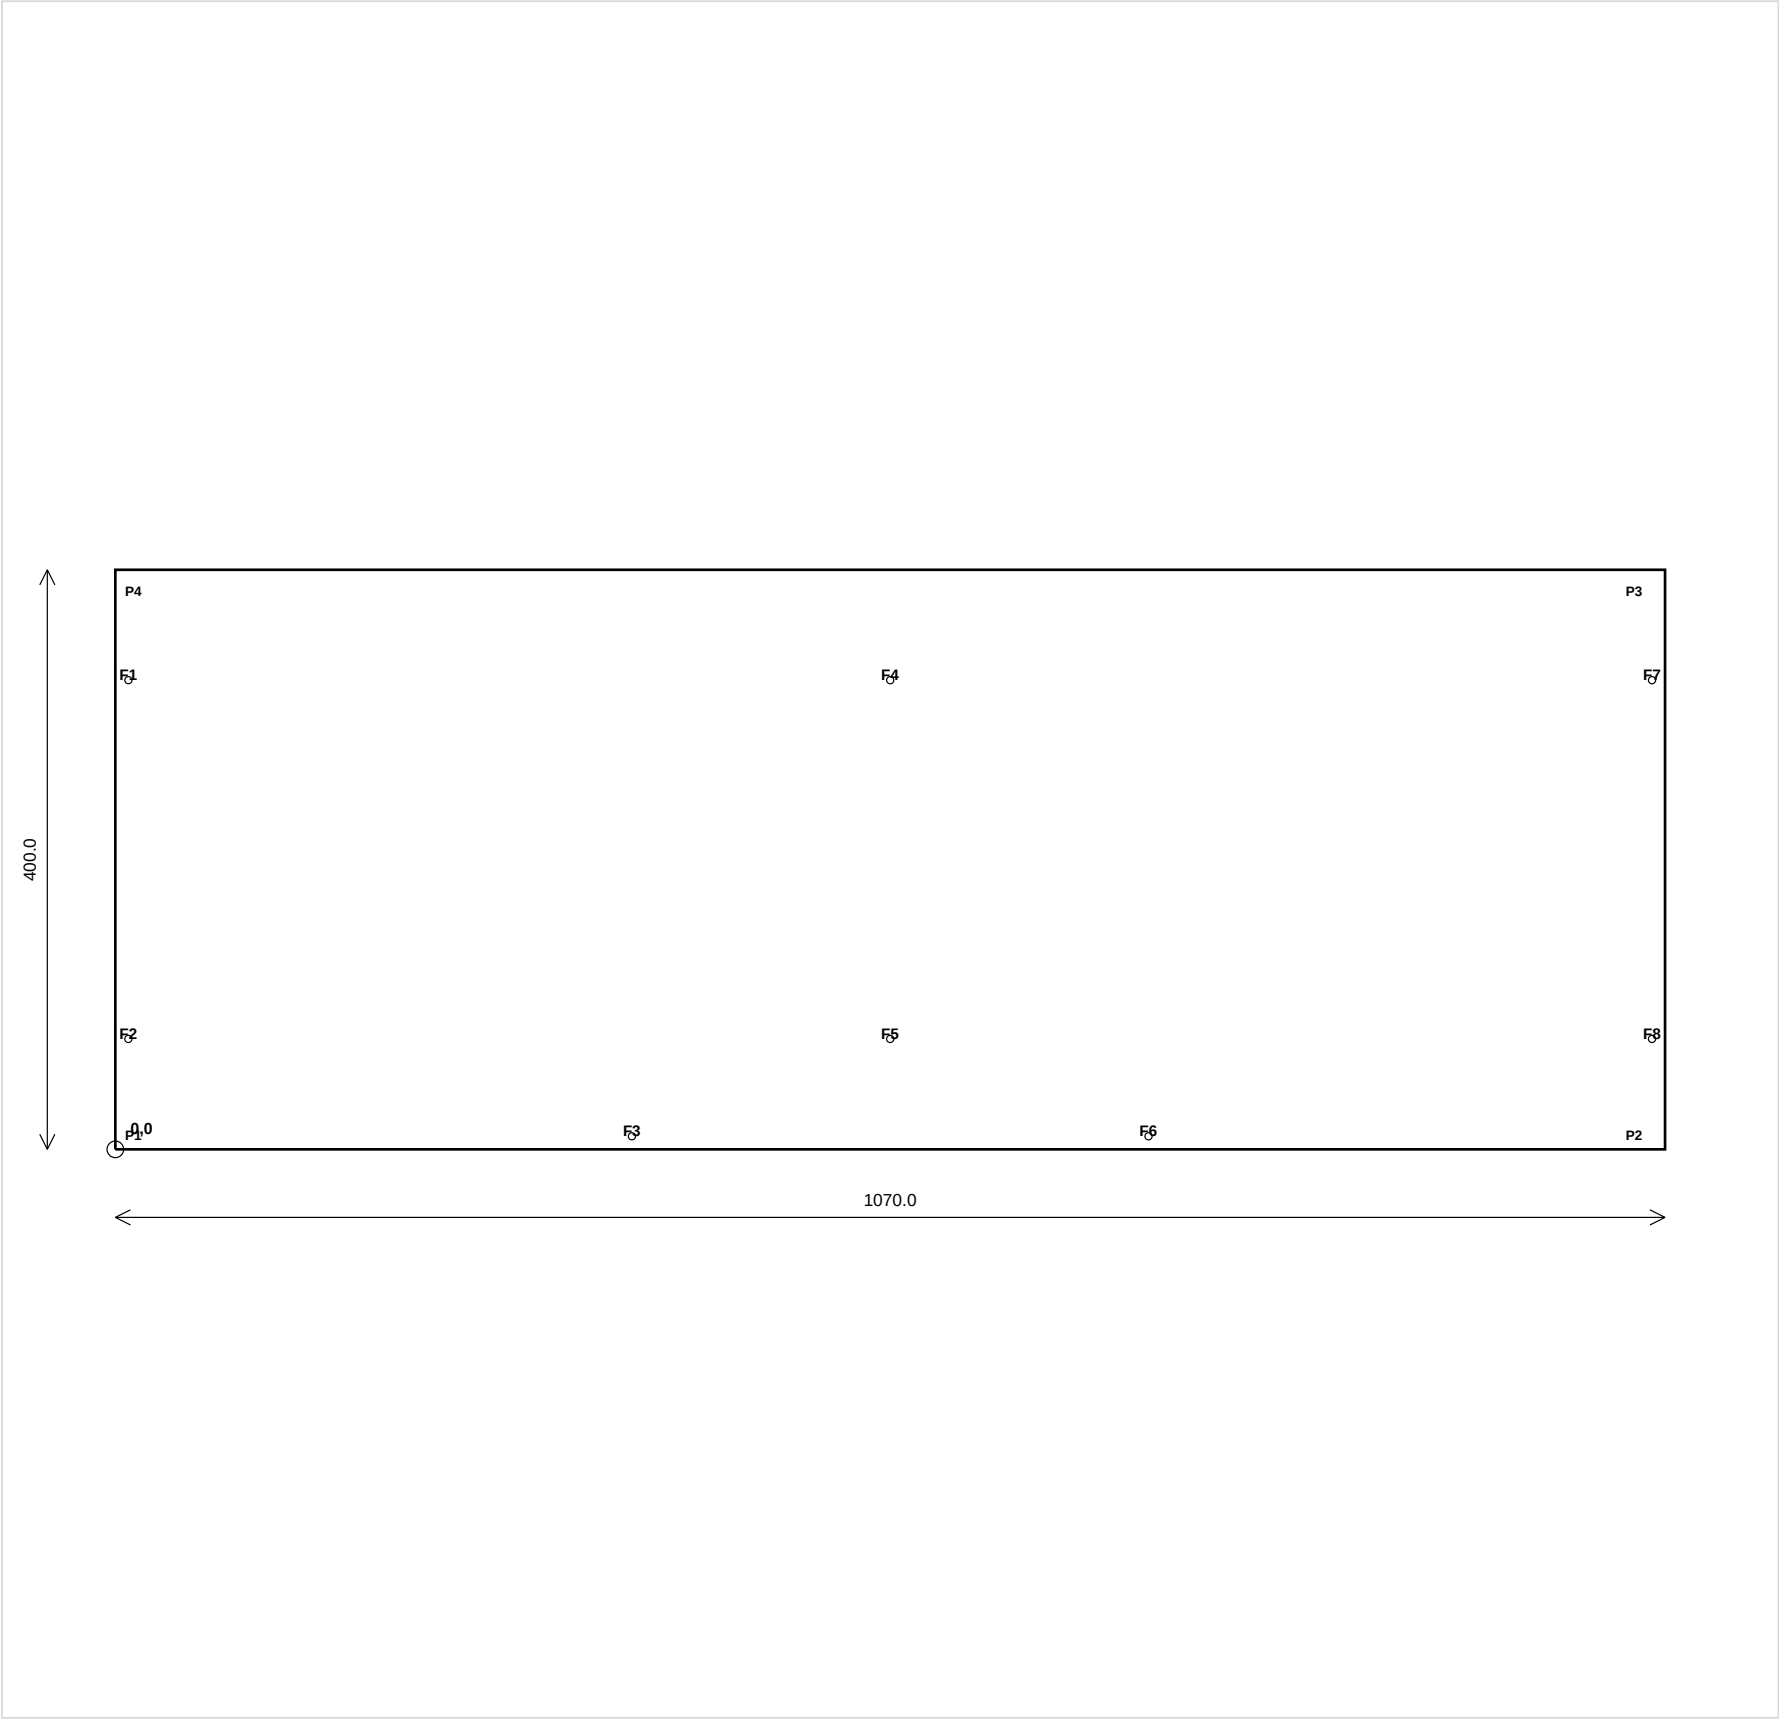

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 5 x 11 deep	X 9.0 Y 324.0
F2	Dia 5 x 11 deep	X 9.0 Y 76.0
F3	Dia 5 x 11 deep	X 356.7 Y 9.0
F4	Dia 5 x 11 deep	X 535.0 Y 324.0
F5	Dia 5 x 11 deep	X 535.0 Y 76.0
F6	Dia 5 x 11 deep	X 713.3 Y 9.0
F7	Dia 5 x 11 deep	X 1061.0 Y 324.0
F8	Dia 5 x 11 deep	X 1061.0 Y 76.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X1070.0 Y0.0	LINE
P3	X1070.0 Y400.0	LINE
P4	X0.0 Y400.0	LINE

S4-B - Part detail

Overall 508.0 x 382.0 mm | 18 mm plywood | datum lower-left = X0 Y0

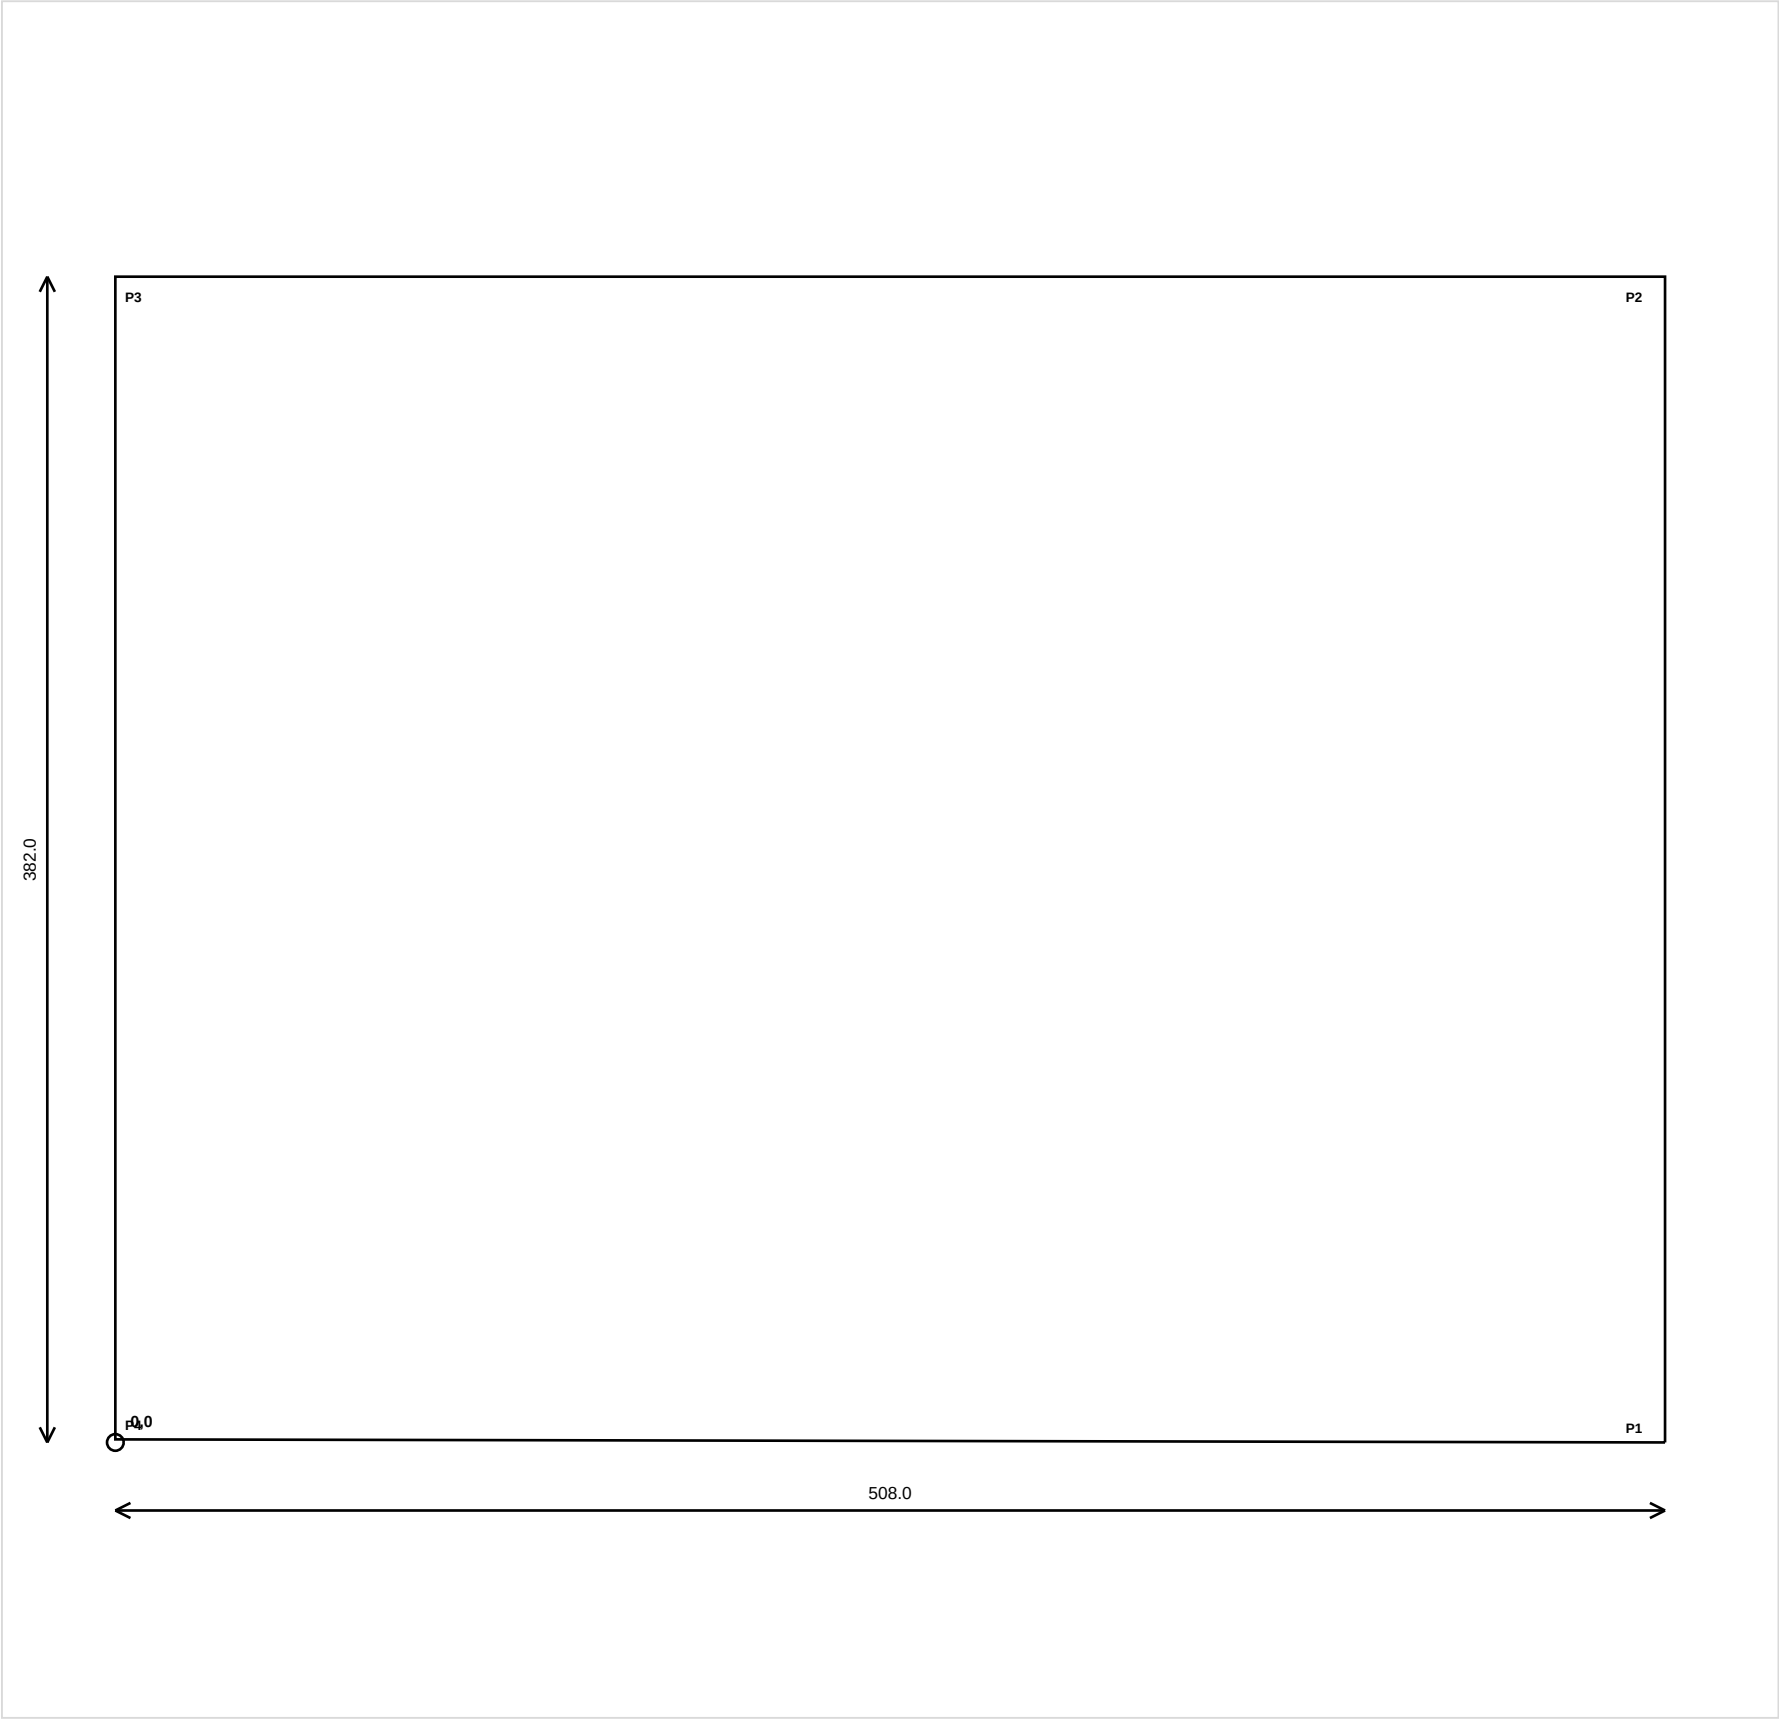

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X508.0 Y0.0	LINE
P2	X508.0 Y382.0	LINE
P3	X0.0 Y382.0	LINE
P4	X0.0 Y1.0	LINE

S4-C - Part detail

Overall 508.0 x 382.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X508.0 Y0.0	LINE
P2	X0.0 Y0.0	LINE
P3	X0.0 Y382.0	LINE
P4	X508.0 Y382.0	LINE

S4-D - Part detail

Overall 382.0 x 742.0 mm | 18 mm plywood | datum lower-left = X0 Y0

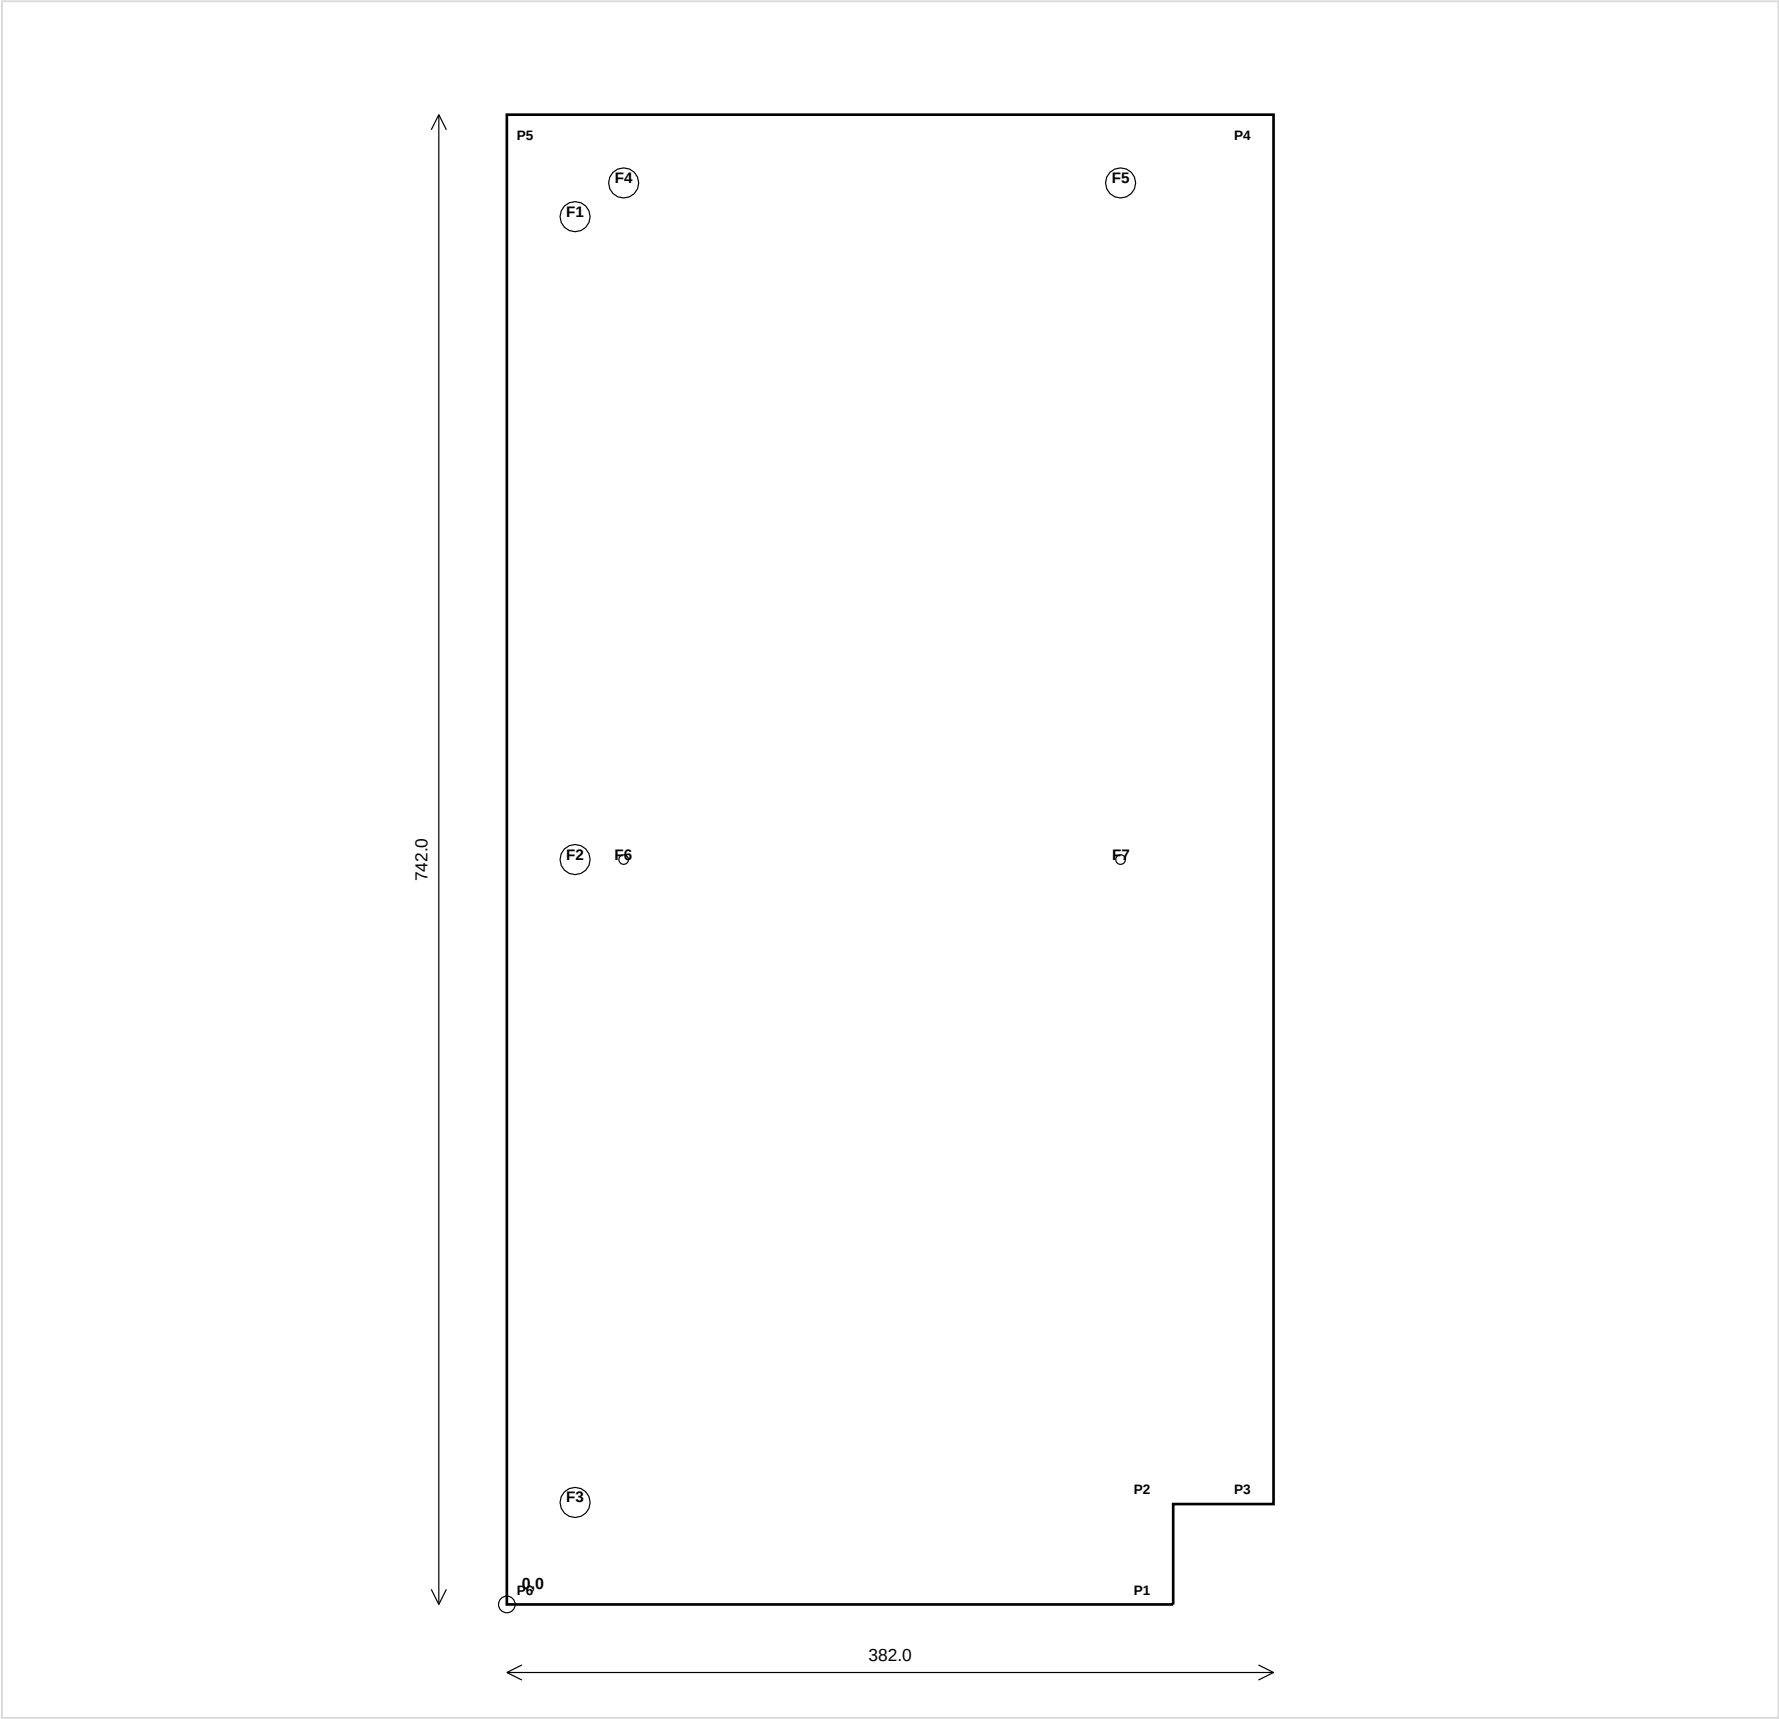

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 34.0 Y 691.2
F2	Dia 15 x 14 deep	X 34.0 Y 371.0
F3	Dia 15 x 14 deep	X 34.0 Y 50.8
F4	Dia 15 x 14 deep	X 58.2 Y 708.0
F5	Dia 15 x 14 deep	X 305.8 Y 708.0
F6	Dia 5 x 11 deep	X 58.0 Y 371.0
F7	Dia 5 x 11 deep	X 306.0 Y 371.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X332.0 Y0.0	LINE
P2	X332.0 Y50.0	LINE
P3	X382.0 Y50.0	LINE
P4	X382.0 Y742.0	LINE
P5	X0.0 Y742.0	LINE
P6	X0.0 Y0.0	LINE

S4-E - Part detail

Overall 382.0 x 742.0 mm | 18 mm plywood | datum lower-left = X0 Y0

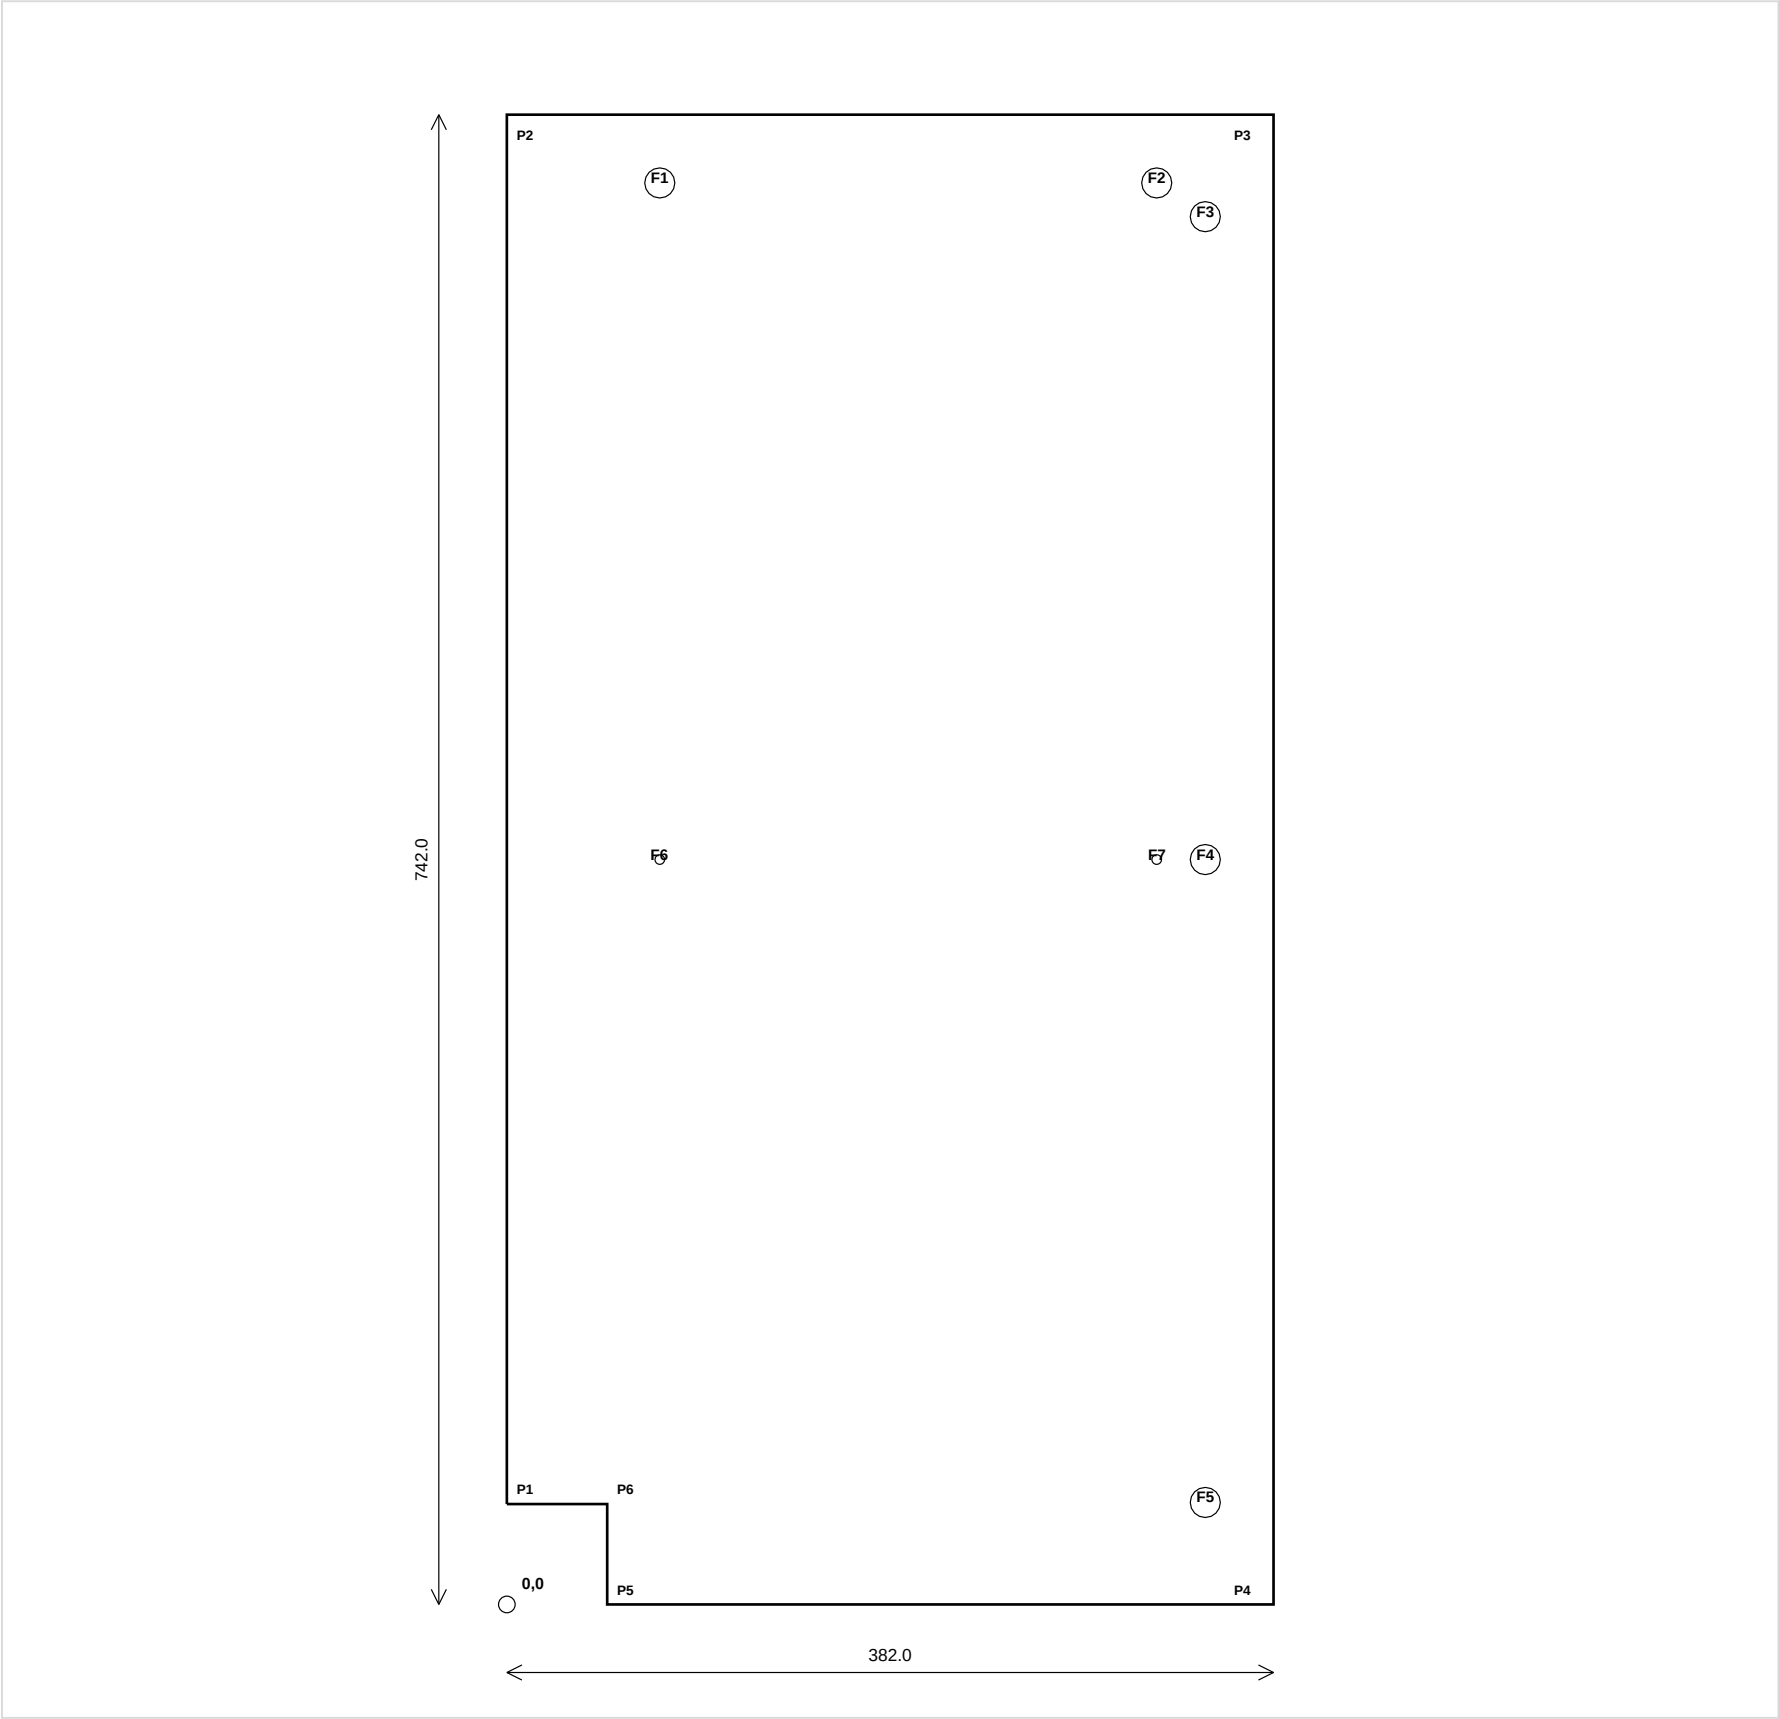

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 76.2 Y 708.0
F2	Dia 15 x 14 deep	X 323.8 Y 708.0
F3	Dia 15 x 14 deep	X 348.0 Y 691.2
F4	Dia 15 x 14 deep	X 348.0 Y 371.0
F5	Dia 15 x 14 deep	X 348.0 Y 50.8
F6	Dia 5 x 11 deep	X 76.0 Y 371.0
F7	Dia 5 x 11 deep	X 324.0 Y 371.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y50.0	LINE
P2	X0.0 Y742.0	LINE
P3	X382.0 Y742.0	LINE
P4	X382.0 Y0.0	LINE
P5	X50.0 Y0.0	LINE
P6	X50.0 Y50.0	LINE

S4-F - Part detail

Overall 382.0 x 742.0 mm | 18 mm plywood | datum lower-left = X0 Y0

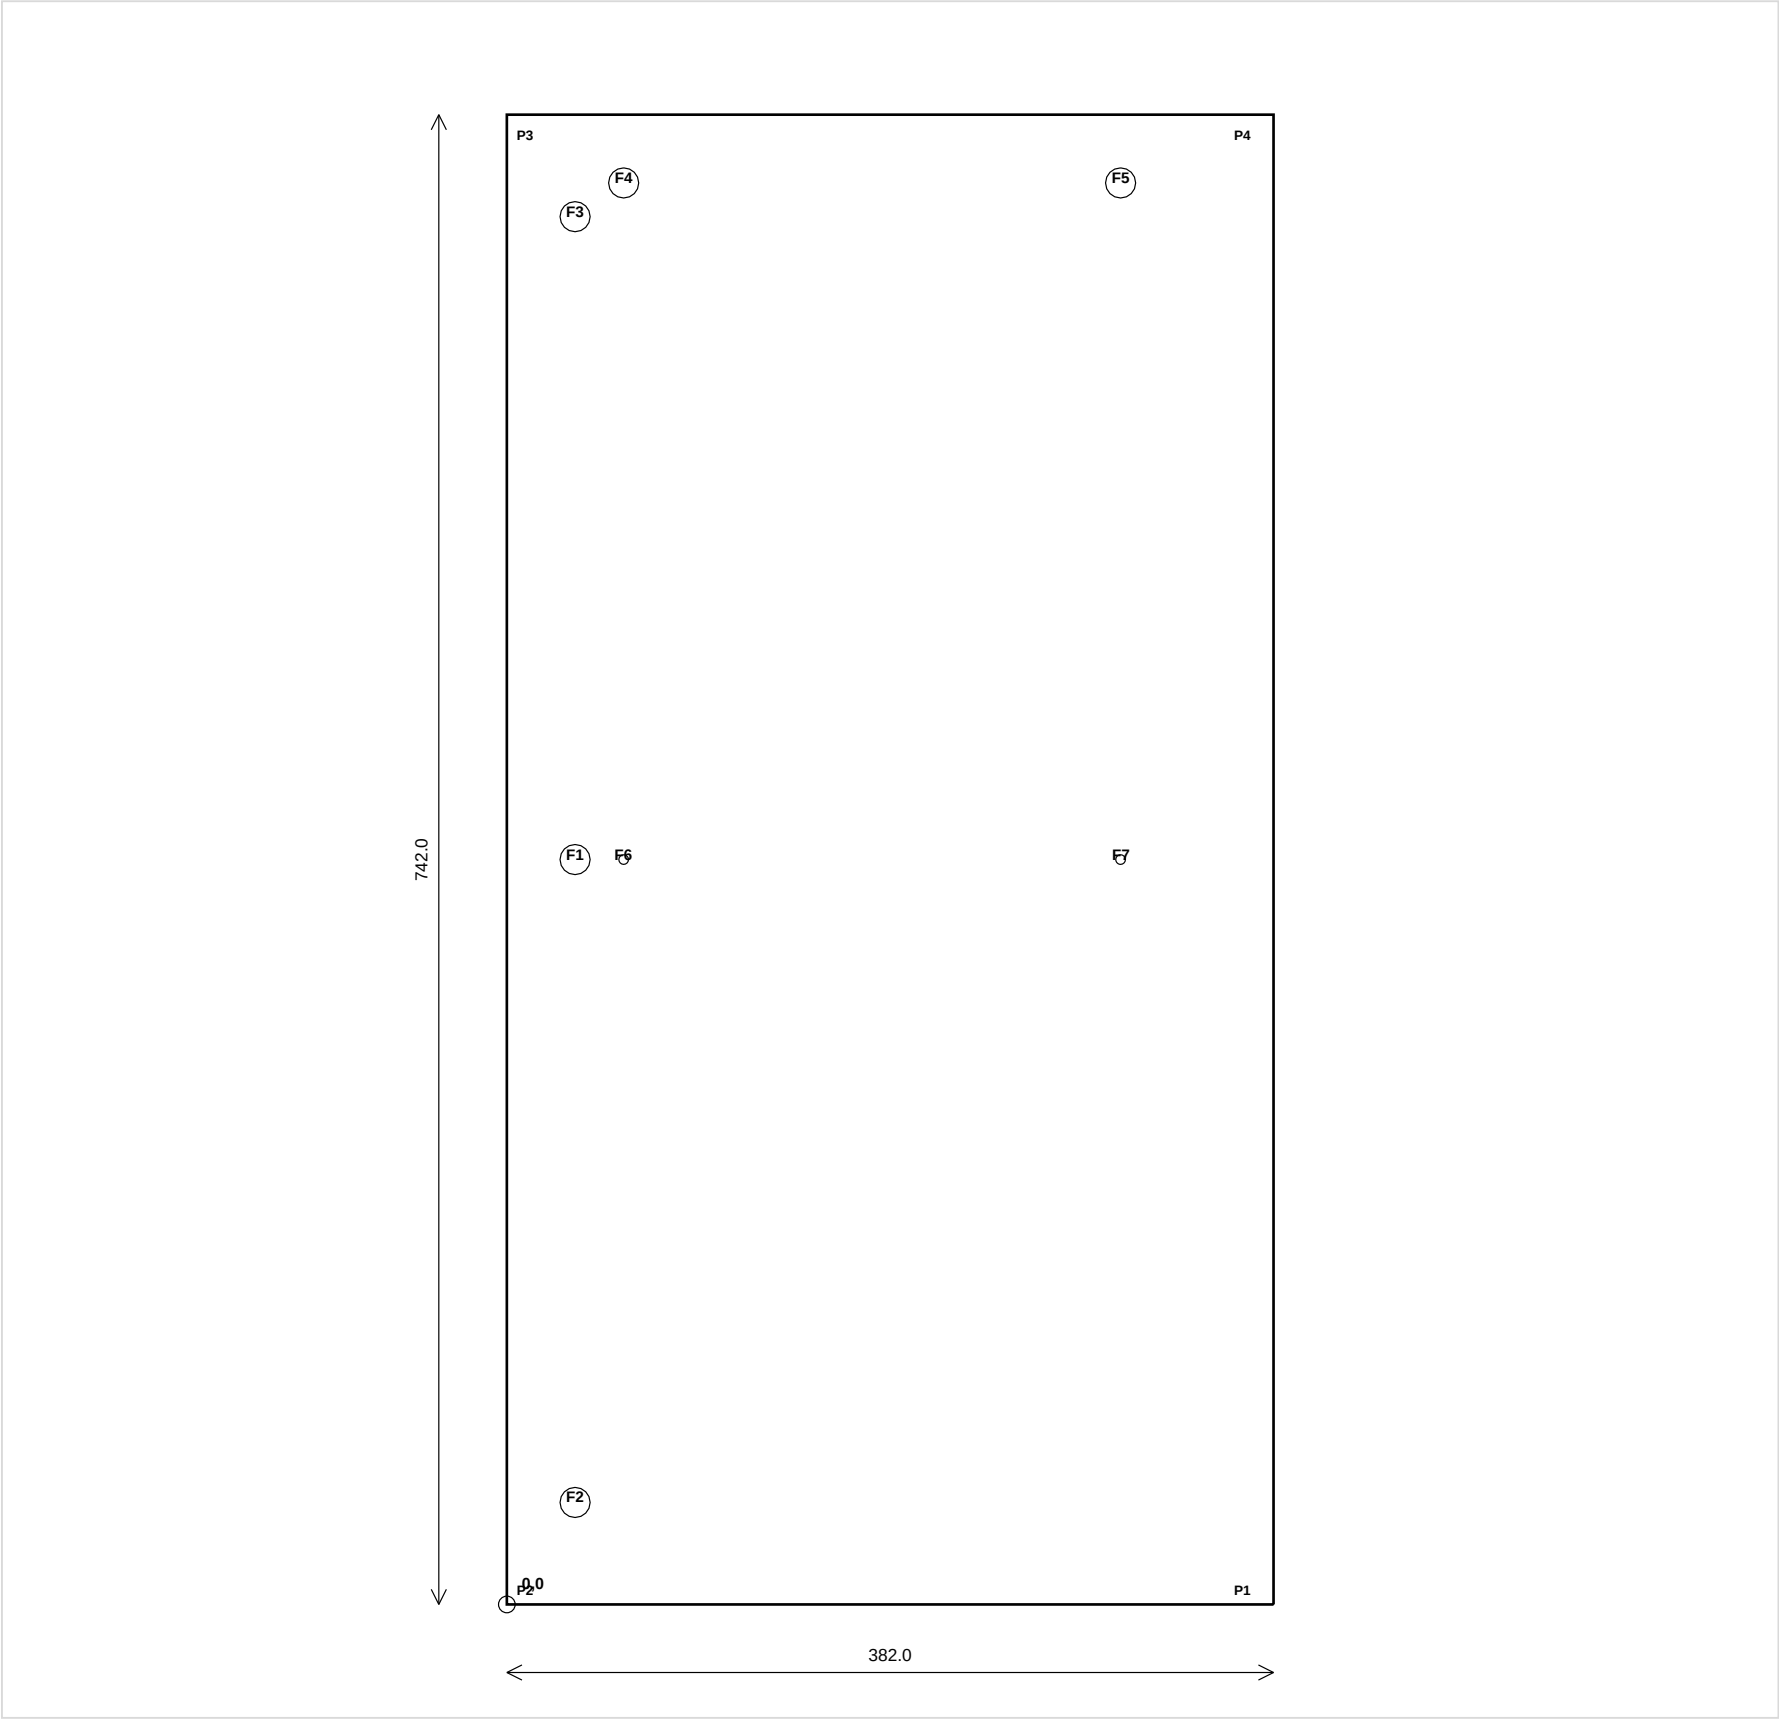

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 34.0 Y 371.0
F2	Dia 15 x 14 deep	X 34.0 Y 50.8
F3	Dia 15 x 14 deep	X 34.0 Y 691.2
F4	Dia 15 x 14 deep	X 58.2 Y 708.0
F5	Dia 15 x 14 deep	X 305.8 Y 708.0
F6	Dia 5 x 11 deep	X 58.0 Y 371.0
F7	Dia 5 x 11 deep	X 306.0 Y 371.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X382.0 Y0.0	LINE
P2	X0.0 Y0.0	LINE
P3	X0.0 Y742.0	LINE
P4	X382.0 Y742.0	LINE

S4-G - Part detail

Overall 1070.0 x 742.0 mm | 18 mm plywood | datum lower-left = X0 Y0

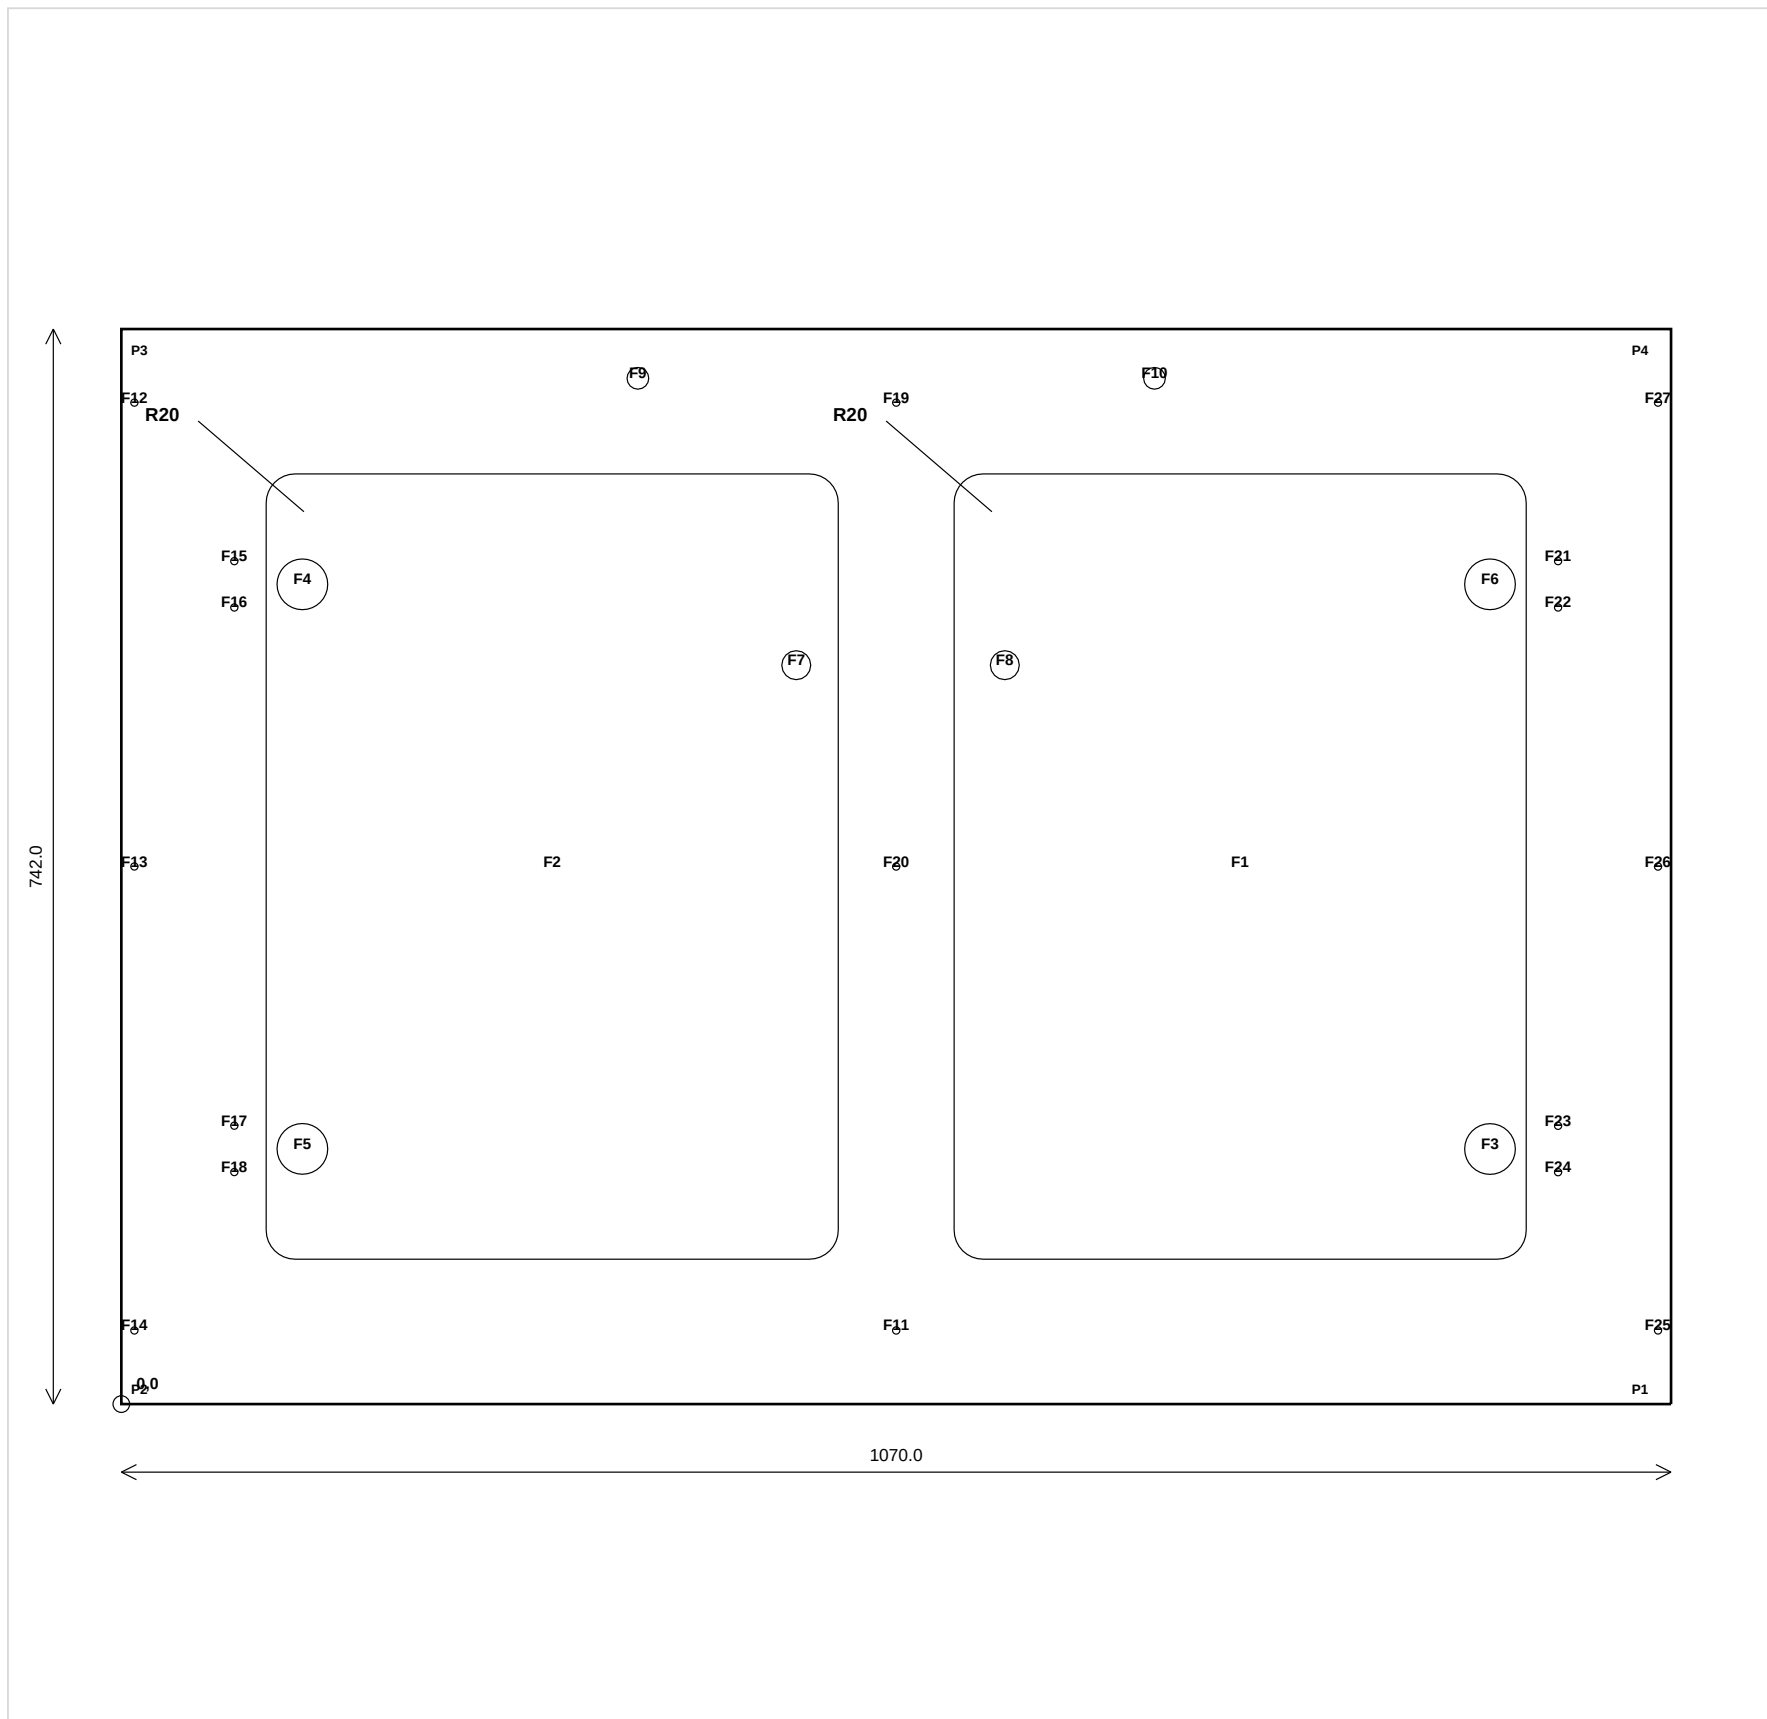

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1	door cut-out 395.0 x 542.0, R20	X 772.5 Y 371.0
F2	door cut-out 395.0 x 542.0, R20	X 297.5 Y 371.0
F3	Dia 35 x 13 deep	X 945.0 Y 176.0
F4	Dia 35 x 13 deep	X 125.0 Y 565.8
F5	Dia 35 x 13 deep	X 125.0 Y 176.1
F6	Dia 35 x 13 deep	X 945.0 Y 565.8
F7	Dia 20 THROUGH	X 466.0 Y 510.0
F8	Dia 20 THROUGH	X 610.0 Y 510.0
F9	Dia 15 x 14 deep	X 356.7 Y 708.0
F10	Dia 15 x 14 deep	X 713.3 Y 708.0
F11	Dia 5 x 11 deep	X 535.0 Y 51.0
F12	Dia 5 x 11 deep	X 9.0 Y 691.0
F13	Dia 5 x 11 deep	X 9.0 Y 371.0
F14	Dia 5 x 11 deep	X 9.0 Y 51.0
F15	Dia 5 x 11 deep	X 78.0 Y 582.0
F16	Dia 5 x 11 deep	X 78.0 Y 550.0
F17	Dia 5 x 11 deep	X 78.0 Y 192.0
F18	Dia 5 x 11 deep	X 78.0 Y 160.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X1070.0 Y0.0	LINE
P2	X0.0 Y0.0	LINE
P3	X0.0 Y742.0	LINE
P4	X1070.0 Y742.0	LINE

Machining features - continued

F19	Dia 5 x 11 deep	X 535.0 Y 691.0
F20	Dia 5 x 11 deep	X 535.0 Y 371.0
F21	Dia 5 x 11 deep	X 992.0 Y 582.0
F22	Dia 5 x 11 deep	X 992.0 Y 550.0
F23	Dia 5 x 11 deep	X 992.0 Y 192.0
F24	Dia 5 x 11 deep	X 992.0 Y 160.0
F25	Dia 5 x 11 deep	X 1061.0 Y 51.0
F26	Dia 5 x 11 deep	X 1061.0 Y 371.0
F27	Dia 5 x 11 deep	X 1061.0 Y 691.0