

VW-CADDY-STANDARD-USHAPE

Coordinate system

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Example: X100 / Y50 = 100 mm right from the left edge, then 50 mm up from the bottom.

Rules

- 18 mm plywood
- Dia 5 = 11 mm deep; nominal 8.8/8.9 edge positions shown as 9 mm
- Dia 15 = 14 mm deep
- Dia 20 = THROUGH
- Dia 35 = 13 mm deep
- Radius of a rounded slot/cut-out = half its narrow width unless a specific radius is shown
- Door cut-outs use R20
- 5 mm / 15 mm fixing holes may be omitted when using L-brackets or timber blocks.

8 mm cam-fitting edge holes

Where a 15 mm cam-lock hole is shown, drill an 8 mm hole centrally through the edge of the mating side panel using a self-centring jig with an 8 mm guide.

Align the 8 mm hole with the centre of the 15 mm cam-lock bore.


Sheet structure


Sheet 1: 9 panels


Sheet 2: 15 panels

Sheet 3: 11 panels

Total: 35 panels

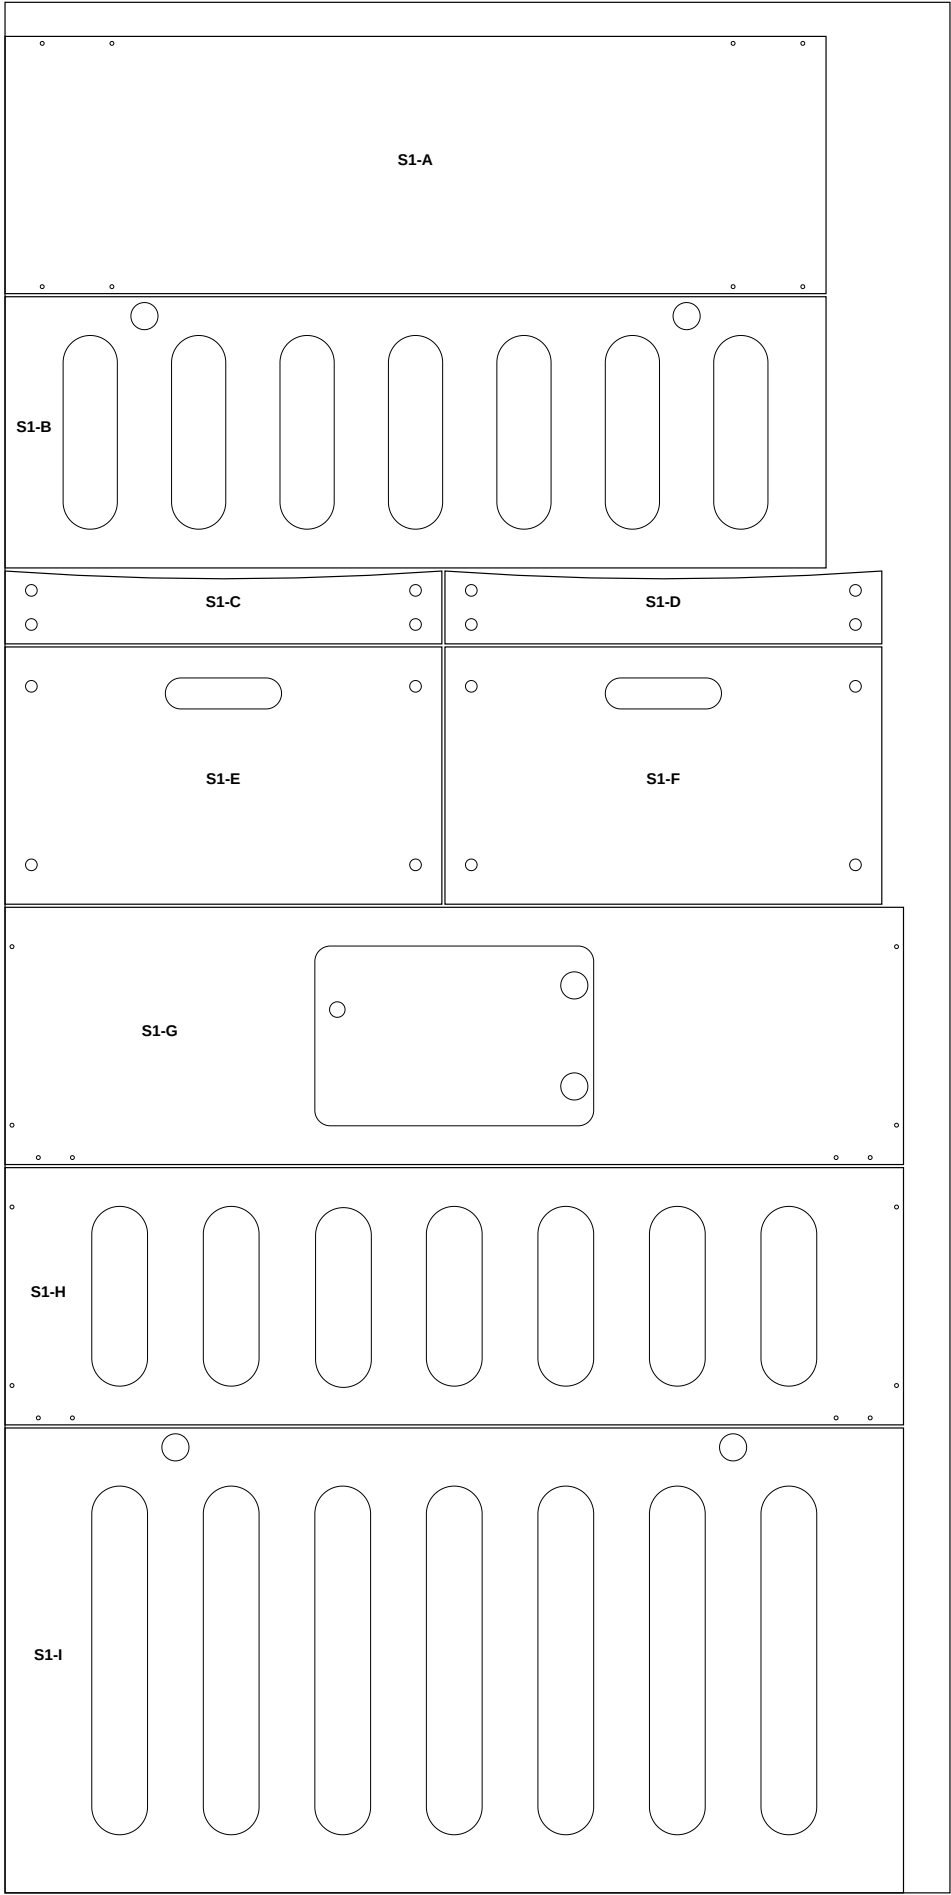


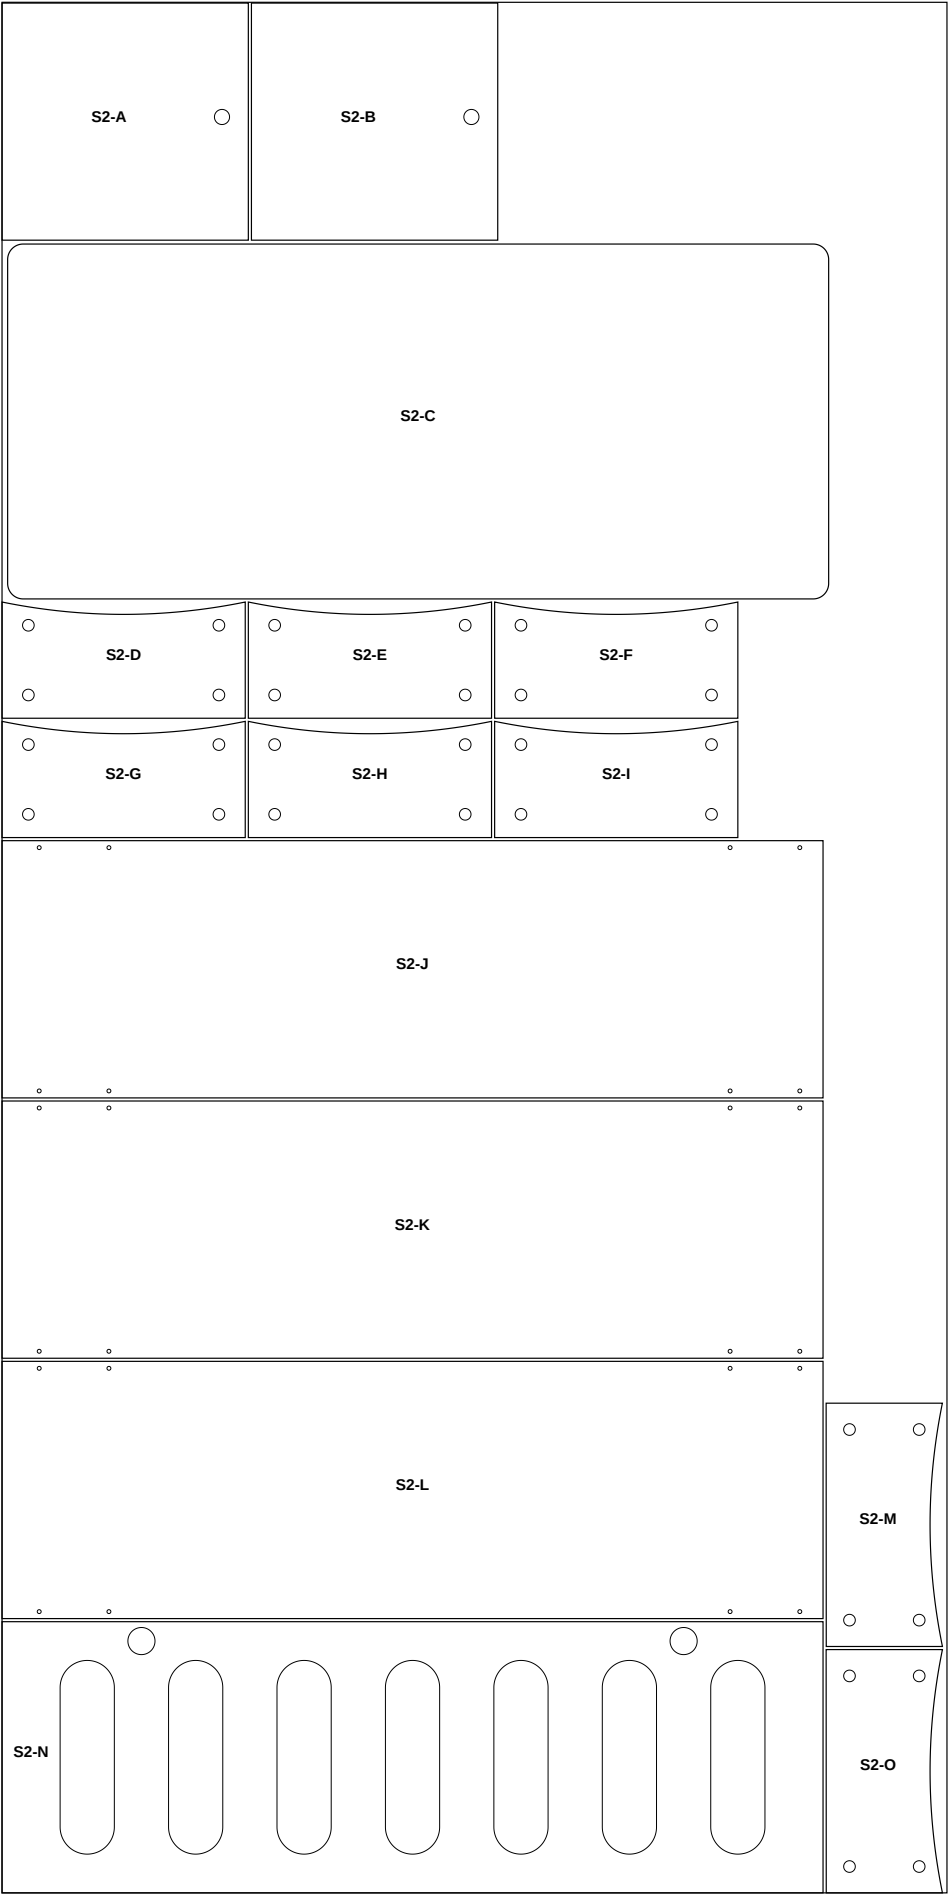

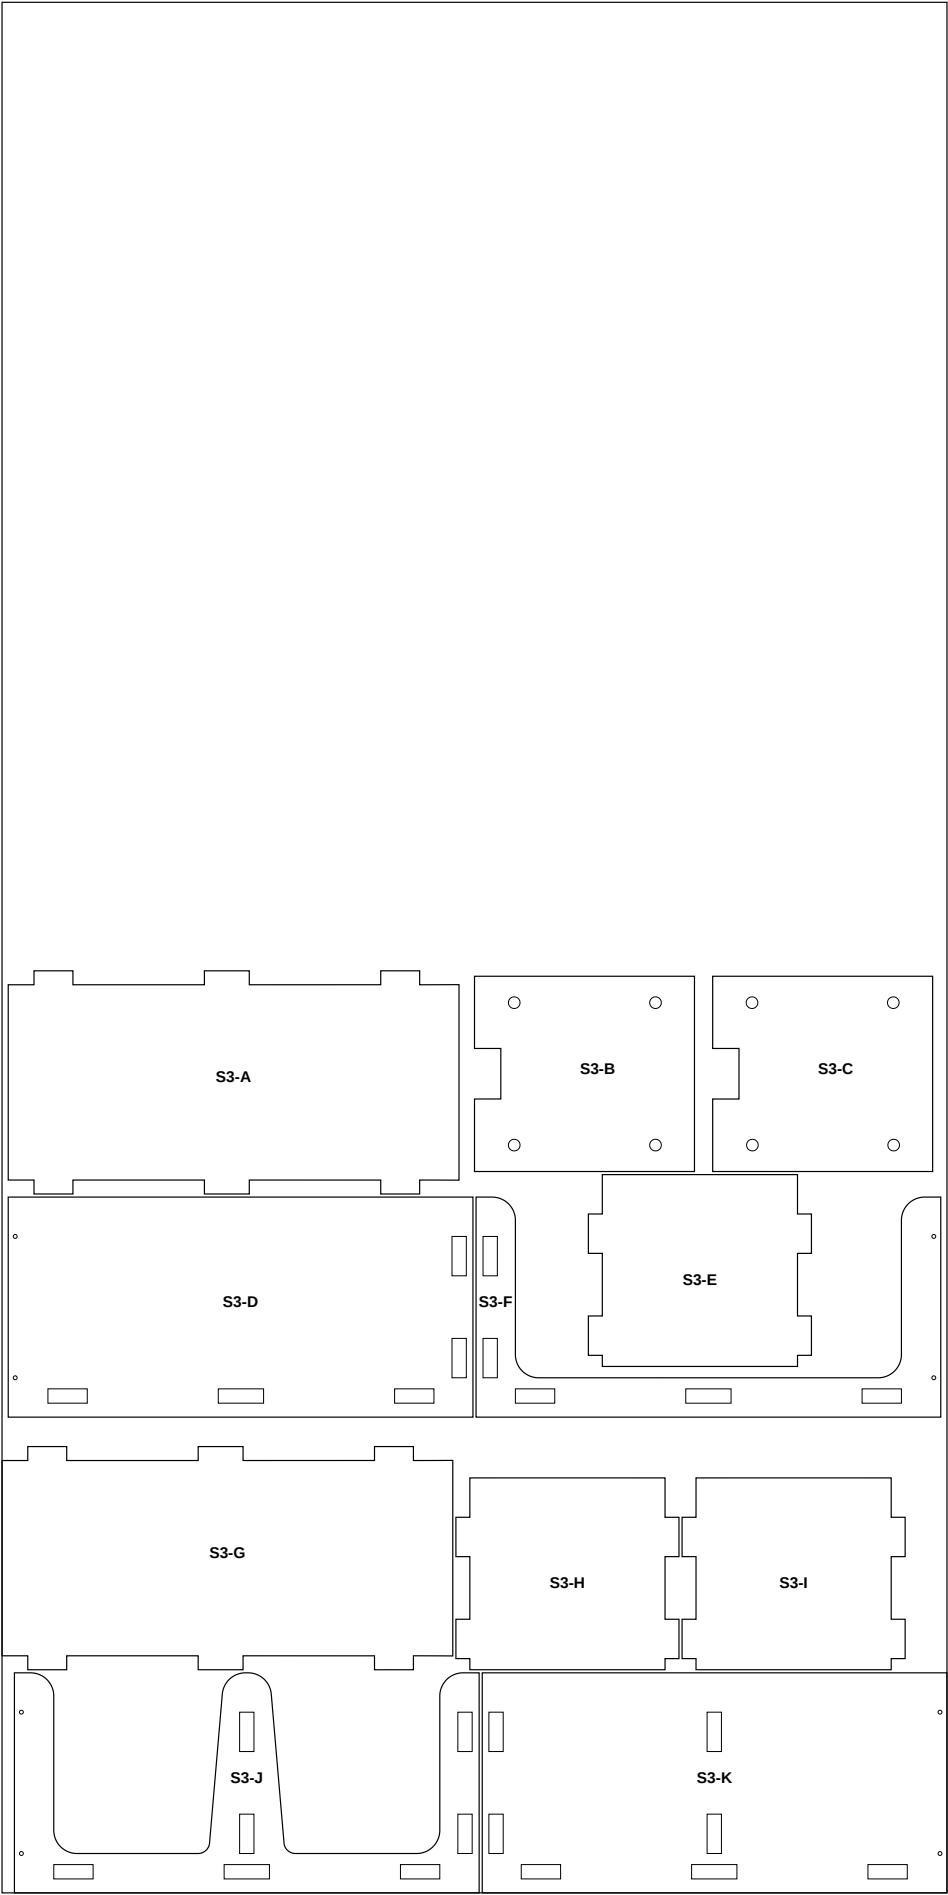

S1-A - Part detail

Overall 1060.0 x 332.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 48.0 Y 9.0
- F2 Dia 5 x 11 deep X 138.0 Y 9.0
- F3 Dia 5 x 11 deep X 940.0 Y 9.0
- F4 Dia 5 x 11 deep X 1030.0 Y 9.0
- F5 Dia 5 x 11 deep X 48.0 Y 323.0
- F6 Dia 5 x 11 deep X 138.0 Y 323.0
- F7 Dia 5 x 11 deep X 940.0 Y 323.0
- F8 Dia 5 x 11 deep X 1030.0 Y 323.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y332.0 LINE
- P2 X1060.0 Y332.0 LINE
- P3 X1060.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE

S1-B - Part detail

Overall 1060.0 x 350.0 mm | 18 mm plywood | datum lower-left = X0 Y0

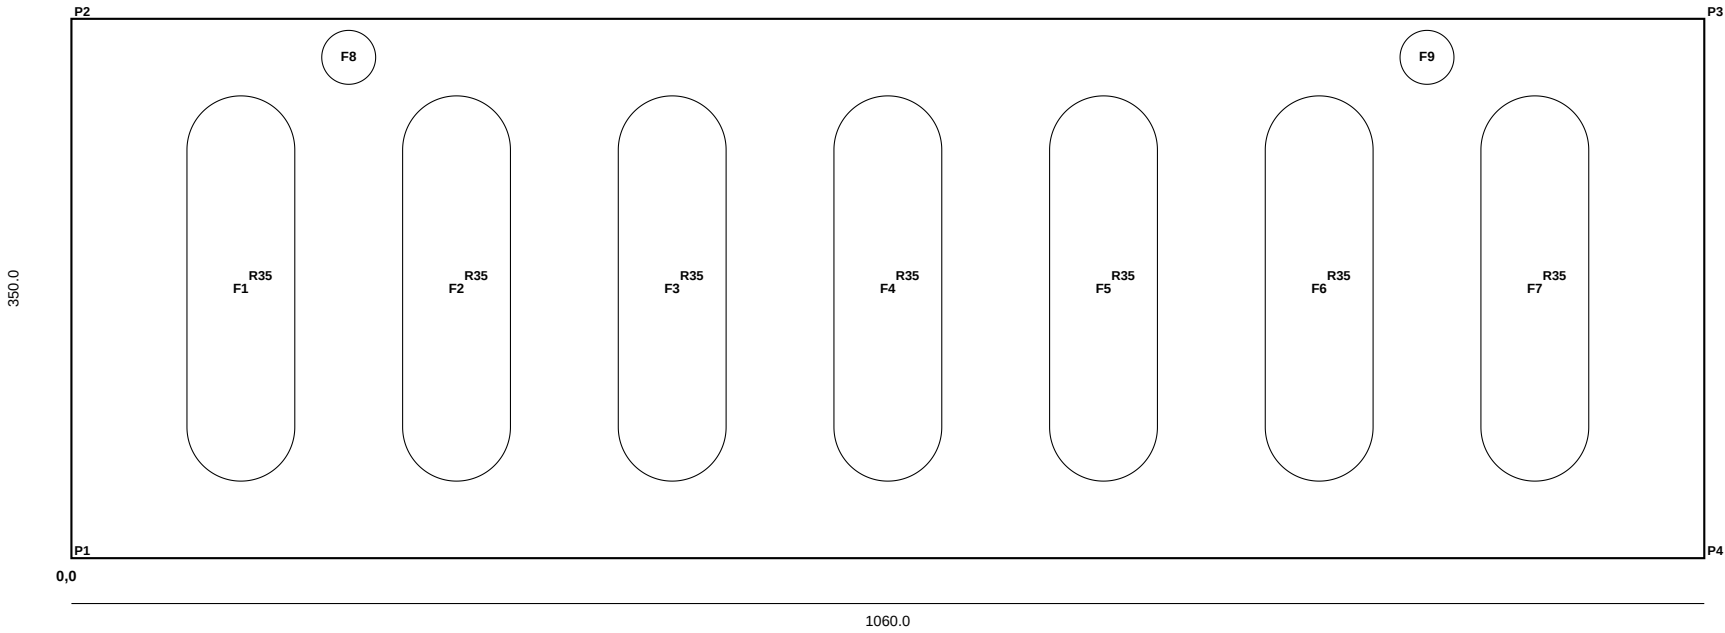

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 slot/cut-out 70.0 x 250.0, R35 X 110.0 Y 175.0

F2 slot/cut-out 70.0 x 250.0, R35 X 250.0 Y 175.0

F3 slot/cut-out 70.0 x 250.0, R35 X 390.0 Y 175.0

F4 slot/cut-out 70.0 x 250.0, R35 X 530.0 Y 175.0

F5 slot/cut-out 70.0 x 250.0, R35 X 670.0 Y 175.0

F6 slot/cut-out 70.0 x 250.0, R35 X 810.0 Y 175.0

F7 slot/cut-out 70.0 x 250.0, R35 X 950.0 Y 175.0

F8 Dia 35 x 13 deep X 180.0 Y 325.0

F9 Dia 35 x 13 deep X 880.0 Y 325.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE


P2 X0.0 Y350.0 LINE

P3 X1060.0 Y350.0 LINE

P4 X1060.0 Y0.0 LINE

S1-C - Part detail

Overall 564.0 x 94.0 mm | 18 mm plywood | datum lower-left = X0 Y0

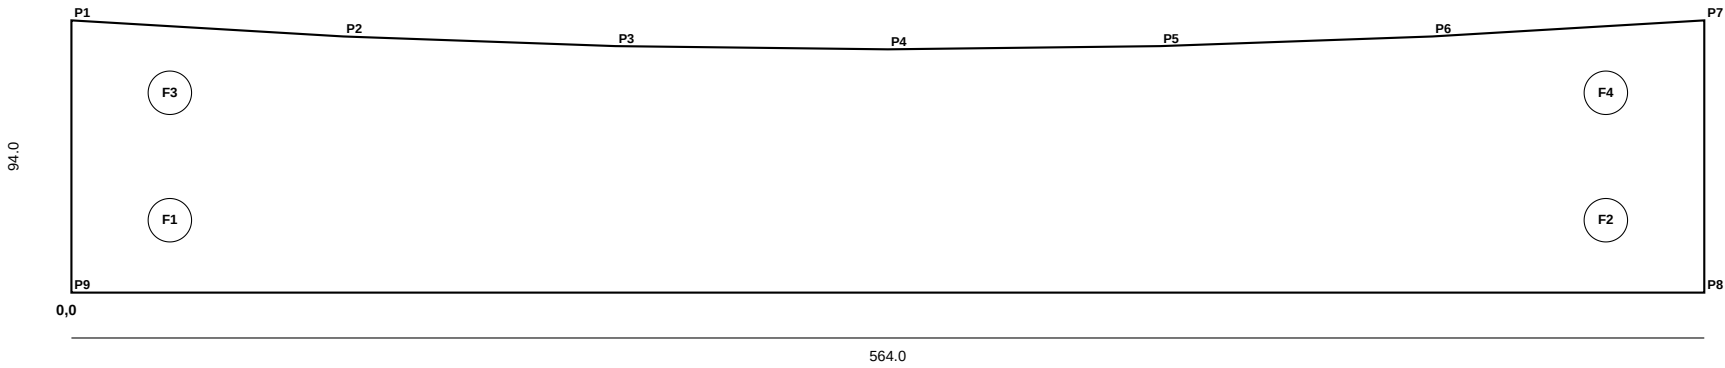

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 34.0 Y 25.0

F2 Dia 15 x 14 deep X 530.0 Y 25.0

F3 Dia 15 x 14 deep X 34.0 Y 69.0

F4 Dia 15 x 14 deep X 530.0 Y 69.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y94.0 LINE

P2 X93.9 Y88.4 LINE

P3 X187.9 Y85.1 LINE

P4 X282.0 Y84.0 LINE

P5 X376.1 Y85.1 LINE

P6 X470.1 Y88.4 LINE


P7 X564.0 Y94.0 LINE

P8 X564.0 Y0.0 LINE

P9 X0.0 Y0.0 LINE

S1-D - Part detail

Overall 564.0 x 94.0 mm | 18 mm plywood | datum lower-left = X0 Y0

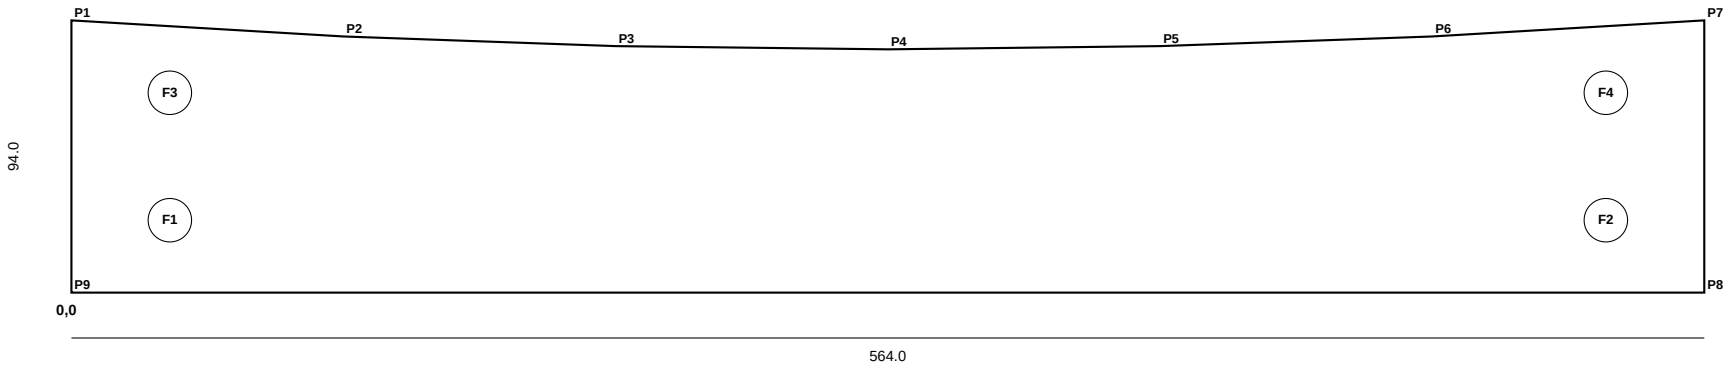

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 34.0 Y 25.0
- F2 Dia 15 x 14 deep X 530.0 Y 25.0
- F3 Dia 15 x 14 deep X 34.0 Y 69.0
- F4 Dia 15 x 14 deep X 530.0 Y 69.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y94.0 LINE
- P2 X93.9 Y88.4 LINE
- P3 X187.9 Y85.1 LINE
- P4 X282.0 Y84.0 LINE
- P5 X376.1 Y85.1 LINE
- P6 X470.1 Y88.4 LINE
- P7 X564.0 Y94.0 LINE
- P8 X564.0 Y0.0 LINE
- P9 X0.0 Y0.0 LINE

S1-E - Part detail

Overall 564.0 x 332.0 mm | 18 mm plywood | datum lower-left = X0 Y0

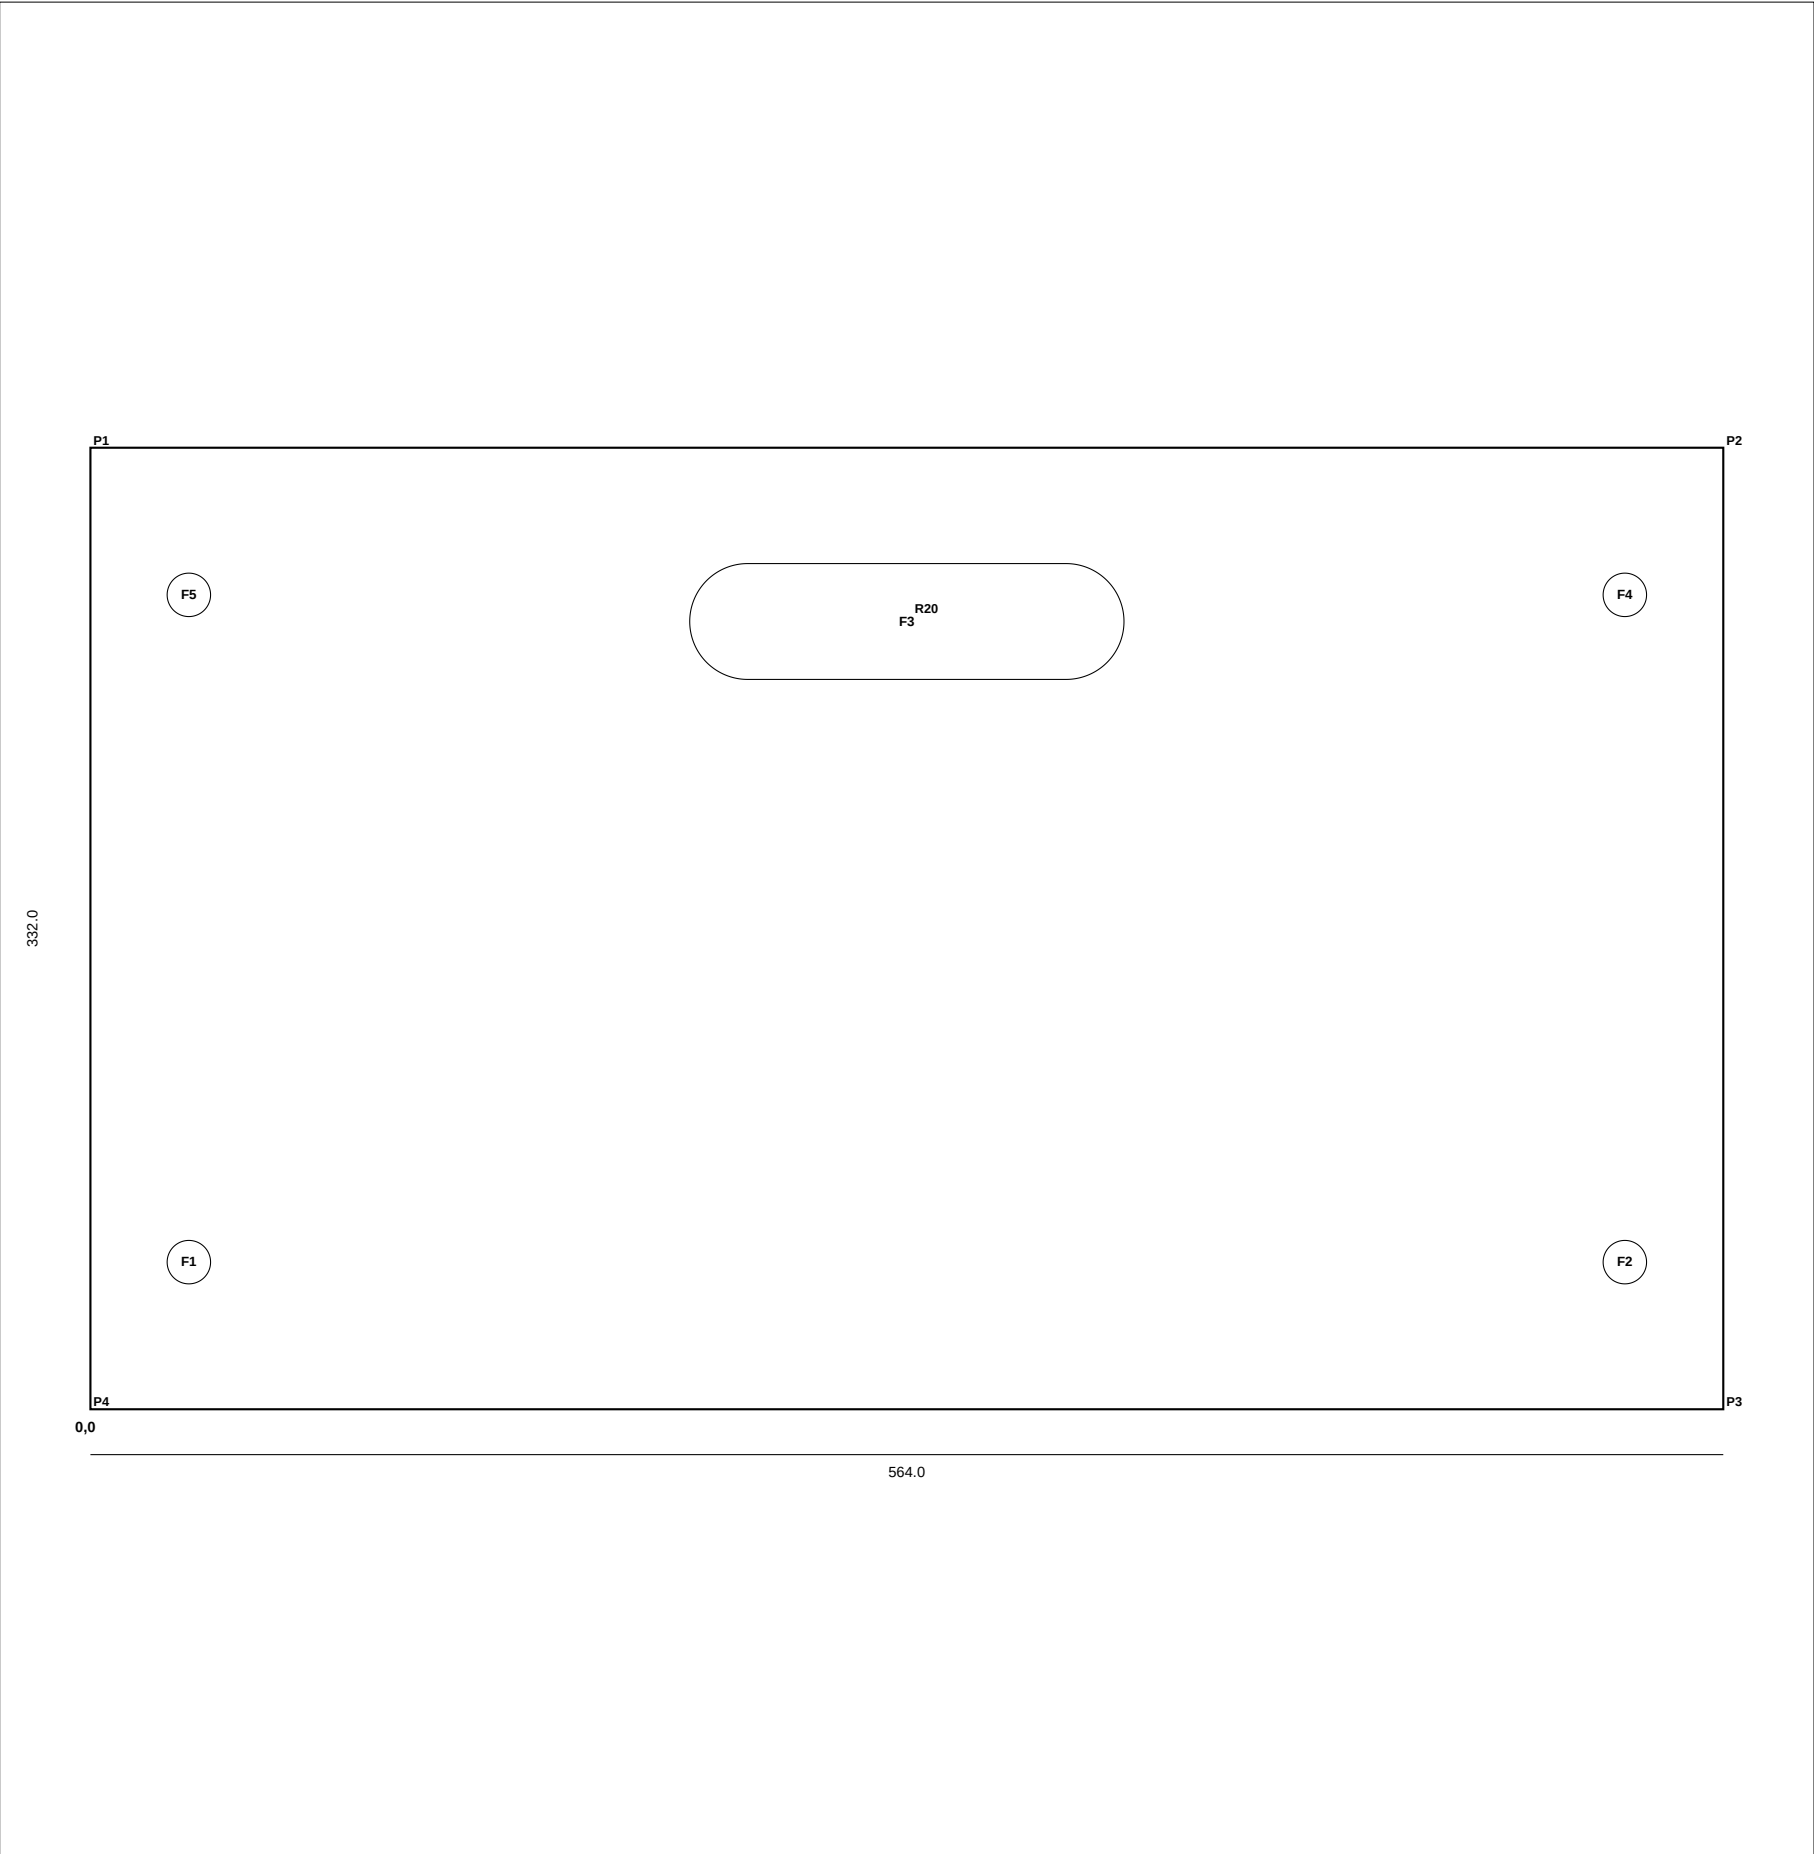

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 34.0 Y 50.8
- F2 Dia 15 x 14 deep X 530.0 Y 50.8
- F3 slot/cut-out 150.0 x 40.0, R20 X 282.0 Y 272.0
- F4 Dia 15 x 14 deep X 530.0 Y 281.2
- F5 Dia 15 x 14 deep X 34.0 Y 281.2


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y332.0 LINE
- P2 X564.0 Y332.0 LINE
- P3 X564.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE

S1-F - Part detail

Overall 564.0 x 332.0 mm | 18 mm plywood | datum lower-left = X0 Y0

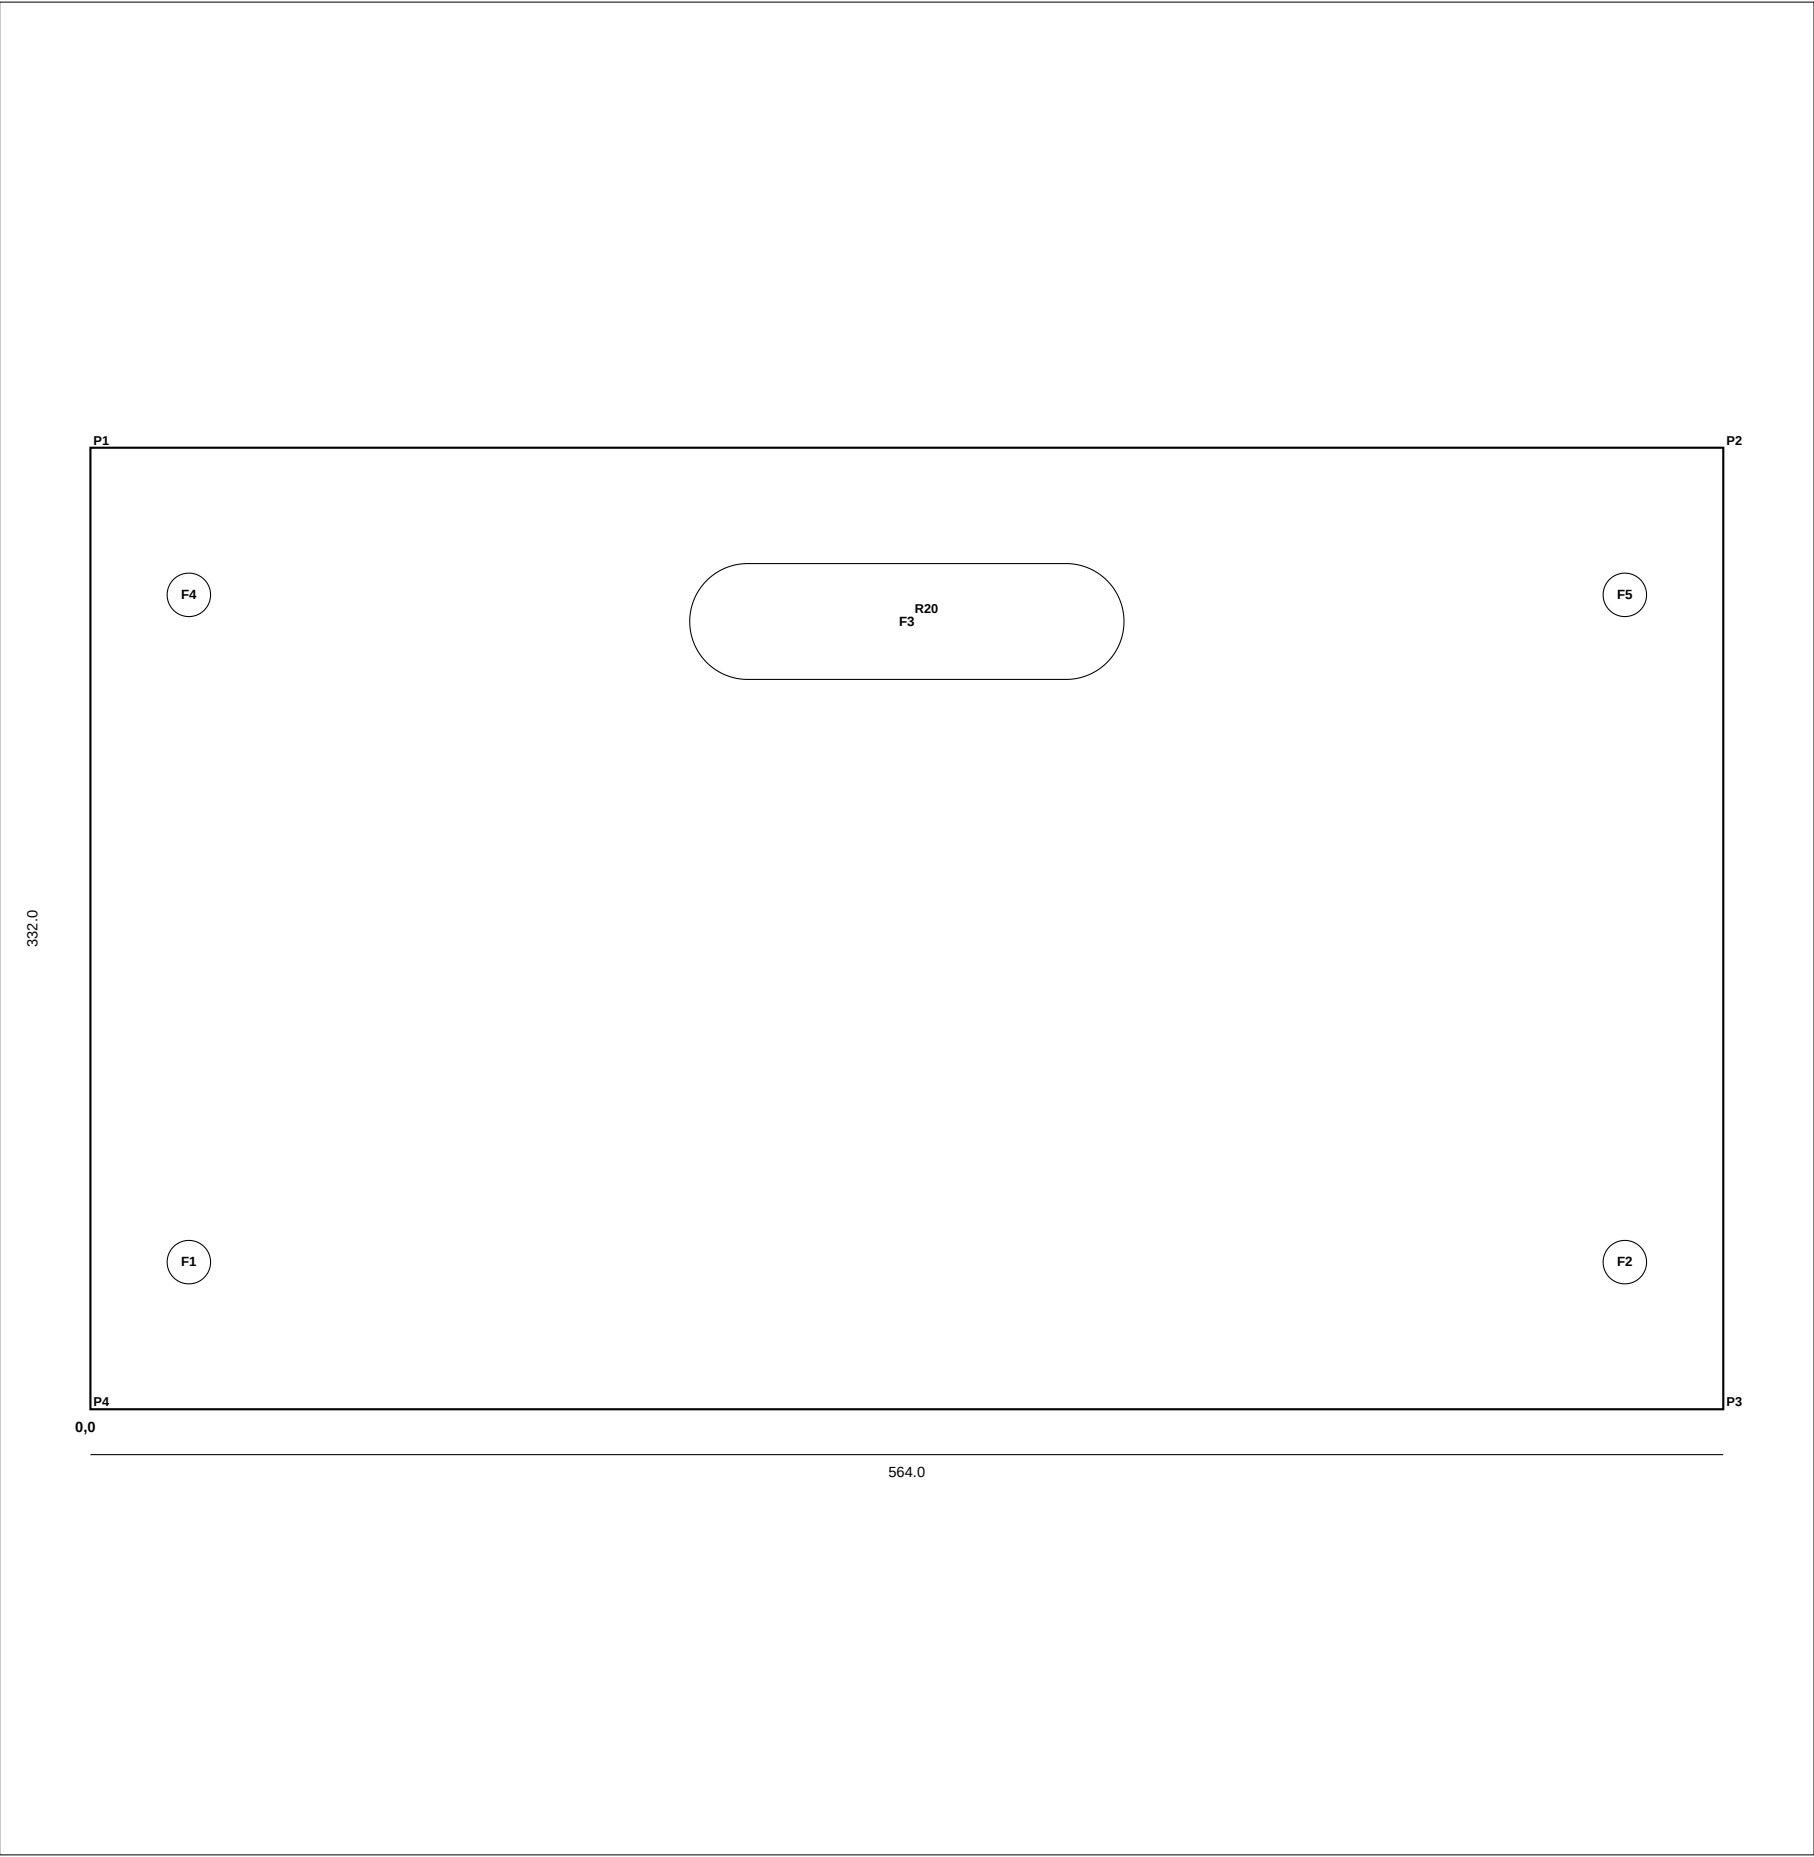

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 34.0 Y 50.8
- F2 Dia 15 x 14 deep X 530.0 Y 50.8
- F3 slot/cut-out 150.0 x 40.0, R20 X 282.0 Y 272.0
- F4 Dia 15 x 14 deep X 34.0 Y 281.2
- F5 Dia 15 x 14 deep X 530.0 Y 281.2


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y332.0 LINE
- P2 X564.0 Y332.0 LINE
- P3 X564.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE

S1-G - Part detail

Overall 1160.0 x 332.0 mm | 18 mm plywood | datum lower-left = X0 Y0

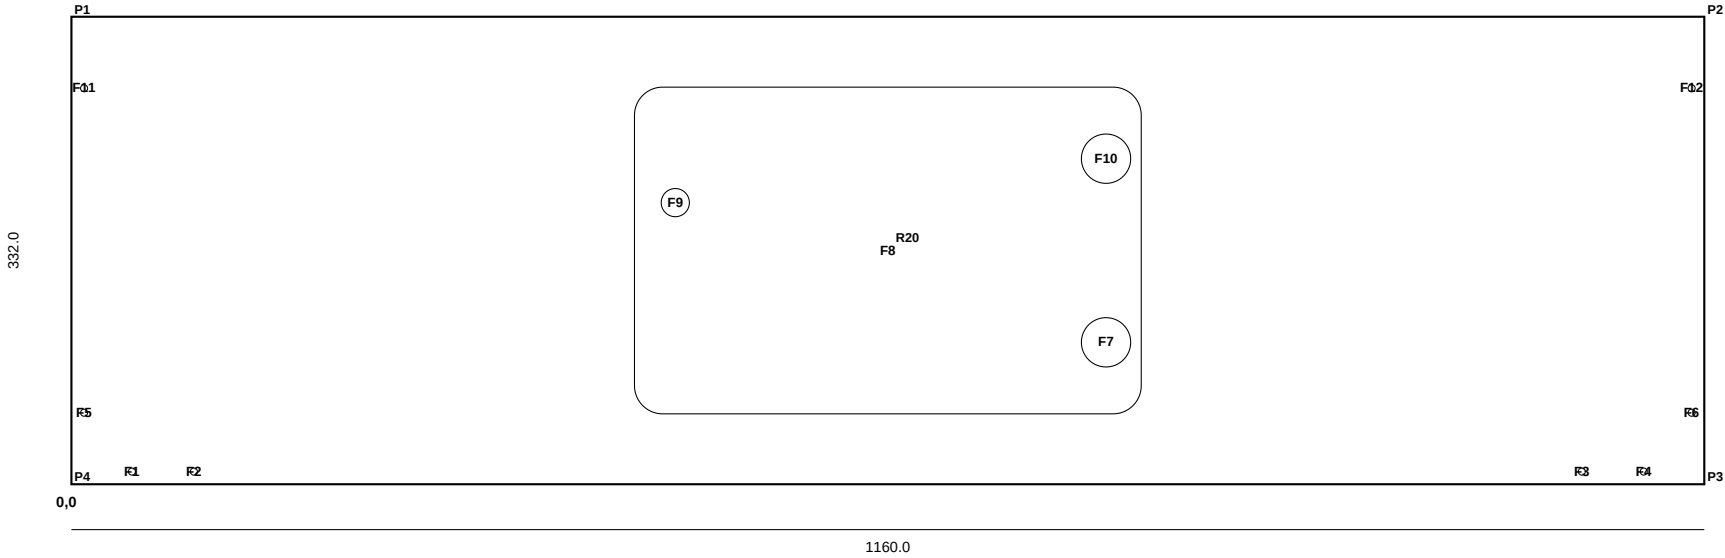

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 43.0 Y 9.0
- F2 Dia 5 x 11 deep X 87.0 Y 9.0
- F3 Dia 5 x 11 deep X 1073.0 Y 9.0
- F4 Dia 5 x 11 deep X 1117.0 Y 9.0
- F5 Dia 5 x 11 deep X 9.0 Y 50.8
- F6 Dia 5 x 11 deep X 1151.0 Y 50.8
- F7 Dia 35 x 13 deep X 735.0 Y 100.8
- F8 door cut-out 360.0 x 232.0, R20 X 580.0 Y 166.0
- F9 Dia 20 THROUGH X 429.0 Y 200.0
- F10 Dia 35 x 13 deep X 735.0 Y 231.2
- F11 Dia 5 x 11 deep X 9.0 Y 281.2
- F12 Dia 5 x 11 deep X 1151.0 Y 281.2


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y332.0 LINE
- P2 X1160.0 Y332.0 LINE
- P3 X1160.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE

S1-H - Part detail

Overall 1160.0 x 332.0 mm | 18 mm plywood | datum lower-left = X0 Y0

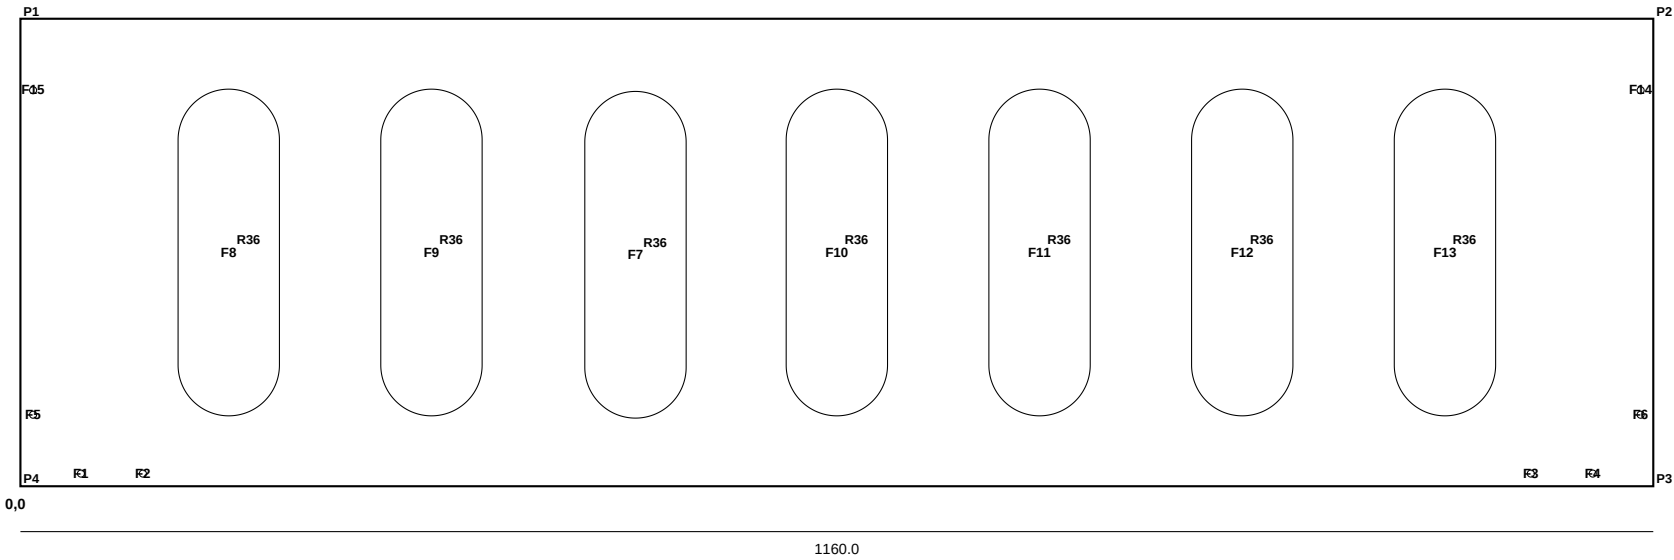

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 43.0 Y 9.0
- F2 Dia 5 x 11 deep X 87.0 Y 9.0
- F3 Dia 5 x 11 deep X 1073.0 Y 9.0
- F4 Dia 5 x 11 deep X 1117.0 Y 9.0
- F5 Dia 5 x 11 deep X 9.0 Y 50.8
- F6 Dia 5 x 11 deep X 1151.0 Y 50.8
- F7 slot/cut-out 72.0 x 232.0, R36 X 436.9 Y 164.4
- F8 slot/cut-out 72.0 x 232.0, R36 X 148.0 Y 166.0
- F9 slot/cut-out 72.0 x 232.0, R36 X 292.0 Y 166.0
- F10 slot/cut-out 72.0 x 232.0, R36 X 580.0 Y 166.0
- F11 slot/cut-out 72.0 x 232.0, R36 X 724.0 Y 166.0
- F12 slot/cut-out 72.0 x 232.0, R36 X 868.0 Y 166.0
- F13 slot/cut-out 72.0 x 232.0, R36 X 1012.0 Y 166.0
- F14 Dia 5 x 11 deep X 1151.0 Y 281.2
- F15 Dia 5 x 11 deep X 9.0 Y 281.2


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y332.0 LINE
- P2 X1160.0 Y332.0 LINE
- P3 X1160.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE

S1-I - Part detail

Overall 1160.0 x 600.0 mm | 18 mm plywood | datum lower-left = X0 Y0

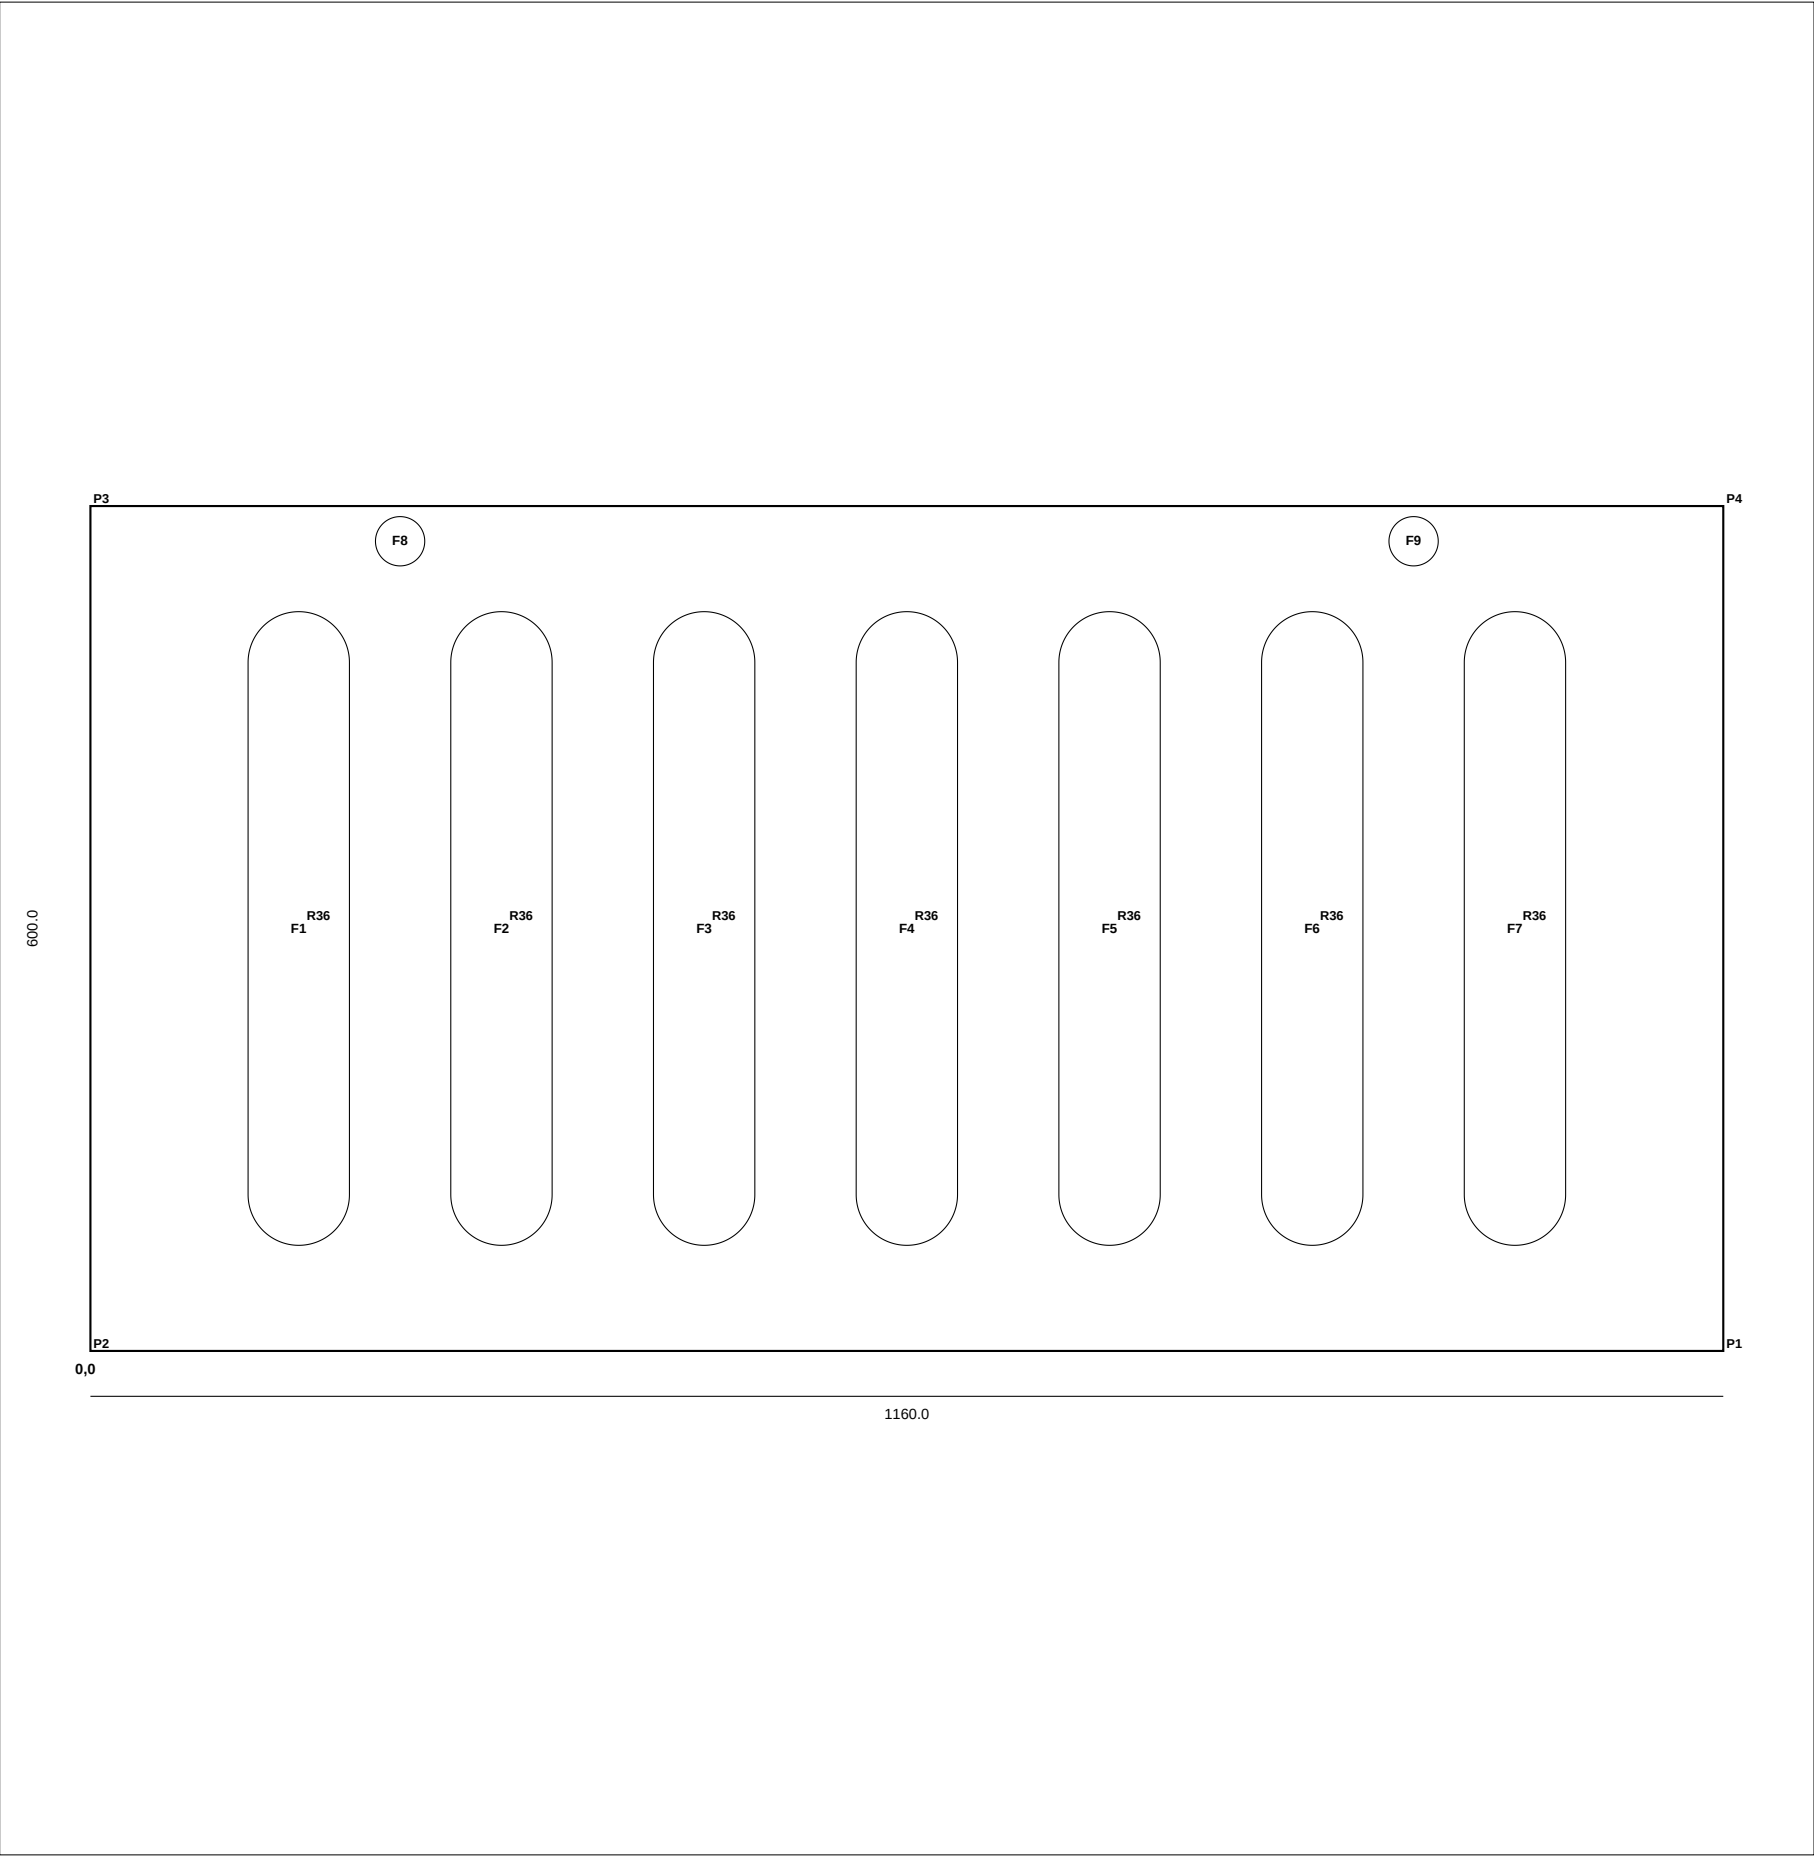

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 slot/cut-out 72.0 x 450.0, R36 X 148.0 Y 300.0

F2 slot/cut-out 72.0 x 450.0, R36 X 292.0 Y 300.0

F3 slot/cut-out 72.0 x 450.0, R36 X 436.0 Y 300.0

F4 slot/cut-out 72.0 x 450.0, R36 X 580.0 Y 300.0

F5 slot/cut-out 72.0 x 450.0, R36 X 724.0 Y 300.0

F6 slot/cut-out 72.0 x 450.0, R36 X 868.0 Y 300.0

F7 slot/cut-out 72.0 x 450.0, R36 X 1012.0 Y 300.0

F8 Dia 35 x 13 deep X 220.0 Y 575.0

F9 Dia 35 x 13 deep X 940.0 Y 575.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X1160.0 Y0.0 LINE


P2 X0.0 Y0.0 LINE

P3 X0.0 Y600.0 LINE

P4 X1160.0 Y600.0 LINE

S2-A - Part detail

Overall 318.0 x 306.0 mm | 18 mm plywood | datum lower-left = X0 Y0

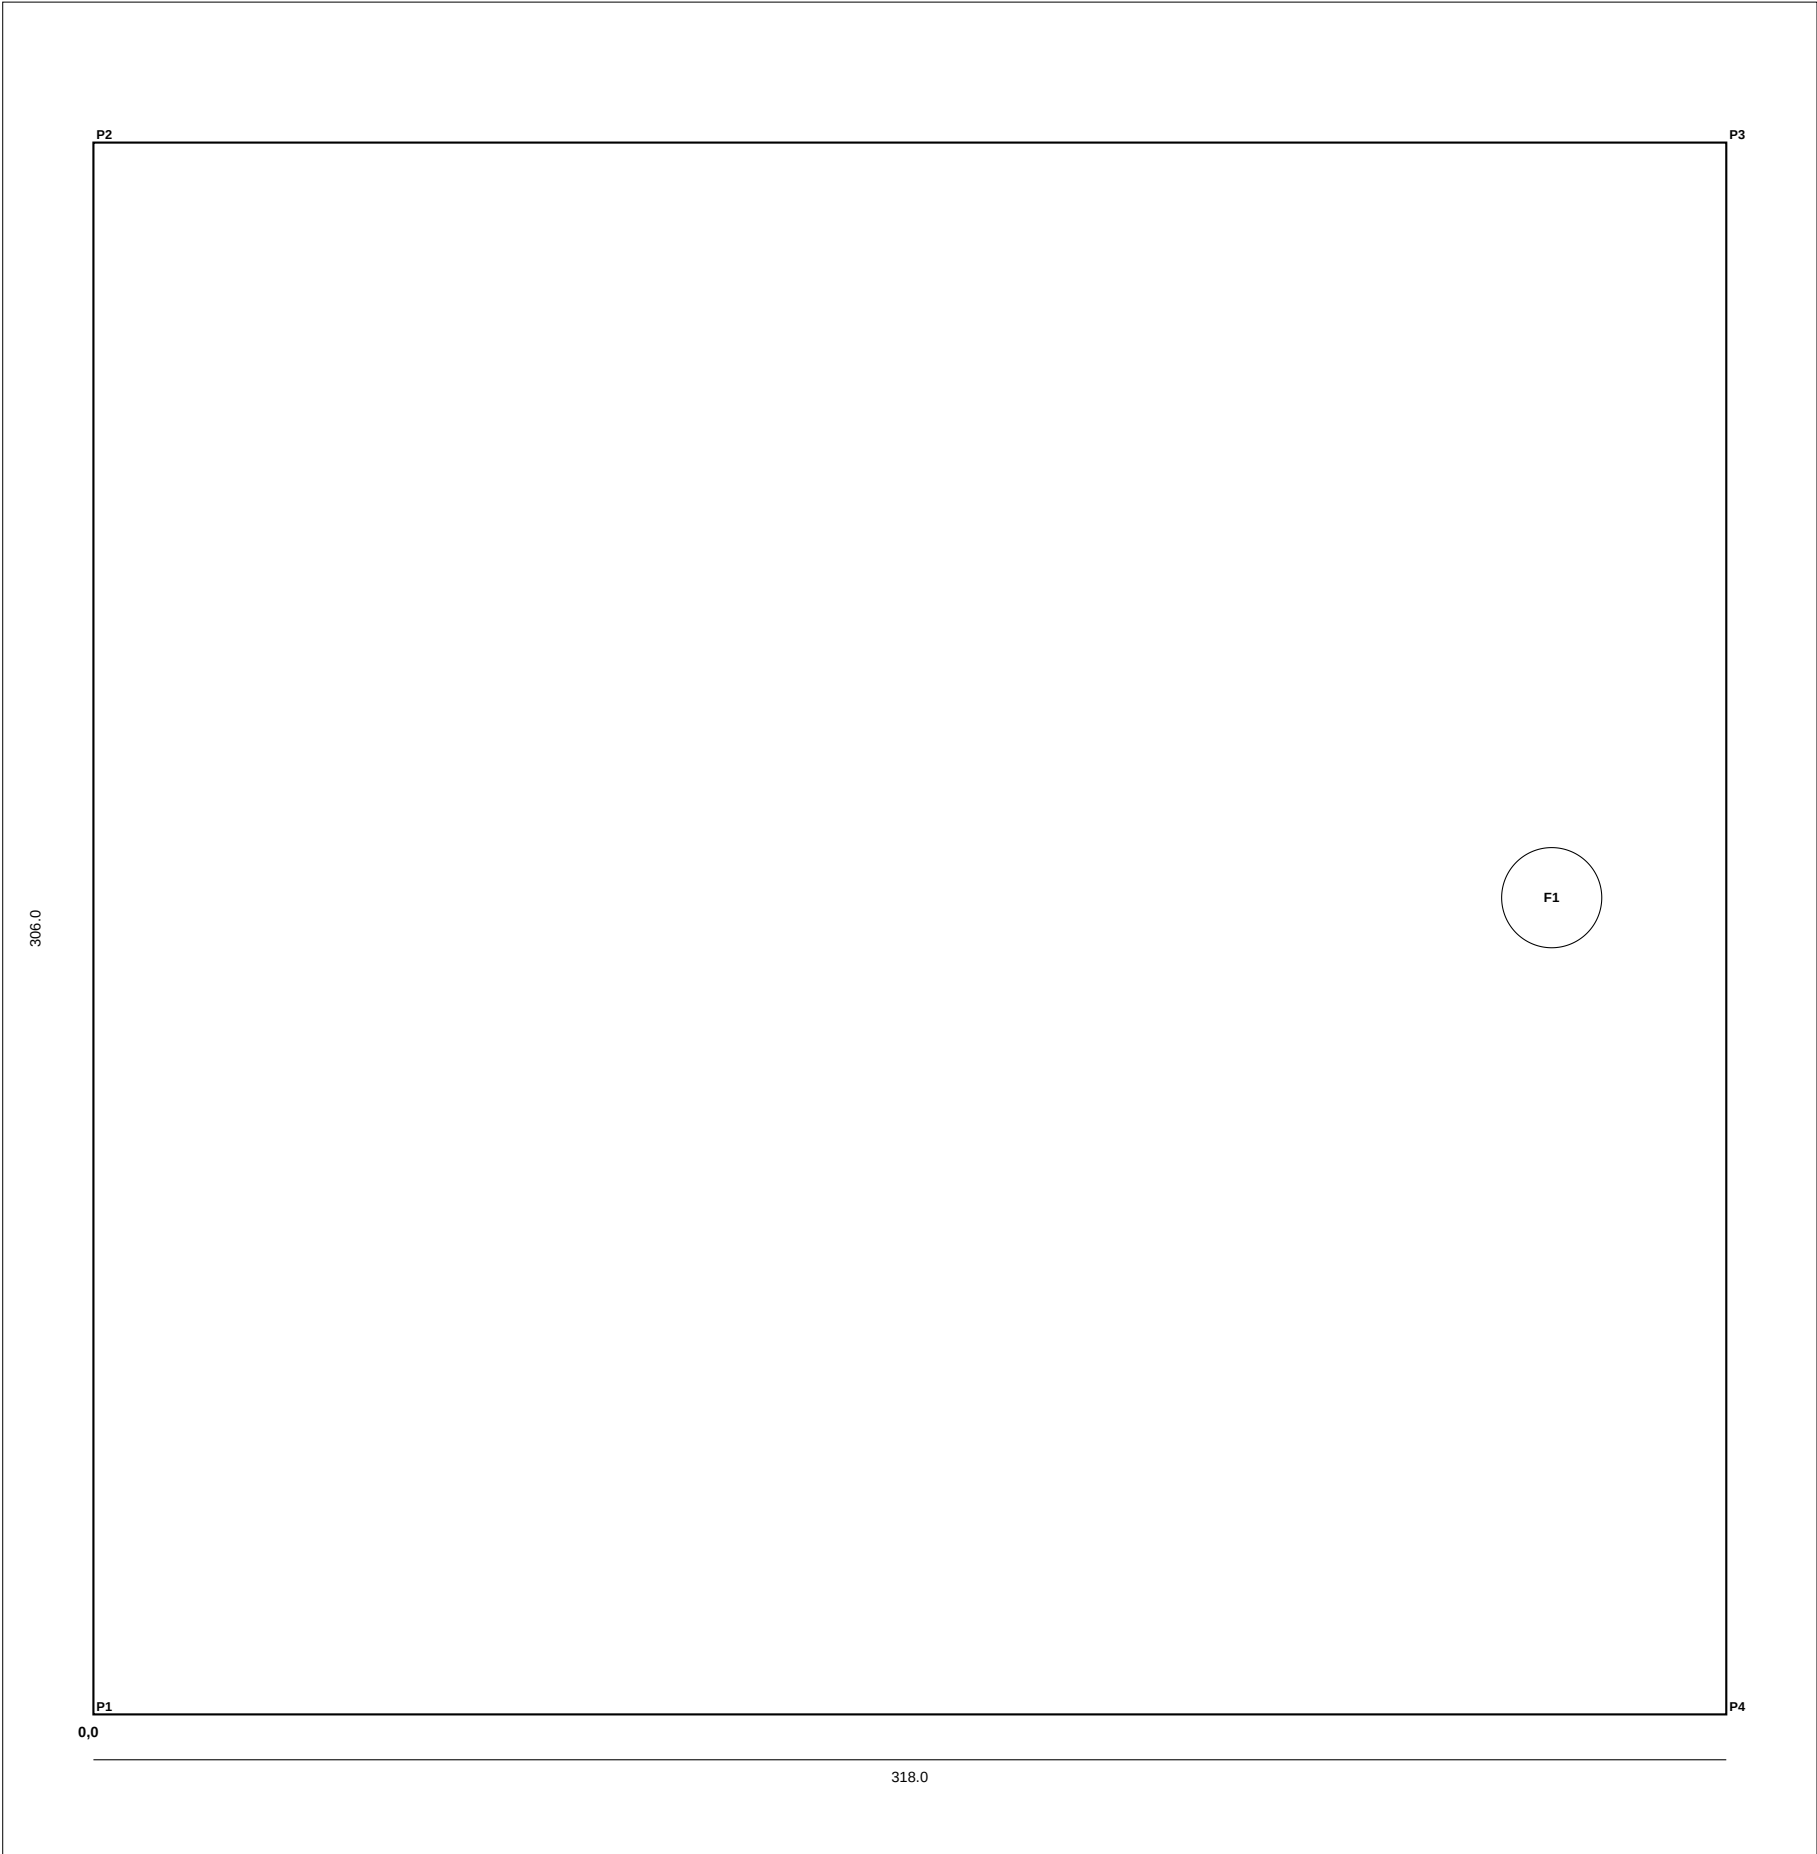

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 20 THROUGH X 284.0 Y 159.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE


P2 X0.0 Y306.0 LINE

P3 X318.0 Y306.0 LINE

P4 X318.0 Y0.0 LINE

S2-B - Part detail

Overall 318.0 x 306.0 mm | 18 mm plywood | datum lower-left = X0 Y0

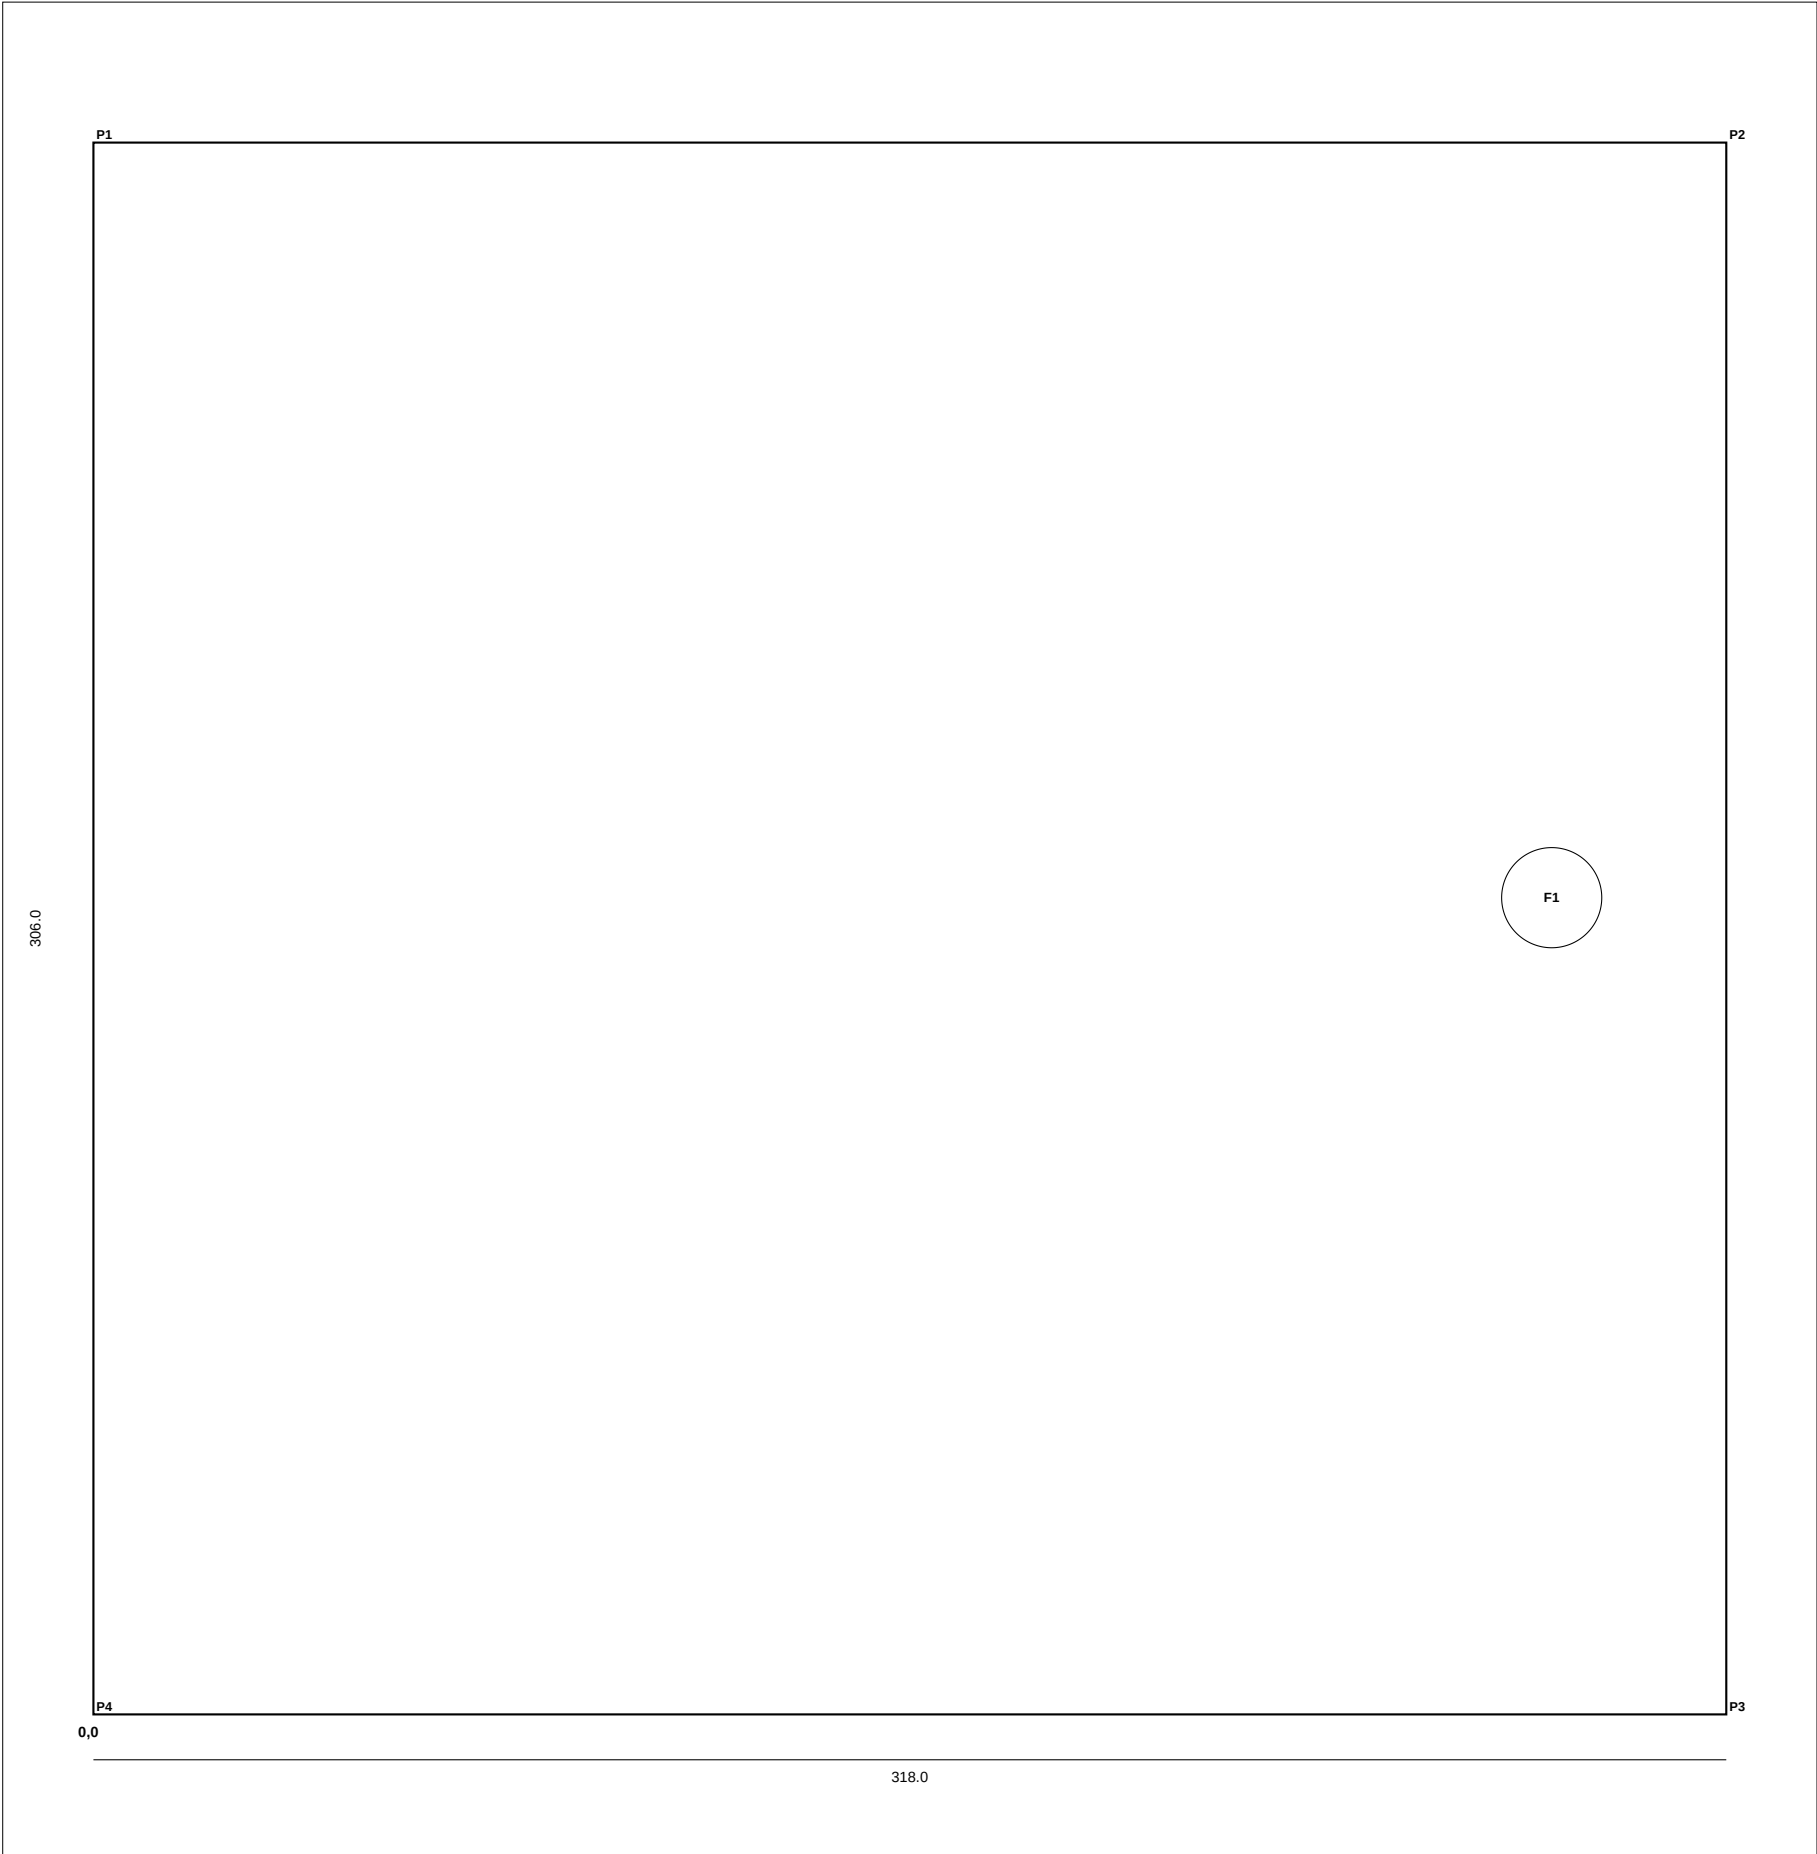

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 20 THROUGH X 284.0 Y 159.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y306.0 LINE


P2 X318.0 Y306.0 LINE

P3 X318.0 Y0.0 LINE

P4 X0.0 Y0.0 LINE

S2-C - Part detail

Overall 1060.0 x 458.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y20.0 LINE

P2 X0.0 Y438.7 ARC R20.0 CW

P3 X20.0 Y458.0 LINE

P4 X1040.0 Y458.0 ARC R20.0 CW

P5 X1060.0 Y438.0 LINE


P6 X1060.0 Y19.3 ARC R20.0 CW

P7 X1040.0 Y0.0 LINE

P8 X19.3 Y0.0 ARC R20.0 CW

S2-D - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

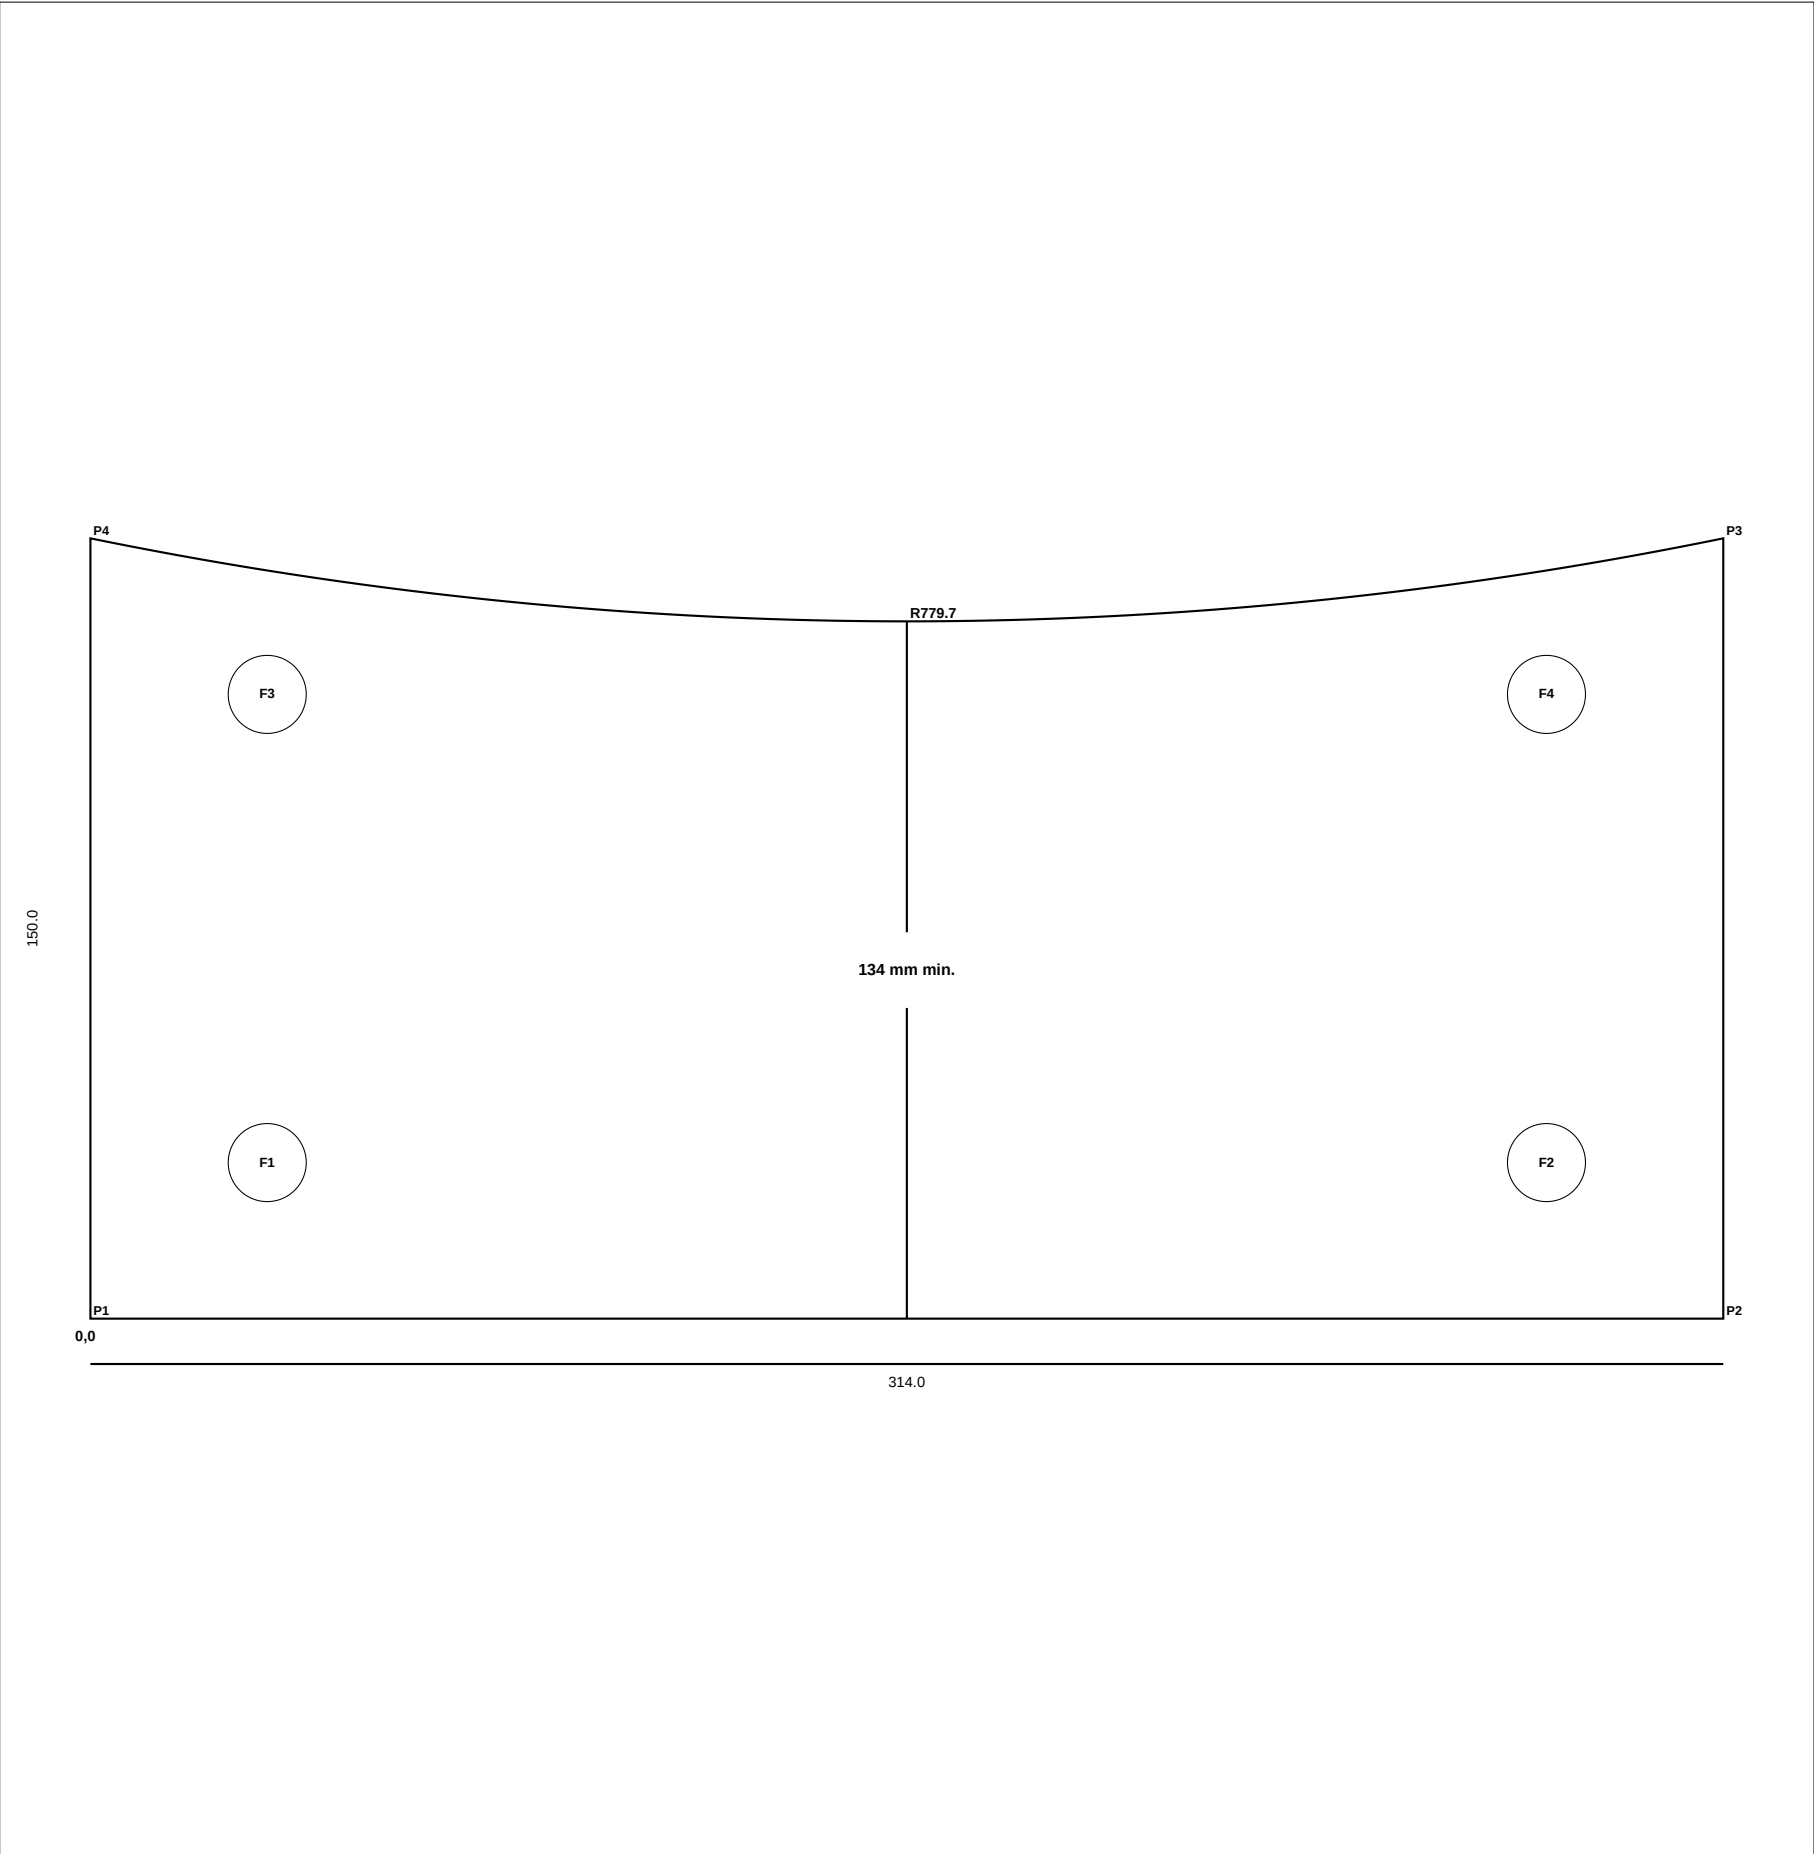

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 34.0 Y 30.0

F2 Dia 15 x 14 deep X 280.0 Y 30.0

F3 Dia 15 x 14 deep X 34.0 Y 120.0

F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE

P2 X314.0 Y0.0 LINE


P3 X314.0 Y150.0 ARC R779.7 CW

P4 X0.0 Y150.0 LINE

Minimum height at centre = 134 mm

S2-E - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

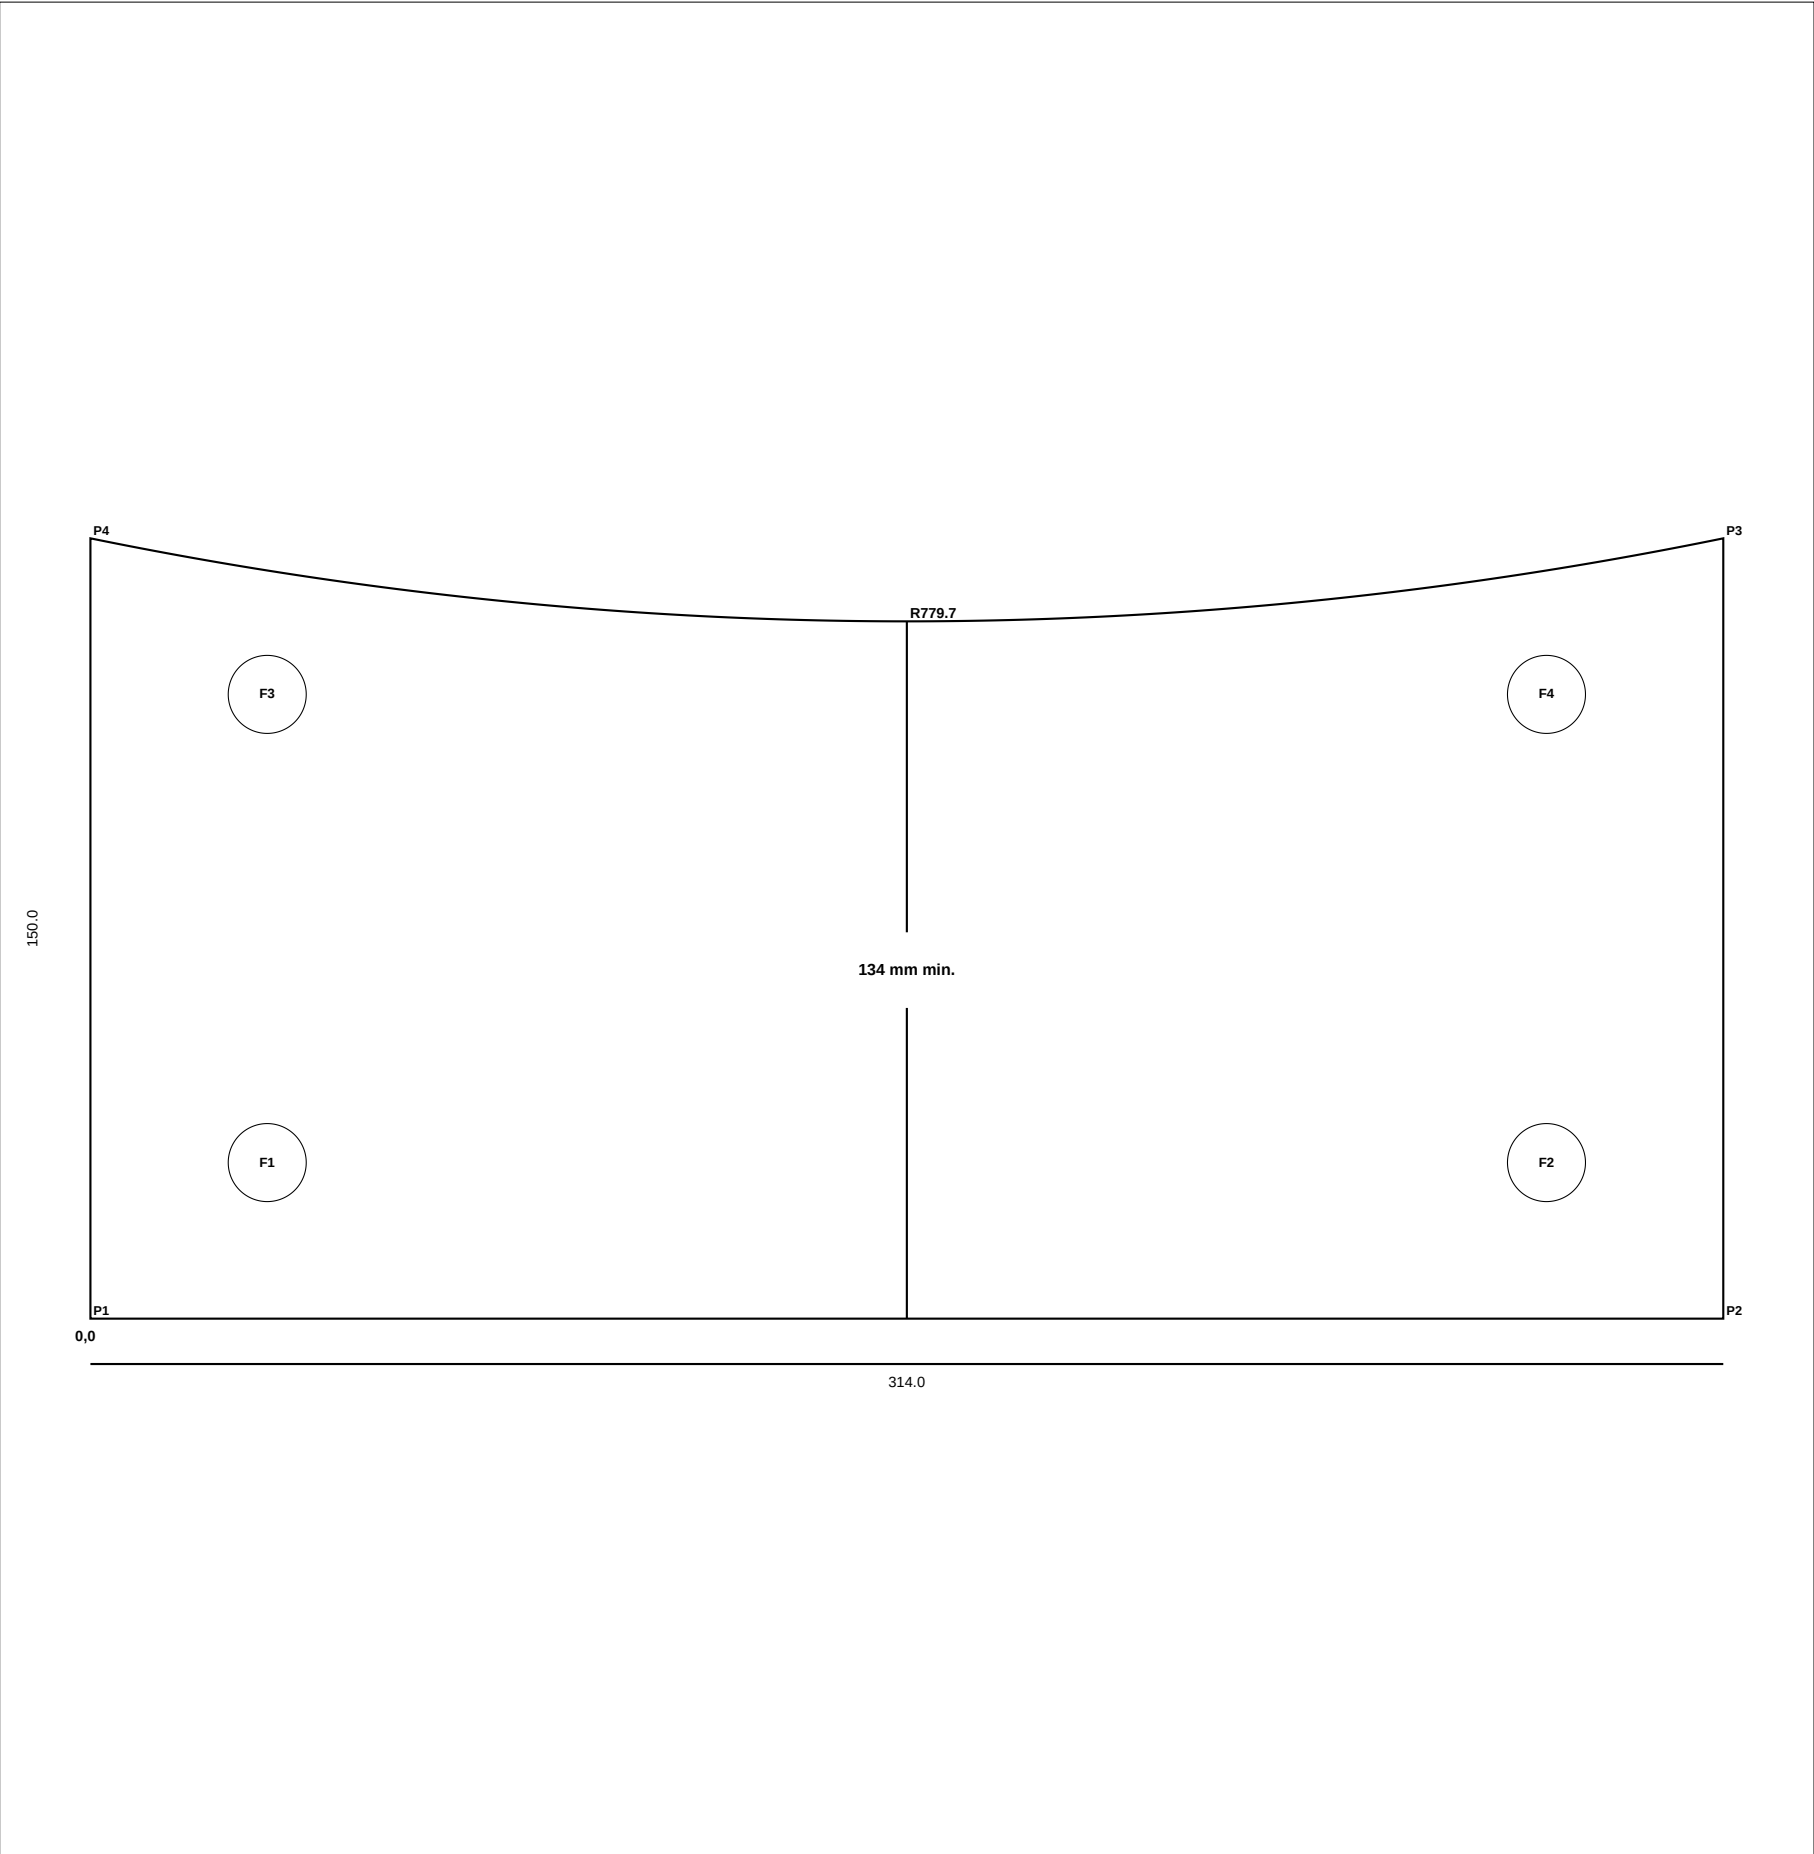

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 34.0 Y 30.0

F2 Dia 15 x 14 deep X 280.0 Y 30.0

F3 Dia 15 x 14 deep X 34.0 Y 120.0

F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE

P2 X314.0 Y0.0 LINE


P3 X314.0 Y150.0 ARC R779.7 CW

P4 X0.0 Y150.0 LINE

Minimum height at centre = 134 mm

S2-F - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

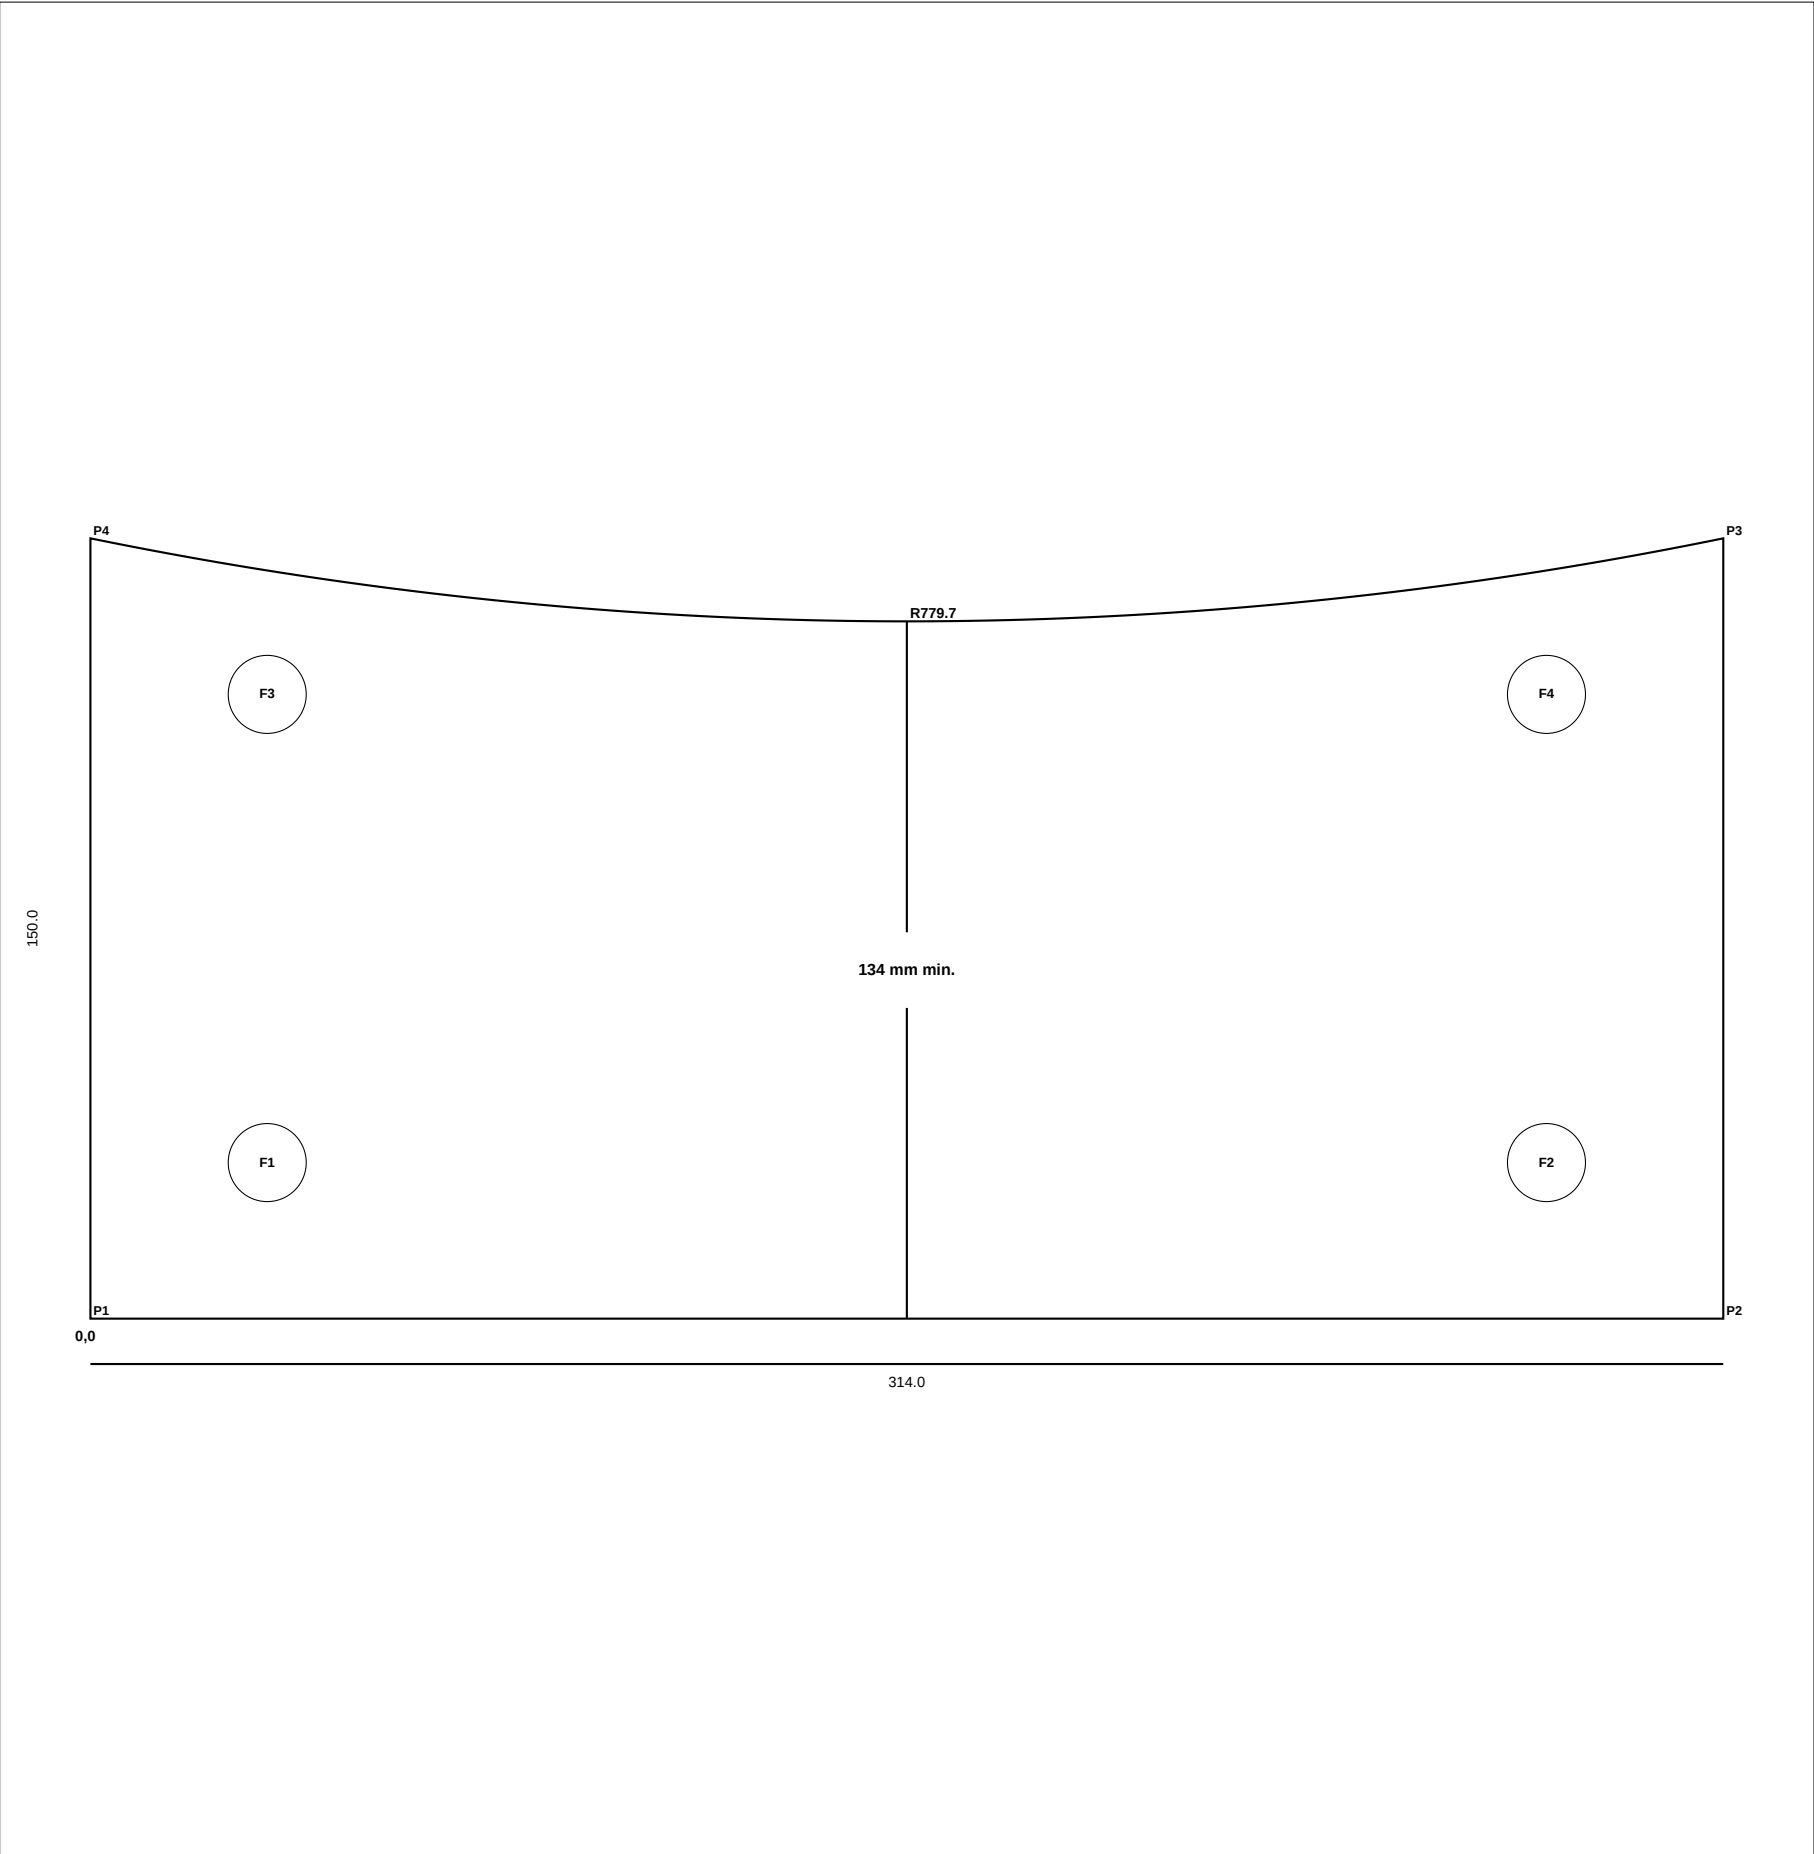

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 34.0 Y 30.0

F2 Dia 15 x 14 deep X 280.0 Y 30.0

F3 Dia 15 x 14 deep X 34.0 Y 120.0

F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE

P2 X314.0 Y0.0 LINE


P3 X314.0 Y150.0 ARC R779.7 CW

P4 X0.0 Y150.0 LINE

Minimum height at centre = 134 mm

S2-G - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

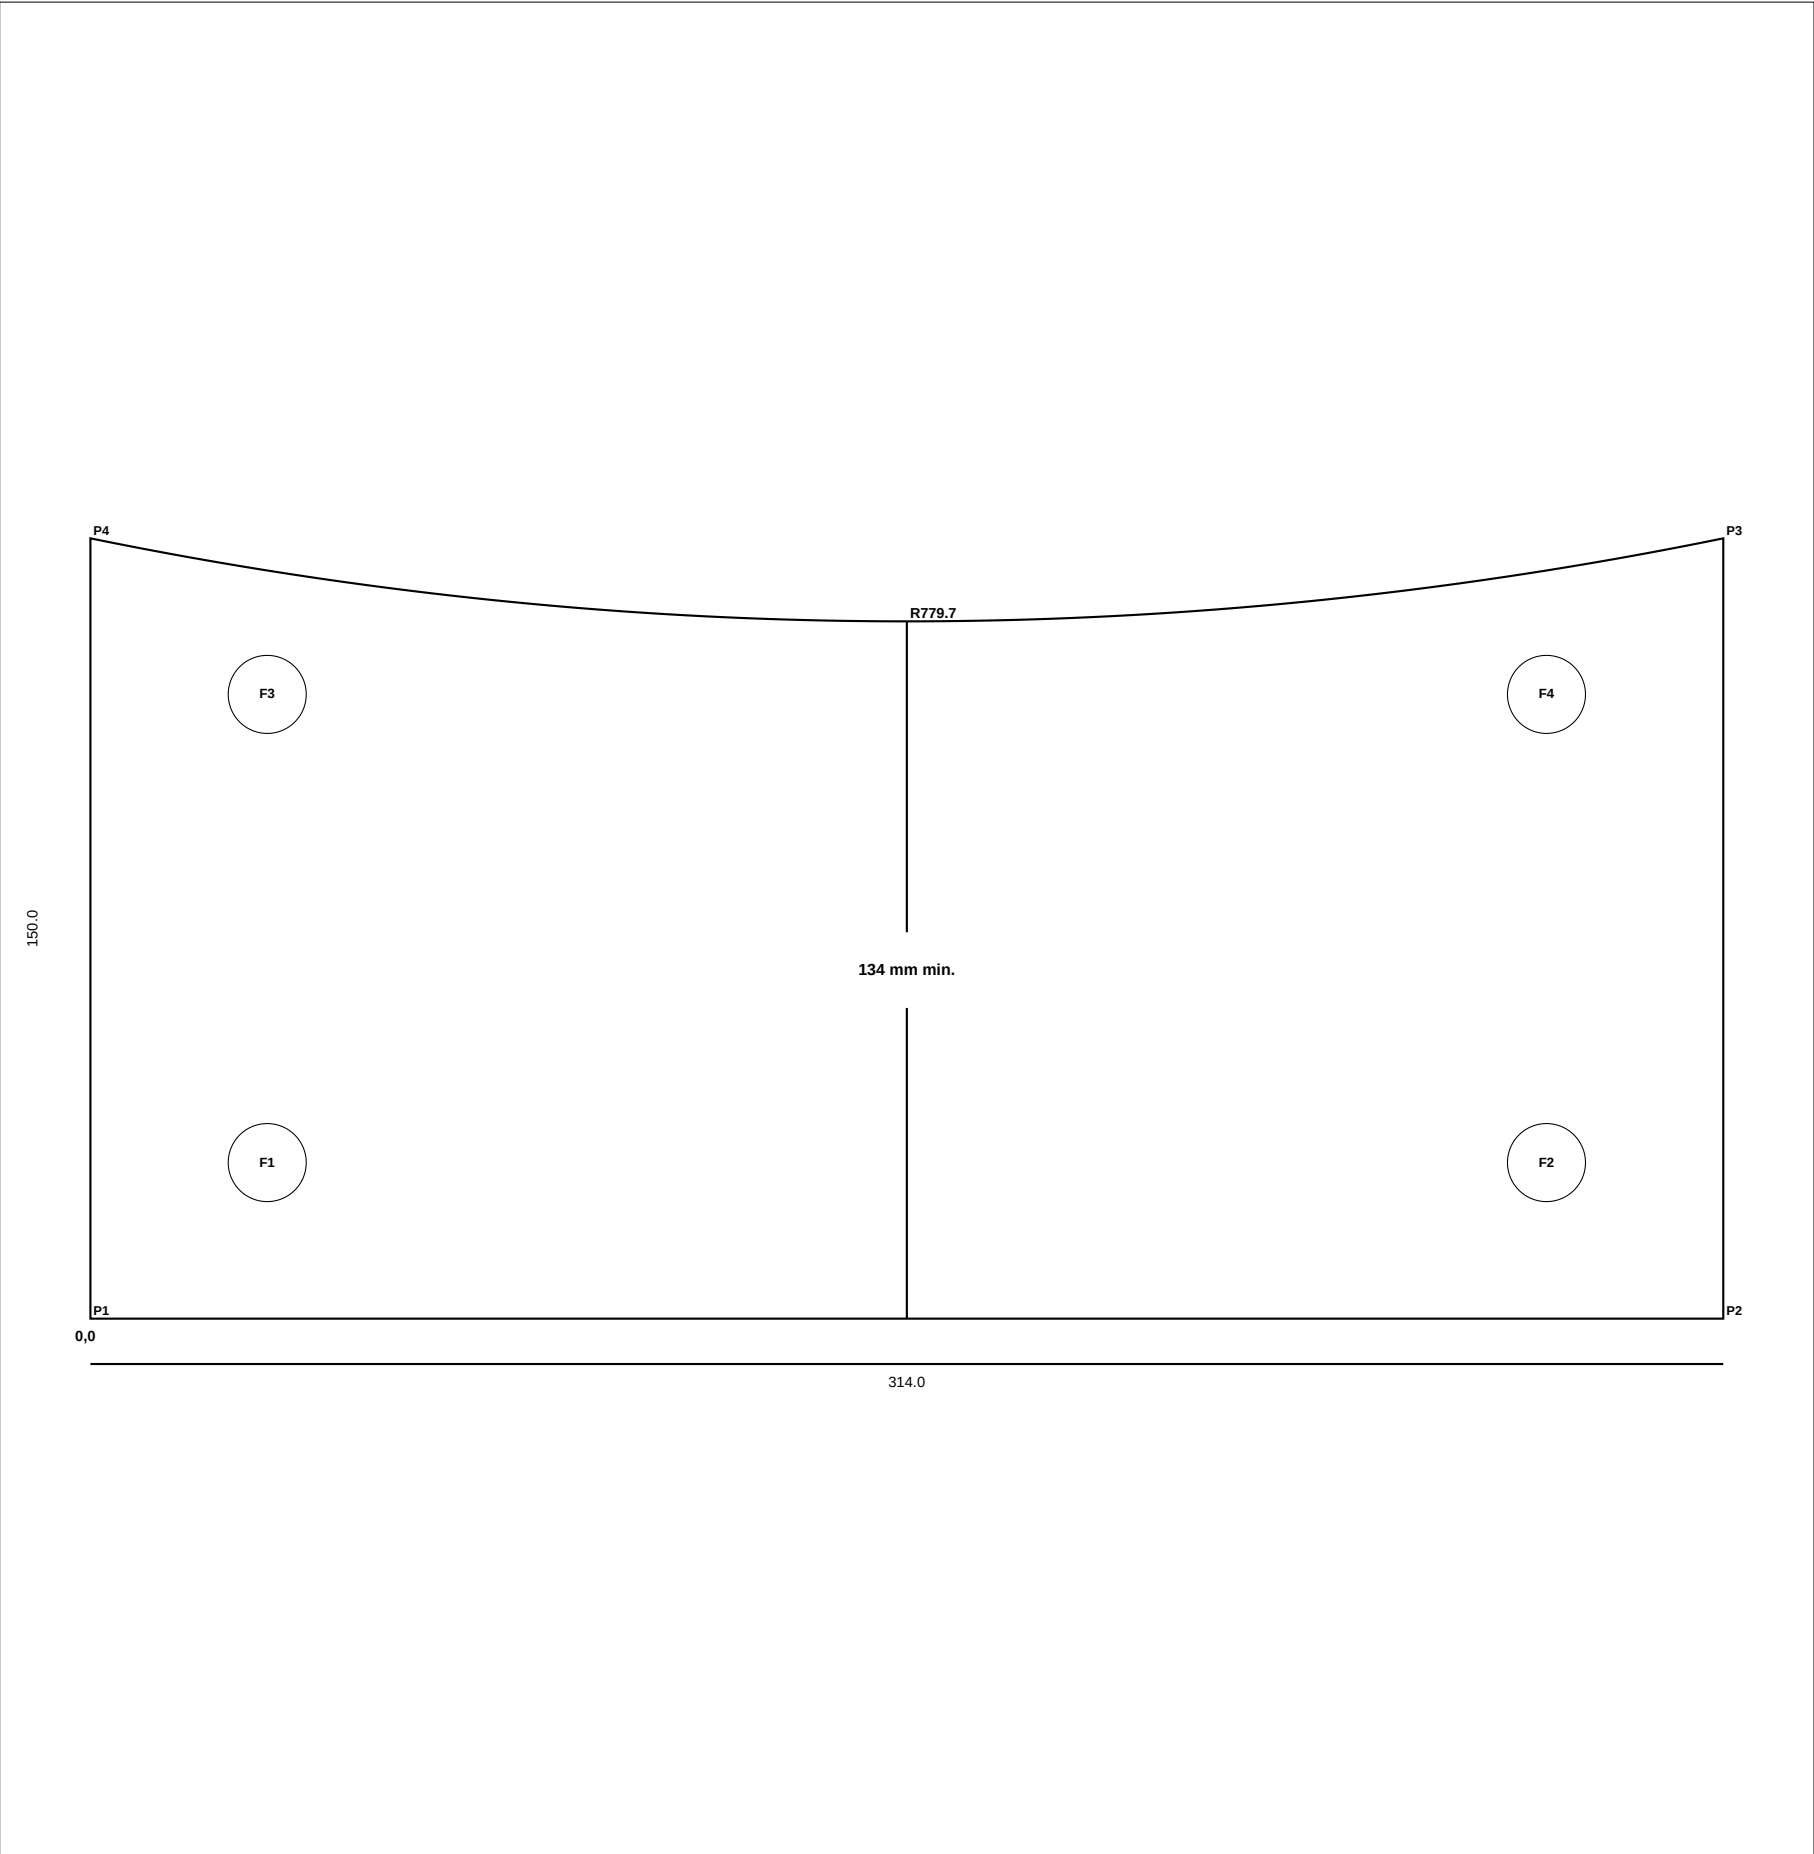

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 34.0 Y 30.0

F2 Dia 15 x 14 deep X 280.0 Y 30.0

F3 Dia 15 x 14 deep X 34.0 Y 120.0

F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE

P2 X314.0 Y0.0 LINE


P3 X314.0 Y150.0 ARC R779.7 CW

P4 X0.0 Y150.0 LINE

Minimum height at centre = 134 mm

S2-H - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

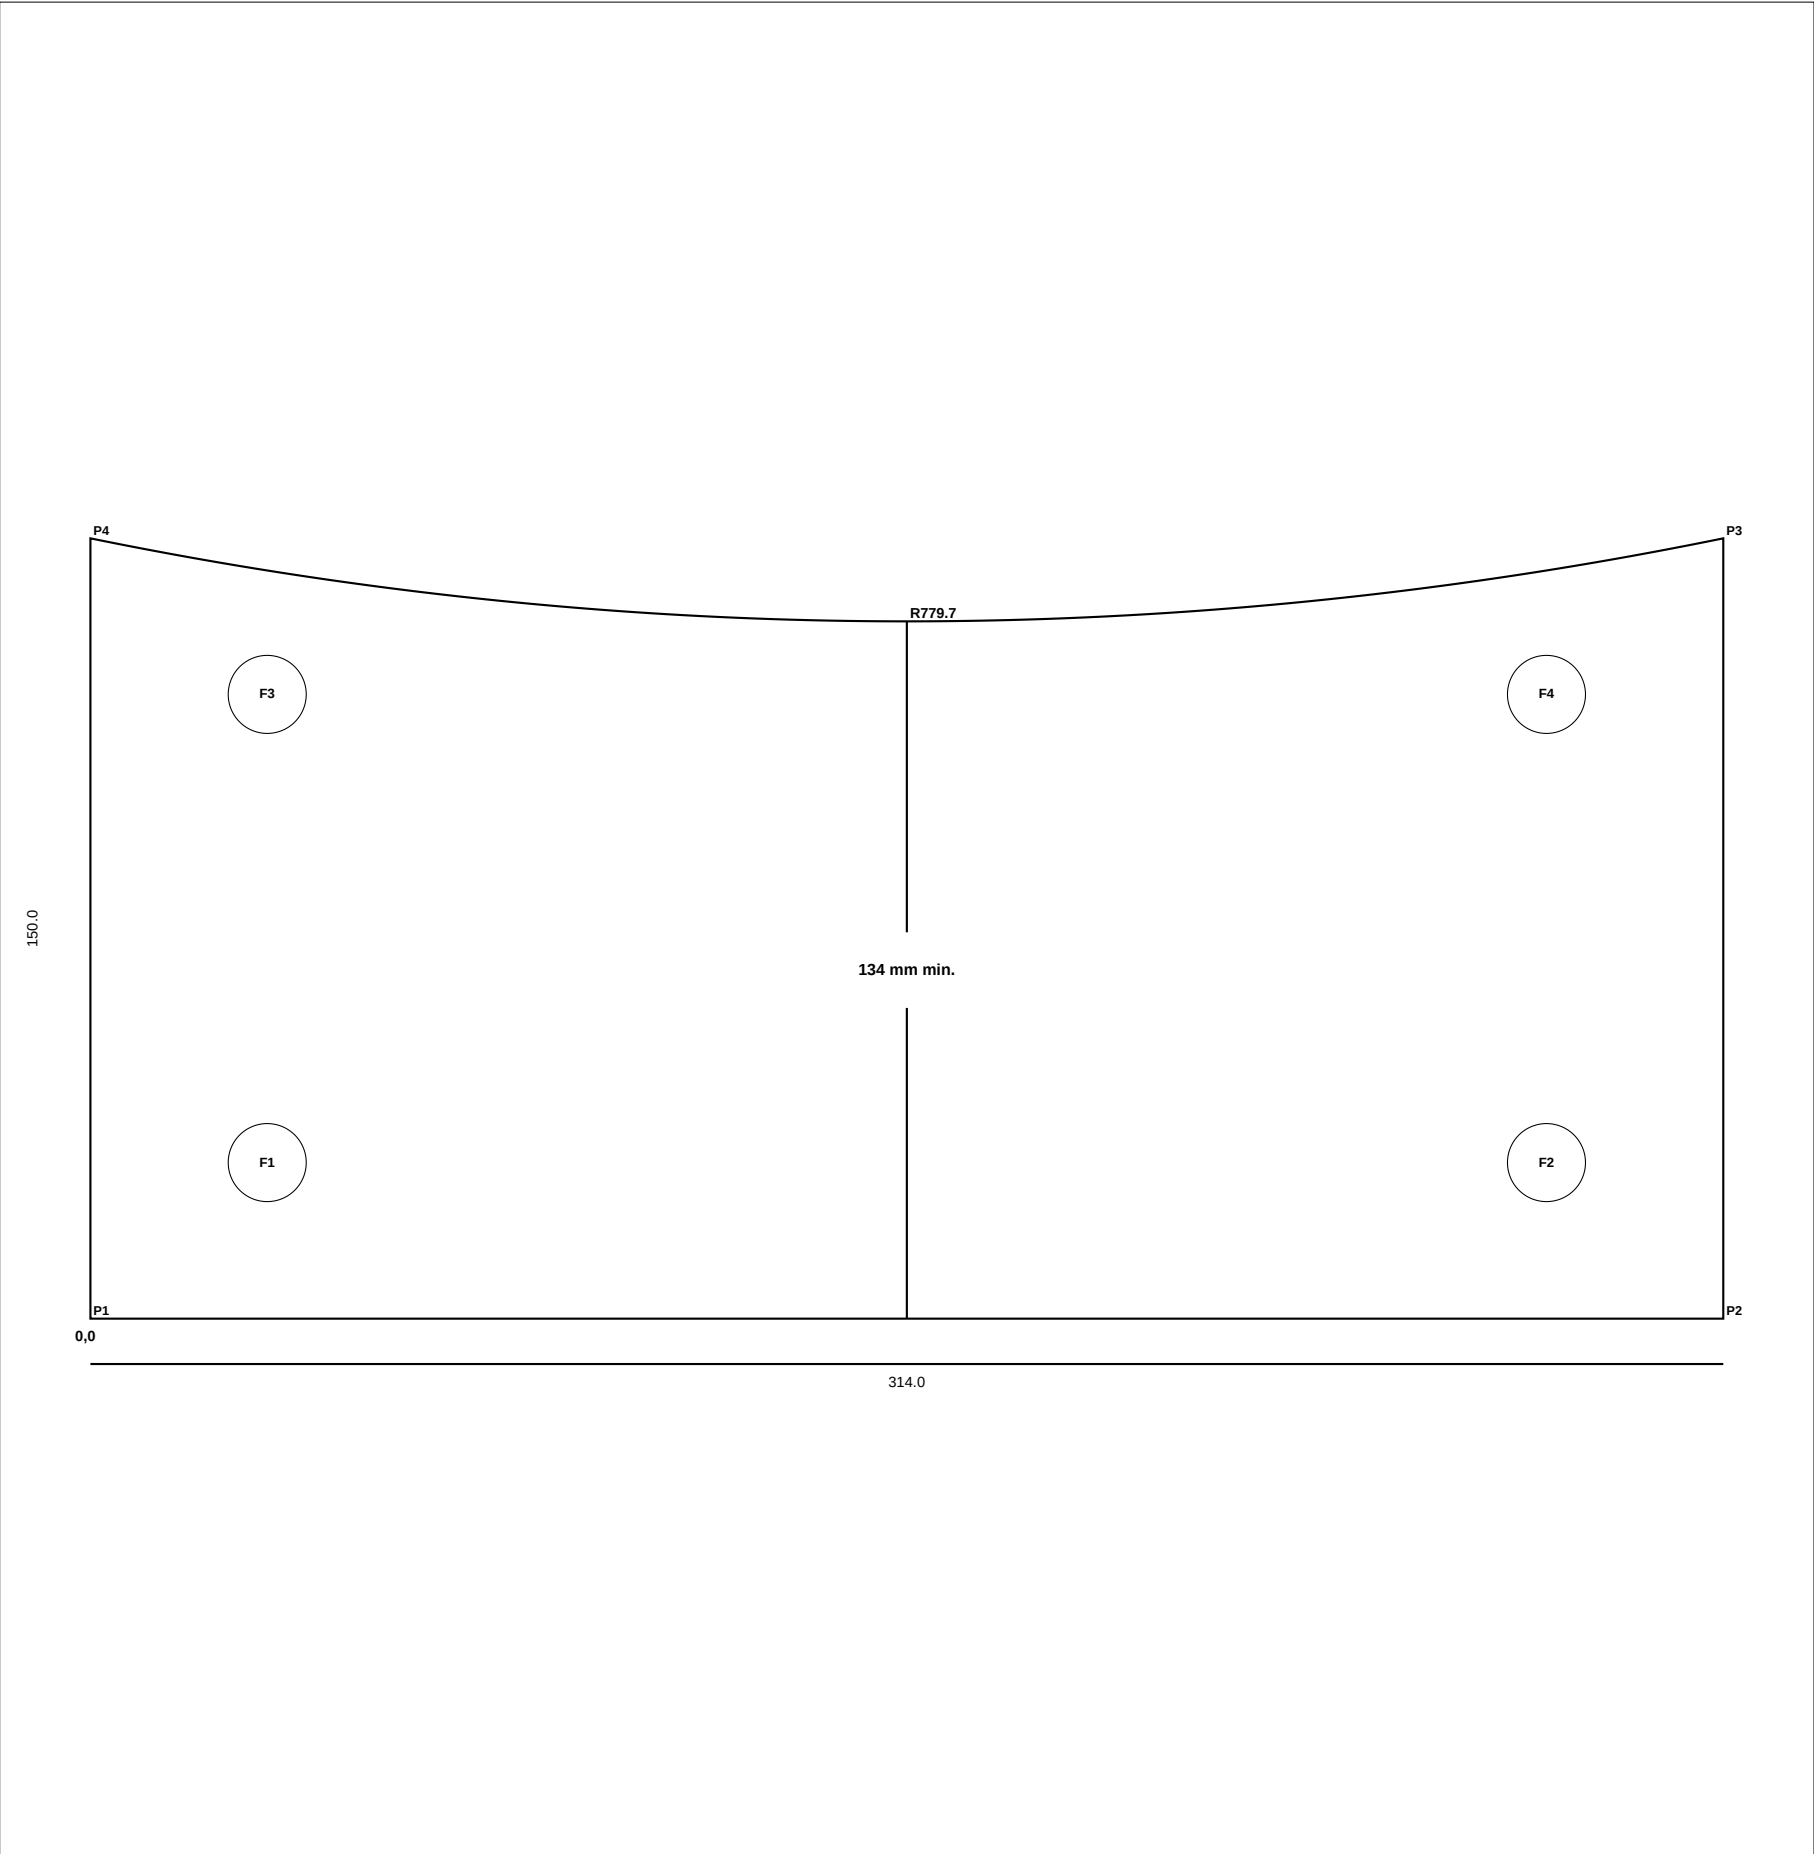

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 34.0 Y 30.0

F2 Dia 15 x 14 deep X 280.0 Y 30.0

F3 Dia 15 x 14 deep X 34.0 Y 120.0

F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE

P2 X314.0 Y0.0 LINE


P3 X314.0 Y150.0 ARC R779.7 CW

P4 X0.0 Y150.0 LINE

Minimum height at centre = 134 mm

S2-I - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

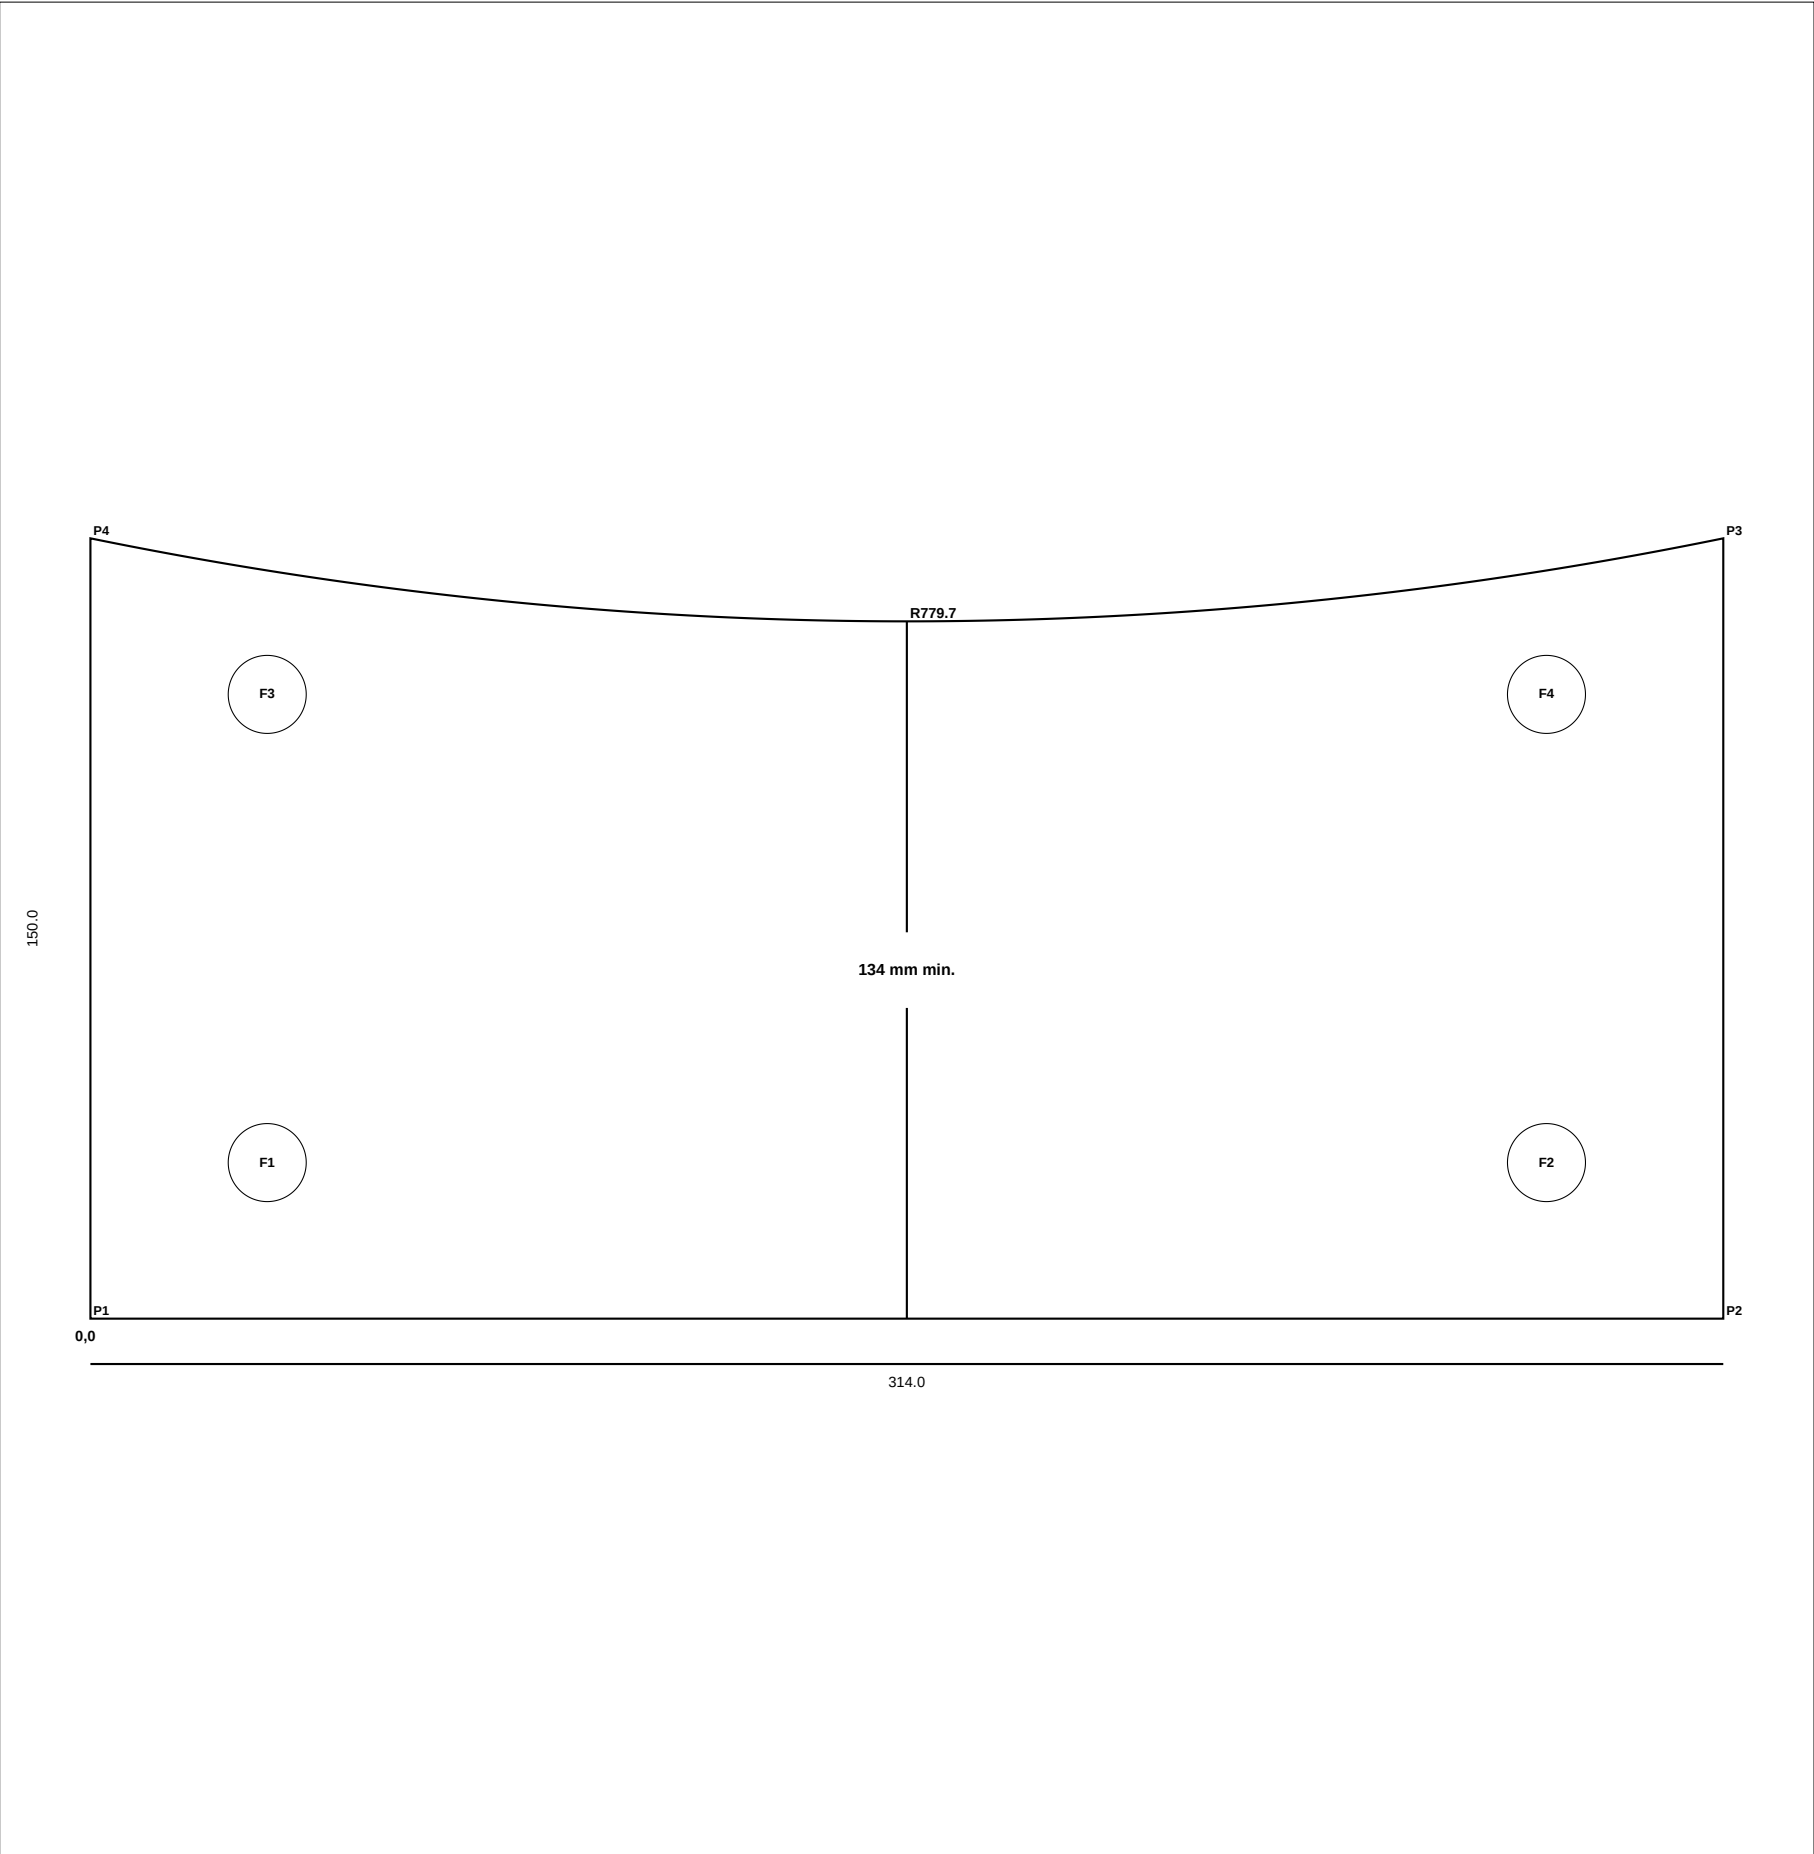

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 34.0 Y 30.0

F2 Dia 15 x 14 deep X 280.0 Y 30.0

F3 Dia 15 x 14 deep X 34.0 Y 120.0

F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE

P2 X314.0 Y0.0 LINE


P3 X314.0 Y150.0 ARC R779.7 CW

P4 X0.0 Y150.0 LINE

Minimum height at centre = 134 mm

S2-J - Part detail

Overall 1060.0 x 332.0 mm | 18 mm plywood | datum lower-left = X0 Y0

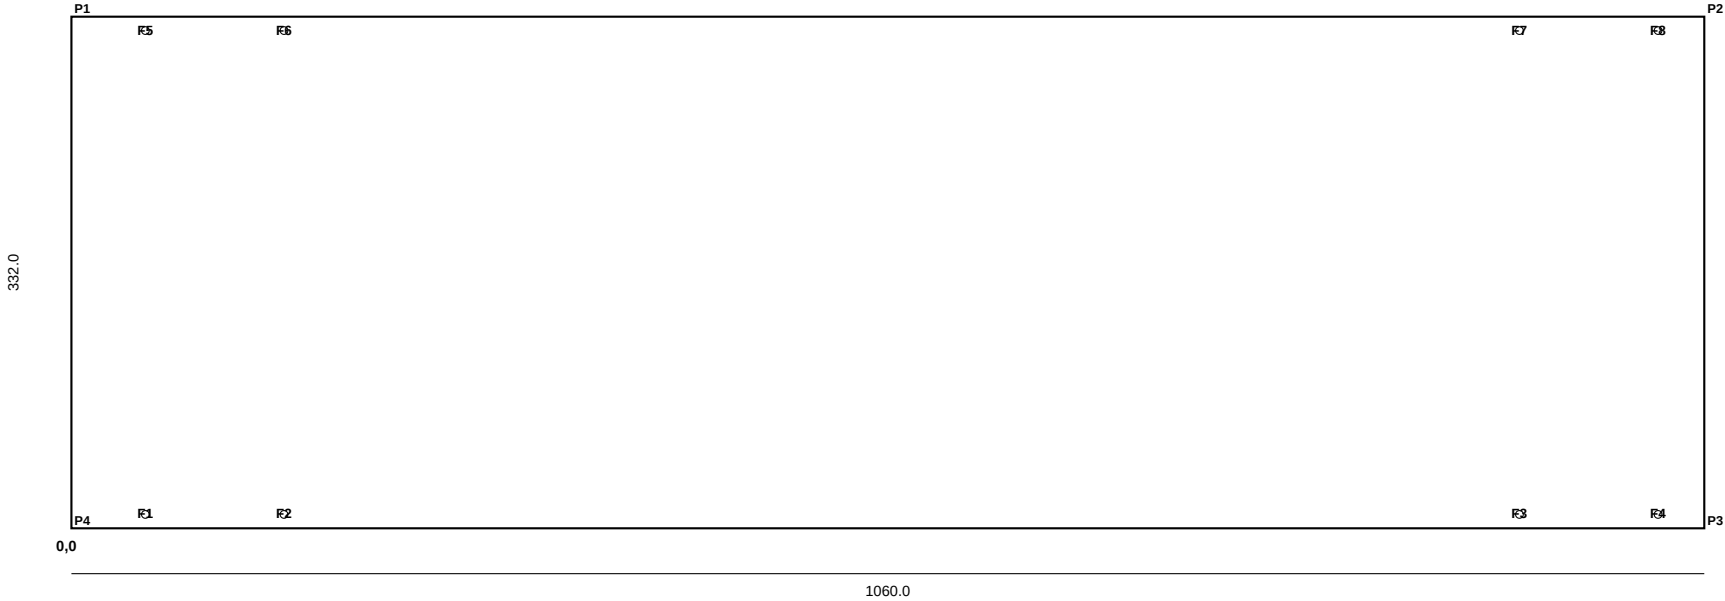

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 48.0 Y 9.0
- F2 Dia 5 x 11 deep X 138.0 Y 9.0
- F3 Dia 5 x 11 deep X 940.0 Y 9.0
- F4 Dia 5 x 11 deep X 1030.0 Y 9.0
- F5 Dia 5 x 11 deep X 48.0 Y 323.0
- F6 Dia 5 x 11 deep X 138.0 Y 323.0
- F7 Dia 5 x 11 deep X 940.0 Y 323.0
- F8 Dia 5 x 11 deep X 1030.0 Y 323.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y332.0 LINE
- P2 X1060.0 Y332.0 LINE
- P3 X1060.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE

S2-K - Part detail

Overall 1060.0 x 332.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 48.0 Y 9.0
- F2 Dia 5 x 11 deep X 138.0 Y 9.0
- F3 Dia 5 x 11 deep X 940.0 Y 9.0
- F4 Dia 5 x 11 deep X 1030.0 Y 9.0
- F5 Dia 5 x 11 deep X 48.0 Y 323.0
- F6 Dia 5 x 11 deep X 138.0 Y 323.0
- F7 Dia 5 x 11 deep X 940.0 Y 323.0
- F8 Dia 5 x 11 deep X 1030.0 Y 323.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y332.0 LINE
- P2 X1060.0 Y332.0 LINE
- P3 X1060.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE

S2-L - Part detail

Overall 1060.0 x 332.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 48.0 Y 9.0
- F2 Dia 5 x 11 deep X 138.0 Y 9.0
- F3 Dia 5 x 11 deep X 940.0 Y 9.0
- F4 Dia 5 x 11 deep X 1030.0 Y 9.0
- F5 Dia 5 x 11 deep X 48.0 Y 323.0
- F6 Dia 5 x 11 deep X 138.0 Y 323.0
- F7 Dia 5 x 11 deep X 940.0 Y 323.0
- F8 Dia 5 x 11 deep X 1030.0 Y 323.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y332.0 LINE
- P2 X1060.0 Y332.0 LINE
- P3 X1060.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE

S2-M - Part detail

Overall 150.1 x 314.0 mm | 18 mm plywood | datum lower-left = X0 Y0

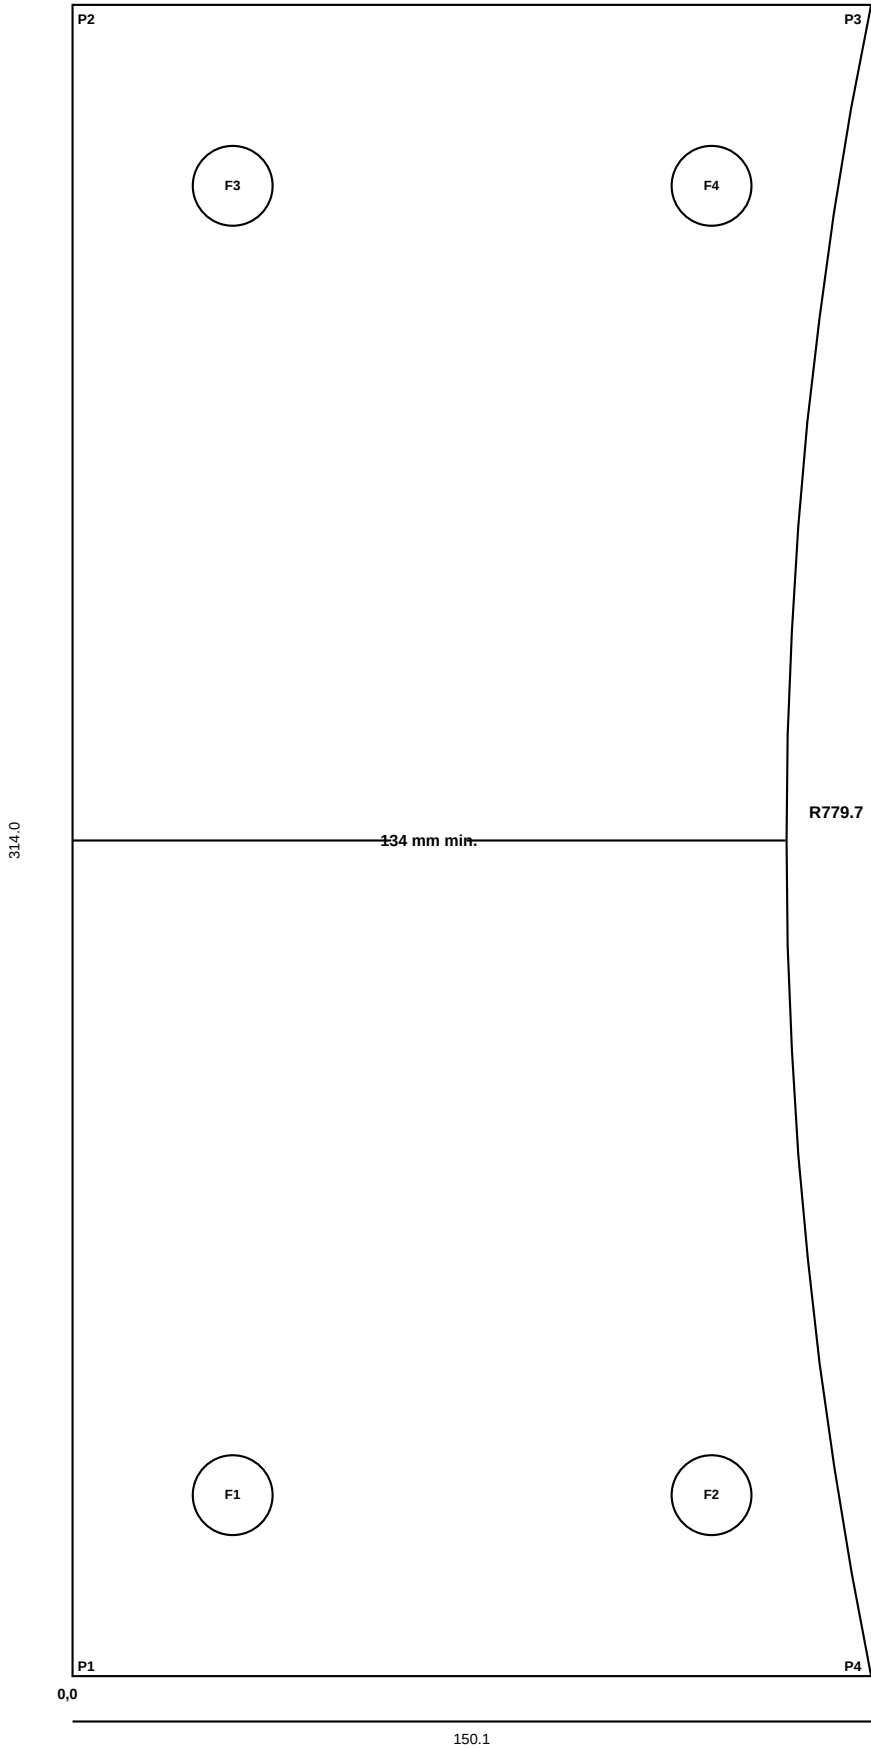

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 30.1 Y 34.0
- F2 Dia 15 x 14 deep X 120.1 Y 34.0
- F3 Dia 15 x 14 deep X 30.1 Y 280.0
- F4 Dia 15 x 14 deep X 120.1 Y 280.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE

P2 X0.0 Y314.0 LINE


P3 X150.1 Y314.0 ARC R779.7 CW

P4 X150.1 Y0.0 LINE

Minimum width at centre = 134 mm

S2-N - Part detail

Overall 1060.0 x 350.0 mm | 18 mm plywood | datum lower-left = X0 Y0

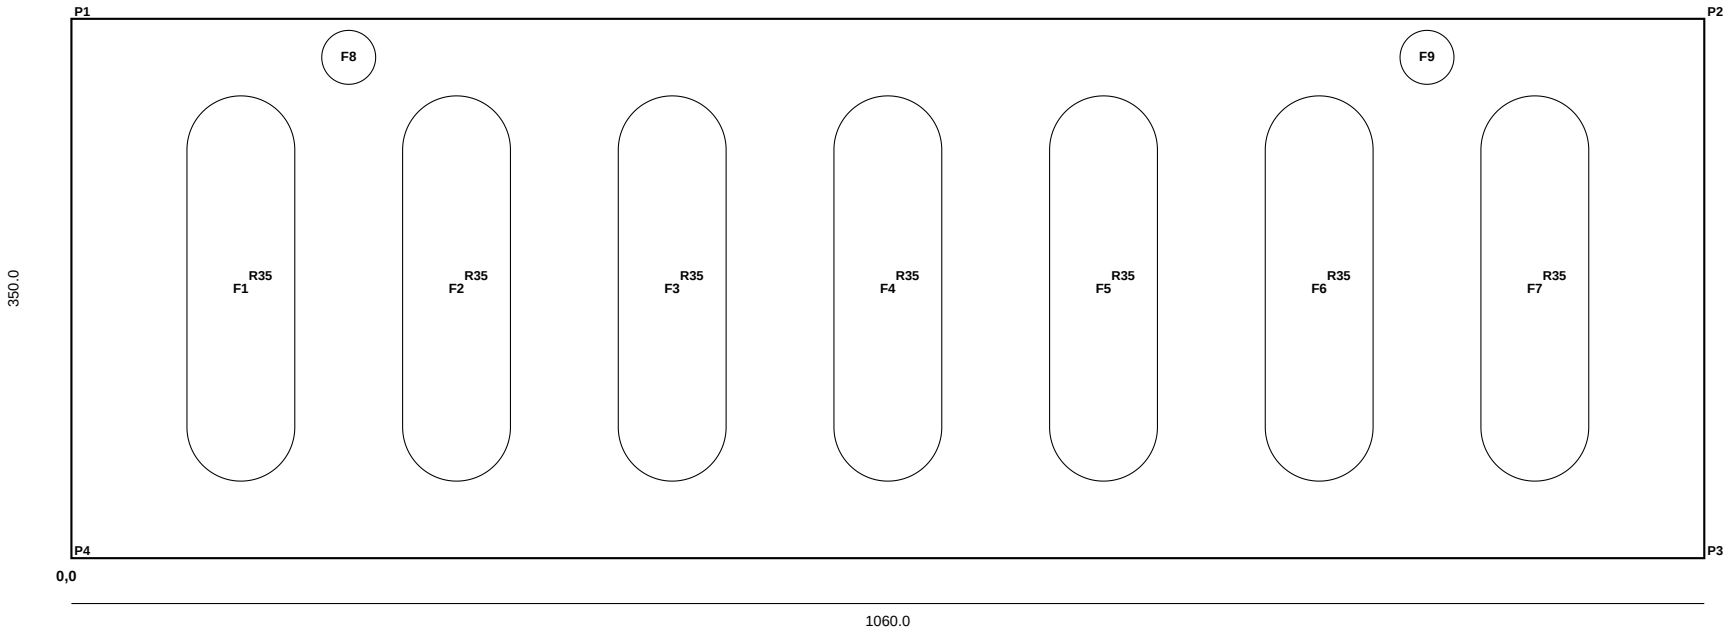

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 slot/cut-out 70.0 x 250.0, R35 X 110.0 Y 175.0
- F2 slot/cut-out 70.0 x 250.0, R35 X 250.0 Y 175.0
- F3 slot/cut-out 70.0 x 250.0, R35 X 390.0 Y 175.0
- F4 slot/cut-out 70.0 x 250.0, R35 X 530.0 Y 175.0
- F5 slot/cut-out 70.0 x 250.0, R35 X 670.0 Y 175.0
- F6 slot/cut-out 70.0 x 250.0, R35 X 810.0 Y 175.0
- F7 slot/cut-out 70.0 x 250.0, R35 X 950.0 Y 175.0
- F8 Dia 35 x 13 deep X 180.0 Y 325.0
- F9 Dia 35 x 13 deep X 880.0 Y 325.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y350.0 LINE
- P2 X1060.0 Y350.0 LINE
- P3 X1060.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE

S2-O - Part detail

Overall 150.1 x 314.0 mm | 18 mm plywood | datum lower-left = X0 Y0

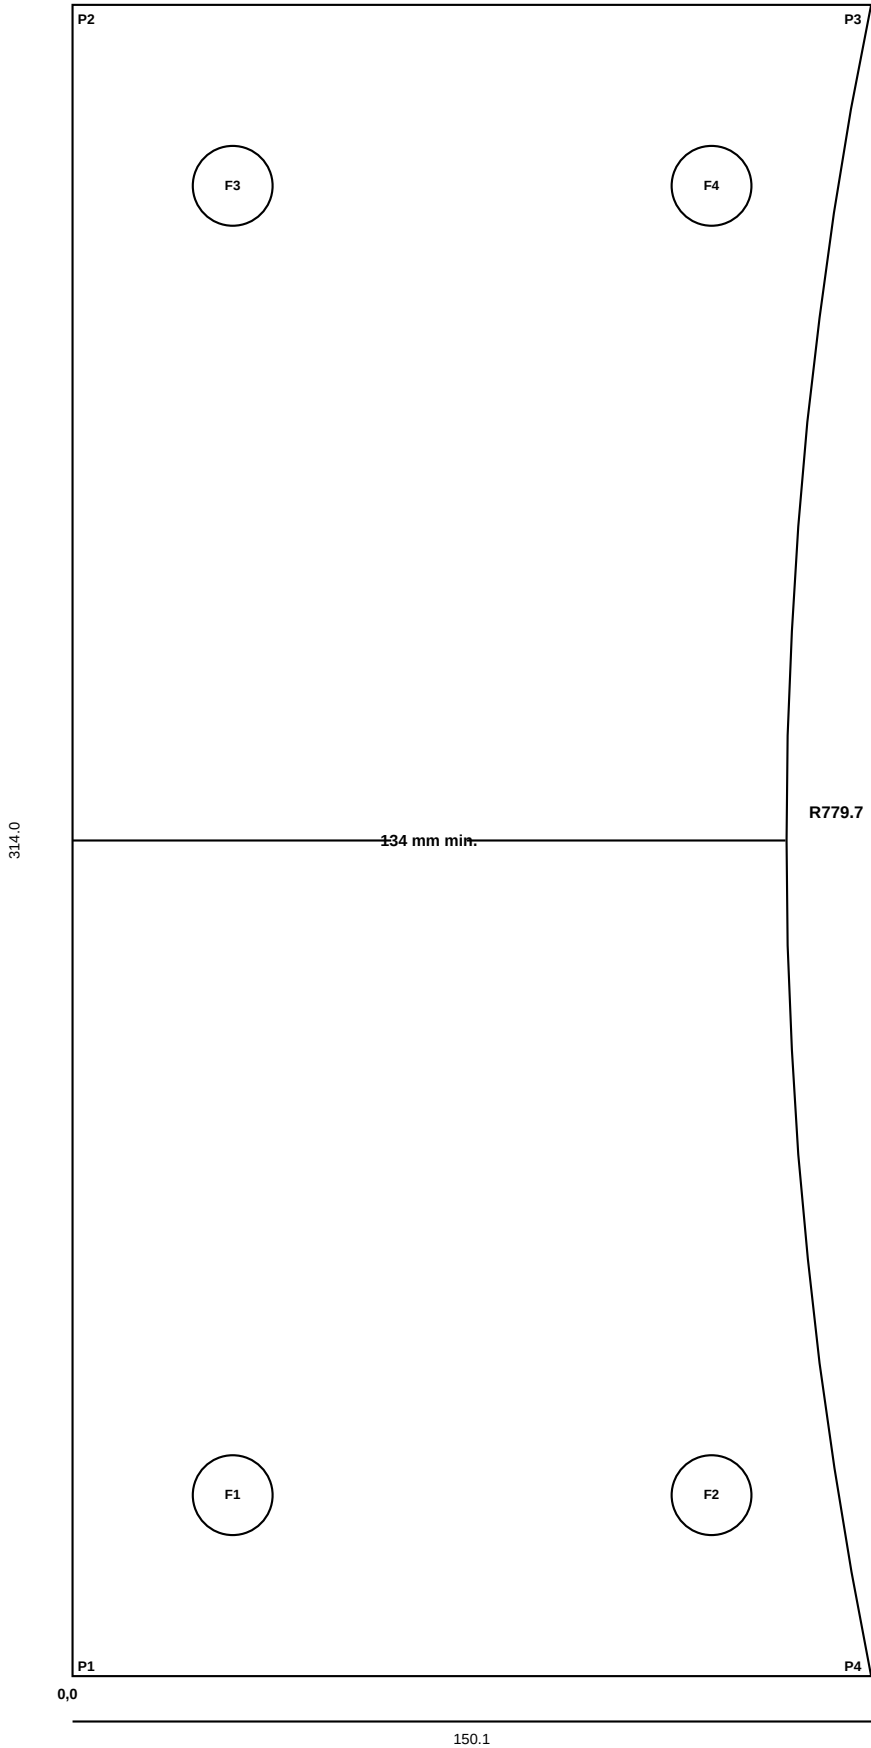

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 30.1 Y 34.0
- F2 Dia 15 x 14 deep X 120.1 Y 34.0
- F3 Dia 15 x 14 deep X 30.1 Y 280.0
- F4 Dia 15 x 14 deep X 120.1 Y 280.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE

P2 X0.0 Y314.0 LINE


P3 X150.1 Y314.0 ARC R779.7 CW

P4 X150.1 Y0.0 LINE

Minimum width at centre = 134 mm

S3-A - Part detail

Overall 582.0 x 288.1 mm | 18 mm plywood | datum lower-left = X0 Y0

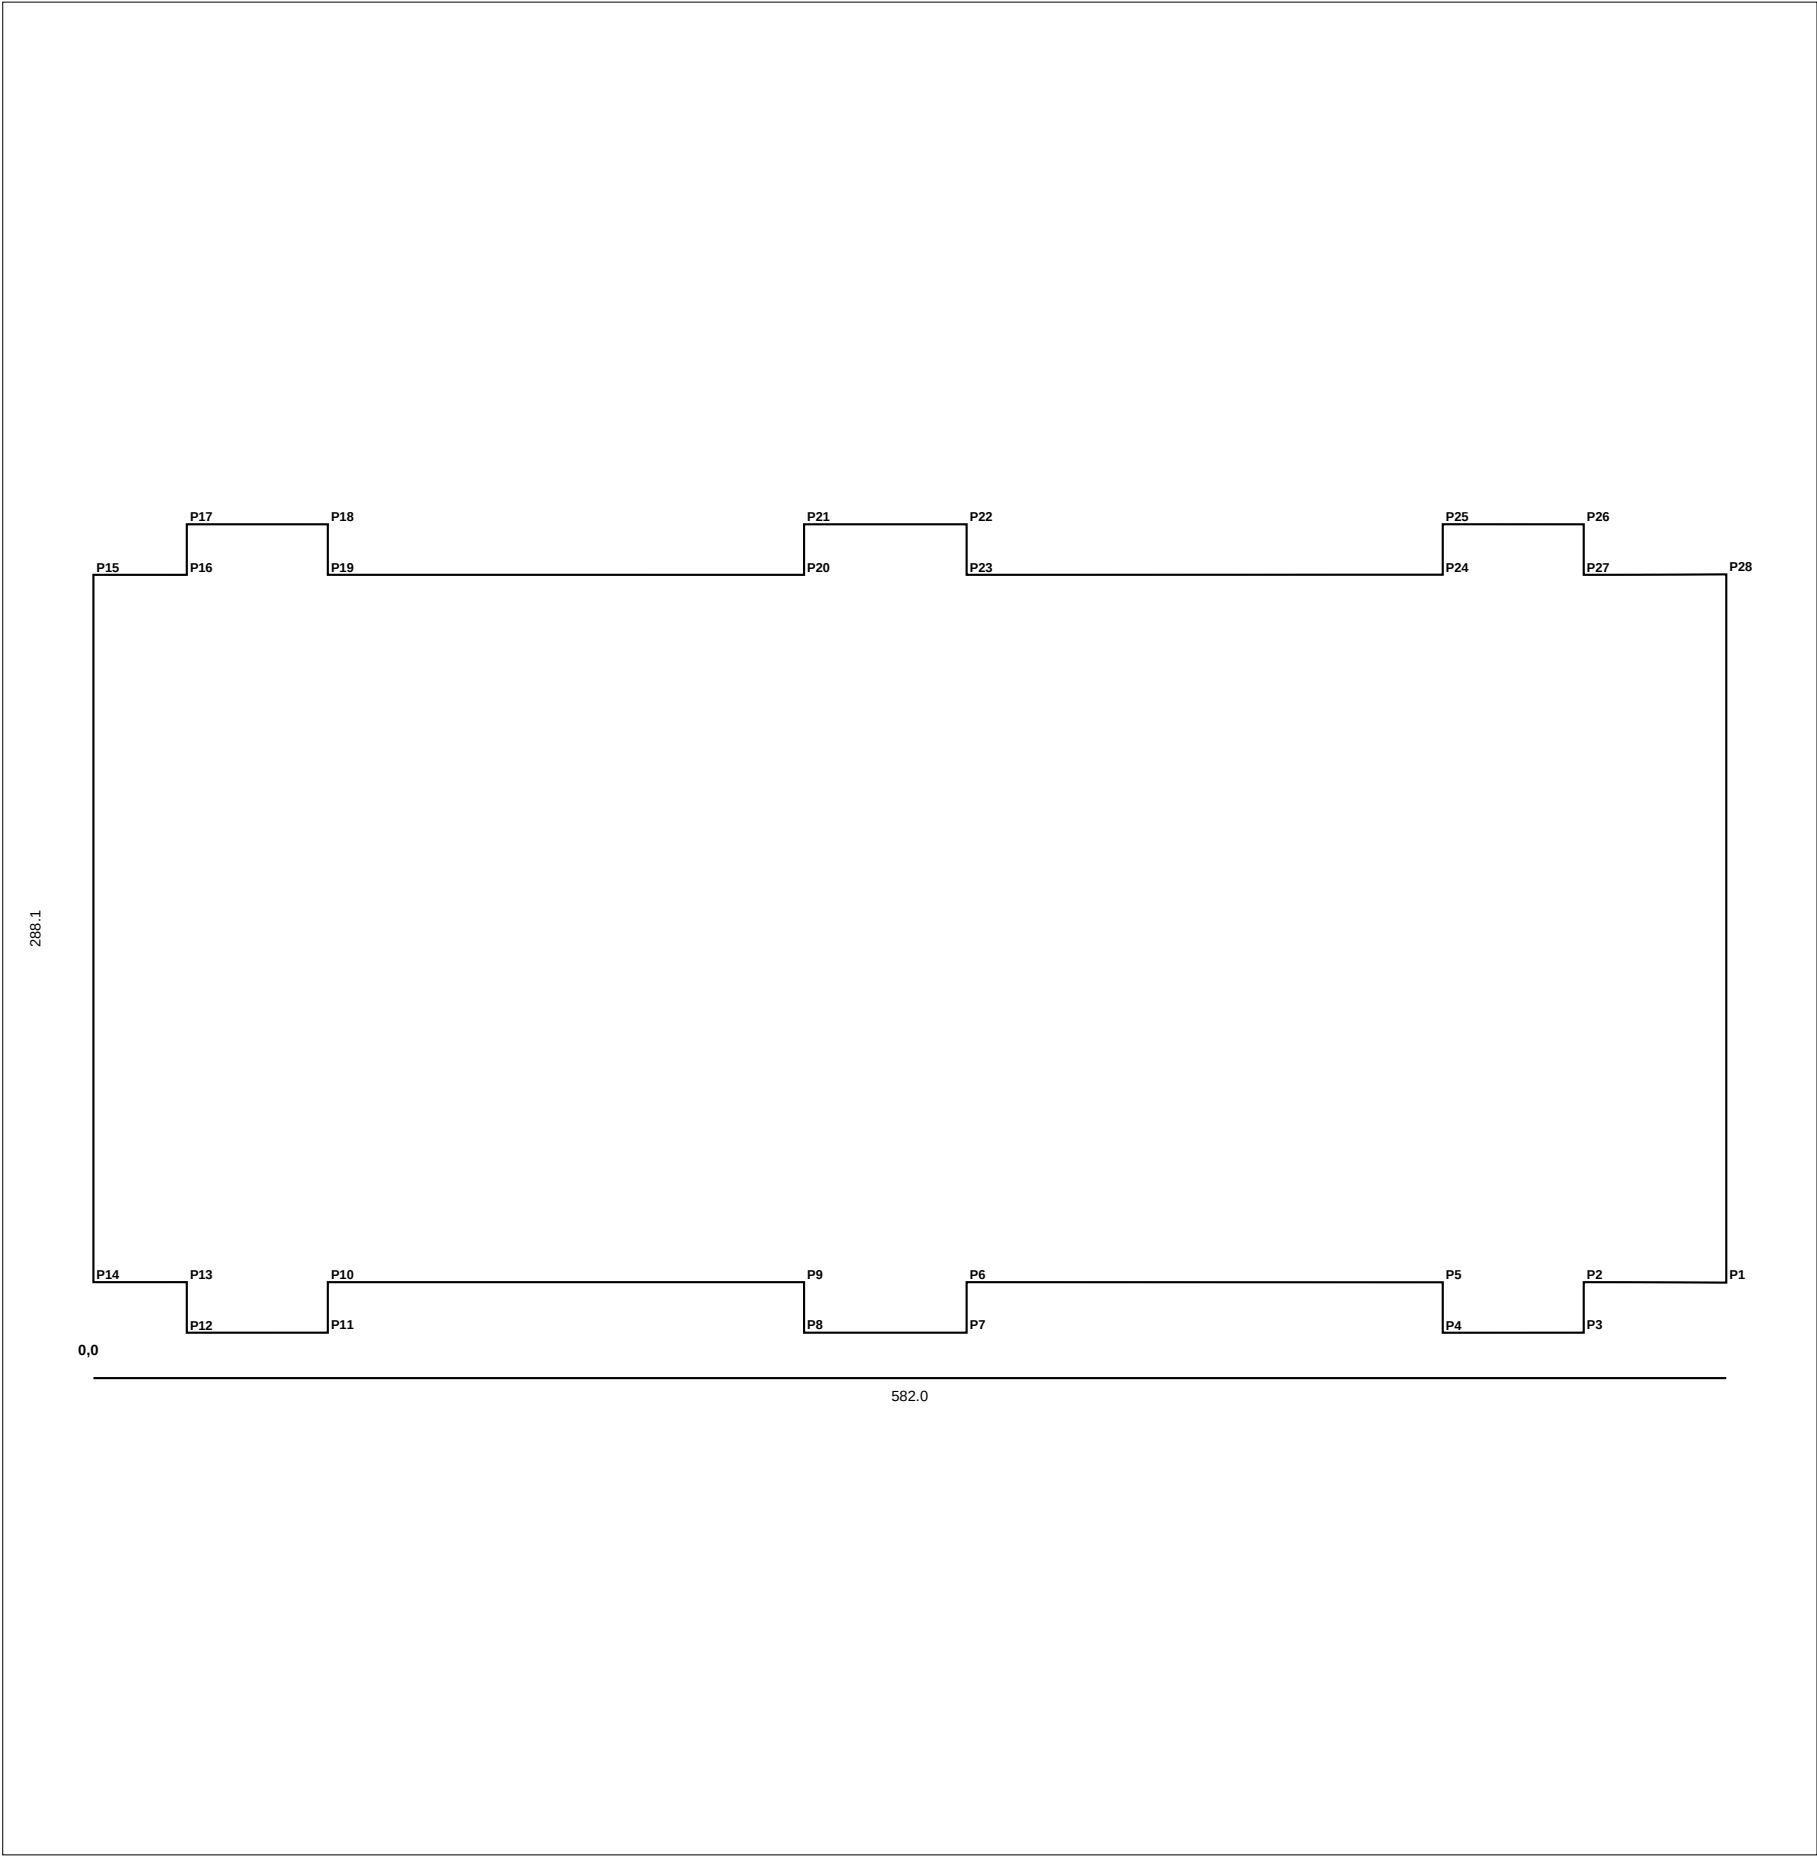

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X582.0 Y17.9 LINE
- P2 X531.2 Y18.0 LINE
- P3 X531.2 Y0.0 LINE
- P4 X480.9 Y0.0 LINE
- P5 X480.9 Y18.0 LINE
- P6 X311.2 Y18.0 LINE
- P7 X311.2 Y0.0 LINE
- P8 X253.3 Y0.0 LINE
- P9 X253.3 Y18.0 LINE
- P10 X83.5 Y18.0 LINE
- P11 X83.5 Y0.0 LINE
- P12 X33.3 Y0.0 LINE
- P13 X33.3 Y18.0 LINE
- P14 X0.0 Y18.0 LINE
- P15 X0.0 Y270.0 LINE
- P16 X33.3 Y270.0 LINE
- P17 X33.3 Y288.1 LINE
- P18 X83.5 Y288.0 LINE
- P19 X83.5 Y270.0 LINE
- P20 X253.3 Y270.0 LINE
- P21 X253.3 Y288.1 LINE
- P22 X311.2 Y288.0 LINE
- P23 X311.2 Y270.0 LINE
- P24 X480.9 Y270.1 LINE
- P25 X480.9 Y288.1 LINE
- P26 X531.2 Y288.0 LINE
- P27 X531.2 Y270.0 LINE
- P28 X582.0 Y270.2 LINE

S3-B - Part detail

Overall 284.0 x 252.0 mm | 18 mm plywood | datum lower-left = X0 Y0

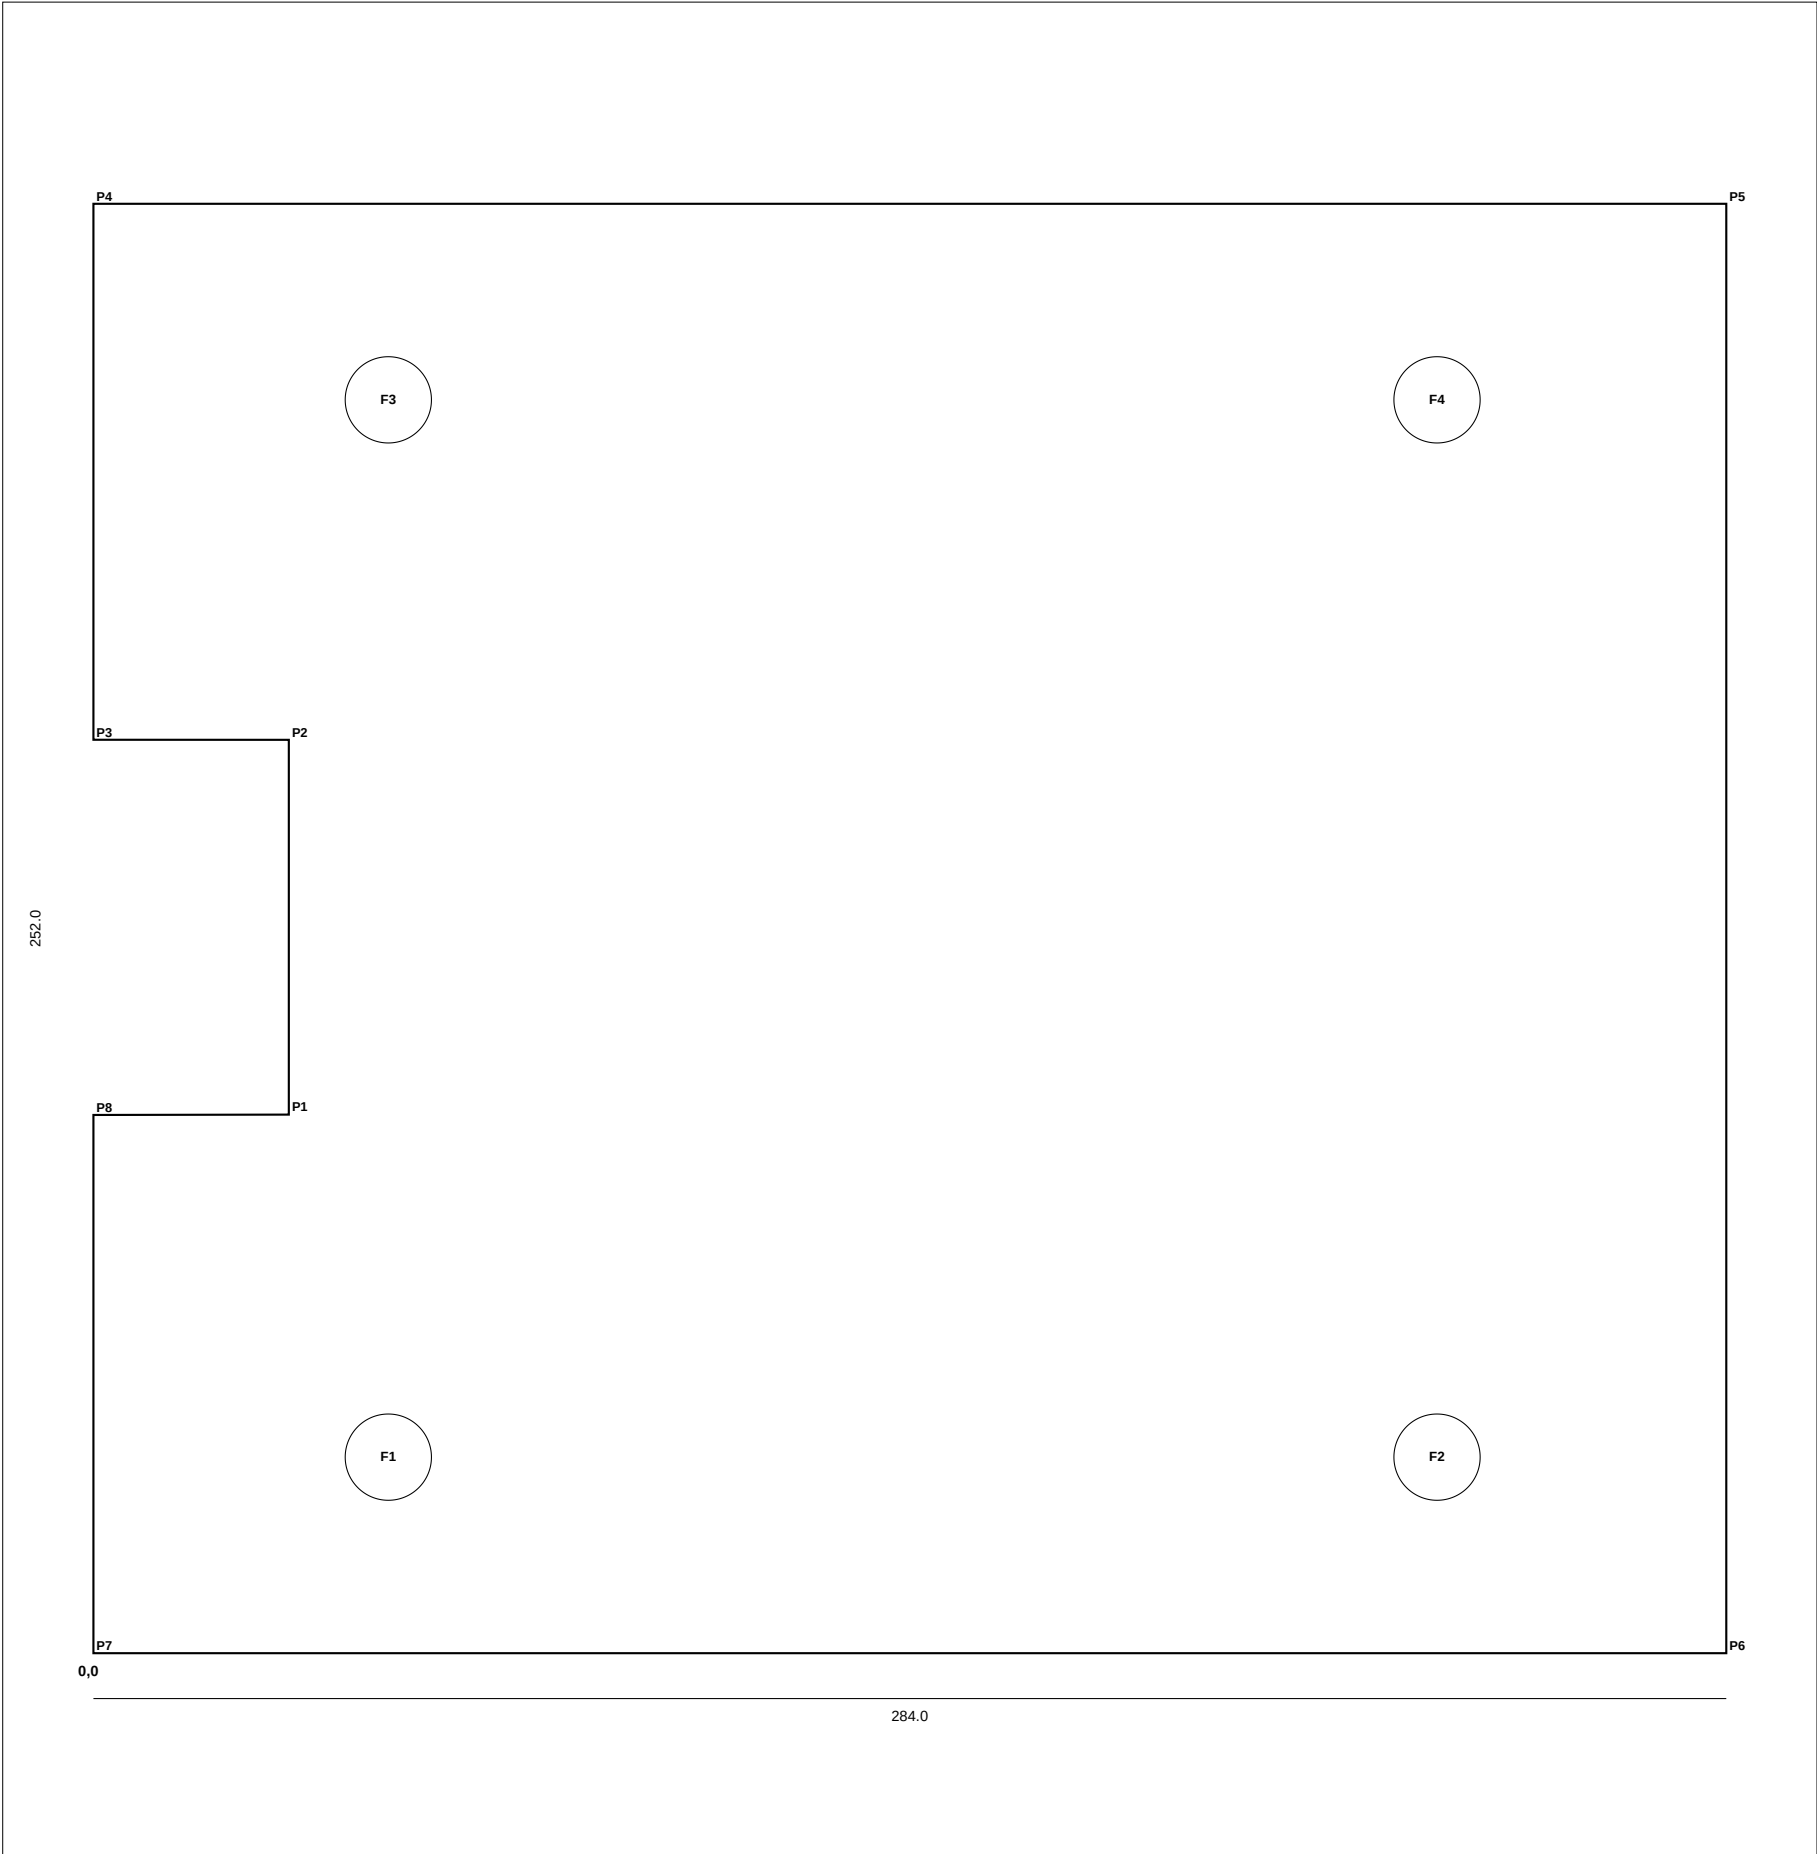

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 51.3 Y 34.1
- F2 Dia 15 x 14 deep X 233.7 Y 34.1
- F3 Dia 15 x 14 deep X 51.3 Y 217.9
- F4 Dia 15 x 14 deep X 233.7 Y 217.9


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X34.0 Y93.6 LINE
- P2 X34.0 Y158.8 LINE
- P3 X0.0 Y158.8 LINE
- P4 X0.0 Y252.0 LINE
- P5 X284.0 Y252.0 LINE
- P6 X284.0 Y0.0 LINE
- P7 X0.0 Y0.0 LINE
- P8 X0.0 Y93.6 LINE

S3-C - Part detail

Overall 284.0 x 252.0 mm | 18 mm plywood | datum lower-left = X0 Y0

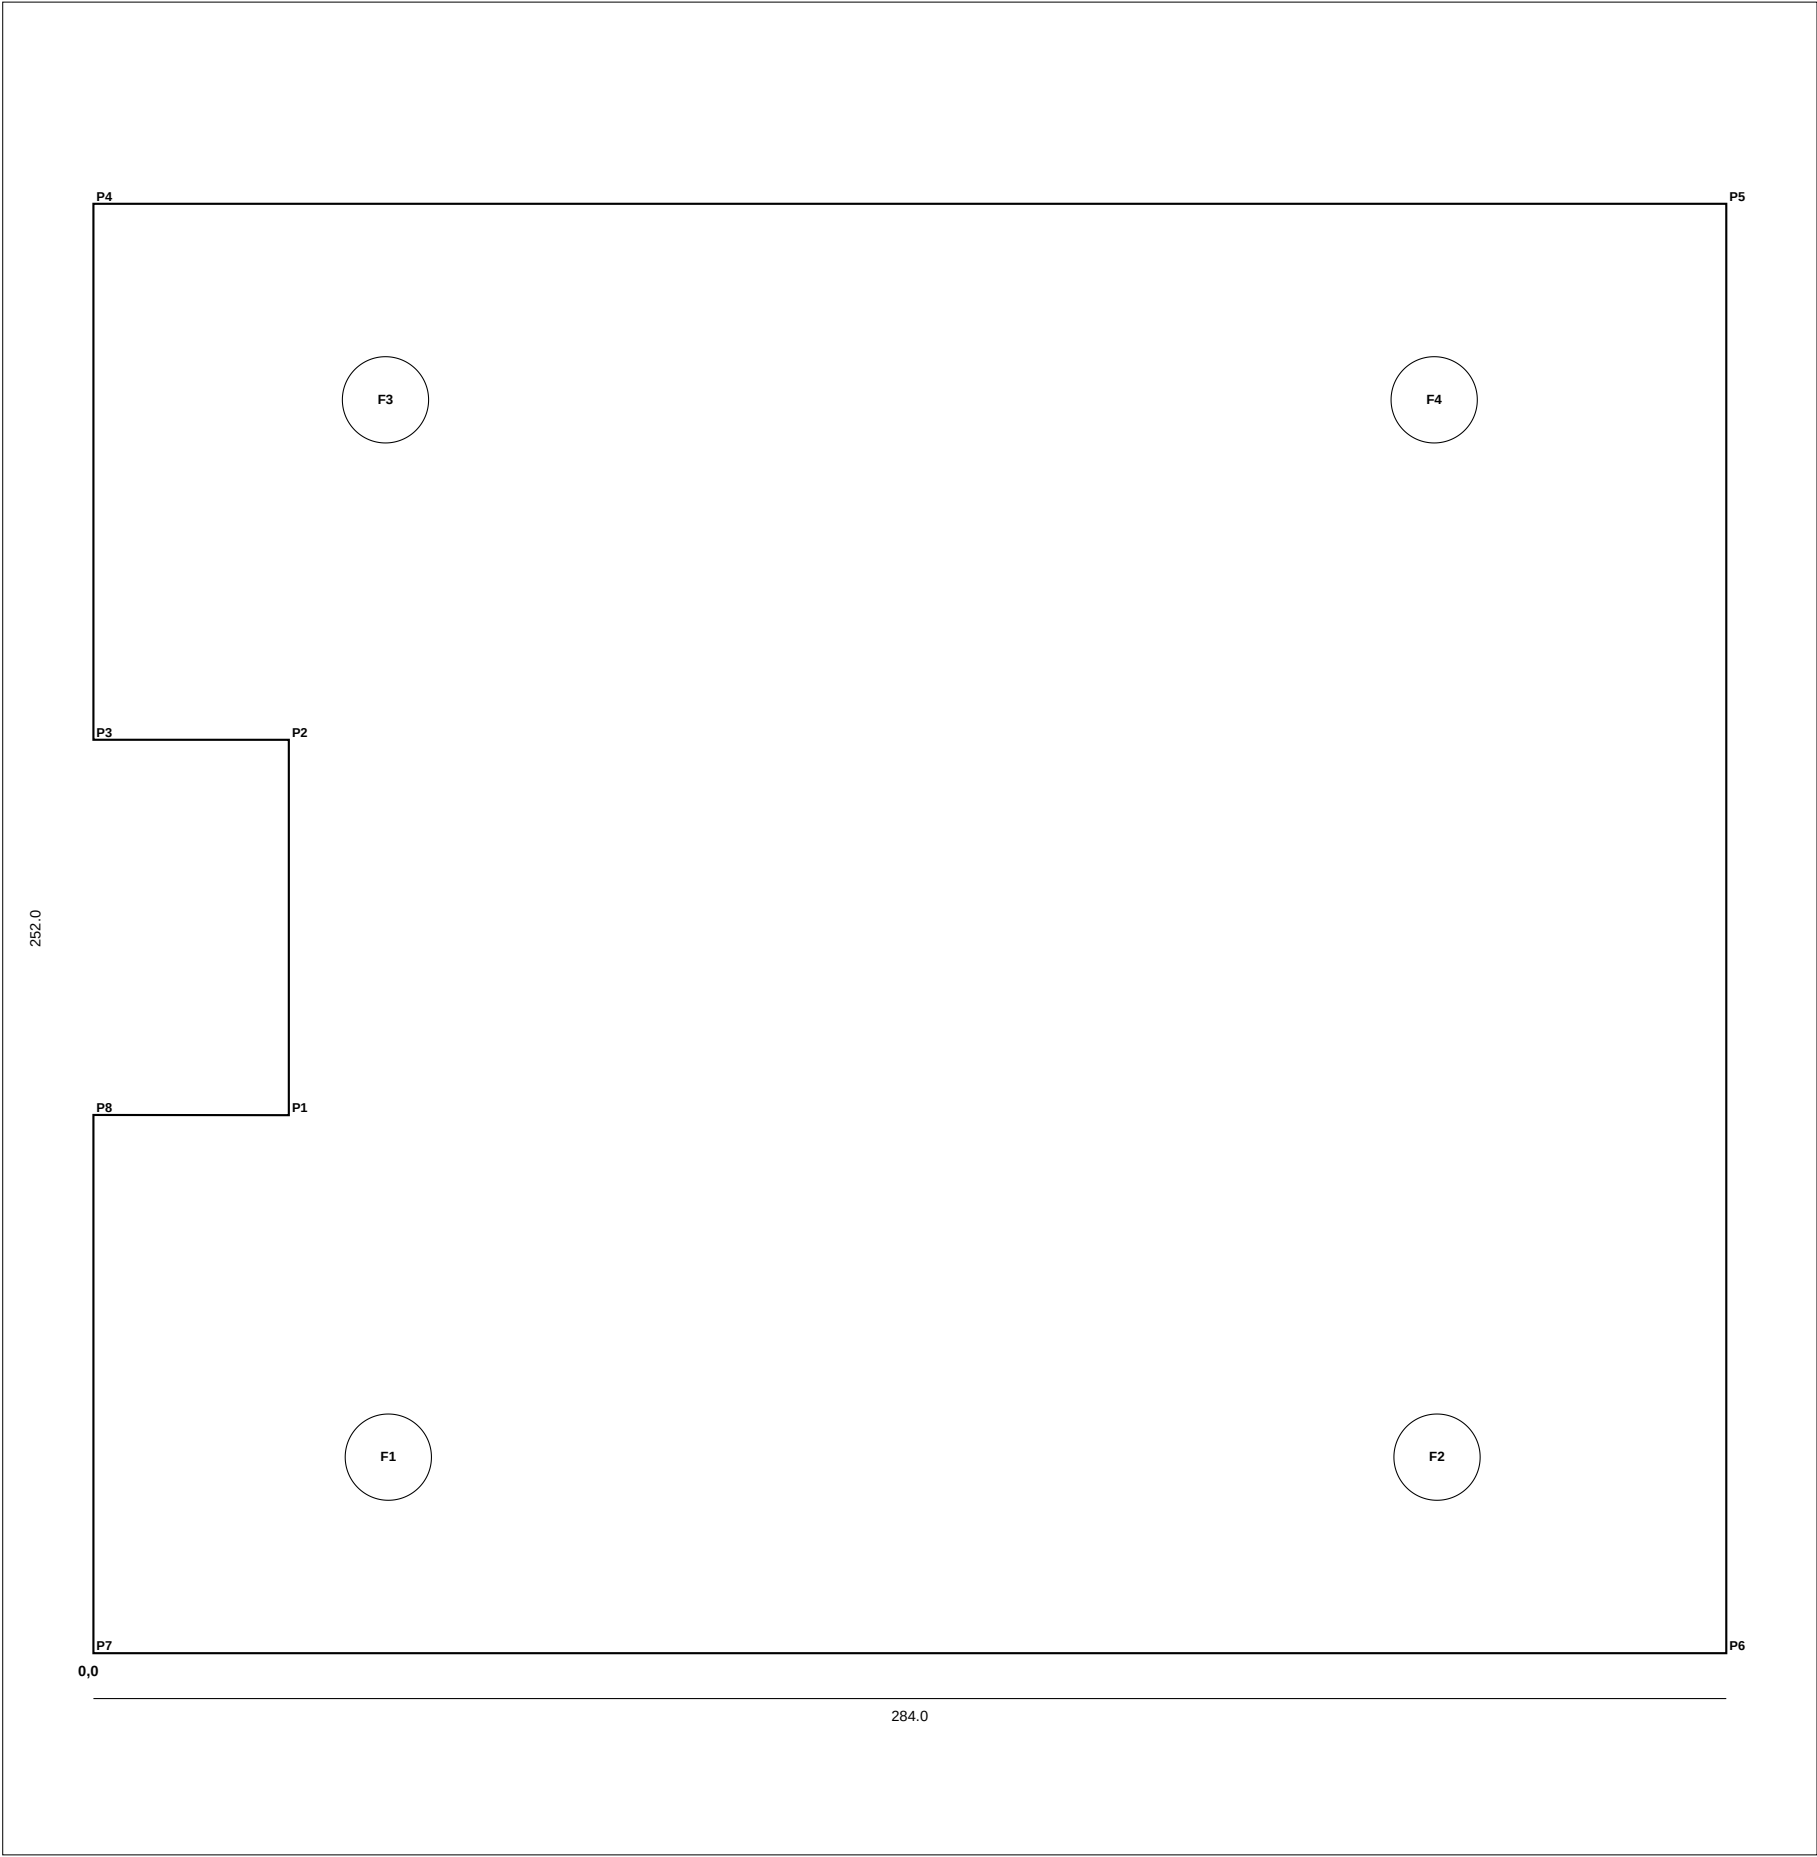

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 51.3 Y 34.1
- F2 Dia 15 x 14 deep X 233.7 Y 34.1
- F3 Dia 15 x 14 deep X 50.8 Y 217.9
- F4 Dia 15 x 14 deep X 233.2 Y 217.9


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X34.0 Y93.5 LINE
- P2 X34.0 Y158.8 LINE
- P3 X0.0 Y158.8 LINE
- P4 X0.0 Y252.0 LINE
- P5 X284.0 Y252.0 LINE
- P6 X284.0 Y0.0 LINE
- P7 X0.0 Y0.0 LINE
- P8 X0.0 Y93.6 LINE

S3-D - Part detail

Overall 600.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 slot/cut-out 50.8 x 18.5 X 76.6 Y 27.3

F2 slot/cut-out 58.5 x 18.5 X 300.4 Y 27.3

F3 slot/cut-out 50.8 x 18.5 X 524.2 Y 27.3

F4 Dia 5 x 11 deep X 9.0 Y 50.8

F5 slot/cut-out 18.5 x 50.8 X 582.2 Y 76.2

F6 slot/cut-out 18.5 x 50.8 X 582.2 Y 207.8

F7 Dia 5 x 11 deep X 9.0 Y 233.2

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE


P2 X0.0 Y284.0 LINE

P3 X600.0 Y284.0 LINE

P4 X600.0 Y0.0 LINE

S3-E - Part detail

Overall 288.0 x 247.6 mm | 18 mm plywood | datum lower-left = X0 Y0

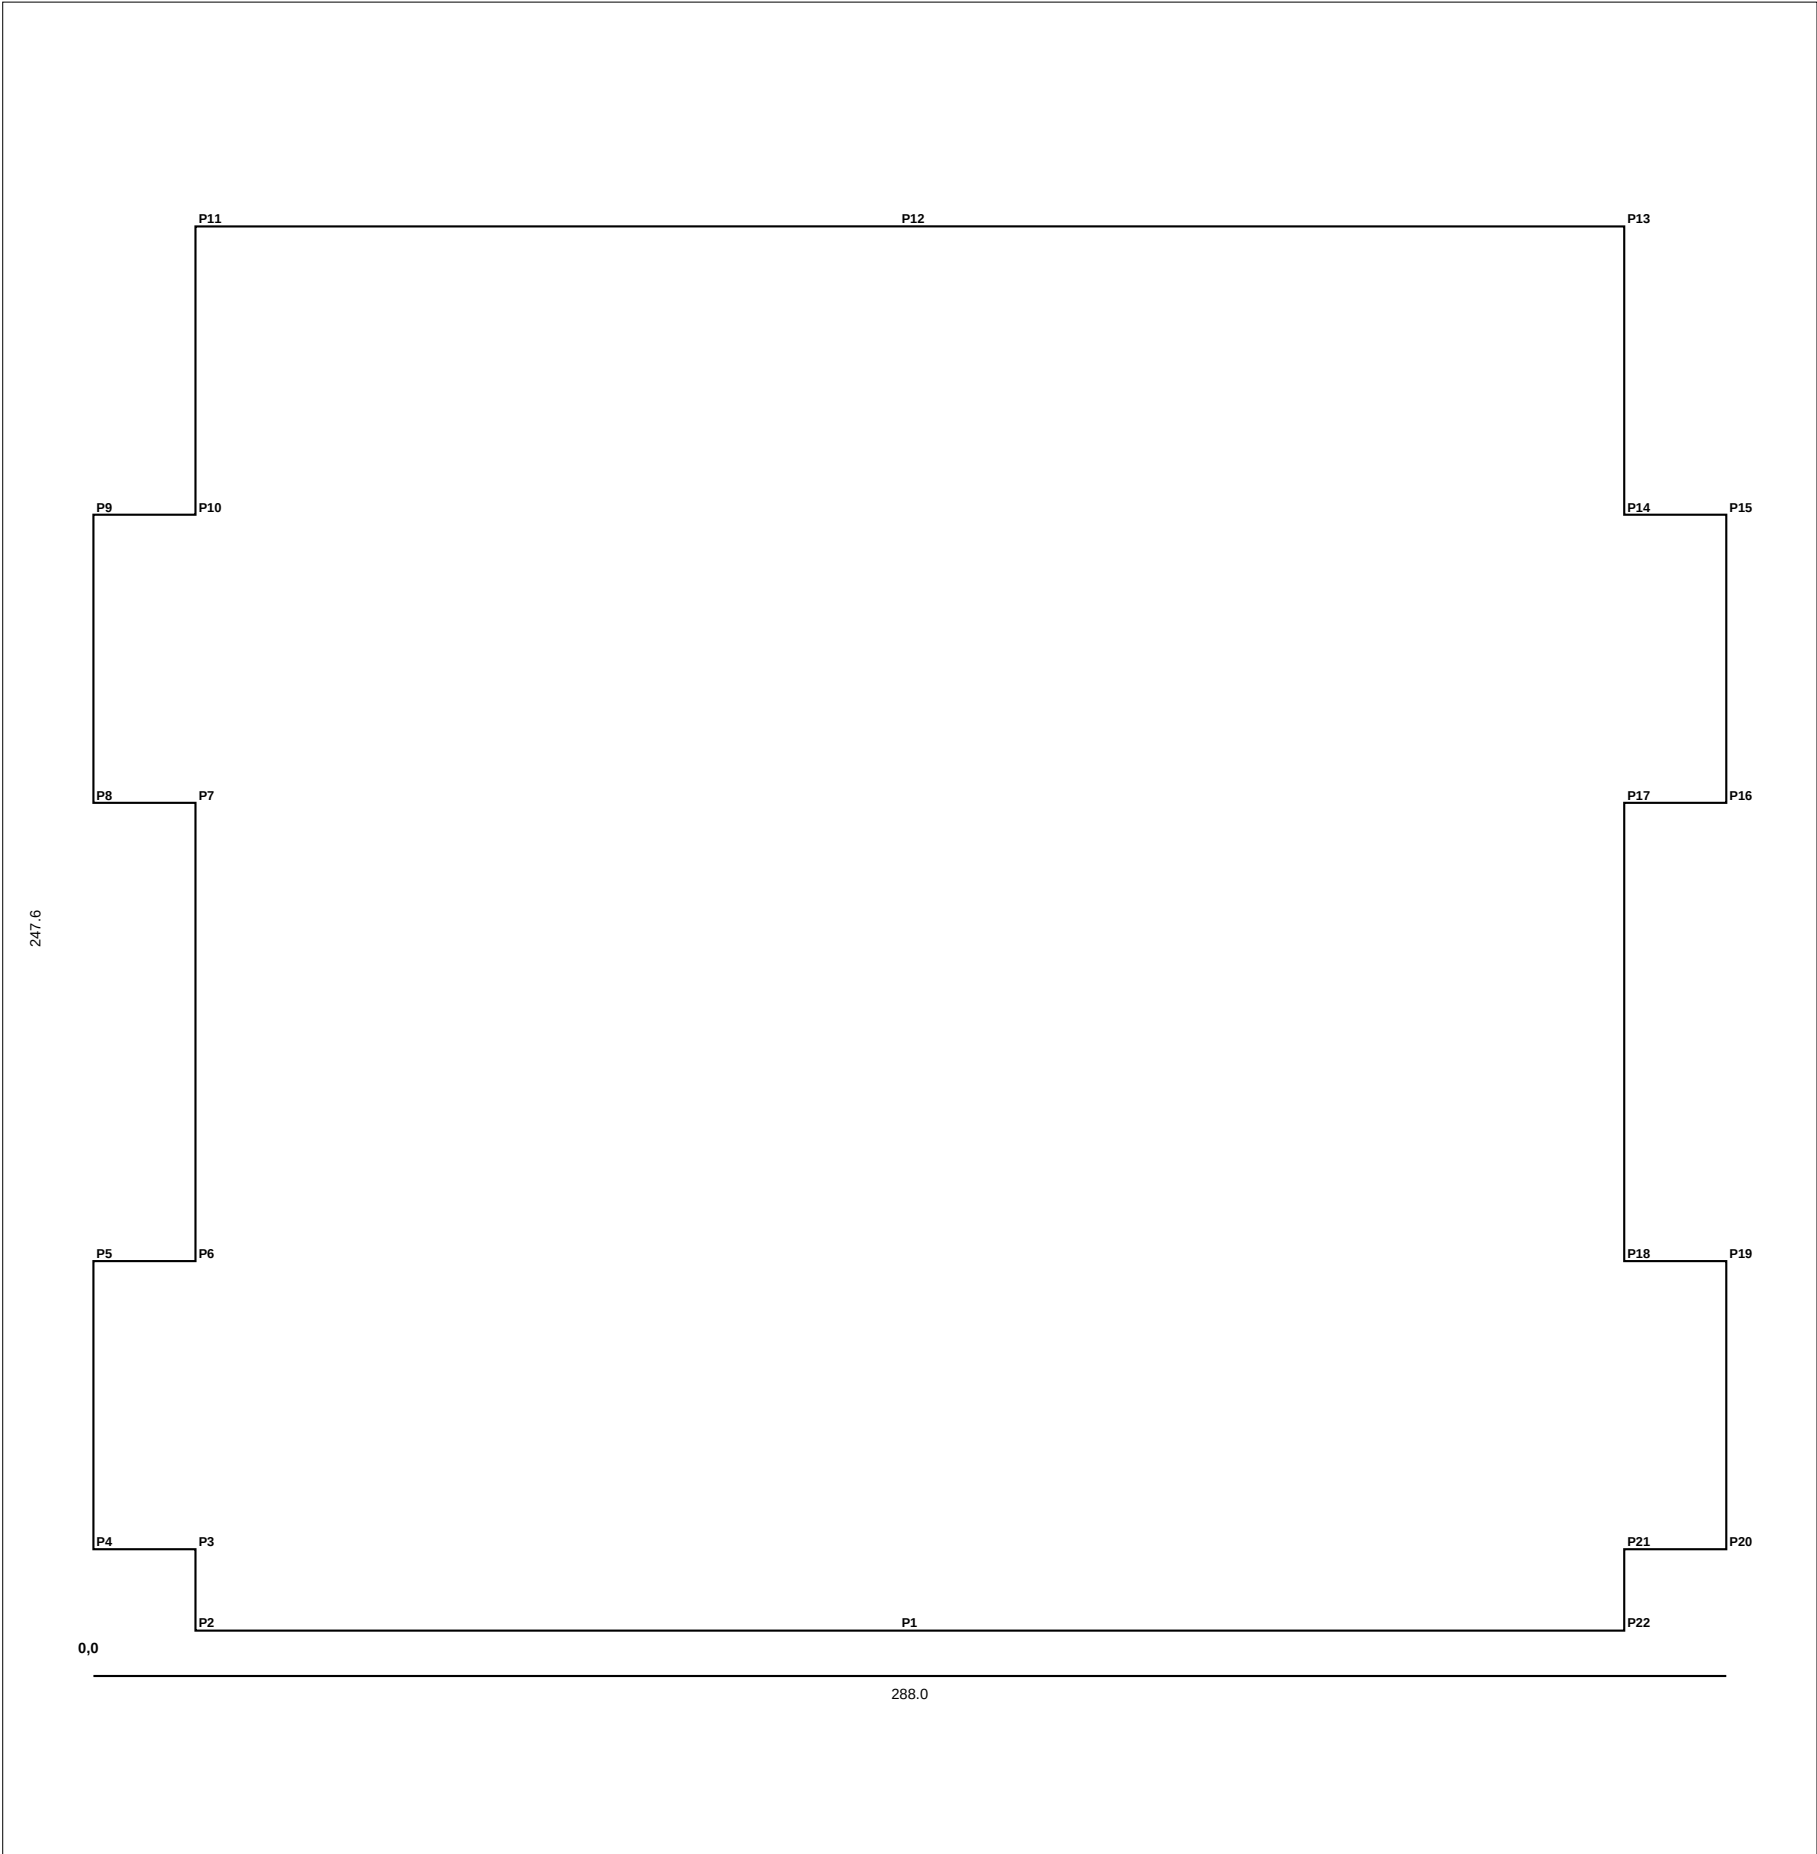

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X142.0 Y0.0 LINE
- P2 X18.0 Y0.0 LINE
- P3 X18.0 Y14.4 LINE
- P4 X0.0 Y14.4 LINE
- P5 X0.0 Y65.2 LINE
- P6 X18.0 Y65.2 LINE
- P7 X18.0 Y146.0 LINE
- P8 X0.0 Y146.0 LINE
- P9 X0.0 Y196.8 LINE
- P10 X18.0 Y196.8 LINE
- P11 X18.0 Y247.6 LINE
- P12 X142.0 Y247.6 LINE
- P13 X270.0 Y247.6 LINE
- P14 X270.0 Y196.7 LINE
- P15 X288.0 Y196.7 LINE
- P16 X288.0 Y145.9 LINE
- P17 X270.0 Y146.0 LINE
- P18 X270.0 Y65.2 LINE
- P19 X288.0 Y65.1 LINE
- P20 X288.0 Y14.3 LINE
- P21 X270.0 Y14.4 LINE
- P22 X270.0 Y0.0 LINE

S3-F - Part detail

Overall 600.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge


Machining features

- F1 slot/cut-out 50.8 x 18.5 X 523.8 Y 27.3
- F2 slot/cut-out 58.5 x 18.5 X 300.0 Y 27.3
- F3 slot/cut-out 50.8 x 18.5 X 76.2 Y 27.3
- F4 Dia 5 x 11 deep X 591.0 Y 50.8
- F5 slot/cut-out 18.5 x 50.8 X 18.3 Y 76.2
- F6 slot/cut-out 18.5 x 50.8 X 18.2 Y 207.8
- F7 Dia 5 x 11 deep X 591.0 Y 233.2

Outer profile cuts


P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X0.0 Y284.0 LINE
- P3 X22.8 Y283.9 ARC R30.0 CW
- P4 X50.8 Y253.9 LINE
- P5 X50.8 Y79.8 ARC R30.0 CCW
- P6 X78.9 Y50.9 LINE
- P7 X237.0 Y50.8 LINE
- P8 X519.2 Y50.8 ARC R30.0 CCW
- P9 X549.1 Y78.8 LINE
- P10 X549.2 Y254.0 ARC R30.0 CW
- P11 X577.3 Y283.9 LINE
- P12 X600.0 Y284.0 LINE
- P13 X600.0 Y0.0 LINE

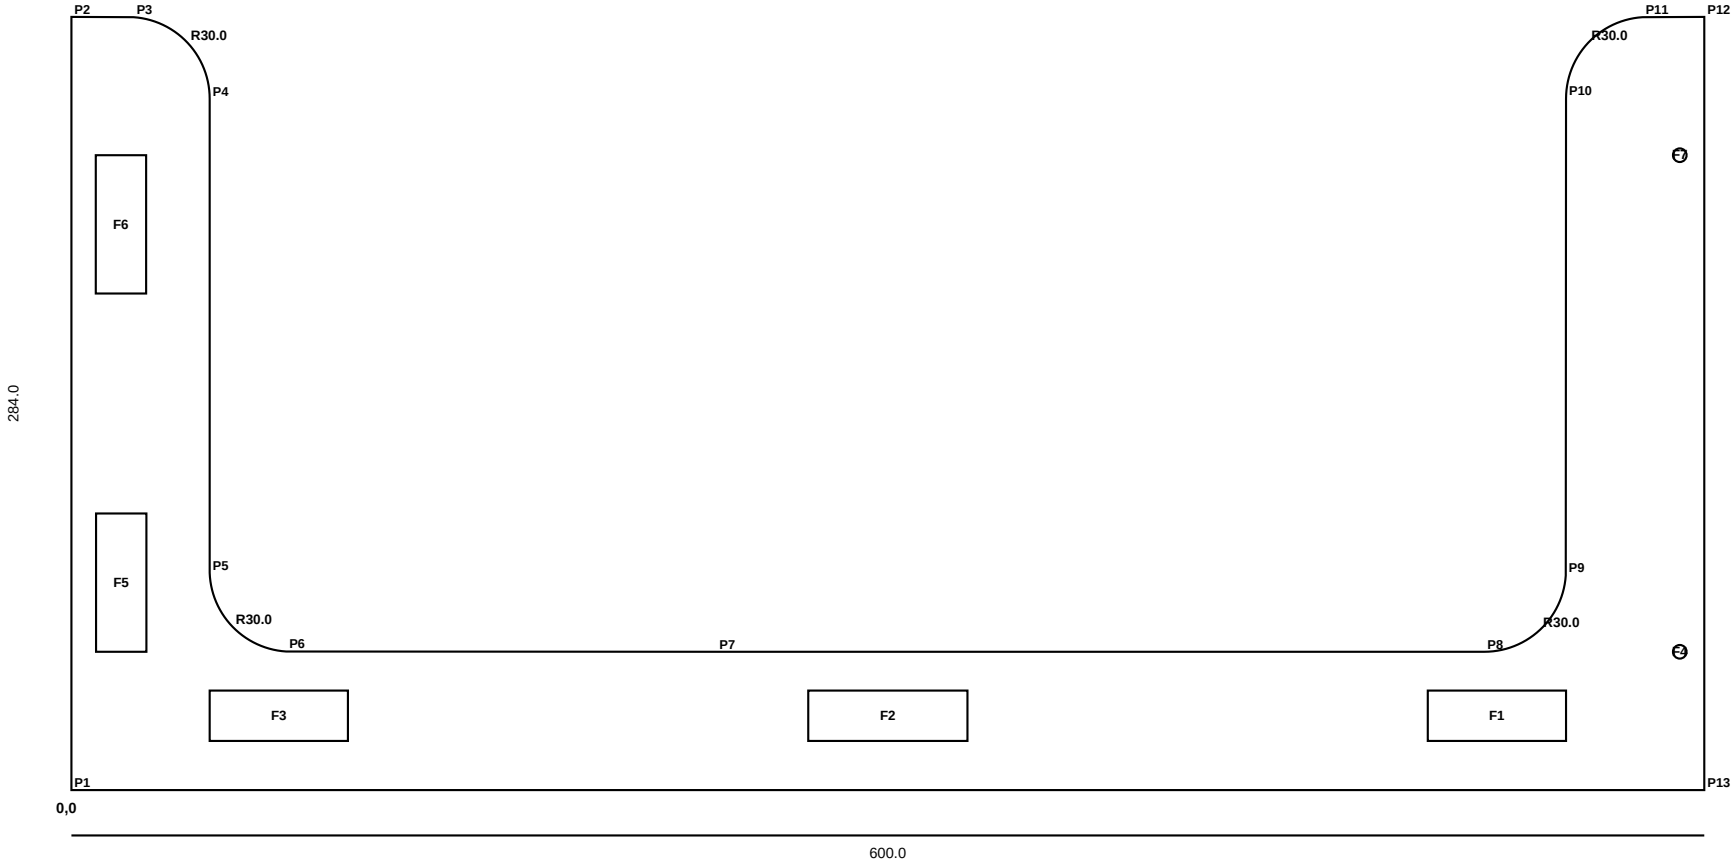

S3-G - Part detail

Overall 582.0 x 288.1 mm | 18 mm plywood | datum lower-left = X0 Y0

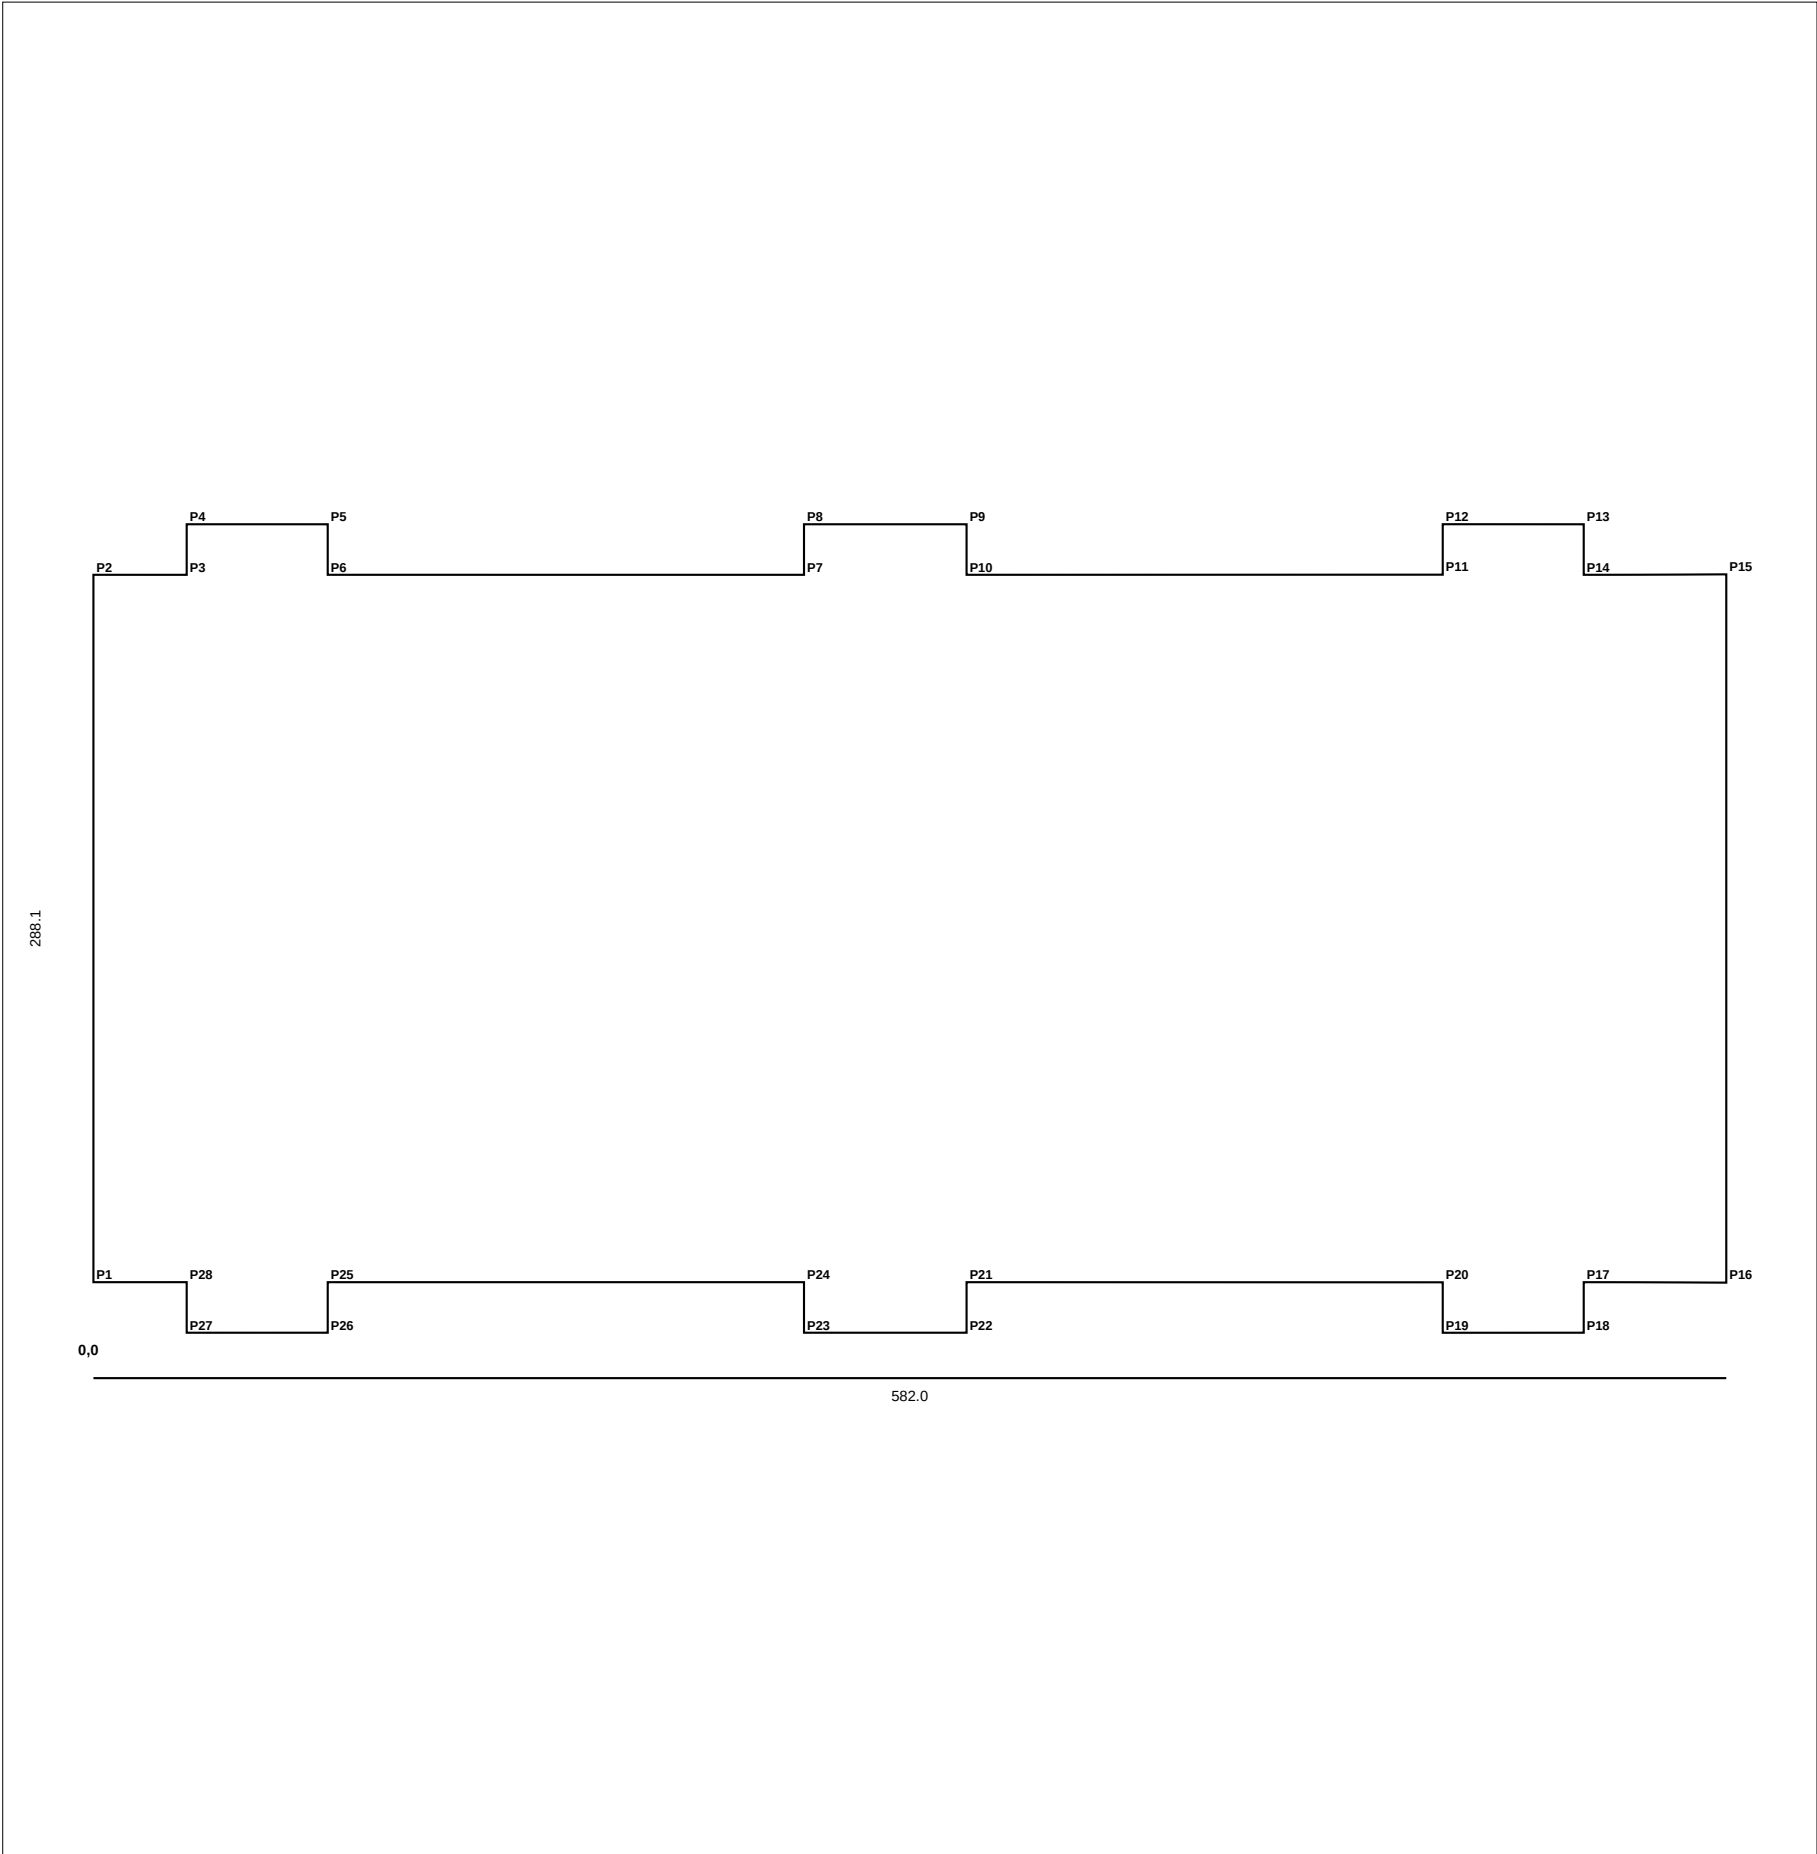

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y18.0 LINE

P2 X0.0 Y270.0 LINE

P3 X33.2 Y270.0 LINE

P4 X33.2 Y288.1 LINE

P5 X83.5 Y288.0 LINE

P6 X83.5 Y270.0 LINE

P7 X253.3 Y270.0 LINE

P8 X253.3 Y288.1 LINE

P9 X311.2 Y288.0 LINE

P10 X311.2 Y270.0 LINE

P11 X480.9 Y270.1 LINE

P12 X480.9 Y288.1 LINE

P13 X531.2 Y288.0 LINE

P14 X531.2 Y270.0 LINE

P15 X582.0 Y270.2 LINE

P16 X582.0 Y17.9 LINE

P17 X531.2 Y18.0 LINE

P18 X531.2 Y0.0 LINE

P19 X480.9 Y0.0 LINE

P20 X480.9 Y18.0 LINE

P21 X311.2 Y18.0 LINE

P22 X311.2 Y0.0 LINE

P23 X253.3 Y0.0 LINE

P24 X253.3 Y18.0 LINE

P25 X83.5 Y18.0 LINE


P26 X83.5 Y0.0 LINE

P27 X33.2 Y0.0 LINE

P28 X33.2 Y18.0 LINE

S3-H - Part detail

Overall 288.0 x 247.6 mm | 18 mm plywood | datum lower-left = X0 Y0

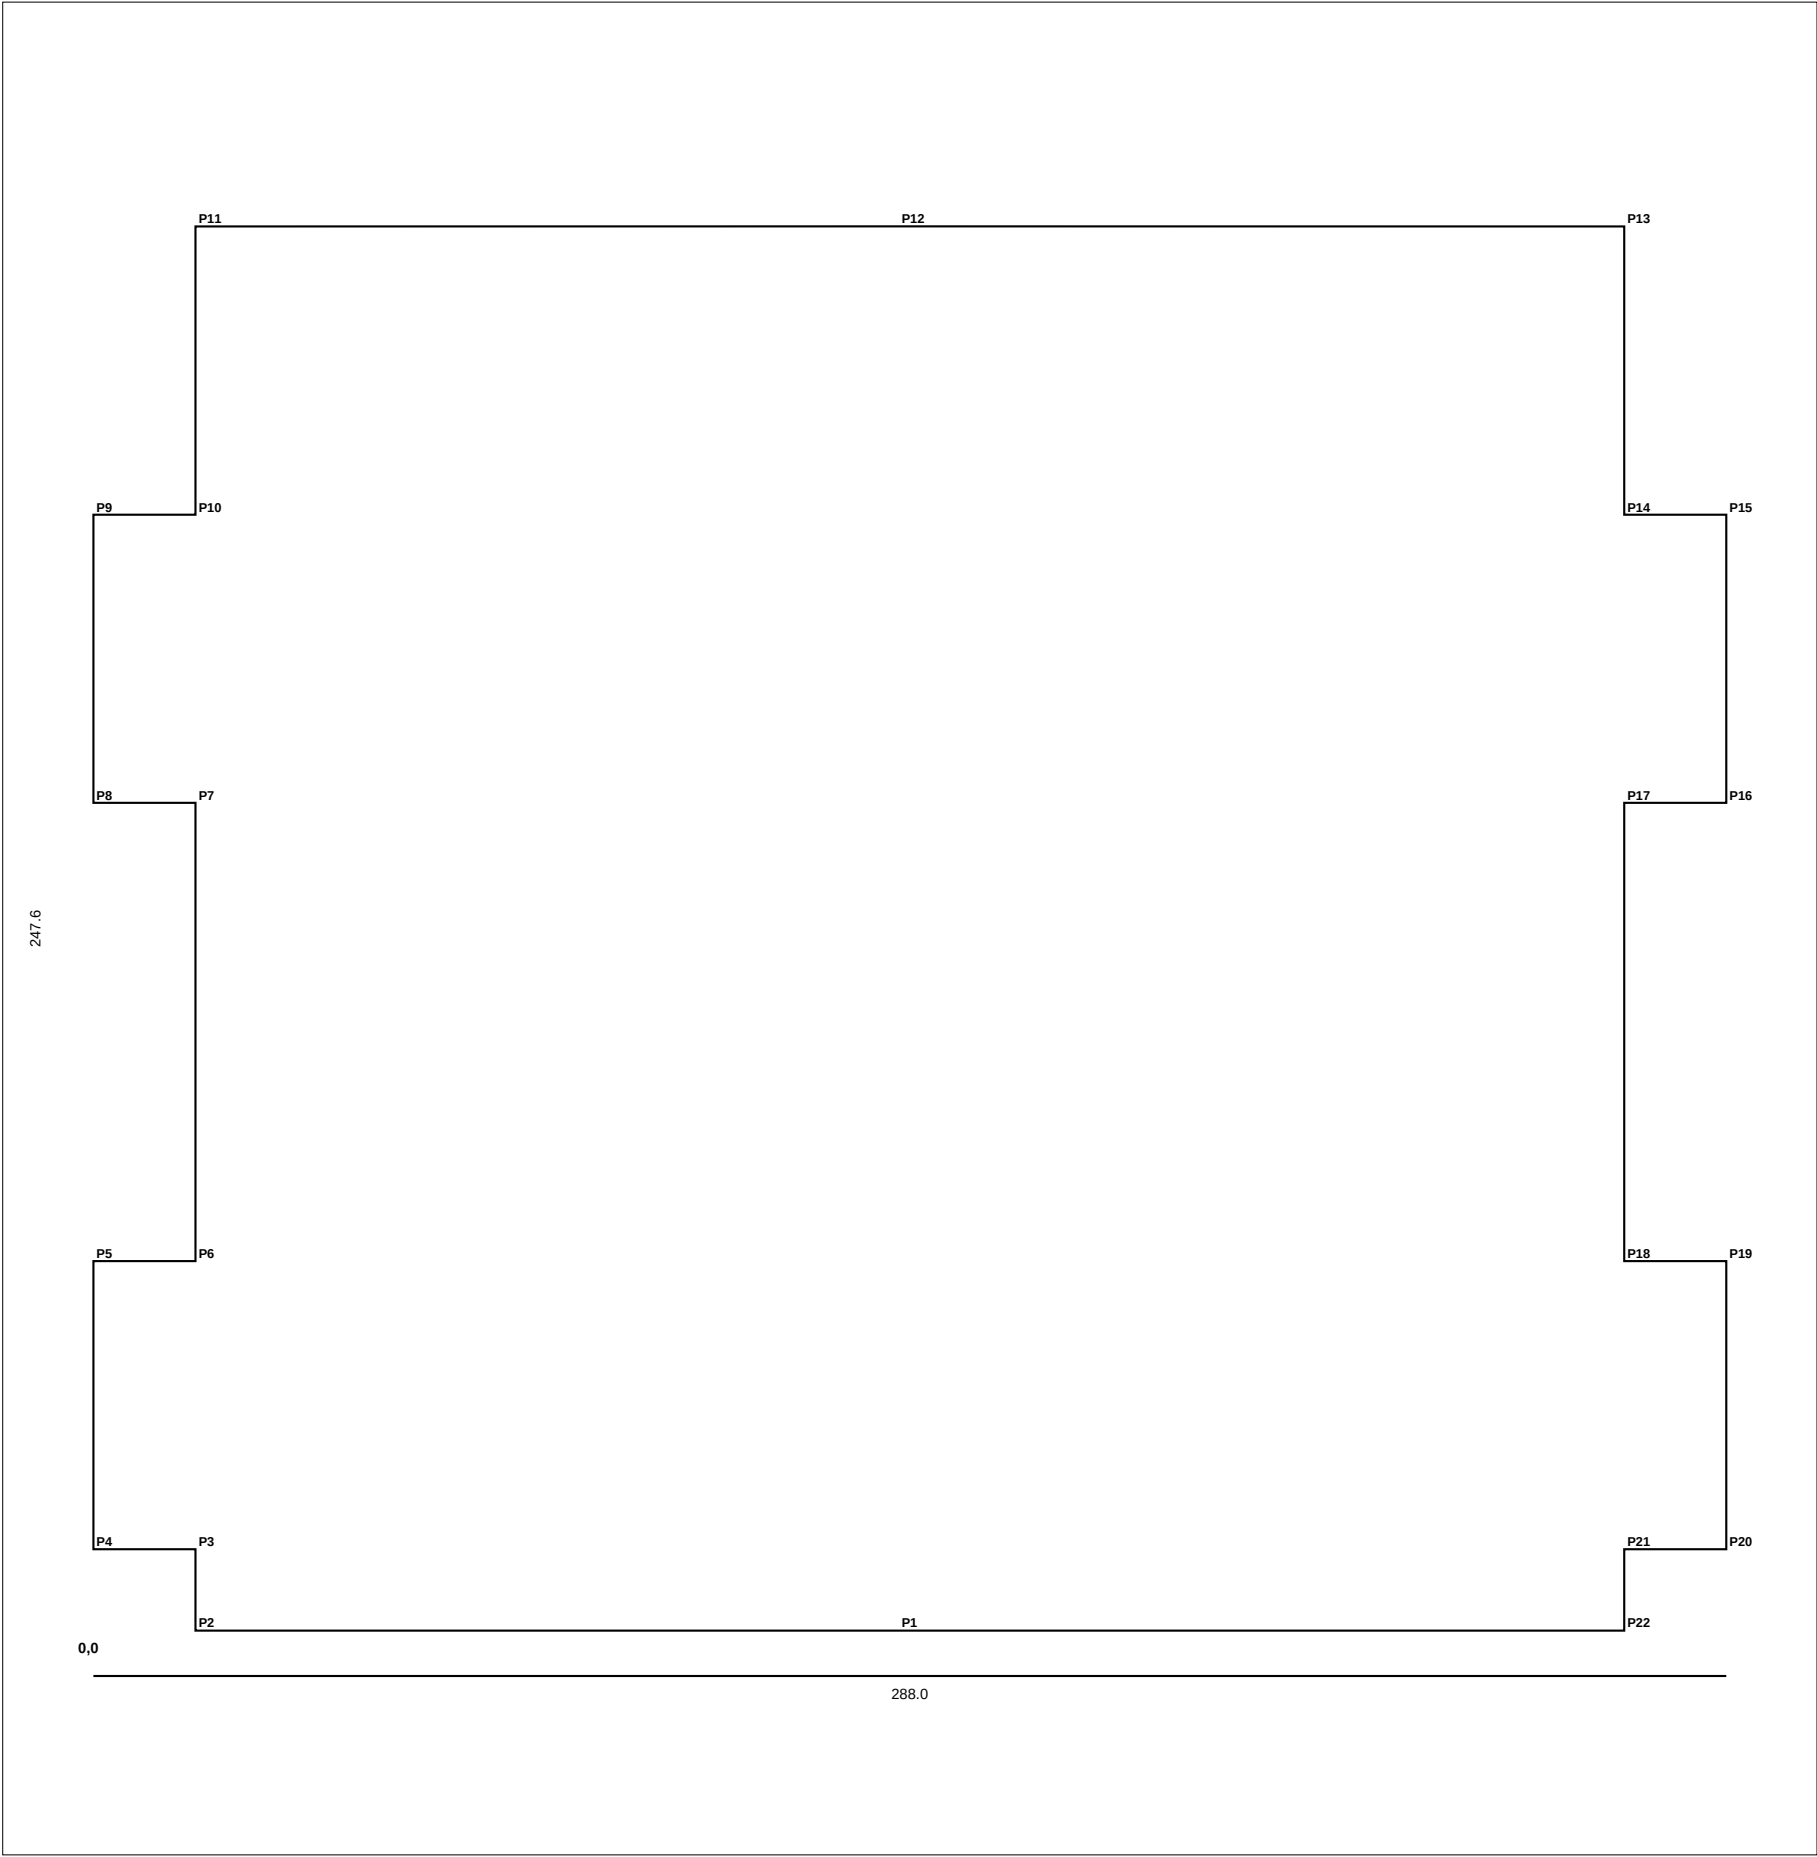

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X142.0 Y0.0 LINE
- P2 X18.0 Y0.0 LINE
- P3 X18.0 Y14.4 LINE
- P4 X0.0 Y14.4 LINE
- P5 X0.0 Y65.2 LINE
- P6 X18.0 Y65.2 LINE
- P7 X18.0 Y146.0 LINE
- P8 X0.0 Y146.0 LINE
- P9 X0.0 Y196.8 LINE
- P10 X18.0 Y196.8 LINE
- P11 X18.0 Y247.6 LINE
- P12 X142.0 Y247.6 LINE
- P13 X270.0 Y247.6 LINE
- P14 X270.0 Y196.7 LINE
- P15 X288.0 Y196.7 LINE
- P16 X288.0 Y145.9 LINE
- P17 X270.0 Y146.0 LINE
- P18 X270.0 Y65.1 LINE
- P19 X288.0 Y65.1 LINE
- P20 X288.0 Y14.3 LINE
- P21 X270.0 Y14.4 LINE
- P22 X270.0 Y0.0 LINE

S3-I - Part detail

Overall 288.0 x 247.6 mm | 18 mm plywood | datum lower-left = X0 Y0

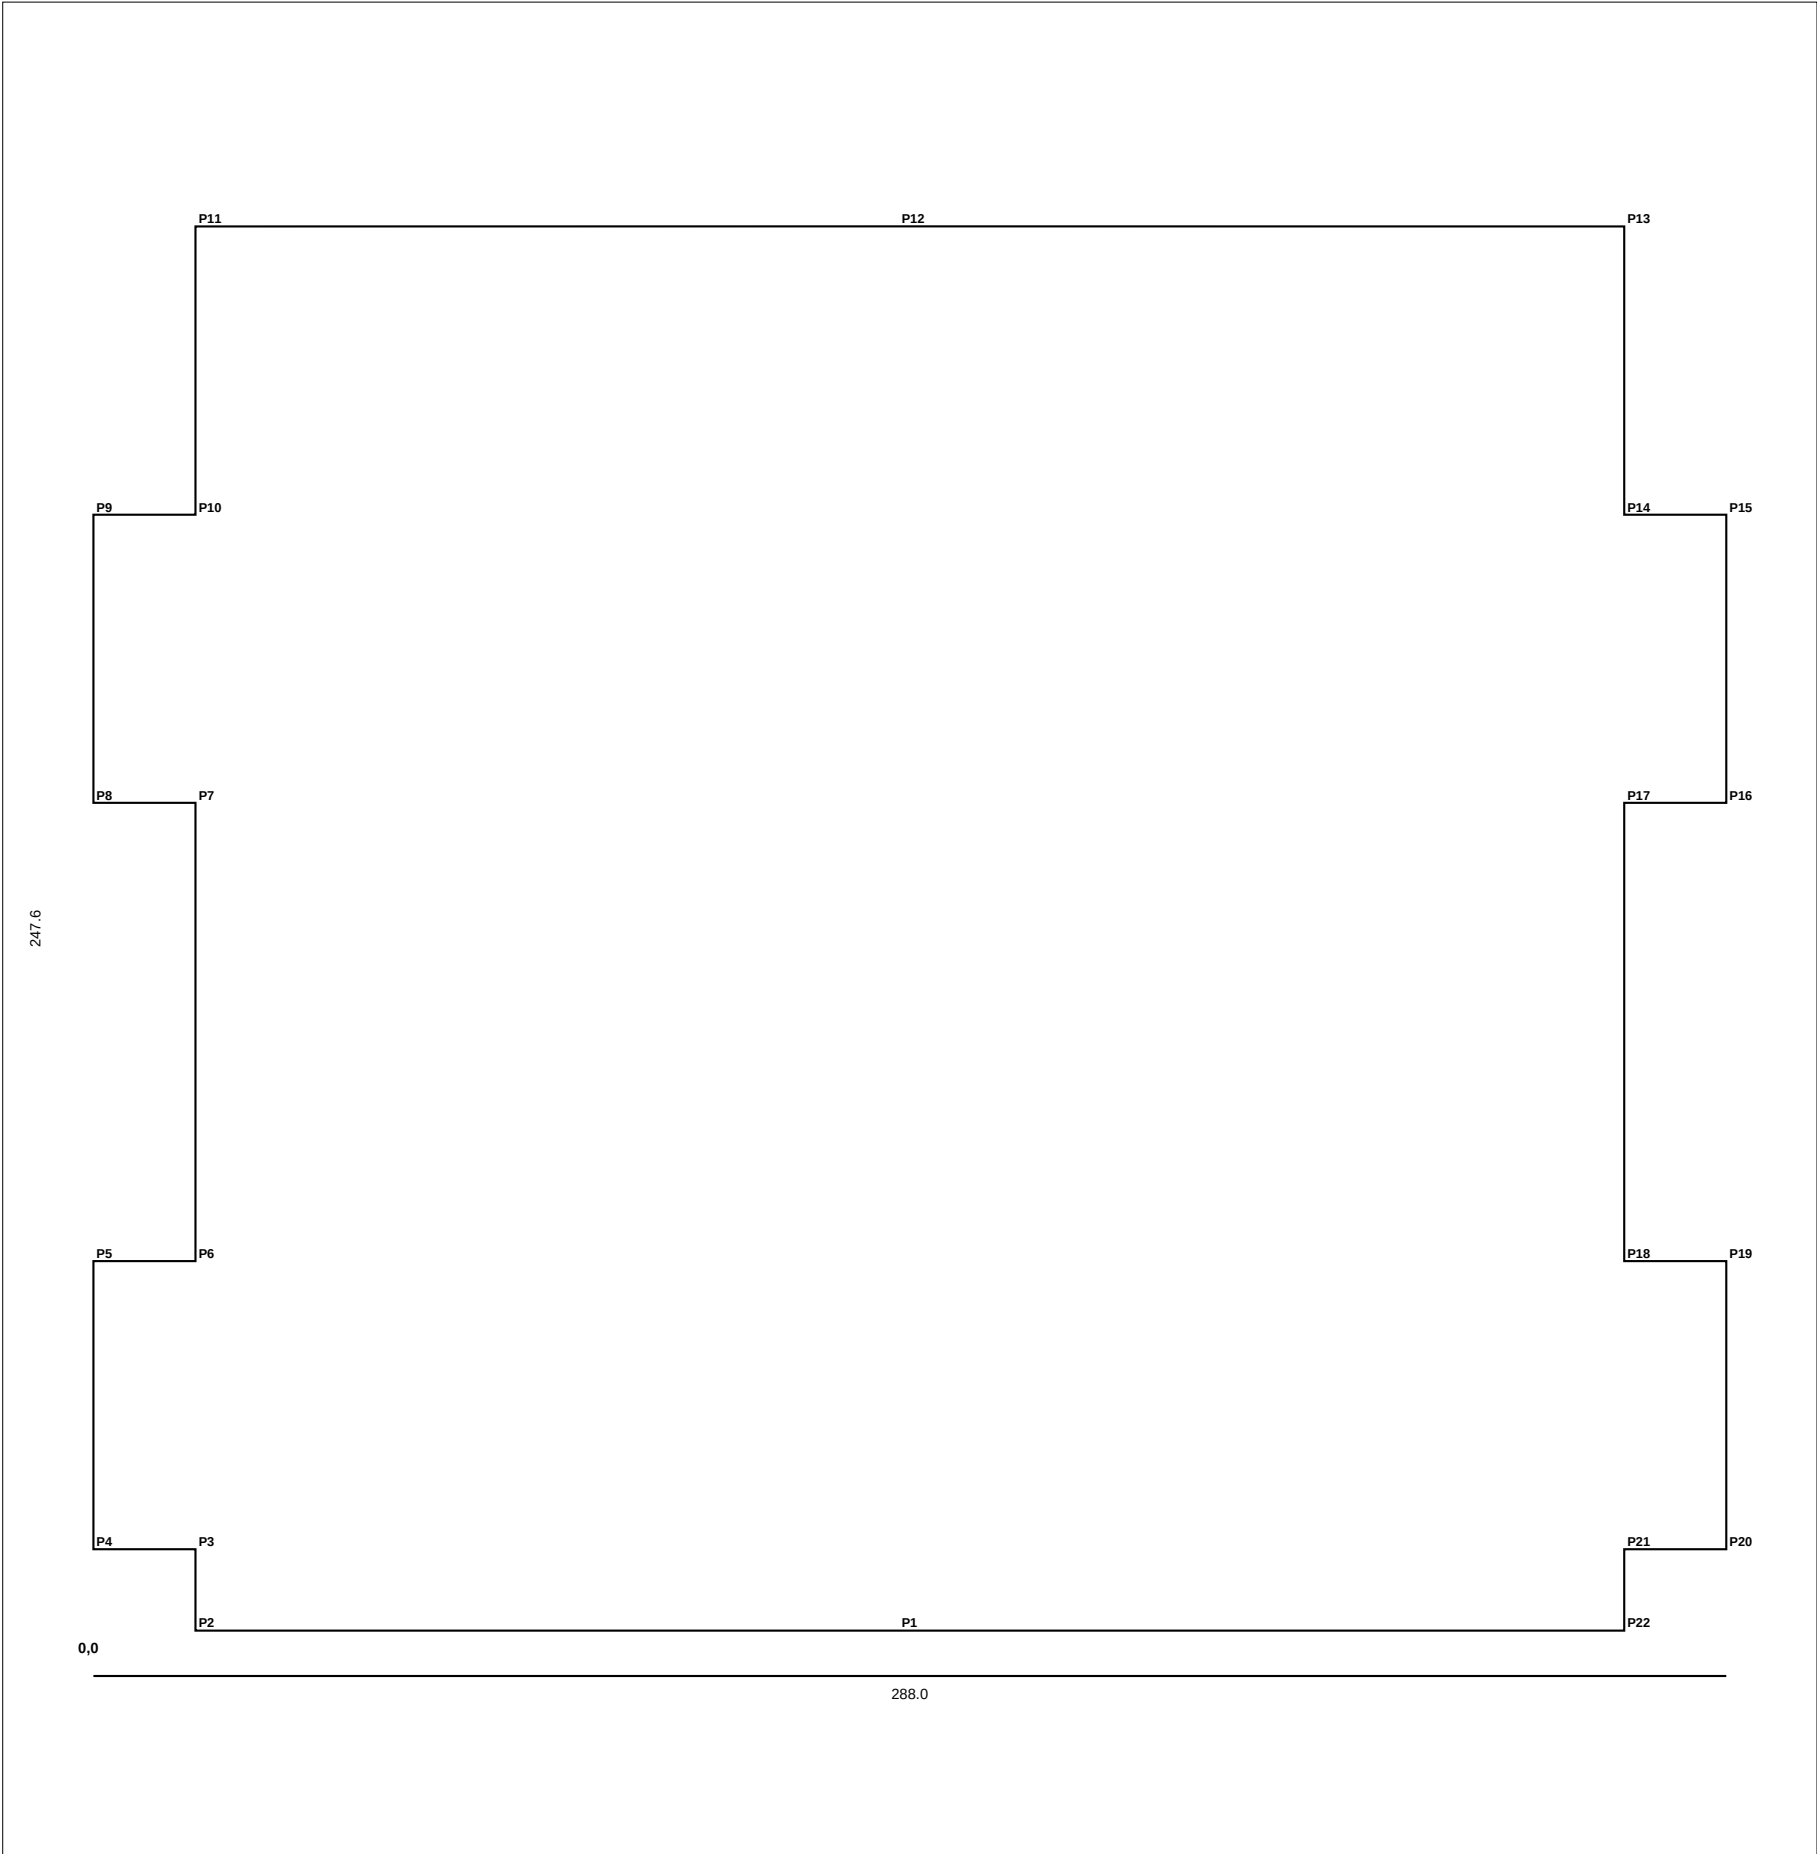

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X142.0 Y0.0 LINE

P2 X18.0 Y0.0 LINE

P3 X18.0 Y14.4 LINE

P4 X0.0 Y14.4 LINE

P5 X0.0 Y65.2 LINE

P6 X18.0 Y65.2 LINE

P7 X18.0 Y146.0 LINE

P8 X0.0 Y146.0 LINE

P9 X0.0 Y196.8 LINE

P10 X18.0 Y196.8 LINE

P11 X18.0 Y247.6 LINE

P12 X142.0 Y247.6 LINE

P13 X270.0 Y247.6 LINE

P14 X270.0 Y196.8 LINE

P15 X288.0 Y196.7 LINE

P16 X288.0 Y145.9 LINE

P17 X270.0 Y145.9 LINE

P18 X270.0 Y65.1 LINE

P19 X288.0 Y65.1 LINE

P20 X288.0 Y14.3 LINE

P21 X270.0 Y14.3 LINE

P22 X270.0 Y0.0 LINE

S3-J - Part detail

Overall 600.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge


Machining features

- F1 slot/cut-out 50.8 x 18.5 X 76.2 Y 27.3
- F2 slot/cut-out 58.5 x 18.5 X 300.0 Y 27.3
- F3 slot/cut-out 50.8 x 18.5 X 523.8 Y 27.3
- F4 Dia 5 x 11 deep X 9.0 Y 50.8
- F5 slot/cut-out 18.5 x 50.8 X 300.0 Y 76.2
- F6 slot/cut-out 18.5 x 50.8 X 581.7 Y 76.2
- F7 slot/cut-out 18.5 x 50.8 X 581.8 Y 207.8
- F8 slot/cut-out 18.5 x 50.8 X 300.0 Y 207.8
- F9 Dia 5 x 11 deep X 9.0 Y 233.2

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X0.0 Y284.0 LINE
- P3 X22.7 Y283.9 ARC R30.0 CW
- P4 X50.8 Y254.0 LINE
- P5 X50.8 Y80.9 ARC R30.0 CCW
- P6 X80.8 Y50.8 LINE
- P7 X237.4 Y50.8 ARC R14.9 CCW
- P8 X251.9 Y63.8 LINE
- P9 X268.4 Y256.7 ARC R32.2 CW
- P10 X331.4 Y258.6 LINE
- P11 X348.3 Y62.4 ARC R15.0 CCW
- P12 X363.0 Y50.8 LINE
- P13 X521.1 Y50.9 ARC R30.0 CCW
- P14 X549.2 Y79.8 LINE
- P15 X549.2 Y253.9 ARC R30.0 CW
- P16 X577.2 Y283.9 LINE
- P17 X600.0 Y284.0 LINE
- P18 X600.0 Y0.0 LINE

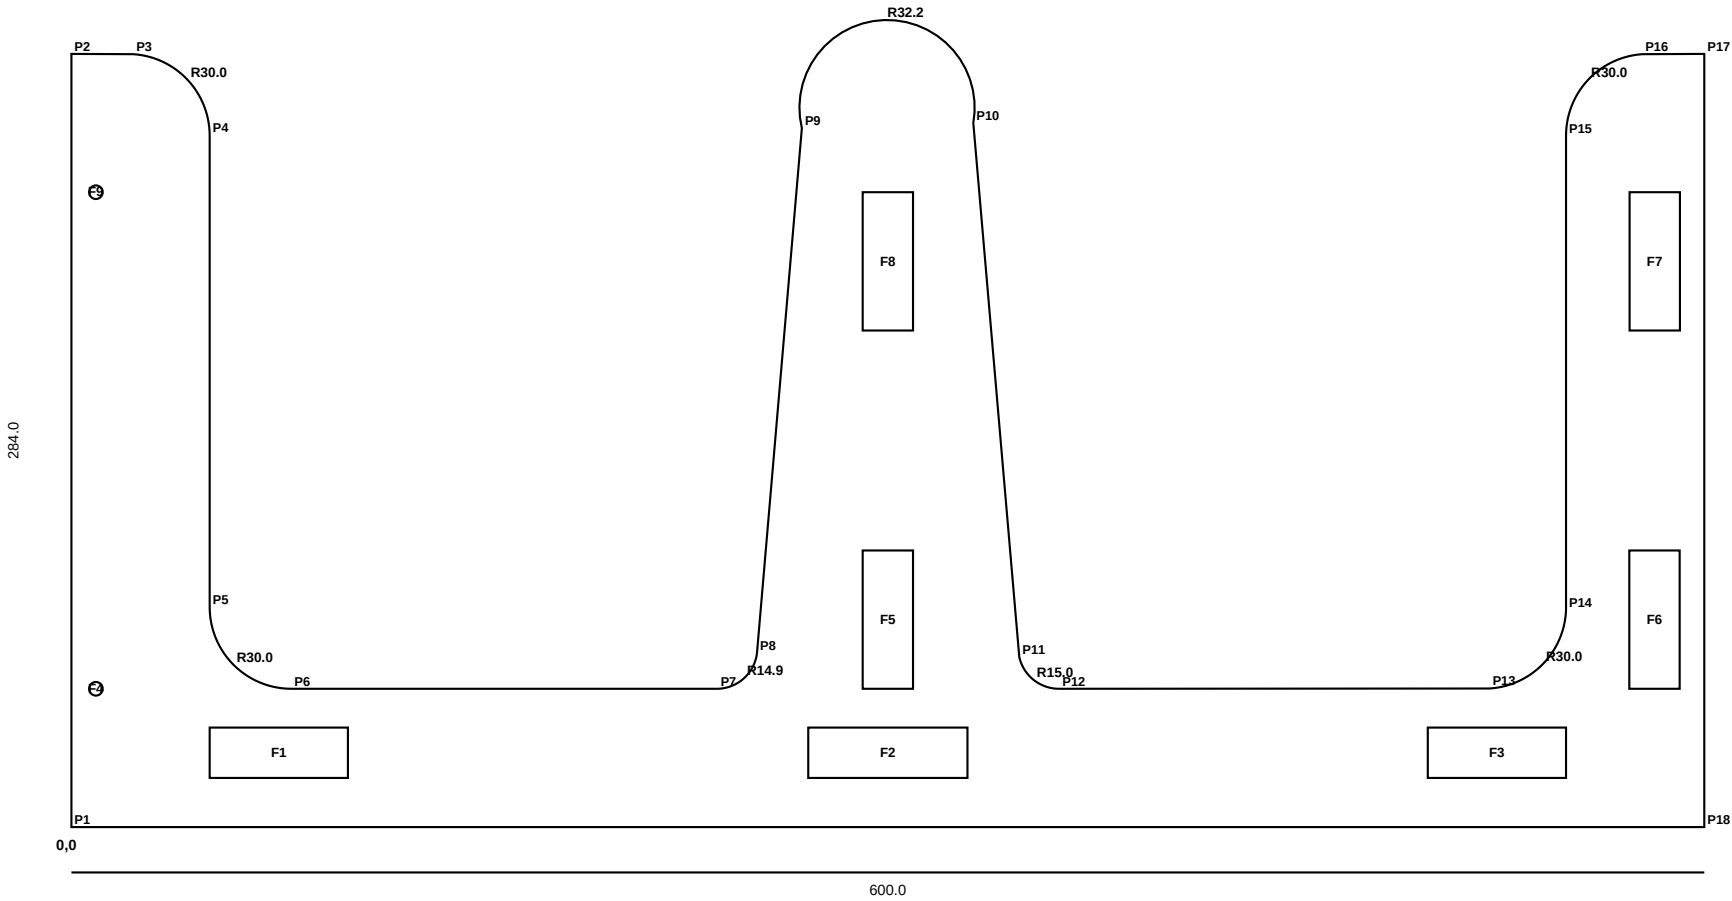

S3-K - Part detail

Overall 600.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 slot/cut-out 50.8 x 18.5 X 75.8 Y 27.3
- F2 slot/cut-out 58.5 x 18.5 X 299.6 Y 27.3
- F3 slot/cut-out 50.8 x 18.5 X 523.4 Y 27.3
- F4 Dia 5 x 11 deep X 591.0 Y 50.8
- F5 slot/cut-out 18.5 x 50.8 X 17.8 Y 76.2
- F6 slot/cut-out 18.5 x 50.8 X 299.6 Y 76.2
- F7 slot/cut-out 18.5 x 50.8 X 17.8 Y 207.8
- F8 slot/cut-out 18.5 x 50.8 X 299.6 Y 207.8
- F9 Dia 5 x 11 deep X 591.0 Y 233.2

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X600.0 Y284.0 LINE
 - P2 X600.0 Y0.0 LINE
 - P3 X0.0 Y0.0 LINE
 - P4 X0.0 Y284.0 LINE

