

VW-T5-6-SWB-BENCHES

Coordinate system

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Example: X100 / Y50 = 100 mm right from the left edge, then 50 mm up from the bottom.

Rules


- 18 mm plywood
- Dia 5 = 11 mm deep; nominal 8.8/8.9 edge positions shown as 9 mm
- Dia 15 = 14 mm deep
- Dia 20 = THROUGH
- Dia 35 = 13 mm deep
- Rounded slots/cut-outs show their useful manual-cutting radius
- 5 mm / 15 mm fixing holes may be omitted when using L-brackets or timber blocks.


8 mm cam-fitting edge holes


Where a 15 mm cam-lock hole is shown, drill an 8 mm hole centrally through the edge of the mating side panel using a self-centring jig with an 8 mm guide.
Align the 8 mm hole with the centre of the 15 mm cam-lock bore.

Sheet structure

- Sheet 1: 7 panels
- Sheet 2: 10 panels
- Sheet 3: 3 panels
- Total: 20 panels

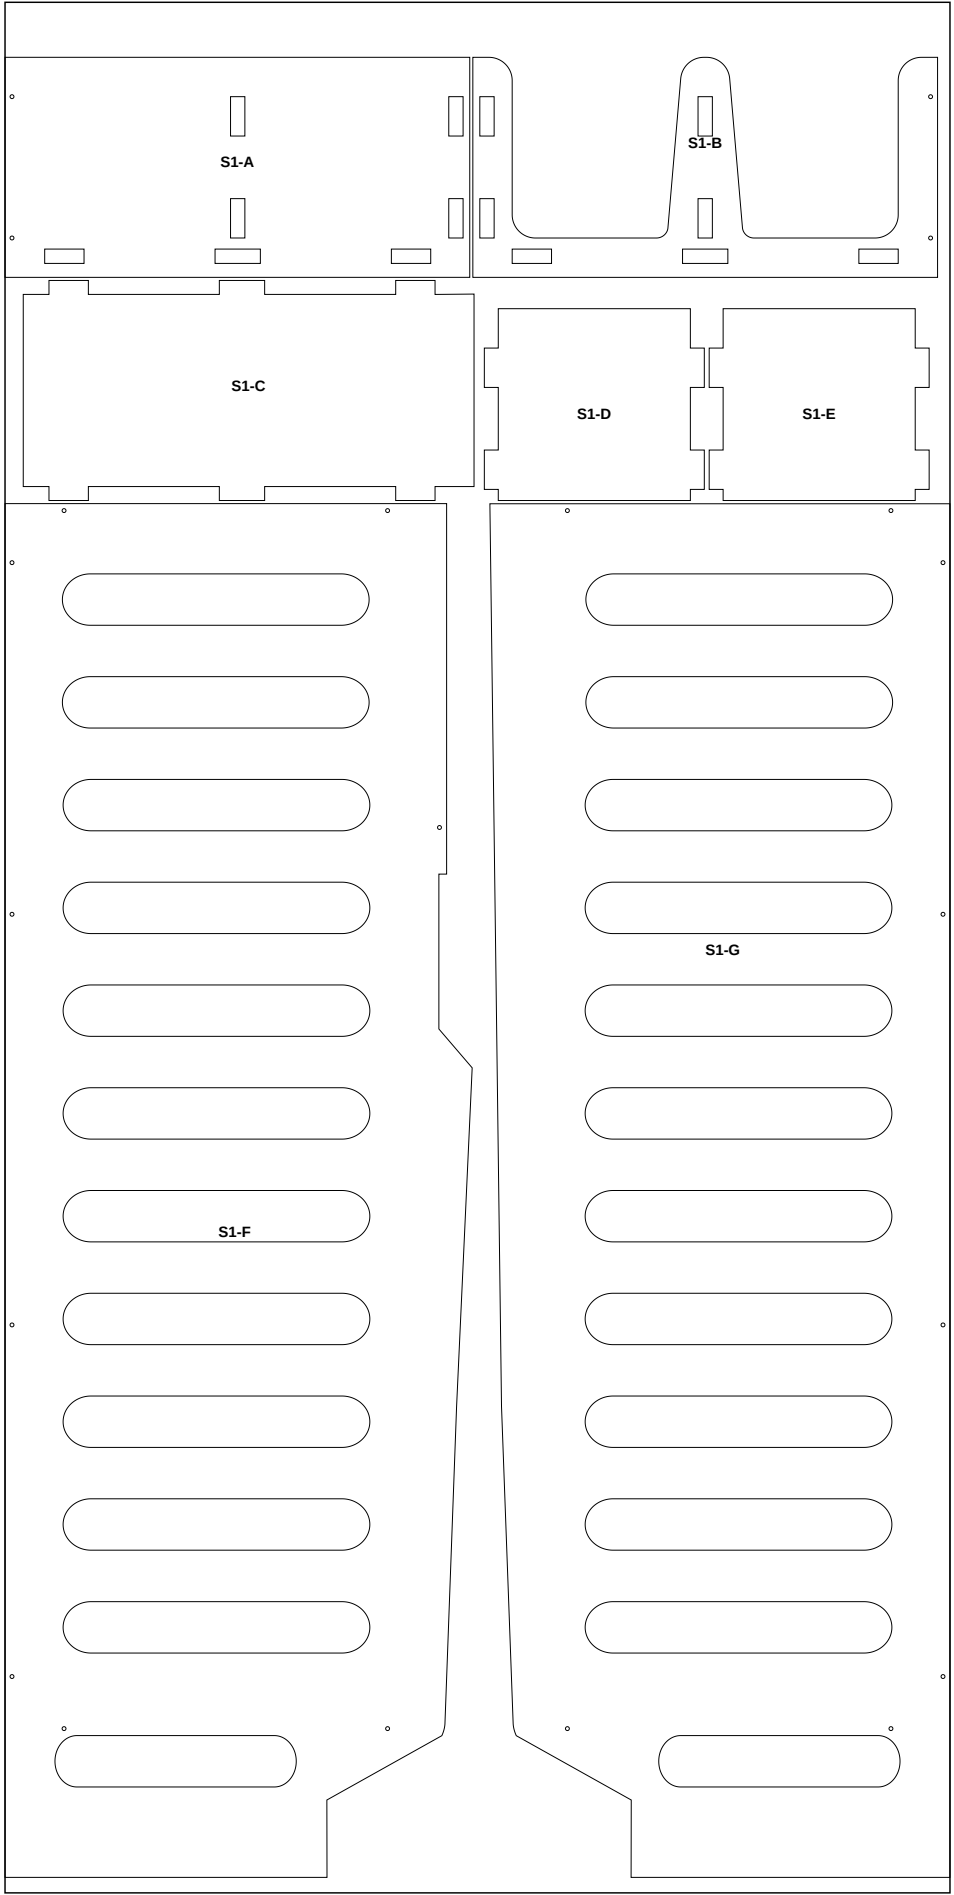


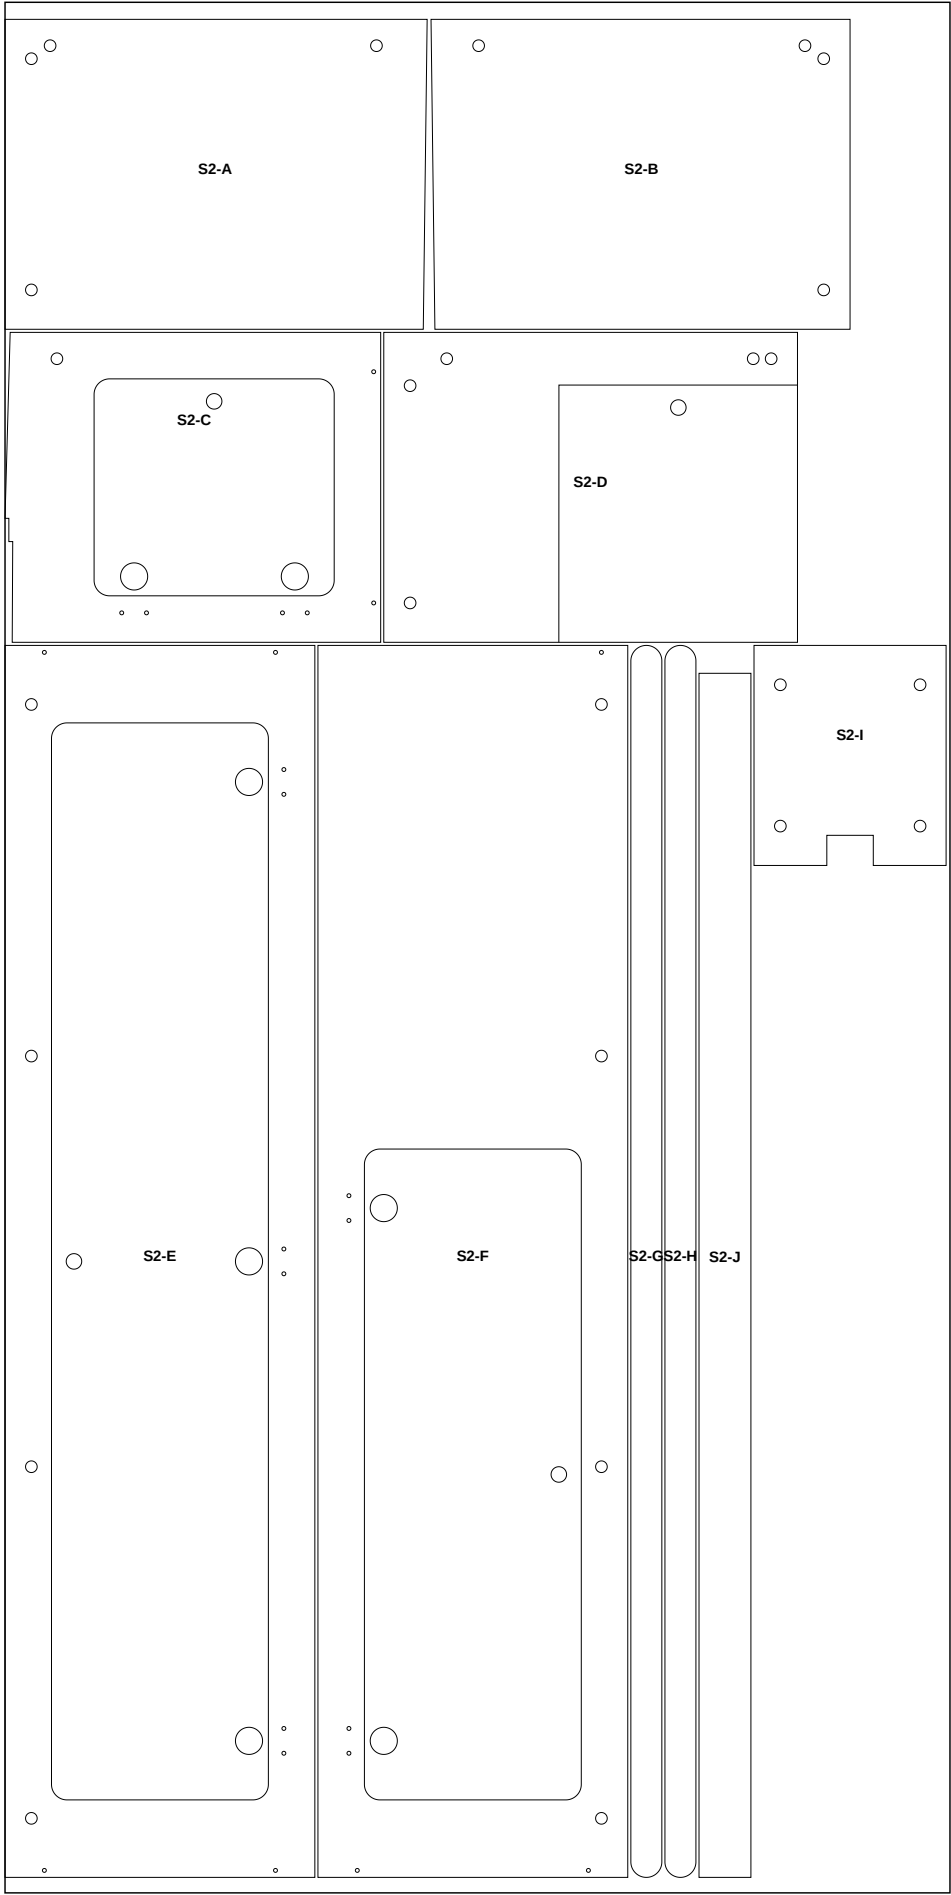

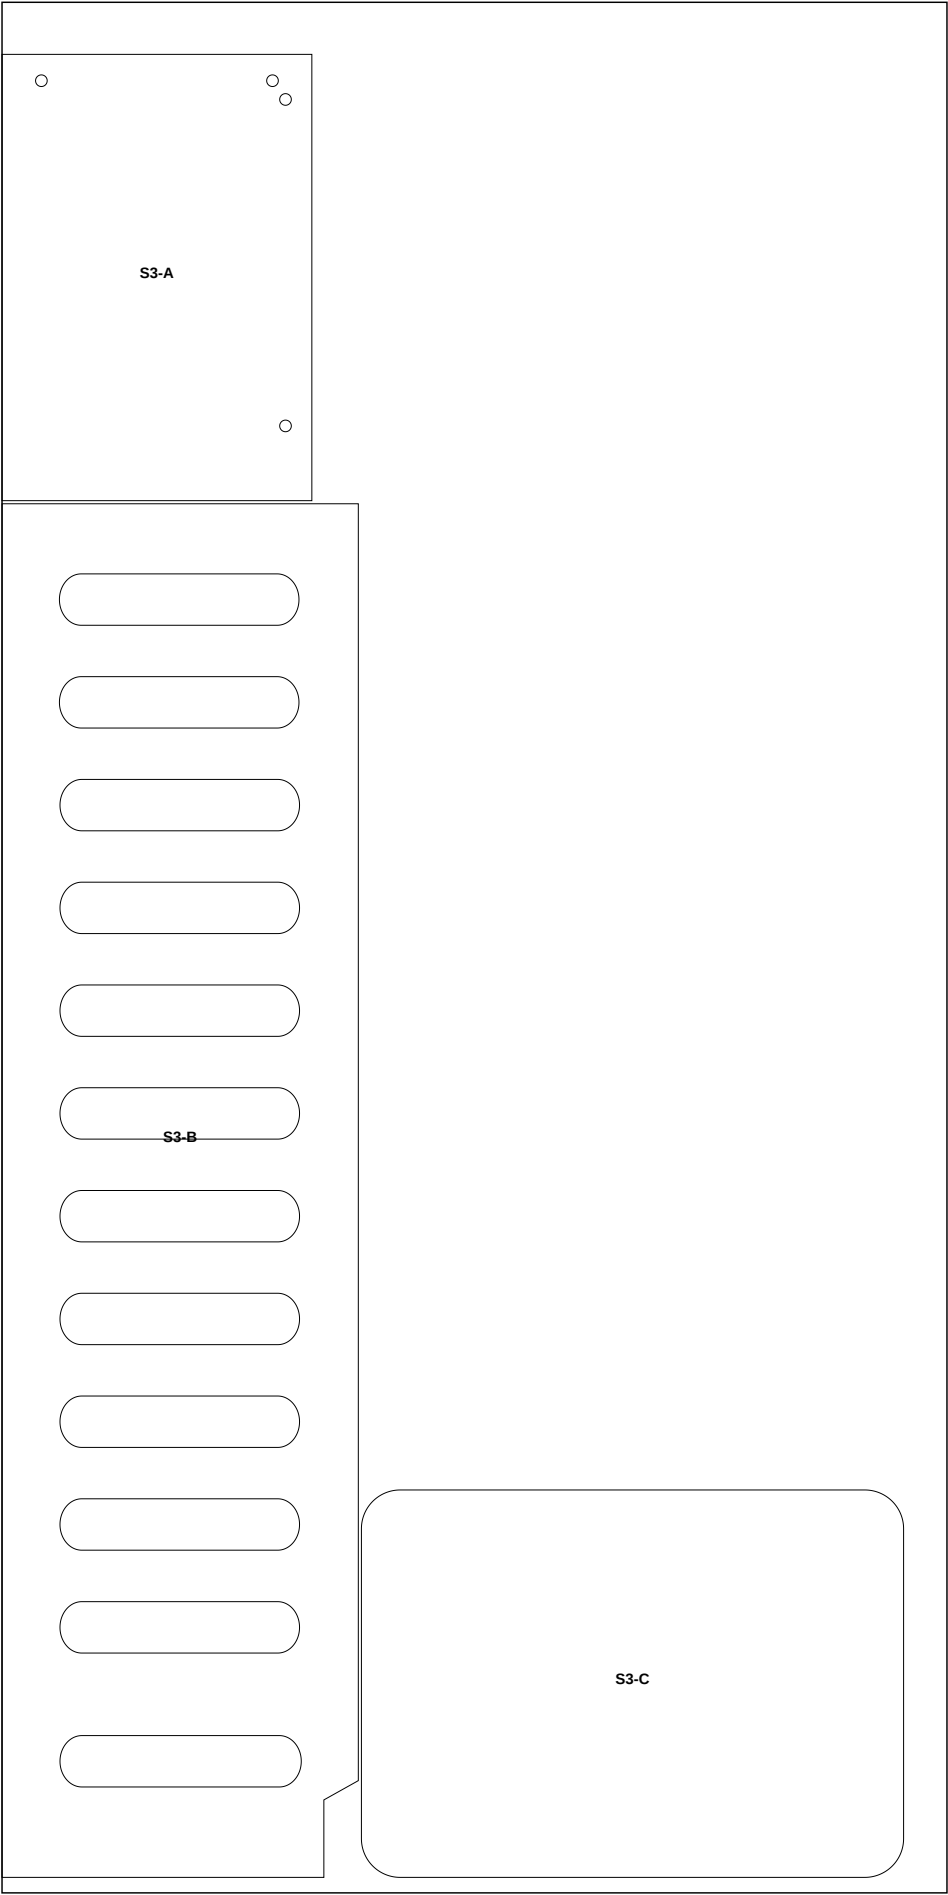

S1-A - Part detail

Overall 600.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

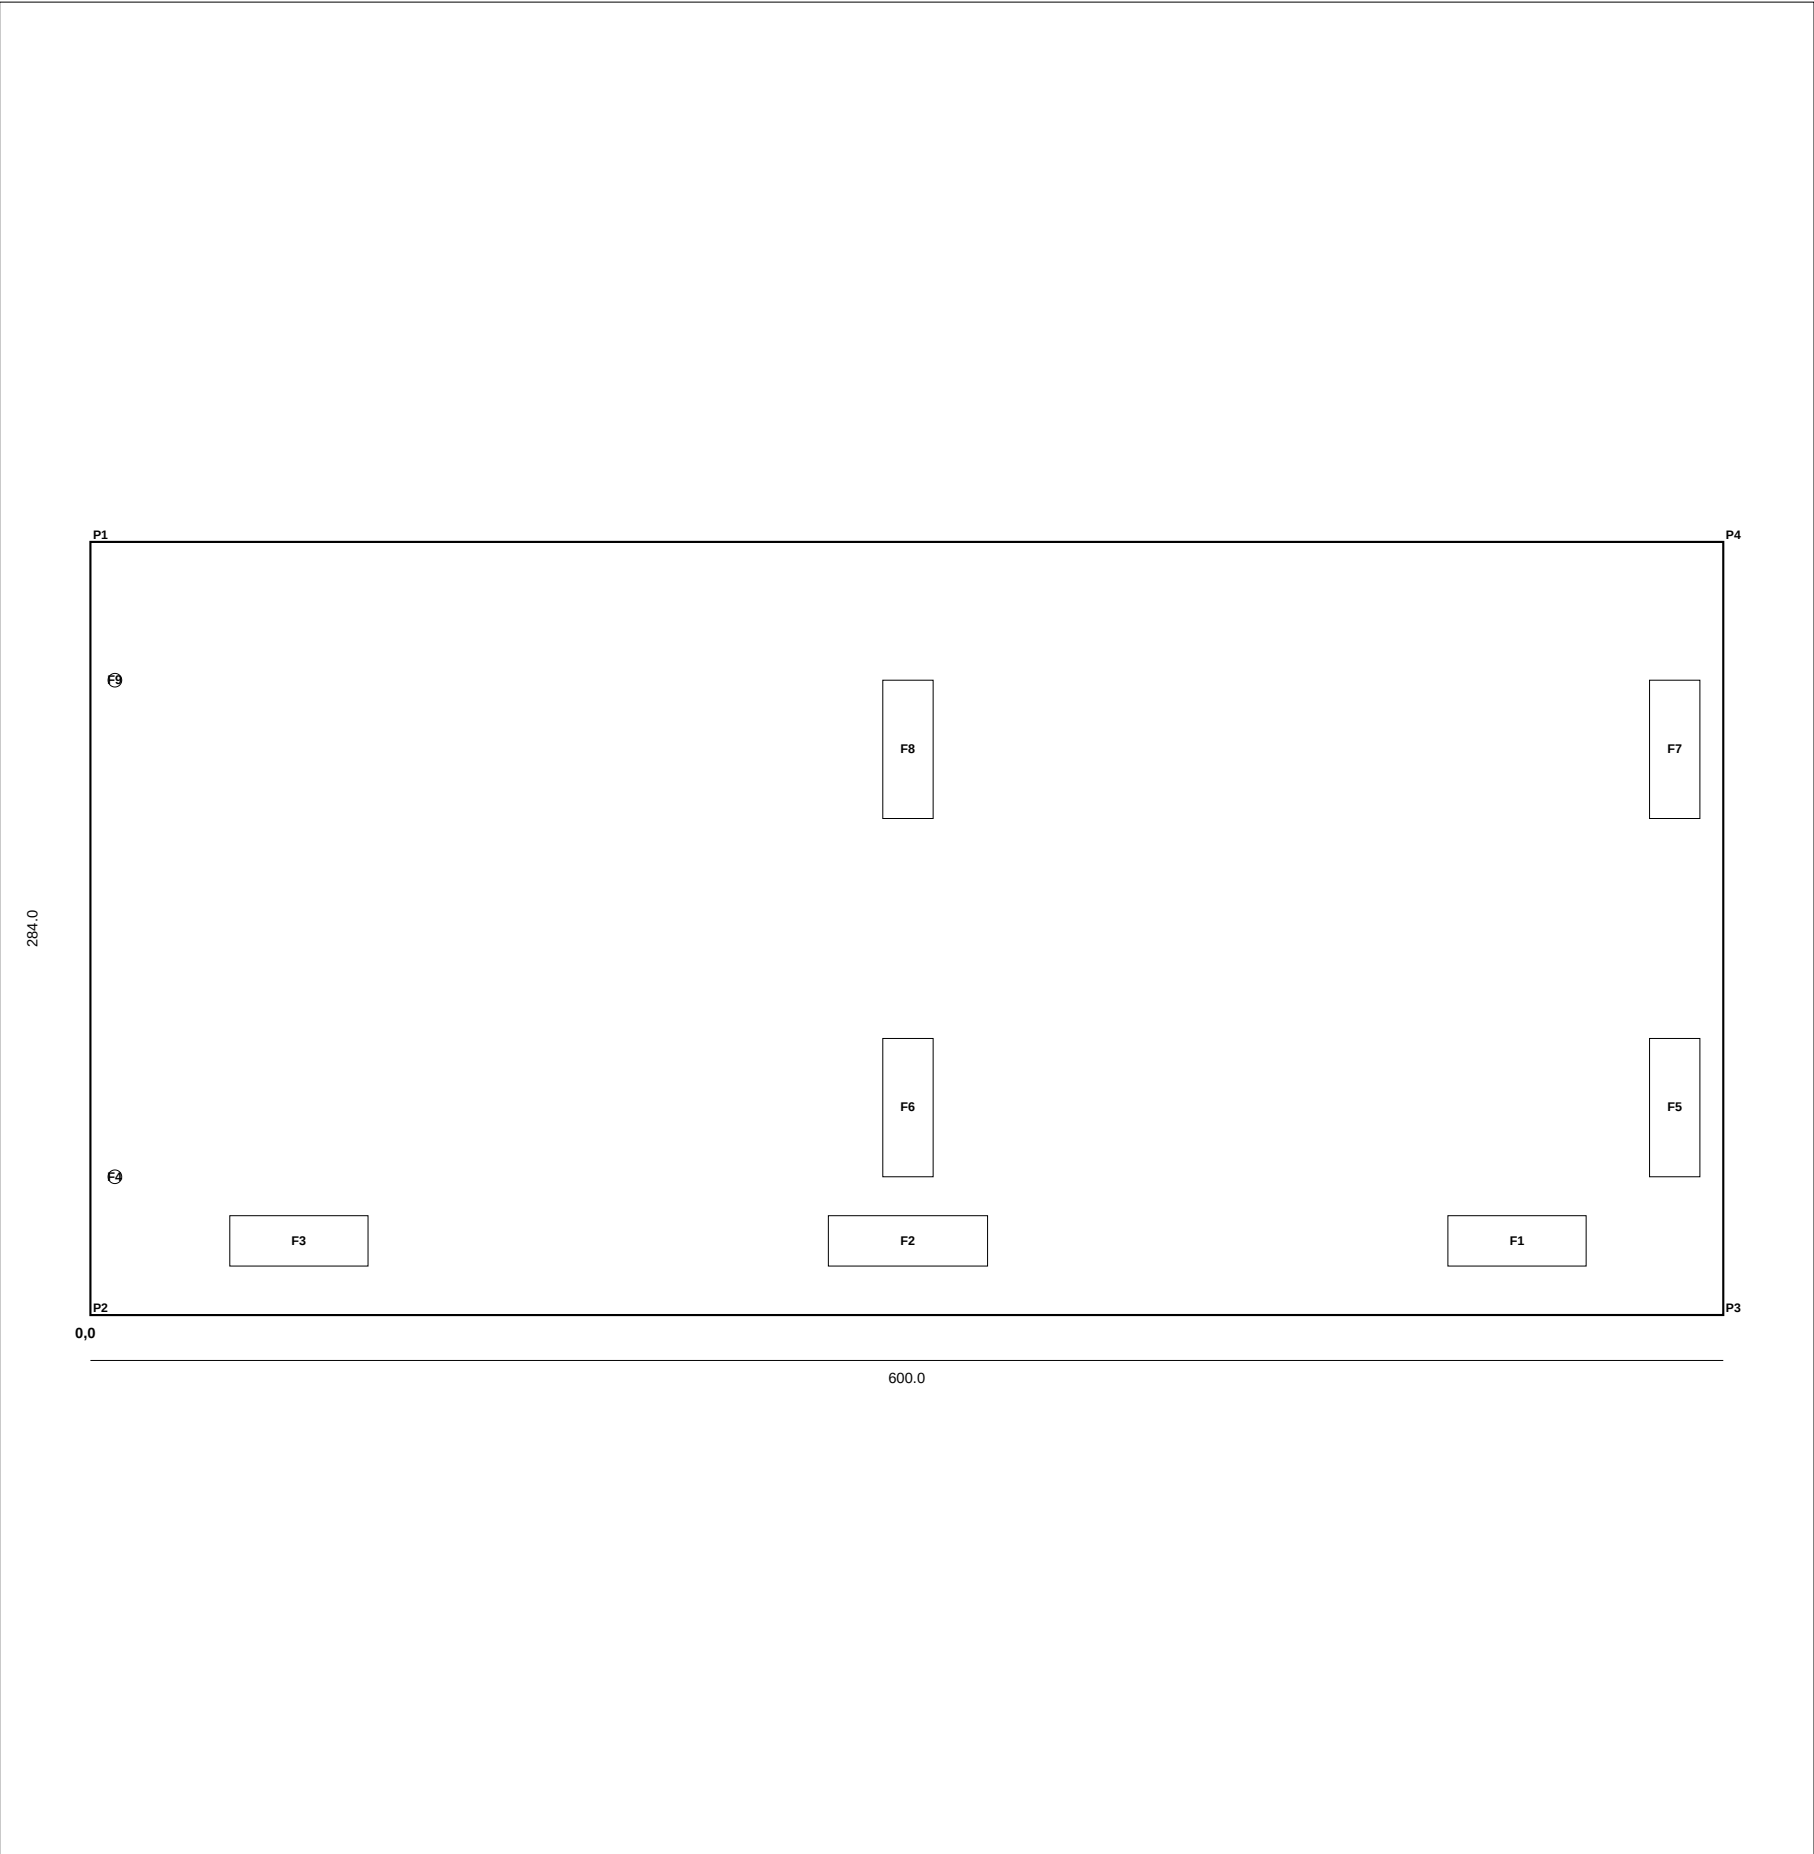

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 cut-out 50.8 x 18.5 X 524.2 Y 27.3
- F2 cut-out 58.5 x 18.5 X 300.4 Y 27.3
- F3 cut-out 50.8 x 18.5 X 76.6 Y 27.3
- F4 Dia 5 x 11 deep X 9.0 Y 50.8
- F5 cut-out 18.5 x 50.8 X 582.2 Y 76.2
- F6 cut-out 18.5 x 50.8 X 300.4 Y 76.2
- F7 cut-out 18.5 x 50.8 X 582.2 Y 207.8
- F8 cut-out 18.5 x 50.8 X 300.4 Y 207.8
- F9 Dia 5 x 11 deep X 9.0 Y 233.2

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y284.0 LINE
 - P2 X0.0 Y0.0 LINE
 - P3 X600.0 Y0.0 LINE
 - P4 X600.0 Y284.0 LINE

S1-B - Part detail

Overall 600.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge


Machining features

- F1 cut-out 58.5 x 18.5 X 300.0 Y 27.2
- F2 cut-out 50.8 x 18.5 X 76.2 Y 27.2
- F3 cut-out 50.8 x 18.5 X 523.8 Y 27.3
- F4 Dia 5 x 11 deep X 591.0 Y 50.8
- F5 cut-out 18.5 x 50.8 X 300.0 Y 76.2
- F6 cut-out 18.5 x 50.8 X 18.2 Y 76.2
- F7 cut-out 18.5 x 50.8 X 18.3 Y 207.8
- F8 cut-out 18.5 x 50.8 X 300.0 Y 207.8
- F9 Dia 5 x 11 deep X 591.0 Y 233.2

Outer profile cuts


P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y284.0 LINE
- P2 X0.0 Y0.0 LINE
- P3 X600.0 Y0.0 LINE
- P4 X600.0 Y284.0 LINE
- P5 X579.3 Y284.0 ARC R30
- P6 X549.2 Y254.0 LINE
- P7 X549.2 Y80.9 ARC R30
- P8 X519.2 Y50.8 LINE
- P9 X363.0 Y50.8 ARC R14.9
- P10 X348.1 Y64.5 LINE
- P11 X331.6 Y256.7 ARC R30
- P12 X301.7 Y284.0 LINE
- P13 X298.4 Y284.0 ARC R30
- P14 X268.4 Y256.6 LINE
- P15 X251.9 Y64.5 ARC R14.9
- P16 X237.0 Y50.8 LINE
- P17 X80.9 Y50.8 ARC R30
- P18 X50.8 Y80.8 LINE
- P19 X50.8 Y253.9 ARC R30
- P20 X20.8 Y284.0 LINE

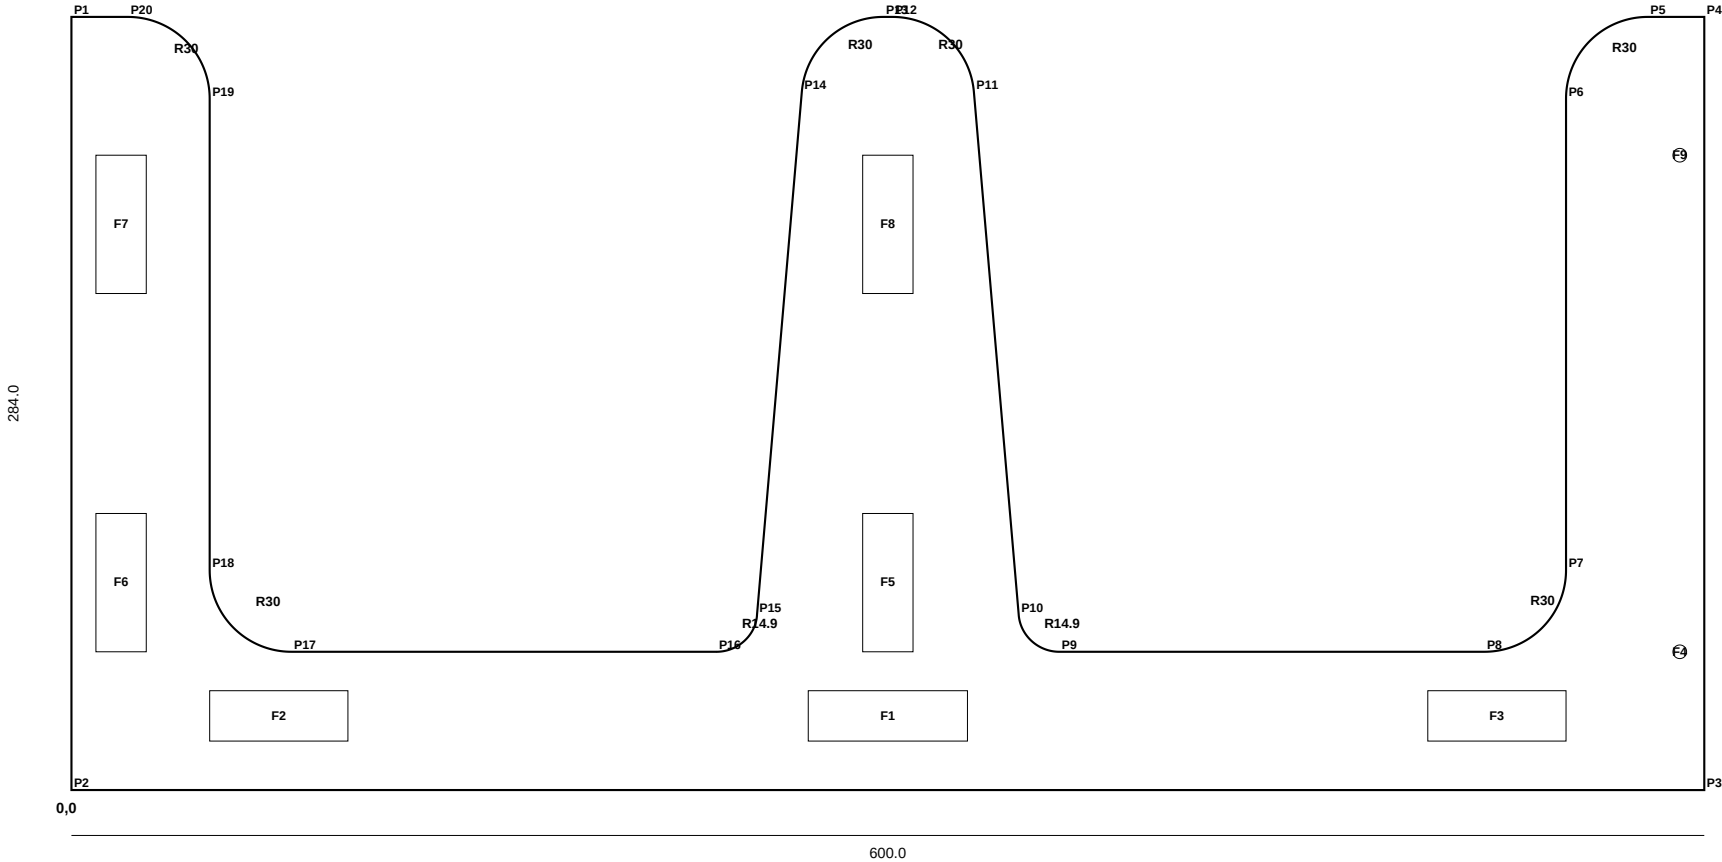

S1-C - Part detail

Overall 582.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

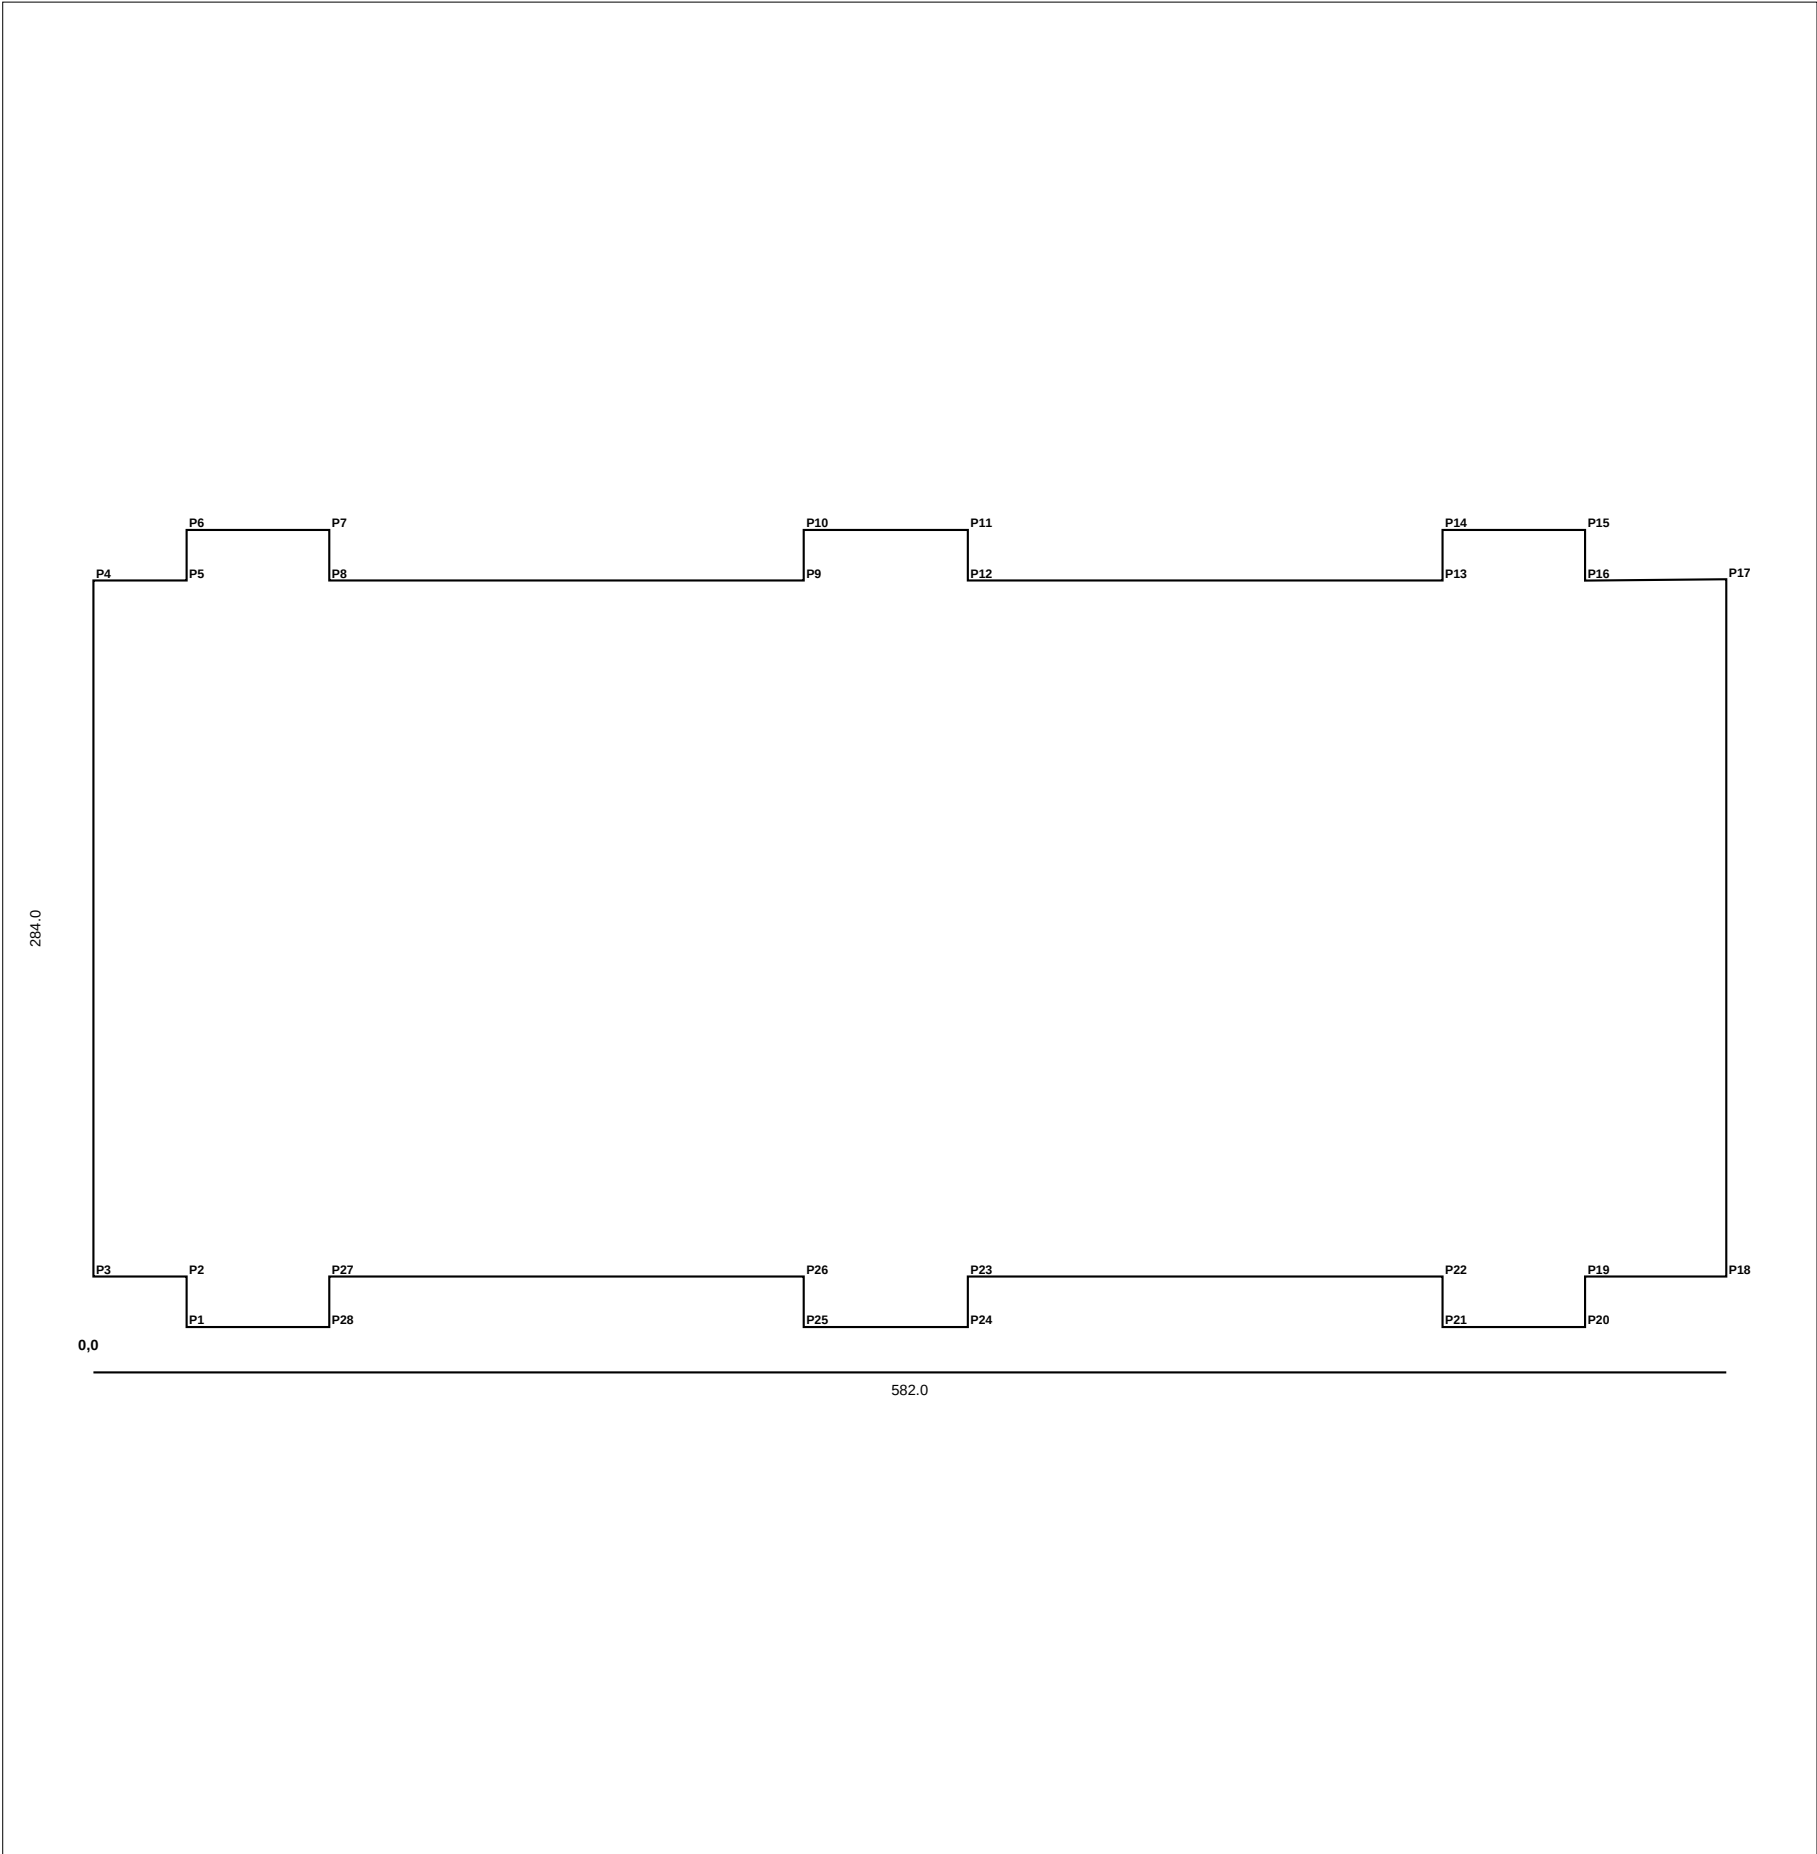

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X33.2 Y0.0 LINE

P2 X33.2 Y18.0 LINE

P3 X0.0 Y18.0 LINE

P4 X0.0 Y266.0 LINE

P5 X33.2 Y266.0 LINE

P6 X33.2 Y284.0 LINE

P7 X84.1 Y284.0 LINE

P8 X84.1 Y266.0 LINE

P9 X253.2 Y266.0 LINE

P10 X253.2 Y284.0 LINE

P11 X311.7 Y284.0 LINE

P12 X311.7 Y266.0 LINE

P13 X480.9 Y266.0 LINE

P14 X480.9 Y284.0 LINE

P15 X531.7 Y284.0 LINE

P16 X531.7 Y266.0 LINE

P17 X582.0 Y266.4 LINE

P18 X582.0 Y18.0 LINE

P19 X531.7 Y18.0 LINE

P20 X531.7 Y0.0 LINE

P21 X480.9 Y0.0 LINE

P22 X480.9 Y18.0 LINE

P23 X311.7 Y18.0 LINE

P24 X311.7 Y0.0 LINE

P25 X253.2 Y0.0 LINE


P26 X253.2 Y18.0 LINE

P27 X84.1 Y18.0 LINE

P28 X84.1 Y0.0 LINE

S1-D - Part detail

Overall 284.0 x 247.6 mm | 18 mm plywood | datum lower-left = X0 Y0

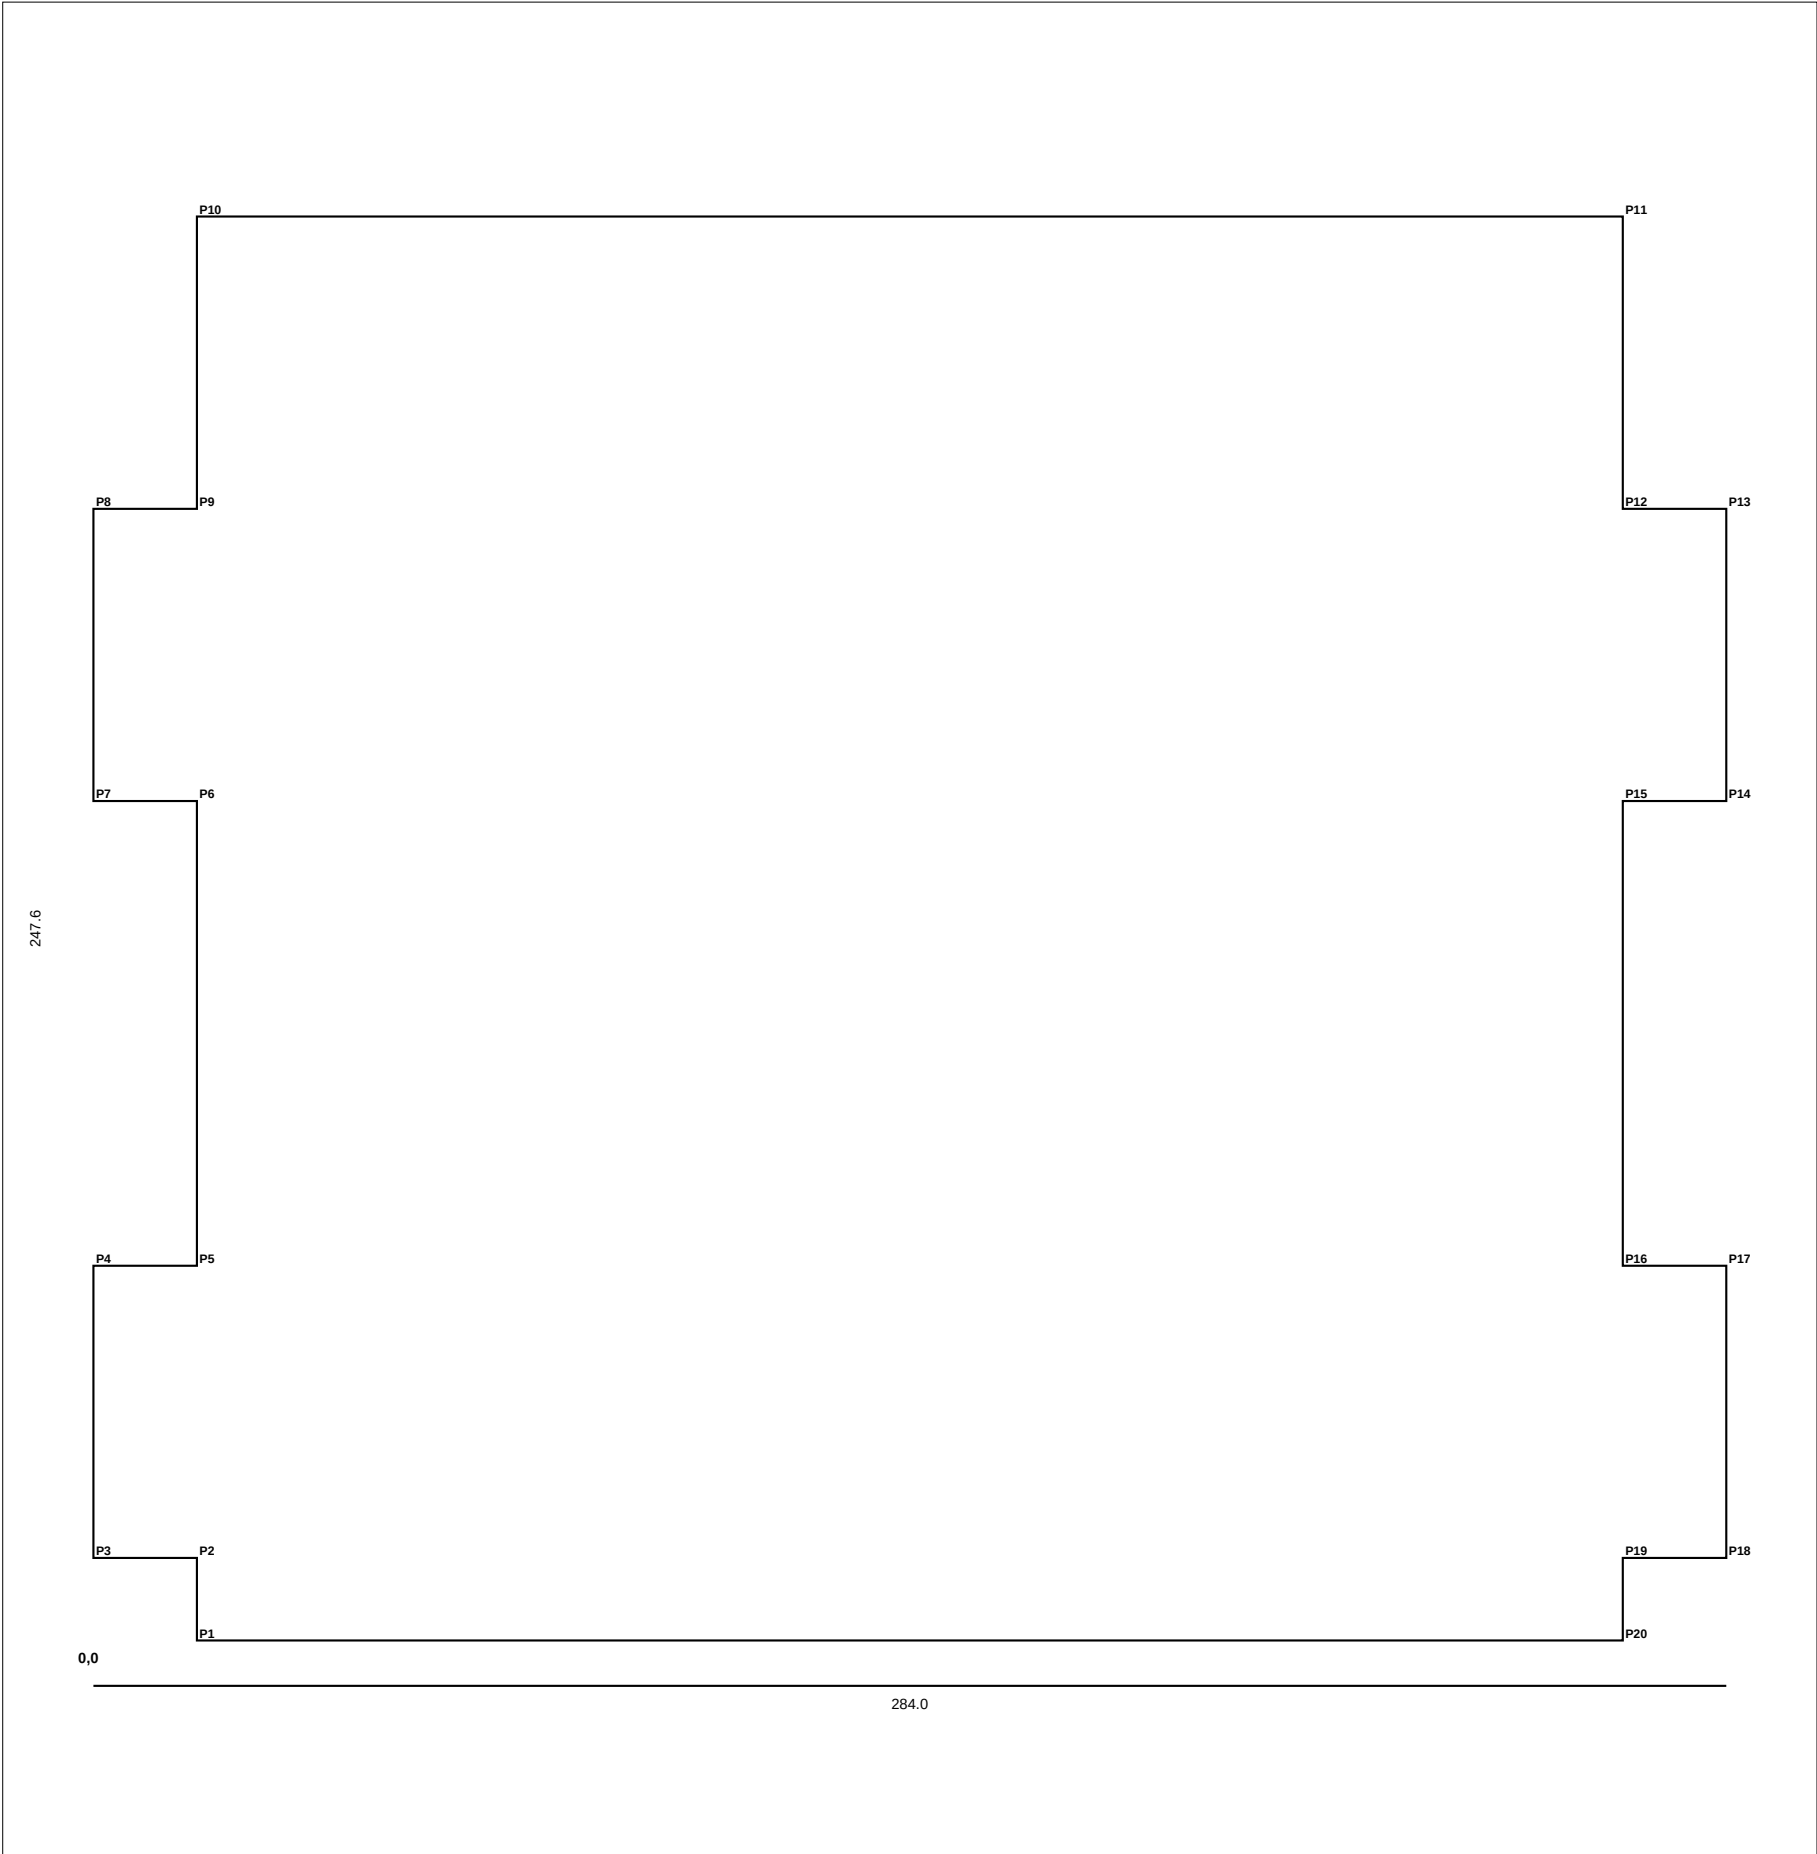

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X18.0 Y0.0 LINE

P2 X18.0 Y14.3 LINE

P3 X0.0 Y14.3 LINE

P4 X0.0 Y65.1 LINE

P5 X18.0 Y65.2 LINE

P6 X18.0 Y146.0 LINE

P7 X0.0 Y145.9 LINE

P8 X0.0 Y196.7 LINE

P9 X18.0 Y196.8 LINE

P10 X18.0 Y247.6 LINE

P11 X266.0 Y247.6 LINE

P12 X266.0 Y196.7 LINE

P13 X284.0 Y196.7 LINE

P14 X284.0 Y145.9 LINE

P15 X266.0 Y146.0 LINE

P16 X266.0 Y65.1 LINE

P17 X284.0 Y65.1 LINE


P18 X284.0 Y14.3 LINE

P19 X266.0 Y14.3 LINE

P20 X266.0 Y0.0 LINE

S1-E - Part detail

Overall 284.0 x 247.6 mm | 18 mm plywood | datum lower-left = X0 Y0

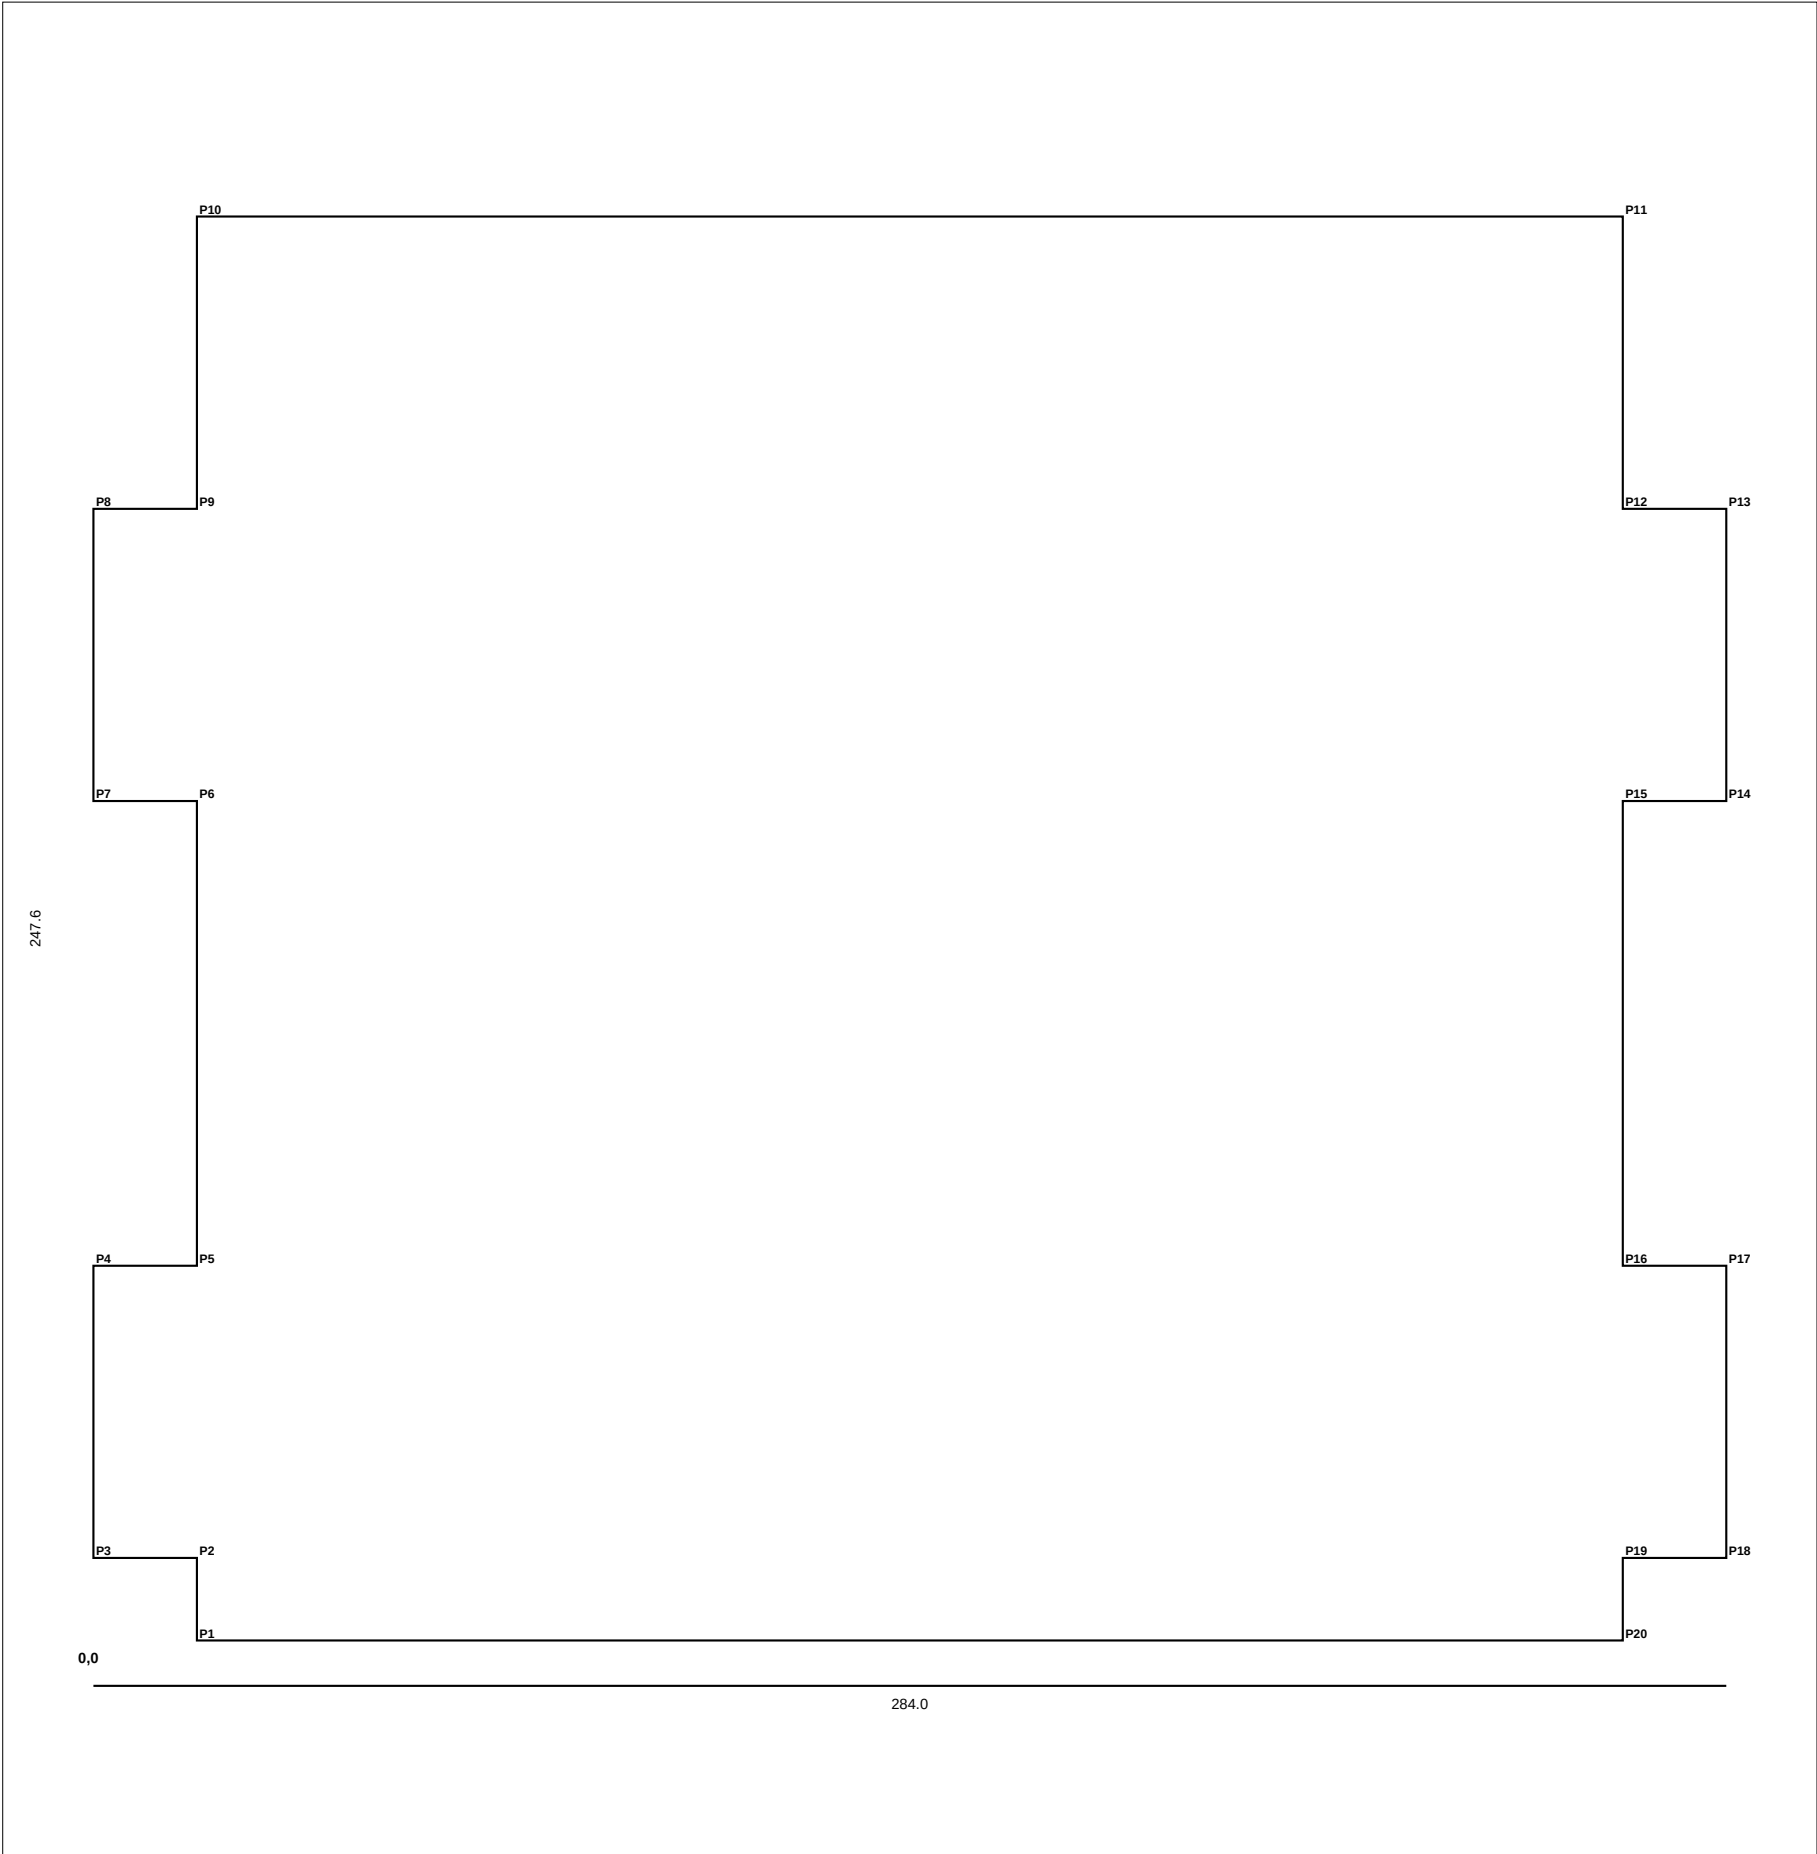

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X18.0 Y0.0 LINE

P2 X18.0 Y14.4 LINE

P3 X0.0 Y14.3 LINE

P4 X0.0 Y65.1 LINE

P5 X18.0 Y65.1 LINE

P6 X18.0 Y145.9 LINE

P7 X0.0 Y145.9 LINE

P8 X0.0 Y196.7 LINE

P9 X18.0 Y196.7 LINE

P10 X18.0 Y247.6 LINE

P11 X266.0 Y247.6 LINE

P12 X266.0 Y196.7 LINE

P13 X284.0 Y196.7 LINE

P14 X284.0 Y145.9 LINE

P15 X266.0 Y145.9 LINE

P16 X266.0 Y65.1 LINE

P17 X284.0 Y65.1 LINE


P18 X284.0 Y14.3 LINE

P19 X266.0 Y14.4 LINE

P20 X266.0 Y0.0 LINE

S1-F - Part detail

Overall 603.1 x 1773.0 mm | 18 mm plywood | datum lower-left = X0 Y0

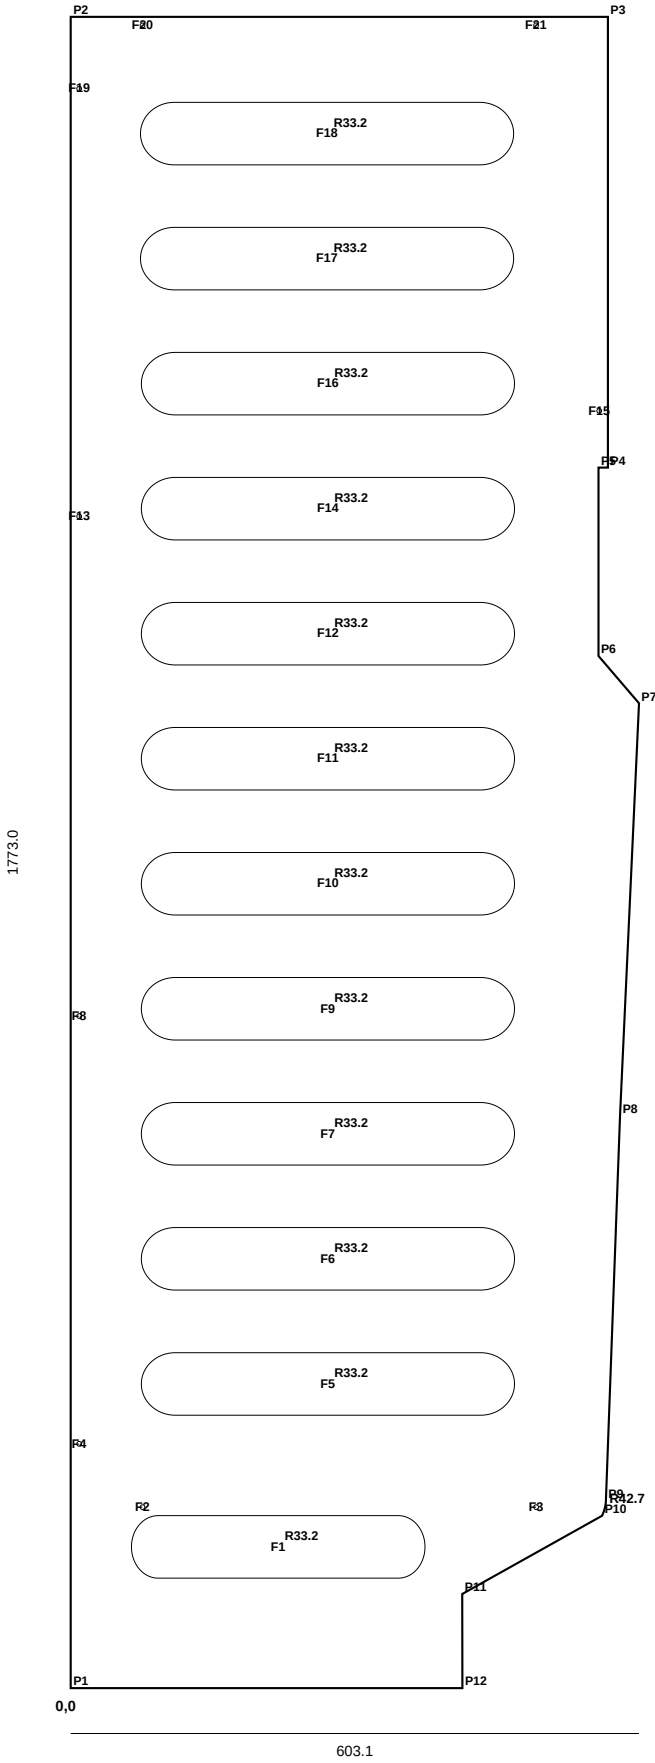

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 slot/cut-out 311.5 x 66.3, R33.2 X 220.2 Y 149.8
- F2 Dia 5 x 11 deep X 76.2 Y 192.0
- F3 Dia 5 x 11 deep X 493.9 Y 192.0
- F4 Dia 5 x 11 deep X 9.0 Y 259.2
- F5 slot/cut-out 396.0 x 66.3, R33.2 X 273.0 Y 322.7
- F6 slot/cut-out 396.0 x 66.3, R33.2 X 273.0 Y 455.4
- F7 slot/cut-out 396.0 x 66.3, R33.2 X 273.0 Y 588.1
- F8 Dia 5 x 11 deep X 9.0 Y 713.0
- F9 slot/cut-out 396.0 x 66.3, R33.2 X 273.0 Y 720.7
- F10 slot/cut-out 396.0 x 66.3, R33.2 X 273.0 Y 853.3
- F11 slot/cut-out 396.0 x 66.3, R33.2 X 273.0 Y 986.0
- F12 slot/cut-out 396.0 x 66.3, R33.2 X 273.0 Y 1118.6
- F13 Dia 5 x 11 deep X 9.0 Y 1243.0
- F14 slot/cut-out 396.0 x 66.3, R33.2 X 273.0 Y 1251.2
- F15 Dia 5 x 11 deep X 560.9 Y 1355.0
- F16 slot/cut-out 396.0 x 66.3, R33.2 X 273.0 Y 1383.9
- F17 slot/cut-out 396.0 x 66.3, R33.2 X 272.1 Y 1516.5
- F18 slot/cut-out 396.0 x 66.3, R33.2 X 272.1 Y 1649.1
- F19 Dia 5 x 11 deep X 9.0 Y 1696.8
- F20 Dia 5 x 11 deep X 76.2 Y 1764.0
- F21 Dia 5 x 11 deep X 493.9 Y 1764.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X0.0 Y1773.0 LINE
- P3 X570.1 Y1773.0 LINE
- P4 X570.1 Y1294.8 LINE
- P5 X560.1 Y1294.8 LINE
- P6 X560.1 Y1095.0 LINE
- P7 X603.1 Y1044.8 LINE
- P8 X583.0 Y607.8 LINE
- P9 X568.0 Y199.4 ARC R42.7
- P10 X564.0 Y182.9 LINE
- P11 X415.5 Y99.9 LINE
- P12 X415.5 Y0.0 LINE


FITTING NOTE - REAR PASSENGER QUARTER PANEL

The profile between P7 and P10 may need to be trimmed further depending on how your ply lining is fitted over the rear passenger quarter panel.

If the ply lining is set back from the pillar, no trimming should be required. If the ply lining covers the pillar and continues up to the sliding door, scribe this section to the van and trim it to fit.

S1-G - Part detail

Overall 594.0 x 1772.8 mm | 18 mm plywood | datum lower-left = X0 Y0

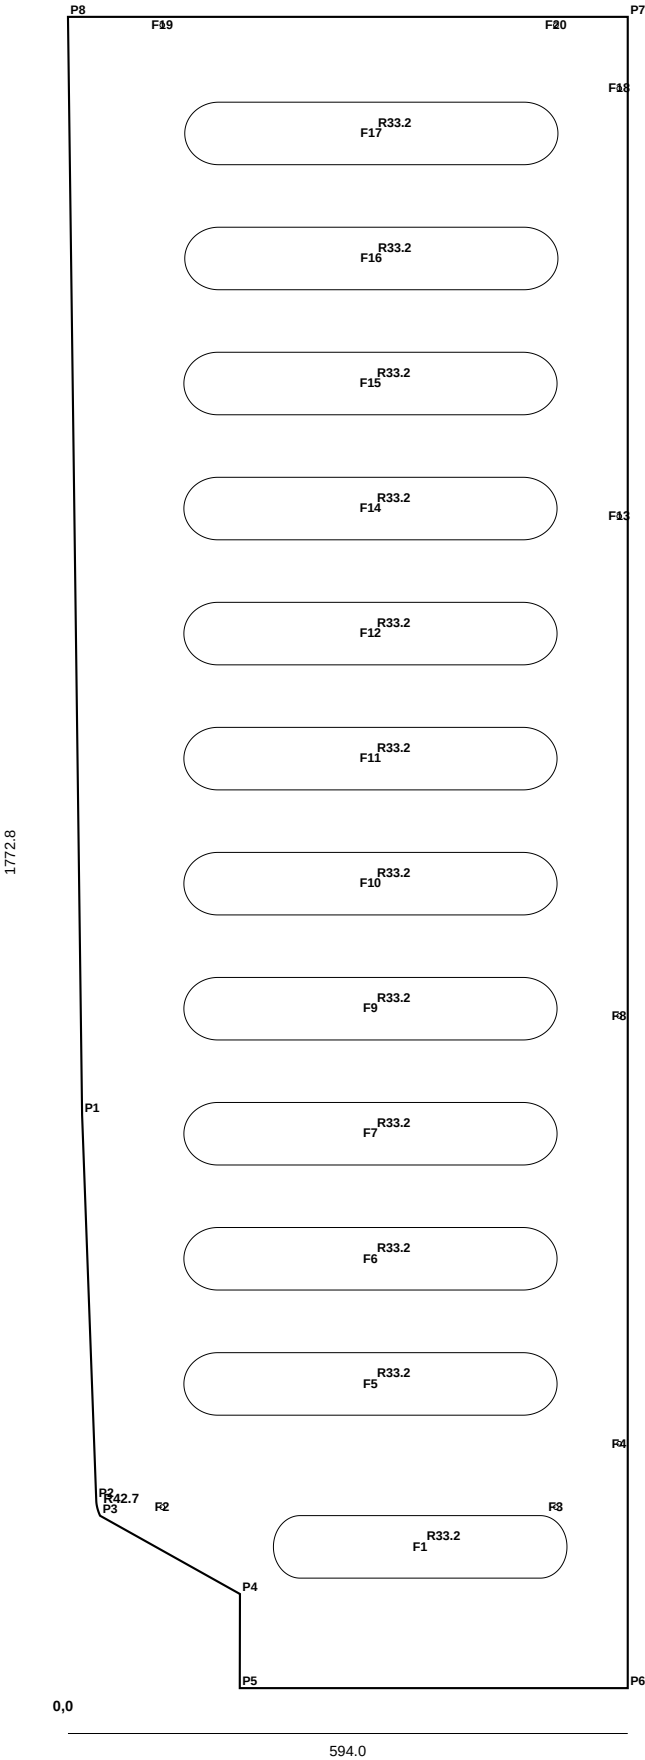

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 slot/cut-out 311.5 x 66.3, R33.2 X 373.8 Y 149.8
- F2 Dia 5 x 11 deep X 100.1 Y 192.0
- F3 Dia 5 x 11 deep X 517.8 Y 192.0
- F4 Dia 5 x 11 deep X 585.0 Y 259.2
- F5 slot/cut-out 396.0 x 66.3, R33.2 X 321.0 Y 322.7
- F6 slot/cut-out 396.0 x 66.3, R33.2 X 321.0 Y 455.4
- F7 slot/cut-out 396.0 x 66.3, R33.2 X 321.0 Y 588.1
- F8 Dia 5 x 11 deep X 585.0 Y 713.0
- F9 slot/cut-out 396.0 x 66.3, R33.2 X 321.0 Y 720.7
- F10 slot/cut-out 396.0 x 66.3, R33.2 X 321.0 Y 853.3
- F11 slot/cut-out 396.0 x 66.3, R33.2 X 321.0 Y 986.0
- F12 slot/cut-out 396.0 x 66.3, R33.2 X 321.0 Y 1118.6
- F13 Dia 5 x 11 deep X 585.0 Y 1243.0
- F14 slot/cut-out 396.0 x 66.3, R33.2 X 321.0 Y 1251.2
- F15 slot/cut-out 396.0 x 66.3, R33.2 X 321.0 Y 1383.9
- F16 slot/cut-out 396.0 x 66.3, R33.2 X 321.9 Y 1516.5
- F17 slot/cut-out 396.0 x 66.3, R33.2 X 321.9 Y 1649.1
- F18 Dia 5 x 11 deep X 585.0 Y 1696.8
- F19 Dia 5 x 11 deep X 100.1 Y 1764.0
- F20 Dia 5 x 11 deep X 517.8 Y 1764.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X15.0 Y607.8 LINE
- P2 X30.0 Y199.4 ARC R42.7
- P3 X34.1 Y182.9 LINE
- P4 X182.5 Y99.9 LINE
- P5 X182.3 Y0.0 LINE
- P6 X594.0 Y0.0 LINE
- P7 X594.0 Y1772.8 LINE
- P8 X0.0 Y1772.8 LINE

S2-A - Part detail

Overall 545.0 x 400.0 mm | 18 mm plywood | datum lower-left = X0 Y0

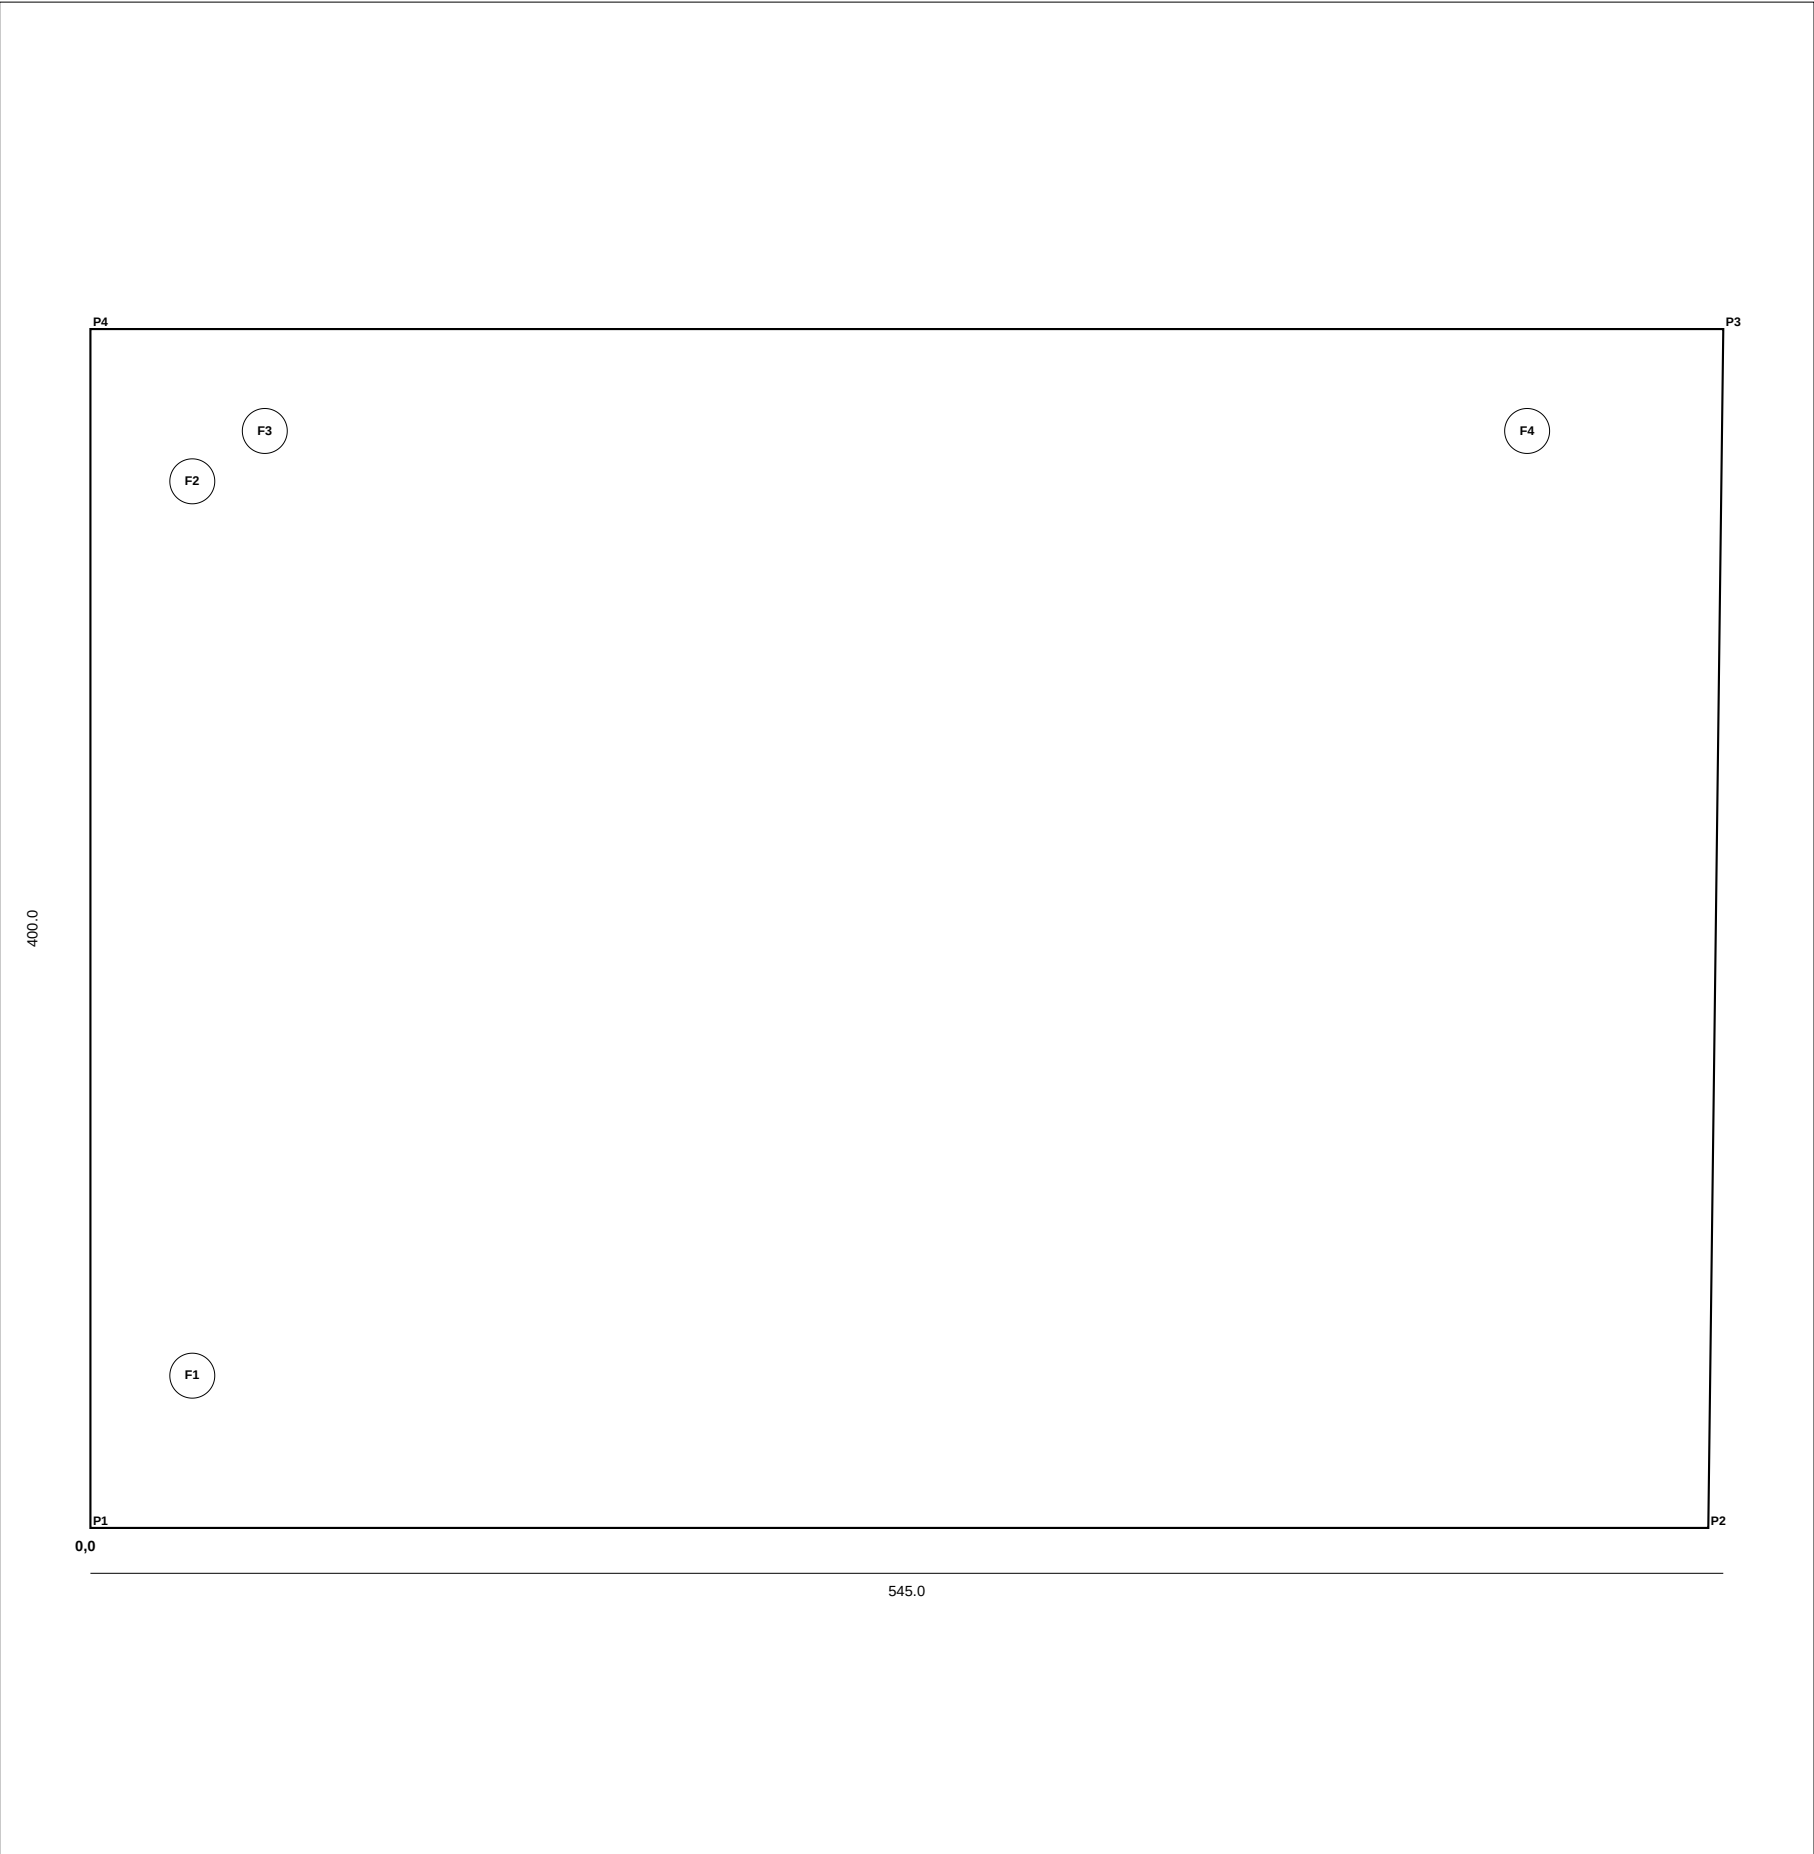

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 34.0 Y 50.8

F2 Dia 15 x 14 deep X 34.0 Y 349.2

F3 Dia 15 x 14 deep X 58.2 Y 366.0

F4 Dia 15 x 14 deep X 479.5 Y 366.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE


P2 X540.0 Y0.0 LINE

P3 X545.0 Y400.0 LINE

P4 X0.0 Y400.0 LINE

S2-B - Part detail

Overall 541.0 x 400.0 mm | 18 mm plywood | datum lower-left = X0 Y0

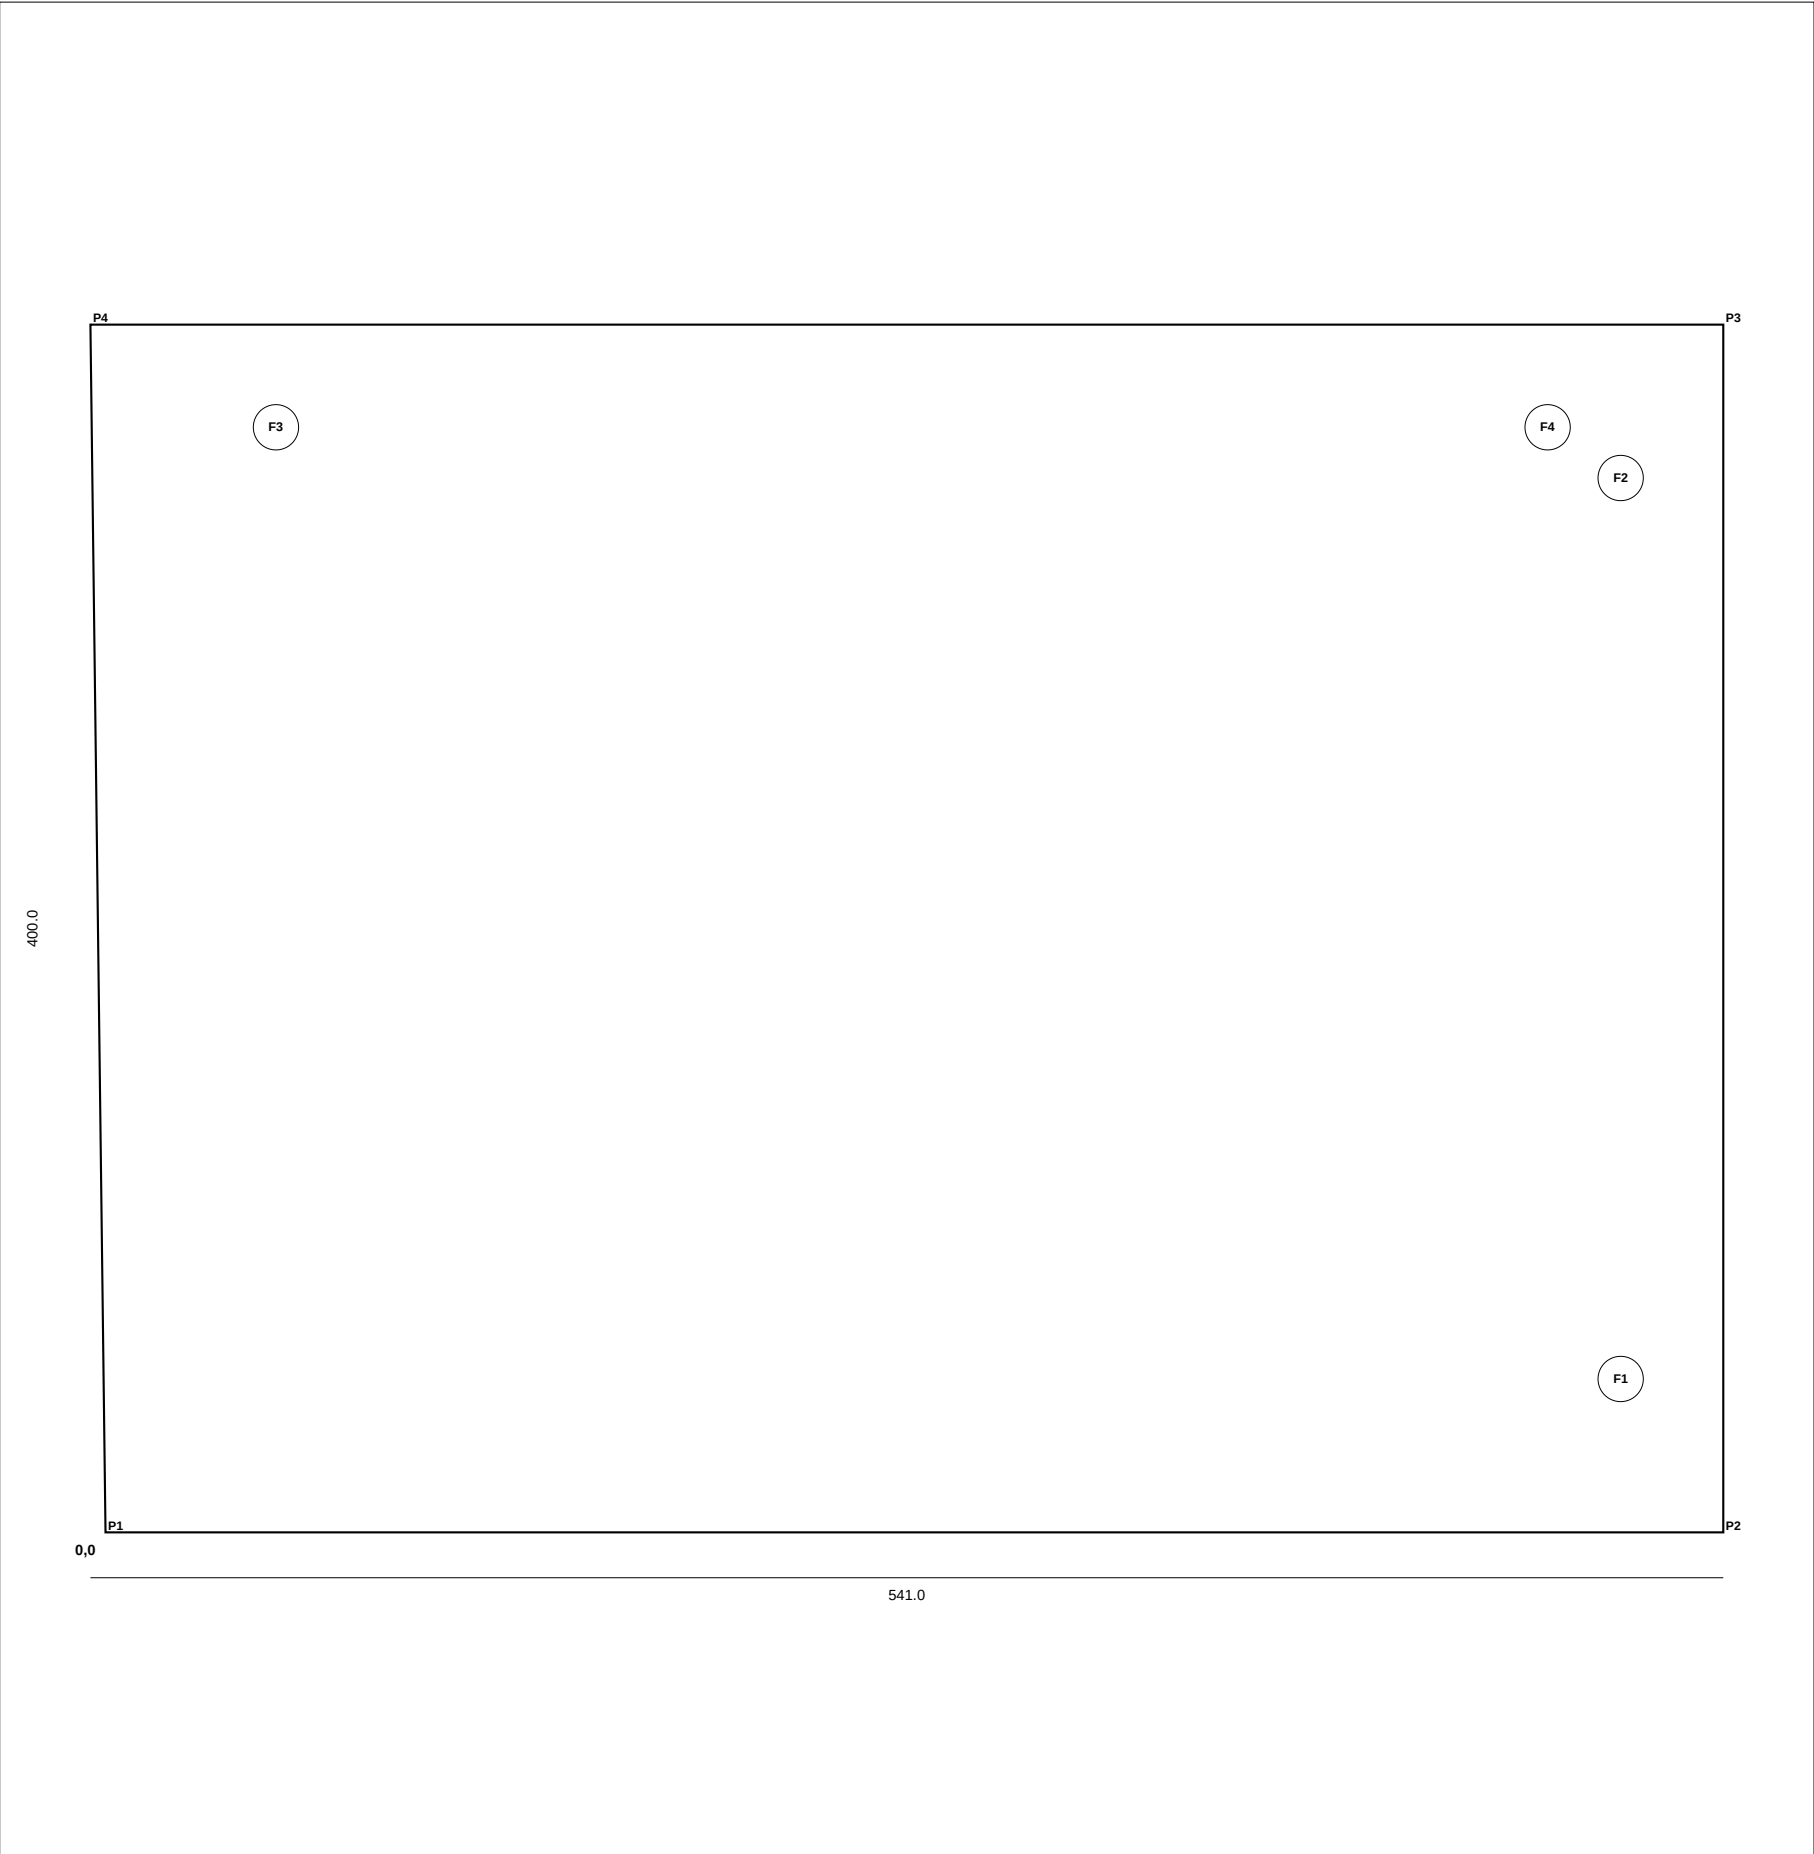

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 507.0 Y 50.8

F2 Dia 15 x 14 deep X 507.0 Y 349.2

F3 Dia 15 x 14 deep X 61.5 Y 366.0

F4 Dia 15 x 14 deep X 482.8 Y 366.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X5.0 Y0.0 LINE


P2 X541.0 Y0.0 LINE

P3 X541.0 Y400.0 LINE

P4 X0.0 Y400.0 LINE

S2-C - Part detail

Overall 485.0 x 400.0 mm | 18 mm plywood | datum lower-left = X0 Y0

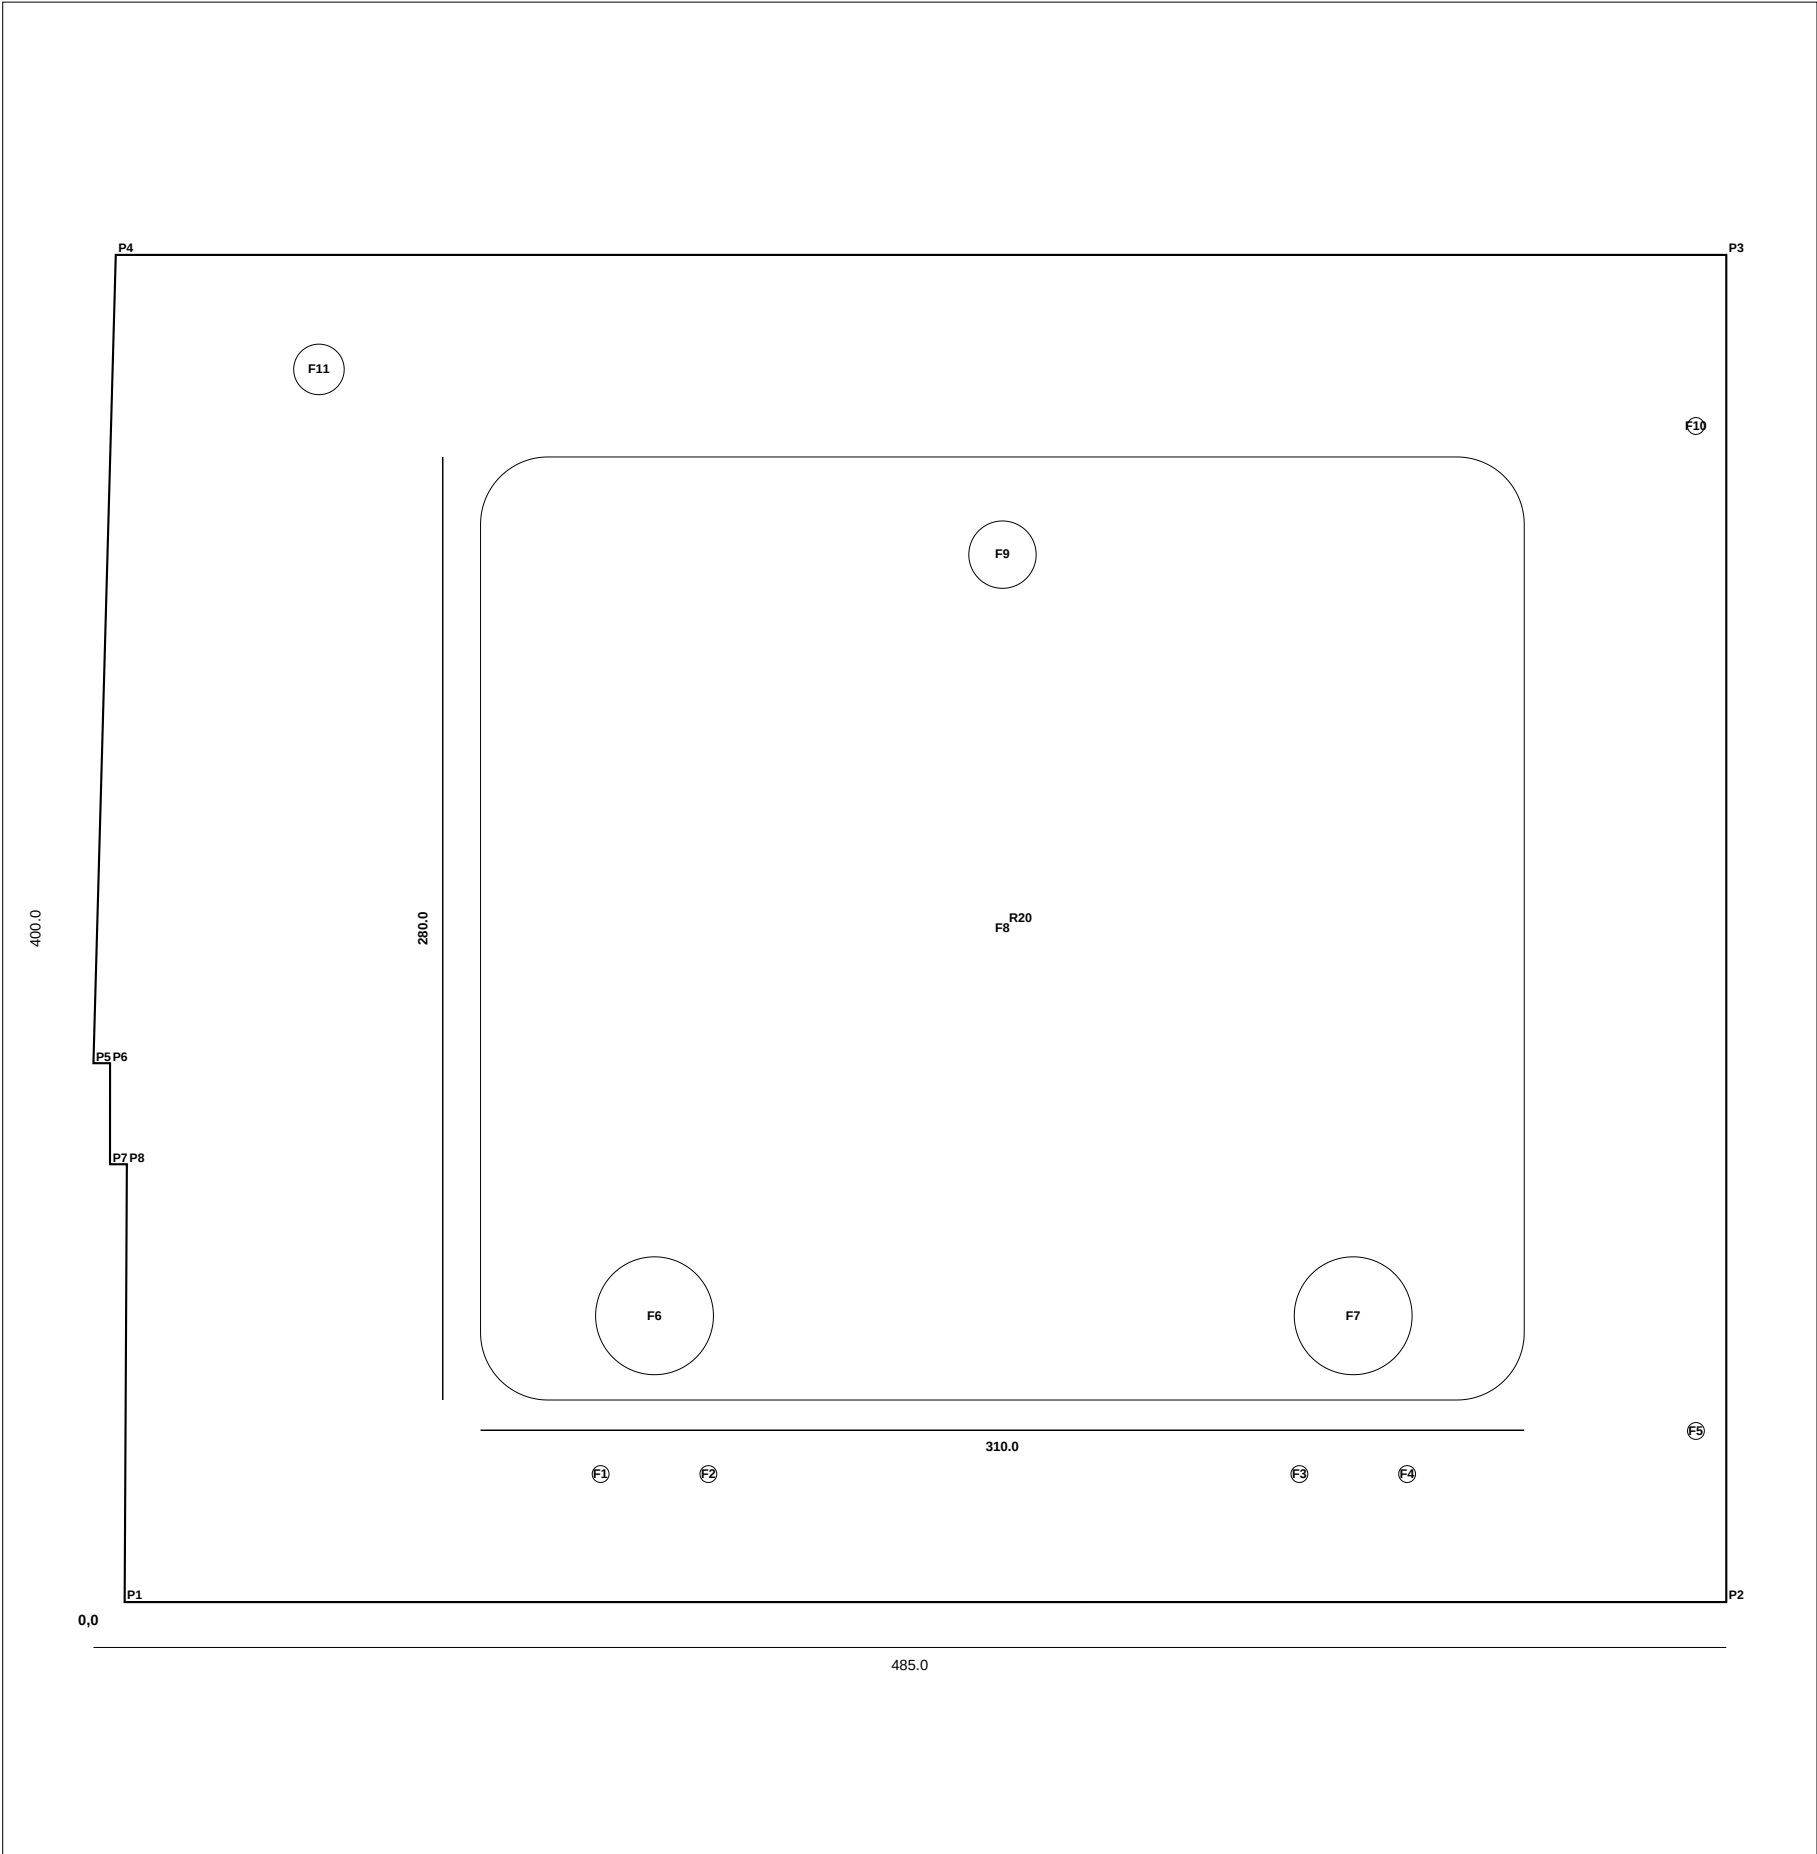

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 5 x 11 deep X 150.7 Y 38.0
- F2 Dia 5 x 11 deep X 182.7 Y 38.0
- F3 Dia 5 x 11 deep X 358.2 Y 38.0
- F4 Dia 5 x 11 deep X 390.2 Y 38.0
- F5 Dia 5 x 11 deep X 476.0 Y 50.8
- F6 Dia 35 x 13 deep X 166.7 Y 85.0
- F7 Dia 35 x 13 deep X 374.2 Y 85.0
- F8 door cut-out 310.0 x 280.0, R20 X 270.0 Y 200.0
- F9 Dia 20 THROUGH X 270.0 Y 311.0
- F10 Dia 5 x 11 deep X 476.0 Y 349.2
- F11 Dia 15 x 14 deep X 67.0 Y 366.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X9.3 Y0.0 LINE
 - P2 X485.0 Y0.0 LINE
 - P3 X485.0 Y400.0 LINE
 - P4 X6.6 Y400.0 LINE
 - P5 X0.0 Y160.0 LINE
 - P6 X4.9 Y160.0 LINE
 - P7 X4.9 Y130.0 LINE
 - P8 X9.9 Y130.0 LINE

S2-D - Part detail

Overall 534.2 x 400.0 mm | 18 mm plywood | datum lower-left = X0 Y0

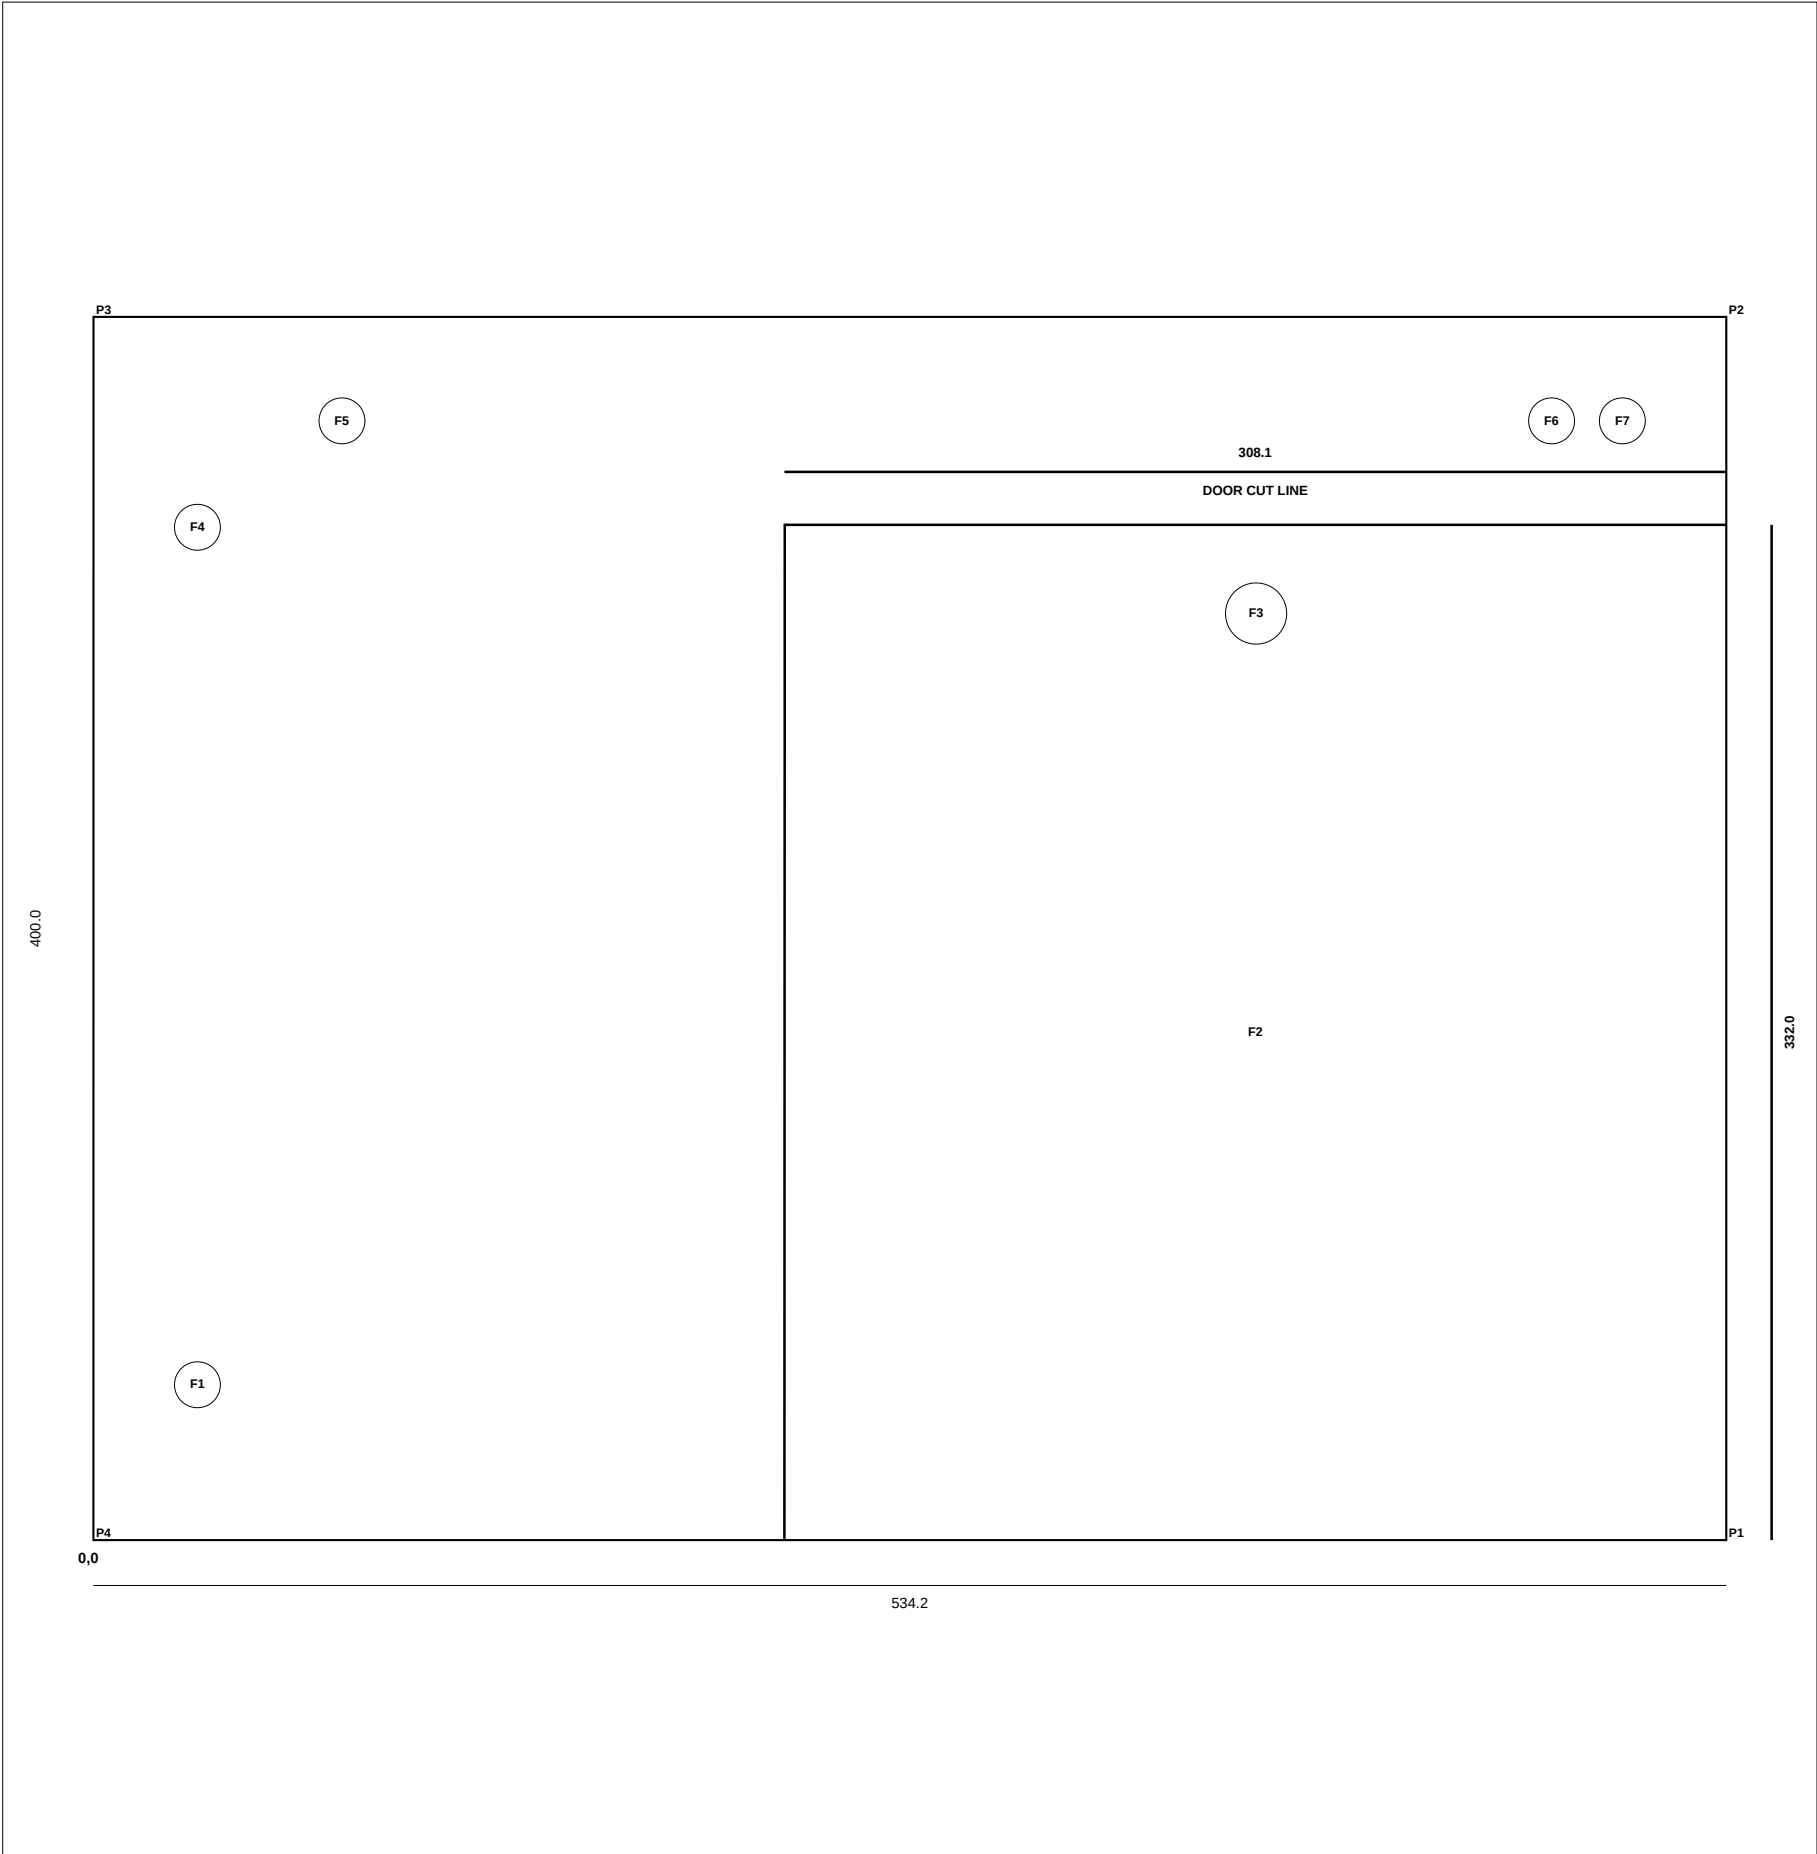

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 15 x 14 deep X 34.0 Y 50.8
- F2 door cut line 308.1 x 332.0 X 380.1 Y 166.0
- F3 Dia 20 THROUGH X 380.3 Y 303.0
- F4 Dia 15 x 14 deep X 34.0 Y 331.2
- F5 Dia 15 x 14 deep X 81.3 Y 366.0
- F6 Dia 15 x 14 deep X 477.0 Y 366.0
- F7 Dia 15 x 14 deep X 500.2 Y 366.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X534.2 Y0.0 LINE
 - P2 X534.2 Y400.0 LINE
 - P3 X0.0 Y400.0 LINE
 - P4 X0.0 Y0.0 LINE

S2-E - Part detail

Overall 400.0 x 1590.0 mm | 18 mm plywood | datum lower-left = X0 Y0

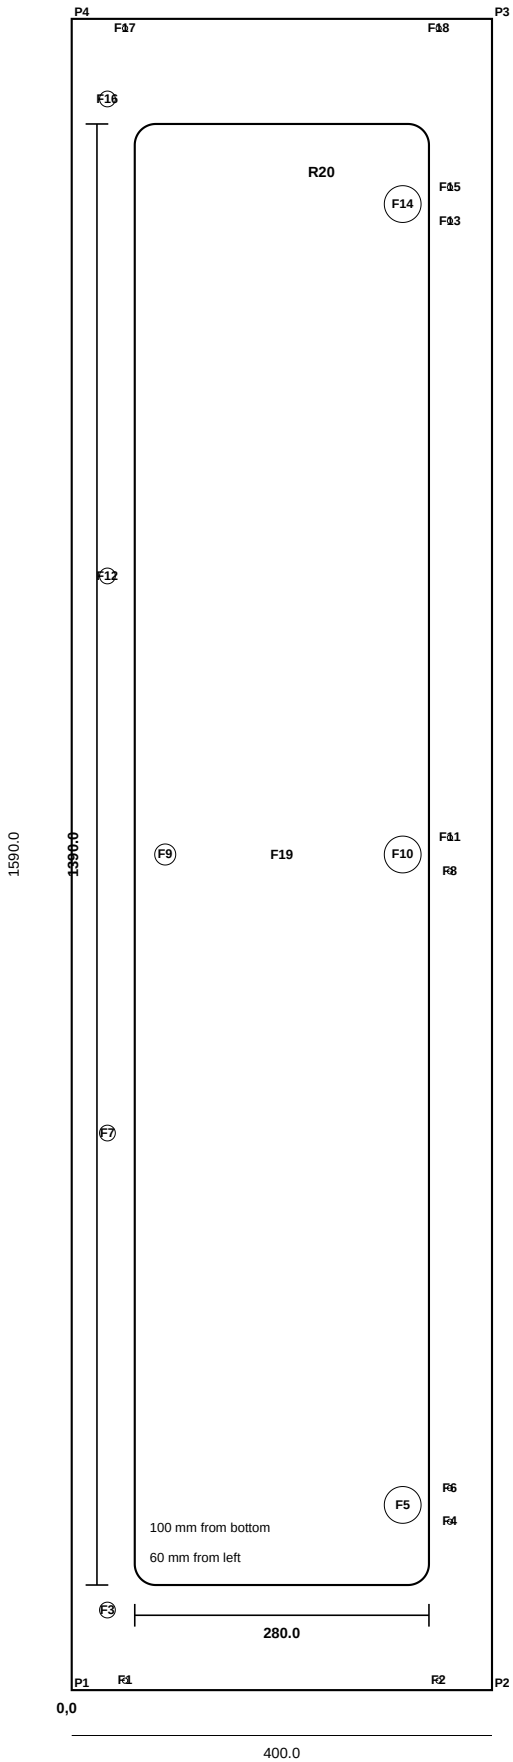

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 50.8 Y 9.0
- F2 Dia 5 x 11 deep X 349.2 Y 9.0
- F3 Dia 15 x 14 deep X 34.0 Y 76.2
- F4 Dia 5 x 11 deep X 360.0 Y 160.2
- F5 Dia 35 x 13 deep X 315.0 Y 176.2
- F6 Dia 5 x 11 deep X 360.0 Y 192.2
- F7 Dia 15 x 14 deep X 34.0 Y 530.0
- F8 Dia 5 x 11 deep X 360.0 Y 779.0
- F9 Dia 20 THROUGH X 89.0 Y 795.0
- F10 Dia 35 x 13 deep X 315.0 Y 795.0
- F11 Dia 5 x 11 deep X 360.0 Y 811.0
- F12 Dia 15 x 14 deep X 34.0 Y 1060.0
- F13 Dia 5 x 11 deep X 360.0 Y 1397.8
- F14 Dia 35 x 13 deep X 315.0 Y 1413.8
- F15 Dia 5 x 11 deep X 360.0 Y 1429.8
- F16 Dia 15 x 14 deep X 34.0 Y 1513.8
- F17 Dia 5 x 11 deep X 50.8 Y 1581.0
- F18 Dia 5 x 11 deep X 349.2 Y 1581.0
- F19 door cut-out 280.0 x 1390.0, R20 X 200.0 Y 795.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE


P2 X400.0 Y0.0 LINE

P3 X400.0 Y1590.0 LINE

P4 X0.0 Y1590.0 LINE

S2-F - Part detail

Overall 400.0 x 1590.0 mm | 18 mm plywood | datum lower-left = X0 Y0

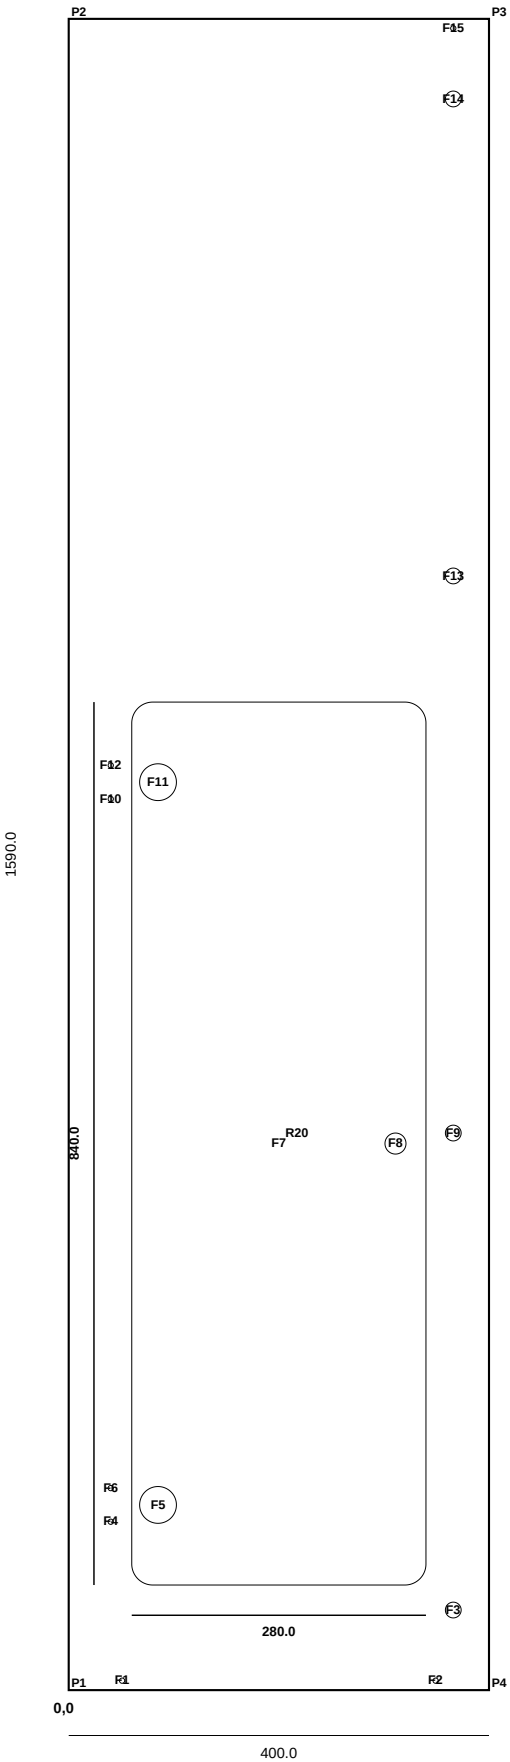

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 50.8 Y 9.0
- F2 Dia 5 x 11 deep X 349.2 Y 9.0
- F3 Dia 15 x 14 deep X 366.0 Y 76.2
- F4 Dia 5 x 11 deep X 40.0 Y 160.2
- F5 Dia 35 x 13 deep X 85.0 Y 176.2
- F6 Dia 5 x 11 deep X 40.0 Y 192.2
- F7 door cut-out 280.0 x 840.0, R20 X 200.0 Y 520.0
- F8 Dia 20 THROUGH X 311.0 Y 520.0
- F9 Dia 15 x 14 deep X 366.0 Y 530.0
- F10 Dia 5 x 11 deep X 40.0 Y 847.8
- F11 Dia 35 x 13 deep X 85.0 Y 863.8
- F12 Dia 5 x 11 deep X 40.0 Y 879.8
- F13 Dia 15 x 14 deep X 366.0 Y 1060.0
- F14 Dia 15 x 14 deep X 366.0 Y 1513.8
- F15 Dia 5 x 11 deep X 366.0 Y 1581.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE


P2 X0.0 Y1590.0 LINE

P3 X400.0 Y1590.0 LINE

P4 X400.0 Y0.0 LINE

S2-G - Part detail

Overall 40.0 x 1590.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y20.0 ARC R20

P2 X20.0 Y0.0 ARC R20

P3 X40.0 Y20.0 LINE


P4 X40.0 Y1570.0 ARC R20

P5 X20.0 Y1590.0 ARC R20

P6 X0.0 Y1570.0 LINE

S2-H - Part detail

Overall 40.0 x 1590.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y20.0 ARC R20

P2 X20.0 Y0.0 ARC R20

P3 X40.0 Y20.0 LINE


P4 X40.0 Y1570.0 ARC R20

P5 X20.0 Y1590.0 ARC R20

P6 X0.0 Y1570.0 LINE

S2-I - Part detail

Overall 248.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

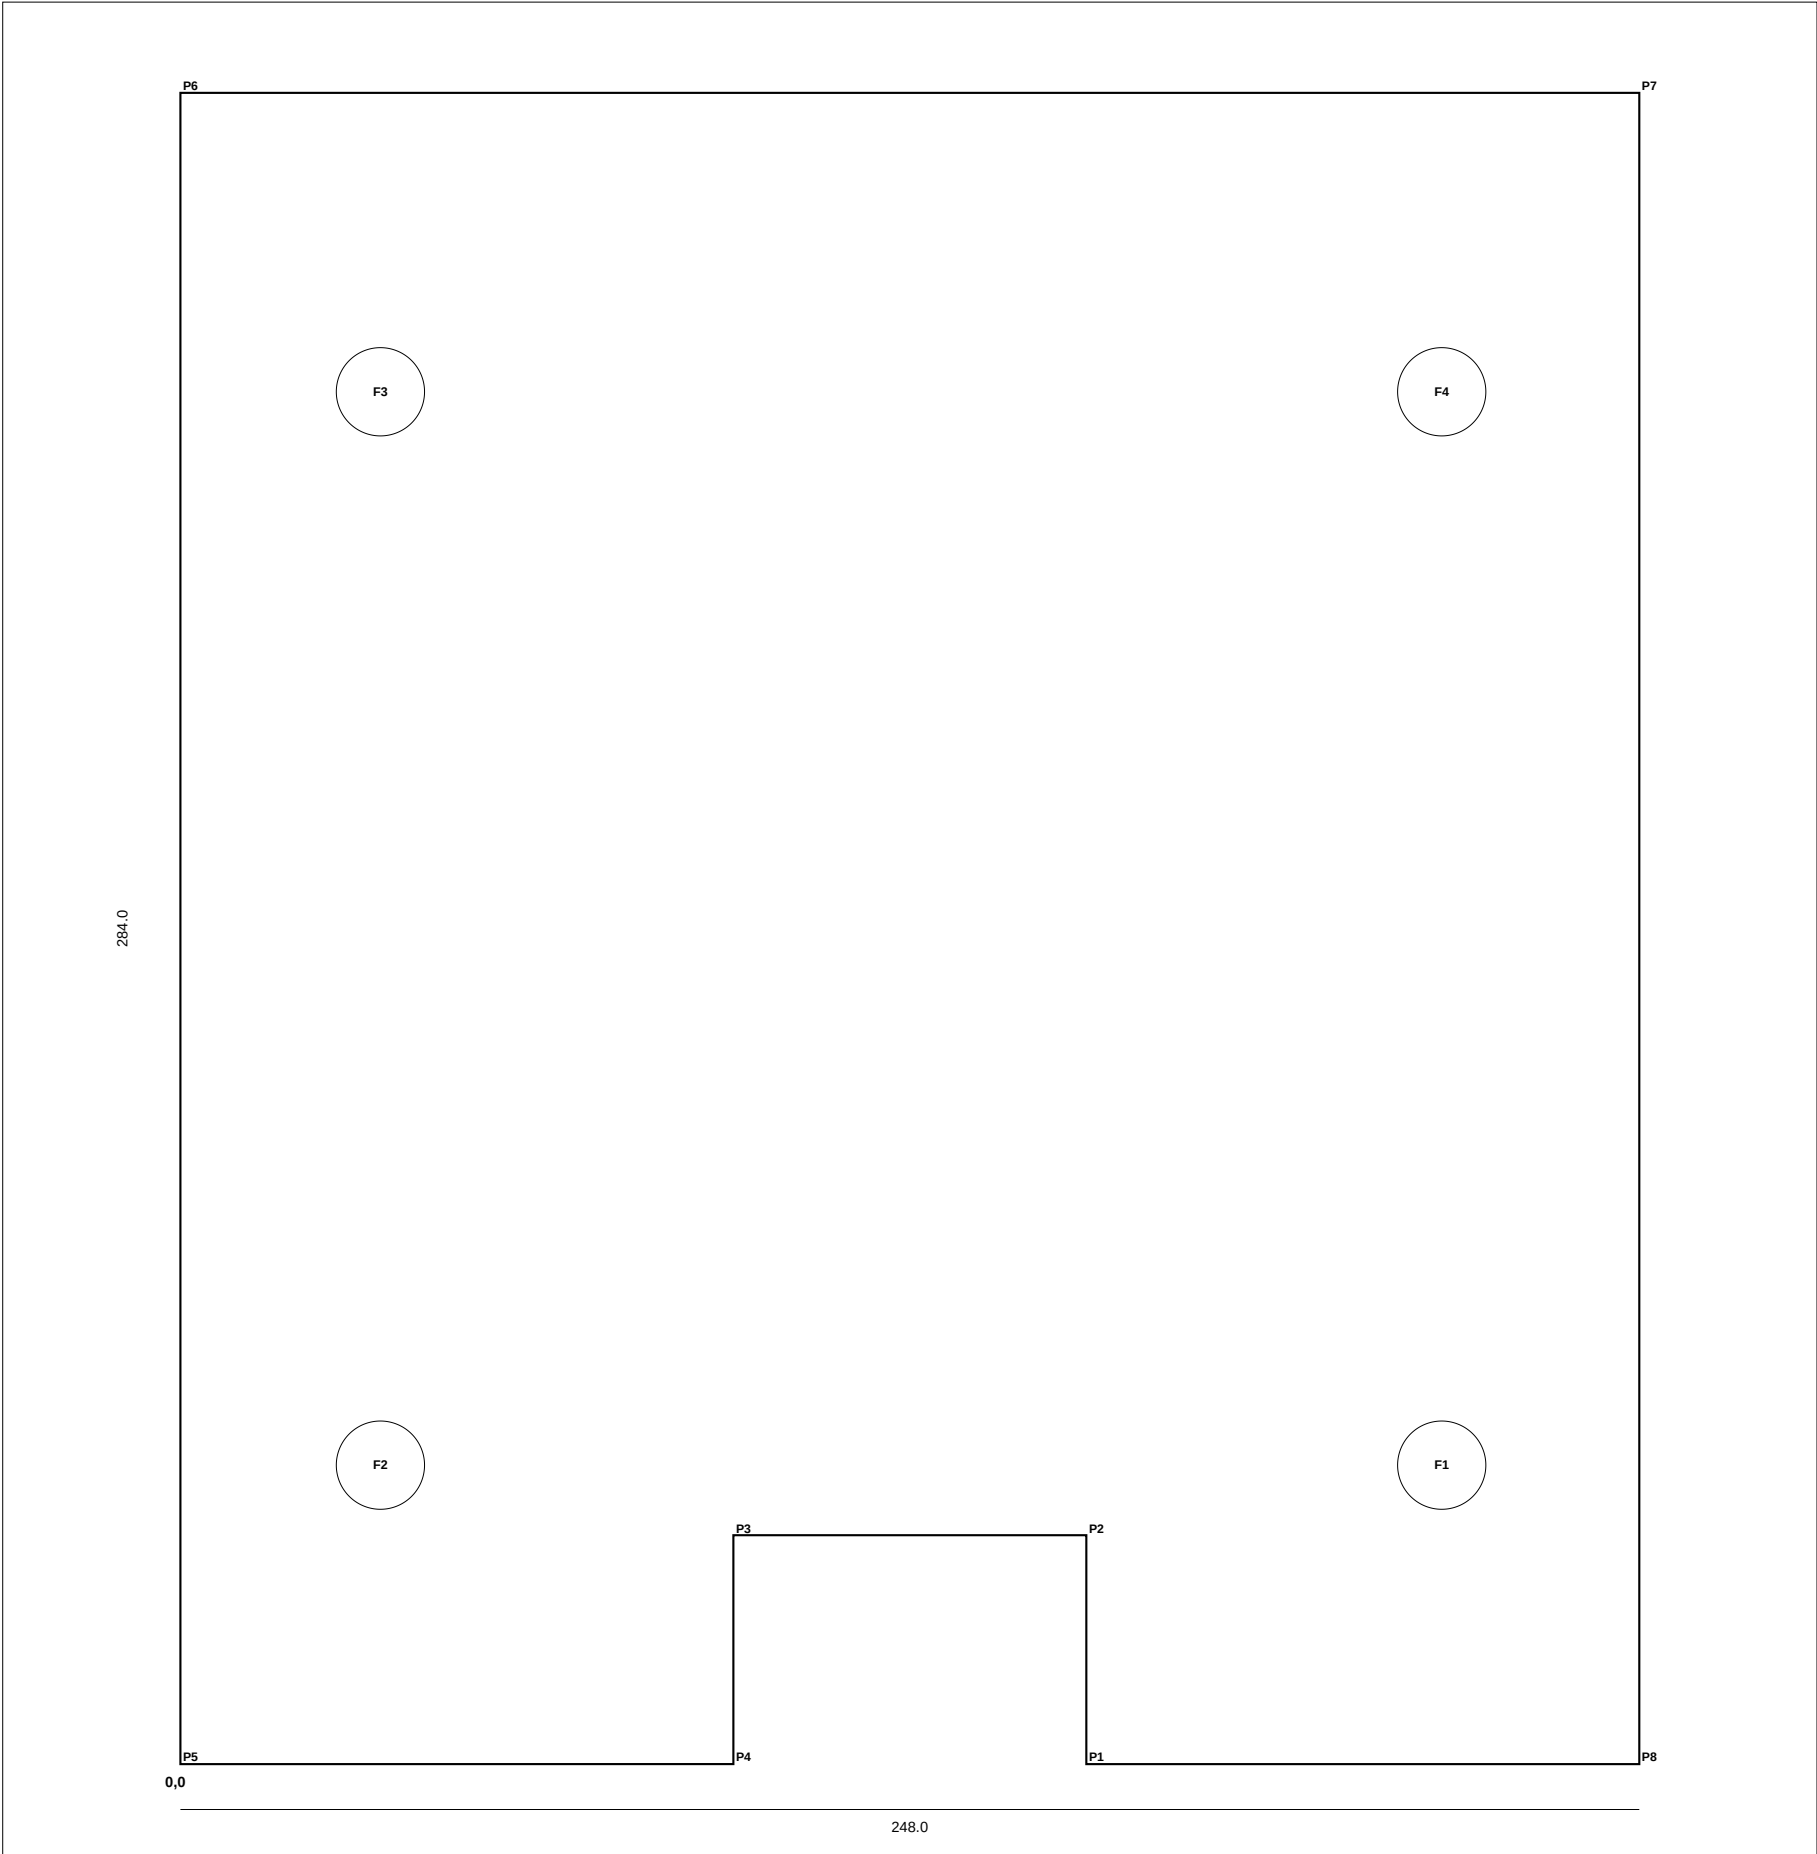

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 214.4 Y 50.8

F2 Dia 15 x 14 deep X 34.0 Y 50.8

F3 Dia 15 x 14 deep X 34.0 Y 233.2

F4 Dia 15 x 14 deep X 214.4 Y 233.2

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X154.0 Y0.0 LINE

P2 X154.0 Y38.9 LINE

P3 X94.0 Y38.9 LINE

P4 X94.0 Y0.0 LINE

P5 X0.0 Y0.0 LINE


P6 X0.0 Y284.0 LINE

P7 X248.0 Y284.0 LINE

P8 X248.0 Y0.0 LINE

S2-J - Part detail

Overall 67.0 x 1554.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y34.0 LINE

P2 X0.0 Y0.0 LINE

P3 X67.0 Y0.0 LINE


P4 X67.0 Y1554.0 LINE

P5 X0.0 Y1554.0 LINE

S3-A - Part detail

Overall 400.0 x 576.0 mm | 18 mm plywood | datum lower-left = X0 Y0

576.0



X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 366.0 Y 96.5

F2 Dia 15 x 14 deep X 366.0 Y 517.8

F3 Dia 15 x 14 deep X 50.8 Y 542.0

F4 Dia 15 x 14 deep X 349.2 Y 542.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X400.0 Y0.0 LINE


P2 X0.0 Y0.0 LINE

P3 X0.0 Y576.0 LINE

P4 X400.0 Y576.0 LINE

S3-B - Part detail

Overall 460.0 x 1772.8 mm | 18 mm plywood | datum lower-left = X0 Y0

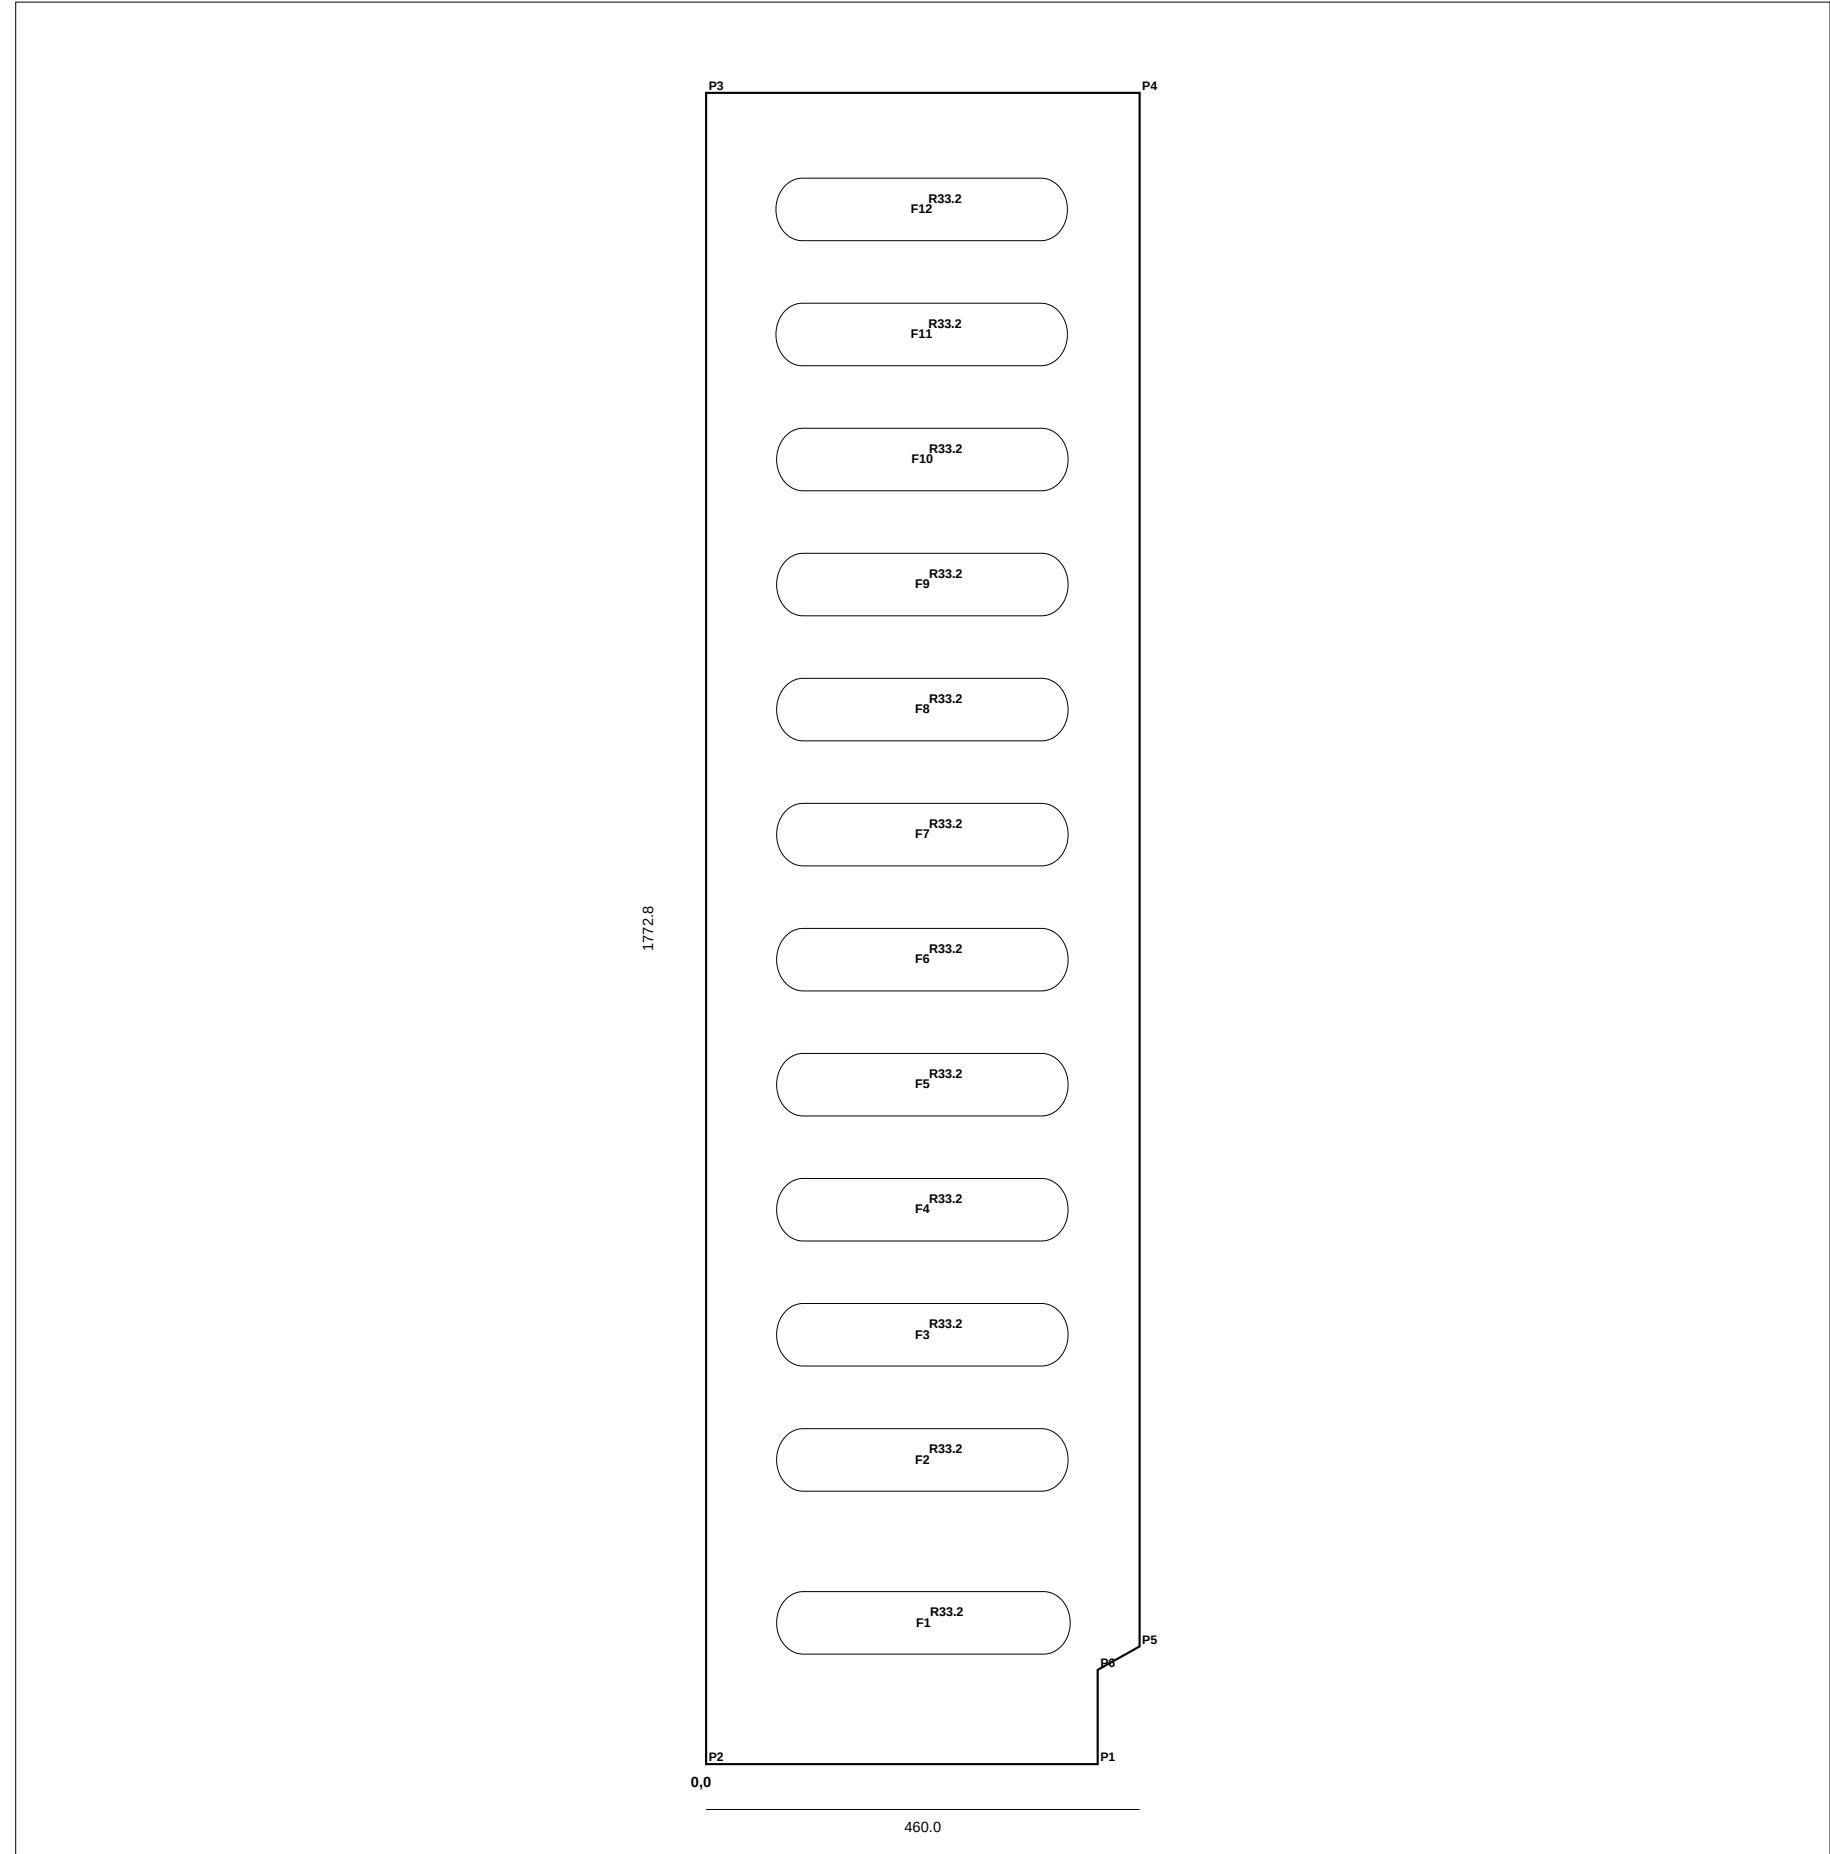

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 slot/cut-out 311.5 x 66.3, R33.2 X 230.6 Y 149.8

F2 slot/cut-out 309.3 x 66.3, R33.2 X 229.5 Y 322.7

F3 slot/cut-out 309.3 x 66.3, R33.2 X 229.5 Y 455.4

F4 slot/cut-out 309.3 x 66.3, R33.2 X 229.5 Y 588.1

F5 slot/cut-out 309.3 x 66.3, R33.2 X 229.5 Y 720.7

F6 slot/cut-out 309.3 x 66.3, R33.2 X 229.5 Y 853.3

F7 slot/cut-out 309.3 x 66.3, R33.2 X 229.5 Y 986.0

F8 slot/cut-out 309.3 x 66.3, R33.2 X 229.5 Y 1118.6

F9 slot/cut-out 309.3 x 66.3, R33.2 X 229.5 Y 1251.2

F10 slot/cut-out 309.3 x 66.3, R33.2 X 229.5 Y 1383.9

F11 slot/cut-out 309.3 x 66.3, R33.2 X 228.7 Y 1516.5

F12 slot/cut-out 309.3 x 66.3, R33.2 X 228.7 Y 1649.1

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X415.5 Y0.0 LINE

P2 X0.0 Y0.0 LINE

P3 X0.0 Y1772.8 LINE


P4 X460.0 Y1772.8 LINE

P5 X460.0 Y124.8 LINE

P6 X415.5 Y100.0 LINE

S3-C - Part detail

Overall 700.0 x 500.0 mm | 18 mm plywood | datum lower-left = X0 Y0

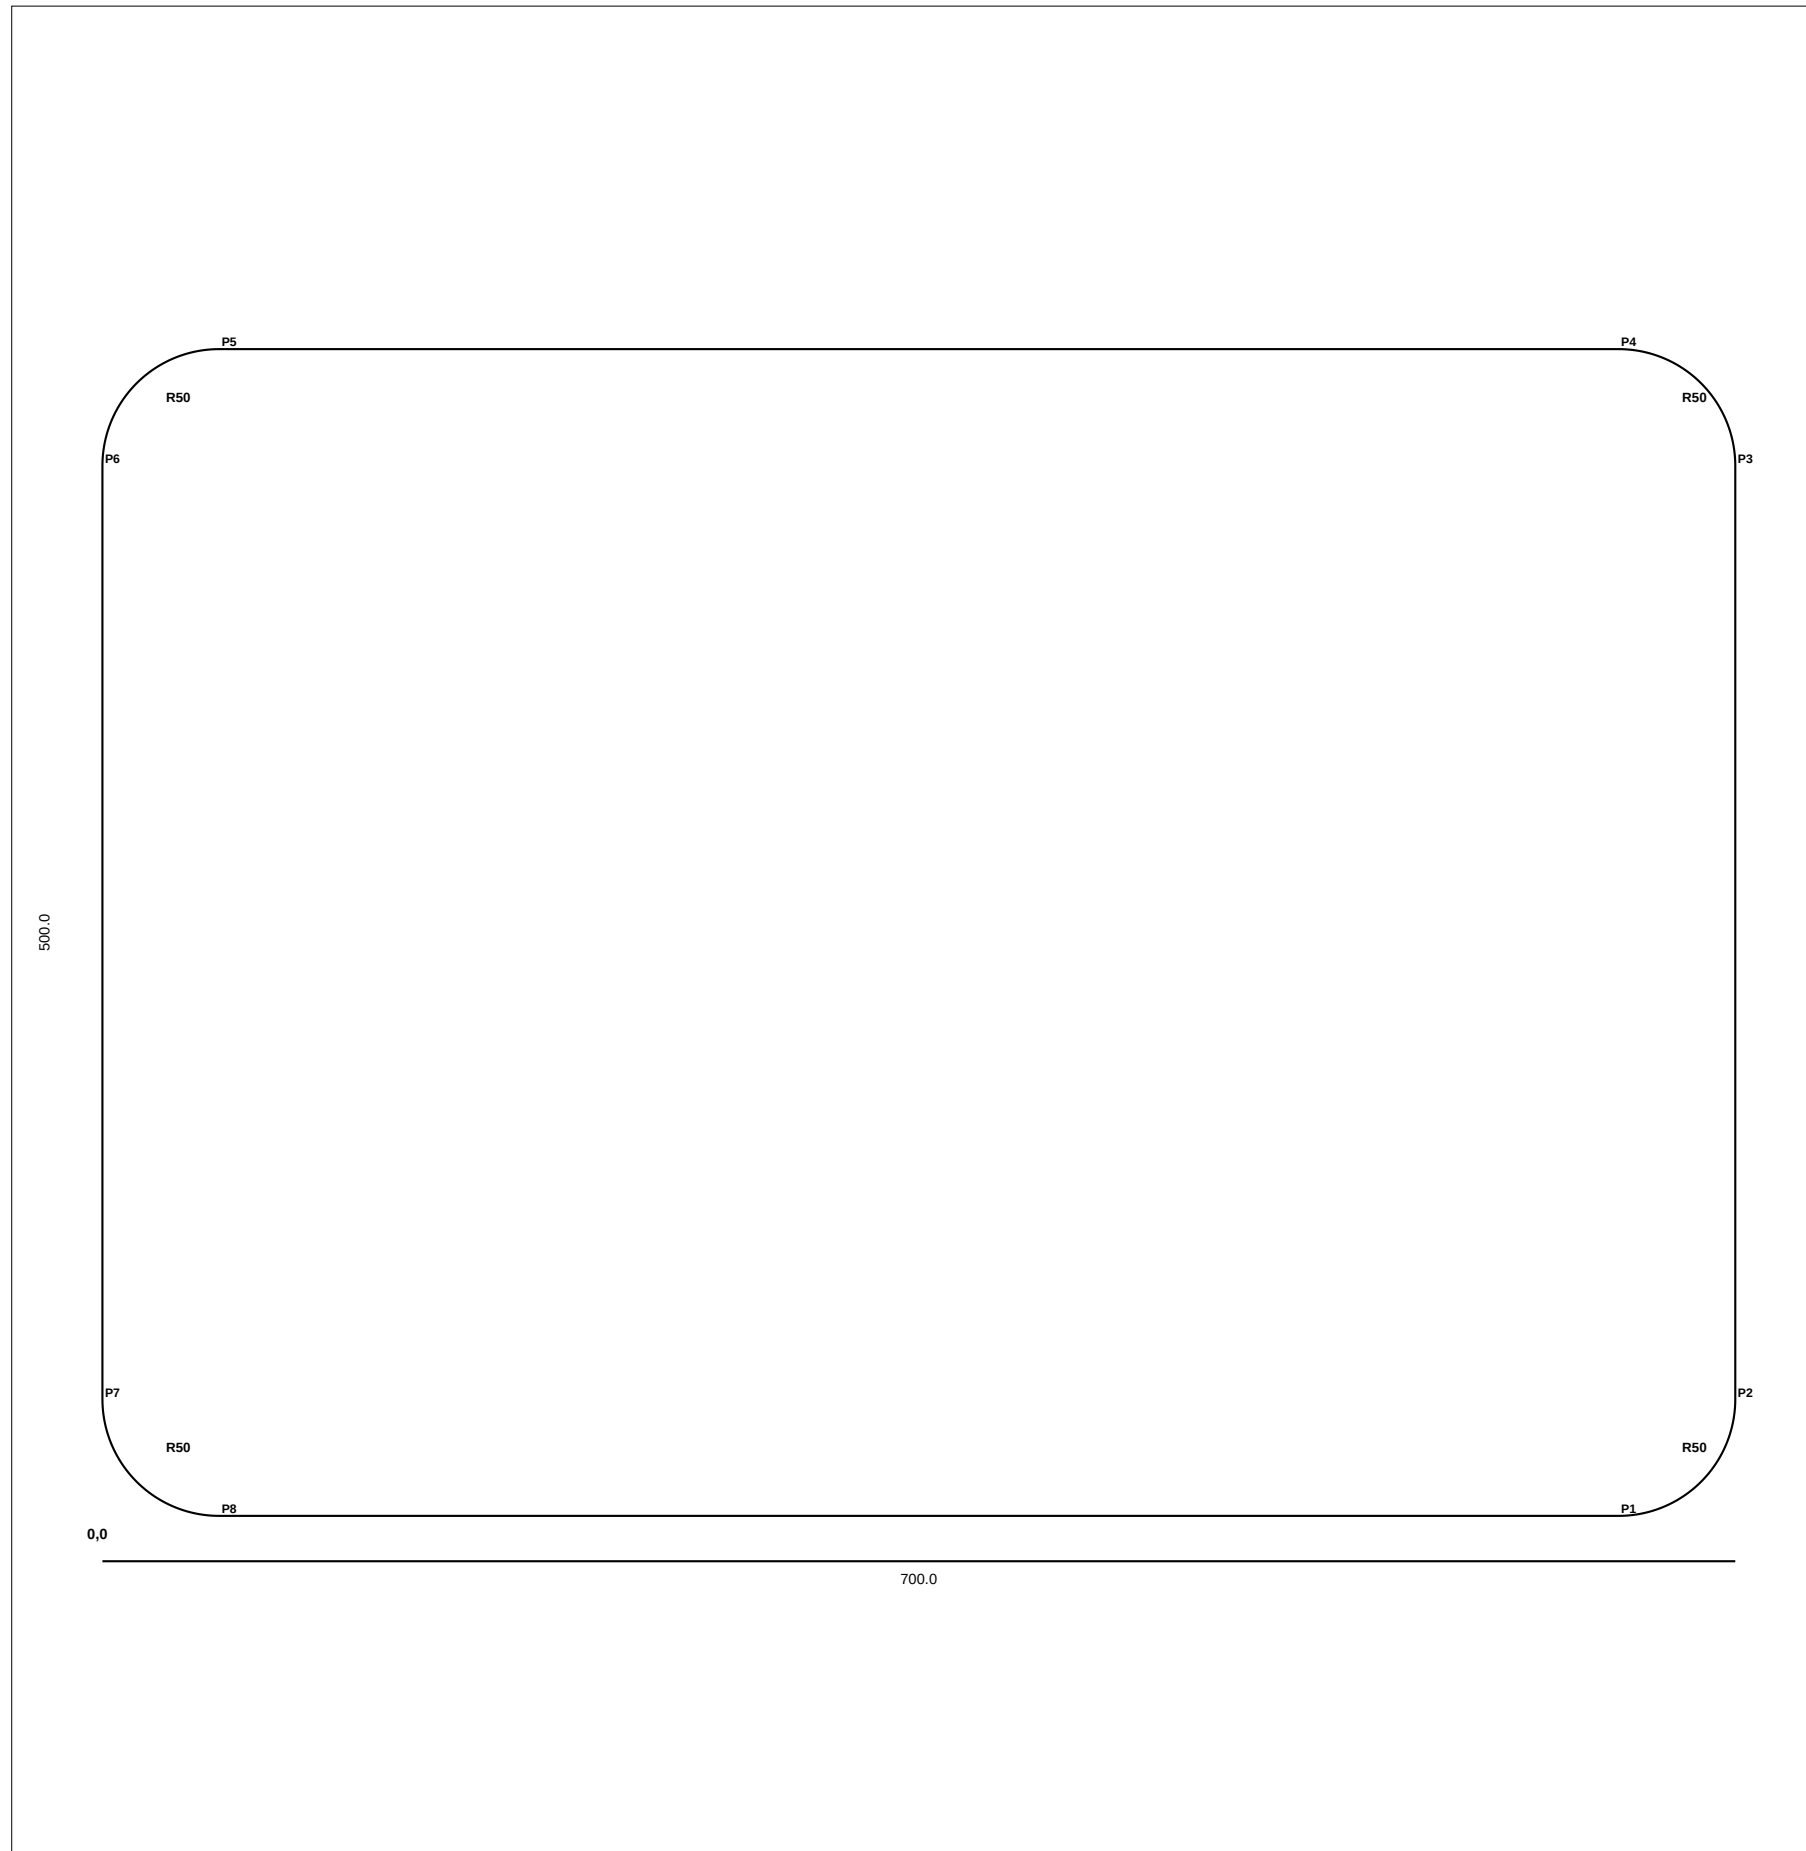

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X650.0 Y0.0 ARC R50

P2 X700.0 Y50.0 LINE

P3 X700.0 Y450.0 ARC R50

P4 X650.0 Y500.0 LINE

P5 X50.0 Y500.0 ARC R50

P6 X0.0 Y450.0 LINE

P7 X0.0 Y50.0 ARC R50

P8 X50.0 Y0.0 LINE