




39K
39K
10K
+5
-5
CARRIER NULL
RT3
1K
100
470pf
5.1K
R
150
.003
5.1K
3030
330
100
1445
2.2K
R-Y
TO
CHROMA
BOARD
-Y
RT4
10K
WHITE
BALANCE
33
pf
33pf
100
CB FROM
7414
BF TO
R-Y, B-Y
75
FRONT
PANEL
CARRIER
BALANCE
10K
RT2
1K
100
R-Y BOARD
4.7K
BF
10K
R5
HUE
4.7K

LUMINANCE BOARD

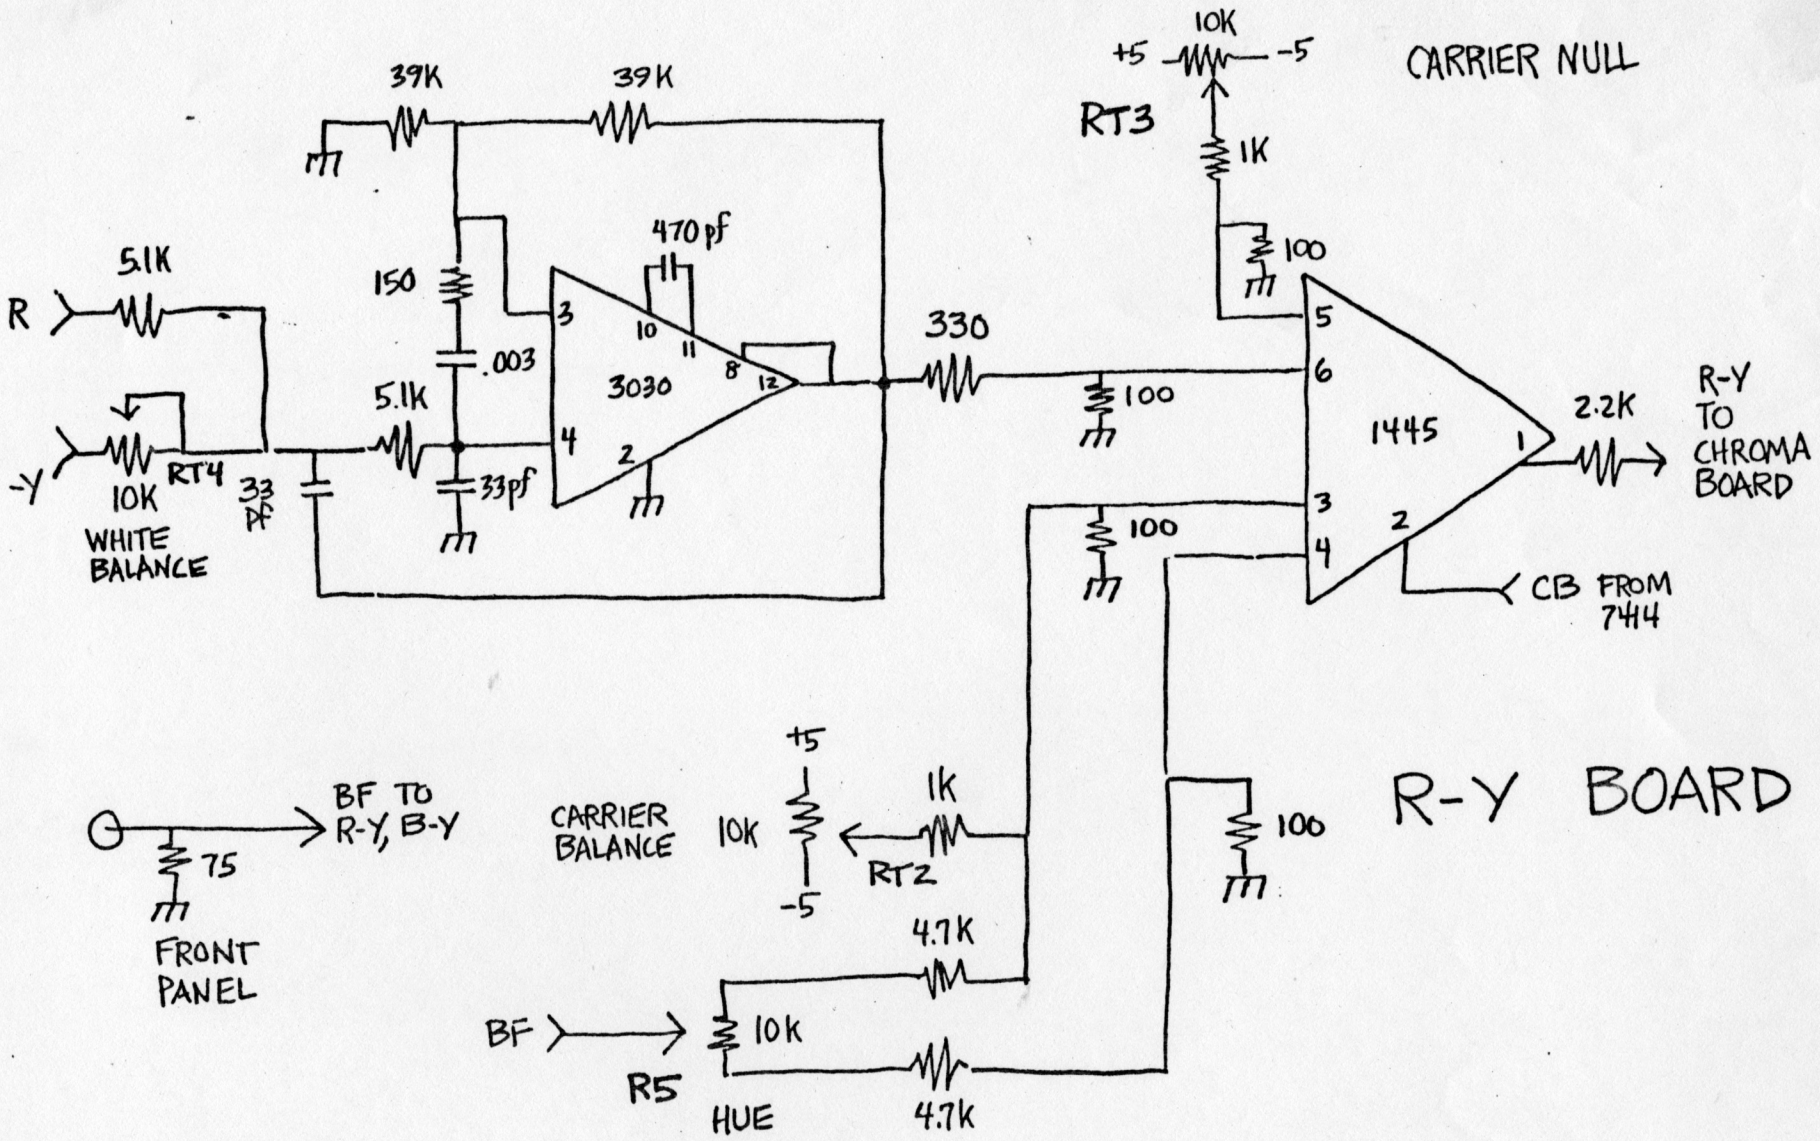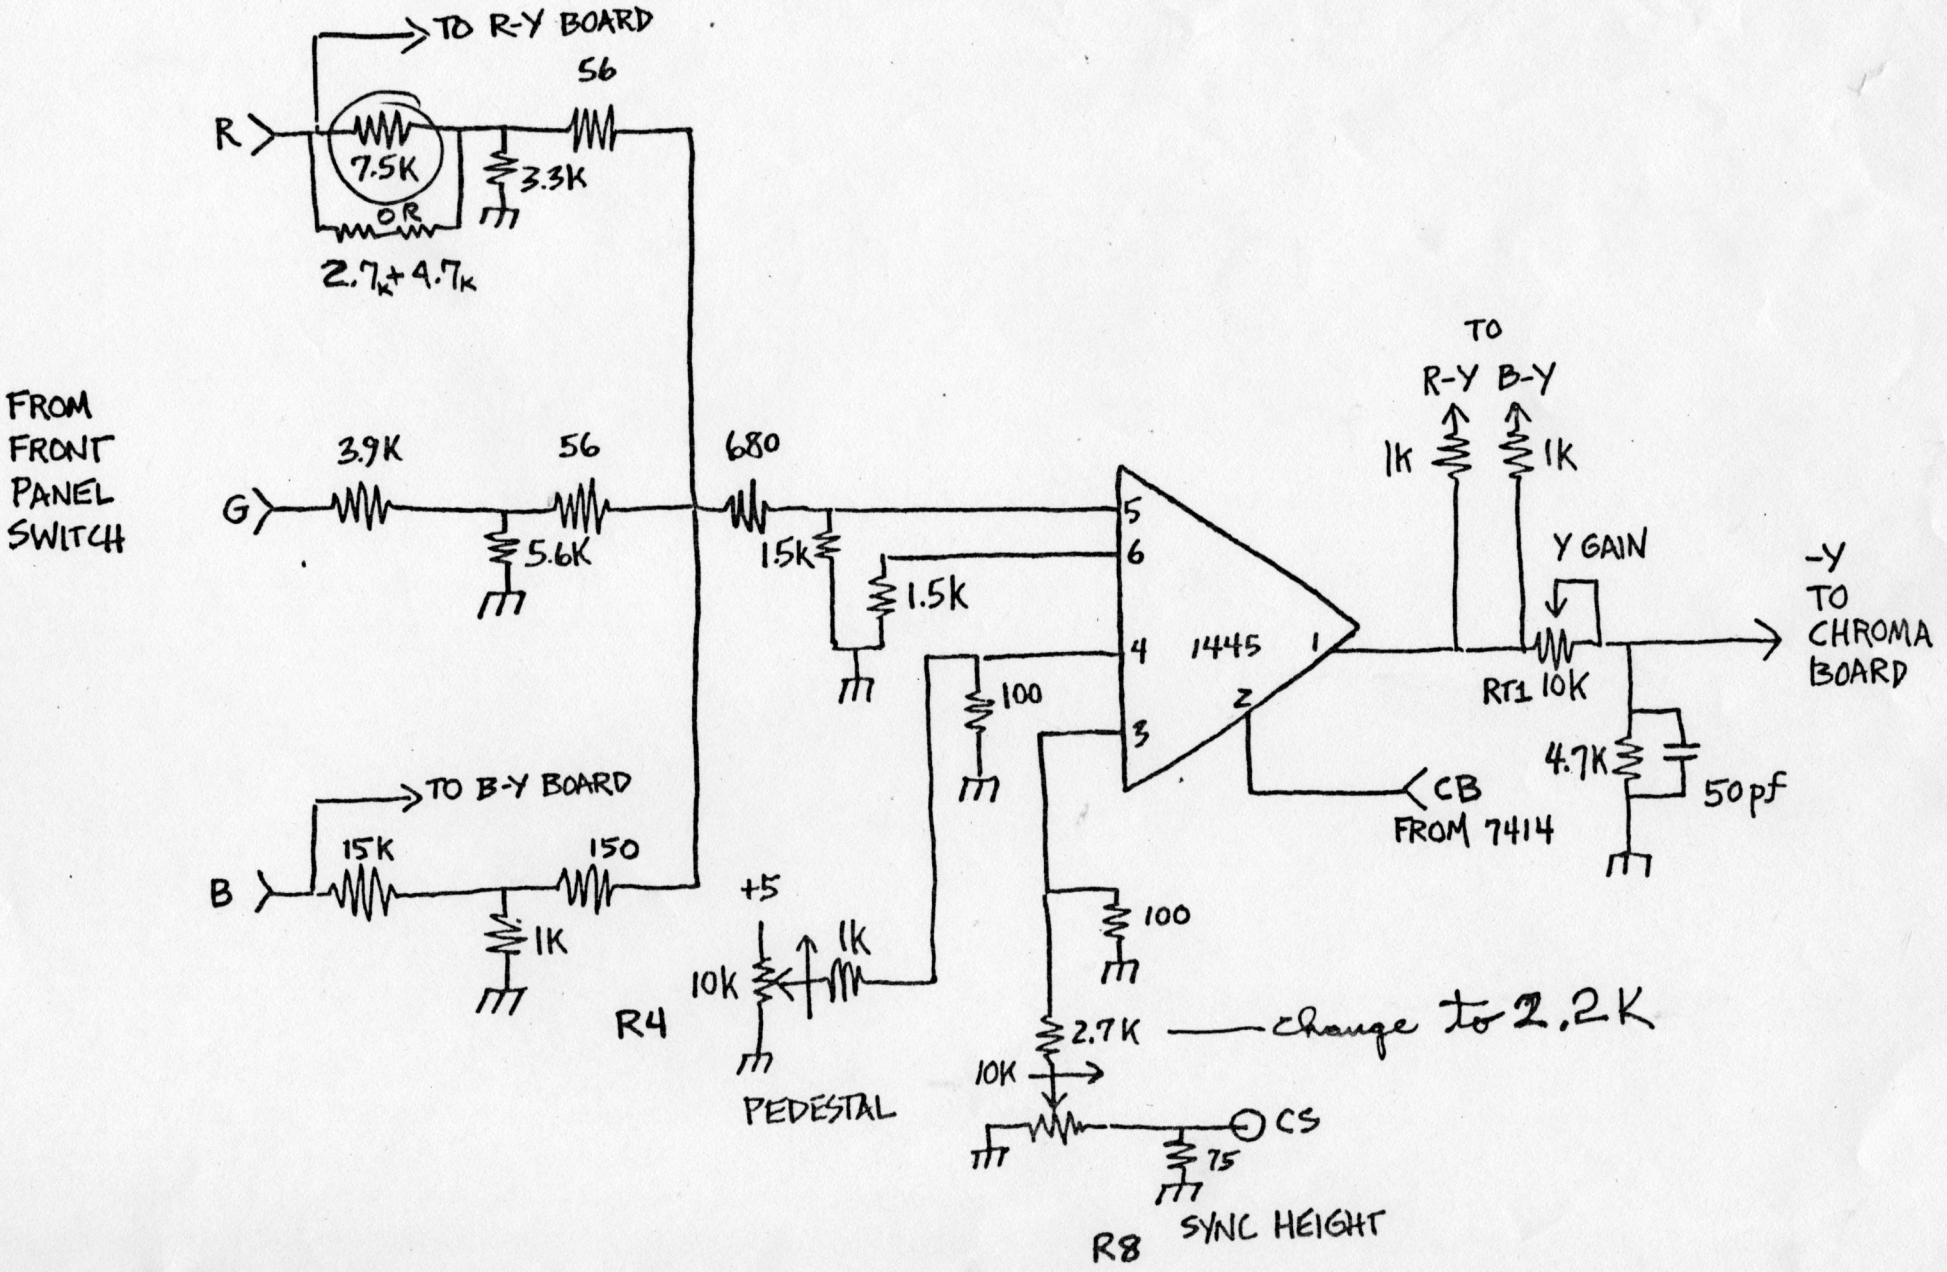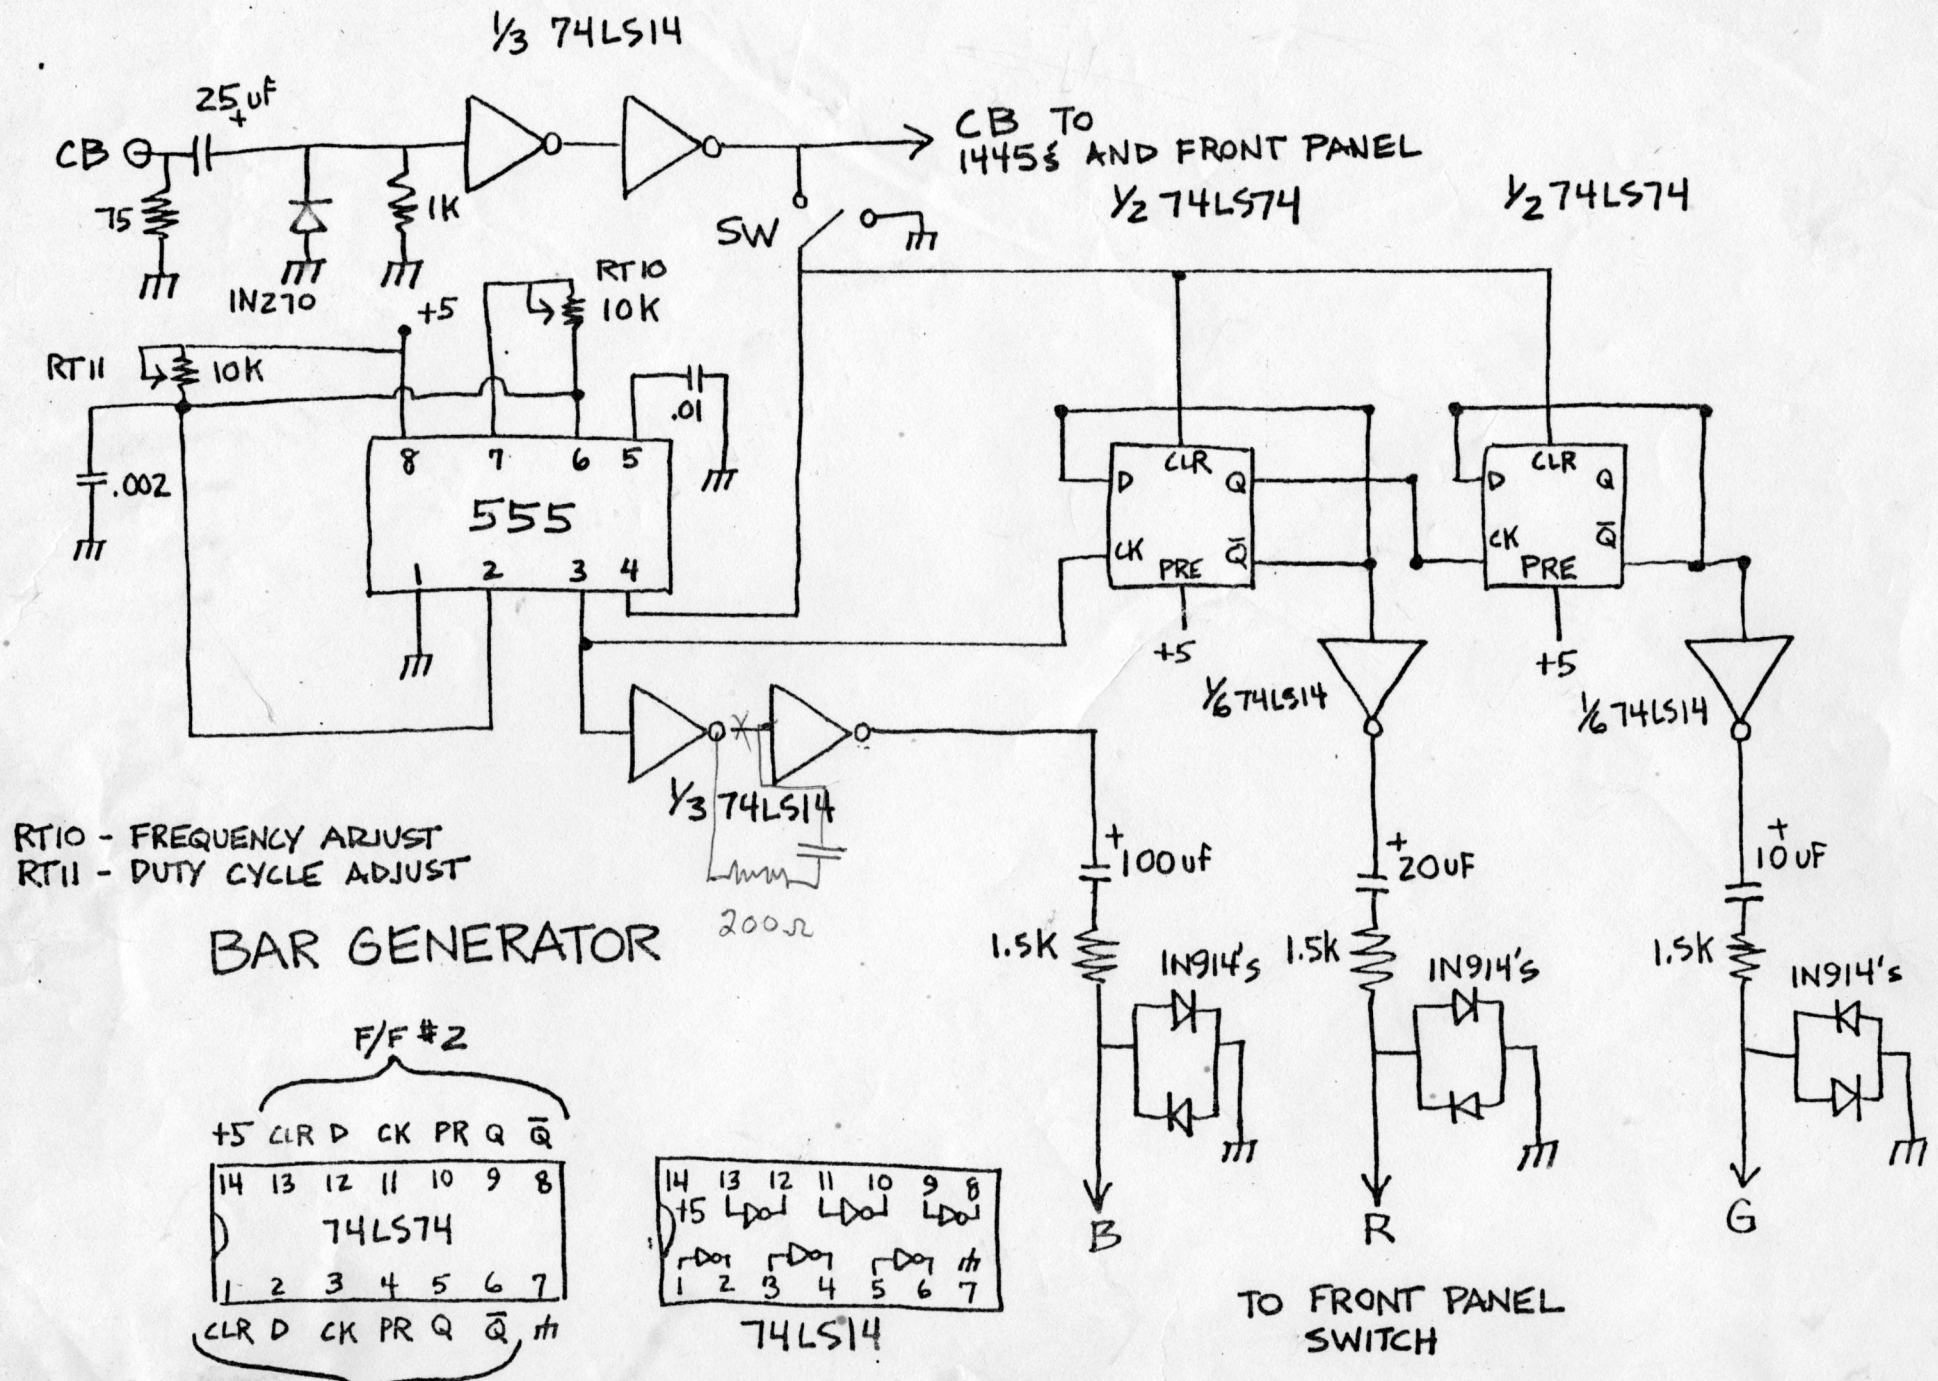


1/3 74LS14
25 uF
CB
75
IN270
1K
SW
CB TO 1445 & AND FRONT PANEL
1/2 74LS74
1/2 74LS74
RT10 10K
+5
RT11 10K
.01
.002
8 7 6 5
555
1 2 3 4
CLR
D
CK
PRE
Q
Q̄
+5
1/6 74LS14
1/6 74LS14
1/3 74LS14
200Ω
+ 100 uf
+ 20UF
+ 10 UF
1.5K
IN914's
1.5K
IN914's
1.5K
IN914's
B
R
G
TO FRONT PANEL SWITCH
RT10 - FREQUENCY ADJUST
RT11 - DUTY CYCLE ADJUST
BAR GENERATOR
F/F #2
+5 CLR D CK PR Q Q̄
14 13 12 11 10 9 8
74LS74
1 2 3 4 5 6 7
CLR D CK PR Q Q̄
F/F #1
14 13 12 11 10 9 8
+5
1 2 3 4 5 6 7
74LS14

NOTE: USE SHIELDED CABLE
FOR 3.58 AND OUTPUT

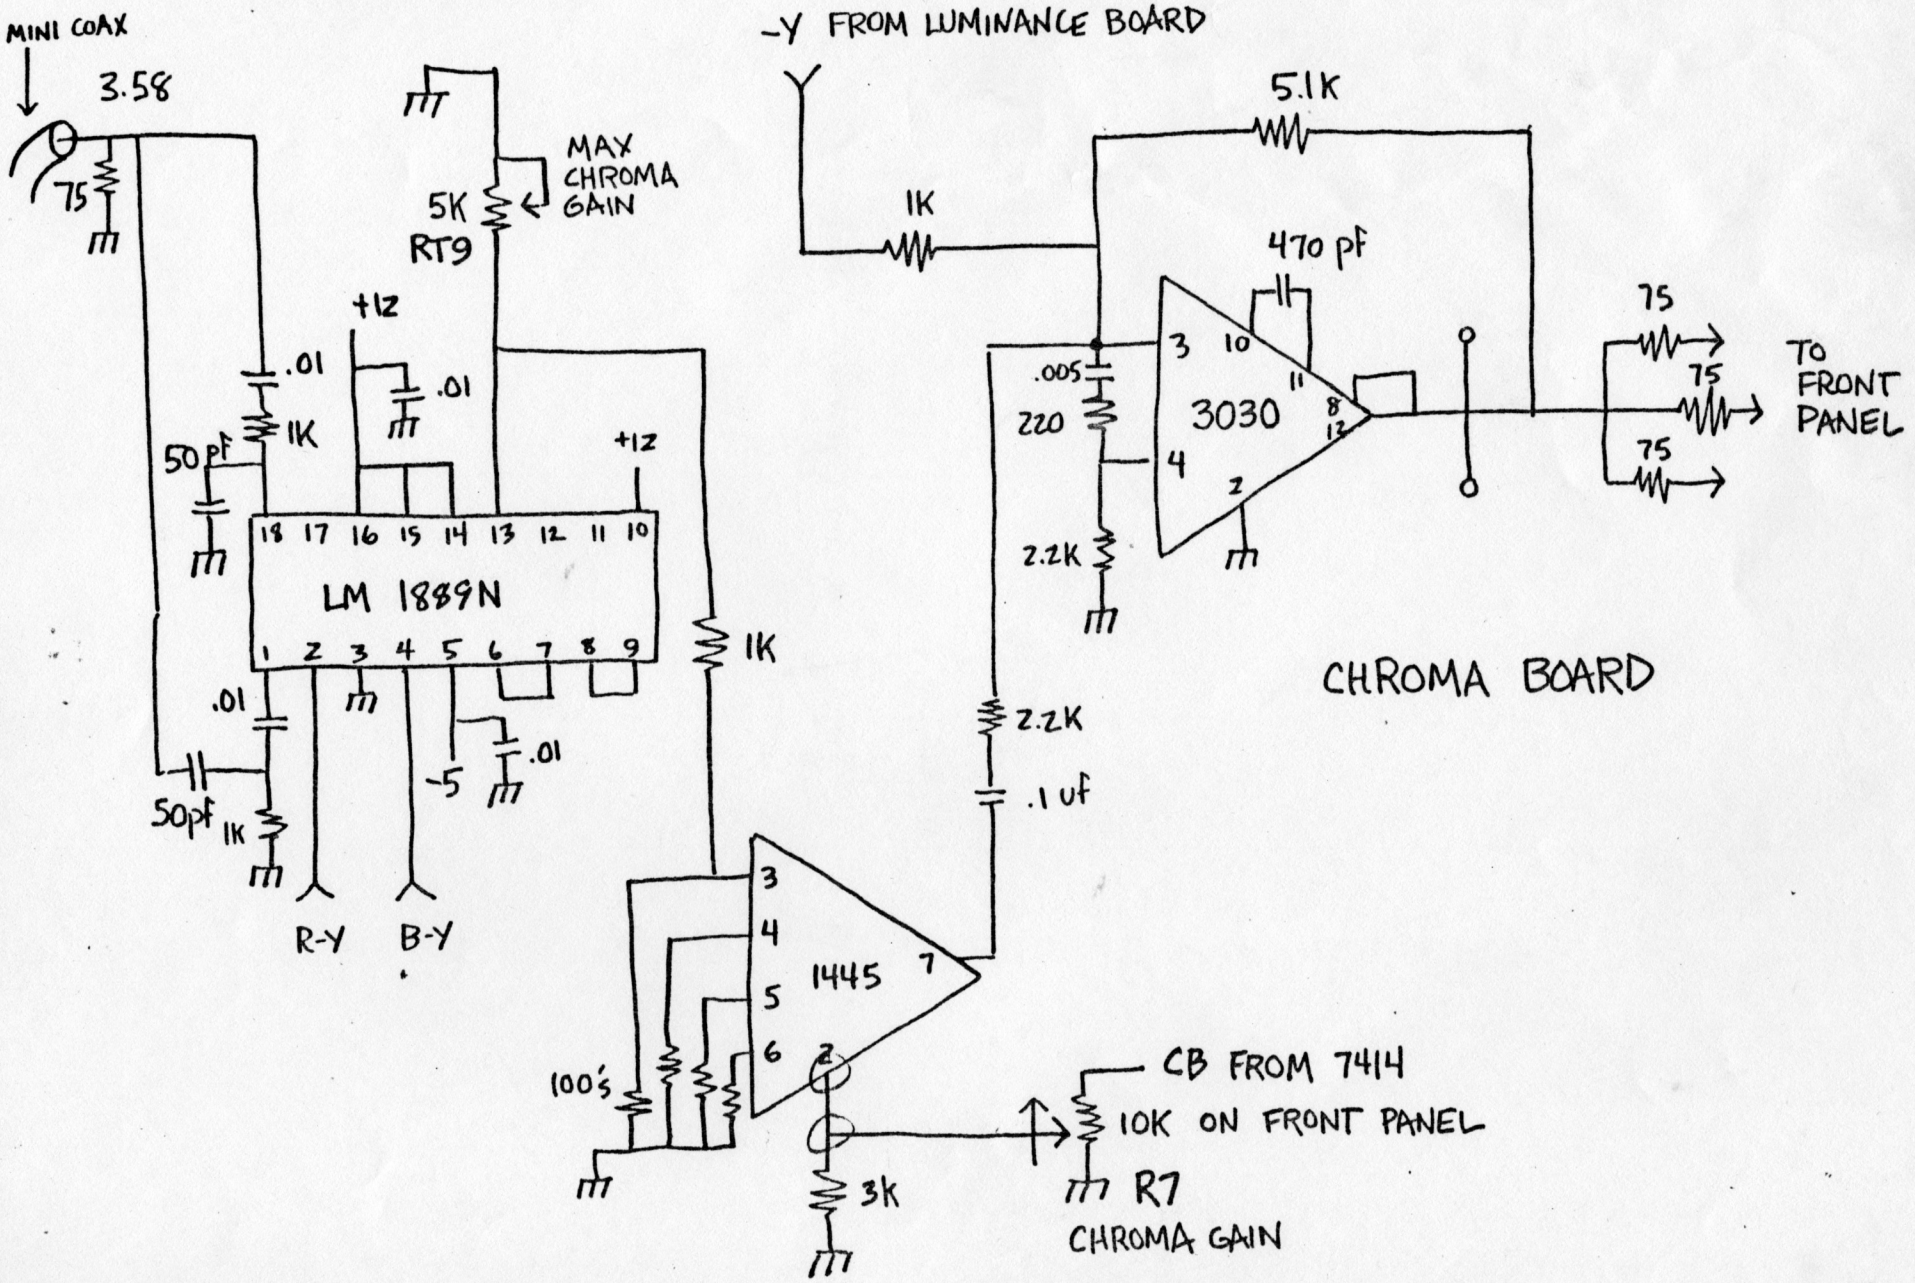

POWER SUPPLY

The power supplies are purchased modules and should come with complete documentation; if not request from LAMDA.

In the IP, power supply regulation and high frequency transient response are critical. Substitution of other power supply modules is NOT recommended.

In each box all corresponding terminals of the 10 pin Jones connector are connected together.

The output of the power supplies are connected to the appropriate pin of one of the connectors.

In box one, the binding post terminals are connected to the appropriate 10 pin Jones.

A cable with two male Jones plugs and corresponding pins connected together is used to communicate power between the boxes.

One side of each box should be covered with perferated metal or screen to allow for ventilation. This side should never be blocked to prevent ventilation. DO NOT let transistors touch screen.

The 110 v. AC which powers the power supplies is the only potentially lethal voltage in the IP. BE CAREFUL AND WATCH YOUR FINGERS.

--Box one contains +12, -12 power supplies.
--Box two contains +5, -5, +14 power supplies.

NOTICE: --+14 volt power supply needed for Color Encoder only!
(not needed for black and white operation.)


AC PLUG SYSTEM

WATCH ALL OF THIS STUFF!!!
SOMEONES LIFE MAY DEPEND ON IT!!!

BLACK (HOT) ≈ 120V. ABOVE GROUND

WHITE ≈ GROUND

GREEN — CHASSIS GROUND (EVENTUALLY CONNECTED TO EARTH (PLANET) (WATER-SYSTEM)...

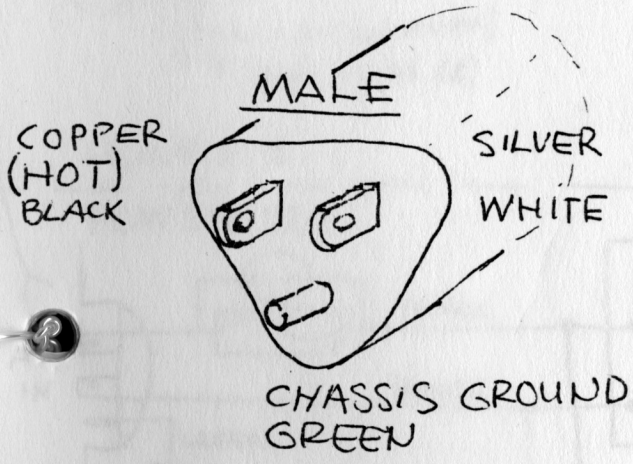


BLACK IS HOT LINE. THIS IS THE ONE WIRE THAT GOES THROUGH FUZE AND SWITCH.

WHITE IS RETURN.

GREEN IS CONNECTED TO METAL BOX. THIS SOMETIMES IS DONE IN THE FIXTURE ITSELF.

SILVER IS EQUIVALENT TO WHITE ON CONNECTORS.

COPPER IS EQUIVALENT TO BLACK ON CONNECTORS.

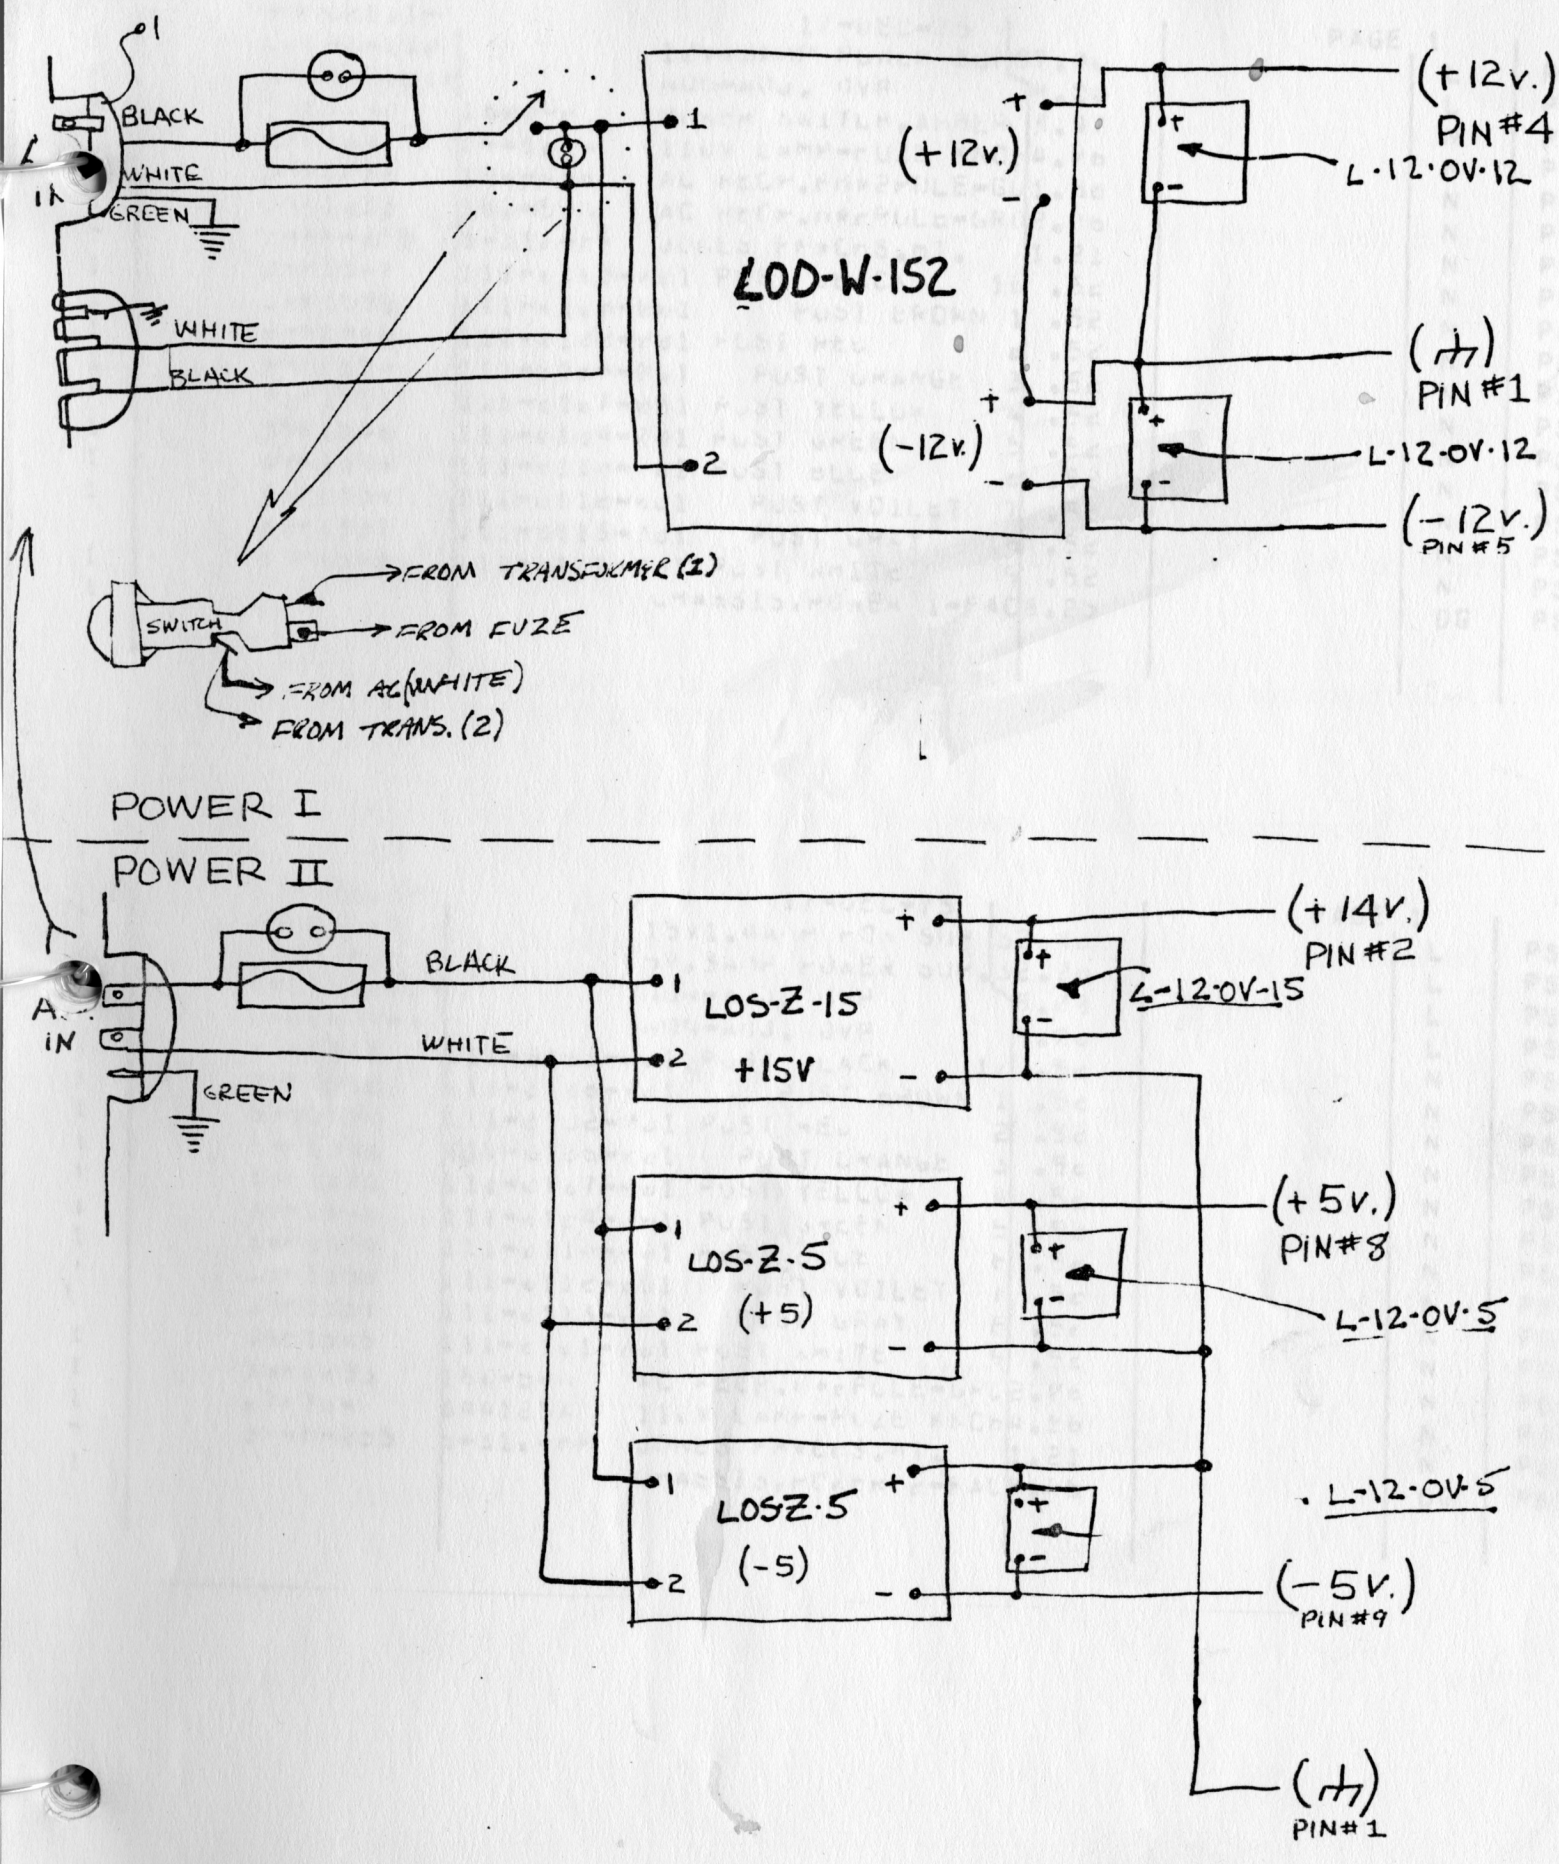
1
BLACK
WHITE
GREEN
WHITE
BLACK
LOD-W-152
(+12v.)
(-12v.)
(+12v.)
PIN #4
L-12-0V-12
(⏚)
PIN #1
L-12-0V-12
(-12v.)
PIN #5
FROM TRANSFORMER (1)
SWITCH
FROM FUZE
FROM AC (WHITE)
FROM TRANS. (2)
POWER I
POWER II
BLACK
WHITE
GREEN
LOS-Z-15
+15V
(+14V.)
PIN #2
L-12-0V-15
LOS-Z-5
(+5)
(+5v.)
PIN #8
L-12-0V-5
LOSZ-5
(-5)
L-12-0V-5
(-5V.)
PIN #9
(⏚)
PIN #1