1335 Swindon NEV, Old Vicarage Lane

Road Safety Audit Stage 1/2 – Designers Response
8th September 2022

1 Project Details

Report title	Stage 1/2 Road Safety Audit
Date	September 2022
Document reference and revision	1335-DR02 Revision 1
Prepared by	Brookbanks
On behalf of	Hallam Land Taylor Wimpey

Table 1-1: Project details

Project		Swindon NEV Old Vicarage Lane
Report title		Stage 1/2 Road Safety Audit
Prepared by	Name	Christian McArdle
	Position	Senior Engineer
	Signed	C.McArdle
	Organisation	Brookbanks
	Date	17th May 2024
Approved by	Name	Siobhan Murphy
	Position	Associate Director
	Signed	S. Murphy
	Organisation	Brookbanks
	Date	22nd May 2024

Table 1-2: Authorisation sheet

2 Introduction

2.1 This report responds to a Stage 1/2 Road Safety Audit (RSA) for an existing road to be amended to allow for access from Old Vicarage Lane to the spine road for the proposed Swindon NEV developments at South Marston. The works include realigning Old Vicarage Lane to connect to the proposed South Marston Primary Street, with another junction connecting Old Vicarage Lane back to its existing alignment.

2.2 The representatives from the design organisation who prepared this RSA response report are as follows:

- Christian McArdle
- Siobhan Murphy

3 Key personnel

Overseeing organisation	Swindon Borough Council
RSA team	Paul Salmon – Audit Team Leader Caroline Shakespreare – Audit Team Member
Design organisation	Brookbanks

Table 3-1: Key personnel

4 Road Safety Audit decision log

Stage 1/2 Road Safety Audit DESIGNER'S ROAD SAFETY AUDIT RESPONSE **Scheme Name:** Swindon NEV, Old Vicarage Lane			
The issues categorised in this road safety audit as 'Problem' matters are those causing serious concern and are summarised below. The purpose of this form is for the scheme Designer or Overseeing Organisation to respond to the 'Problem' matters. Responses should be returned to Traffic Management Consultants. 'Comments' in this report are made for the benefit of the Designer and are not referred to below.			
RSA Matter	**Summary of RSA Problem**	**Designer's Response**	**Overseeing Authority Response**
3.1	Re-design the highway alignment to suit the existing speed limit (i.e., 60mph); or change the speed limit of this section of road to suit the necessary design parameters.	Road will become a 30mph road once construction has been completed. This will commence from the A420 signalised junction and continue to Thornhill roundabout.	
3.2	Install corduroy paving at this location.	Corduroy paving to be shown in future works when area is designed to north-east.	
3.3	Provide tactile paving across the full width of the crossing point and to a depth of 1,200mm.	Tactile paving depth extended to 1.2m provide extra protection. Width of tactiles is shown across dropped kerb extents.	
3.4	Ensure adequate intervisibility is available for all approaching drivers at this location.	Visibility splays shown for Carpenters Arms on drawing.	
3.5	Provide corduroy paving at the junction of the footpath link and the proposed segregated footway / cycleway route. A route across the cycleway should also be provided to guide pedestrians to the footway side of the segregated route.	Corduroy paving added at this area in accordance with document 'Guidance on the use of tactile paving surfaces'.	

3.6	Provide corduroy paving at the footpath link prior to crossing Old Vicarage Lane.	Corduroy paving added at the crossing point to the pub.	
3.7	Provide matching tactile paving and road markings at all required locations.	Tactiles have been proposed in accordance with the document 'Guidance on the Use of Tactile Paving Surfaces'.	
3.8	Provide measures to prevent motor vehicle access to the footway / cycleway at this location.	Bollards have been agreed with local council and are to be shown on the drawings to prevent motor access to the footway-cycleway.	
3.9	If the intention is to transition pedestrians into the main carriageway, corduroy warning paving should be provided at the transition between footway and carriageway to warn visually impaired pedestrians of the change of usage.	Area to be designed in future works and include correct provision. A footpath link will be provided for movements north through Rowborough Lane and pedestrians won't be required to enter the main carriageway.	
3.10	Undertake swept path analysis of this proposed junction re-alignment to ensure all likely vehicles types can manoeuvre safely and efficiently through it.	Junction has been tracked and successful movements are shown on '1335-S278-OVL-100-106F-107F-120A-121 - Vehicle Tracking'. Existing junction radii's have also been improved with the proposed design.	
3.11	Provide a link between the proposed segregated footway / cycleway and the north-west section of Old Vicarage Lane on the cyclists' desire line.	Cyclists will be encouraged to cross at the cycle crossing point just further eastwards instead of at this point. There is no proposal for a cycle path being added to the north west section so a crossing would not be encouraged. Cyclists who want to travel north west will join on the carriageway at the crossing point.	
3.12	Ensure sufficient visibility is available for all road users.	Shared space visibility has been added to drawing reference '1335-S278-OVL-100-113'.	

3.13	Ensure required visibility splays are available and kept clear.	Visibility to remain clear of vegetation and any other obstruction.	
3.14	Ensure appropriate stopping sight distances are provided for both vehicles emerging from side road junctions and at pedestrian / cycle crossing points, in accordance with the design speed of approaching traffic.	Stopping sight distances are shown in accordance with Manual for Streets for 30mph roads. The junction towards the east of OVL will also be 30mph. Pedestrian/shared space visibility splays have been demonstrated on drawing '1335-S278-OVL-100-113' in accordance with LTN 1/20 and CD 143 guidance.	
4.1	Ensure proposed landscaping does not hinder access to the proposed lighting columns.	Landscaping and lighting to be designed in accordance with each other.	
4.2	Ensure proposed landscaping does not hinder the effectiveness of proposed lighting columns.	As above.	
5.1	Install signage at this location.	Segregated cycleway and end of cycle route signs added to this location.	
5.2	Provide signage at the junction of the footpath link and the proposed segregated footway / cycleway route.	Sign added in location to show end of cycle route to dia. 965. Road markings to dia. 1057 added to provide pedestrians with clear identification of cycle route. Continuous profile marking to dia 1049B also used as a separator throughout the cycle route.	
6.1	Ensure manhole covers have high-friction covers.	Manholes are no longer proposed across junctions due to a strategy change, so the point is now not considered an issue.	

5 Design organisation and overseeing organisation statements

On behalf of the design organisation I can certify that: **1) The RSA actions identified in response to the road safety audit problems in this road safety audit have been discussed and agreed with the overseeing organisation.**	
Name	Siobhan Murphy
Position	Associate Director
Signed	SMurphy
Organisation	Brookbanks
Date	08/09/22

Table 5-1: Design organisation statement

On behalf of the overseeing organisation I can certify that: **1) The RSA actions identified in response to the road safety audit problems in this road safety audit have been discussed and agreed with the design organisation; and** **2) The agreed RSA actions will be progressed**	
Name	
Position	
Signed	
Organisation	
Date	

Table 5-2: Overseeing organisation statement

Appendix A - Stage 1/2 RSA

Cole Easdon

STAGE 2 ROAD SAFETY AUDIT

Proposed Section 278 Works at Old Vicarage Lane, South Marston, Swindon on Behalf of the Swindon EDA Consortium

Date: September 2022
Issue No. 1

DOCUMENT ISSUE RECORD

Client: **Swindon EDA Consortium**

Project: **Proposed Section 278 Works at Old Vicarage Lane, South Marston, Swindon**

Job Number: **8852**

Document Title: **Stage 2 Road Safety Audit**

Issue No.	1			
Date	September 2022			
Description / Status	Issue for Designer's Response			
Prepared	P. Salmon MCIHT MSoRSA			
Technical Check	C. Shakespeare BA (Hons) MCIHT			
Authorised	J. B. Farmery MEng CEng MICE MCIHT ICE Health & Safety Registered			
Document Check				

The methodology adopted and the sources of information used by Cole Easdon Consultants Limited (CE) in providing its services are outlined within this Report. Any information provided by third parties and referred to herein has not been checked or verified by CE, unless otherwise expressly stated within this Report. This Report was checked and approved on the date shown in the Document Issue Record and the Report (including its base information, adopted parameters and assessment methodology) is therefore valid on this date. Circumstances, regulations, assessment methodology and professional standards do change which could subsequently affect the validity of this Report.

All intellectual property rights in or arising out of or in connection with this Report are owned by CE. The Report has been prepared for the Client named on the Document Issue Record who has a licence to copy and use this Report only for the purposes for which it was prepared and provided. The licence to use and copy this Report is subject to other Terms & Conditions agreed between CE and the Client. This document cannot be assigned or transferred to any third party and no third party may rely upon this document nor shall CE have any liability to any third party for the contents of this Report without the express written agreement of both CE and the Client.

CONTENTS

SECTION	HEADING	PAGE NO.
1.0	INTRODUCTION	1
2.0	AUDIT BRIEF	3
3.0	VEHICULAR & HIGHWAY ASPECTS OF DESIGN	4
4.0	STREET LIGHTING	10
5.0	ROAD MARKINGS & SIGNAGE	11
6.0	SURFACE WATER DRAINAGE	12
7.0	EMERGENCY ACCESS	13
8.0	AUDIT STATEMENT	14
9.0	DESIGNER'S, ADOPTING AUTHORITY & AUDITOR'S RESPONSES TO STAGE 2 ROAD SAFETY AUDIT	15

APPENDICES

Appendix 1 – Audit Reference Plan

1.0 INTRODUCTION

1.1 This *Stage 2 Road Safety Audit* has been prepared by Cole Easdon Consultants Limited (CE) on behalf of the Swindon EDA Consortium.

Scope of Study

1.2 This *Stage 2 Road Safety Audit* Report identifies safety concerns and recommendations with respect to the Proposed Section 278 Works at Old Vicarage Lane, South Marston, Swindon. The *Stage 2 Road Safety Audit* has been carried out independently by Paul Salmon (Audit Team Leader) and Caroline Shakespeare (Audit Team Member) both of Cole Easdon Consultants. The Audit Team has had no involvement in the design of the scheme being audited or discussed any safety concerns raised in the Report with members of the Design Team.

Audit Site Visit and Plan Examination

1.3 A site visit was undertaken by the Audit Team on Monday 26th September 2022 at 9.00am. Weather conditions were overcast and dry. The road surface was dry. Traffic flows were low, no pedestrian or cyclist movements were observed. The Audit also comprised an examination of the following documents provided by Brookbanks:

- 1335-S278-OVL-100-101D-General Arrangement
- 1335-S278-OVL-100-104D-Finishes Plan
- 1335-S278-OVL-1100-101D - Kerbs, Footways and Paved Areas
- 1335-S278-OVL-1200-101B-Traffic Signs and Road Markings Plan
- 1335-S278-OVL-700-001B Road Pavement Layout
- 1335-S278-OVL-100-106C - Vehicle Tracking Public Service Vehicle
- 1335-S278-OVL-100-151 Standard Details Sheet 1 of 4
- 1335-S278-OVL-100-152 Standard Details Sheet 2 of 4
- 1335-S278-OVL-100-153 Standard Details Sheet 3 of 4
- 1335-S278-OVL-100-154 Standard Details Sheet 4 of 4
- 1335-S278-OVL-1300-100B Lighting Layout
- 1335-S278-OVL-500-100B Drainage Layout
- 1335-S278-OVL-800-101B-Strings, Chainages & Proposed Contours
- 1796-L-102 to 113 LANDSCAPE DESIGN rev D

1.4 This Report comments only on issues raised in carrying out the *Stage 2 Road Safety Audit*. The Auditors have examined and reported only on the road safety implications of the scheme arising from the site visit and review of the drawings referred to above. The Auditors have not examined or verified the compliance of the design with any other criteria.

1.5 Personal injury accident data has not been provided for consideration within this Audit. A review of the Crashmap.co.uk website indicates no accidents were reported within the area to be audited in the most recent five-year period.

1.6 Copies of all Road Safety Audits must be retained. All comments and recommendations must be investigated, subsequent decisions/actions must be logged, and a formal record kept of all responses.

1.7 It is the Project Sponsor's responsibility to advise the Audit Team Leader if any Problem / Recommendation is not accepted. The Project Sponsor should then supply a copy of each signed Exception Report to the Audit Team Leader, for information.

1.8 The terms of reference of the Audit are based on *Guidelines for the Safety Audit of Highway Schemes* published by the Institution of Highways and Transportation, other guidance references are the *Traffic Signs Regulations and General Directions 2016*, and *GG 119 – Road Safety Audit from the Design Manual for Roads & Bridges*.

2.0 AUDIT BRIEF

2.1 The Audit Team were not provided with an audit brief as approved by the overseeing local authority.

2.2 The project relates to the proposed Section 278 (S278) Works at Old Vicarage Lane, South Marston, Swindon

2.3 The proposals include re-alignment of a length of Old Vicarage Lane, provision of off-carriageway footway & cycleway facilities, provision of four new junctions and the re-alignment of an existing junction at Rowborough Lane.

2.4 Old Vicarage Lane is currently subject to the national speed limit along the length subject to this audit, changing to 30mph at the western extent of the study area. It would appear from the signage drawing provided to the Audit Team that the intention is to extend the 30mph speed limit east to a point immediately east of The Carpenter's Arms public house.

3.0 VEHICULAR & HIGHWAY ASPECTS OF DESIGN

Safety Concern

3.1 Location: Proposed junction west of railway bridge

Summary: Risk of vehicle loss of control

Old Vicarage Lane is currently subject to the national speed limit (60mph) along the length subject to this audit and up to the junction with the A420. It would appear from the signage drawing provided to the Audit Team that the intention is to extend the 30mph speed limit east to a point immediately east of The Carpenter's Arms public house. The assumption is that the section of proposed re-aligned road from a point shown on the drawing to the immediate west of the rail bridge, that travels west and then turns north, will remain subject to the national speed limit. The curvature of the realigned road would appear to be too tight for vehicles to safely negotiate at this higher speed. Vehicles may lose control should they attempt to drive at or near the posted speed limit.

Recommendation

3.1.1 Re-design the highway alignment to suit the existing speed limit (i.e. 60mph); or change the speed limit of this section of road to suit the necessary design parameters.

Safety Concern

3.2 Location: Proposed footway / shared route junction, east end of scheme

Summary: Risk of pedestrian injury

At the eastern end of the proposed scheme, on the northern side of the carriageway, there appears to be a proposed footway joining a proposed shared use footpath / cyclepath. No corduroy paving appears to be shown on the drawings provided to the Audit Team to warn visually impaired pedestrians of the change of use.

Recommendation

3.2.1 Install corduroy paving at this location.

Safety Concern

3.3 Location: Proposed segregated footway / cycleway route crossing point, east end of scheme

Summary: Risk of pedestrian injury

At the eastern end of the proposed scheme, the proposed segregated footway / cycleway crosses Old Vicarage Lane by means of an informal crossing point, the alignment of such would appear to be an in-line arrangement. A visually impaired person walking at speed may not pick up the tactile paving arrangement as detailed as it does not extend across the full width of the

route and would appear to be only 800mm in depth. This may result in visually impaired pedestrians entering the carriageway.

Recommendation

3.3.1 Provide tactile paving across the full width of the crossing point and to a depth of 1,200mm.

Safety Concern

3.4 Location: The Carpenter's Arms public house, vehicular access

Summary: Risk of collision

The frontage / access to The Carpenter's Arms public house has not been shown on the plans provided to the Audit Team. It is unclear whether there is suitable separation between the entry to the public house frontage / car park and the proposed junction to ensure adequate intervisibility is available for all approaching drivers at this location, particularly at the eastern end of the public house frontage, adjacent to a hedge.

Recommendation

3.4.1 Ensure adequate intervisibility is available for all approaching drivers at this location.

Safety Concern

3.5 Location: Proposed segregated footway / cycleway route, (assumed) crossing point to The Carpenter's Arms public house

Summary: Risk of pedestrian injury

There is a spur shown from the proposed segregated footway / cycleway route in the approximate location of The Carpenter's Arms public house. It is assumed by the Audit Team that this is to be a crossing to the public house. Given the width shown on the plans, it is also assumed to be a pedestrian link and not a shared one. On crossing from the public house to gain access to the proposed segregated footway / cycleway route, this pedestrian link will join on the cycle side of the segregated route. Visually impaired pedestrians may enter into the cycleway into the path of an oncoming cyclist unaware of the designer's intention at this location.

Recommendation

3.5.1 Provide corduroy paving at the junction of the footpath link and the proposed segregated footway / cycleway route. A route across the cycleway should also be provided to guide pedestrians to the footway side of the segregated route.

Safety Concern

3.6 Location: Proposed segregated footway / cycleway route, (assumed) crossing point to The Carpenter's Arms public house

Summary: Risk of pedestrian injury

There is a spur shown from the proposed segregated footway / cycleway route in the approximate location of The Carpenter's Arms public house. It is assumed by the Audit Team that this is to be a crossing to the public house. Given the width shown on the plans, it is also assumed to be a pedestrian link and not a shared one. On crossing to the public house from the proposed segregated footway / cycleway route, pedestrians are not warned that they will be entering a shared space (the highway and then the public house car park), and may not take suitable care.

Recommendation

3.6.1 Provide corduroy paving at the footpath link prior to crossing Old Vicarage Lane.

Safety Concern

3.7 Location: Proposed segregated footway / cycleway route, west of proposed new junction

Summary: Risk of loss of control / pedestrian injury

A proposed segregated footway / cycleway route has been shown on the northern side of Old Vicarage Lane, immediately to the west of the proposed side road. The road markings and tactile paving shown on entry to this segregated route when crossing from the southern side of Old Vicarage Lane contradict each other; the transverse tactile paving is shown on the same lane as the cycle symbol.

Recommendation

3.7.1 Provide matching tactile paving and road markings at all required locations.

Safety Concern

3.8 Location: Severed section of Old Vicarage Lane

Summary: Risk of cycle / pedestrian injury

It is proposed to sever a section of Old Vicarage Lane, between the proposed side road and Rowborough Lane. A priority junction is to be provided to allow vehicular access to this length of road to retain access to an existing property at this location. There is also a proposed segregated footway / cycleway route shown immediately to the west of the proposed side road. The segregated footway / cycleway route would appear to run into the length of severed section of Old Vicarage Lane. There does not appear to be any segregation between the segregated footway / cycleway route and the length of severed section of Old Vicarage Lane to prevent motor vehicle entry to the footway / cycleway facility.

Recommendation

3.8.1 Provide measures to prevent motor vehicle access to the footway / cycleway at this location.

Safety Concern

3.9 Location: Rowborough Lane

Summary: Risk of pedestrian injury

It is proposed to re-align the junction of Old Vicarage Lane and Rowborough Lane. The drawings provided to the Audit Team indicate the provision of a footway on the eastern side of the re-aligned junction. There is currently no pedestrian provision along Rowborough Lane for this proposed footway to connect to. Pedestrians that use this footway will need to enter the main carriageway to continue north-east. Visually impaired pedestrians may not be aware of the change in usage.

Recommendation

3.9.1 If the intention is to transition pedestrians into the main carriageway, corduroy warning paving should be provided at the transition between footway and carriageway to warn visually impaired pedestrians of the change of usage.

Safety Concern

3.10 Location: Rowborough Lane

Summary: Risk of collision

It is proposed to re-align the junction of Old Vicarage Lane and Rowborough Lane. The drawing provided to the Audit Team indicates that the width of highway at this location will be 4-4.5m. Rowborough Lane currently leads to light engineering premises a short distance to the north-east of this location. No swept path analysis has been supplied to the Audit Team to demonstrate the manoeuvres of the vehicle types likely to use this junction in connection with the nearby businesses. It is unclear whether mid-to-large vehicles could safely manoeuvre through this junction without encroaching into oncoming traffic or the proposed adjacent footway.

Recommendation

3.10.1 Undertake swept path analysis of this proposed junction re-alignment to ensure all likely vehicles types can manoeuvre safely and efficiently through it.

Safety Concern

3.11 Location: Re-aligned Old Vicarage Lane

Summary: Risk of cycle injury

It is proposed to re-align Old Vicarage Lane, introducing a new priority junction at a point south of Rowborough Lane. There does not appear to be provision for cyclists travelling east or west along the proposed segregated footway / cycleway to gain entry to the section of Old Vicarage Lane that will remain to travel on to the existing village. Cyclists wishing to travel this route may attempt to cross the swale and full height kerbs, which may result in loss of control injuries.

Recommendation

3.11.1 Provide a link between the proposed segregated footway / cycleway and the north-west section of Old Vicarage Lane on the cyclists' desire line.

Safety Concern

3.12 Location: General

Summary: Risk of cycle injury

Visibility splays have been indicated at a number of locations for motor vehicle and pedestrians; cycle visibility splays have not been indicated. Cyclists have different 'X' distance requirements than pedestrians and may not have sufficient visibility available to them when at crossing points.

Recommendation

3.12.1 Ensure sufficient visibility is available for all road users.

Safety Concern

3.13 Location: General

Summary: Risk of collision

Visibility splays have been indicated at a number of locations. Some of these splays cross existing vegetation which may be retained and as such may obstruct the visibility splays indicated on the drawings.

Recommendation

3.13.1 Ensure required visibility splays are available and kept clear.

Safety Concern

3.14 Location: General

Summary: Risk of collision

Visibility splays have been indicated at a number of locations. Different stopping sight distances (SSD) have been quoted on the drawings at different locations. It is unclear how an approaching vehicle can stop in a shorter distance when a pedestrian steps into the carriageway, than when a vehicle emerges from a side road.

Recommendation

3.14.1 Ensure appropriate stopping sight distances are provided for both vehicles emerging from side road junctions and at pedestrian / cycle crossing points, in accordance with the design speed of approaching traffic.

4.0 STREET LIGHTING

Safety Concern

4.1 Location: General

Summary: Risk of collision

Street lighting and landscaping plans have been provided to the Audit Team as part of this audit There would appear to be sections of proposed hedgerow along the southern side of Old Vicarage Lane that will encompass a number of proposed street lighting columns. This hedgerow may prevent routine maintenance being undertaken on said columns resulting in their malfunction / in-operation during the hours of darkness, resulting in reduced levels of lighting at night.

Recommendation

4.1.1 Ensure proposed landscaping does not hinder access to the proposed lighting columns.

Safety Concern

4.2 Location: Lighting column proposed adjacent to Tree T56(B)

Summary: Risk of collision

Street lighting and landscaping plans have been provided to the Audit Team as part of this audit There would appear to be a proposed lighting column within the canopy of Tree T56(B). This tree canopy will obstruct the lighting column resulting in reduced levels of lighting during the hours of darkness.

Recommendation

4.2.1 Ensure proposed landscaping does not hinder the effectiveness of proposed lighting columns.

5.0 ROAD MARKINGS & SIGNAGE

Safety Concern

5.1 Location: Proposed footway / shared route junction, east end of scheme

Summary: Risk of pedestrian injury

At the eastern end of the proposed scheme, on the northern side of the carriageway, there appears to be a proposed footway joining a proposed shared use footpath / cyclepath. No signage appears to be shown on the drawings provided to the Audit Team to inform pedestrians of the change of use.

Recommendation

5.1.1 Install signage at this location.

Safety Concern

5.2 Location: Proposed segregated footway / cycleway route, (assumed) crossing point to The Carpenter's Arms public house

Summary: Risk of pedestrian injury

There is a spur shown from the proposed segregated footway / cycleway route in the approximate location of The Carpenter's Arms public house. It is assumed by the Audit Team that this is to be a crossing to the public house. Given the width shown on the plans, it is also assumed to be a pedestrian link and not a shared one. On crossing from the public house to gain access to the proposed segregated footway / cycleway route, this pedestrian link will join on the cycle side of the segregated route. Pedestrians, particularly visually impaired ones, may enter into the cycleway into the path of an oncoming cyclist unaware of the designer's intention at this location.

Recommendation

5.2.1 Provide signage at the junction of the footpath link and the proposed segregated footway / cycleway route.

6.0 SURFACE WATER DRAINAGE

Safety Concern

6.1 Location: Junctions

Summary: Risk of loss of control

There are manhole covers detailed within junctions. These may cause problems for motorcycle/cycle stability when turning, particularly during wet or icy conditions.

Recommendation

6.1.1 Ensure manhole covers have high-friction covers.

7.0 EMERGENCY ACCESS

Commentary

7.1 Emergency vehicle access would appear to be adequate. No swept path analysis has been provided to the Audit Team to demonstrate this.

8.0 AUDIT STATEMENT

8.1 We certify that the drawings and other items listed have been examined with the objective of identifying any features of the design at the *Stage 2 Road Safety Audit* stage that could be removed or modified in order to improve the safety of the scheme. Issues identified have been noted in this Report together with any associated safety suggestions; these are recommended for consideration and implementation. Prior to the request to carry out this Audit, we have not been involved in the detailed design of this scheme.

Cole Easdon Consultants Limited
September 2022

9.0 DESIGNER'S & AUDITOR'S RESPONSE TO STAGE 2 ROAD SAFETY AUDIT

9.1 The issues categorised in this road safety audit as a 'Safety Concern' are those causing serious concern and are summarised below. The purpose of this Section is for the scheme Designer or Overseeing Organisation to respond to the 'Safety Concerns'. Responses should be returned to Cole Easdon Consultants Limited. 'Commentary' points in this Report are made for the benefit of the Designer and are not referred to below.

Stage 2 Road Safety Audit - Designer's Road Safety Audit Response:

Safety Concern Reference No	Summary of Road Safety Concern	Designer's Response
3.1	Design speed at eastern extent of works	
3.2	No corduroy paving proposed at footway junction with footway / cycleway	
3.3	Insufficient tactile paving at crossing point	
3.4	Intervisibility at Public House frontage	
3.5	Possible footway link to shared footway / cycleway	
3.6	Possible crossing point to Public House	
3.7	Mis-matched tactile paving and road markings	
3.8	Possible access to footway / cycleway from Old Vicarage Lane	
3.9	Footway into Rowborough Lane	
3.10	Swept path analysis at re-designed Rowborough Lane junction	
3.11	No cycle link from proposed segregated facility to NW Old Vicarage Lane	
3.12	No cycle visibility splays	
3.13	Obstructed visibility splays	

3.14	Different SSD used	
4.1	Obstructed maintenance panels on lighting columns	
4.2	Obstructed lighting column	
5.1	No signage proposed at footway junction with footway / cycleway	
5.2	No signage at possible footway link to shared footway / cycleway	
6.1	High friction covers on manholes	

Adopting Authority Response:

Safety Concern Reference No.	Adopting Authority Response
3.1	
3.2	
3.3	
3.4	
3.5	
3.6	
3.7	

Safety Concern Reference No.	Adopting Authority Response
3.8	
3.9	
3.10	
3.11	
3.12	
3.13	
3.14	
4.1	
4.2	
5.1	
5.2	
6.1	

Audit Team Response (If required):

Safety Concern Reference No.	Audit Team Response
3.1	
3.2	
3.3	
3.4	
3.5	
3.6	
3.7	
3.8	
3.9	
3.10	
3.11	

Safety Concern Reference No.	Audit Team Response
3.12	
3.13	
3.14	
4.1	
4.2	
5.1	
5.2	
6.1	

Appendix 1
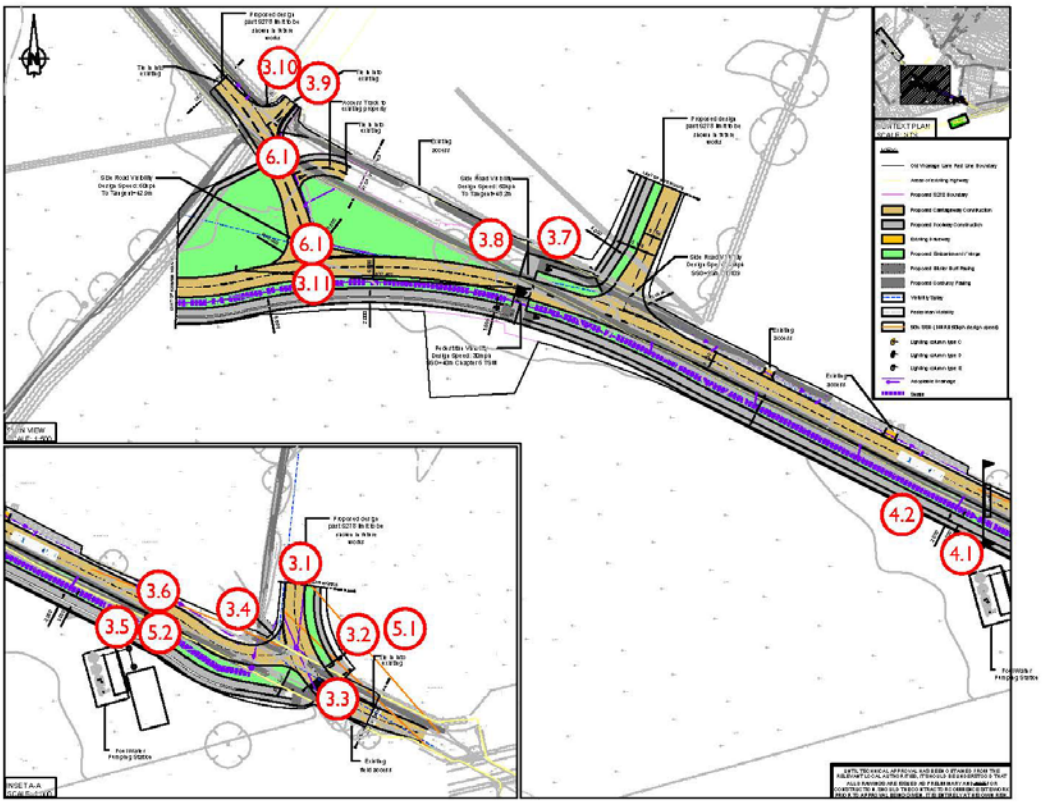
Audit Reference Plan