Stage 1 (Feasibility) Road Safety Audit Report

Parcels R1/R2, South Marston
Section 38 Highway Works
(Designer and Auditor Responses)

Produced for:
Bloor Homes

Date: 13th February 2026

trafficmanagementconsultants@hotmail.co.uk

07771 557382

DOCUMENT REGISTER

Project Name: Parcels R1/R2, South Marston.

Report Title: Stage 1 Road Safety Audit

Date: 13th February 2026

Client: Bloor Homes

Audit Team	Name	Position	Date
Audit Team Leader:	Peter Ronald	Director	13/02/2026
Audit Team Member:	Paul Salmon	Road Safety Auditor	13/02/2026
Approved By:	Peter Ronald	Director	13/02/2026

Revision History					
Revision	Date	Description	Audit Team Leader	Audit Team Member	Approved
-	13/02/2026	Draft	PR	PS	PR
A	13/02/2026	Final	PR	PS	PR
B	25/02/2026	Designer and Auditor Responses	PR		

Prepared By: **Traffic Management Consultants Ltd**
Unit 2
71A Hamilton Road
READING
RG1 5RA
☎07771 557382
✉ trafficmanagementconsultants@hotmail.co.uk

14 Aintree Lane
Liverpool
L10 2JL

Disclaimer

"No part of this report may be copied or reproduced by any means without prior written permission from Traffic Management Consultants. If you have received this report in error, please destroy all copies in your possession or control and notify Traffic Management Consultants.

This report has been prepared for the exclusive use of the commissioning party and unless otherwise agreed in writing by Traffic Management Consultants, no other party may use, make use of, or rely on the contents of the report. If others choose to rely upon this report they do so entirely at their own risk. No liability is accepted by Traffic Management Consultants for any use of this report, other than for the purposes for which it was originally prepared and provided.

Opinions and information provided in the report are based on Traffic Management Consultants using due skill, care, and diligence in the preparation of the same and no explicit warranty is provided as to their accuracy. It should be noted, and it is expressly stated, that no independent verification of any of the documents or information supplied to Traffic Management Consultants has been made."

1. Table of Contents

1. Executive Summary 5
2. Introduction 5
3. Risk Assessment 7
4. Historical Summary 7
5. Existing Environment 7
6. Collision Data 7
7. Survey Information 7
8. Audit Assessment 8
9. Nil Response/Comments 12
10. Non-Motorised User Report (NMU's) 12
11. Audit Team Statement 12
12. Appendix A - List of Documents 12
13. Appendix B - Identified Road Safety Audit Matters Location Plan 13
14. Appendix C – Designer, Overseeing Authority and Auditor Response to Stage 1 RSA 14

1. Executive Summary

1.1 This scheme is promoted by Bloor Homes. This Road Safety Audit is supplied under the provisions of the Safety Audit request dated 3rd February 2026. The overseeing authority is Swindon Borough Council.

2. Introduction

2.1 This report results from a Stage 1 Road Safety Audit carried out of a proposed S38 adoptable highway works for Parcels R1/R2 in South Marston, Swindon .

2.2 **Audit Team Membership**

The Audit Team comprised the following individuals:
Peter Ronald I.Eng, AMICE, MCIHT, MSoRSA, (HE - RSA Cert of Comp).
(Audit Team Leader)

Paul Salmon MCIHT, MSoRSA
(Audit Team Member)

2.3 **Audit Site Visit and Plan Examination**

A site visit was made to the site on Thursday 5th February between 9.30am and 10.00am, by the team. The weather conditions were cloudy with signs of recent rainfall. No traffic, pedestrian or cycle movements were observed. The site is currently under construction with limited access.
The Audit also comprised an examination by the team of the drawings provided by Bloor Homes and any additional support documents completed by the Audit Team as listed in Appendix A. All safety issues are with reference to the outline design details shown on the drawing.

2.4 **Strategic Decisions**

The Audit Team has not been advised of any Strategic Decisions made by the local Highway Authority or by the local Planning Authority.

2.5 **Audit Brief**

The Audit Team have not been provided with an approved Audit Brief.

2.6 **Terms of Reference**

The terms of reference of the audit are based on "Guidelines for the Safety Audit of Highway Schemes" published by the Institution of Highways and Transportation, other guidance references are the Traffic Signs Regulations and General Directions 2016, and GG 119 Design Manual for Roads and Bridges.

The Audit Team has examined and reported only on the road safety implications of the scheme and has not verified the compliance of the designs to any other criteria. However, to clearly explain a safety problem or the recommendation to resolve a problem the Audit Team may, on occasion, have referred to a design standard or other guidance documents.

2.7 Audit Recommendations

Recommendations included within this report should not be regarded as being prescriptive design solutions to the problems identified. They are only to indicate a proportionate and viable means of eliminating or mitigating the identified road safety audit matters, and in no way imply that a formal design process has been undertaken.

There may be alternative measures of addressing a problem which would be equally acceptable or superior in achieving the desired degree of mitigation and these should be considered by the designer when responding to this report.

2.8 Scope of Road Safety Audits

Road Safety Audit shall only be concerned with Road Safety Matters, i.e. *an element of the existing road environment or proposed road environment that could potentially contribute to a road traffic collision or features that could present a risk of injuries to road users.*

Road Safety Audit is not a technical check that the design conforms to standards and/or best practice guidance.

Road Safety Audit is not a check that the scheme has been constructed in accordance with the design.

Road Safety Audit does not consider structural safety.

Road Safety Audit does not cover health and safety issues concerning road workers during the construction phase but may cover the future maintenance and operation of the road.

Road safety matters resulting from the operation of facilities for highway maintenance that affect road users shall be included in the scope of Road Safety Audit.

The needs of all road users shall be assessed when undertaking Road Safety Audits.

3. Risk Assessment

3.1 Each of the Auditors' responses is classified as either a 'Problem' or a 'Nil Response/Comment'. Items classified as a 'Problem' denote matters likely to result in significant road safety hazards. Items marked as 'Nil Response/Comment' are less serious but worthy of consideration by the Designer and/or by the Overseeing Organisation.

3.2 Although all the problems identified are of sufficient importance to require action, the table below shows their relative urgency based on the risk perceived by the Safety Auditors. The level of risk assigned to each problem is largely subjective and is only intended as a guide to assist the client in determining the priority of the road safety matters raised.

Severity / Risk Level	Probability				
	Frequent	Probable	Occasional	Remote	Improbable
Catastrophic	****Problem**** (Urgent)				
Critical		***Problem*** (High Risk)			
Major			**Problem** (Medium Risk)		
Minor				*Problem* (Low Risk)	
Negligible					Comment

4. Historical Summary

4.1 Not known.

5. Existing Environment

5.1 The proposed site is an existing green field site that lies to the south of South Marston

6. Collision Data

6.1 The Audit Team has not been provided with recorded injury collision data as part of this road safety audit. However, interrogation of www.crashmap.co.uk indicates that there has been no personal injury accidents on the lengths of road that is the subject of this audit during the 2020 – 2024 five-year period.

7. Survey Information

7.1 None provided.

8. Audit Assessment

8.1 The table below summarises the findings from this audit which are described in detail within the following pages.

Identified locations of Road Safety Audit Matters are indicated on drawings within **Appendix B** to the rear of this report.

No.	Item	Comments	Notes
A1	**General**		
A1.1	Departures from Standards		None reported
A1.2	Drainage		Not detailed
A1.3	Climatic Conditions		
A1.4	Landscaping		
A1.5	Public Utilities/ Services Apparatus		
A1.6	Lay-bys		
A1.7	Access		
A1.8	Skid Resistance		
A1.9	Agriculture		
A1.10	Fences and Road Restraint Systems		
A1.11	Adjacent Developments and Roads		
A1.12	Road alignment	Problem	(8.1) Larger vehicles may have difficult negotiating the site
A1.13	General layout		
A2	**Local Alignment**		
A2.1	Visibility		
A2.2	New/Existing Road Interface		
A3	**Junctions**		
A3.1	Layout	Problem	(8.2) Forward visibility not detailed
A3.2	Visibility	Problem	(8.3) Visibility splays not detailed
A3.3	Signing		
A3.4	Road Markings		
A3.5	T, X and Y junctions		
A3.6	All roundabouts		
A3.7	Mini Roundabouts		
A3.8	Traffic Signals		
A4	**Non-Motorised User Provision**		
A4.1	Adjacent Land		
A4.2	Pedestrians	Problem	(8.4) Pedestrian visibility splays not detailed

A4.3	Cyclists		
A4.4	Equestrians		
A5	**Road Signs, Carriageway Markings and Lighting**		
A5.1	ADS and Local Traffic Signs		
A5.2	Variable Message Signs		
A5.3	Lighting		
A5.4	Road Markings		
A5.5	Poles and Columns		

8.1*Problem* (Item A1.12)	
Location:	General
Summary:	Larger vehicles may have difficult negotiating the site
There are a number of locations throughout the proposals where larger vehicles such as refuse vehicles may have difficulty manoeuvring; junction, turning heads and sharp horizontal alignment changes. This may result in kerb strike / loss of control or vehicles having to perform onerous reversing manoeuvres. Carry out swept path analysis of all likely large vehicles that will travel through the site. Amend the design where necessary.	
TYPE OF CONFLICT/COLLISION	
Risk of collisions.	
RECOMMENDATION	
Carry out swept path analysis of all likely large vehicles that will travel through the site. Amend the design where necessary.	

8.2*Problem* (Item A3.1)	
Location:	Carriageway alignment at Plots 168/169
Summary:	No forward visibility splays detailed at sharp bend in road alignment
There is a sharp bend detailed adjacent to Plots 168/169. Forward visibility has not been detailed at this bend. A lack of forward visibility may result in head-on collisions at the bend. Check forward visibility splays around bends, ensure they fall over land to be offered for adoption where visibility can be maintained and meet current criteria. Amend design where required.	
TYPE OF CONFLICT/COLLISION	
Risk of head-on collisions due to reduced visibility.	
RECOMMENDATION	
Check forward visibility splays around bends, ensure they fall over land to be offered for adoption where visibility can be maintained and meet current criteria. Amend design where required.	

8.3*Problem* (Item A3.2)	
Location:	Proposed junctions
Summary:	No visibility splays detailed
There are a number of junctions to be provided within the parcels. Visibility splays have not been detailed at these junctions. A lack of suitable visibility may result in vehicles emerging from side roads into the path of oncoming vehicles, resulting in collisions. Appropriate junction visibility splays need to be detailed at all junctions to ensure that they are provided free of obstructions and within land to be offered for adoption.	
TYPE OF CONFLICT/COLLISION	
Risk of collisions due to reduced visibility at junctions.	
RECOMMENDATION	
Appropriate junction visibility splays need to be detailed at all junctions to ensure that they are provided free of obstructions and within land to be offered for adoption.	

8.4*Problem* (Item A4.2)	
Location:	Proposed pedestrian crossing points
Summary:	No visibility splays detailed at the new pedestrian crossing points
There are a number of pedestrian crossing points detailed throughout the site. There are no visibility splays detailed at these crossing points. Pedestrians need to see and be seen by approaching drivers before crossing the road. Appropriate pedestrian visibility splays need to be detailed at all pedestrian crossing points to ensure that they are provided free of obstructions and within land to be offered for adoption.	
TYPE OF CONFLICT/COLLISION	
Risk of collisions due to reduced visibility at crossing point.	
RECOMMENDATION	
Appropriate pedestrian visibility splays need to be detailed at all pedestrian crossing points to ensure that they are provided free of obstructions and within land to be offered for adoption.	

9. Nil Response/Comments

9.1 None.

10. Non-Motorised User Report (NMU's)

10.1 This report has identified road safety problems affecting NMU's that should be resolved.

11. Audit Team Statement

I certify that we have examined the drawing listed within **Appendix A** and that the site has been inspected. The examination has been carried out with the sole purpose of identifying road safety matters that can be addressed to improve the safety of the scheme.

The problems identified have been noted in the report together with associated safety improvement suggestions that we recommend should be studied for implementation.

I can confirm that we have not been involved with the scheme design.

Peter Ronald 13th February 2026
(Audit Team Leader)

13th February 2026
(Audit Team Member)

12. Appendix A - List of Documents

Drawings
SW192-PD-0001P (Planning Layout)

13. Appendix B - Identified Road Safety Audit Matters Location Plans

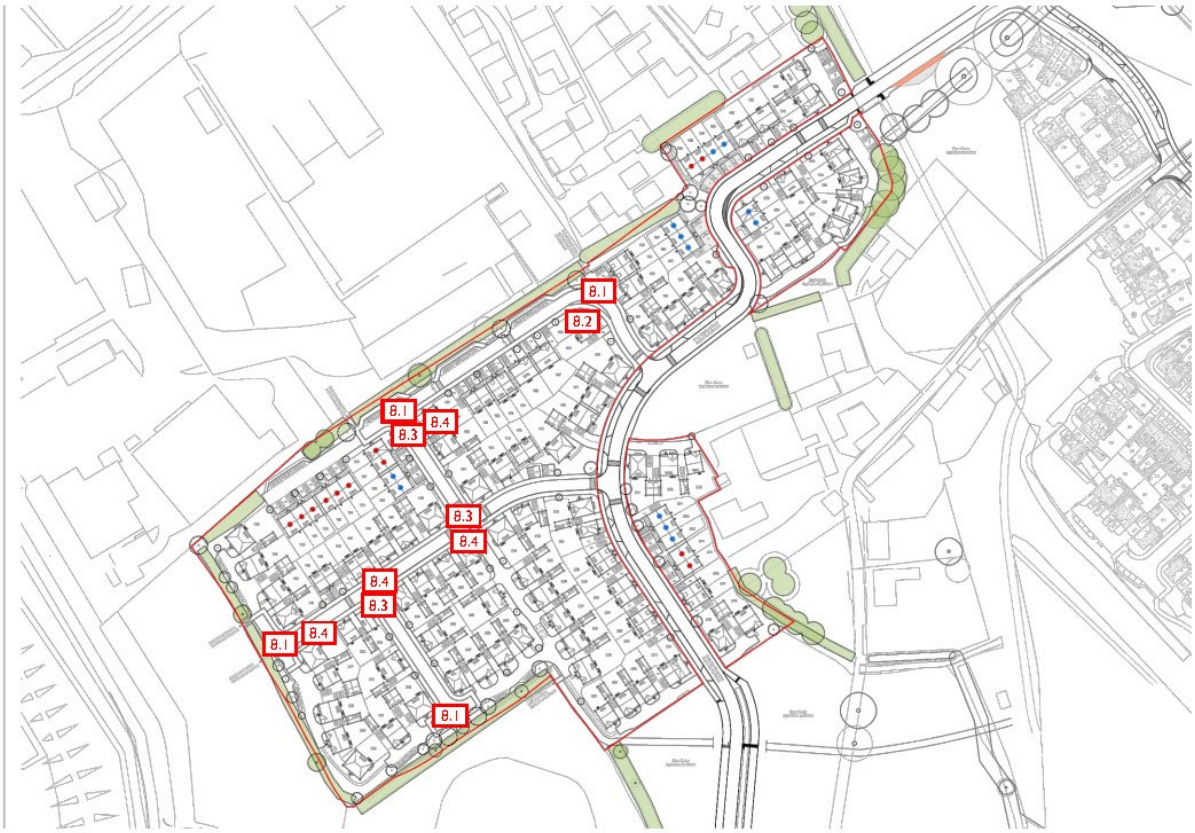

14. Appendix C - Designer's and Auditor Response to Stage 1 Road Safety Audit

Stage 1 (Road Safety Audit) DESIGNER'S ROAD SAFETY AUDIT RESPONSE **Scheme Name: Parcels R1/R2, South Marston Section 38 Highway Works**			
The issues categorised in this road safety audit as 'Problem' matters are those causing serious concern and are summarised below. The purpose of this form is for the scheme Designer or Overseeing Organisation to respond to the 'Problem' matters. Responses should be returned to Traffic Management Consultants. 'Comments' in this report are made for the benefit of the Designer and are not referred to below.			
RSA Matter	**Summary of RSA Problem**	**Designer's Response**	**Overseeing Authority Response**
8.1	Larger vehicles may have difficult negotiating the site	Refuse swept path analysis is demonstrated on drawing: SW192-EN-401A which demonstrates the refuse vehicle can manoeuvre around the development without conflict	
8.2	Forward visibility not detailed	Forward visibility splays are demonstrated on drawing SW192-EN-401A – Engineering Layout, all visibility splats are contained within the proposed adoptable extents.	
8.3	Visibility splays not detailed	Junction visibility splays are demonstrated on drawings SW192-EN-401A – Engineering Layout, all visibility splays are contained within the proposed adoptable extents.	
8.4	Pedestrian visibility splays not detailed	Pedestrian crossing points are location at the Junction tangent point in order to reduce the distance at which a pedestrian needs to be on the carriageway, the exact location of the tactile crossings will be determined at the detailed design stage.	

AUDIT TEAM RESPONSE to designer's response

8.1 Noted . Local Authority to agree that these meet their standard requirement
8.2 Agreed
8.3 Agreed
8.4 Agreed. Ensure all ped vis splays detailed are over adopted land

Design Organisation Response

The Design Organisation Response has been prepared by:

Name: Mike Atkins

Position / Organisation: Engineering Manager

Date: 25.02.26

Overseeing Authority Response

The Overseeing Authority Response has been prepared by:

Name:

Position / Organisation:

Date: