From:	Edward Snook
To:	Scanning; SBC Development Control
Subject:	FW: S/COND/22/0711 updated comments
Date:	28 February 2023 17:06:32
Attachments:	image005.png image006.png image007.png image008.png image009.png

---

From: Richard Bennett <RBennett2@swindon.gov.uk>
Sent: 28 February 2023 15:49
To: Edward Snook <ESnook@swindon.gov.uk>
Cc: LLFA <LLFA@swindon.gov.uk>
Subject: S/COND/22/0711 updated comments

Hi Ed,

S/COND/22/0711
Condition 40
Whilst we agree with the principles proposed, a further detailed plan for each area is required highlighting exact work required. Points 5-8 must be carried out before any development in the South Marston area commence.

Condition 41
I have had a look through the updated report and we seem to be there with the high level parameters we have covered in the meetings, but we still require further detail to cover all elements with regards to the discharge of condition.

The calculations for the swales are fine but the calcs for the basins have not been included in the latest submission.

There are issues with existing ponds being affect by proposed Basin B and also a conveyance swale discharging into Basin C although this swale is indicative at this stage. These are shown in the snapshot below.

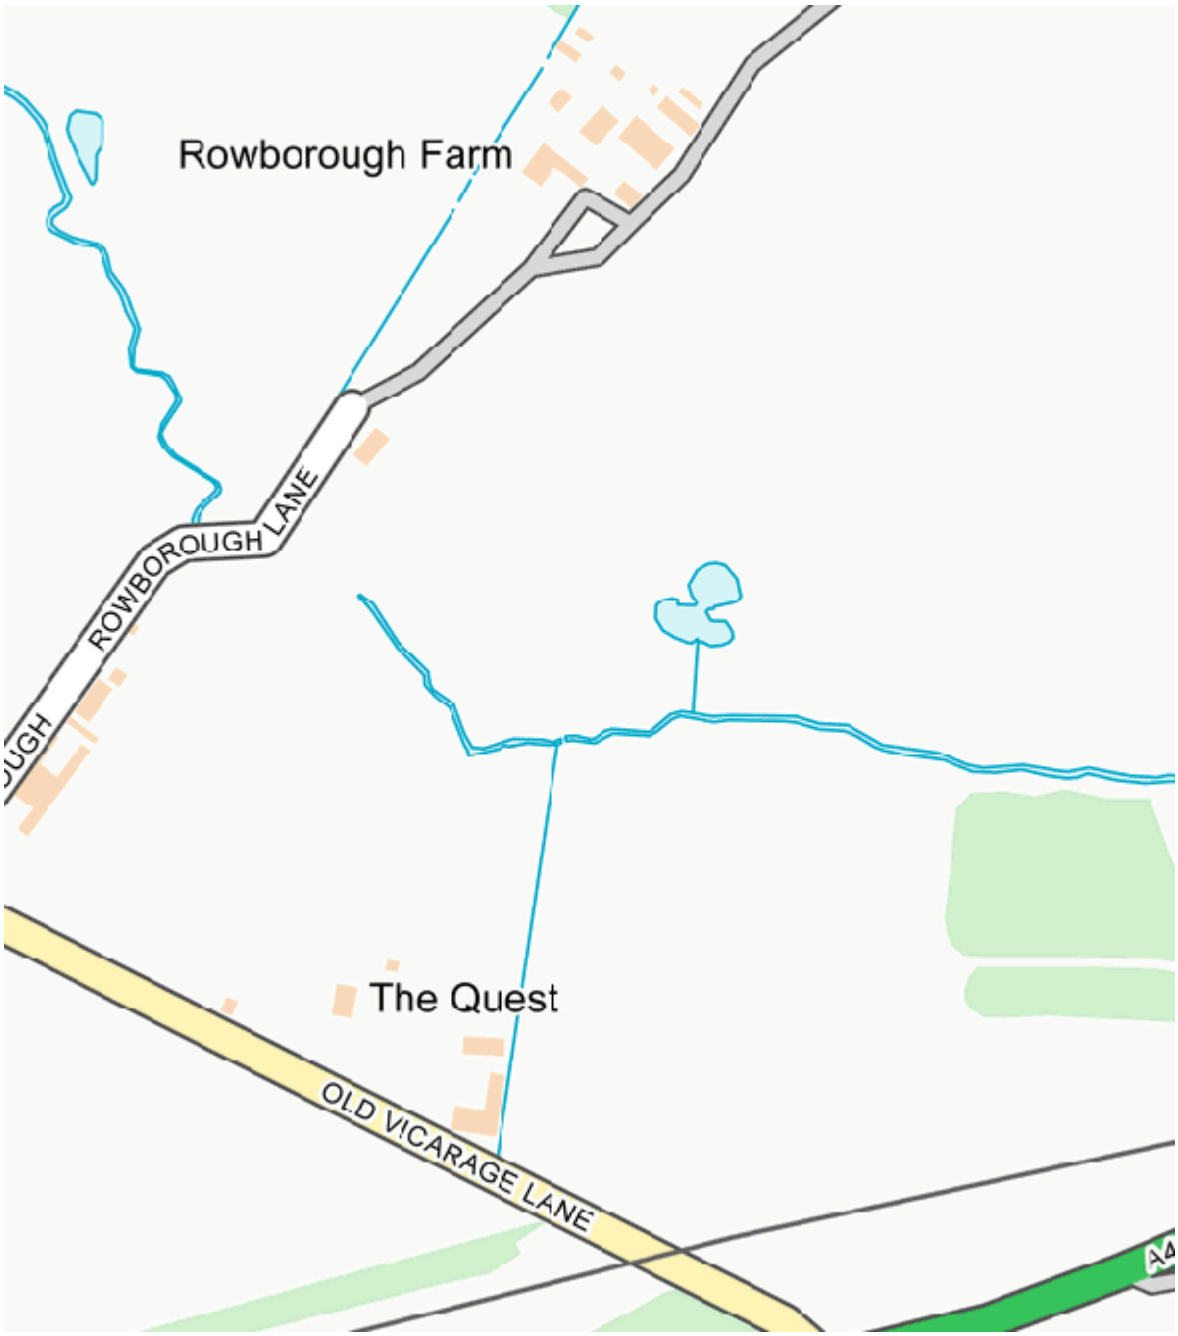

We will need further details on these ponds (current use, any incoming drainage, current water level etc..).

I was informed previously that the storage features were outside the floodplain however, Storage swales 2, 3 and 5 are shown within the flood plain on the Flood Risk Plan 1335-SK-111 B now included in the report. Basins C and E are also shown within or immediately adjacent to the floodplain. There needs to be an adequate buffer between any storage features and the flood plain as agreed previously.

We need detailed cross sections and level information for the proposed basins and swales. Where these are adjacent to the flood plain or discharge into the main river, we require further level detail at the outfall points including recorded water levels and fluvial flood levels. Further measures may be required to ensure these basins operate during high river/flood levels. Outfall level into the River Cole from Basin E is assumed and needs to be confirmed at this stage.

Regards,

Richard

Richard Bennett
Flood Risk Engineer
Lead Local Flood Authority
Highway Infrastructure and Asset Management
Swindon Borough Council
Tel: 07841829787
www.swindon.gov.uk