

### **Description**

#### **Image**





#### Caption

1. Cast iron pan. © Evan-Amos at en.wikipedia - Public domain 2. The fluidity of the material allows intricate castings. © John Fernandez

#### The material

The foundations of modern industrial society are set, so to speak, in cast iron: it is the material that made the industrial revolution possible. Today it holds a second honor: that of being the cheapest of all engineering metals. Cast iron contains at least 2% carbon -- most have 3 to 4% -- and from 1-3% silicon. The carbon makes the iron very fluid when molten, allowing it to be cast to intricate shapes. There are five classes of cast iron: gray, white, ductile (or nodular), malleable and alloy; details are given under Design Guidelines, below. The two that are most used are gray and ductile. This record is for gray cast iron.

#### Composition (summary)

Fe/3.2-4.1%C/1.8-2.8%Si/<0.8%Mn/<0.1%P/<0.03%S

### **General properties**

Density	7.05e3	-	7.25e3	kg/m^3
Price	* 0.42	-	0.45	USD/kg
Date first used	-513			

### **Mechanical properties**

Young's modulus	80	-	138	GPa
Shear modulus	31	-	57	GPa
Bulk modulus	130	-	140	GPa
Poisson's ratio	0.26	-	0.28	
Yield strength (elastic limit)	140	-	420	MPa
Tensile strength	140	-	448	MPa
Compressive strength	500	-	1.1e3	MPa
Elongation	0.17	-	0.7	% strain



## Cast iron, gray

Hardness - Vickers	90	-	310	HV
Fatigue strength at 10^7 cycles	40	-	170	MPa
Fracture toughness	10	-	24	MPa.m^0.5
Mechanical loss coefficient (tan delta)	* 0.01	-	0.04	

### **Thermal properties**

Melting point	1.13e3	-	1.38e3	$\mathcal C$
Maximum service temperature	350	-	450	$\mathcal C$
Minimum service temperature	-150	-	-50	$\mathcal C$
Thermal conductor or insulator?	Good co	ondu	ctor	
Thermal conductivity	40	-	72	W/m.℃
Specific heat capacity	430	-	495	J/kg.℃
Thermal expansion coefficient	11	-	12.5	µstrain/℃

# **Electrical properties**

Electrical conductor or insulator?	Good co	onduc	tor	
Electrical resistivity	62	-	86	µohm.cm

# **Optical properties**

### **Critical Materials Risk**

High critical material risk?	No
3	

# **Processability**

Castability	5
Formability	1 - 2
Machinability	4
Weldability	1
Solder/brazability	1 - 2

# **Durability: water and aqueous solutions**

Water (fresh)	Acceptable
Water (salt)	Limited use
Soils, acidic (peat)	Acceptable
Soils, alkaline (clay)	Acceptable
Wine	Unacceptable

# **Durability: acids**

Acetic acid (10%)	Limited use
Acetic acid (glacial)	Limited use
Citric acid (10%)	Limited use





Hydrochloric acid (10%)	Unacceptable
Hydrochloric acid (36%)	Unacceptable
Hydrofluoric acid (40%)	Unacceptable
Nitric acid (10%)	Unacceptable
Nitric acid (70%)	Unacceptable
Phosphoric acid (10%)	Unacceptable
Phosphoric acid (85%)	Unacceptable
Sulfuric acid (10%)	Unacceptable
Sulfuric acid (70%)	Excellent

# **Durability: alkalis**

Sodium hydroxide (10%)	Excellent
Sodium hydroxide (60%)	Acceptable

# **Durability: fuels, oils and solvents**

Amyl acetate	Excellent
Benzene	Excellent
Carbon tetrachloride	Excellent
Chloroform	Excellent
Crude oil	Acceptable
Diesel oil	Excellent
Lubricating oil	Excellent
Paraffin oil (kerosene)	Excellent
Petrol (gasoline)	Excellent
Silicone fluids	Excellent
Toluene	Excellent
Turpentine	Excellent
Vegetable oils (general)	Excellent
White spirit	Excellent

# Durability: alcohols, aldehydes, ketones

Acetaldehyde	Limited use
Acetone	Excellent
Ethyl alcohol (ethanol)	Acceptable
Ethylene glycol	Acceptable
Formaldehyde (40%)	Limited use
Glycerol	Excellent
Methyl alcohol (methanol)	Acceptable

# **Durability: halogens and gases**

Chlorine gas (dry)	Excellent



Fluorine (gas)	Limited use
O2 (oxygen gas)	Limited use
Sulfur dioxide (gas)	Acceptable

## **Durability: built environments**

Industrial atmosphere	Acceptable
Rural atmosphere	Acceptable
Marine atmosphere	Limited use
UV radiation (sunlight)	Excellent

## **Durability: flammability**

Flammability	n-flammable
--------------	-------------

## **Durability: thermal environments**

Tolerance to cryogenic temperatures	Unacceptable
Tolerance up to 150 C (302 F)	Excellent
Tolerance up to 250 C (482 F)	Excellent
Tolerance up to 450 C (842 F)	Excellent
Tolerance up to 850 C (1562 F)	Unacceptable
Tolerance above 850 C (1562 F)	Unacceptable

## Geo-economic data for principal component

Annual world production, principal component	2.3e9	tonne/yr
Reserves, principal component	1.6e11	tonne


# Primary material production: energy, CO2 and water

Embodied energy, primary production	* 17	-	21	MJ/kg
CO2 footprint, primary production	* 1.65	-	1.75	kg/kg
Water usage	* 42	-	46.4	l/kg
Eco-indicator 95	40			millipoints/kg
Eco-indicator 99	112			millipoints/kg

# Material processing: energy

Casting energy	* 10	-	11.1	MJ/kg
Metal powder forming energy	* 30.1	-	36.5	MJ/kg
Vaporization energy	* 1.09e4	-	1.2e4	MJ/kg
Coarse machining energy (per unit wt removed)	* 0.841	-	0.93	MJ/kg
Fine machining energy (per unit wt removed)	* 4.14	-	4.57	MJ/kg
Grinding energy (per unit wt removed)	* 7.8	-	8.62	MJ/kg
Non-conventional machining energy (per unit wt removed	109	-	120	MJ/kg

## **Material processing: CO2 footprint**





Casting CO2	* 0.751	-	0.83	kg/kg
Metal powder forming CO2	* 2.41	-	2.92	kg/kg
Vaporization CO2	* 815	-	901	kg/kg
Coarse machining CO2 (per unit wt removed)	* 0.0631	-	0.0697	kg/kg
Fine machining CO2 (per unit wt removed)	* 0.31	-	0.343	kg/kg
Grinding CO2 (per unit wt removed)	* 0.585	-	0.646	kg/kg
Non-conventional machining CO2 (per unit wt removed	8.15	-	9.01	kg/kg

### Material recycling: energy, CO2 and recycle fraction

Recycle	✓
Embodied energy, recycling	* 7.65 - 8.45 MJ/kg
CO2 footprint, recycling	* 0.601 - 0.664 kg/kg
Recycle fraction in current supply	60 - 80 %
Downcycle	✓
Combust for energy recovery	×
Landfill	✓
Biodegrade	×
Toxicity rating	Non-toxic
A renewable resource?	×

#### **Environmental notes**

As metals go, it takes relatively little energy to make cast iron; it's exceptionally durable, and easily recycled. The pollution caused by blast furnaces in which it is made was at one time a major problem; but modern technology has totally overcome this.

### Supporting information

### Design guidelines


There are five kinds of cast iron. Gray cast iron machines easily, damps vibration well, is relatively brittle and has low tensile strength; it is the material of automotive cylinder blocks, exhaust manifolds, break disks and drums, gears and flywheels. White cast iron, made by chill casting to give a high cooling rate at the surface, is much harder than gray; it is used when wear resistance is wanted, as in rolls for rolling mills, blades for crushers and mixers. Nodular (ductile) cast iron contains additions that cause the flakes of graphite that are present in gray iron to spherodize, giving higher toughness and strength but at the loss of damping-ability; it is used for crank shafts and heavy duty gears. Malleable cast iron, made by heat-treating white cast iron, is ductile and easily machined; it is used for heavy-duty parts of cars, trucks, and railway rolling stock. Finally, alloy cast irons contain up to 35% of chromium or nickel; they are corrosion resistant and have high strength, but are much more expensive.

#### Technical notes

There is no single systematic numbering system for cast irons. The UNS and the AISI systems are widely used, particularly in the US. More information on designations and equivalent grades can be found on the Granta Design website at www.grantadesign.com/designations

#### Phase diagram



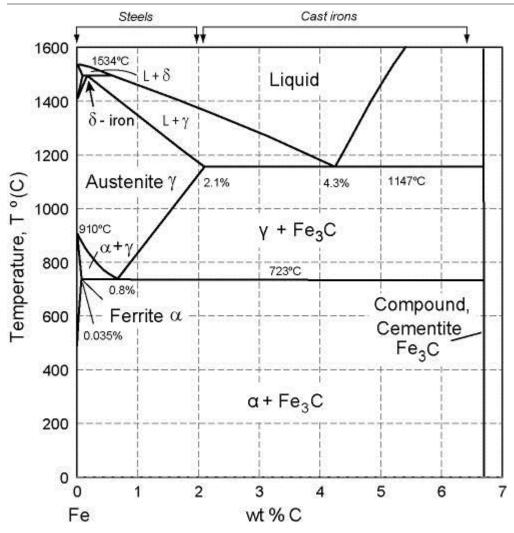

#### Phase diagram description

Grey cast irons are based on iron (Fe) with 3 - 4.1% carbon (C), for which this is the phase diagram. Some have additions of silicon and manganese.

#### Typical uses

Brake discs and drums, bearings, camshafts, cylinder liners, piston rings, machine tool structural parts, engine blocks, gears, crankshafts, heavy-duty gear cases, pipe joints, pump casings, components in rock crushers.

#### Links

Reference

ProcessUniverse

**Producers**