


## **Description**

#### **Process schematic**

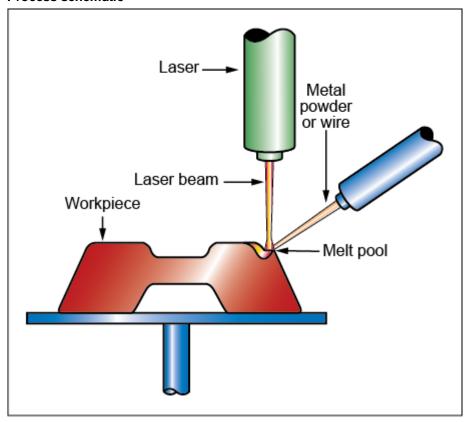

#### The process

LASER POWDER FORMING (LPF) is an additive manufacturing technique in which wire or powder is fed into a melt pool created by a laser. The laser is scanned across the surface to add material to one layer at a time. When used as an alternative to machining from a block, a simple geometry is printed which requires milling to give the desired finish. As with other additive manufacturing processes, a CAD solid model of the part is used to create the code to guide the laser.

The process is also known as blown powder additive manufacturing, laser beam metal deposition, directed light fabrication, 3D laser cladding, laser generation, laser-based metal deposition, laser freeform fabrication, laser direct casting, laser consolidation or direct metal deposition. A variation on this method is wire fed plasma arc.

#### **Tradenames**

LaserCast, LasForm, Laser-Engineered Net Shaping (LENS)

# **Material compatibility**

Metals - ferrous	✓
Metals - non-ferrous	✓

# **Shape**

Circular prismatic	✓
Non-circular prismatic	✓
Flat sheet	✓
Dished sheet	✓



Solid 3-D	✓
Hollow 3-D	✓

## **Economic compatibility**

Economic batch size (units)	1 - 10
-----------------------------	--------

# Physical and quality attributes


## **Process characteristics**

Primary shaping processes	✓
Discrete	✓
Prototyping	✓

## Cost model and defaults

Relative cost index (per unit) 16.5 - 4.7e3

Parameters: Material Cost = 8USD/kg, Component Mass = 1kg, Batch Size = 1e3, Overhead Rate = 150USD/hr, Discount Rate = 5%, Capital Write-off Time = 5yrs, Load Factor = 0.5

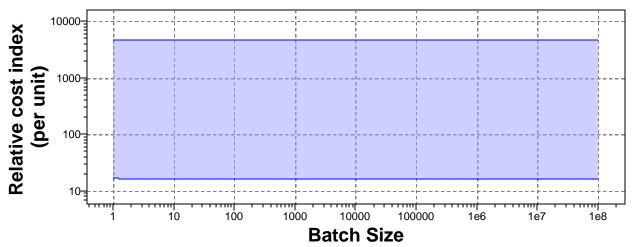

Capital Write-off Time=5yrs, Load Factor=0.5, Component Mass=1kg, Material Cost=8USD/kg, Overhead Rate=150USD/hr, Discount Rate=5%

Capital cost	5e5	-	8e5	USD
Material utilization fraction	0.8	-	1	
Production rate (units)	0.04	-	25	/hr
Tooling cost	0	-	0.1	USD
Tool life (units)	1e5	-	1e6	

# **Supporting information**

## Design guidelines

Requires support structures (which can be removed later) in addition to the main body of the object for some complex geometries such as overhangs. Produces fully dense objects suitable for immediate use.

#### **Technical notes**



# Laser powder forming

The build envelope (L x W x H) ranges from  $100 \times 100 \times 100 \text{ mm}$  for jewelry and dentistry to  $900 \times 1500 \times 900 \text{ mm}$ . Typical layer thickness is  $250 - 1000 \mu \text{m}$ .

Material is added at a rate of around 16 - 320 cubic cm per hour.

Materials are processed in an inert gas chamber and must be available in either powder or wire form.

## Typical uses

Fully dense functional parts in metals and ceramics such as: building ribs onto flat plates in aerospace industry, development of alloys, jewelry and dentistry. Repair and modification of existing structures to improve wear properties.

#### The environment

Direct exposure to the laser beam must be avoided. Excess powder can be reused if captured in a clean state and 100% feedstock efficiency if wire is used.

## Links

MaterialUniverse

Reference