

Description

Image



Caption

Medium carbon steel is the material of cheap tools. Low alloy steels are much superior and only a little more expensive -- quality tools are low alloy. © Granta Design

The material

Medium carbon steel (0.25-0.7% carbon) hardens when quenched - a quality that gives great control over properties. "Hardenability" measures the degree to which it can be hardened in thick sections; plain carbon steels have poor hardenability - additional alloying elements are used to increase it (see Low alloy steels). Medium carbon steels are used on an enormous scale for railroad tracks; there are many other lower-volume applications.

Compositional summary

Fe/0.3 - 0.7%C

General properties

Density	7.8e3	-	7.9e3	kg/m^3
Price	* 0.58	-	0.59	USD/kg
Date first used	1610			

Mechanical properties

Young's modulus	200	-	216	GPa
Shear modulus	77	-	85	GPa
Bulk modulus	158	-	170	GPa
Poisson's ratio	0.285	-	0.295	
Yield strength (elastic limit)	305	-	900	MPa
Tensile strength	410	-	1.2e3	MPa
Compressive strength	305	-	1.76e3	MPa
Elongation	4	-	39	% strain
Hardness - Vickers	120	-	565	HV
Fatigue strength at 10^7 cycles	* 229	-	600	MPa





Fracture toughness	* 12	-	92	MPa.m^0.5
Mechanical loss coefficient (tan delta)	* 2.2e-4	-	0.00119	

Thermal properties

Melting point	1.38e3	-	1.51e3	°C
Maximum service temperature	* 370	-	420	°C
Minimum service temperature	* -68.2	-	-33.2	°C
Thermal conductor or insulator?	Good co	ondu	ctor	
Thermal conductivity	45	-	55	W/m.°C
Specific heat capacity	440	-	520	J/kg.°C
Thermal expansion coefficient	10	-	14	µstrain/°C

Electrical properties

Electrical conductor or insulator?	Good conductor
Electrical resistivity	15 - 22 μohm.cm

Optical properties

Transparency	Opaque
Processability	
•	

Castability	2	-	3
Formability	4	-	5
Machinability	3	-	4
Weldability	5		
Solder/brazability	5		

Durability: water and aqueous solutions

Water (fresh)	Acceptable
Water (salt)	Limited use
Soils, acidic (peat)	Acceptable
Soils, alkaline (clay)	Acceptable
Wine	Unacceptable

Durability: acids

Acetic acid (10%)	Limited use
Acetic acid (glacial)	Unacceptable
Citric acid (10%)	Unacceptable
Hydrochloric acid (10%)	Unacceptable
Hydrochloric acid (36%)	Unacceptable
Hydrofluoric acid (40%)	Unacceptable
Nitric acid (10%)	Unacceptable
Nitric acid (70%)	



	Unacceptable
Phosphoric acid (10%)	Unacceptable
Phosphoric acid (85%)	Unacceptable
Sulfuric acid (10%)	Unacceptable
Sulfuric acid (70%)	Unacceptable

Durability: alkalis

Sodium hydroxide (10%)	Excellent
Sodium hydroxide (60%)	Acceptable

Durability: fuels, oils and solvents

Excellent
LAGGIGIT
Excellent

Durability: alcohols, aldehydes, ketones

Acetaldehyde	Limited use
Acetone	Excellent
Ethyl alcohol (ethanol)	Acceptable
Ethylene glycol	Acceptable
Formaldehyde (40%)	Unacceptable
Glycerol	Excellent
Methyl alcohol (methanol)	Acceptable

Durability: halogens and gases

Chlorine gas (dry)	Acceptable
Fluorine (gas)	Excellent
O2 (oxygen gas)	Limited use
Sulfur dioxide (gas)	Acceptable



Industrial atmosphere	Limited use
Rural atmosphere	Acceptable
Marine atmosphere	Limited use
UV radiation (sunlight)	Excellent

Durability: flammability

Flammability	on-flammable
--------------	--------------

Durability: thermal environments

Tolerance to cryogenic temperatures	Unacceptable
Tolerance up to 150 C (302 F)	Excellent
Tolerance up to 250 C (482 F)	Excellent
Tolerance up to 450 C (842 F)	Acceptable
Tolerance up to 850 C (1562 F)	Unacceptable
Tolerance above 850 C (1562 F)	Unacceptable

Geo-economic data for principal component

Annual world production, principal component	2.3e9	tonne/yr
Reserves, principal component	1.6e11	tonne

Primary material production: energy, CO2 and water

Embodied energy, primary production	* 25.1	-	27.8	MJ/kg
CO2 footprint, primary production	* 1.72	-	1.9	kg/kg
Water usage	* 43.6	-	48.2	l/kg
Eco-indicator 95	86			millipoints/kg
Eco-indicator 99	106			millipoints/kg

Material processing: energy

* 10.9	-	12.1	MJ/kg
* 5.94	-	6.57	MJ/kg
* 3.11	-	3.44	MJ/kg
* 21.5	-	23.8	MJ/kg
* 35.9	-	42.8	MJ/kg
* 1.09e4	-	1.2e4	MJ/kg
* 0.899	-	0.994	MJ/kg
* 4.72	-	5.21	MJ/kg
* 8.96	-	9.9	MJ/kg
109	-	120	MJ/kg
	* 5.94 * 3.11 * 21.5 * 35.9 * 1.09e4 * 0.899 * 4.72 * 8.96	* 5.94 - * 3.11 - * 21.5 - * 35.9 - * 1.09e4 - * 0.899 - * 4.72 - * 8.96 -	* 5.94 - 6.57 * 3.11 - 3.44 * 21.5 - 23.8 * 35.9 - 42.8 * 1.09e4 - 1.2e4 * 0.899 - 0.994 * 4.72 - 5.21 * 8.96 - 9.9

Material processing: CO2 footprint



Casting CO2	* 0.819	-	0.906	kg/kg
Extrusion, foil rolling CO2	* 0.446	-	0.492	kg/kg
Rough rolling, forging CO2	* 0.233	-	0.258	kg/kg
Wire drawing CO2	* 1.61	-	1.78	kg/kg
Metal powder forming CO2	* 2.87	-	3.42	kg/kg
Vaporization CO2	* 815	-	901	kg/kg
Coarse machining CO2 (per unit wt removed)	* 0.0674	-	0.0745	kg/kg
Fine machining CO2 (per unit wt removed)	* 0.354	-	0.391	kg/kg
Grinding CO2 (per unit wt removed)	* 0.672	-	0.743	kg/kg
Non-conventional machining CO2 (per unit wt removed)	8.15	-	9.01	kg/kg

Material recycling: energy, CO2 and recycle fraction

Recycle	✓
Embodied energy, recycling	* 6.96 - 7.69 MJ/kg
CO2 footprint, recycling	* 0.547 - 0.605 kg/kg
Recycle fraction in current supply	40 - 44 %
Downcycle	✓
Combust for energy recovery	×
Landfill	✓
Biodegrade	×
Toxicity rating	Non-toxic
A renewable resource?	×

Environmental notes

The production energy of steel is comparatively low - per unit weight, about a half that of polymers; per unit volume, though, twice as much. Carbon steels are easy to recycle, and the energy to do so is small.

Supporting information

Design guidelines


Hardenability measures the degree to which it can be hardened in thick sections; plain carbon steels have poor hardenability - additional alloying elements are used to increase it (see Low alloy steels).

Technical notes

The two standard classifications for steels, the AISI and the SAE standards, have now been merged. In the SAE-AISI system, each steel has a four-digit code. The first two digits indicate the major alloying elements. The second two give the amount of carbon, in hundredths of a percent. Thus the plain carbon steels have designations starting 10xx, 11xx, 12xx or 14xxx, depending on how much manganese, sulfur and phosphorus they contain. The common low-carbon steels have the designations 1015,1020, 1022, 1117,1118; the common medium carbon steels are 1030,1040, 1050, 1060, 1137, 1141, 1144 and 1340; the common high alloy steels are 1080and 1095. More information on designations and equivalent grades can be found on the Granta Design website at www.grantadesign.com/designations

Phase diagram



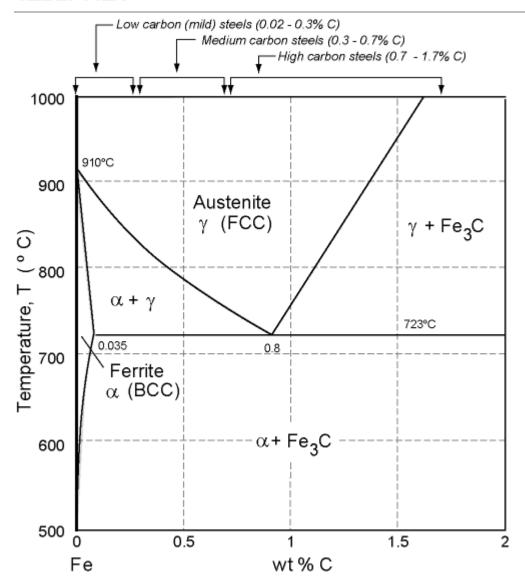

Phase diagram description

Medium carbon steels are alloys of iron (Fe) with 0.3 - 0.7% carbon (C), for which this is the phase

Typical uses

General construction; general mechanical engineering; automotive; tools; axles; gears; bearings; cranks; shafts; gears; bells; cams, knives and scissors.

Links

Reference
ProcessUniverse
Producers