

REV A LAYOUT REVIEW. NOT FOR FABRICATION.

915 MHz FLRC socket adapter

Local labels connect equal names. NC marks deliberate unused module pins.
Selected parts: see BOM, FOOTPRINT_REVIEW.md and ASSEMBLY_NOTES.md.





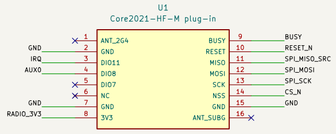









U1 represents the plug-in module, not a soldered module footprint.
Socket contacts for module pins 1, 5, 6 and 16 are isolated.
TX_EN/RX_EN slot contacts unused. No external RF switch added.
J3/J4: 15.24 mm row spacing; top/bottom numbering in FOOTPRINT_REVIEW.md.




























































MISO: source -> 22R -> slot A7. Fit OR option: scope/IBIS verify.
Place at module output/socket, before shared bus. No long stubs.

KEYED SLOT: H1 engages the carrier M3 x 25 post before electrical contact.
All headers and passives factory fitted. No user soldering or antenna-selector rework.
Power declarations describe power arriving through the slot and buck output after L1.
Layout authorized; no fabrication release. See DESIGN_REVIEW.md.

SCHEMATIC REVIEW — NOT FOR FABRICATION

Sheet: /
File: core2021-hf-m-rev-a.kicad_sch

Title: 915 MHz FLRC socket adapter

Size: A2	Date: 2026-09-17	**Rev: A-schematic**
KiCad E.D.A. 10.0.6		Id: 1/1