REV A SCHEMATIC REVIEW. NO PCB LAYOUT OR FABRICATION RELEASE.


915 MHz FLRC socket adapter

Local labels connect equal names. NC marks deliberate unused module pins.
Selected parts: see BOM, FOOTPRINT_REVIEW.md and ASSEMBLY_NOTES.md.

J1
TSW-110-07-G-S



U1
Core2021-HF-M plug-in

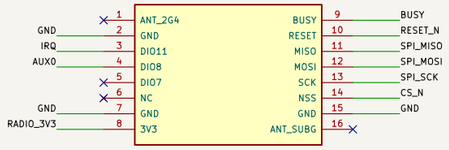

U2
AP2112K-3.3TRG1



J2
TSW-108-07-G-S



U1 represents the plug-in module, not a soldered module footprint.
Socket contacts for module pins 1, 5, 6 and 16 are isolated.
TX_EN/RX_EN slot contacts unused. No external RF switch added.
J3/J4: 15.24 mm row spacing; top/bottom numbering in FOOTPRINT_REVIEW.md.

#FLG01
POWER DECLARATION: SLOT_5V



#FLG02
POWER DECLARATION: GND



C1
22uF



C2
22uF



C3
100nF



J3
SSQ-108-01-G-S



J4
SSQ-108-01-G-S



C4
22uF



R1
10k



R2
10k



H1
M3 alignment hole



KEYED SLOT: H1 engages the carrier M3 x 25 post before electrical contact.
All headers and passives factory fitted. No user soldering or antenna-selector rework.
Power declarations describe power arriving through the slot and buck output after L1.
No PCB layout is authorized. Footprint and assembly evidence: see DESIGN_REVIEW.md.

SCHEMATIC REVIEW — NOT FOR FABRICATION

Sheet: /
File: core2021-hf-m-rev-a.kicad_sch

Title: 915 MHz FLRC socket adapter

Size: A3	Date: 2026-09-17	**Rev: A-schematic**
KiCad E.D.A. 10.0.6		Id: 1/1