

ITEM	NAME	MATERIAL	Q'TY	REMARK
01	GFW30_HINGE_R_LCD_BRK_L	SK7	1	BLACK
02	GFW30_LCD_HINGE_SUP_BRK_L2	SK7	1	BLACK
03	GFW30_HINGE_L_AXIS	FE8N1	1	BLACK
04	GFW30_HINGE_L_BASE_BRK	SK7	1	BLACK
05	GFW30_BASE_HINGE_RIVET_L	SUS304	2	BLACK

REV	DESCRIPTION OF CHANGE	REV BY	DATE

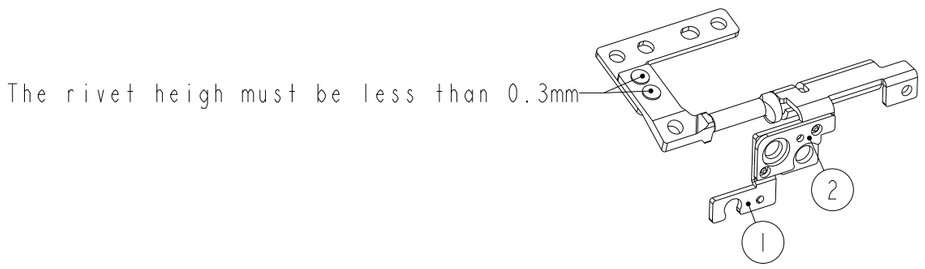

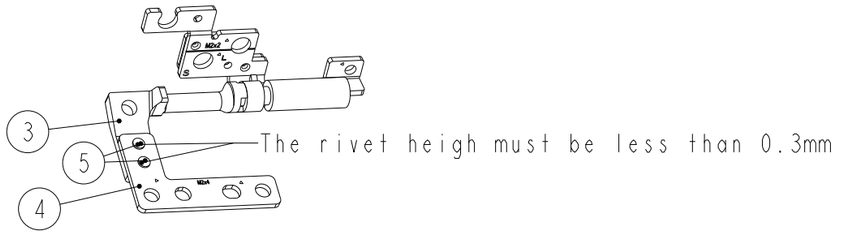

NOTES:
1. INTERPRET DIMENSIONS PER ANSI Y14.5M-1982.
2. ALL DIMENSIONS, UNLESS OTHERWISE NOTED, ARE CRITICAL DIMENSIONS AND SHALL BE CHECKED FOR CONFORMITY DURING FIRST ARTICLE INSPECTION.
PROCESS CONTROL DIMENSION: THESE DIMENSIONS SHALL BE STATISTICALLY MONITORED BY SUPPLIER.
CRITICAL CONTROL: THESE DIMENSIONS SHALL BE MONITORED AS SPECIFIED IN THE SUPPLIER QUALITY PLAN.
3. AN FAI MUST BE APPROVED FOR THE SPECIFIC REVISION OF THIS PART PRIOR TO SHIPMENT.
4. ACTUAL STAMPED PART SHALL CONFORM TO ALL APPLICABLE INDUSTRY STANDARDS. SPECIFICATIONS AND THE TOLERANCED FEATURES INDICATED ON THIS DRAWING SHALL TAKE PRECEDENCE.
5.
a. BEFORE AND AFTER HINGE LIFE TEST (20000 TIMES) HINGE CAP AND HINGE CAN'T HAVE CRACK,SCRATCH,FOULING,DENT AND PROTRUDING
b. AFTER HINGE LIFE TEST(20000TIMES),HINGE CAN'T PULL OUT AND HAVE NOISE
c. HINGE STOPER ANGLE IS : 180° +10°/-0°
d. DECAY PERCENT SHOULD BE LESS.
THEN 15% AFTER 20000 TIMES SWING TEST.
e. HIINGE FINISHED PRODUCTS ANGLE IS 105° ±3°
f. LET THE SOLUTION STAND FOR ONE DAY AFTER HINGE CAP AND HINGE ADDING GLUE
h. The free down angel of close is max 30°and free down angel of open is max 150°after 20000 cycles hinge life test

ITEM	NAME	PART NO.	Q'TY	REMARK
01	HINGE_L_ASSY	AM3BA000100	1	OPEN HINGE TORQUE:3.3 ±0.5 kg-f/cm CLOSE HINGE TORQUE:4.3 ±0.5 kg-f/cm

framework

UNLESS SPECIFIED TOLERANCE ARE:	
300 ABOVE :	± 0.20
300 ≥ X ≥ 150 :	± 0.15
150 > X ≥ 50 :	± 0.10
50 > X ≥ 20 :	± 0.075
20mm BELOW :	± 0.05
ANGLES :	± 1°
FLATNESS :	▱ 0.20
CONCENTRICITY :	± 0.05

MODEL

THIRD ANGLE PROJECTION

DESIGNED BY	DRAWN BY
CHECKED BY	APPROVED BY
ISSUED DATE: Jun-27-23	SCALE: 1.000 / UNIT: mm
DRAWING FILE NAME: Hinge L Assy	
SIZE: A3 / SHEET: 1 OF 2	REVISION: 0 / VERSION: 0