

1. Reason for the job

Slat actuation power control unit

Installation

Object code	DMC-A350X-A-27-81-00-00A-720A-A	Issue	002-00 (revised)
Issue date	2026-05-04	Language	en-GB
Responsible partner	AIRBUS S.A.S. (U8025)	Originator	AIRBUS S.A.S. — Technical Data Toulouse (U8025)
Security	01 — Unclassified	Quality assurance	Second verification (tabtop)
Applicability	A350X-900 and A350X-1000, all aircraft		

1. Reason for the job

This data module gives the procedure to install the slat actuation power control unit (PCU) in the belly fairing. Do the procedure after the removal procedure (Ref. Slat actuation power control unit — Removal), or after a PCU has been replaced under modification 27-8117.

2. Job set-up information

A. Referenced information

TYPE	DESIGNATION	IDENTIFICATION No.
DM	The aircraft is safe for maintenance and the landing gear ground locks are installed.	DMC-A350X-A-00-20-00-00A-941A-A
DM	The green and the yellow hydraulic systems are depressurized.	DMC-A350X-A-29-00-00-00A-861A-A
GEN	The fwd belly fairing access panel 196AB is open.	—

B. Fixtures, tools, test and support equipment

QTY	DESIGNATION	IDENTIFICATION No.
1	Sling, PCU handling	98D27814500000 (CAGE U8025)
1	Torque wrench, 10 to 70 Nm	TW-70-DR (CAGE 96906)
1	Platform, adjustable, 2 m to 4 m	98D00000100000 (CAGE U8025)

C. Consumable materials

QTY	DESIGNATION	IDENTIFICATION No.
2 l	Hydraulic fluid, phosphate ester, type IV Material No. 02-004	NSA307110 (CAGE 81349)
1 m	Lockwire, corrosion resistant steel, 0.8 mm Material No. 19-003	NSA935403-08 (CAGE 81349)

D. Expendable parts

QTY	DESIGNATION	IDENTIFICATION No.
2	Packing, PCU mounting flange	NSA8102-118 (CAGE U8025)

3. Procedure

E. Safety conditions

WARNING

Make sure that the green and the yellow hydraulic systems are depressurized before you disconnect or connect a hydraulic line. Hydraulic fluid at 206 bar (2988 psi) can cause injury to persons and damage to equipment.

CAUTION

Do not let the PCU hang on the hydraulic lines. Damage to the pipe couplings and to the manifold face can occur.

3. Procedure

1. Prepare for the installation

- A. Make sure that the mounting flange of the PCU support structure is clean and that no damage is found on the sealing face.
- B. Install a new packing NSA8102-118 on each of the two hydraulic manifold ports.

NOTE: Discard the packings that were removed with the unit. Packings are not re-used.

- C. Attach the handling sling to the two lifting points on the PCU housing.

3. Procedure


2. Install the power control unit

WARNING

Make sure that no person is below the unit while it is lifted into the belly fairing. The unit has a mass of 34 kg.

- A. Lift the PCU into position and engage the two locating dowels on the support structure.
- B. Install the four attachment bolts and the washers. Tighten the bolts to a torque of 48 Nm to 52 Nm in the sequence shown in Figure 1.

PCU MOUNTING FLANGE — BOLT TIGHTENING SEQUENCE

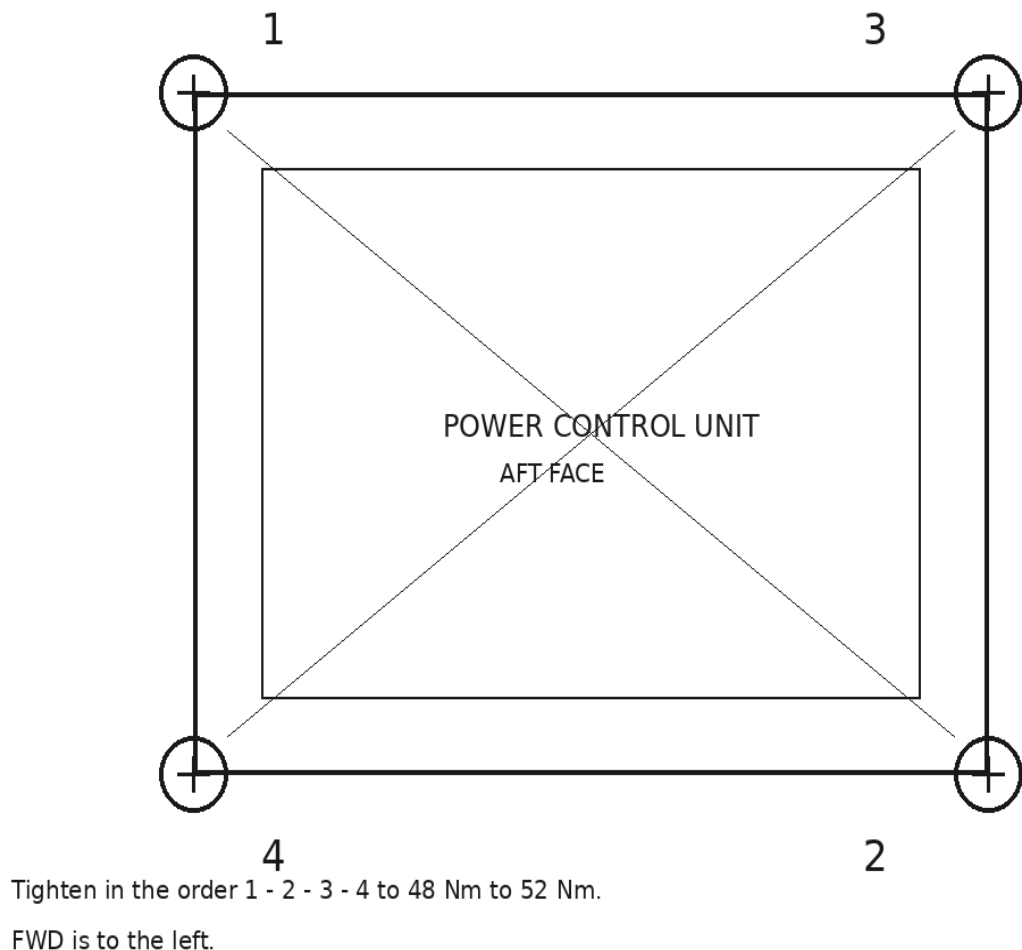

Power control unit — bolt tightening sequence — Figure 1

- C. Install the lockwire on the four attachment bolts.
- D. **APPLICABLE TO: A350X-1000 only**
Install the thermal blanket on the aft face of the unit and attach it with the six quick-release fasteners.

4. Close-up

3. Connect the unit

- A.** Connect the green system supply and return lines to ports A and B. Tighten the couplings to 34 Nm to 38 Nm.
- B.** Connect the yellow system supply and return lines to ports C and D. Tighten the couplings to 34 Nm to 38 Nm.
- C.** Connect the electrical connectors 2027VC and 2028VC. Make sure that the coupling rings are fully engaged.

4. Do the installation test

- A.** Pressurize the green hydraulic system and examine the couplings on ports A and B for leakage. The permitted leakage is zero.
- B.** Do the slat system operational test and make sure that no fault message is shown on the maintenance terminal.

4. Close-up

Remove the handling sling and the platform from the work area.

Close the fwd belly fairing access panel 196AB.

Make an entry in the aircraft technical log.