

**PHASE II ENVIRONMENTAL SITE ASSESSMENT
FOR
HITCHING POST INN
1600 WEST LINCOLNWAY
CHEYENNE, LARAMIE COUNTY, WYOMING**



Prepared for:

U.S. ENVIRONMENTAL PROTECTION AGENCY
1595 Wynkoop Street
Denver, Colorado 80202

Prepared by:

WESTON SOLUTIONS, INC.
1435 Garrison Street, Suite 100
Lakewood, Colorado 80215
303-729-6100 • Fax 303-729-6101

Date Prepared	March 2018
TDD No.	0003/1711-13
Document Control No.	W0555.1A.01563
Contract No.	EP-S8-13-01
U.S. EPA Work Assignment Manager	Barbara Benoy

**PHASE II ENVIRONMENTAL SITE ASSESSMENT
FOR
HITCHING POST INN
1600 WEST LINCOLNWAY
CHEYENNE, LARAMIE COUNTY, WYOMING**


Prepared for:

U.S. ENVIRONMENTAL PROTECTION AGENCY
1595 Wynkoop Street
Denver, Colorado 80202

Prepared by:

WESTON SOLUTIONS, INC.
1435 Garrison Street, Suite 100
Lakewood, Colorado 80215
303-729-6100 • Fax 303-729-6101

Prepared by:

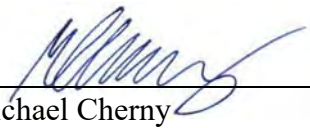

Michael Cherny
START Scientist

Date: 3/27/2018

Reviewed and Approved by:



Elliott Petri, P.E.
START Project Team Leader and
Environmental Professional

Date: 3/27/2018

TABLE OF CONTENTS

Section	Page
SUMMARY	S-1
1.0 INTRODUCTION	1
1.1 SCOPE OF WORK AND PURPOSE.....	1
1.2 STATEMENT OF OBJECTIVES	1
2.0 SUMMARY OF BACKGROUND INFORMATION	2
2.1 PROPERTY DESCRIPTION, LOCATION, AND HISTORY	2
2.2 PREVIOUS ENVIRONMENTAL REPORTS AND RECORDS.....	2
3.0 DESCRIPTION OF WORK PERFORMED AND RATIONALE	4
3.1 ASBESTOS-CONTAINING MATERIAL	4
3.2 LEAD-BASED PAINT.....	4
3.3 VISUAL INSPECTIONS	4
3.4 DEVIATIONS FROM THE SAMPLING AND ANALYSIS PLAN.....	5
4.0 DESCRIPTION OF METHODS USED.....	6
4.1 ASBESTOS-CONTAINING MATERIAL	6
4.2 LEAD-BASED PAINT.....	7
4.3 PCBS, MERCURY, AND MOLD.....	7
5.0 PRESENTATION OF INFORMATION AND DATA ACQUIRED	8
5.1 ASBESTOS-CONTAINING MATERIAL	8
5.2 LEAD-BASED PAINT.....	9
5.3 PCBS, MERCURY, AND MOLD.....	10
6.0 EVALUATION AND INTERPRETATION OF INFORMATION, DATA, AND RESULTS.....	11
6.1 ASBESTOS-CONTAINING MATERIAL	11
6.2 LEAD-BASED PAINT.....	14
6.3 PCBS, MERCURY, AND MOLD.....	15
6.4 CONCEPTUAL SITE MODEL	16
6.5 DISCLOSURE OF AVAILABLE DATA INSUFFICIENT TO MEET OBJECTIVES	16
7.0 CONCLUSIONS OF THE PHASE II ESA	17
8.0 SIGNATURE OF PHASE II ASSESSOR AND SEAL.....	19
9.0 SPECIFICATIONS FOR ASTM E1903-11 REPORT USE AND RELIANCE	20
9.1 SPECIAL TERMS AND CONDITIONS.....	20
9.2 LIMITATIONS AND EXCEPTIONS OF ASSESSMENT	20
9.3 DISCLAIMERS	20
10.0 REFERENCES	22
11.0 QUALIFICATIONS.....	23

LIST OF FIGURES

FIGURE 1	SITE LOCATION MAP
FIGURE 2	SITE FEATURES MAP
FIGURE 3	LBP AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 1 – MAIN FLOOR
FIGURE 4	LBP AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 1 – SECOND FLOOR
FIGURE 5	LBP AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 2 – MAIN FLOOR
FIGURE 6	LBP AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 2 – SECOND FLOOR
FIGURE 7	LBP AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 3 – MAIN FLOOR
FIGURE 8	LBP AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 3 – SECOND FLOOR
FIGURE 9	LBP AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 4 – MAIN FLOOR
FIGURE 10	LBP AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 4 – SECOND FLOOR
FIGURE 11	ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 5 – MAIN FLOOR
FIGURE 12	ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 5 – SECOND FLOOR
FIGURE 13	ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 5 – THIRD FLOOR
FIGURE 14	ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 1 – ROOF
FIGURE 15	ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 2 – ROOF
FIGURE 16	ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 3 – ROOF
FIGURE 17	ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 4 – ROOF
FIGURE 18	ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 5 – ROOF

LIST OF TABLES

TABLE 1	ACM SAMPLE RESULTS AND ESTIMATED VOLUMES
TABLE 2	NON-ACM SAMPLES BY POINT COUNT
TABLE 3	NON-DETECT FOR ASBESTOS SAMPLES

LIST OF TABLES (CONTINUED)

TABLE 4 LEAD-BASED PAINT SCREENING RESULTS

LIST OF APPENDICES

APPENDIX A PHOTOGRAPH LOG
APPENDIX B LABORATORY REPORTS
APPENDIX C INSPECTOR CERTIFICATIONS

LIST OF ACRONYMS

ACM	asbestos-containing material
AHERA	Asbestos Hazard Emergency Response Act
ASTM	ASTM, International
COC	contaminant of concern
EPA	United States Environmental Protection Agency
HA	homogeneous area
HUD	United States Department of Housing and Urban Development
LBP	lead-based paint
LF	linear feet
mg/cm ²	milligrams per square centimeter
PCB	polychlorinated biphenyl
P.E.	Professional Engineer
PLM	Polarized Light Microscopy
QA	Quality Assurance
QC	Quality Control
RACM	regulated asbestos-containing material
SAP	Sampling and Analysis Plan
sq. ft.	square feet
START	Superfund Technical Assessment and Response Team
SOO	Statement of Objectives
TBA	Targeted Brownfields Assessment
TCLP	Toxicity Characteristic Leaching Procedure
TDD	Technical Direction Document
user	City of Cheyenne
WESTON	Weston Solutions, Inc.
XRF	X-ray fluorescence

SUMMARY

The United States Environmental Protection Agency (EPA) tasked the Weston Solutions, Inc. (WESTON) Superfund Technical Assessment and Response Team (START) to assist the EPA in conducting a Phase II Environmental Site Assessment (ESA) for the Hitching Post Inn at 1600 West Lincolnway located in Cheyenne, Wyoming (WY) (Site, Figure 1).

SCOPE OF WORK

This Phase II ESA was conducted in accordance with Technical Direction Document (TDD) 0003/1711-13 and ASTM, International (ASTM) E1903-11– Standard Practice for Environmental Site Assessments: Phase II Environmental Site Assessment Process. The purpose of a Phase II ESA is to achieve the objectives set forth in the Statement of Objectives (SOO) developed by the EPA, user(s), and the Phase II Assessor. Goals for this Phase II ESA were to acquire and evaluate sufficient information to determine the location and concentration of potential environmental contamination at the Site, if present. The specific SOO for this Phase II ESA were as follows:

- Assess and evaluate suspected contaminants that may be present at the Site. Develop sufficient information to reasonably render a professional opinion that, with respect to the potential concerns assessed, hazardous substances either are or are not present at the property, including the concentrations of the substances if present;
- Gather and provide sufficient data to assist the Targeted Brownfield Assessment (TBA) recipient to make informed decisions with regard to the future use of the property; and
- Gather sufficient data to provide cost estimates for properly disposing of hazardous materials, remediation, and or demolition, if necessary.

SITE BACKGROUND

The Site is located in Cheyenne, WY just southwest of the downtown area and features five buildings previously used as a hotel which are currently vacant.

Victory Real Estate Management, LLC, in cooperation with The City of Cheyenne, plan to demolish the five buildings and redevelop the Site. The Phase I ESA completed by START (WESTON, 2018b) identified the possibility of asbestos-containing material (ACM), lead-based paint (LBP) and other environmental hazards being present, due to the age of the building. The Phase II ESA was performed as a result of the findings of the Phase I ESA.

SUMMARY OF RESULTS AND CONCLUSIONS

Phase II assessment fieldwork was conducted between February 5th and 7th, 2018. Results of the Phase II ESA have confirmed the presence of contaminants of concern (COCs) at the Site. The

following list is a summary of the results and conclusions regarding COCs and associated media identified by START at the Site:

Asbestos-Containing Material (ACM)

Of the 333 samples START submitted for laboratory analysis, a total of 264 samples were determined to be “positive” (>1% asbestos) for asbestos. The following tables indicate the locations and estimated extents of ACM identified at the Site. See Sections 5.1 and 6.1 of this report for a more detailed breakdown.

Building #1			
ACM		Estimated Volume / Extent	Location
Drywall	Ceilings	12,000 sq. ft.	Throughout building
	Walls	29,500 sq. ft.	
Roofing Material		4,500 sq. ft.	Roof

Notes:
sq. ft. = square feet

Building #2			
ACM		Estimated Volume / Extent	Location
Drywall	Ceilings	9,180 sq. ft.	Throughout building
	Walls	25,600 sq. ft.	
Roofing Material		4,300 sq. ft.	Roof

Notes:
sq. ft. = square feet

Building #3			
ACM		Estimated Volume / Extent	Location
Drywall	Ceilings	16,050 sq. ft.	Throughout building
	Walls	34,000 sq. ft.	
Roofing Material		5,500 sq. ft.	Roof

Notes:
sq. ft. = square feet

Building #4			
ACM		Estimated Volume / Extent	Location
Drywall	Ceilings	23,900 sq. ft.	Throughout building
	Walls	50,400 sq. ft.	
Roofing Material		9,000 sq. ft.	Roof

Notes:
sq. ft. = square feet

Breezeway		
ACM	Estimated Volume / Extent	Location
Drywall	1,600 sq. ft.	All walls
Popcorn Ceiling	1,000 sq. ft.	Entire ceiling
Roofing Material	1,000 sq. ft.	Roof

Notes:
sq. ft. = square feet

Building #5			
ACM		Estimated Volume / Extent	Location
Drywall	Ceilings	3,210 sq. ft.	Throughout building
	Walls	77,000 sq. ft.	
Floor Tile		260 sq. ft.	Laundry and rooms 474 and 477
Linoleum		70 sq. ft.	Kitchen of room 474
Popcorn Ceiling		31,500 sq. ft.	Throughout building
Roofing Material		9,300 sq. ft.	Roof

Notes:
sq. ft. = square feet

Based on the results of the ACM survey, asbestos is present in the buildings. ACM is considered to be a COC in relation to the Site.

Lead-Based Paint (LBP)

Based on the XRF results, elevated lead concentrations are present on the ceilings, stair rail, and trim on the interior and/or exterior of the buildings. The following table lists the location, current surface paint color, and estimated extent of LBP present at the Site. Although there were positive readings on the exterior, there were no bare soils present around the locations of the readings; therefore, lead impacts to surface soil were not evaluated. LBP is considered to be a COC at the Site.

0003/1711-13

Location	Current Surface Paint Color	Estimated Extent
Exterior of Buildings #1 and #2		
Trim	Cream	2,750 sq. ft.
Exterior of Buildings #3 and #4		
Trim	Cream	680 sq. ft.
Interior of Building #2 – 1st Floor		
Ceiling	White	50 sq. ft.
Stair Railing	Brown	25 LF
Interior of Building #2 – 2nd Floor		
Ceiling	White	100 sq. ft.
Interior of Building #3 – 1st Floor		
Ceiling	White	80 sq. ft.
Interior of Building #3 – 2nd Floor		
Ceiling	White	160 sq. ft.

Notes:
LF = linear feet
sq. ft. = square feet

Polychlorinated biphenyls (PCBs), Mercury, and Mold: A summary of the observations regarding the visual inspections conducted are presented below:

- Of the fluorescent light fixtures observed, only ballasts with a “no-PCBs” label were identified. PCBs are not considered a COC in relation to the Site.
- Mercury-containing thermostats were observed in all buildings except #1. Mercury is considered a COC in relation to the Site.
- Mold was encountered throughout the Site. Mold is considered a COC in relation to the Site.

SUMMARY OF RECOMMENDATIONS

Based on the results of the environmental assessment, START recommends the following:

- START recommends contracting an accredited asbestos remediation company to determine appropriate remedial actions to address the ACM at the Site during the cleanup phase of demolition. Abatement of friable ACM (i.e., drywall and linoleum) is recommended prior to any demolition activities at the Site. The non-friable ACM (i.e., floor tile and roofing) identified is classified as Category I non-friable; therefore, ACM remediation may not be required prior to demolition as the non-friable ACM may be

0003/1711-13

disposed with construction debris, if acceptable by the landfill. The landfill should be contacted prior to redevelopment regarding the disposal requirements of the construction debris. Though non-friable ACM may be able to be disposed of as construction waste, construction workers need to be made aware of the ACM present and appropriate protective measures will need to be implemented.

- START recommends contracting an accredited lead-based paint remediation company to assess disposal requirements for LBP at the Site if the buildings are to be demolished. Dust control methods should be implemented for the debris and all work performed should be done so by an EPA Lead-Safe certified firm. It is recommended that a construction debris disposal facility be contacted to determine if Toxicity Characteristic Leaching Procedure (TCLP) samples will be required.
- Mercury-containing thermostats will need to be removed and properly disposed of prior to building demolition.
- Mold should be controlled during demolition (e.g., dust control, ventilation, etc.).

This summary is intended to be a general description of the scope of work, results, conclusions, and recommendations identified as a result of the Phase II ESA of the Site; however, this section is not intended to be a “stand alone” document or to include the basis of all conclusions presented. The report should be read and used in its entirety. Information included in this section is subject to the scope of services and limitations noted in the original TDD and in this complete report.

1.0 INTRODUCTION

1.1 SCOPE OF WORK AND PURPOSE

WESTON START conducted a Phase II ESA for the Hitching Post Inn located at 1600 West Lincolnway, Cheyenne, WY (Site) (Figure 1). The ESA was conducted in accordance with TDD 0003/1711-13 and ASTM E1903-11 – Standard Practice for Environmental Site Assessments: Phase II Environmental Site Assessment Process. The purpose of a Phase II ESA is to acquire and evaluate information sufficient to achieve the objectives set forth in the SOO developed by the user(s) and the Phase II Assessor. The scope of a Phase II ESA is related to the activities agreed upon to meet the objectives of the investigation as defined in the SOO which are subject to ongoing evaluation and refinement as the assessment progresses. The SOO developed for this Site is presented in Section 1.2.

This Phase II ESA report contains the results of the data collection activities and associated quality assurance (QA)/quality control (QC) measures conducted specific to the Site. Information used to conduct this Phase II ESA was based upon reasonably ascertainable, visually and physically observable conditions, and included testing or sampling of materials. The structure of this report is based on the ASTM E1903-11 standard.

1.2 STATEMENT OF OBJECTIVES

The objectives were developed by the City of Cheyenne (user), START (Phase II Assessor), and the EPA to obtain sound, scientifically valid data concerning actual property conditions at the Site with respect to the presence or the likely presence of target analytes/substances including, but not limited to, those within the scope of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). The SOO for the Site were determined during the project scoping meeting held on December 19th, 2017. The Phase II ESA objectives determined for the Site were as follows:

- Assess and evaluate suspected contaminants that may be present at the Site. Develop sufficient information to reasonably render a professional opinion that, with respect to the potential concerns assessed, hazardous substances either are or are not present at the property, including the concentrations of the substances if present;
- Gather and provide sufficient data to assist the TBA recipient to make informed decisions with regard to the future use of the property; and
- Gather sufficient data to provide cost estimates for properly disposing hazardous materials, if necessary.

2.0 SUMMARY OF BACKGROUND INFORMATION

The Site is located in Cheyenne, WY, in a commercial use area on West Lincolnway. Victory Real Estate Management, LLC is planning on demolishing the buildings and redeveloping the property, in cooperation with the City of Cheyenne. The stakeholders would like to determine the extent and locations of possible contaminants before moving forward with redevelopment.

2.1 PROPERTY DESCRIPTION, LOCATION, AND HISTORY

The Site is approximately 10.82 acres located in Cheyenne, WY at 41.127103°N latitude and -104.832709°W longitude. Historically, the property was used as a hotel but is now abandoned. There are currently five buildings at the Site (Figure 2), as described below:

- **Building #1:** Two-story hotel building of 11,728 sq. ft. with 28 guest rooms.
- **Building #2:** Two-story hotel building of 11,516 sq. ft. with 26 guest rooms.
- **Building #3:** Two-story hotel building of 16,000 sq. ft. with 30 guest rooms.
- **Building #4:** Two-story hotel building of 29,270 sq. ft. with 44 guest rooms.
- **Building #5:** Three-story hotel building of 38,160 sq. ft. with 49 guest rooms.

The property is currently owned by Victory Real Estate Management, LLC and considered for redevelopment, in cooperation with the City of Cheyenne. The Phase I ESA, performed by START, highlighted the possibility of asbestos containing material (ACM), lead-based paint (LBP), and other environmental hazards potentially being present. The Phase II ESA was performed as a result of the conclusions of the Phase I ESA.

2.2 PREVIOUS ENVIRONMENTAL REPORTS AND RECORDS

Previous environmental reports and/or records, if available, were obtained by START from various sources, including local agencies, and reviewed for information relating to the Site. A summary of records obtained is provided in the following table.

Document Reviewed	Description
Document: TBA Application Prepared for: EPA Prepared by: City of Cheyenne on behalf of Victory Real Estate Management, LLC Date: 2017 Report Source: EPA	Document Summary: The application gives brief summary of subject property background information and environmental conditions at the subject property (including potential contaminants). The application also provides contact names(s) and phone numbers for stakeholders, and potential redevelopment foundation. Information Relating to the Subject Property: The application indicates the property was developed in 1955 and operated as a conference center and hotel until September 2010 when a fire destroyed the Main Building. The hotel continued to operate in the undamaged buildings until September 2017 when they closed. The property is owned by Victory Real Estate Management, LLC and would like to redevelop the property into a commercial center with the potential for four acres adjacent to the Ice Rink and Events Center to be acquired by the City of Cheyenne.

Document Reviewed	Description
Document: Phase I ESA for Hitching Post 1600 W Lincolnway Cheyenne, Laramie County, Wyoming (WESTON, 2018b) Prepared for: EPA Prepared by: WESTON Date: 2018 Report Source: WESTON	Document Summary: This Phase I ESA lists ACM as a recognized environmental condition due to laboratory results being available for the Site; however, the locations of samples are unknown. Additionally, the following non-scope considerations are identified: LBP, PCBs, mercury thermostat switches, and mold. Information Relating to the Subject Property: Records indicate that the subject property had been utilized as a conference center and hotel since construction in 1955. A fire in September 2010 heavily damaged one of the buildings (Main Building) which contained the front desk, offices, conference center, restaurants, and hotel related amenities, and whose remnants have since been removed from the property. The hotel continued to operate in Buildings #3 and #4 until September 2017. There are currently five buildings on the site that are vacant.

3.0 DESCRIPTION OF WORK PERFORMED AND RATIONALE

This section summarizes the work performed and rationale for the work conducted to meet the SOO developed for the investigation as documented in the approved Sampling and Analysis Plan (SAP) for the Site (WESTON, 2018a). Deviations from the approved SAP for this Phase II ESA are presented in Section 3.4.

Based upon the SOO developed for the Site, a building inspection was conducted as part of this Phase II ESA. The investigation included visual inspection, field screening, and/or sample collection for laboratory analysis. Details of the individual media investigations along with rationale are presented below. Photographs of field activities are included in the Photograph Log presented in Appendix A, the analytical laboratory results are included in Appendix B, and the inspector certifications are included in Appendix C. The Phase II fieldwork was conducted between February 5th and 7th, 2018.

3.1 ASBESTOS-CONTAINING MATERIAL

This Phase II ESA involved an ACM survey, including the collection of bulk asbestos samples in order to establish the extent and presence of ACM. The survey was conducted by Asbestos Hazard Emergency Response Act (AHERA) Certified Asbestos Building Inspectors: Mr. Michael Cherny and Mr. Elliott Petri. Visual inspections were conducted on areas of the structures where an individual performing demolition or renovation operations may encounter regulated asbestos-containing material (RACM). Sample locations and the total number of samples were based on AHERA standards (EPA, 1985) and/or the best professional judgment of the inspector. Each potential RACM location was touched to determine if it was friable. Bulk samples were collected of all suspect friable and non-friable RACM and submitted to an asbestos-certified laboratory for analysis.

3.2 LEAD-BASED PAINT

Due to the age of the buildings at the Site, this Phase II ESA involved a LBP survey by EPA Certified LBP Inspector: Mr. Elliott Petri. In order to conduct the LBP survey, an XRF instrument was used on painted surface locations to determine if materials were positive for lead (≥ 1 milligram per square centimeter [mg/cm^2]). Visual inspections were conducted on areas of the buildings and XRF readings were collected based upon the best professional judgment of the inspector.

3.3 VISUAL INSPECTIONS

Due to the age of the buildings, visual inspections were conducted for PCB ballasts, mercury thermostats, and mold. The visual inspection included presence/non-presence determination of the hazards. Quantity and location information was documented where possible, but no samples were collected.

3.4 DEVIATIONS FROM THE SAMPLING AND ANALYSIS PLAN

Due to the ongoing evaluation and refinement of the SOO, changes can occur to the approved SAP based upon site conditions encountered. A list of the deviations from the approved SAP are presented below.

- Rolling sample total component of the nomenclature was not continuous since two sampling teams were utilized.
- Sample nomenclature was modified to include building segment identifiers:
 - “HP#” for the building number (i.e., 1, 2, 3, 4, or 5);
 - “-#-” for floor of building (i.e., 1, 2, or 3);
 - “-R-” for roof; and
 - “-BW-” for breezeway.

No other deviations from the approved SAP were identified during this Phase II ESA.

4.0 DESCRIPTION OF METHODS USED

4.1 ASBESTOS-CONTAINING MATERIAL

Asbestos Bulk Sampling

Personnel performing the sampling wore personal protective equipment appropriate to the hazard(s) presented and included gloves, Tyvek, booties, hard hats, and/or high-efficiency particulate air respiratory protection. Asbestos bulk samples were randomly collected using the grid system described in the EPA publication “Asbestos in Buildings – Simplified Sampling Scheme for Friable Surfacing Materials” (EPA, 1985). The following general sampling guidelines were followed during the inspection, as applicable:

- In areas where homogeneous suspected RACM (surfacing) was less than 1,000 square feet (sq. ft.), three randomly collected bulk samples were collected from each area;
- In areas where homogeneous suspected RACM (surfacing) was at least 1,000 sq. ft. but less than 5,000 sq. ft., five randomly collected bulk samples were collected from each area;
- In areas where homogeneous suspect RACM (surfacing) was at least 5,000 sq. ft., seven randomly selected bulk samples were collected from each area;
- At the discretion of the inspector, the EPA recommended nine randomly selected bulk samples were collected from each area;
- At least three samples were collected from thermal systems insulations (TSI);
- At least one sample was taken from pipe fittings; and
- For miscellaneous materials, a minimum of one bulk sample was collected for each type.

Quality Assurance (QA)/Quality Control (QC)

Side-by-side field duplicate samples were collected at the frequency of one per 20 bulk samples. Sample HP3-1-DW03-020 was identified as non-ACM but duplicate sample HP3-1-DW03-021 was identified as ACM. This discrepancy suggests heterogeneity since the other two samples taken of the homogenous area (HA) were also non-ACM; however, the resulting drywall HA added as ACM is negligible compared to the rest of the ACM drywall present in Building #3. No other discrepancies were reported and all results are considered acceptable.

Laboratory Analytical Methods

Samples collected were sent to Reservoirs Environmental Inc. in Denver, CO for polarized light microscopy (PLM) analysis by Method EPA 600/R-93/116 to determine a visual estimation of asbestos content and, if applicable, Method EPA 600/R-93/116 (400 Point Count).

4.2 LEAD-BASED PAINT

XRF Readings

XRF in-situ readings were collected using an Innov-X Alpha Series™ handheld XRF instrument to analyze painted and coated surfaces (interior and exterior) for lead during this Phase II ESA. XRF readings of walls, windows, and other painted surfaces in each room equivalent were collected. Room equivalents include painted or coated surfaces that are not considered to be separate rooms such as hallways and closets. A representative number of sample readings were collected from a subset of rooms considered by the certified LBP inspector to be of like coated surfaces.

In general, locations where the paint appeared to be thickest were selected for XRF analysis. Locations where paint was worn away or scraped off were avoided. Areas over pipes, electrical surfaces, nails, and other possible interferences were also avoided. The XRF probe faceplate was allowed to lie flat against the surface of the test location to obtain a quality reading.

QA/QC

The following QA/QC activities were conducted as part of this investigation:

- XRF Standardization Readings – XRF standardization readings were collected prior to use, every four hours during use (as applicable), and following use to verify accuracy.

No other QA/QC activities or sample types were required based upon the assessment techniques and sample collection methods. Based on the results of the standardization readings, all results reported are considered acceptable. Results of the QA/QC activities are presented in Table 4.

Laboratory Analytical Methods

Due to no inconclusive readings reported by the XRF instrument, no paint chip samples were collected for laboratory analysis.

4.3 PCBS, MERCURY, AND MOLD

Visual Inspections

Visual inspections were conducted for presence/non-presence of mercury thermostats, PCB ballasts, and mold. Suspect hazards encountered, if any, were documented in field notes and/or photographed.

5.0 PRESENTATION OF INFORMATION AND DATA ACQUIRED

5.1 ASBESTOS-CONTAINING MATERIAL

A total of 333 bulk samples were collected from the buildings at the Site and submitted for PLM analysis. Of the samples collected, the following number of samples were collected of each bulk material.

Bulk Material	Number of Samples Collected
Carpet and Mastic	26
Cove Base	4
Drywall (ceiling and walls)	253
Floor Tile	5
Linoleum	5
Miscellaneous	2
Pipe Joints	4
Popcorn Ceiling	27
Roofing Materials	4
Stucco	3

In addition, the following assumptions and items of note were observed during the ACM survey:

- When appropriate, samples were collected from areas of the building material already damaged or disturbed; however, intrusive and destructive sampling methods were employed, as needed, since the buildings are slated for demolition.
- Multiple types of surfacing textures were observed throughout the buildings on sheetrock. Several areas had double layered drywall walls and/or ceilings present. All layers were sampled and drywall samples included sheetrock, tape, compound, and/or texture components. Due to the unknown renovation history of the buildings, each building and floor were considered a separate HA.
- Popcorn ceilings were present in the breezeway and in Building #5.
- Most flooring consisted of carpeting and pad with some leveling compound and/or mastic present. Suspect floor tiles and/or linoleum were present in Buildings #4 and #5. Double layered floor tiles were present in the third-floor laundry room of Building #5. A concrete subfloor was below all flooring layers.
- No suspect window glazing was present since all windows observed were vinyl or metal.
- Fire-rated doors were constructed using polystyrene cores.

0003/1711-13

- No ceiling tiles were observed in the buildings.
- No crawlspaces were present since all buildings were slab-on-grade.
- Insulation types observed were fiberglass, cellulose, straw, or a synthetic material. Some mudded fittings were present and sampled in Building #5. No vermiculite was observed inside of concrete masonry units.
- Miscellaneous materials sampled included a mastic used on double layer drywall and electrical panel partitions.
- Exterior facing roofing was comprised of wooden shingles and a felt paper. The inner portions of the roofs were built-up asphalt of which all layers were sampled. Suspect roofing sealant was observed around bathroom vent piping. Although only the roof of Building #4 was accessible, it is assumed all roofs are homogenous based on dates of construction and aerial photographs. The exteriors walls of the buildings were stucco and brick.

5.2 LEAD-BASED PAINT

A total of 373 XRF readings were taken from the buildings. The following number of readings were collected from each area:

Location	Readings Count
Building #1 Interior – 1 st Floor	23
Building #1 Interior – 2 nd Floor	22
Building #2 Interior – 1 st Floor	26
Building #2 Interior – 2 nd Floor	24
Building #3 Interior – 1 st Floor	40
Building #3 Interior – 2 nd Floor	28
Building #4 Interior – 1 st Floor	44
Building #4 Interior – 2 nd Floor	40
Breezeway	4
Building #5 Interior – 1 st Floor	37
Building #5 Interior – 2 nd Floor	32
Building #5 Interior – 3 rd Floor	31
Buildings #1 and #2 Exterior	6
Buildings #3 and #4 Exterior	11
Building #5 Exterior	5

5.3 PCBS, MERCURY, AND MOLD

The following observations were made during the visual inspections:

- Most of the fixtures observed in the buildings were incandescent, but some fluorescent fixtures were present in the bathrooms and utility rooms. All ballasts inspected had a “No-PCBs” label.
- Mercury-containing thermostat switches were observed throughout multiple rooms in all buildings except #1. An exact count of the devices present was not able to be made since not all rooms were accessible.
- Mold was encountered throughout multiple buildings.

6.0 EVALUATION AND INTERPRETATION OF INFORMATION, DATA, AND RESULTS

The evaluation and interpretation of the information, data, and results for the Phase II ESA are presented below. This section summarizes the field screening data and laboratory results obtained to identify the location and extent of contamination. Benchmarks used for comparison are listed below:

ACM

- **Asbestos-Containing Materials in Schools Rule (40 Code of Federal Regulations [CFR] Part 763, Subpart E).** ACM is defined as any material containing more than one percent (1%) asbestos.

LBP

- **U.S. Department of Housing and Urban Development (HUD) Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing (2012 Edition).** The HUD benchmark for lead-based paint is greater than or equal to 1.0 milligrams per centimeter square ($\geq 1.0 \text{ mg/cm}^2$).

The locations of samples and/or extent of hazardous building materials exceeding benchmarks are depicted on Figures 3 through 18. Field readings and laboratory results for the samples collected are summarized in Tables 1 through 4. Photographs of the field activities conducted are presented in Appendix A. Copies of the laboratory reports are presented in Appendix B. Inspector Certifications are presented in Appendix C.

6.1 ASBESTOS-CONTAINING MATERIAL

Of the 333 bulk samples submitted for laboratory analysis, 265 samples were reported as “positive” ($>1\%$ asbestos) or trace ($<1\%$ asbestos) for asbestos. Asbestos results ranged from trace to 18% total asbestos. Of the 265 samples, four were reanalyzed by point count analysis and one sample (HP4-R-RF01-190) was point counted below one and is not considered to be ACM. In all, 264 confirmed ACM samples were collected at the Site. The following table indicates the type, condition, and number of samples identified as ACM.

Identified ACM	Condition	Number of ACM Samples
Carpet ¹	Non-Friable	1
Cove Base ²	Non-Friable	2
Drywall	Friable	228
Floor Tile	Non-Friable	2
Linoleum	Friable	1
Popcorn Ceiling	Friable	27
Roofing Materials	Non-Friable	3

Notes:

¹ = A white perlite compound from the damaged surrounding popcorn ceiling is the ACM

² = An off-white compound from the drywall is the ACM

ACM sample collection locations and approximate extent of ACM are presented in Figures 3 through 18. The confirmed ACM sample(s), the asbestos-containing layer(s), and the estimated volume of ACM is presented in Table 1. Samples point counted below one and not considered ACM are presented in Table 2. A list of the samples collected that were reported as non-detect for asbestos is presented in Table 3.

Interpretation of Results

All wallboard (i.e., textured, unfinished, or wallpapered), ceilings (i.e., textured or popcorn), and inner portions of the roofs for all buildings are considered to be ACM. The only exception is the bathroom ceiling on the second floor of Building #2 which is not ACM. Additionally, in Building #5, a linoleum in the kitchen of room 474 and floor tiles found in the laundry and rooms 474 and 477 were confirmed to be ACM.

Based on the laboratory results reported for the confirmed ACM samples, asbestos is present in all the buildings at the Site. ACM is considered to be a COC in relation to the Site. The following tables indicate the location and estimated extent of ACM identified at the Site.

Building #1			
ACM		Estimated Volume / Extent	Location
Drywall	Ceilings	12,000 sq. ft.	Throughout building
	Walls	29,500 sq. ft.	
Roofing Material		4,500 sq. ft.	Roof

Notes:

sq. ft. = square feet

Building #2			
ACM		Estimated Volume / Extent	Location
Drywall	Ceilings	9,180 sq. ft.	Throughout building
	Walls	25,600 sq. ft.	
Roofing Material		4,300 sq. ft.	Roof

Notes:

sq. ft. = square feet

Building #3			
ACM		Estimated Volume / Extent	Location
Drywall	Ceilings	16,050 sq. ft.	Throughout building
	Walls	34,000 sq. ft.	
Roofing Material		5,500 sq. ft.	Roof

Notes:

sq. ft. = square feet

Building #4			
ACM		Estimated Volume / Extent	Location
Drywall	Ceilings	23,900 sq. ft.	Throughout building
	Walls	50,400 sq. ft.	
Roofing Material		9,000 sq. ft.	Roof

Notes:

sq. ft. = square feet

Breezeway			
ACM		Estimated Volume / Extent	Location
Drywall		1,600 sq. ft.	All walls
Popcorn Ceiling		1,000 sq. ft.	Entire ceiling
Roofing Material		1,000 sq. ft.	Roof

Notes:

sq. ft. = square feet

Building #5			
ACM		Estimated Volume / Extent	Location
Drywall	Ceilings	3,210 sq. ft.	Throughout building
	Walls	77,000 sq. ft.	
Floor Tile		260 sq. ft.	Laundry and rooms 474 and 477

0003/1711-13

Building #5		
ACM	Estimated Volume / Extent	Location
Linoleum	70 sq. ft.	Kitchen of room 474
Popcorn Ceiling	31,500 sq. ft.	Throughout building
Roofing Material	9,300 sq. ft.	Roof

Notes:
sq. ft. = square feet

6.2 LEAD-BASED PAINT

Of the 373 XRF readings taken from the buildings, a total of 20 readings were positive for LBP contamination (≥ 1 mg/cm²). The following table indicates the location, current surface paint color, and percent lead for LBP identified at the Site.

Location (# of Positive Readings)	Current Surface Paint Color	Area Concentration of LBP ($\pm$ Error)
Exterior of Buildings #1 and #2		
Trim (3)	Cream	1 mg/cm ² ($\pm$ 0.06) to 1.12 mg/cm ² ($\pm$ 0.06)
Exterior of Buildings #3 and #4		
Trim (3)	Cream	5 mg/cm ² ($\pm$ 0.76 to 1.26)
Interior of Building #2 – 1st Floor		
Ceiling (2)	White	1 mg/cm ² ($\pm$ 0.02)
Stair rail (2)	Brown	1 mg/cm ² ($\pm$ 0.05 to 0.1)
Interior of Building #2 – 2nd Floor		
Ceiling (3)	White	1 mg/cm ² ($\pm$ 0.03 to 0.08)
Interior of Building #3 – 1st Floor		
Ceiling (3)	White	1 mg/cm ² ($\pm$ 0.02 to 0.04)
Interior of Building #3 – 2nd Floor		
Ceiling (4)	White	1 mg/cm ² ($\pm$ 0.01 to 0.06)

A complete list of LBP readings is presented in Table 4. The location and approximate extent of LBP identified is presented on Figures 3 through 10.

Interpretation of Results

Based on the XRF results, elevated lead concentrations are present on the ceilings, stair rail, and trim on the interior and/or exterior of the buildings. The following table lists the location, current surface paint color, and estimated extent of LBP present at the Site. Although there were positive

0003/1711-13

readings on the exterior, there were no bare soils present around the locations of the readings; therefore, lead impacts to surface soil were not evaluated. LBP is considered to be a COC at the Site.

Location	Current Surface Paint Color	Estimated Extent
Exterior of Buildings #1 and #2		
Trim	Cream	2,750 sq. ft.
Exterior of Buildings #3 and #4		
Trim	Cream	680 sq. ft.
Interior of Building #2 – 1st Floor		
Ceiling	White	50 sq. ft.
Stair Railing	Brown	25 LF
Interior of Building #2 – 2nd Floor		
Ceiling	White	100 sq. ft.
Interior of Building #3 – 1st Floor		
Ceiling	White	80 sq. ft.
Interior of Building #3 – 2nd Floor		
Ceiling	White	160 sq. ft.

Notes:
LF = linear feet
sq. ft. = square feet

6.3 PCBS, MERCURY, AND MOLD

The following additional items were noted:

- Fluorescent lighting fixtures or ballasts were only observed in the bathrooms or utility rooms. Only ballasts with a “no-PCBs” label were identified.
- Mercury thermostats were observed in all buildings except #1.
- Mold was encountered throughout the Site. Several buildings had water damage from copper salvaging operations and other leaks.

Interpretation of Results

- Based on the visual inspection, PCBs are not considered a COC at the Site.
- Based on the visual inspection, mercury is considered a COC at the Site.
- Based on the visual inspection, mold is considered a COC at the Site.

6.4 CONCEPTUAL SITE MODEL

Per ASTM E1903-11 (Section 6.4.6), validation of the conceptual site model is conducted by evaluating testing results and other investigation findings to determine whether available information is sufficient to support sound conclusions regarding the presence of the target analytes. The presence of the target analytes investigated as part of this Phase II ESA along with the current exposure pathways, as applicable, for the Site is presented in the following table.

Target Analytes	Media	Contaminants Present Above Screening Benchmarks	Exposure Pathway	Exposure Route	Human Receptors	
					Residential	Workers
ACM	Building Materials	Yes	Potentially Complete	Dermal	--	X
				Ingestion	--	X
				Inhalation	--	X
LBP	Building Materials	Yes	Potentially Complete	Dermal	--	X
				Ingestion	--	X
				Inhalation	--	X
Mercury, PCBs, and Mold	Building Materials	Yes (Mercury and Mold)	Potentially Complete	Dermal	--	X
				Ingestion	--	X
				Inhalation	--	X

Comments: Evaluation of exposure pathway completeness is based upon the current site use as vacant and assumes that no people are currently accessing the Site or will be accessing the Site other than workers during future redevelopment. Once future site-specific activities are determined or if a change in current use occurs, exposure pathways should be re-assessed as they may alter the pathway completeness presented in this report and require further evaluation prior to conducting any activities or change in use at the Site.

Note:

-- = Receptor not at risk (Currently)

X = Receptor at risk to exposure (Currently or Potentially)

6.5 DISCLOSURE OF AVAILABLE DATA INSUFFICIENT TO MEET OBJECTIVES

Per ASTM E1903-11 (Section 1.3.2), all Phase II ESA reports must disclose any respect in which available data are insufficient to meet the objectives of the assessment. Listed below are the disclosures in which the available data set for this investigation were insufficient to meet the objectives of this Phase II ESA, if any.

- Based upon the objectives for this Phase II ESA, all objectives were met based upon the available data. In no respect was the available data insufficient to meet the objectives.

7.0 CONCLUSIONS OF THE PHASE II ESA

START performed a Phase II ESA in conformance with the scope and limitations of ASTM Practice E1903-11 for Hitching Post Inn at 1600 West Lincolnway located in Cheyenne, WY. The following list is a summary of the conclusions regarding COCs and associated media identified by START at the Site:

Asbestos-Containing Material

- Based on the results of the ACM survey, asbestos is present in all buildings. ACM is considered to be a COC in relation to the Site.

Lead-Based Paint

- Based on the results of the LBP screening, LBP is present in the buildings. LBP is considered to be a COC in relation to the Site.

PCBs, Mercury, and Mold

A summary of the observations regarding the visual inspections conducted are presented below:

- Of the fluorescent light fixtures observed, only ballasts with a “no-PCBs” label were identified. PCBs are not considered a COC in relation to the Site.
- Mercury-containing thermostats were observed in all buildings except #1. Mercury is considered a COC in relation to the Site.
- Mold was encountered throughout the Site. Mold is considered a COC in relation to the Site.

RECOMMENDATIONS

Based on the results of the environmental assessment, START recommends the following:

- START recommends contracting an accredited asbestos remediation company to determine appropriate remedial actions to address the ACM at the Site during the cleanup phase of demolition. Abatement of friable ACM (i.e., drywall and linoleum) is recommended prior to any demolition activities at the Site. The non-friable ACM (i.e., floor tile and roofing) identified is classified as Category I non-friable; therefore, ACM remediation may not be required prior to demolition as the non-friable ACM may be disposed with construction debris, if acceptable by the landfill. The landfill should be contacted prior to redevelopment regarding the disposal requirements of the construction debris. Though non-friable ACM may be able to be disposed of as construction waste, construction worker need to be made aware of the ACM present and appropriate protective measures will need to be implemented.
- START recommends contracting an accredited lead remediation company to assess disposal requirements for LBP at the Site if the buildings are to be demolished. Dust control

methods should be implemented for the debris and all work performed should be done so by an EPA Lead-Safe certified firm. It is recommended that a construction debris disposal facility be contacted to determine if Toxicity Characteristic Leaching Procedure (TCLP) samples will be required.

- Mercury-containing thermostats will need to be removed and properly disposed of prior to building demolition.
- Mold should be controlled during demolition (e.g., dust control, ventilation, etc.).

8.0 SIGNATURE OF PHASE II ASSESSOR AND SEAL

This Phase II ESA was completed by the following START personnel and subcontractor(s), if applicable. Qualifications are provided at the end of the report:

- Mr. Michael Cherny, Scientist – AHERA Certified Asbestos Building Inspector and EPA Lead-Based Paint Inspector; and
- Mr. Elliott Petri, P.E. – Environmental Professional, AHERA Certified Asbestos Building Inspector, and EPA Lead-Based Paint Inspector.

Elliott Petri, P.E. has undertaken the role of Phase II Assessor for this assessment. The following is the certification statement as defined in ASTM Practice E1903-11 (Section 9.2.1):

We have performed a Phase II environmental site assessment at the Hitching Post Inn at 1600 West Lincolnway located in Cheyenne, WY in conformance with the scope and limitations of ASTM Practice E1903-11 and for the following objectives:


- *Assess and evaluate suspected contaminants that may be present at the Site. Develop sufficient information to reasonably render a professional opinion that, with respect to the potential concerns assessed, hazardous substances either are or are not present at the property, including the concentrations of the substances if present;*
- *Gather and provide sufficient data to assist the TBA recipient to make informed decisions with regard to the future use of the property; and*
- *Gather sufficient data to provide cost estimates for properly disposing hazardous materials, if necessary.*

Elliott Petri, P.E.

Certifying Environmental Professional (Print)

Project Team Lead

Title

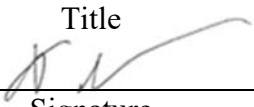

Signature

3/27/2018

Date

0003/1711-13

9.0 SPECIFICATIONS FOR ASTM E1903-11 REPORT USE AND RELIANCE

9.1 SPECIAL TERMS AND CONDITIONS

This document has been prepared by the WESTON START-IV team as tasked by the EPA solely for the use and benefit of the EPA and the City of Cheyenne. Any use of this document or information herein by persons or entities other than the EPA or the City of Cheyenne, without the express written consent of START, will be at the sole risk and liability of said person or entity. START will not be liable to the EPA, the City of Cheyenne, or such persons or entities, for any damages resulting therefrom. It is understood that this document may not include all information pertaining to the described site.

9.2 LIMITATIONS AND EXCEPTIONS OF ASSESSMENT

ASTM E1903-11 (Section 4.2.1) acknowledges that “No Phase II ESA can eliminate all uncertainty. Furthermore, any sample, either surface or subsurface, taken for chemical testing may or may not be representative of a larger population. Professional judgment and interpretation are inherent in the process, and even when exercised in accordance with objective scientific principles, uncertainty is inevitable. Additional assessment beyond that which was reasonably undertaken may reduce the uncertainty”. ASTM E1903-11 (Section 4.2.1.2) acknowledges that “The effectiveness of a Phase II ESA may be compromised by limitations or defects in the information used to define the objectives and scope of the investigation, including inability to obtain information concerning historic site uses or prior site assessment activities despite the efforts of the user and Phase II Assessor to obtain such information in accordance with 5.1.3”. Furthermore, the ASTM E1903-11 (Section 4.2.2) states “Phase II ESAs do not generally require an exhaustive assessment of environmental conditions on a property. There is a point at which the cost of information obtained and the time required to obtain it outweigh the benefit of the information and, in the context of private transactions and contractual responsibilities, may become a material detriment to the orderly conduct of business. If the presence of target analytes is confirmed on a property, the extent of further assessment is a function of the degree of confidence required and the degree of uncertainty acceptable in relation to the objectives of the assessment”.

9.3 DISCLAIMERS

START has performed this Phase II ESA in general conformance with the scope and limitations of ASTM E1903-11 standards and TDD 0003/1711-13. The Phase II ESA findings and conclusions presented herein are professional opinions based solely on data collected during the assessment and/or interpretation of information and past data provided for review. The information and data collected from the Site by START is based on the conditions existing on the date(s) of START’s assessment activities at the property. START does not warrant or guarantee information obtained from third parties used for this assessment are correct, complete, and/or current.

0003/1711-13

Though START did collect samples and/or perform testing during this assessment, it is possible that past contamination remains undiscovered or that property conditions will change in the future. START does not warrant or guarantee the property suitable for any particular purpose or certify the property as “clean.”

ASTM E1903-11 (Section 1.5) states “This practice is not intended to supersede applicable requirements imposed by regulatory authorities. This practice does not attempt to define a legal standard of care either for the performance of professional services with respect to matters within its scope, or for the performance of any individual *Phase II Environmental Site Assessment*”.

Information, limitations, and disclaimers provided in this general section apply to all of the sections included in this report.

10.0 REFERENCES

ASTM, International (ASTM), 2011. E1903-11, *Standard Practice for Environmental Site Assessments: Phase II Environmental Site Assessment Process*. West Conshohocken, Pennsylvania.

Citation	Reference Type	Assessment Factor				
		Soundness	Applicability and Utility	Clarity and Completeness	Uncertainty and Variability	Evaluation and Review
ASTM, 2011	Guidance	Acceptable	Acceptable	Acceptable	Acceptable	Acceptable

EPA, 2017. *Technical Direction Document (TDD) 0003/1711-13*.

Citation	Reference Type	Assessment Factor				
		Soundness	Applicability and Utility	Clarity and Completeness	Uncertainty and Variability	Evaluation and Review
EPA, 2017	Guidance	Acceptable	Acceptable	Acceptable	Acceptable	Acceptable

EPA, October 1985. EPA's "Pink Book", *Asbestos in Buildings: Simplified Sampling Scheme for Friable Surfacing Materials*. (EPA 560/5-85-030a).

Citation	Reference Type	Assessment Factor				
		Soundness	Applicability and Utility	Clarity and Completeness	Uncertainty and Variability	Evaluation and Review
EPA, 1985	Document	Acceptable	Acceptable	Acceptable	Acceptable	Acceptable

WESTON, 2018a. *Sampling and Analysis Plan Goodyear and Hitching Post Sites Cheyenne, Laramie County, Wyoming Targeted Brownfields Assessment*. February 2018.

Citation	Reference Type	Assessment Factor				
		Soundness	Applicability and Utility	Clarity and Completeness	Uncertainty and Variability	Evaluation and Review
WESTON, 2018a	Document	Acceptable	Acceptable	Acceptable	Acceptable	Acceptable

WESTON, 2018b. *Phase I Environmental Site Assessment for Hitching Post 1600 Lincolnway Cheyenne, Laramie County, Wyoming*. February 2018.

Citation	Reference Type	Assessment Factor				
		Soundness	Applicability and Utility	Clarity and Completeness	Uncertainty and Variability	Evaluation and Review
WESTON, 2018b	Document	Acceptable	Acceptable	Acceptable	Acceptable	Acceptable


0003/1711-13

11.0 QUALIFICATIONS

START utilized qualified, professional staff, trained in performing the scope of work required for this Phase II ESA. The START team personnel included a project manager and technical specialist(s). Their roles are described in more detail as follows:

- Engineer and Environmental Professional – Mr. Elliott Petri, P.E. has a M.S. in Environmental Science and Engineering with 8+ years of experience in the field of environmental sciences including Phase I/II ESAs, site investigations, assessments and remediation; Mr. Petri has managed/conducted quality control on projects from \$20,000 to 4 million dollars for the United States Air Force and the EPA.
- Scientist – Mr. Michael Cherny has 2+ years of project experience collecting soil, groundwater, surface water, and air samples, and conducting air monitoring. His experience includes conducting site assessments, removals, technical report documentation, and field instrument proficiency. Mr. Cherny is a certified asbestos and LBP inspector in Colorado, Montana, and EPA administered states.

FIGURES

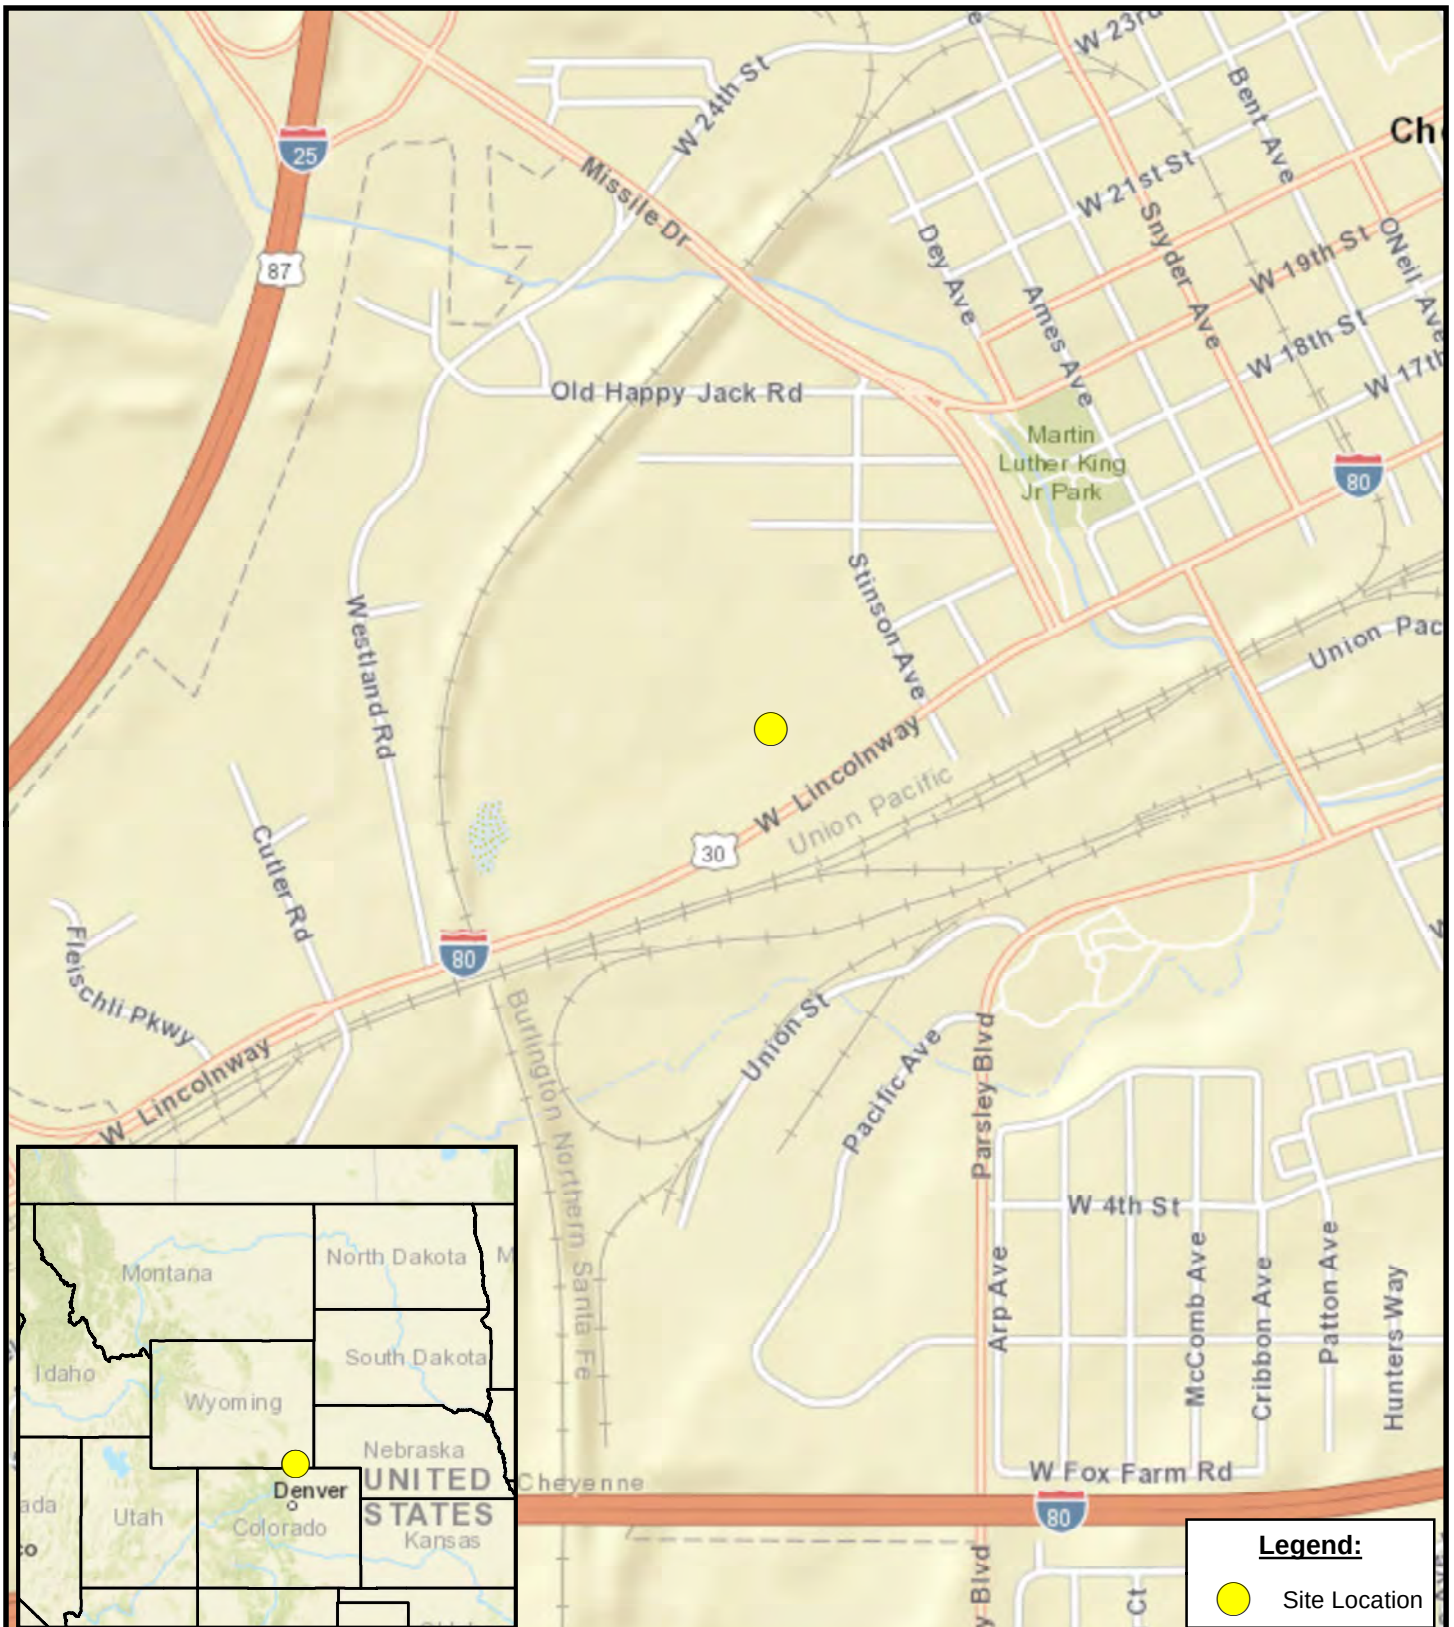

Coordinate System: WGS 1984 Web Mercator Auxiliary Sphere
 Projection: Mercator Auxiliary Sphere
 Datum: WGS 1984

Source:
 Site Boundary: Georeferenced Aerial (Google Earth 2017)
 Background: ESRI USA Topo Maps (2017)

0 0.125 0.25 0.5 Miles



Prepared for:
 U.S. EPA - Region 8

Contract: EP-S8-13-01
 TO/TDD: 0003/1711-13

Prepared By:
 Weston Solutions, Inc.
 START IV
 Suite 100
 1435 Garrison St.
 Lakewood, CO



FIGURE 1
SITE LOCATION MAP
HITCHING POST SITE
CHEYENNE
LARAMIE COUNTY,
WYOMING

Date: 1/9/2018




Legend:

 Property Boundary

Coordinate System: WGS 1984 Web Mercator Auxiliary Sphere
 Projection: Mercator Auxiliary Sphere
 Datum: WGS 1984

Source:
 Site Boundary: Georeferenced Aerial (Google Earth 2017)
 Background: ESRI USA Topo Maps (2017)



Prepared for:
 U.S. EPA - Region 8

Contract: EP-S8-13-01
TO/TDD: 0003/1711-13

Prepared By:
 Weston Solutions, Inc.
 START IV
 Suite 100
 1435 Garrison St.
 Lakewood, CO


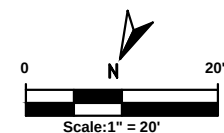


FIGURE 2
SITE BUILDINGS MAP
HITCHING POST SITE
CHEYENNE
LARAMIE COUNTY,
WYOMING

Date: 1/9/2018

LEGEND:

ACM	ASBESTOS CONTAINING MATERIAL
LBP	LEAD BASED PAINT
	ACM SAMPLE LOCATION (APPROXIMATE)
	ACM CEILING DRYWALL COMPOUND EXTENT
	ACM DRYWALL COMPOUND EXTENT
	LEAD BASED PAINT EXTENT

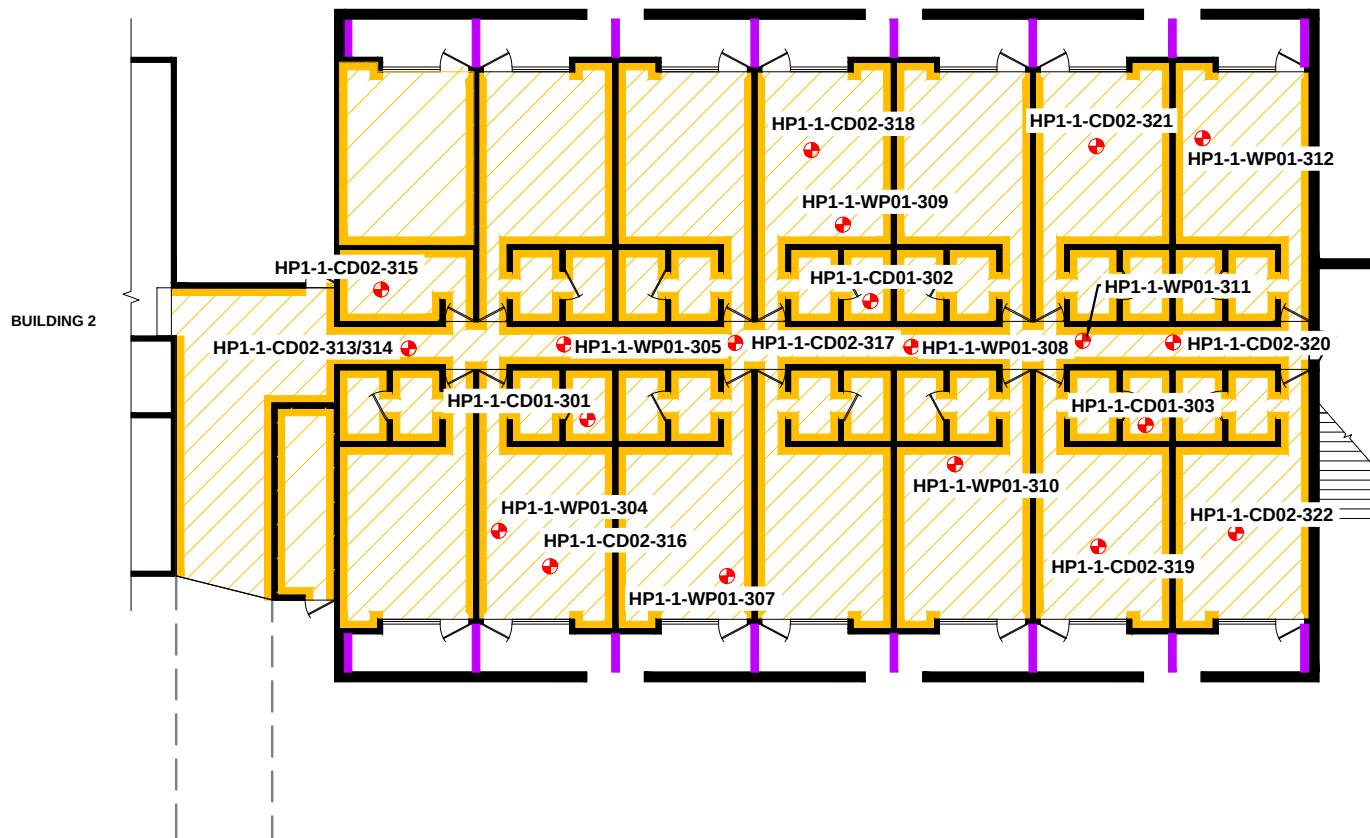

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215



LEAD BASED PAINT AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 1 - MAIN FLOOR HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY

DATE:
2/21/18
SCALE:
1" = 20'

Figure
3

LEGEND:

ACM	ASBESTOS CONTAINING MATERIAL
LBP	LEAD BASED PAINT
	ACM SAMPLE LOCATION (APPROXIMATE)
	ACM CEILING DRYWALL COMPOUND EXTENT
	ACM DRYWALL COMPOUND EXTENT
	LEAD BASED PAINT EXTENT

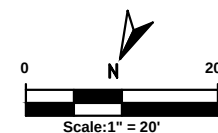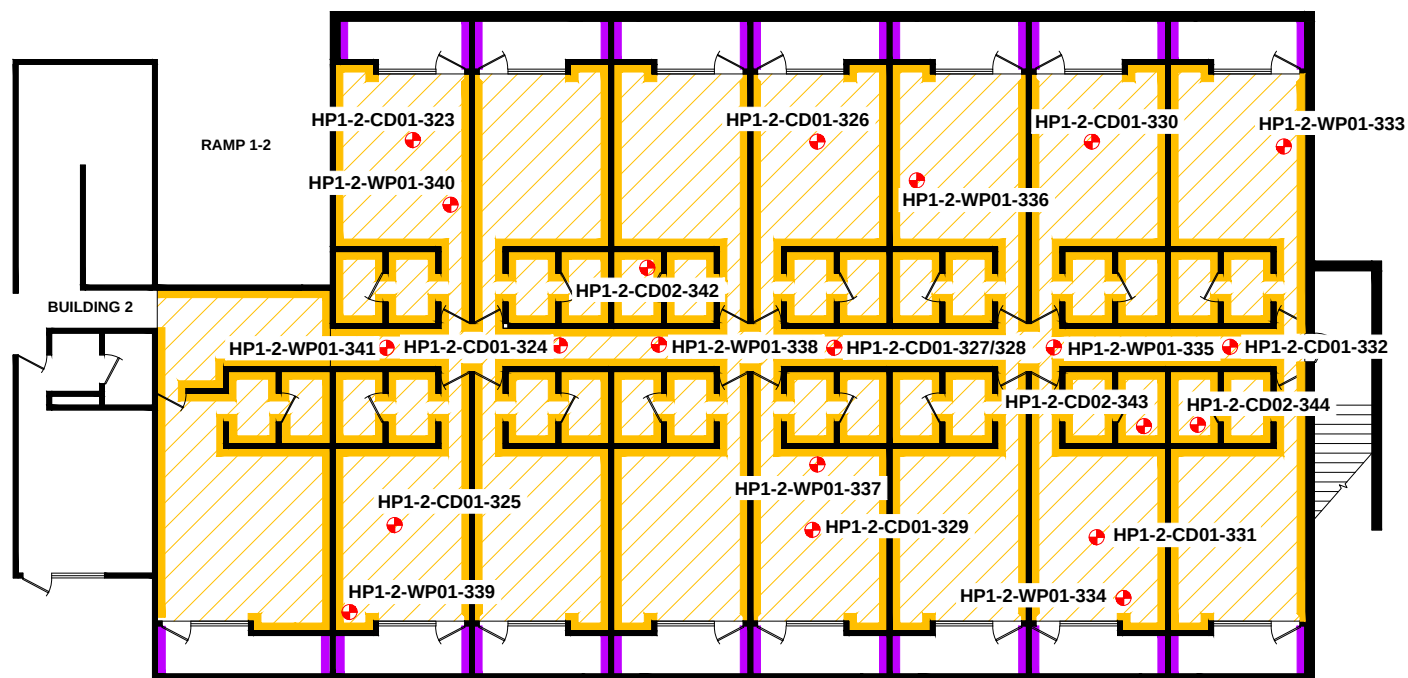

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215

LEAD BASED PAINT AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 1 - SECOND FLOOR HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY



DATE:
2/21/18

SCALE:
1" = 20'

Figure
4

LEGEND:

ACM	ASBESTOS CONTAINING MATERIAL
LBP	LEAD BASED PAINT
	ACM SAMPLE LOCATION (APPROXIMATE)
	ACM CEILING DRYWALL COMPOUND EXTENT
	ACM DRYWALL COMPOUND EXTENT
	LEAD BASED PAINT EXTENT
	LEAD BASED PAINT

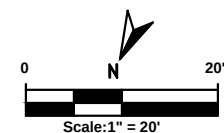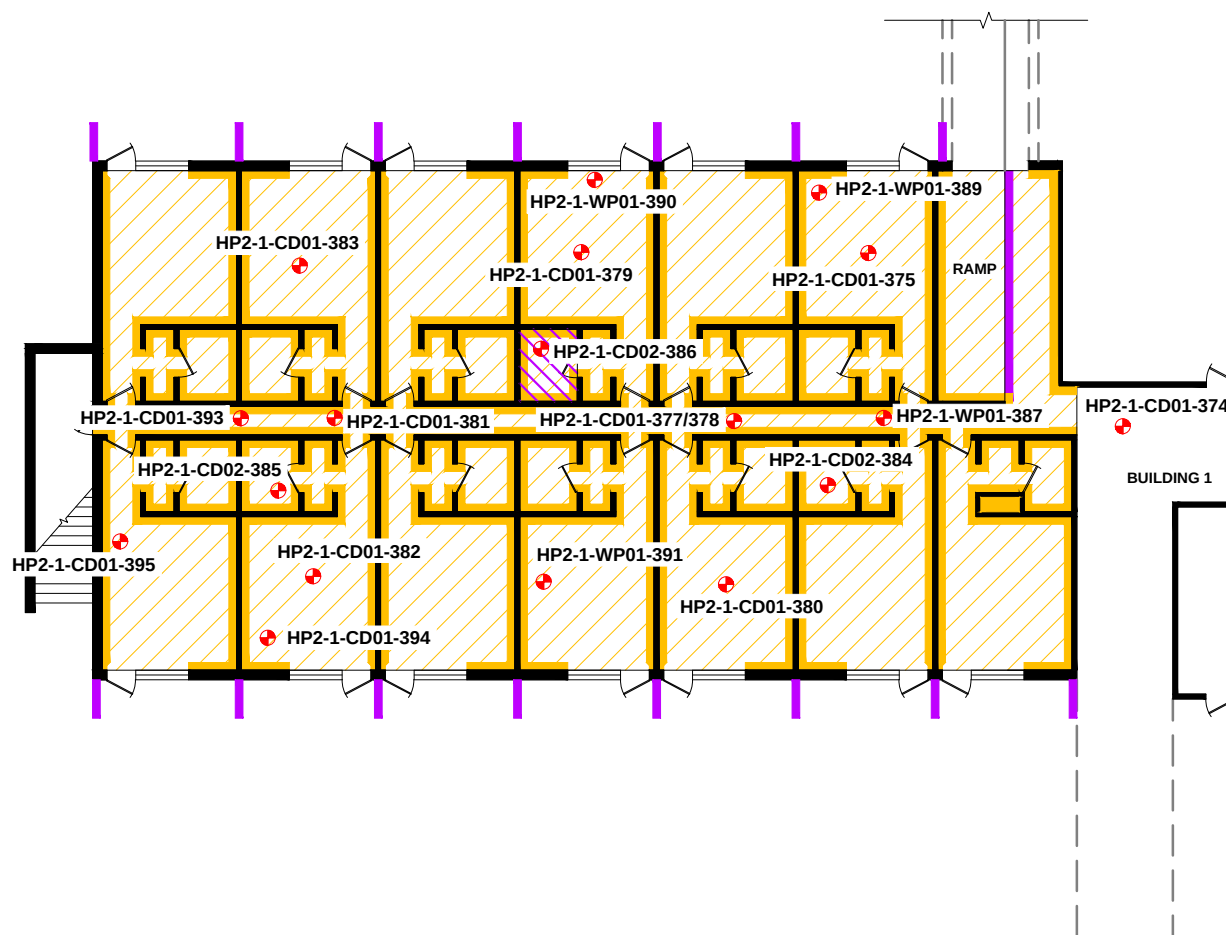

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215

LEAD BASED PAINT AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 2 - MAIN FLOOR HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY



DATE:
2/21/18

SCALE:
1" = 20'

Figure
5

LEGEND:

ACM	ASBESTOS CONTAINING MATERIAL
LBP	LEAD BASED PAINT
	ACM SAMPLE LOCATION (APPROXIMATE)
	ACM CEILING DRYWALL COMPOUND EXTENT
	ACM DRYWALL COMPOUND EXTENT
	LEAD BASED PAINT EXTENT
	LEAD BASED PAINT

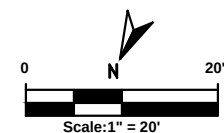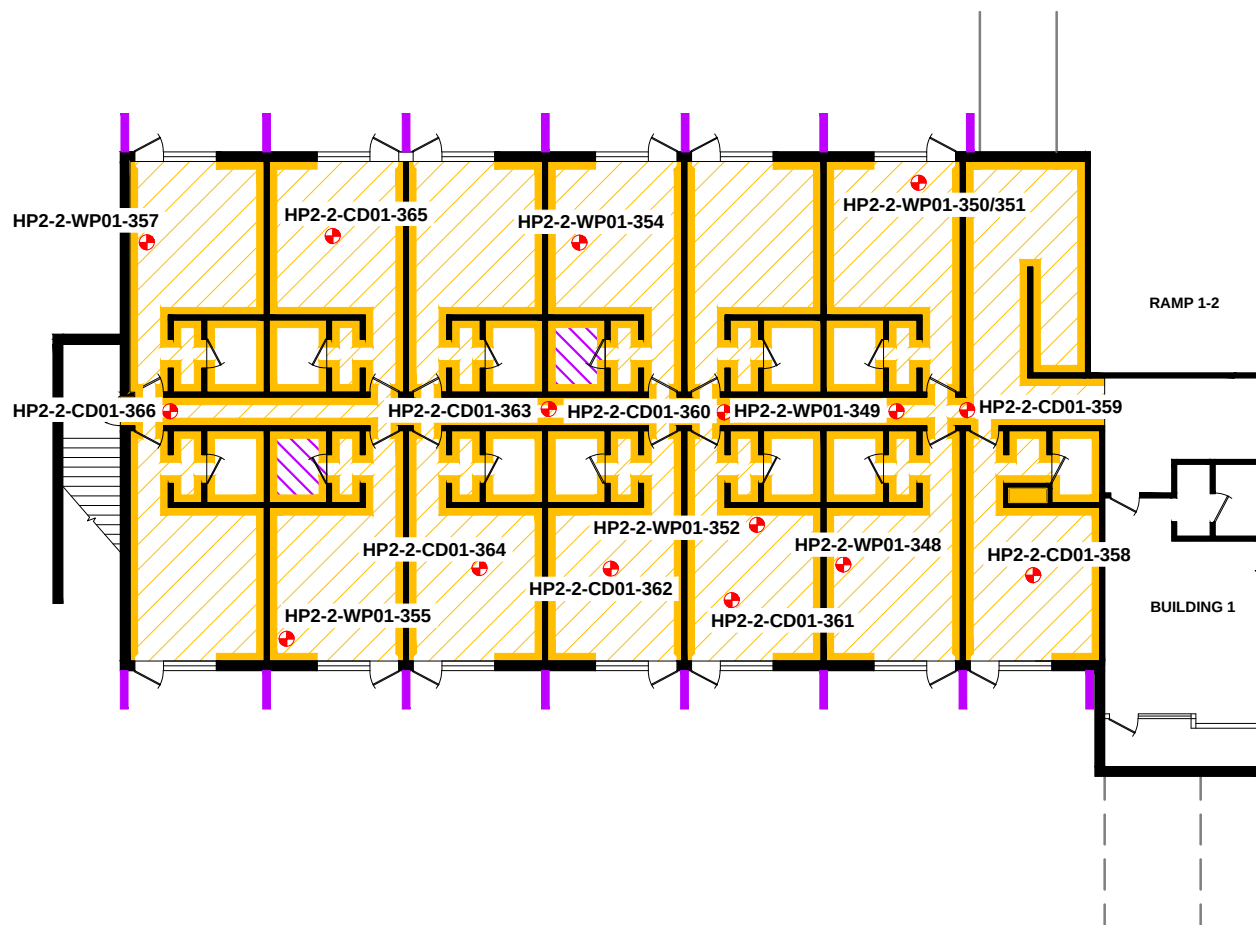

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215

LEAD BASED PAINT AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 2 - SECOND FLOOR HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY


DATE:
2/21/18

SCALE:
1" = 20'

Figure
6

LEGEND:

ACM	ASBESTOS CONTAINING MATERIAL
LBP	LEAD BASED PAINT
	ACM SAMPLE LOCATION (APPROXIMATE)
	ACM CEILING DRYWALL COMPOUND EXTENT
	ACM DRYWALL COMPOUND EXTENT
	LEAD BASED PAINT EXTENT
	LEAD BASED PAINT

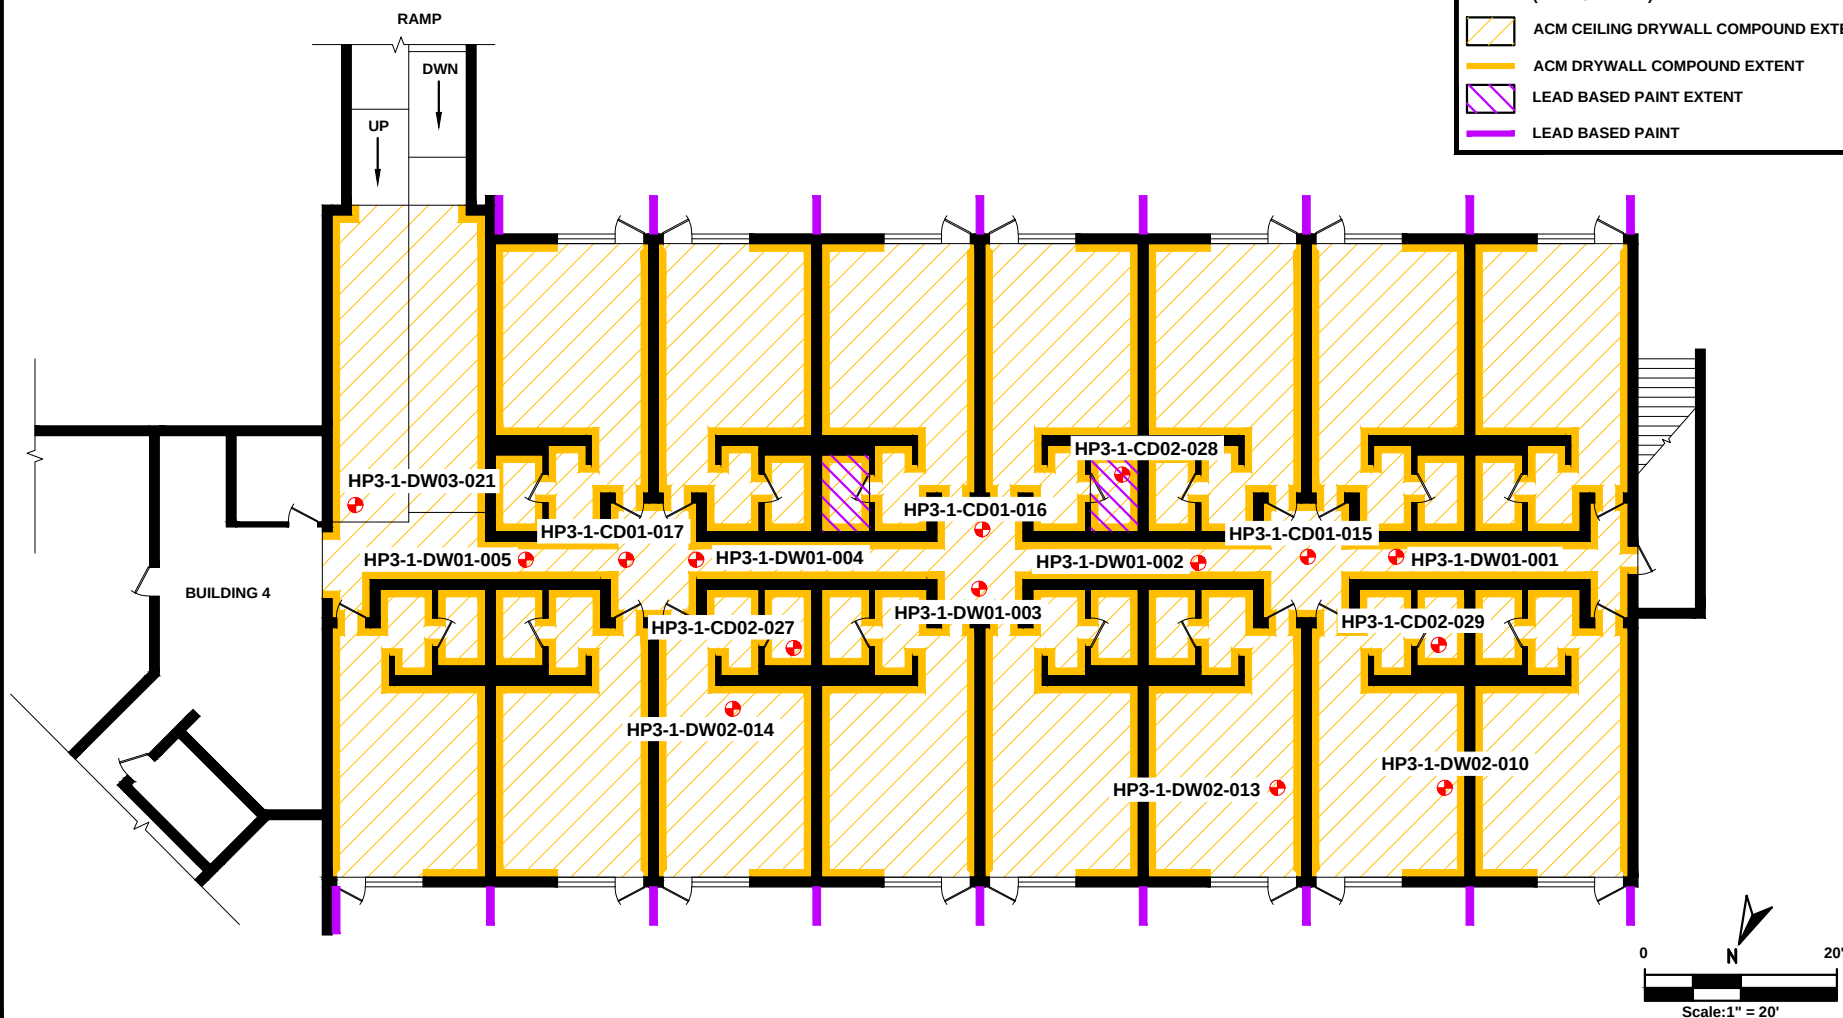

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215

LEAD BASED PAINT AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 3 - MAIN FLOOR HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY


DATE:
2/21/18

SCALE:
1" = 20'

Figure
7

LEGEND:

ACM	ASBESTOS CONTAINING MATERIAL
LBP	LEAD BASED PAINT
	ACM SAMPLE LOCATION (APPROXIMATE)
	ACM CEILING DRYWALL COMPOUND EXTENT
	ACM DRYWALL COMPOUND EXTENT
	LEAD BASED PAINT EXTENT
	LEAD BASED PAINT

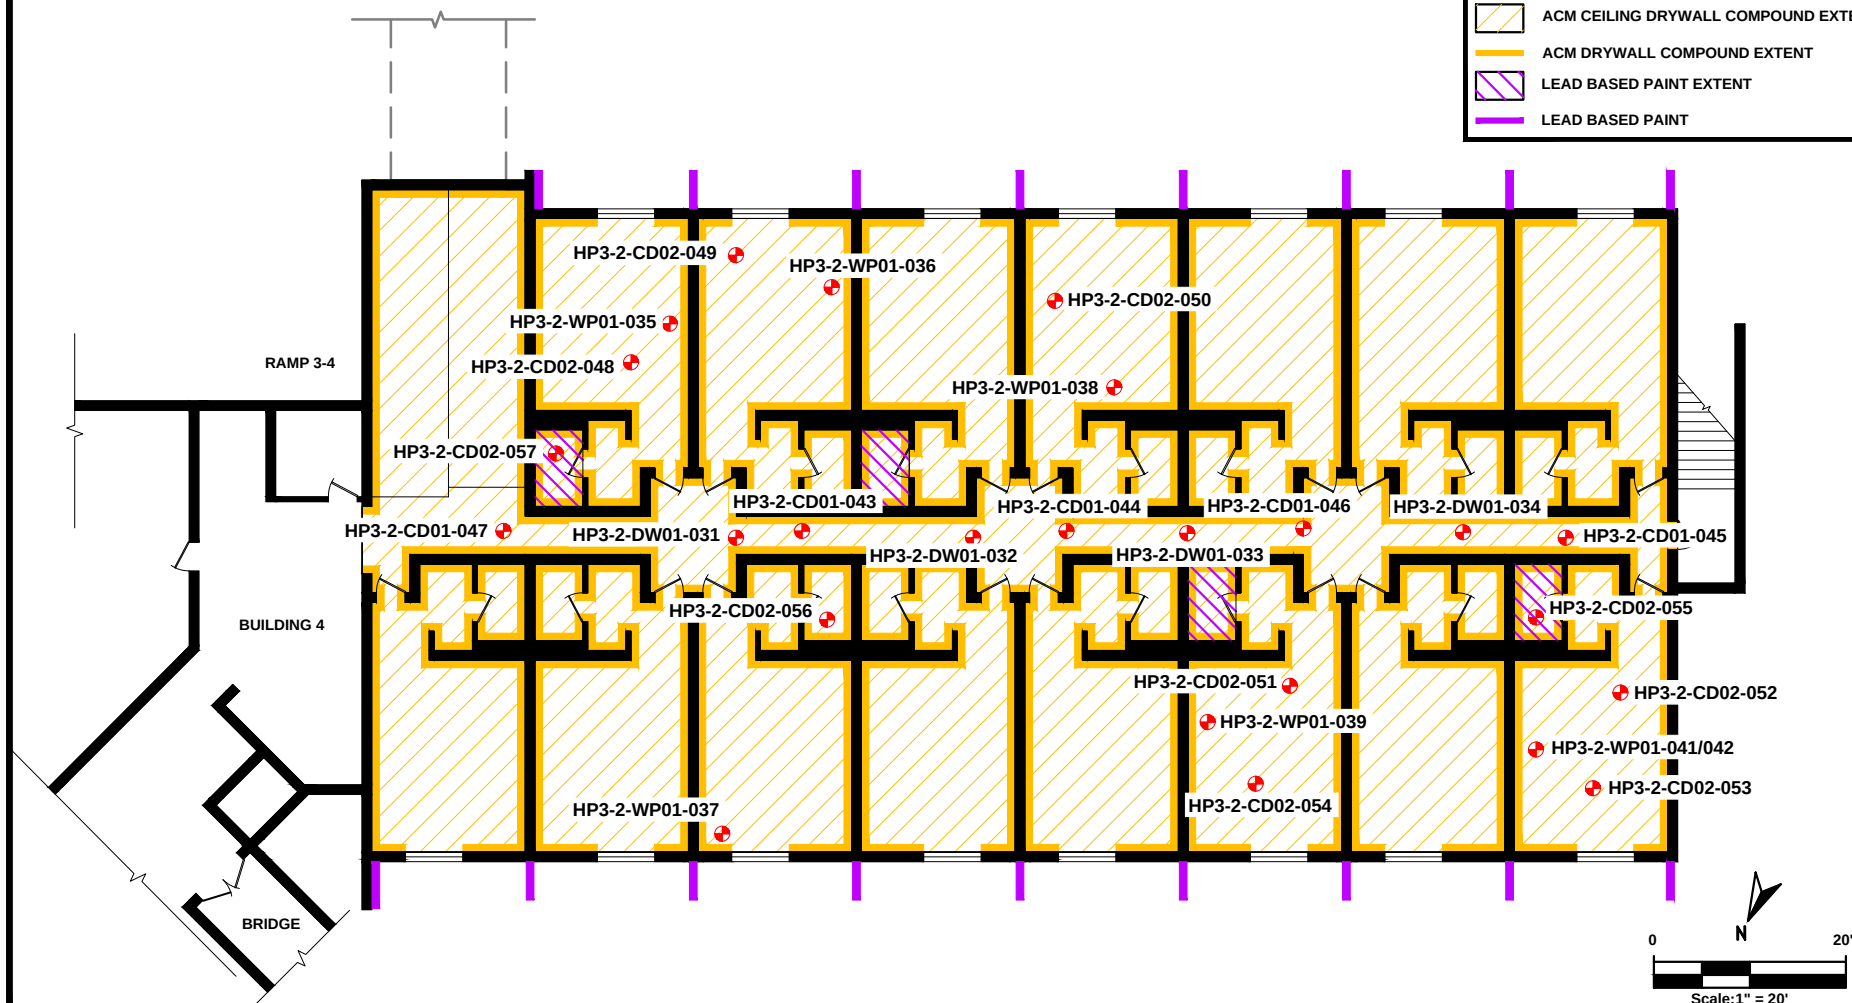

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215

LEAD BASED PAINT AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 3 - SECOND FLOOR HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY

DATE:
2/21/18



SCALE:
1"= 20'

Figure

8

LEGEND:

ACM	ASBESTOS CONTAINING MATERIAL
LBP	LEAD BASED PAINT
	ACM SAMPLE LOCATION (APPROXIMATE)
	ACM CEILING DRYWALL COMPOUND EXTENT
	ACM DRYWALL COMPOUND EXTENT
	LEAD BASED PAINT EXTENT

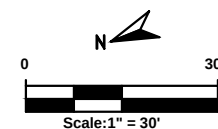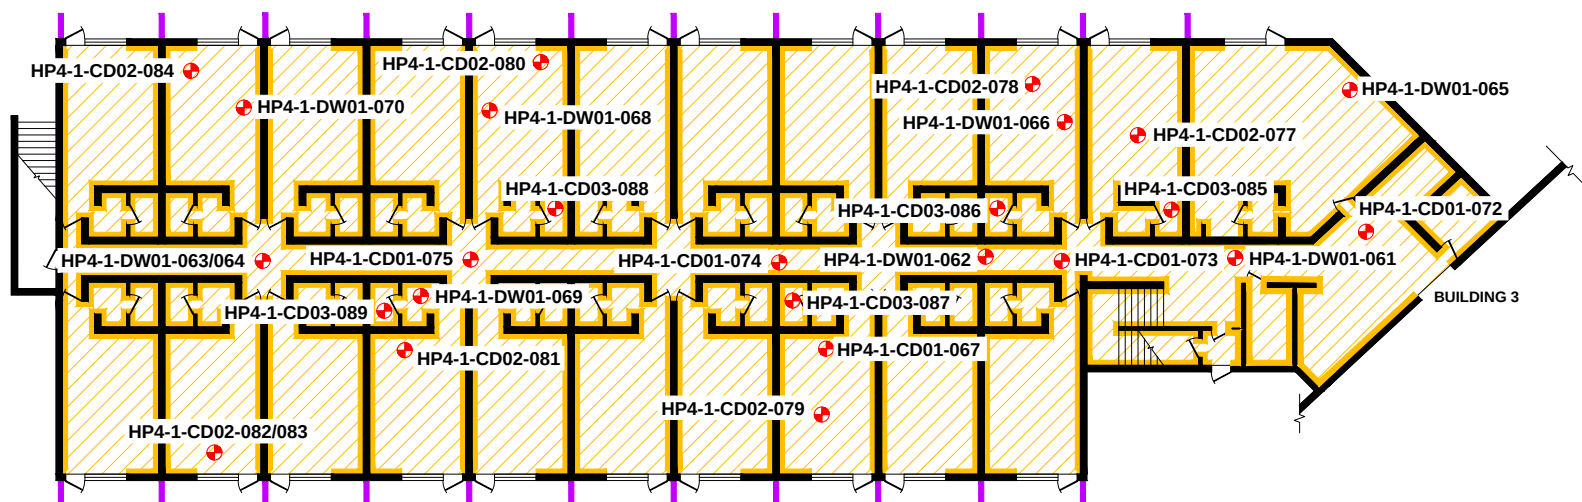

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003




Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215

LEAD BASED PAINT AND ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 4 - MAIN FLOOR HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY

DATE:
2/21/18

SCALE:
1" = 30'

Figure
9

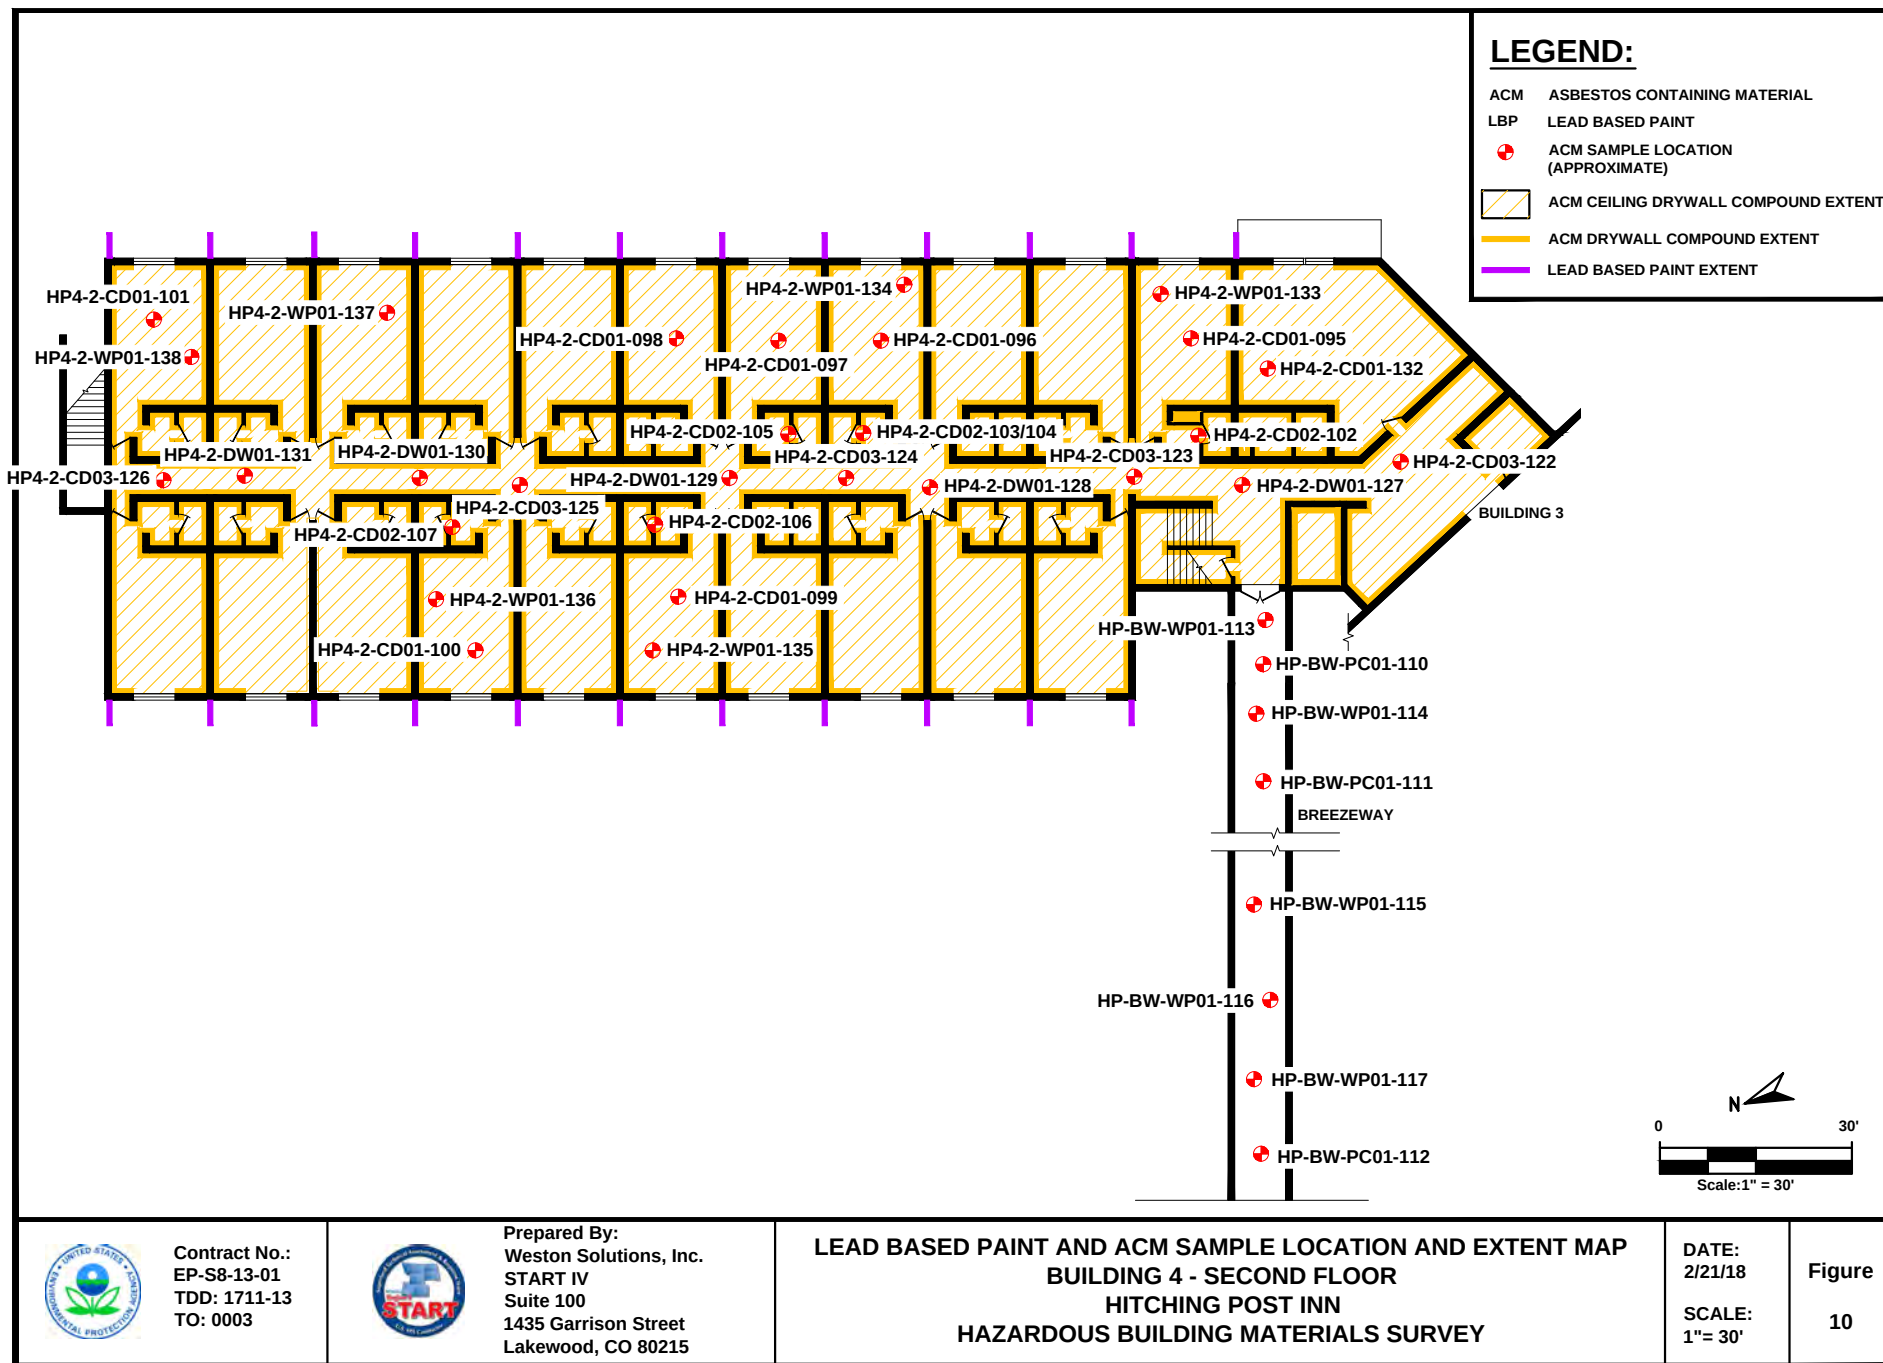

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003





Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215

**LEAD BASED PAINT AND ACM SAMPLE LOCATION AND EXTENT MAP
BUILDING 4 - SECOND FLOOR
HITCHING POST INN
HAZARDOUS BUILDING MATERIALS SURVEY**

DATE:
2/21/18
SCALE:
1" = 30'

LEGEND:

- ACM ASBESTOS CONTAINING MATERIAL
- ACM SAMPLE LOCATION (APPROXIMATE)
- ACM POPCORN CEILING EXTENT
- ACM DRYWALL CEILING EXTENT
- ACM DRYWALL COMPOUND EXTENT

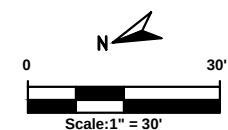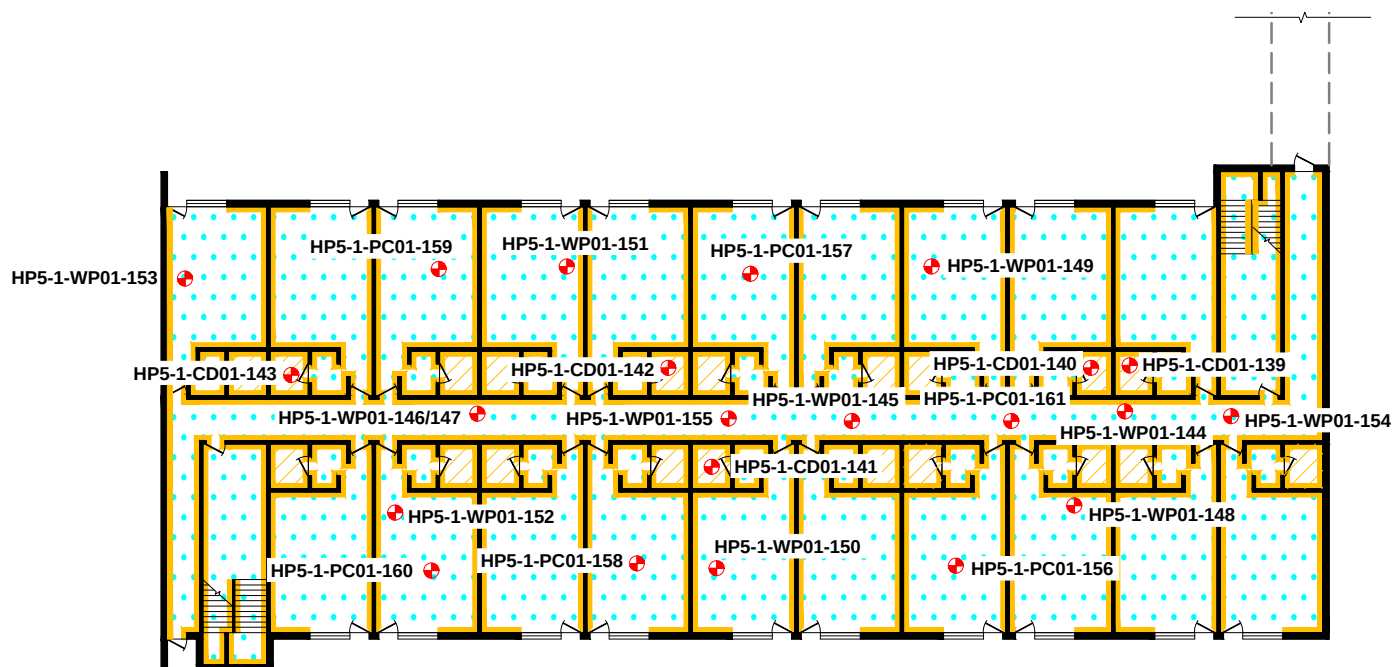

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215


ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 5 - MAIN FLOOR HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY

DATE:
2/21/18
SCALE:
1" = 30'

Figure
11

LEGEND:

- ACM ASBESTOS CONTAINING MATERIAL
- ACM SAMPLE LOCATION (APPROXIMATE)
- ACM POPCORN CEILING EXTENT
- ACM DRYWALL CEILING EXTENT
- ACM DRYWALL COMPOUND EXTENT

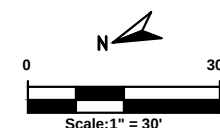

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215


ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 5 - SECOND FLOOR HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY

DATE:
2/21/18
SCALE:
1" = 30'

Figure
12

LEGEND:

- ACM ASBESTOS CONTAINING MATERIAL
- ACM SAMPLE LOCATION (APPROXIMATE)
- ACM LINOLEUM EXTENT
- ACM FLOOR TILES EXTENT
- ACM POPCORN CEILING EXTENT
- ACM DRYWALL CEILING EXTENT
- ACM DRYWALL COMPOUND EXTENT

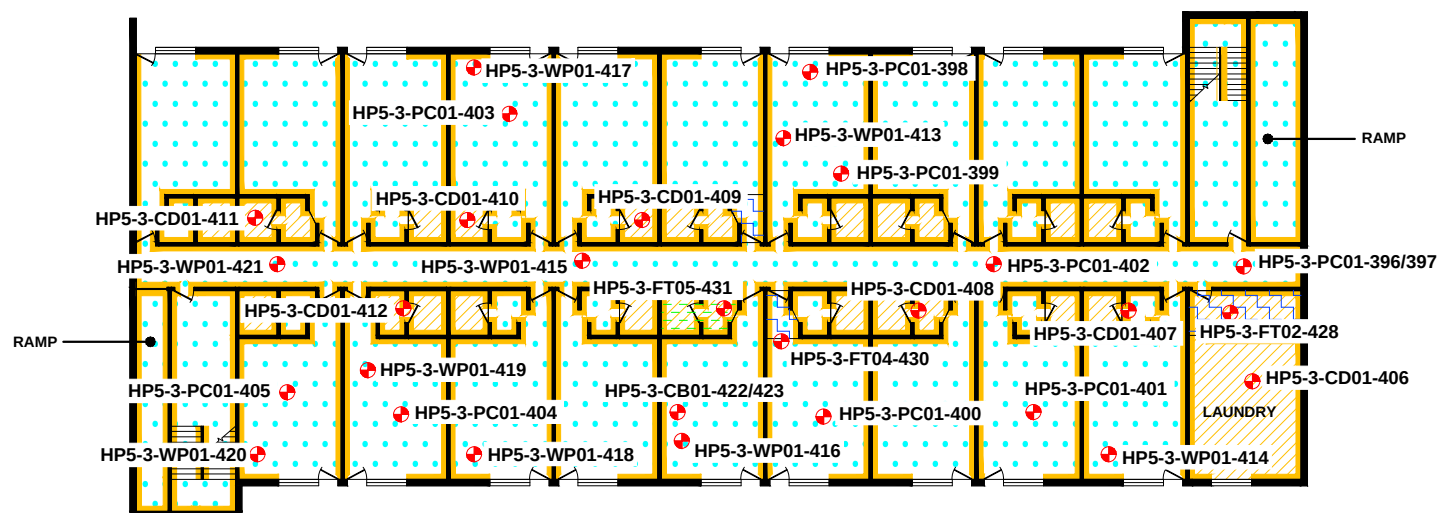

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215



ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 5 - THIRD FLOOR HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY

DATE:
2/21/18
SCALE:
1" = 30'

Figure
13

LEGEND:

ACM ASBESTOS CONTAINING MATERIAL
 ACM ROOFING MATERIAL EXTENT

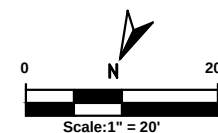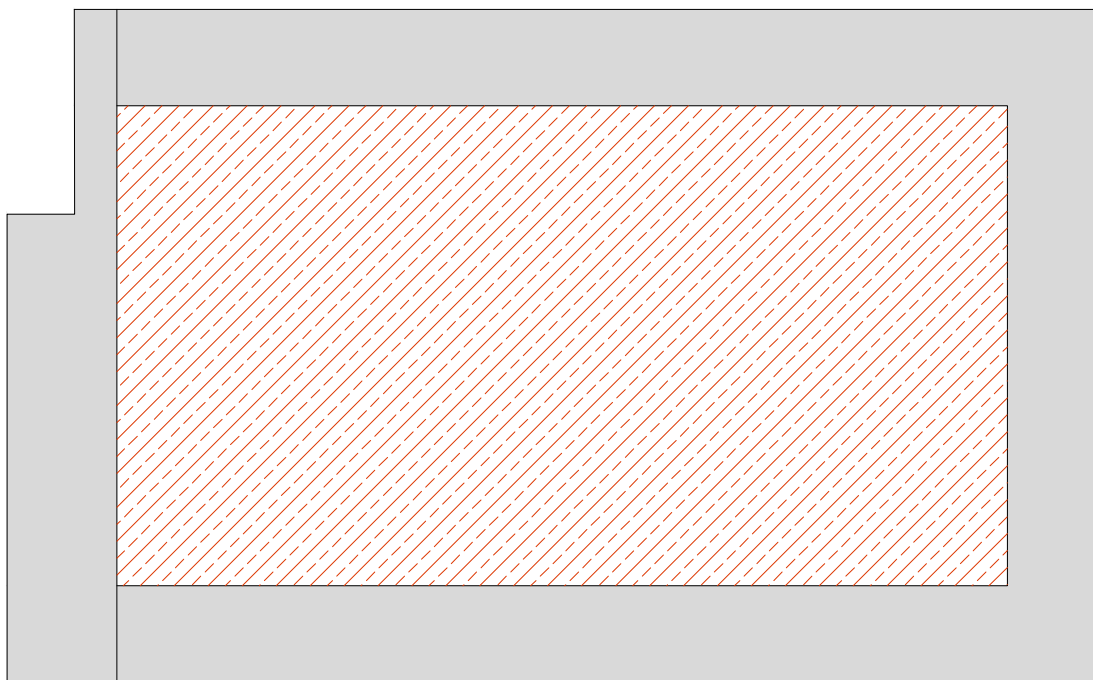

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215

ACM LOCATION AND EXTENT MAP BUILDING 1 - ROOF HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY



DATE:
2/21/18

SCALE:
1" = 20'

Figure
14

LEGEND:

ACM ASBESTOS CONTAINING MATERIAL
 ACM ROOFING MATERIAL EXTENT

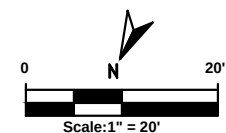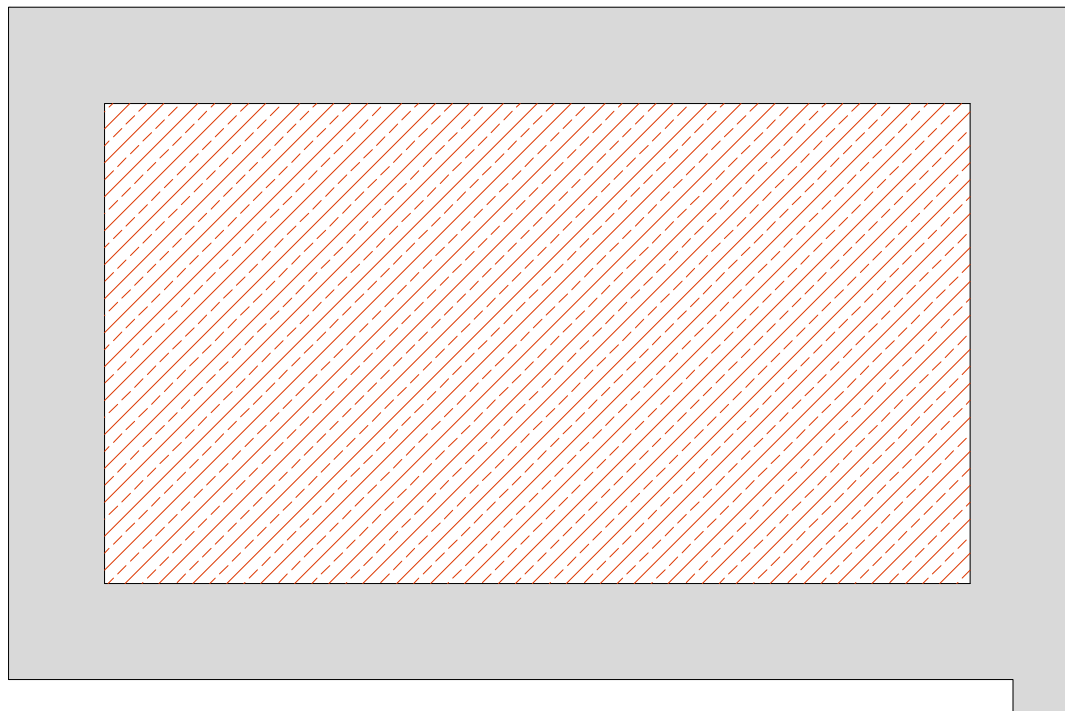

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215

ACM LOCATION AND EXTENT MAP BUILDING 2 - ROOF HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY

DATE:
2/21/18



SCALE:
1" = 20'

Figure

15

LEGEND:

- ACM ASBESTOS CONTAINING MATERIAL
-  ACM ROOFING MATERIAL EXTENT

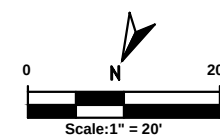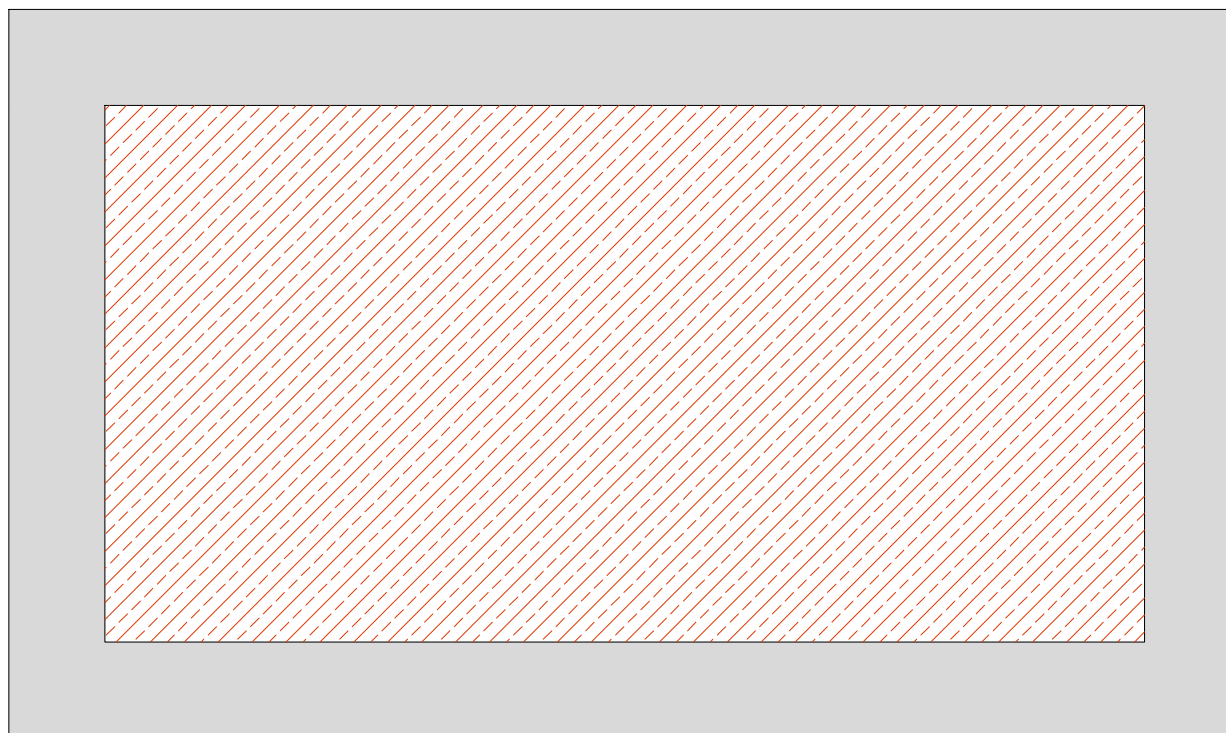

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215

ACM LOCATION AND EXTENT MAP BUILDING 3 - ROOF HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY



DATE:
2/21/18

SCALE:
1" = 20'

Figure
16

LEGEND:

- ACM ASBESTOS CONTAINING MATERIAL
- ACM SAMPLE LOCATION (APPROXIMATE)
- ACM ROOFING MATERIAL EXTENT

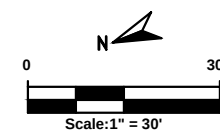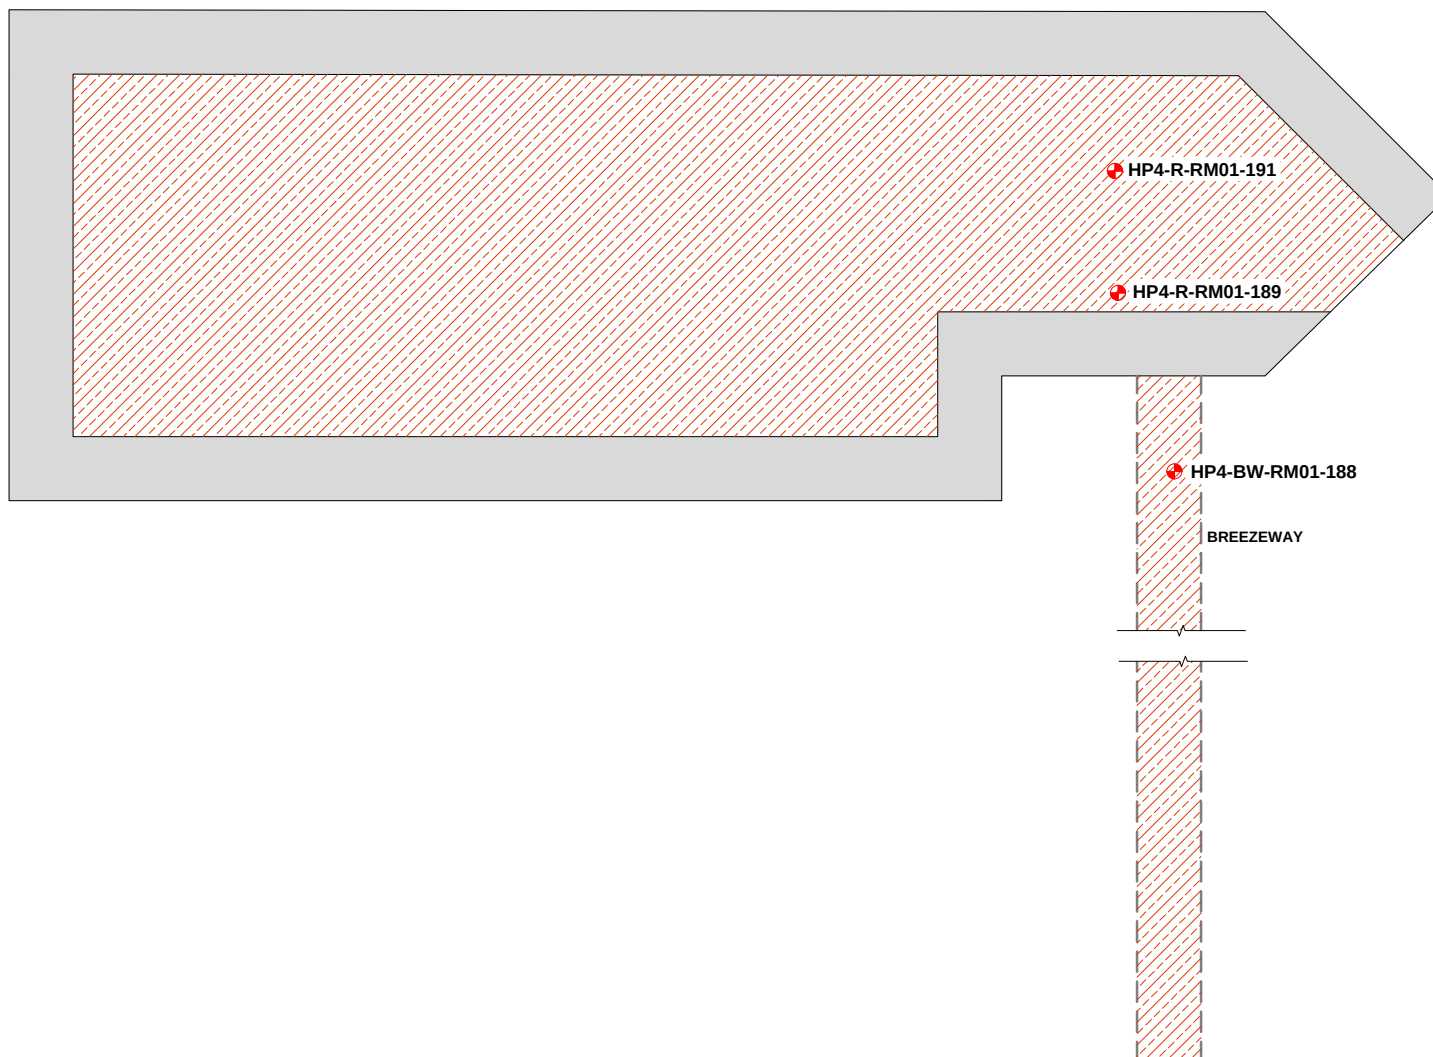

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215

ACM SAMPLE LOCATION AND EXTENT MAP BUILDING 4 - ROOF HITCHING POST INN HAZARDOUS BUILDING MATERIALS SURVEY



DATE:
2/21/18

SCALE:
1" = 30'

Figure
17

LEGEND:

- ACM ASBESTOS CONTAINING MATERIAL
-  ACM ROOFING MATERIAL EXTENT

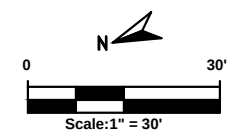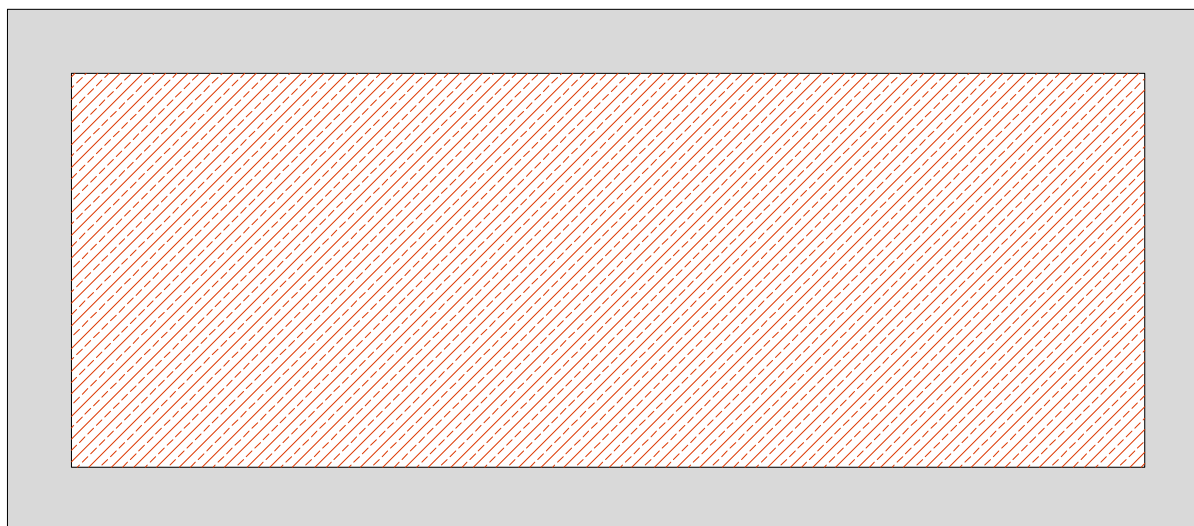

Contract No.:
EP-S8-13-01
TDD: 1711-13
TO: 0003



Prepared By:
Weston Solutions, Inc.
START IV
Suite 100
1435 Garrison Street
Lakewood, CO 80215

**ACM LOCATION AND EXTENT MAP
BUILDING 5 - ROOF
HITCHING POST INN
HAZARDOUS BUILDING MATERIALS SURVEY**

DATE:
2/21/18

SCALE:
1" = 30'

Figure

18

TABLES

Table 1
ACM Sample Results and Estimated Volumes

Sample ID	Physical Description	ACM Layer	Asbestos Type and Percent Composition (by PLM Method)	Point Count Method Result	Estimated Volume
Building 1 - 1st Floor					
HP1-1-CD01-301	Ceiling Drywall	B - Off white compound	Chrysotile 2%	--	700 sq. ft.
HP1-1-CD01-302	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--	
HP1-1-CD01-303	Ceiling Drywall	A - Off white compound	Chrysotile 4%	--	
HP1-1-WP01-304	Wallpapered Drywall	C - Off white compound E - White/tan drywall	Chrysotile 3% Tremolite/Actinolite Trace	--	14,600 sq. ft.
HP1-1-WP01-305	Wallpapered Drywall	A - White paint w/ white compound C - White/tan drywall	Chrysotile Trace Tremolite/Actinolite Trace	--	
HP1-1-WP01-307	Wallpapered Drywall	A - Off white compound	Chrysotile 3%	--	
HP1-1-WP01-308	Wallpapered Drywall	B - Off white joint compound	Chrysotile 3%	--	
HP1-1-WP01-309	Wallpapered Drywall	A - Off white compound	Chrysotile 3%	--	
HP1-1-WP01-310	Wallpapered Drywall	A - Off white joint compound	Chrysotile 2%	--	
HP1-1-WP01-311	Wallpapered Drywall	B - Off white compound	Chrysotile 4%	--	
HP1-1-WP01-312	Wallpapered Drywall	B - Off white compound	Chrysotile 3%	--	
HP1-1-WP01-312	Wallpapered Drywall	B - Off white joint compound	Chrysotile 3%	--	
HP1-1-WP01-312	Wallpapered Drywall	C - Off white compound	Chrysotile 2%	--	
HP1-1-CD02-313	Ceiling Drywall	A - Off white joint compound C - Off white compound	Chrysotile 2% Chrysotile 2%	--	5,250 sq. ft.
HP1-1-CD02-314	Ceiling Drywall	A - Off white joint compound B - Off white compound	Chrysotile 3% Chrysotile 3%	--	
HP1-1-CD02-315	Ceiling Drywall	C - Off white joint compound D - Tan compound	Chrysotile 2% Chrysotile 3%	--	
HP1-1-CD02-316	Ceiling Drywall	A - Off white joint compound C - Off white compound	Chrysotile 3% Chrysotile 2%	--	
HP1-1-CD02-317	Ceiling Drywall	A - Off white joint compound B - Off white compound	Chrysotile 2% Chrysotile 2%	--	
HP1-1-CD02-318	Ceiling Drywall	A - Off white compound	Chrysotile 4%	--	
HP1-1-CD02-319	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--	
HP1-1-CD02-320	Ceiling Drywall	A - Off white joint compound C - Off white compound	Chrysotile 2% Chrysotile 3%	--	
HP1-1-CD02-321	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--	
HP1-1-CD02-322	Ceiling Drywall	B - Off white compound	Chrysotile 2%	--	
Building 1 - 2nd Floor					
HP1-2-CD01-323	Ceiling Drywall	A - Off white compound	Chrysotile 2%	--	750 sq. ft.
HP1-2-CD01-324	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--	
HP1-2-CD01-325	Ceiling Drywall	A - Off white compound	Chrysotile 3%	--	
HP1-2-CD01-326	Ceiling Drywall	B - Off white joint compound D - Off white compound	Chrysotile 2% Chrysotile 3%	--	
HP1-2-CD01-327	Ceiling Drywall	B - Off white compound	Chrysotile 2%	--	
HP1-2-CD01-328	Ceiling Drywall	B - Off white compound	Chrysotile 2%	--	
HP1-2-CD01-329	Ceiling Drywall	A - Off white compound	Chrysotile 2%	--	
HP1-2-CD01-330	Ceiling Drywall	B - Tan compound	Chrysotile 3%	--	
HP1-2-CD01-331	Ceiling Drywall	B - Off white compound	Chrysotile 4%	--	
HP1-2-CD01-332	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--	
HP1-2-WP01-333	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	14,900 sq. ft.
HP1-2-WP01-334	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	
HP1-2-WP01-335	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	
HP1-2-WP01-336	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	
HP1-2-WP01-337	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	
HP1-2-WP01-338	Wallpapered Drywall	B - Off white compound	Chrysotile 3%	--	
HP1-2-WP01-339	Wallpapered Drywall	B - Off white compound w/ white paint	Chrysotile 3%	--	
HP1-2-WP01-340	Wallpapered Drywall	A - White joint compound B - White joint compound E - White compound	Chrysotile 2% Chrysotile 2% Chrysotile 2%	--	
HP1-2-WP01-341	Wallpapered Drywall	A - Off white compound w/ white paint	Chrysotile 3%	--	
HP1-2-CD02-342	Ceiling Drywall	B - White compound	Chrysotile 3%	--	5,300 sq. ft.
HP1-2-CD02-343	Ceiling Drywall	B - White compound D - White joint compound E - White compound	Chrysotile 4% Chrysotile 3% Chrysotile 3%	--	
HP1-2-CD02-344	Ceiling Drywall	B - White compound	Chrysotile 4%	--	
HP1-2-CD02-344	Ceiling Drywall	C - White compound	Chrysotile 3%	--	
Building 2 - 1st Floor					
HP2-1-CD01-374	Ceiling Drywall	B - White compound w/ white/yellow paint C - White joint compound	Chrysotile 2% Chrysotile 3%	--	4,300 sq. ft.
HP2-1-CD01-375	Ceiling Drywall	B - White compound w/ white/yellow paint C - White joint compound	Chrysotile 2% Chrysotile 3%	--	
HP2-1-CD01-377	Ceiling Drywall	B - White joint compound C - White compound w/ white/yellow paint	Chrysotile 4% Chrysotile 3%	--	
HP2-1-CD01-378	Ceiling Drywall	A - White compound w/ white/yellow paint	Chrysotile 3%	--	
HP2-1-CD01-379	Ceiling Drywall	B - White compound w/ white/yellow paint C - White joint compound	Chrysotile 3% Chrysotile 4%	--	
HP2-1-CD01-380	Ceiling Drywall	B - White compound w/ white/yellow paint C - White joint compound	Chrysotile 2% Chrysotile 3%	--	
HP2-1-CD01-381	Ceiling Drywall	B - White compound w/ white/yellow paint C - White joint compound	Chrysotile 3% Chrysotile 4%	--	
HP2-1-CD01-382	Ceiling Drywall	A - White compound w/ white/yellow paint B - Off white compound w/ white paint	Chrysotile 3% Chrysotile 3%	--	
HP2-1-CD01-383	Ceiling Drywall	B - White compound w/ white/yellow paint C - White joint compound	Chrysotile 3% Chrysotile 4%	--	

Table 1
ACM Sample Results and Estimated Volumes

Sample ID	Physical Description	ACM Layer	Asbestos Type and Percent Composition (by PLM Method)	Point Count Method Result	Estimated Volume	
HP2-1-CD02-384	Ceiling Drywall	B - Off white compound w/ white/yellow paint	Chrysotile 3%	--	580 sq. ft.	
		C - Off white joint compound	Chrysotile 4%	--		
HP2-1-CD02-385	Ceiling Drywall	C - Off white joint compound	Chrysotile 4%	--		
		D - White/off white compound w/ white paint	Chrysotile 3%	--		
HP2-1-CD02-386	Ceiling Drywall	A - White compound w/ white/yellow paint	Chrysotile 2%	--	12,800 sq. ft.	
		C - White compound w/ yellow paint	Chrysotile 3%	--		
		D - White joint compound	Chrysotile 4%	--		
HP2-1-WP01-387	Wallpapered Drywall	B - Off white compound w/ yellow paint	Chrysotile 2%	--		
HP2-1-WP01-389	Wallpapered Drywall	A - Yellow/white paint w/ off white compound	Chrysotile Trace	--		
HP2-1-WP01-390	Wallpapered Drywall	C - Off white compound w/ yellow paint	Chrysotile 3%	--		
HP2-1-WP01-391	Wallpapered Drywall	B - Off white compound w/ off white paint	Chrysotile 3%	--		
HP2-1-WP01-393	Wallpapered Drywall	B - Yellow/white paint w/ off white compound	Chrysotile Trace	--		
HP2-1-WP01-394	Wallpapered Drywall	B - Tan/yellow paint w/ off white compound	Chrysotile 2%	--		
HP2-1-WP01-395	Wallpapered Drywall	A - Yellow adhesive	Chrysotile Trace	--		
		C - Off white/yellow paint w/ off white compound	Chrysotile Trace	--		
Building 2 - 2nd Floor						
HP2-2-WP01-348	Wallpapered Drywall	B - White compound	Chrysotile 2%	--	12,800 sq. ft.	
HP2-2-WP01-349	Wallpapered Drywall	C - Off white compound	Chrysotile 3%	--		
HP2-2-WP01-350	Wallpapered Drywall	B - Off white joint compound	Chrysotile 2%	--		
		C - Off white compound	Chrysotile 3%	--		
HP2-2-WP01-351	Wallpapered Drywall	B - Off white compound	Chrysotile 2%	--		
		C - Off white joint compound	Chrysotile 2%	--		
HP2-2-WP01-352	Wallpapered Drywall	A - Off white compound	Chrysotile 3%	--		
HP2-2-WP01-354	Wallpapered Drywall	A - Off white compound	Chrysotile 6%	--		
HP2-2-WP01-355	Wallpapered Drywall	A - Off white compound	Chrysotile 4%	--	4,300 sq. ft.	
HP2-2-WP01-357	Wallpapered Drywall	A - Off white joint compound	Chrysotile 2%	--		
		B - Off white compound	Chrysotile 2%	--		
HP2-2-CD01-358	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--		
		C - Off white joint compound	Chrysotile 4%	--		
HP2-2-CD01-359	Ceiling Drywall	B - Off white compound	Chrysotile 2%	--		
		C - Off white joint compound	Chrysotile 2%	--		
HP2-2-CD01-360	Ceiling Drywall	A - Off white compound	Chrysotile 4%	--		
		B - Off white joint compound	Chrysotile 3%	--		
HP2-2-CD01-361	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--		
		C - Off white joint compound	Chrysotile 3%	--		
HP2-2-CD01-362	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--		
		C - Off white joint compound	Chrysotile 2%	--		
HP2-2-CD01-363	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--		
		C - Off white joint compound	Chrysotile 2%	--		
HP2-2-CD01-364	Ceiling Drywall	A - Off white joint compound	Chrysotile 4%	--	800 sq. ft.	
		B - Off white compound	Chrysotile 3%	--		
HP2-2-CD01-365	Ceiling Drywall	A - Off white compound	Chrysotile 3%	--		
		D - Off white joint compound	Chrysotile 4%	--		
HP2-2-CD01-366	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--	100 sq. ft.	
		C - Off white joint compound	Chrysotile 3%	--		
Building 3 - 1st Floor						
HP3-1-DW01-001	Drywall	C - Off white compound	Chrysotile 4%	--	2,650 sq. ft.	
HP3-1-DW01-002	Drywall	C - Off white compound	Chrysotile 3%	--		
HP3-1-DW01-003	Drywall	C - Off white compound	Chrysotile 4%	--		
HP3-1-DW01-004	Drywall	C - Off white compound	Chrysotile 3%	--		
		E - Off white joint compound	Chrysotile 4%	--	14,000 sq. ft.	
HP3-1-DW01-005	Drywall	B - Off white compound	Chrysotile 3%	--		
		C - Off white joint compound	Chrysotile 3%	--		
HP3-1-DW02-010	Drywall	B - Off white compound	Chrysotile 2%	--		
HP3-1-DW02-013	Drywall	C - Off white joint compound	Chrysotile 3%	--	14,000 sq. ft.	
		D - Off white compound	Chrysotile 4%	--		
HP3-1-DW02-014	Drywall	C - Off white compound	Chrysotile 4%	--		
		D - Off white joint compound	Chrysotile 2%	--		
HP3-1-CD01-015	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--	800 sq. ft.	
HP3-1-CD01-016	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--		
HP3-1-CD01-017	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--		
HP3-1-DW03-021	Drywall	A - Off white compound	Chrysotile 3%	1.00	100 sq. ft.	
HP3-1-CD02-027	Ceiling Drywall	B - Off white joint compound	Chrysotile 2%	--	7,200 sq. ft.	
		C - Off white compound	Chrysotile 4%	--		
HP3-1-CD02-028	Ceiling Drywall	A - Off white compound	Chrysotile 3%	--		
HP3-1-CD02-029	Ceiling Drywall	D - Off white joint compound	Chrysotile 3%	--		
		E - Off white compound	Chrysotile 3%	--	2,650 sq. ft.	
Building 3 - 2nd Floor						
HP3-2-DW01-031	Drywall	B - Off white compound	Chrysotile 4%	--		
HP3-2-DW01-032	Drywall	C - Off white joint compound	Chrysotile 3%	--		
		E - Off white compound	Chrysotile 4%	--		
HP3-2-DW01-033	Drywall	C - Off white joint compound	Chrysotile 2%	--		
		E - Off white compound	Chrysotile 4%	--		
HP3-2-DW01-034	Drywall	C - Off white compound	Chrysotile 3%	--		
HP3-2-WP01-035	Wallpapered Drywall	B - Off white joint compound	Chrysotile 2%	--		
		D - Off white compound	Chrysotile 3%	--		
HP3-2-WP01-036	Wallpapered Drywall	B - Off white compound	Chrysotile 3%	--		
HP3-2-WP01-037	Wallpapered Drywall	B - Off white joint compound	Chrysotile 2%	--		
		D - Off white compound	Chrysotile 3%	--		
HP3-2-WP01-038	Wallpapered Drywall	B - Off white compound	Chrysotile 3%	--	14,600 sq. ft.	
HP3-2-WP01-039	Wallpapered Drywall	B - Off white compound	Chrysotile 3%	--		
		B - Off white joint compound	Chrysotile 2%	--		
HP3-2-WP01-041	Wallpapered Drywall	C - Off white compound	Chrysotile 4%	--		
		B - Off white joint compound	Chrysotile 2%	--		
HP3-2-WP01-042	Wallpapered Drywall	C - Off white compound	Chrysotile 4%	--		

Table 1
ACM Sample Results and Estimated Volumes

Sample ID	Physical Description	ACM Layer	Asbestos Type and Percent Composition (by PLM Method)	Point Count Method Result	Estimated Volume	
HP3-2-CD01-043	Ceiling Drywall	B - Off white compound	Chrysotile 2%	--	800 sq. ft.	
HP3-2-CD01-044	Ceiling Drywall	A - Off white compound	Chrysotile 2%	--		
HP3-2-CD01-045	Ceiling Drywall	B - Off white compound	Chrysotile 4%	--		
HP3-2-CD01-046	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--		
HP3-2-CD01-047	Ceiling Drywall	A - White compound w/ white paint	Chrysotile 3%	--		
HP3-2-CD02-048	Ceiling Drywall	C - Off white joint compound	Chrysotile 4%	--	6,500 sq. ft.	
		D - Off white compound w/ cream paint	Chrysotile 3%	--		
HP3-2-CD02-049	Ceiling Drywall	C - White joint compound	Chrysotile 4%	--		
		D - Off white compound w/ off white paint	Chrysotile 5%	--		
HP3-2-CD02-050	Ceiling Drywall	B - White joint compound	Chrysotile 4%	--		
		C - White compound w/ white paint	Chrysotile 3%	--		
HP3-2-CD02-051	Ceiling Drywall	A - White compound w/ white paint	Chrysotile 3%	--		
		C - White joint compound	Chrysotile 3%	--		
HP3-2-CD02-052	Ceiling Drywall	B - White joint compound	Chrysotile 4%	--		
		C - White compound w/ white paint	Chrysotile 4%	--		
HP3-2-CD02-053	Ceiling Drywall	B - White joint compound	Chrysotile 4%	--		
		C - White compound w/ white paint	Chrysotile 3%	--		
HP3-2-CD02-054	Ceiling Drywall	A - White paint w/ white compound	Chrysotile Trace	--		
HP3-2-CD03-055	Ceiling Drywall	B - White joint compound	Chrysotile 4%	--	750 sq. ft.	
		C - White compound w/ white paint	Chrysotile 4%	--		
HP3-2-CD03-056	Ceiling Drywall	B - White compound w/ white paint	Chrysotile 3%	--		
		C - White joint compound	Chrysotile 3%	--		
HP3-2-CD03-057	Ceiling Drywall	B - White joint compound	Chrysotile 3%	--		
		C - White compound w/ white paint	Chrysotile 2%	--		
Building 4 - 1st Floor						
HP4-1-DW01-061	Drywall	B - Tan paint w/ white compound	Chrysotile 2%	--	24,900 sq. ft.	
		C - White compound	Chrysotile 4%	--		
HP4-1-DW01-062	Drywall	A - White paint w/ white compound	Chrysotile Trace	--		
		C - White compound	Chrysotile 3%	--		
HP4-1-DW01-063	Drywall	A - White paint w/ white compound	Chrysotile Trace	--		
		C - White compound	Chrysotile 3%	--		
HP4-1-DW01-064	Drywall	A - Tan paint w/ white compound	Chrysotile 2%	--		
		C - White compound	Chrysotile 3%	--		
HP4-1-DW01-065	Drywall	C - White compound w/ white paint	Chrysotile 2%	--		
		D - White joint compound	Chrysotile 3%	--		
HP4-1-DW01-066	Drywall	C - White compound w/ pink paint	Chrysotile 3%	--		
		D - Pink joint compound	Chrysotile 2%	--		
HP4-1-DW01-068	Drywall	B - Tan paint w/ white compound	Chrysotile 2%	--		
		E - White compound	Chrysotile 3%	--		
HP4-1-DW01-069	Drywall	B - White compound	Chrysotile 3%	--		
		C - White compound w/ white paint	Chrysotile 3%	--		
HP4-1-DW01-070	Drywall	D - White joint compound	Chrysotile 3%	--		
		D - White compound w/ cream paint	Chrysotile 2%	--		
HP4-1-CD01-072	Ceiling Drywall	E - White/off white joint compound	Chrysotile 3%	--	1,500 sq. ft.	
HP4-1-CD01-073	Ceiling Drywall	E - White compound w/ white paint	Chrysotile 2%	--		
HP4-1-CD01-074	Ceiling Drywall	A - White paint w/ white compound	Chrysotile 2%	--		
HP4-1-CD01-075	Ceiling Drywall	B - White paint w/ white compound	Chrysotile Trace	--		
HP4-1-CD02-077	Ceiling Drywall	B - White compound w/ white paint	Chrysotile 2%	--		
HP4-1-CD02-078	Ceiling Drywall	B - White compound w/ white paint	Chrysotile 2%	--	9,350 sq. ft.	
		C - Pink joint compound	Chrysotile 2%	--		
		D - White joint compound	Chrysotile 3%	--		
		C - Pink joint compound	Chrysotile 2%	--		
HP4-1-CD02-079	Ceiling Drywall	D - White joint compound	Chrysotile 3%	--		
		E - White compound w/ white paint	Chrysotile Trace	--		
		C - White compound w/ white paint	Chrysotile Trace	--		
HP4-1-CD02-080	Ceiling Drywall	D - White joint compound	Chrysotile 3%	--		
		E - Pink joint compound	Chrysotile 2%	--		
		B - White compound w/ white paint	Chrysotile 2%	--		
HP4-1-CD02-081	Ceiling Drywall	A - White joint compound	Chrysotile 2%	--		1,100 sq. ft.
HP4-1-CD02-082	Ceiling Drywall	B - Off white joint compound	Chrysotile 2%	--		
HP4-1-CD02-083	Ceiling Drywall	A - White joint compound	Chrysotile 2%	--		
		B - Pink joint compound	Chrysotile 2%	--		
		E - White compound w/ white paint	Chrysotile Trace	--		
HP4-1-CD02-084	Ceiling Drywall	C - White joint compound	Chrysotile 3%	--		
		D - Pink joint compound	Chrysotile 2%	--		
		E - White compound w/ white paint	Chrysotile Trace	--		
HP4-1-CD03-085	Ceiling Drywall	A - White paint w/ white compound	Chrysotile 2%	--		
		C - White joint compound	Chrysotile 4%	--		
HP4-1-CD03-086	Ceiling Drywall	B - White compound w/ white paint	Chrysotile 2%	--		
		C - Pink joint compound	Chrysotile 2%	--		
HP4-1-CD03-087	Ceiling Drywall	A - White compound w/ white paint	Chrysotile Trace	--		
		C - White joint compound	Chrysotile 3%	--		
		D - Pink compound	Chrysotile 2%	--		
		E - Pink joint compound	Chrysotile 2%	--		
HP4-1-CD03-088	Ceiling Drywall	A - White compound w/ white paint	Chrysotile Trace	--		
		C - Pink joint compound	Chrysotile 2%	--		
HP4-1-CD03-089	Ceiling Drywall	B - Pink compound	Chrysotile 2%	--		
		C - White compound w/ white paint	Chrysotile Trace	--		
		D - White joint compound	Chrysotile 3%	--		

Table 1
ACM Sample Results and Estimated Volumes

Sample ID	Physical Description	ACM Layer	Asbestos Type and Percent Composition (by PLM Method)	Point Count Method Result	Estimated Volume
Building 4 - 2nd Floor					
HP4-2-CD01-095	Ceiling Drywall	B - White compound C - White joint compound	Chrysotile 2% Chrysotile 2%	-- --	9,350 sq. ft.
HP4-2-CD01-096	Ceiling Drywall	B - White joint compound D - White compound	Chrysotile 2% Chrysotile 2%	-- --	
HP4-2-CD01-097	Ceiling Drywall	B - Off white compound C - Off white joint compound	Chrysotile 2% Chrysotile 2%	-- --	
HP4-2-CD01-098	Ceiling Drywall	A - Off white compound	Chrysotile 2%	--	
HP4-2-CD01-099	Ceiling Drywall	B - Off white compound	Chrysotile 2%	--	
HP4-2-CD01-100	Ceiling Drywall	B - Pink joint compound C - Off white compound	Chrysotile 2% Chrysotile 2%	-- --	
HP4-2-CD01-101	Ceiling Drywall	B - Off white compound	Chrysotile 2%	--	
HP4-2-CD02-102	Ceiling Drywall	A - Off white compound	Chrysotile 3%	--	
HP4-2-CD02-103	Ceiling Drywall	B - Off white compound	Chrysotile 2%	--	
HP4-2-CD02-104	Ceiling Drywall	A - Off white compound	Chrysotile 2%	--	
HP4-2-CD02-105	Ceiling Drywall	A - Off white compound C - Pink compound D - Pink joint compound	Chrysotile 2% Chrysotile 2% Chrysotile 2%	-- -- --	1,100 sq. ft.
HP4-2-CD02-106	Ceiling Drywall	B - Off white compound	Chrysotile 2%	--	
HP4-2-CD02-107	Ceiling Drywall	A - Off white compound	Chrysotile 2%	--	
HP4-2-CD03-122	Ceiling Drywall	A - Off white compound	Chrysotile 2%	--	
HP4-2-CD03-123	Ceiling Drywall	A - Off white compound	Chrysotile 2%	--	1,500 sq. ft.
HP4-2-CD03-124	Ceiling Drywall	C - Off white compound	Chrysotile 3%	--	
HP4-2-CD03-125	Ceiling Drywall	A - Off white compound	Chrysotile 2%	--	
HP4-2-CD03-126	Ceiling Drywall	B - Off white compound C - Off white joint compound	Chrysotile 2% Chrysotile 3%	-- --	
HP4-2-DW01-127	Drywall	A - Off white compound	Chrysotile 2%	--	
HP4-2-DW01-128	Drywall	B - Off white compound	Chrysotile 2%	--	4,500 sq. ft.
HP4-2-DW01-129	Drywall	A - Off white compound	Chrysotile 3%	--	
HP4-2-DW01-130	Drywall	B - Off white compound C - White compound	Chrysotile 2% Chrysotile 2%	-- --	
HP4-2-DW01-131	Drywall	A - Off white compound	Chrysotile 2%	--	
HP4-2-WP01-132	Wallpapered Drywall	A - Off white joint compound C - Off white compound	Chrysotile 2% Chrysotile 2%	-- --	21,000 sq. ft.
HP4-2-WP01-133	Wallpapered Drywall	A - Off white compound B - Off white compound	Chrysotile 2% Chrysotile 2%	-- --	
HP4-2-WP01-134	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	
HP4-2-WP01-135	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	
HP4-2-WP01-136	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	
HP4-2-WP01-137	Wallpapered Drywall	A - Off white compound B - Off white joint compound	Chrysotile 2% Chrysotile 2%	-- --	
HP4-2-WP01-138	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	
Building 4 - Roof					
HP4-R-RM01-189	Roofing Material	A - Black fibrous tar	Chrysotile 15%	--	9,000 sq. ft.
HP4-R-RS01-191	Roofing Sealant	B - Black fibrous tar	Chrysotile 12%	--	25 LF
Breezeway					
HP-BW-PC01-110	Popcorn Ceiling	C - Off white compound D - Off white joint compound E - White micaceous texture	Chrysotile 3% Chrysotile 2% Chrysotile 5%	-- -- --	1,000 sq. ft.
HP-BW-PC01-111	Popcorn Ceiling	C - White micaceous texture D - Off white compound E - Off white joint compound	Chrysotile 6% Chrysotile 2% Chrysotile 2%	-- -- --	
HP-BW-PC01-112	Popcorn Ceiling	C - Off white compound D - Off white joint compound E - White micaceous texture	Chrysotile 2% Chrysotile 2% Chrysotile 5%	-- -- --	
HP-BW-WP01-113	Wallpapered Drywall	B - Off white compound	Chrysotile 2%	--	
HP-BW-WP01-114	Wallpapered Drywall	B - Off white compound C - Off white joint compound	Chrysotile 2% Chrysotile 2%	-- --	
HP-BW-WP01-115	Wallpapered Drywall	B - Off white joint compound D - Off white compound	Chrysotile 2% Chrysotile 2%	-- --	1,600 sq. ft.
HP-BW-WP01-116	Wallpapered Drywall	B - Off white compound C - Off white joint compound	Chrysotile 2% Chrysotile 2%	-- --	
HP-BW-WP01-117	Wallpapered Drywall	B - Off white compound	Chrysotile 2%	--	
HP-BW-RM01-188	Roofing Material	A - Silver resinous material B - Black tar	Chrysotile 2% Chrysotile 8%	-- --	1,000 sq. ft.
Building 5 - 1st Floor					
HP5-1-CD01-139	Ceiling Drywall	A - Off white compound B - White compound w/ white paint	Chrysotile 2% Chrysotile 2%	-- --	840 sq. ft.
HP5-1-CD01-140	Ceiling Drywall	C - White joint compound D - White joint compound	Chrysotile 2% Chrysotile 3%	-- --	
HP5-1-CD01-141	Ceiling Drywall	B - White joint compound C - White joint compound D - White compound w/ white paint	Chrysotile 2% Chrysotile 3% Chrysotile 2%	-- -- --	
HP5-1-CD01-142	Ceiling Drywall	A - White paint w/ white compound D - White joint compound E - White compound w/ white paint	Chrysotile Trace Chrysotile 3% Chrysotile 3%	-- -- --	
HP5-1-CD01-143	Ceiling Drywall	B - White joint compound C - White compound w/ white paint	Chrysotile 4% Chrysotile 2%	-- --	

Table 1
ACM Sample Results and Estimated Volumes

Sample ID	Physical Description	ACM Layer	Asbestos Type and Percent Composition (by PLM Method)	Point Count Method Result	Estimated Volume
HP5-1-WP01-144	Wallpapered Drywall	A - White compound w/ white paint	Chrysotile 3%	--	25,000 sq. ft.
		B - White compound w/ white paint	Chrysotile 2%	--	
HP5-1-WP01-145	Wallpapered Drywall	B - White compound w/ white paint	Chrysotile 2%	--	
HP5-1-WP01-146	Wallpapered Drywall	A - White compound	Chrysotile 4%	--	
HP5-1-WP01-147	Wallpapered Drywall	A - White compound	Chrysotile 4%	--	
HP5-1-WP01-148	Wallpapered Drywall	E - White joint compound	Chrysotile 4%	--	
		C - Pink joint compound	Chrysotile 2%	--	
HP5-1-WP01-149	Wallpapered Drywall	D - White joint compound	Chrysotile 3%	--	
		E - White compound w/ white paint	Chrysotile 2%	--	
HP5-1-WP01-150	Wallpapered Drywall	A - Off white compound	Chrysotile 5%	--	
HP5-1-WP01-151	Wallpapered Drywall	D - White compound w/ white paint	Chrysotile 2%	--	
		E - White joint compound	Chrysotile 3%	--	
HP5-1-WP01-152	Wallpapered Drywall	C - White compound w/ white paint	Chrysotile 2%	--	
		D - White joint compound	Chrysotile 3%	--	
HP5-1-WP01-153	Wallpapered Drywall	B - White compound w/ white paint	Chrysotile 2%	--	10,650 sq. ft.
HP5-1-PC01-154	Popcorn Ceiling	A - White compound	Chrysotile 2%	--	
		B - White perlitic texture w/ white paint	Chrysotile 4%	--	
		C - White compound w/ white paint	Chrysotile 2%	--	
HP5-1-PC01-155	Popcorn Ceiling	A - White joint compound	Chrysotile 2%	--	
		C - White perlitic texture w/ white paint	Chrysotile 4%	--	
HP5-1-PC01-156	Popcorn Ceiling	A - Pink joint compound	Chrysotile 2%	--	
		C - White perlitic texture w/ white paint	Chrysotile 4%	--	
		D - White compound	Chrysotile 2%	--	
		E - White joint compound	Chrysotile 2%	--	
HP5-1-PC01-157	Popcorn Ceiling	A - White perlitic texture w/ white paint	Chrysotile 4%	--	
		C - White joint compound	Chrysotile 3%	--	
		D - White compound	Chrysotile 2%	--	
HP5-1-PC01-158	Popcorn Ceiling	B - White perlitic texture w/ white paint	Chrysotile 4%	--	
		C - White joint compound	Chrysotile 2%	--	
		D - White compound	Chrysotile 2%	--	
HP5-1-PC01-159	Popcorn Ceiling	A - White perlitic texture w/ white paint	Chrysotile 4%	--	
		C - White texture w/ white white paint	Chrysotile 4%	--	
		D - White joint compound	Chrysotile 2%	--	
		E - White compound	Chrysotile 2%	--	
HP5-1-PC01-160	Popcorn Ceiling	B - White perlitic texture w/ white paint	Chrysotile 4%	--	
		C - White texture w/ white paint	Chrysotile 4%	--	
		D - White joint compound	Chrysotile 2%	--	
		E - White compound	Chrysotile 2%	--	
HP5-1-CP01-161	Carpet	A - White perlitic compound	Chrysotile 3%	--	27,000 sq. ft.
HP5-2-WP01-163	Wallpapered Drywall	C - White joint compound	Chrysotile 2%	--	
		D - White compound	Chrysotile 2%	--	
HP5-2-WP01-164	Wallpapered Drywall	A - White joint compound	Chrysotile 2%	--	
		D - White compound	Chrysotile 2%	--	
HP5-2-WP01-165	Wallpapered Drywall	C - White compound w/ white paint	Chrysotile 2%	--	
		D - White joint compound	Chrysotile 3%	--	
HP5-2-WP01-166	Wallpapered Drywall	D - White joint compound	Chrysotile Trace	--	
		E - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-WP01-167	Wallpapered Drywall	C - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-WP01-168	Wallpapered Drywall	C - White paint w/ white compound	Chrysotile 2%	--	
HP5-2-WP01-169	Wallpapered Drywall	A - White compound w/ white paint	Chrysotile 3%	--	
HP5-2-WP01-170	Wallpapered Drywall	B - White compound w/ white paint	Chrysotile 3%	--	
HP5-2-WP01-171	Wallpapered Drywall	A - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-WP01-172	Wallpapered Drywall	B - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-PC01-173	Popcorn Ceiling	A - White perlitic texture w/ white paint	Chrysotile 6%	--	
		C - White compound w/ white paint	Chrysotile 2%	--	
		D - White joint compound	Chrysotile 4%	--	
HP5-2-PC01-174	Popcorn Ceiling	A - White perlitic texture w/ white paint	Chrysotile 6%	--	
		B - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-PC01-175	Popcorn Ceiling	A - White compound w/ white paint	Chrysotile 2%	--	
		C - White perlitic texture w/ white paint	Chrysotile 6%	--	
		D - White joint compound	Chrysotile 4%	--	
HP5-2-PC01-176	Popcorn Ceiling	A - White perlitic texture w/ white paint	Chrysotile 6%	--	
		C - White compound w/ white paint	Chrysotile 3%	--	
		D - White joint compound	Chrysotile 4%	--	
HP5-2-PC01-177	Popcorn Ceiling	A - White perlitic texture w/ white paint	Chrysotile 6%	--	
		B - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-PC01-178	Popcorn Ceiling	A - White perlitic texture	Chrysotile 8%	--	
		C - White joint compound	Chrysotile 4%	--	
		D - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-PC01-179	Popcorn Ceiling	A - White perlitic texture w/ white paint	Chrysotile 6%	--	
		C - White joint compound	Chrysotile 4%	--	
		D - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-CD01-180	Ceiling Drywall	B - White joint compound	Chrysotile 3%	--	850 sq. ft.
		C - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-CD01-181	Ceiling Drywall	B - White joint compound	Chrysotile 3%	--	
		C - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-CD01-182	Ceiling Drywall	B - White joint compound	Chrysotile 3%	--	
		C - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-CD01-183	Ceiling Drywall	B - White joint compound	Chrysotile 3%	--	
		C - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-CD01-184	Ceiling Drywall	B - White joint compound	Chrysotile 3%	--	
		C - White compound w/ white paint	Chrysotile 2%	--	
HP5-2-CD01-185	Ceiling Drywall	B - White joint compound	Chrysotile 3%	--	
		C - White compound w/ white paint	Chrysotile 2%	--	

Table 1
ACM Sample Results and Estimated Volumes

Sample ID	Physical Description	ACM Layer	Asbestos Type and Percent Composition (by PLM Method)	Point Count Method Result	Estimated Volume
Building 5 - 3rd Floor					
HP5-3-PC01-396	Popcorn Ceiling	A - White perlitic texture w/ white paint	Chrysotile 7%	--	10,100 sq. ft.
		B - White compound w/ white paint	Chrysotile 2%	--	
		D - White joint compound	Chrysotile 3%	--	
HP5-3-PC01-397	Popcorn Ceiling	B - White perlitic texture w/ white paint	Chrysotile 6%	--	
		C - White compound w/ white paint	Chrysotile 2%	--	
		D - White joint compound	Chrysotile 3%	--	
HP5-3-PC01-398	Popcorn Ceiling	A - White perlitic texture w/ white paint	Chrysotile 6%	--	
HP5-3-PC01-399	Popcorn Ceiling	A - Off white perlitic texture w/ white paint	Chrysotile 7%	--	
HP5-3-PC01-400	Popcorn Ceiling	A - White perlitic texture w/ white paint	Chrysotile 6%	--	
		B - White compound w/ white paint	Chrysotile 2%	--	
		D - White joint compound	Chrysotile 3%	--	
HP5-3-PC01-401	Popcorn Ceiling	A - White perlitic texture	Chrysotile 8%	--	
		B - White compound w/ white paint	Chrysotile 2%	--	
		A - White perlitic texture	Chrysotile 8%	--	
HP5-3-PC01-402	Popcorn Ceiling	C - White joint compound	Chrysotile 4%	--	
		D - White compound w/ white paint	Chrysotile 2%	--	
		A - White perlitic texture	Chrysotile 8%	--	
HP5-3-PC01-403	Popcorn Ceiling	B - White compound	Chrysotile 3%	--	
		D - White compound w/ white paint	Chrysotile 3%	--	
		B - White perlitic texture w/ white paint	Chrysotile 7%	--	
HP5-3-PC01-404	Popcorn Ceiling	A - White perlitic texture w/ white paint	Chrysotile 7%	--	
HP5-3-PC01-405	Popcorn Ceiling	B - White paint w/ white compound	Chrysotile 2%	--	
		B - Off white compound	Chrysotile 2%	--	
		C - Off white joint compound	Chrysotile 2%	--	
HP5-3-CD01-406	Ceiling Drywall	B - Off white compound	Chrysotile 2%	--	1,520 sq. ft.
HP5-3-CD01-407	Ceiling Drywall	C - Off white joint compound	Chrysotile 2%	--	
		C - Off white joint compound	Chrysotile 2%	--	
HP5-3-CD01-408	Ceiling Drywall	A - Off white joint compound	Chrysotile 2%	--	
		C - Off white joint compound	Chrysotile 2%	--	
HP5-3-CD01-409	Ceiling Drywall	B - Off white compound	Chrysotile 2%	--	
		C - Off white joint compound	Chrysotile 2%	--	
		B - Off white compound	Chrysotile 2%	--	
HP5-3-CD01-410	Ceiling Drywall	C - Off white joint compound	Chrysotile 2%	--	
		B - Off white compound	Chrysotile 2%	--	
		C - Off white joint compound	Chrysotile 2%	--	
HP5-3-CD01-411	Ceiling Drywall	B - Off white compound	Chrysotile 3%	--	
		C - Off white joint compound	Chrysotile 2%	--	
		B - Off white compound	Chrysotile 3%	--	
HP5-3-CD01-412	Ceiling Drywall	C - Off white joint compound	Chrysotile 2%	--	
		A - Off white compound	Chrysotile 2%	--	
HP5-3-WP01-413	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	25,000 sq. ft.
HP5-3-WP01-414	Wallpapered Drywall	B - Off white compound	Chrysotile 2%	--	
HP5-3-WP01-415	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	
HP5-3-WP01-416	Wallpapered Drywall	B - Off white compound	Chrysotile 2%	--	
HP5-3-WP01-417	Wallpapered Drywall	B - Off white joint compound	Chrysotile 2%	--	
		C - Off white compound	Chrysotile 2%	--	
		B - Off white compound	Chrysotile 2%	--	
HP5-3-WP01-418	Wallpapered Drywall	C - Off white joint compound	Chrysotile 3%	--	
		A - Off white compound	Chrysotile 2%	--	
		A - Off white compound	Chrysotile 2%	--	
HP5-3-WP01-419	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	
HP5-3-WP01-420	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	
HP5-3-WP01-421	Wallpapered Drywall	A - Off white compound	Chrysotile 2%	--	
HP5-3-CB01-422	Cove Base	B - Off white compound	Chrysotile 3%	2.00	
		E - Brown adhesive	Chrysotile Trace	<0.25	
			Tremolite/Actinolite Trace	<0.25	
HP5-3-CB01-423	Cove Base	B - Off white compound	Chrysotile 2%	1.00	
			Chrysotile Trace	<0.25	
		D - Brown adhesive	Tremolite/Actinolite Trace	0.50	
HP5-3-FT02-428	Floor Tile	C - Green tile	Chrysotile 3%	--	100 sq. ft.
		D - Off white tile	Chrysotile 5%	--	
HP5-3-FT04-430	Floor Tile	B - Red tile	Chrysotile 4%	--	160 sq. ft.
HP5-3-FT05-431	Linoleum	A - Green/multi-colored sheet vinyl w/ gray fibrous backing material & brown mastic	Chrysotile 18%	--	70 sq. ft.

Table 2
Non-ACM Samples by Point Count

Sample ID	Physical Description	ACM Layer(s)	Asbestos Type and Percent Composition (by PLM Method)	Point Count Method Result
Building 4 - Roof				
HP4-R-RF01-190	Roofing Felt	A - Black felt w/ silver resinous material	Chrysotile Trace	<0.25

Table 3
Non-detect for Asbestos Samples

Sample ID	Physical Description	Sample Layer(s)
Building 1 - 1st Floor		
HP1-1-WP01-306	Wallpapered Drywall	A - Tan/off white wall covering B - Off white/tan drywall
Building 1 - 2nd Floor		
HP1-2-CP01-345	Carpet	A - Green/pink carpet w/ tan paper B - Gray/multi-colored carpet material
HP1-2-CP02-346	Carpet	A - Cream adhesive B - Red/multi-colored carpet w/ light yellow foam
HP1-2-CP03-347	Carpet	A - Pink/multi-colored foam B - Green/multi-colored carpet
Building 2 - 1st Floor		
HP2-1-CD01-376	Ceiling Drywall	A - Tan/white drywall w/ white/yellow paint
HP2-1-WP01-388	Wallpapered Drywall	A - Tan/white wall covering w/ tan adhesive B - Tan/white drywall w/ off white/white paint
HP2-1-WP01-392	Wallpapered Drywall	A - Tan wall covering w/ yellow adhesive B - Tan/white drywall w/ off white/white paint
Building 2 - 2nd Floor		
HP2-2-WP01-353	Wallpapered Drywall	A - Off white compound B - Beige/multi-colored wall covering C - Off white/tan drywall w/ off white paint
HP2-2-WP01-356	Wallpapered Drywall	A - Beige/multi-colored wall covering w/ white caulk B - Off white/tan drywall w/ off white paint
HP2-2-CD02-367	Ceiling Drywall	A - Gray/tan drywall w/ white/off white paint
HP2-2-CD02-368	Ceiling Drywall	A - Gray/tan drywall w/ white/off white paint
HP2-2-CD02-369	Ceiling Drywall	A - Gray/tan drywall w/ white/off white paint
HP2-2-DG01-370	Drywall Glue	A - Black adhesive
HP2-2-CP01-371	Carpet	A - Yellow adhesive B - Green/multi-colored carpet
HP2-2-CP02-372	Carpet	A - Yellow adhesive B - Red/multi-colored carpet
HP2-2-CP03-373	Carpet	A - Yellow adhesive B - Pink/multi-colored foam C - Green/multi-colored carpet
Building 3 - 1st Floor		
HP3-1-DW02-006	Drywall	A - White texture w/ cream paint B - White joint compound C - White tape D - Gray/tan drywall
HP3-1-DW02-007	Drywall	A - White texture w/ cream paint B - Gray/tan drywall
HP3-1-DW02-008	Drywall	A - White texture w/ tan paint B - Gray/tan drywall
HP3-1-DW02-009	Drywall	A - White texture w/ cream paint B - Gray/tan drywall
HP3-1-DW02-011	Drywall	A - White texture w/ cream paint B - Gray/tan drywall
HP3-1-DW02-012	Drywall	A - White joint compound B - White paint w/ white compound C - White texture w/ cream paint D - Off white tape E - Off white/tan drywall
HP3-1-DW03-018	Drywall	A - White joint compound B - White compound C - Off white tape D - Off white/tan drywall
HP3-1-DW03-019	Drywall	A - White compound B - White joint compound C - Off white tape D - Gray/tan drywall

Table 3
Non-detect for Asbestos Samples

Sample ID	Physical Description	Sample Layer(s)
HP3-1-DW03-020	Drywall	A - White compound
		B - Off white tape
		C - White joint compound
		D - Tan/off white drywall
HP3-1-CP01-022	Carpet	A - Tan adhesive
		B - Tan adhesive
		C - White leveling compound
		D - Brown/multi-colored carpet
		E - Gray foam
HP3-1-ST01-023	Stucco	A - Brown/multi-colored stucco
HP3-1-ST01-024	Stucco	A - Brown/multi-colored stucco
HP3-1-ST01-025	Stucco	A - Brown/multi-colored stucco
HP3-1-CP02-026	Carpet	A - Tan/multi-colored carpet
		B - Pink/multi-colored foam
Building 3 - 2nd Floor		
HP3-2-DW01-030	Drywall	A - White joint compound
		B - White texture w/ tan/white paint
		C - Off white tape
		D - Gray/tan drywall
HP3-2-WP01-040	Wallpapered Drywall	A Tan/off white wall covering
		B Off white/tan drywall w/ off white paint
HP3-2-CP01-058	Carpet	A - Green/colorless adhesive
		B - Green/multi-colored carpet w/ tan foam
HP3-2-CP02-059	Carpet	A - Yellow adhesive
		B - Green/multi-colored carpet
		C - Pink/multi-colored foam
Building 4 - 1st Floor		
HP4-1-EP01-060	Electrical Panel	A - Brown/white fiberboard
HP4-1-DW01-067	Drywall	A - White tape
		B - White texture w/ cream paint
		C - White joint compound
		D - Tan/white drywall
HP4-1-FT01-071	Floor Tile	A - Brown mastic
		B - Tan/brown tile
HP4-1-CD01-076	Ceiling Drywall	A - White texture w/ white paint
		B - White compound
		C - Tan/white drywall
HP4-1-CP01-090	Carpet	A - Tan adhesive
		B - White leveling compound
		C - Blue adhesive
		D - Tan carpet
		E - Gray/multi-colored fibrous material
HP4-1-CP02-091	Carpet	A - Tan adhesive
		B - White leveling compound
		C - Blue adhesive
		D - Black/tan carpet
		E - Pink/multi-colored foam
HP4-1-DW02-092	Drywall	A - White texture w/ white paint
HP4-1-DW02-093	Drywall	B - Gray/tan drywall
		A - White texture w/ white paint
HP4-1-DW02-094	Drywall	B - Gray/tan drywall
		A - White texture w/ white paint
Building 4 - 2nd Floor		
HP4-2-CP01-108	Carpet	A - White leveling compound
		B - Off white adhesive
		C - Yellow foam w/ off white fibrous woven material
		D - Red/multi-colored carpet
HP4-2-CP02-109	Carpet	A - Tan adhesive
		B - Green/multi-colored carpet
		C - Gray/multi-colored fibrous material

Table 3
Non-detect for Asbestos Samples

Sample ID	Physical Description	Sample Layer(s)
Building 5 - 1st Floor		
HP5-1-PJ01-118	Pipe Joint	A - Gray fibrous plaster w/ off white fibrous woven material
HP5-1-PJ01-119	Pipe Joint	A - Gray fibrous plaster w/ brown fibrous woven material
HP5-1-PJ01-120	Pipe Joint	A - Gray fibrous plaster w/ off white fibrous woven material
HP5-1-PJ01-121	Pipe Joint	A - Gray fibrous plaster w/ off white fibrous woven material
HP5-1-CP02-162	Carpet	A - Yellow adhesive
		B - Gray/multi-colored carpet
		C - Green/multi-colored carpet
Building 5 - 2nd Floor		
HP5-2-CP01-186	Carpet	A - Tan adhesive
		B - Green/multi-colored carpet
		C - Pink/multi-colored foam
HP5-2-CP02-187	Carpet	A - Tan adhesive
		B - Green/multi-colored carpet w/ tan foam
Building 5 - 3rd Floor		
HP5-3-CB02-424	Cove Base	A - Yellow adhesive
		B - Off white cove base
HP5-3-CB03-425	Cove Base	A - Yellow adhesive
		B - Purple cove base
HP5-3-FT01-426	Floor Tile	A - Yellow mastic
		B - White/brown tile
HP5-3-FT01-427	Floor Tile	A - Yellow mastic
		B - White/brown tile
HP5-3-FT03-429	Linoleum	A - Off white/yellow sheet vinyl w/ gray fibrous backing material & yellow mastic
HP5-3-FT06-432	Linoleum	A - Off white/gray sheet vinyl w/ gray fibrous backing material & white mastic
HP5-3-FT07-433	Linoleum	A - Off white/gray sheet vinyl w/ gray fibrous backing material & white mastic
HP5-3-FT08-434	Linoleum	A - Off white sheet vinyl w/ gray fibrous backing material & yellow mastic
HP5-3-CP01-435	Carpet	A - Yellow adhesive
		B - Reddish purple/multi-colored carpet w/ tan foam
HP5-3-CP02-436	Carpet	A - Green/yellow foam
		B - Green carpet
HP5-3-CP03-437	Carpet	A - Tan carpet
		B - Green/multi-colored foam
HP5-3-CP04-438	Carpet	A - Brown fibrous material
		B - Yellow adhesive
		C - Pink/multi-colored fibrous material
		D - Grayish green carpet
HP5-3-CP05-439	Carpet	A - Green/pink carpet
		B - Pink/multi-colored foam
HP5-3-CP06-440	Carpet	A - Yellow adhesive
		B - Brown fibrous material
		C - Tan foam
		D - Tan carpet
HP5-3-CP07-441	Carpet	A - White fibrous material
		B - Brown fibrous material
		C - Tan foam
		D - Tan/off white carpet
HP5-3-CP08-442	Carpet	A - Yellow adhesive
		B - Green/multi-colored foam
		C - Brownish purple carpet

Table 4
Lead-Based Paint Screening Results

Reading	Date	Time	Location	Room	Component	Substrate	Color	Lead mg/cm ²	(+/-) Error
XRF - Calibration Checks									
Day One									
3	2/5/2018	13:22:49	Hitching Post Inn	N/A	N/A	SRM 2570	WHITE	0	0
4	2/5/2018	13:23:34	Hitching Post Inn	N/A	N/A	SRM 2571	YELLOW	3.65	0.27
5	2/5/2018	13:24:21	Hitching Post Inn	N/A	N/A	SRM 2572	ORANGE	1.54	0.12
6	2/5/2018	13:25:08	Hitching Post Inn	N/A	N/A	SRM 2573	RED	1.07	0.04
7	2/5/2018	13:26:19	Hitching Post Inn	N/A	N/A	SRM 2574	GOLD	0.67	0.06
8	2/5/2018	13:27:17	Hitching Post Inn	N/A	N/A	SRM 2575	GREEN	0.38	0.05
121	2/5/2018	16:34:08	Hitching Post Inn	N/A	N/A	SRM 2570	WHITE	0	0
122	2/5/2018	16:35:24	Hitching Post Inn	N/A	N/A	SRM 2571	YELLOW	3.57	0.27
123	2/5/2018	16:36:24	Hitching Post Inn	N/A	N/A	SRM 2572	ORANGE	1.76	0.17
124	2/5/2018	16:37:31	Hitching Post Inn	N/A	N/A	SRM 2573	RED	1.04	0.04
125	2/5/2018	16:38:58	Hitching Post Inn	N/A	N/A	SRM 2574	GOLD	0.72	0.06
126	2/5/2018	16:40:32	Hitching Post Inn	N/A	N/A	SRM 2575	GREEN	0.33	0.04
Day Two									
2	2/6/2018	7:56:37	Hitching Post Inn	N/A	N/A	SRM 2570	WHITE	0	0
3	2/6/2018	7:58:08	Hitching Post Inn	N/A	N/A	SRM 2571	YELLOW	3.88	0.29
4	2/6/2018	7:59:35	Hitching Post Inn	N/A	N/A	SRM 2572	ORANGE	1.49	0.12
5	2/6/2018	8:00:56	Hitching Post Inn	N/A	N/A	SRM 2573	RED	1.11	0.06
6	2/6/2018	8:02:23	Hitching Post Inn	N/A	N/A	SRM 2574	GOLD	0.65	0.06
7	2/6/2018	8:03:35	Hitching Post Inn	N/A	N/A	SRM 2575	GREEN	0.31	0.04
89	2/6/2018	11:20:34	Hitching Post Inn	N/A	N/A	SRM 2570	WHITE	0	0
90	2/6/2018	11:21:18	Hitching Post Inn	N/A	N/A	SRM 2571	YELLOW	3.47	0.26
91	2/6/2018	11:21:54	Hitching Post Inn	N/A	N/A	SRM 2572	ORANGE	1.84	0.18
92	2/6/2018	11:22:17	Hitching Post Inn	N/A	N/A	SRM 2573	RED	1.05	0.04
93	2/6/2018	11:23:10	Hitching Post Inn	N/A	N/A	SRM 2574	GOLD	0.64	0.06
94	2/6/2018	11:23:39	Hitching Post Inn	N/A	N/A	SRM 2575	GREEN	0.3	0.04
96	2/6/2018	12:32:46	Hitching Post Inn	N/A	N/A	SRM 2570	WHITE	0	0
97	2/6/2018	12:33:51	Hitching Post Inn	N/A	N/A	SRM 2571	YELLOW	3.7	0.28
98	2/6/2018	12:34:49	Hitching Post Inn	N/A	N/A	SRM 2572	ORANGE	1.55	0.12
99	2/6/2018	12:35:51	Hitching Post Inn	N/A	N/A	SRM 2573	RED	1.03	0.04
100	2/6/2018	12:39:59	Hitching Post Inn	N/A	N/A	SRM 2574	GOLD	0.67	0.06
101	2/6/2018	12:41:12	Hitching Post Inn	N/A	N/A	SRM 2575	GREEN	0.31	0.04
283	2/6/2018	16:37:48	Hitching Post Inn	N/A	N/A	SRM 2570	WHITE	0	0
284	2/6/2018	16:38:32	Hitching Post Inn	N/A	N/A	SRM 2571	YELLOW	3.83	0.29
285	2/6/2018	16:39:26	Hitching Post Inn	N/A	N/A	SRM 2572	ORANGE	1.63	0.13
286	2/6/2018	16:40:07	Hitching Post Inn	N/A	N/A	SRM 2573	RED	1.14	0.06
287	2/6/2018	16:41:05	Hitching Post Inn	N/A	N/A	SRM 2574	GOLD	0.66	0.06
288	2/6/2018	16:41:58	Hitching Post Inn	N/A	N/A	SRM 2575	GREEN	0.38	0.05
Screening Results									
Day One									
9	2/5/2018	13:45:21	Building 3 - 1st Floor	room A	WALL	DRYWALL	GOLD	0	0
10	2/5/2018	13:45:55	Building 3 - 1st Floor	room A	WALL	DRYWALL	CREAM	0	0
11	2/5/2018	13:46:22	Building 3 - 1st Floor	room A	CEILING	DRYWALL	CREAM	0	0
12	2/5/2018	13:47:11	Building 3 - 1st Floor	room A	DOOR	METAL	CREAM	0.02	0.03
13	2/5/2018	13:47:47	Building 3 - 1st Floor	room A	WINDOW FRAME	WOOD	CREAM	0.02	0.05
14	2/5/2018	13:48:55	Building 3 - 1st Floor	room A	CEILING	DRYWALL	WHITE	0	0
15	2/5/2018	13:49:54	Building 3 - 1st Floor	room A	DOOR	WOOD	WHITE	0.04	0.04
16	2/5/2018	13:50:42	Building 3 - 1st Floor	room A	DOOR	WOOD	WHITE	0.02	0.03
17	2/5/2018	13:54:57	Building 3 - 1st Floor	room B	DOOR	WOOD	WHITE	0.02	0.02
18	2/5/2018	13:55:22	Building 3 - 1st Floor	room B	DOOR FRAME	METAL	WHITE	0.01	0.01
19	2/5/2018	13:56:00	Building 3 - 1st Floor	room B	WALL	DRYWALL	WHITE	0	0
20	2/5/2018	13:56:26	Building 3 - 1st Floor	room B	WALL	DRYWALL	GOLD	0	0
21	2/5/2018	13:57:19	Building 3 - 1st Floor	room B	CEILING	DRYWALL	WHITE	0	0
22	2/5/2018	13:59:10	Building 3 - 1st Floor	room C	CEILING	DRYWALL	WHITE	0	0
23	2/5/2018	13:59:34	Building 3 - 1st Floor	room C	WALL	DRYWALL	WHITE	0	0
24	2/5/2018	14:00:12	Building 3 - 1st Floor	room C	DOOR	WOOD	WHITE	0.01	0.02
25	2/5/2018	14:00:41	Building 3 - 1st Floor	room C	WINDOW FRAME	WOOD	WHITE	0	0

Table 4
Lead-Based Paint Screening Results

Reading	Date	Time	Location	Room	Component	Substrate	Color	Lead mg/cm ²	(+/-) Error
26	2/5/2018	14:07:35	Building 3 - 1st Floor	room D	WINDOW FRAME	WOOD	WHITE	0.01	0.02
27	2/5/2018	14:08:11	Building 3 - 1st Floor	room D	DOOR	WOOD	WHITE	0.03	0.02
28	2/5/2018	14:08:37	Building 3 - 1st Floor	room D	DOOR FRAME	METAL	WHITE	0.06	0.05
29	2/5/2018	14:09:16	Building 3 - 1st Floor	room D	WALL	DRYWALL	WHITE	0	0
30	2/5/2018	14:09:48	Building 3 - 1st Floor	room D	CEILING	DRYWALL	WHITE	0	0
31	2/5/2018	14:10:09	Building 3 - 1st Floor	room D	CEILING	DRYWALL	WHITE	1	0.04
32	2/5/2018	14:10:36	Building 3 - 1st Floor	room D	CEILING	DRYWALL	WHITE	1	0.02
33	2/5/2018	14:15:41	Building 3 - 1st Floor	room E	CEILING	DRYWALL	WHITE	1	0.02
34	2/5/2018	14:16:38	Building 3 - 1st Floor	room E	CEILING	DRYWALL	WHITE	0	0
35	2/5/2018	14:17:32	Building 3 - 1st Floor	room E	WALL	DRYWALL	WHITE	0	0
36	2/5/2018	14:18:01	Building 3 - 1st Floor	room E	WALL	DRYWALL	GOLD	0	0
37	2/5/2018	14:18:41	Building 3 - 1st Floor	room E	DOOR	WOOD	WHITE	0	0.01
38	2/5/2018	14:19:10	Building 3 - 1st Floor	room E	DOOR FRAME	METAL	WHITE	0.02	0.02
39	2/5/2018	14:23:06	Building 3 - 1st Floor	room F	WALL	DRYWALL	GOLD	0	0
40	2/5/2018	14:23:52	Building 3 - 1st Floor	room F	WALL	DRYWALL	WHITE	0	0
41	2/5/2018	14:25:12	Building 3 - 1st Floor	room F	CEILING	DRYWALL	WHITE	0.01	0.02
42	2/5/2018	14:29:57	Building 3 - 1st Floor	room G	CEILING	DRYWALL	WHITE	0	0.01
43	2/5/2018	14:31:13	Building 3 - 1st Floor	room G	WALL	BRICK	WHITE	0	0
44	2/5/2018	14:32:03	Building 3 - 1st Floor	room G	FLOOR	CONCRETE	GRAY	0	0
45	2/5/2018	14:36:47	Building 3 - 1st Floor	room H	WALL	DRYWALL	BROWN	0	0
46	2/5/2018	14:37:10	Building 3 - 1st Floor	room H	WALL	DRYWALL	BROWN	0	0
47	2/5/2018	14:37:42	Building 3 - 1st Floor	room H	WALL	DRYWALL	CREAM	0	0
48	2/5/2018	14:38:01	Building 3 - 1st Floor	room H	WALL	DRYWALL	CREAM	0	0
49	2/5/2018	14:51:33	Building 3 - 2nd Floor	room A	WALL	DRYWALL	WHITE	0	0
50	2/5/2018	14:52:21	Building 3 - 2nd Floor	room A	WINDOW FRAME	WOOD	WHITE	0.03	0.03
51	2/5/2018	14:53:00	Building 3 - 2nd Floor	room A	CEILING	DRYWALL	WHITE	0	0
52	2/5/2018	14:53:30	Building 3 - 2nd Floor	room A	CEILING	DRYWALL	WHITE	1	0.01
53	2/5/2018	14:56:27	Building 3 - 2nd Floor	room B	CEILING	DRYWALL	WHITE	0	0
54	2/5/2018	14:57:08	Building 3 - 2nd Floor	room B	CEILING	DRYWALL	WHITE	1	0.06
55	2/5/2018	14:58:31	Building 3 - 2nd Floor	room B	WALL	DRYWALL	WHITE	0	0
56	2/5/2018	14:58:56	Building 3 - 2nd Floor	room B	DOOR FRAME	METAL	WHITE	0.02	0.02
57	2/5/2018	14:59:26	Building 3 - 2nd Floor	room B	DOOR	WOOD	WHITE	0.02	0.02
58	2/5/2018	15:01:30	Building 3 - 2nd Floor	room C	DOOR	WOOD	WHITE	0	0.01
59	2/5/2018	15:01:55	Building 3 - 2nd Floor	room C	DOOR FRAME	METAL	WHITE	0.03	0.04
60	2/5/2018	15:02:24	Building 3 - 2nd Floor	room C	WALL	DRYWALL	WHITE	0	0
61	2/5/2018	15:03:00	Building 3 - 2nd Floor	room C	CEILING	DRYWALL	WHITE	0	0
62	2/5/2018	15:03:31	Building 3 - 2nd Floor	room C	CEILING	DRYWALL	WHITE	0.03	0.04
63	2/5/2018	15:04:00	Building 3 - 2nd Floor	room C	CEILING	DRYWALL	WHITE	0	0
64	2/5/2018	15:06:04	Building 3 - 2nd Floor	room D	CEILING	DRYWALL	WHITE	0	0
65	2/5/2018	15:06:48	Building 3 - 2nd Floor	room D	CEILING	DRYWALL	WHITE	1	0.01
66	2/5/2018	15:07:52	Building 3 - 2nd Floor	room D	WALL	DRYWALL	WHITE	0	0
67	2/5/2018	15:08:28	Building 3 - 2nd Floor	room D	DOOR FRAME	METAL	WHITE	0.01	0.01
68	2/5/2018	15:08:59	Building 3 - 2nd Floor	room D	DOOR	WOOD	WHITE	0.03	0.02
69	2/5/2018	15:10:46	Building 3 - 2nd Floor	room E	DOOR	WOOD	WHITE	0.01	0.01
70	2/5/2018	15:11:14	Building 3 - 2nd Floor	room E	DOOR FRAME	METAL	WHITE	0.01	0.01
71	2/5/2018	15:11:49	Building 3 - 2nd Floor	room E	CEILING	DRYWALL	WHITE	1	0.01
72	2/5/2018	15:12:18	Building 3 - 2nd Floor	room E	CEILING	DRYWALL	WHITE	0	0
73	2/5/2018	15:12:49	Building 3 - 2nd Floor	room E	WALL	DRYWALL	WHITE	0.01	0.03
74	2/5/2018	15:14:32	Building 3 - 2nd Floor	room F	WALL	DRYWALL	BROWN	0	0
75	2/5/2018	15:14:56	Building 3 - 2nd Floor	room F	WALL	DRYWALL	CREAM	0	0
76	2/5/2018	15:15:14	Building 3 - 2nd Floor	room F	WALL	DRYWALL	CREAM	0	0
77	2/5/2018	15:51:14	Building 4 - 1st Floor	room A	WALL	DRYWALL	WHITE	0	0
78	2/5/2018	15:51:40	Building 4 - 1st Floor	room A	CEILING	DRYWALL	WHITE	0	0
79	2/5/2018	15:52:09	Building 4 - 1st Floor	room A	CEILING	DRYWALL	WHITE	0	0
80	2/5/2018	15:52:56	Building 4 - 1st Floor	room A	WINDOW FRAME	WOOD	WHITE	0.01	0.03
81	2/5/2018	15:53:43	Building 4 - 1st Floor	room A	DOOR FRAME	METAL	WHITE	0.06	0.03
82	2/5/2018	15:54:16	Building 4 - 1st Floor	room A	DOOR	WOOD	WHITE	0.03	0.03
83	2/5/2018	15:56:06	Building 4 - 1st Floor	room B	WALL	DRYWALL	WHITE	0	0

Table 4
Lead-Based Paint Screening Results

Reading	Date	Time	Location	Room	Component	Substrate	Color	Lead mg/cm ²	(+/-) Error
84	2/5/2018	15:56:40	Building 4 - 1st Floor	room B	WALL	DRYWALL	WHITE	0	0
85	2/5/2018	15:57:09	Building 4 - 1st Floor	room B	WALL	DRYWALL	GOLD	0	0
86	2/5/2018	15:57:55	Building 4 - 1st Floor	room B	DOOR	WOOD	WHITE	0.06	0.07
87	2/5/2018	15:58:21	Building 4 - 1st Floor	room B	DOOR FRAME	METAL	WHITE	0.04	0.03
88	2/5/2018	15:59:25	Building 4 - 1st Floor	room B	CEILING	DRYWALL	WHITE	0	0
89	2/5/2018	16:01:57	Building 4 - 1st Floor	room C	CEILING	DRYWALL	WHITE	0	0
90	2/5/2018	16:02:54	Building 4 - 1st Floor	room C	CEILING	DRYWALL	WHITE	0	0
91	2/5/2018	16:03:23	Building 4 - 1st Floor	room C	WALL	DRYWALL	WHITE	0	0
92	2/5/2018	16:04:02	Building 4 - 1st Floor	room C	WALL	DRYWALL	GOLD	0	0
93	2/5/2018	16:04:42	Building 4 - 1st Floor	room C	WINDOW FRAME	WOOD	WHITE	0	0
94	2/5/2018	16:05:12	Building 4 - 1st Floor	room C	DOOR	WOOD	WHITE	0.03	0.04
95	2/5/2018	16:06:28	Building 4 - 1st Floor	room D	DOOR	WOOD	WHITE	0.07	0.13
96	2/5/2018	16:06:54	Building 4 - 1st Floor	room D	DOOR FRAME	METAL	WHITE	0.04	0.02
97	2/5/2018	16:07:25	Building 4 - 1st Floor	room D	WALL	DRYWALL	WHITE	0	0
98	2/5/2018	16:07:56	Building 4 - 1st Floor	room D	WALL	DRYWALL	GOLD	0	0
99	2/5/2018	16:08:48	Building 4 - 1st Floor	room D	CEILING	DRYWALL	WHITE	0	0.01
100	2/5/2018	16:09:11	Building 4 - 1st Floor	room D	CEILING	DRYWALL	WHITE	0	0
101	2/5/2018	16:11:52	Building 4 - 1st Floor	room E	CEILING	DRYWALL	WHITE	0	0
102	2/5/2018	16:12:18	Building 4 - 1st Floor	room E	CEILING	DRYWALL	WHITE	0.02	0.04
103	2/5/2018	16:12:51	Building 4 - 1st Floor	room E	WALL	DRYWALL	WHITE	0	0
104	2/5/2018	16:13:24	Building 4 - 1st Floor	room E	WALL	DRYWALL	GOLD	0	0
105	2/5/2018	16:15:24	Building 4 - 1st Floor	room E	DOOR	WOOD	WHITE	0.03	0.06
106	2/5/2018	16:15:46	Building 4 - 1st Floor	room E	DOOR FRAME	METAL	WHITE	0.04	0.02
107	2/5/2018	16:19:43	Building 4 - 1st Floor	room F	WALL	DRYWALL	GOLD	0	0
108	2/5/2018	16:20:16	Building 4 - 1st Floor	room F	WALL	DRYWALL	WHITE	0	0
109	2/5/2018	16:20:45	Building 4 - 1st Floor	room F	DOOR FRAME	METAL	WHITE	0.14	0.11
110	2/5/2018	16:21:14	Building 4 - 1st Floor	room F	DOOR	WOOD	WHITE	0.01	0.02
111	2/5/2018	16:22:00	Building 4 - 1st Floor	room F	CEILING	DRYWALL	WHITE	0	0
112	2/5/2018	16:22:30	Building 4 - 1st Floor	room F	CEILING	DRYWALL	WHITE	0.01	0.02
113	2/5/2018	16:25:05	Building 4 - 1st Floor	room G	WALL	DRYWALL	RED	0	0
114	2/5/2018	16:25:40	Building 4 - 1st Floor	room G	WALL	DRYWALL	WHITE	0	0
115	2/5/2018	16:26:34	Building 4 - 1st Floor	room G	CEILING	DRYWALL	WHITE	0	0
116	2/5/2018	16:27:29	Building 4 - 1st Floor	room G	CEILING	DRYWALL	WHITE	0.01	0.01
117	2/5/2018	16:28:08	Building 4 - 1st Floor	room G	DOOR	WOOD	WHITE	0	0.01
118	2/5/2018	16:30:16	Building 4 - 1st Floor	room H	WALL	DRYWALL	BROWN	0	0
119	2/5/2018	16:30:41	Building 4 - 1st Floor	room H	WALL	DRYWALL	CREAM	0	0
120	2/5/2018	16:31:50	Building 4 - 1st Floor	room H	CEILING	DRYWALL	WHITE	0	0
Day Two									
8	2/6/2018	8:10:16	Building 4 - 2nd Floor	room A	WINDOW FRAME	WOOD	WHITE	0.02	0.02
9	2/6/2018	8:11:15	Building 4 - 2nd Floor	room A	WALL	DRYWALL	WHITE	0	0
10	2/6/2018	8:13:19	Building 4 - 2nd Floor	room A	CEILING	DRYWALL	WHITE	0	0
11	2/6/2018	8:15:20	Building 4 - 2nd Floor	room A	CEILING	DRYWALL	WHITE	0.04	0.07
12	2/6/2018	8:17:28	Building 4 - 2nd Floor	room B	CEILING	DRYWALL	WHITE	0	0
13	2/6/2018	8:18:01	Building 4 - 2nd Floor	room B	WINDOW FRAME	WOOD	WHITE	0.01	0.02
14	2/6/2018	8:18:48	Building 4 - 2nd Floor	room B	WALL	DRYWALL	WHITE	0	0
15	2/6/2018	8:19:26	Building 4 - 2nd Floor	room B	CEILING	DRYWALL	WHITE	0	0
16	2/6/2018	8:19:51	Building 4 - 2nd Floor	room B	DOOR FRAME	METAL	WHITE	0.04	0.02
17	2/6/2018	8:21:55	Building 4 - 2nd Floor	room C	DOOR FRAME	METAL	WHITE	0.09	0.04
18	2/6/2018	8:22:38	Building 4 - 2nd Floor	room C	WALL	DRYWALL	WHITE	0	0
19	2/6/2018	8:23:13	Building 4 - 2nd Floor	room C	CEILING	DRYWALL	WHITE	0	0
20	2/6/2018	8:23:52	Building 4 - 2nd Floor	room C	WINDOW FRAME	WOOD	WHITE	0.01	0.01
21	2/6/2018	8:24:21	Building 4 - 2nd Floor	room C	DOOR	WOOD	WHITE	0.01	0.01
22	2/6/2018	8:25:43	Building 4 - 2nd Floor	room D	DOOR	WOOD	WHITE	0.04	0.05
23	2/6/2018	8:26:17	Building 4 - 2nd Floor	room D	CEILING	DRYWALL	WHITE	0	0
24	2/6/2018	8:26:42	Building 4 - 2nd Floor	room D	CEILING	DRYWALL	WHITE	0	0.01
25	2/6/2018	8:27:32	Building 4 - 2nd Floor	room D	WINDOW FRAME	WOOD	WHITE	0.02	0.02
26	2/6/2018	8:28:04	Building 4 - 2nd Floor	room D	WALL	DRYWALL	WHITE	0	0
27	2/6/2018	8:30:11	Building 4 - 2nd Floor	room E	WALL	DRYWALL	WHITE	0	0

Table 4
Lead-Based Paint Screening Results

Reading	Date	Time	Location	Room	Component	Substrate	Color	Lead mg/cm ²	(+/-) Error
28	2/6/2018	8:30:35	Building 4 - 2nd Floor	room E	CEILING	DRYWALL	WHITE	0	0
29	2/6/2018	8:31:12	Building 4 - 2nd Floor	room E	CEILING	DRYWALL	WHITE	0.01	0.02
30	2/6/2018	8:32:00	Building 4 - 2nd Floor	room E	WINDOW FRAME	WOOD	WHITE	0.04	0.03
31	2/6/2018	8:32:47	Building 4 - 2nd Floor	room E	DOOR FRAME	METAL	WHITE	0	0.01
32	2/6/2018	8:34:46	Building 4 - 2nd Floor	room E	DOOR	WOOD	WHITE	0.01	0.02
33	2/6/2018	8:37:03	Building 4 - 2nd Floor	room F	DOOR	WOOD	WHITE	0.03	0.04
34	2/6/2018	8:38:27	Building 4 - 2nd Floor	room F	DOOR FRAME	METAL	WHITE	0.02	0.01
35	2/6/2018	8:39:32	Building 4 - 2nd Floor	room F	WINDOW FRAME	WOOD	WHITE	0.01	0.01
36	2/6/2018	8:40:59	Building 4 - 2nd Floor	room F	CEILING	DRYWALL	WHITE	0	0
37	2/6/2018	8:41:45	Building 4 - 2nd Floor	room F	CEILING	DRYWALL	WHITE	0	0
38	2/6/2018	8:42:43	Building 4 - 2nd Floor	room F	WALL	DRYWALL	WHITE	0	0
39	2/6/2018	8:48:45	Building 4 - 2nd Floor	room G	WALL	CONCRETE	WHITE	0	0
40	2/6/2018	8:49:20	Building 4 - 2nd Floor	room G	WALL	DRYWALL	WHITE	0	0
41	2/6/2018	8:49:42	Building 4 - 2nd Floor	room G	CEILING	DRYWALL	WHITE	0	0
42	2/6/2018	8:50:10	Building 4 - 2nd Floor	room G	DOOR	WOOD	WHITE	0	0
43	2/6/2018	8:50:32	Building 4 - 2nd Floor	room G	DOOR FRAME	METAL	WHITE	0.01	0.02
44	2/6/2018	8:51:16	Building 4 - 2nd Floor	room H	WALL	DRYWALL	BROWN	0	0
45	2/6/2018	8:51:52	Building 4 - 2nd Floor	room H	WALL	DRYWALL	CREAM	0	0
46	2/6/2018	8:52:22	Building 4 - 2nd Floor	room H	CEILING	DRYWALL	WHITE	0	0
47	2/6/2018	8:53:04	Building 4 - 2nd Floor	room H	BUILT-IN	METAL	BROWN	0	0
48	2/6/2018	10:26:41	Building 4 - 5 Breezeway	room A	DOOR	WOOD	WHITE	0	0
49	2/6/2018	10:27:03	Building 4 - 5 Breezeway	room A	DOOR FRAME	METAL	WHITE	0.04	0.03
50	2/6/2018	10:27:44	Building 4 - 5 Breezeway	room A	CEILING	DRYWALL	WHITE	0	0
51	2/6/2018	10:29:12	Building 4 - 5 Breezeway	room A	WINDOW FRAME	METAL	WHITE	0	0
52	2/6/2018	10:38:42	Building 5 - Basement	room A	DOOR FRAME	WOOD	WHITE	0.09	0.05
53	2/6/2018	10:40:47	Building 5 - Basement	room A	CEILING	DRYWALL	WHITE	0	0
54	2/6/2018	10:41:08	Building 5 - Basement	room A	CEILING	DRYWALL	WHITE	0	0
55	2/6/2018	10:41:52	Building 5 - Basement	room A	WALL	DRYWALL	WHITE	0	0
56	2/6/2018	10:44:00	Building 5 - Basement	room A	DOOR	WOOD	WHITE	0	0
57	2/6/2018	10:45:19	Building 5 - Basement	room B	DOOR	WOOD	WHITE	0	0
58	2/6/2018	10:45:44	Building 5 - Basement	room B	DOOR FRAME	METAL	WHITE	0.02	0.02
59	2/6/2018	10:46:20	Building 5 - Basement	room B	CEILING	DRYWALL	WHITE	0	0
60	2/6/2018	10:46:55	Building 5 - Basement	room B	CEILING	DRYWALL	WHITE	0	0
61	2/6/2018	10:48:01	Building 5 - Basement	room B	WALL	DRYWALL	WHITE	0	0
62	2/6/2018	10:51:41	Building 5 - Basement	room C	DOOR FRAME	METAL	WHITE	0.05	0.03
63	2/6/2018	10:52:21	Building 5 - Basement	room C	DOOR	WOOD	WHITE	0	0
64	2/6/2018	10:53:02	Building 5 - Basement	room C	CEILING	DRYWALL	WHITE	0	0
65	2/6/2018	10:53:28	Building 5 - Basement	room C	CEILING	DRYWALL	WHITE	0	0
66	2/6/2018	10:54:06	Building 5 - Basement	room C	WALL	DRYWALL	WHITE	0	0
67	2/6/2018	10:54:58	Building 5 - Basement	room D	WALL	DRYWALL	WHITE	0	0
68	2/6/2018	10:55:27	Building 5 - Basement	room D	CEILING	DRYWALL	WHITE	0	0
69	2/6/2018	10:55:45	Building 5 - Basement	room D	CEILING	DRYWALL	WHITE	0	0
70	2/6/2018	10:56:21	Building 5 - Basement	room D	DOOR	WOOD	WHITE	0	0
71	2/6/2018	10:56:45	Building 5 - Basement	room D	DOOR FRAME	METAL	WHITE	0.02	0.02
72	2/6/2018	10:58:42	Building 5 - Basement	room E	DOOR FRAME	METAL	WHITE	0.16	0.11
73	2/6/2018	10:59:20	Building 5 - Basement	room E	DOOR	WOOD	WHITE	0	0
74	2/6/2018	11:00:03	Building 5 - Basement	room E	CEILING	DRYWALL	WHITE	0	0
75	2/6/2018	11:00:26	Building 5 - Basement	room E	CEILING	DRYWALL	WHITE	0	0
76	2/6/2018	11:01:38	Building 5 - Basement	room E	WALL	DRYWALL	WHITE	0	0
77	2/6/2018	11:06:31	Building 5 - Basement	room F	WALL	DRYWALL	WHITE	0	0
78	2/6/2018	11:07:06	Building 5 - Basement	room F	CEILING	DRYWALL	WHITE	0	0
79	2/6/2018	11:07:29	Building 5 - Basement	room F	CEILING	DRYWALL	WHITE	0	0
80	2/6/2018	11:07:58	Building 5 - Basement	room F	DOOR	WOOD	WHITE	0	0
81	2/6/2018	11:08:19	Building 5 - Basement	room F	DOOR FRAME	WOOD	WHITE	0.13	0.07
82	2/6/2018	11:09:49	Building 5 - Basement	room G	DOOR FRAME	METAL	WHITE	0.07	0.03
83	2/6/2018	11:10:47	Building 5 - Basement	room G	DOOR	METAL	WHITE	0	0
84	2/6/2018	11:11:26	Building 5 - Basement	room G	WALL	CONCRETE	WHITE	0	0
85	2/6/2018	11:11:57	Building 5 - Basement	room G	CEILING	DRYWALL	WHITE	0	0

Table 4
Lead-Based Paint Screening Results

Reading	Date	Time	Location	Room	Component	Substrate	Color	Lead mg/cm ²	(+/-) Error
86	2/6/2018	11:14:05	Building 5 - Basement	room H	TRIM	WOOD	CREAM	0	0
87	2/6/2018	11:14:42	Building 5 - Basement	room H	CEILING	DRYWALL	WHITE	0	0
88	2/6/2018	11:15:14	Building 5 - Basement	room H	BUILT-IN	METAL	WHITE	0	0.01
102	2/6/2018	12:55:03	Building 5 - 2nd Floor	room A	CEILING	DRYWALL	WHITE	0	0
103	2/6/2018	12:55:32	Building 5 - 2nd Floor	room A	CEILING	DRYWALL	WHITE	0	0
104	2/6/2018	12:56:06	Building 5 - 2nd Floor	room A	WALL	DRYWALL	WHITE	0	0
105	2/6/2018	12:56:37	Building 5 - 2nd Floor	room A	DOOR FRAME	METAL	WHITE	0.06	0.03
106	2/6/2018	12:57:20	Building 5 - 2nd Floor	room A	DOOR	METAL	WHITE	0	0
107	2/6/2018	12:58:49	Building 5 - 2nd Floor	room B	DOOR	METAL	WHITE	0	0
108	2/6/2018	12:59:16	Building 5 - 2nd Floor	room B	DOOR FRAME	METAL	WHITE	0.04	0.02
109	2/6/2018	12:59:49	Building 5 - 2nd Floor	room B	CEILING	DRYWALL	WHITE	0	0
110	2/6/2018	13:00:11	Building 5 - 2nd Floor	room B	CEILING	DRYWALL	WHITE	0	0
111	2/6/2018	13:00:41	Building 5 - 2nd Floor	room B	WALL	DRYWALL	WHITE	0	0
112	2/6/2018	13:02:25	Building 5 - 2nd Floor	room C	WALL	DRYWALL	WHITE	0	0
113	2/6/2018	13:02:59	Building 5 - 2nd Floor	room C	CEILING	DRYWALL	WHITE	0	0
114	2/6/2018	13:03:20	Building 5 - 2nd Floor	room C	CEILING	DRYWALL	WHITE	0	0
115	2/6/2018	13:03:58	Building 5 - 2nd Floor	room C	DOOR FRAME	METAL	WHITE	0	0
116	2/6/2018	13:04:23	Building 5 - 2nd Floor	room C	DOOR FRAME	METAL	WHITE	0.03	0.02
117	2/6/2018	13:06:54	Building 5 - 2nd Floor	room D	DOOR FRAME	METAL	WHITE	0.04	0.02
118	2/6/2018	13:07:26	Building 5 - 2nd Floor	room D	DOOR	METAL	WHITE	0	0
119	2/6/2018	13:08:01	Building 5 - 2nd Floor	room D	WALL	DRYWALL	WHITE	0	0
120	2/6/2018	13:08:27	Building 5 - 2nd Floor	room D	CEILING	DRYWALL	WHITE	0	0
121	2/6/2018	13:08:45	Building 5 - 2nd Floor	room D	CEILING	DRYWALL	WHITE	0	0
122	2/6/2018	13:11:43	Building 5 - 2nd Floor	room E	CEILING	DRYWALL	WHITE	0	0
123	2/6/2018	13:12:04	Building 5 - 2nd Floor	room E	CEILING	DRYWALL	WHITE	0	0
124	2/6/2018	13:12:28	Building 5 - 2nd Floor	room E	WALL	DRYWALL	WHITE	0	0
125	2/6/2018	13:13:00	Building 5 - 2nd Floor	room E	DOOR FRAME	METAL	WHITE	0.04	0.02
126	2/6/2018	13:13:23	Building 5 - 2nd Floor	room E	DOOR	METAL	WHITE	0	0
127	2/6/2018	13:14:16	Building 5 - 2nd Floor	room F	DOOR	METAL	WHITE	0	0
128	2/6/2018	13:14:37	Building 5 - 2nd Floor	room F	DOOR FRAME	METAL	WHITE	0.03	0.02
129	2/6/2018	13:15:09	Building 5 - 2nd Floor	room F	WALL	DRYWALL	WHITE	0	0
130	2/6/2018	13:15:59	Building 5 - 2nd Floor	room F	CEILING	DRYWALL	WHITE	0	0
131	2/6/2018	13:16:41	Building 5 - 2nd Floor	room F	CEILING	DRYWALL	WHITE	0	0
132	2/6/2018	13:17:57	Building 5 - 2nd Floor	room G	CEILING	DRYWALL	WHITE	0	0
133	2/6/2018	13:18:37	Building 5 - 2nd Floor	room G	TRIM	WOOD	CREAM	0	0
134	2/6/2018	13:37:47	Building 5 - 3rd Floor	room A	DOOR	METAL	WHITE	0	0
135	2/6/2018	13:38:06	Building 5 - 3rd Floor	room A	DOOR FRAME	METAL	WHITE	0.02	0.02
136	2/6/2018	13:39:00	Building 5 - 3rd Floor	room A	CEILING	DRYWALL	WHITE	0	0
137	2/6/2018	13:39:16	Building 5 - 3rd Floor	room A	CEILING	DRYWALL	WHITE	0	0
138	2/6/2018	13:39:58	Building 5 - 3rd Floor	room A	WALL	DRYWALL	WHITE	0	0
139	2/6/2018	13:42:34	Building 5 - 3rd Floor	room B	WALL	DRYWALL	WHITE	0	0
140	2/6/2018	13:43:04	Building 5 - 3rd Floor	room B	WALL	DRYWALL	WHITE	0	0
141	2/6/2018	13:44:25	Building 5 - 3rd Floor	room B	CEILING	DRYWALL	WHITE	0	0
142	2/6/2018	13:44:59	Building 5 - 3rd Floor	room B	CEILING	DRYWALL	WHITE	0	0
143	2/6/2018	13:45:28	Building 5 - 3rd Floor	room B	CEILING	DRYWALL	WHITE	0	0
144	2/6/2018	13:47:22	Building 5 - 3rd Floor	room B	DOOR	METAL	WHITE	0	0
145	2/6/2018	13:47:43	Building 5 - 3rd Floor	room B	DOOR FRAME	METAL	WHITE	0.05	0.03
146	2/6/2018	13:49:01	Building 5 - 3rd Floor	room C	DOOR FRAME	METAL	WHITE	0.02	0.03
147	2/6/2018	13:49:25	Building 5 - 3rd Floor	room C	DOOR	METAL	WHITE	0	0
148	2/6/2018	13:49:54	Building 5 - 3rd Floor	room C	CEILING	DRYWALL	WHITE	0	0
149	2/6/2018	13:50:11	Building 5 - 3rd Floor	room C	CEILING	DRYWALL	WHITE	0	0
150	2/6/2018	13:50:35	Building 5 - 3rd Floor	room C	WALL	DRYWALL	WHITE	0	0
151	2/6/2018	13:53:12	Building 5 - 3rd Floor	room D	WALL	DRYWALL	WHITE	0	0
152	2/6/2018	13:53:49	Building 5 - 3rd Floor	room D	WALL	WOOD	WHITE	0	0
153	2/6/2018	13:54:53	Building 5 - 3rd Floor	room D	CEILING	DRYWALL	WHITE	0	0
154	2/6/2018	13:55:32	Building 5 - 3rd Floor	room D	CEILING	DRYWALL	WHITE	0	0
155	2/6/2018	13:56:02	Building 5 - 3rd Floor	room D	CEILING	DRYWALL	WHITE	0	0
156	2/6/2018	13:57:12	Building 5 - 3rd Floor	room D	DOOR	METAL	WHITE	0	0

Table 4
Lead-Based Paint Screening Results

Reading	Date	Time	Location	Room	Component	Substrate	Color	Lead mg/cm ²	(+/-) Error
157	2/6/2018	13:57:47	Building 5 - 3rd Floor	room D	DOOR FRAME	METAL	WHITE	0.03	0.04
158	2/6/2018	13:58:37	Building 5 - 3rd Floor	room E	DOOR FRAME	METAL	WHITE	0.02	0.02
159	2/6/2018	13:59:11	Building 5 - 3rd Floor	room E	DOOR	METAL	WHITE	0	0
160	2/6/2018	13:59:38	Building 5 - 3rd Floor	room E	CEILING	DRYWALL	WHITE	0	0
161	2/6/2018	13:59:55	Building 5 - 3rd Floor	room E	CEILING	DRYWALL	WHITE	0	0
162	2/6/2018	14:00:23	Building 5 - 3rd Floor	room E	WALL	DRYWALL	WHITE	0	0
163	2/6/2018	14:01:02	Building 5 - 3rd Floor	room F	CEILING	DRYWALL	WHITE	0	0
164	2/6/2018	14:01:30	Building 5 - 3rd Floor	room F	DOOR	METAL	GRAY	0	0
165	2/6/2018	14:23:54	Building 1 - 1st Floor	room A	DOOR	METAL	WHITE	0.03	0.04
166	2/6/2018	14:24:17	Building 1 - 1st Floor	room A	DOOR FRAME	METAL	WHITE	0.02	0.02
167	2/6/2018	14:24:53	Building 1 - 1st Floor	room A	WALL	DRYWALL	WHITE	0.03	0.05
168	2/6/2018	14:25:58	Building 1 - 1st Floor	room A	CEILING	DRYWALL	WHITE	0	0
169	2/6/2018	14:26:18	Building 1 - 1st Floor	room A	CEILING	DRYWALL	WHITE	0	0
170	2/6/2018	14:30:59	Building 1 - 1st Floor	room B	CEILING	DRYWALL	WHITE	0	0
171	2/6/2018	14:31:28	Building 1 - 1st Floor	room B	CEILING	DRYWALL	WHITE	0	0
172	2/6/2018	14:32:01	Building 1 - 1st Floor	room B	WALL	DRYWALL	WHITE	0	0
173	2/6/2018	14:32:37	Building 1 - 1st Floor	room B	DOOR FRAME	METAL	WHITE	0.03	0.03
174	2/6/2018	14:33:04	Building 1 - 1st Floor	room B	DOOR	METAL	WHITE	0.05	0.04
175	2/6/2018	14:36:05	Building 1 - 1st Floor	room C	DOOR	METAL	WHITE	0.02	0.02
176	2/6/2018	14:36:30	Building 1 - 1st Floor	room C	DOOR FRAME	METAL	WHITE	0.01	0.01
177	2/6/2018	14:38:55	Building 1 - 1st Floor	room C	WALL	DRYWALL	WHITE	0	0
178	2/6/2018	14:39:29	Building 1 - 1st Floor	room C	CEILING	DRYWALL	WHITE	0	0
179	2/6/2018	14:39:55	Building 1 - 1st Floor	room C	CEILING	DRYWALL	WHITE	0	0
180	2/6/2018	14:40:51	Building 1 - 1st Floor	room D	CEILING	DRYWALL	WHITE	0	0
181	2/6/2018	14:41:08	Building 1 - 1st Floor	room D	CEILING	DRYWALL	WHITE	0	0
182	2/6/2018	14:41:53	Building 1 - 1st Floor	room D	WALL	DRYWALL	WHITE	0	0
183	2/6/2018	14:42:52	Building 1 - 1st Floor	room D	DOOR	METAL	WHITE	0.02	0.02
184	2/6/2018	14:43:34	Building 1 - 1st Floor	room D	DOOR FRAME	METAL	WHITE	0	0
186	2/6/2018	14:53:49	Building 1 - 1st Floor	room E	CEILING	DRYWALL	WHITE	0	0
187	2/6/2018	14:54:20	Building 1 - 1st Floor	room F	CEILING	DRYWALL	WHITE	0	0
188	2/6/2018	14:54:49	Building 1 - 1st Floor	room F	WINDOW FRAME	METAL	WHITE	0	0.01
189	2/6/2018	14:57:19	Building 1 - 2nd Floor	room A	DOOR FRAME	METAL	WHITE	0.09	0.07
190	2/6/2018	14:57:49	Building 1 - 2nd Floor	room A	DOOR	METAL	WHITE	0.01	0.01
191	2/6/2018	14:58:14	Building 1 - 2nd Floor	room A	CEILING	DRYWALL	WHITE	0	0
192	2/6/2018	14:58:38	Building 1 - 2nd Floor	room A	CEILING	DRYWALL	WHITE	0	0
193	2/6/2018	14:59:05	Building 1 - 2nd Floor	room A	WALL	DRYWALL	WHITE	0	0
194	2/6/2018	14:59:47	Building 1 - 2nd Floor	room B	WALL	DRYWALL	WHITE	0	0
195	2/6/2018	15:00:14	Building 1 - 2nd Floor	room B	CEILING	DRYWALL	WHITE	0	0
196	2/6/2018	15:00:37	Building 1 - 2nd Floor	room B	CEILING	DRYWALL	WHITE	0	0
197	2/6/2018	15:01:09	Building 1 - 2nd Floor	room B	DOOR	METAL	WHITE	0.01	0.02
198	2/6/2018	15:01:33	Building 1 - 2nd Floor	room B	DOOR FRAME	METAL	WHITE	0.03	0.02
199	2/6/2018	15:02:27	Building 1 - 2nd Floor	room C	DOOR FRAME	METAL	WHITE	0.07	0.06
200	2/6/2018	15:02:57	Building 1 - 2nd Floor	room C	DOOR	WOOD	WHITE	0.01	0.02
201	2/6/2018	15:03:27	Building 1 - 2nd Floor	room C	WALL	DRYWALL	WHITE	0	0
202	2/6/2018	15:03:59	Building 1 - 2nd Floor	room C	CEILING	DRYWALL	WHITE	0	0
203	2/6/2018	15:04:19	Building 1 - 2nd Floor	room C	CEILING	DRYWALL	WHITE	0	0
204	2/6/2018	15:05:53	Building 1 - 2nd Floor	room D	CEILING	DRYWALL	WHITE	0	0
205	2/6/2018	15:06:16	Building 1 - 2nd Floor	room D	CEILING	DRYWALL	WHITE	0	0
206	2/6/2018	15:06:42	Building 1 - 2nd Floor	room D	WALL	DRYWALL	WHITE	0	0
207	2/6/2018	15:07:12	Building 1 - 2nd Floor	room D	DOOR FRAME	METAL	WHITE	0.01	0.01
208	2/6/2018	15:07:33	Building 1 - 2nd Floor	room D	DOOR	WOOD	WHITE	0.02	0.03
209	2/6/2018	15:08:04	Building 1 - 2nd Floor	room E	CEILING	DRYWALL	WHITE	0	0
210	2/6/2018	15:09:30	Building 1 - 2nd Floor	room E	WINDOW FRAME	METAL	WHITE	0.01	0.01
211	2/6/2018	15:13:24	Building 2 - 1st Floor	room A	DOOR FRAME	METAL	WHITE	0.24	0.06
212	2/6/2018	15:14:01	Building 2 - 1st Floor	room A	DOOR	WOOD	WHITE	0.22	0.06
213	2/6/2018	15:14:30	Building 2 - 1st Floor	room A	WALL	DRYWALL	WHITE	0.1	0.06
214	2/6/2018	15:14:55	Building 2 - 1st Floor	room A	CEILING	DRYWALL	WHITE	0.04	0.03
215	2/6/2018	15:15:18	Building 2 - 1st Floor	room A	CEILING	DRYWALL	WHITE	0.02	0.05

Table 4
Lead-Based Paint Screening Results

Reading	Date	Time	Location	Room	Component	Substrate	Color	Lead mg/cm ²	(+/-) Error
216	2/6/2018	15:16:29	Building 2 - 1st Floor	room B	CEILING	DRYWALL	WHITE	0.1	0.08
217	2/6/2018	15:16:48	Building 2 - 1st Floor	room B	CEILING	DRYWALL	WHITE	0.01	0.03
218	2/6/2018	15:17:22	Building 2 - 1st Floor	room B	WALL	DRYWALL	WHITE	0.24	0.21
219	2/6/2018	15:17:56	Building 2 - 1st Floor	room B	DOOR FRAME	METAL	WHITE	0.24	0.07
220	2/6/2018	15:18:44	Building 2 - 1st Floor	room B	DOOR	WOOD	WHITE	0.18	0.05
221	2/6/2018	15:25:43	Building 2 - 1st Floor	room C	DOOR	WOOD	WHITE	0.22	0.07
222	2/6/2018	15:26:07	Building 2 - 1st Floor	room C	DOOR FRAME	METAL	WHITE	0.31	0.11
223	2/6/2018	15:26:36	Building 2 - 1st Floor	room C	WALL	DRYWALL	WHITE	0.18	0.11
224	2/6/2018	15:27:05	Building 2 - 1st Floor	room C	CEILING	DRYWALL	WHITE	1	0.02
225	2/6/2018	15:27:33	Building 2 - 1st Floor	room C	CEILING	DRYWALL	WHITE	1	0.02
226	2/6/2018	15:28:17	Building 2 - 1st Floor	room C	CEILING	DRYWALL	WHITE	0.09	0.08
227	2/6/2018	15:30:08	Building 2 - 1st Floor	room D	CEILING	DRYWALL	WHITE	0	0.01
228	2/6/2018	15:30:42	Building 2 - 1st Floor	room D	CEILING	DRYWALL	WHITE	0.07	0.04
229	2/6/2018	15:31:10	Building 2 - 1st Floor	room D	WALL	DRYWALL	WHITE	0.05	0.11
230	2/6/2018	15:31:43	Building 2 - 1st Floor	room D	DOOR FRAME	METAL	WHITE	0.1	0.04
231	2/6/2018	15:32:08	Building 2 - 1st Floor	room D	DOOR	WOOD	WHITE	0.02	0.01
232	2/6/2018	15:33:41	Building 2 - 1st Floor	room E	DOOR	WOOD	PINK	0.14	0.04
233	2/6/2018	15:34:42	Building 2 - 1st Floor	room E	TRIM	WOOD	CREAM	0	0
234	2/6/2018	15:35:24	Building 2 - 1st Floor	room E	CEILING	DRYWALL	WHITE	0.06	0.05
235	2/6/2018	15:36:14	Building 2 - 1st Floor	room F	BUILT-IN	METAL	BROWN	1	0.05
236	2/6/2018	15:37:07	Building 2 - 1st Floor	room F	BUILT-IN	METAL	BROWN	1	0.1
237	2/6/2018	15:40:29	Building 2 - 2nd Floor	room A	WALL	DRYWALL	WHITE	0	0
238	2/6/2018	15:41:04	Building 2 - 2nd Floor	room A	CEILING	DRYWALL	WHITE	0.01	0.02
239	2/6/2018	15:41:31	Building 2 - 2nd Floor	room A	CEILING	DRYWALL	WHITE	0.01	0.04
240	2/6/2018	15:42:00	Building 2 - 2nd Floor	room A	DOOR FRAME	METAL	WHITE	0.26	0.08
241	2/6/2018	15:42:23	Building 2 - 2nd Floor	room A	DOOR	WOOD	WHITE	0.4	0.07
242	2/6/2018	15:43:09	Building 2 - 2nd Floor	room B	DOOR	WOOD	WHITE	0.01	0.01
243	2/6/2018	15:43:30	Building 2 - 2nd Floor	room B	DOOR FRAME	METAL	WHITE	0.07	0.04
244	2/6/2018	15:44:13	Building 2 - 2nd Floor	room B	WALL	DRYWALL	WHITE	0	0
245	2/6/2018	15:44:42	Building 2 - 2nd Floor	room B	CEILING	DRYWALL	WHITE	1	0.08
246	2/6/2018	15:45:09	Building 2 - 2nd Floor	room B	CEILING	DRYWALL	WHITE	0	0.01
247	2/6/2018	15:45:28	Building 2 - 2nd Floor	room C	CEILING	DRYWALL	WHITE	1	0.03
248	2/6/2018	15:45:55	Building 2 - 2nd Floor	room C	CEILING	DRYWALL	WHITE	0.04	0.05
249	2/6/2018	15:48:08	Building 2 - 2nd Floor	room C	CEILING	DRYWALL	WHITE	1	0.04
250	2/6/2018	15:48:33	Building 2 - 2nd Floor	room C	CEILING	DRYWALL	WHITE	0.01	0.02
251	2/6/2018	15:49:01	Building 2 - 2nd Floor	room C	WALL	DRYWALL	WHITE	0.21	0.05
252	2/6/2018	15:49:25	Building 2 - 2nd Floor	room C	DOOR FRAME	METAL	WHITE	0.91	0.06
253	2/6/2018	15:50:07	Building 2 - 2nd Floor	room C	DOOR FRAME	METAL	WHITE	0.6	0.11
254	2/6/2018	15:50:33	Building 2 - 2nd Floor	room C	DOOR	WOOD	WHITE	0.44	0.07
255	2/6/2018	15:54:28	Building 2 - 2nd Floor	room D	DOOR	WOOD	WHITE	0.03	0.03
256	2/6/2018	15:54:51	Building 2 - 2nd Floor	room D	DOOR FRAME	METAL	WHITE	0.04	0.02
257	2/6/2018	15:55:22	Building 2 - 2nd Floor	room D	WALL	DRYWALL	WHITE	0	0
258	2/6/2018	15:55:54	Building 2 - 2nd Floor	room D	CEILING	DRYWALL	WHITE	0.01	0.01
259	2/6/2018	15:56:19	Building 2 - 2nd Floor	room D	CEILING	DRYWALL	WHITE	0.01	0.01
260	2/6/2018	15:56:52	Building 2 - 2nd Floor	room E	CEILING	DRYWALL	WHITE	0.02	0.01
261	2/6/2018	16:00:15	Building 1-2 Exterior	N/A	WALL	CONCRETE	BROWN	0	0
262	2/6/2018	16:01:55	Building 1-2 Exterior	N/A	DOOR	METAL	GREEN	0.62	0.08
263	2/6/2018	16:02:21	Building 1-2 Exterior	N/A	TRIM	METAL	CREAM	1.09	0.06
264	2/6/2018	16:06:48	Building 1-2 Exterior	N/A	TRIM	METAL	CREAM	0.45	0.08
265	2/6/2018	16:07:05	Building 1-2 Exterior	N/A	TRIM	METAL	CREAM	1.12	0.06
266	2/6/2018	16:08:41	Building 1-2 Exterior	N/A	TRIM	METAL	CREAM	1	0.06
267	2/6/2018	16:10:48	Building 3-4 Exterior	N/A	TRIM	WOOD	CREAM	0	0
268	2/6/2018	16:11:37	Building 3-4 Exterior	N/A	TRIM	WOOD	CREAM	0.93	0.08
269	2/6/2018	16:12:53	Building 3-4 Exterior	N/A	TRIM	METAL	CREAM	0.78	0.09
270	2/6/2018	16:13:27	Building 3-4 Exterior	N/A	WALL	CONCRETE	BROWN	0	0
271	2/6/2018	16:14:31	Building 3-4 Exterior	N/A	DOOR	METAL	GREEN	0.04	0.02
272	2/6/2018	16:17:40	Building 3-4 Exterior	N/A	DOOR	METAL	GREEN	0.25	0.06
273	2/6/2018	16:18:23	Building 3-4 Exterior	N/A	WALL	CONCRETE	BROWN	0	0

Table 4
Lead-Based Paint Screening Results

Reading	Date	Time	Location	Room	Component	Substrate	Color	Lead mg/cm ²	(+/-) Error
274	2/6/2018	16:18:55	Building 3-4 Exterior	N/A	TRIM	METAL	CREAM	5	0.76
275	2/6/2018	16:19:22	Building 3-4 Exterior	N/A	TRIM	WOOD	CREAM	0.28	0.06
276	2/6/2018	16:19:42	Building 3-4 Exterior	N/A	TRIM	WOOD	CREAM	5	0.88
277	2/6/2018	16:20:20	Building 3-4 Exterior	N/A	TRIM	WOOD	CREAM	5	1.26
278	2/6/2018	16:32:11	Building 5 Exterior	N/A	TRIM	WOOD	CREAM	0	0
279	2/6/2018	16:32:31	Building 5 Exterior	N/A	TRIM	METAL	CREAM	0.28	0.05
280	2/6/2018	16:32:45	Building 5 Exterior	N/A	TRIM	METAL	CREAM	0.09	0.08
281	2/6/2018	16:33:18	Building 5 Exterior	N/A	DOOR	METAL	GREEN	0	0
282	2/6/2018	16:33:56	Building 5 Exterior	N/A	WALL	CONCRETE	BROWN	0	0

APPENDIX A
PHOTOGRAPH LOG

Project Name: Hitching Post Inn	Site Location: Cheyenne, WY	Project No. 0003-1711-13
---	---------------------------------------	------------------------------------

<table> <tr> <td>Photo No. 1</td><td>Date: 02/07/2018</td></tr> <tr> <td colspan="2">Photo Coordinates</td></tr> <tr> <td>Lat</td><td>41.125764</td></tr> <tr> <td>Long</td><td>-104.834144</td></tr> <tr> <td colspan="2">Direction Photo Taken: 357.368932038835</td></tr> <tr> <td colspan="2"> Description: Looking at the site of the former burned down Main Building and current Buildings #1 and #2. </td></tr> </table>	Photo No. 1	Date: 02/07/2018	Photo Coordinates		Lat	41.125764	Long	-104.834144	Direction Photo Taken: 357.368932038835		Description: Looking at the site of the former burned down Main Building and current Buildings #1 and #2.		
Photo No. 1	Date: 02/07/2018												
Photo Coordinates													
Lat	41.125764												
Long	-104.834144												
Direction Photo Taken: 357.368932038835													
Description: Looking at the site of the former burned down Main Building and current Buildings #1 and #2.													
<table> <tr> <td>Photo No. 2</td><td>Date: 01/03/2018</td></tr> <tr> <td colspan="2"> Description: Looking at the exterior of Building #4 with LBP on I-beams. </td></tr> </table>	Photo No. 2	Date: 01/03/2018	Description: Looking at the exterior of Building #4 with LBP on I-beams.										
Photo No. 2	Date: 01/03/2018												
Description: Looking at the exterior of Building #4 with LBP on I-beams.													

Project Name: Hitching Post Inn	Site Location: Cheyenne, WY	Project No. 0003-1711-13
---	---------------------------------------	------------------------------------

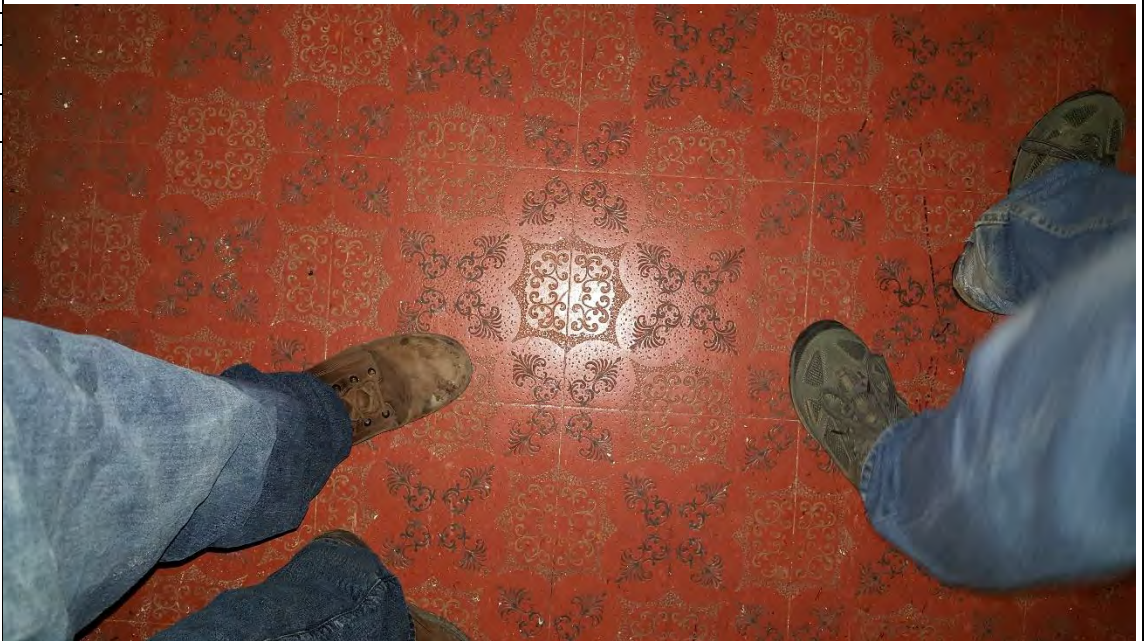
Photo No. 3	Date: 02/07/2018
Photo Coordinates	
Lat	41.128497
Long	-104.831817
Direction Photo Taken: 44.0596923076923	
Description: Roof of Building #4. Assumed all roofs are homogeneous based on aerial photographs.	



Photo No. 4	Date: 02/07/2018
Photo Coordinates	
Lat	41.128497
Long	-104.831817
Direction Photo Taken: 334.31007751938	
Description: Hole saw was used to collect ACM sample HP4-R-RM01-189.	



Project Name: Hitching Post Inn	Site Location: Cheyenne, WY	Project No. 0003-1711-13
---	---------------------------------------	------------------------------------

<table> <tr> <td>Photo No. 5</td><td>Date: 02/05/2018</td></tr> <tr> <td colspan="2">Photo Coordinates</td></tr> <tr> <td>Lat</td><td>41.129722</td></tr> <tr> <td>Long</td><td>-104.830556</td></tr> <tr> <td colspan="2"> Description: Straw wall insulation observed in Building #3. </td></tr> </table>	Photo No. 5	Date: 02/05/2018	Photo Coordinates		Lat	41.129722	Long	-104.830556	Description: Straw wall insulation observed in Building #3.		
Photo No. 5	Date: 02/05/2018										
Photo Coordinates											
Lat	41.129722										
Long	-104.830556										
Description: Straw wall insulation observed in Building #3.											
<table> <tr> <td>Photo No. 6</td><td>Date: 02/05/2018</td></tr> <tr> <td colspan="2">Photo Coordinates</td></tr> <tr> <td>Lat</td><td>41.129722</td></tr> <tr> <td>Long</td><td>-104.830556</td></tr> <tr> <td colspan="2"> Description: ACM floor tile observed on the 3rd floor of Building #5 and location of sample HP5-3-FT04-430. </td></tr> </table>	Photo No. 6	Date: 02/05/2018	Photo Coordinates		Lat	41.129722	Long	-104.830556	Description: ACM floor tile observed on the 3 rd floor of Building #5 and location of sample HP5-3-FT04-430.		
Photo No. 6	Date: 02/05/2018										
Photo Coordinates											
Lat	41.129722										
Long	-104.830556										
Description: ACM floor tile observed on the 3 rd floor of Building #5 and location of sample HP5-3-FT04-430.											

Project Name: Hitching Post Inn	Site Location: Cheyenne, WY	Project No. 0003-1711-13
---	---------------------------------------	------------------------------------

Photo No. 7	Date: 02/06/2018
Description: Example of a mercury thermostat switch observed throughout the buildings.	



Photo No. 8	Date: 01/03/2018	
Description: Primarily fiberglass insulation was observed in the buildings.		

Project Name: Hitching Post Inn	Site Location: Cheyenne, WY	Project No. 0003-1711-13
---	---------------------------------------	------------------------------------

Photo No. 9	Date: 02/05/2018
Photo Coordinates	
Lat	41.128606
Long	-104.831781
Direction Photo Taken: 196.505102040816	
Description: Black mold observed in one of the hotel rooms.	



Photo No. 10	Date: 02/05/2018
Photo Coordinates	
Lat	41.127514
Long	-104.831336
Direction Photo Taken: 312.875502008032	
Description: A ballast with a "No-PCBs" label.	



Project Name: Hitching Post Inn	Site Location: Cheyenne, WY	Project No. 0003-1711-13
---	---------------------------------------	------------------------------------

Photo No. 11	Date: 02/05/2018
Photo Coordinates	
Lat	41.126014
Long	-104.833603
Direction Photo Taken: 242.620437956204	
Description: No suspect materials observed above the ceiling.	

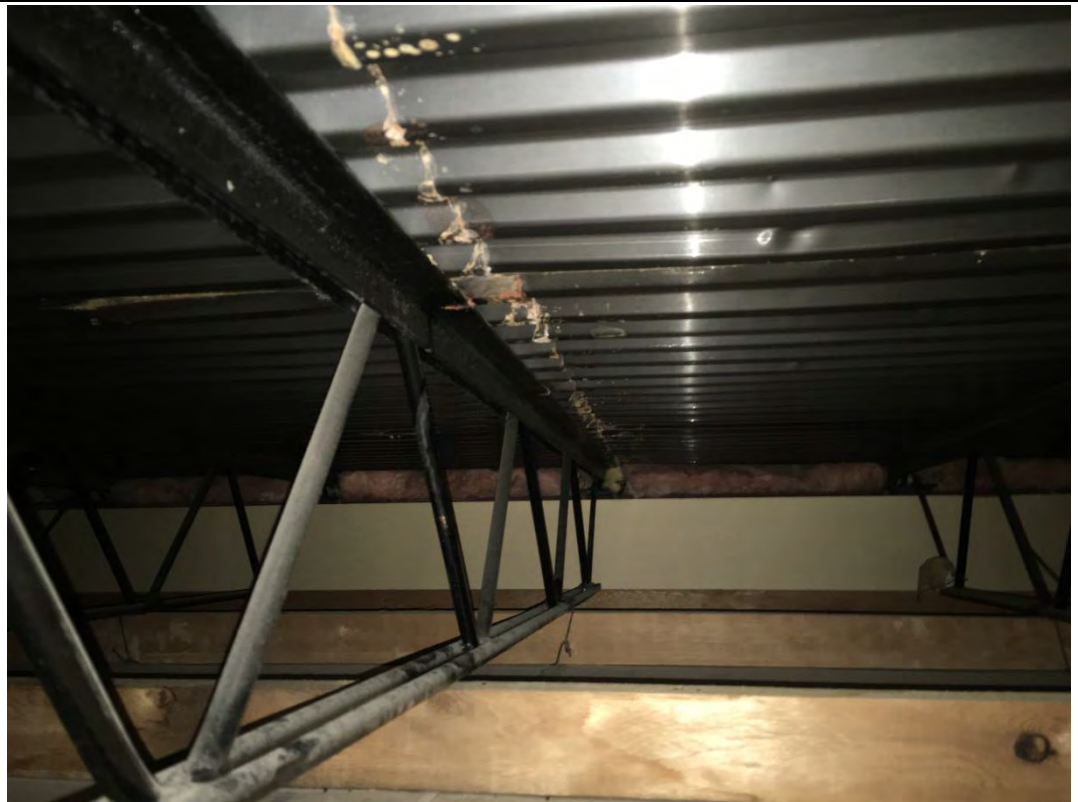


Photo No. 12	Date: 02/05/2018
Photo Coordinates	
Lat	41.127122
Long	-104.833489
Direction Photo Taken: 121.395973154362	
Description: Typical hotel room with ACM compounds on walls and ceilings.	



Project Name: Hitching Post Inn	Site Location: Cheyenne, WY	Project No. 0003-1711-13
---	---------------------------------------	------------------------------------

Photo No. 13	Date: 02/05/2018
Photo Coordinates	
Lat	41.127106
Long	-104.833467
Direction Photo Taken: 303.718023255814	
Description: Concrete subfloor below all carpeted areas with some mastic present.	



Photo No. 14	Date: 02/06/2018
Photo Coordinates	
Lat	41.126586
Long	-104.831031
Direction Photo Taken: 27.8124076809453	
Description: Looking down the hallway of Building #4. All walls and ceilings have ACM drywall compounds present.	



Project Name: Hitching Post Inn	Site Location: Cheyenne, WY	Project No. 0003-1711-13
---	---------------------------------------	------------------------------------

Photo No. 15	Date: 02/06/2018
Photo Coordinates	
Lat	41.128617
Long	-104.831764
Direction Photo Taken: 28.6707152496626	
Description: No suspect materials were observed in the attics of the buildings.	



Photo No. 16	Date: 02/06/2018
Photo Coordinates	
Lat	41.125981
Long	-104.833825
Direction Photo Taken: 267.182795698925	
Description: Mudded fittings in the boiler room are not ACM.	



Project Name: Hitching Post Inn	Site Location: Cheyenne, WY	Project No. 0003-1711-13
---	---------------------------------------	------------------------------------

Photo No. 17	Date: 02/07/2018
Photo Coordinates	
Lat	41.1286
Long	-104.831781
Direction Photo Taken: 29.985200845666	
Description: No vermiculite was observed inside cinder blocks.	



Photo No. 18	Date: 02/07/2018
Photo Coordinates	
Lat	41.126014
Long	-104.833892
Direction Photo Taken: 89.1565495207668	
Description: Damaged conditions present in Building #5. All walls and popcorn ceilings have ACM compounds.	



APPENDIX B
LABORATORY REPORTS



February 22, 2018

Subcontract Number: NA
Laboratory Report: RES 400635-2R
Project # / P.O. # 20408.016.003.0555.02
Project Description: Hitching Post

Elliott Petri
Weston Solutions, Inc. (CO)
1435 Garrison St. Ste. 100
Lakewood CO 80215

Dear Customer,

Reservoirs Environmental, Inc. is an analytical laboratory accredited for the analysis of Industrial Hygiene and Environmental matrices by the National Voluntary Laboratory Accreditation Program (NVLAP), Lab Code 101896-0 for Transmission Electron Microscopy (TEM) and Polarized Light Microscopy (PLM) analysis and the American Industrial Hygiene Association (AIHA), Lab ID 101533 - Accreditation Certificate #480 for Phase Contrast Microscopy (PCM) analysis. This laboratory is currently proficient in both Proficiency Testing and PAT programs respectively.

Reservoirs Environmental, Inc. has analyzed the following samples for asbestos content as per your request. The analysis has been completed in general accordance with the appropriate methodology as stated in the attached analysis table. The results have been submitted to your office.

RES 400635-2R is the job number assigned to this study. This report is considered highly confidential and the sole property of the customer. Reservoirs Environmental, Inc. will not discuss any part of this study with personnel other than those of the client. The results described in this report only apply to the samples analyzed. This report must not be used to claim endorsement of products or analytical results by NVLAP or any agency of the U.S. Government. This report shall not be reproduced except in full, without written approval from Reservoirs Environmental, Inc. Samples will be disposed of after sixty days unless longer storage is requested. If you have any questions about this report, please feel free to call 303-964-1986.

Sincerely,

A handwritten signature in blue ink, appearing to read "Elizabeth Martel", is written over a light blue horizontal line. Below the signature, the name "Elizabeth Martel for" is printed in a small, light blue font.

Jeanne Spencer
President

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-1-DW01-001	EM 2021720	A	Off white paint w/ off white resinous material	2	Chrysotile	ND	0	100
		B	Tan/white paint w/ white texture	5		ND	0	100
		C	Off white compound	5		4	0	96
		D	Off white/tan drywall	88		ND	35	65
HP3-1-DW01-002	EM 2021721	A	Off white paint w/ off white resinous material	3	Chrysotile	ND	0	100
		B	Tan/white paint w/ white texture	5		ND	0	100
		C	Off white compound	5		3	0	97
		D	Off white/tan drywall	87		ND	40	60
HP3-1-DW01-003	EM 2021722	A	Off white paint w/ off white resinous material	2	Chrysotile	ND	0	100
		B	Tan/white paint w/ white texture	4		ND	0	100
		C	Off white compound	5		4	0	96
		D	Off white/tan drywall	89		ND	25	75

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-1-DW01-004	EM 2021723	A	Off white paint w/ off white resinous material	3		ND	0	100
		B	Tan/white paint w/ white texture	8		ND	0	100
		C	Off white compound	8	Chrysotile	3	0	97
		D	Off white tape	10		ND	95	5
		E	Off white joint compound	11	Chrysotile	4	0	96
		F	Tan/off white drywall	60		ND	55	45
HP3-1-DW01-005	EM 2021724	A	Off white paint w/ off white resinous material	3		ND	0	100
		B	Off white compound	5	Chrysotile	3	0	97
		C	Off white joint compound	5	Chrysotile	3	0	97
		D	Tan/white paint w/ white texture	7		ND	0	100
		E	Off white tape	10		ND	95	5
		F	Off white/tan drywall	70		ND	30	70

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-1-DW02-006	EM 2021725	A	White texture w/ cream paint	5		ND	0	100
		B	White joint compound	5		ND	0	100
		C	White tape	20		ND	95	5
		D	Gray/tan drywall	70		ND	40	60
HP3-1-DW02-007	EM 2021726	A	White texture w/ cream paint	6		ND	0	100
		B	Gray/tan drywall	94		ND	20	80
HP3-1-DW02-008	EM 2021727	A	White texture w/ tan paint	8		ND	0	100
		B	Gray/tan drywall	92		ND	20	80
HP3-1-DW02-009	EM 2021728	A	White texture w/ cream paint	8		ND	0	100
		B	Gray/tan drywall	92		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-1-DW02-010	EM 2021729	A	Off white paint w/ off white resinous material	2	Chrysotile	ND	0	100
		B	Off white compound	3		2	0	98
		C	White texture w/ cream paint	4		ND	0	100
		D	Off white/tan drywall	91		ND	40	60
HP3-1-DW02-011	EM 2021730	A	White texture w/ cream paint	18		ND	0	100
		B	Gray/tan drywall	82		ND	15	85
HP3-1-DW02-012	EM 2021731	A	White joint compound	5		ND	0	100
		B	White paint w/ white compound	5		ND	0	100
		C	White texture w/ cream paint	15		ND	0	100
		D	Off white tape	30		ND	95	5
		E	Off white/tan drywall	45		ND	35	65

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-1-DW02-013	EM 2021732	A	Off white paint	3		ND	0	100
		B	Cream/white paint w/ white texture	5		ND	0	100
		C	Off white joint compound	7	Chrysotile	3	0	97
		D	Off white compound	10	Chrysotile	4	0	96
		E	Off white tape	30		ND	95	5
		F	Off white/tan drywall	45		ND	35	65
HP3-1-DW02-014	EM 2021733	A	Off white paint	2		ND	0	100
		B	Cream/white paint w/ white texture	3		ND	0	100
		C	Off white compound	5	Chrysotile	4	0	96
		D	Off white joint compound	5	Chrysotile	2	0	98
		E	Off white tape	15		ND	95	5
		F	Off white/tan drywall	70		ND	35	65

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-1-CD01-015	EM 2021734	A	Off white paint	2	Chrysotile	ND	0	100
		B	Off white compound	2		3	0	97
		C	White joint compound	2		ND	0	100
		D	White texture w/ white paint	3		ND	0	100
		E	Off white tape	5		ND	95	5
		F	Off white/tan drywall	43		ND	15	85
		G	Gray/tan drywall	43		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-1-CD01-016	EM 2021735	A	Off white paint	2	Chrysotile	ND	0	100
		B	Off white compound	2		3	0	97
		C	White texture w/ white paint	2		ND	0	100
		D	Off white tape	5		ND	95	5
		E	White joint compound	10		ND	0	100
		F	Gray/tan drywall	39		ND	20	80
		G	Off white/tan drywall	40		ND	15	85
HP3-1-CD01-017	EM 2021736	A	Off white paint	2	Chrysotile	ND	0	100
		B	Off white compound	2		3	0	97
		C	White texture w/ white paint	4		ND	0	100
		D	Off white/tan drywall	46		ND	15	85
		E	Gray/tan drywall	46		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-1-DW03-018	EM 2021737	A	White joint compound	10		ND	0	100
		B	White compound	20		ND	0	100
		C	Off white tape	35		ND	95	5
		D	Off white/tan drywall	35		ND	5	95
HP3-1-DW03-019	EM 2021738	A	White compound	5		ND	0	100
		B	White joint compound	15		ND	0	100
		C	Off white tape	30		ND	95	5
		D	Gray/tan drywall	50		ND	20	80
HP3-1-DW03-020	EM 2021739	A	White compound	2		ND	0	100
		B	Off white tape	15		ND	95	5
		C	White joint compound	23		ND	0	100
		D	Tan/off white drywall	60		ND	55	45

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-1-DW03-021	EM 2021740	A	Off white compound	1	Chrysotile	3	0	97
					Point Count	1.00		
		B	White compound	1		ND	0	100
		C	White joint compound	8		ND	0	100
		D	Off white tape	30		ND	95	5
HP3-1-CP01-022	EM 2021741	E	Tan/off white drywall	60		ND	60	40
		A	Tan adhesive	1		ND	0	100
		B	Tan adhesive	1		ND	0	100
		C	White leveling compound	1		ND	0	100
		D	Brown/multi-colored carpet	47		ND	85	15
HP3-1-ST01-023	EM 2021742	E	Gray foam	50		ND	5	95
HP3-1-ST01-024	EM 2021743	A	Brown/multi-colored stucco	100		ND	8	92

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-1-ST01-025	EM 2021744	A	Brown/multi-colored stucco	100		ND	9	91
HP3-1-CP02-026	EM 2021745	A	Tan/multi-colored carpet	40		ND	85	15
		B	Pink/multi-colored foam	60		ND	0	100
HP3-1-CD02-027	EM 2021746	A	Off white paint	15		ND	0	100
		B	Off white joint compound	25	Chrysotile	2	0	98
		C	Off white compound	30	Chrysotile	4	0	96
		D	Off white tape	30		ND	95	5
HP3-1-CD02-028	EM 2021747	A	Off white compound	3	Chrysotile	3	0	97
		B	Off white paint	7		ND	0	100
		C	Off white/tan drywall	90		ND	40	60

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-1-CD02-029	EM 2021748	A	Tan drywall paper	5		ND	95	5
		B	Off white tape	10		ND	95	5
		C	Off white paint	15		ND	0	100
		D	Off white joint compound	30	Chrysotile	3	0	97
		E	Off white compound	40	Chrysotile	3	0	97
HP3-2-DW01-030	EM 2021749	A	White joint compound	15		ND	0	100
		B	White texture w/ tan/white paint	20		ND	0	100
		C	Off white tape	25		ND	95	5
		D	Gray/tan drywall	40		ND	45	55
HP3-2-DW01-031	EM 2021750	A	Off white paint w/ off white resinous material	3		ND	0	100
		B	Off white compound	5	Chrysotile	4	0	96
		C	Tan/white paint w/ white texture	7		ND	0	100
		D	Off white/tan drywall	85		ND	40	60

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-2-DW01-032	EM 2021751	A	Off white paint w/ off white resinous material	2		ND	0	100
		B	Tan paint w/ white texture	5		ND	0	100
		C	Off white joint compound	5	Chrysotile	3	0	97
		D	Off white tape	23		ND	95	5
		E	Off white compound	25	Chrysotile	4	0	96
		F	Off white/tan drywall	40		ND	50	50
HP3-2-DW01-033	EM 2021752	A	Off white paint w/ off white resinous material	3		ND	0	100
		B	Tan/white paint w/ white texture	5		ND	0	100
		C	Off white joint compound	5	Chrysotile	2	0	98
		D	Off white tape	10		ND	95	5
		E	Off white compound	20	Chrysotile	4	0	96
		F	Off white/tan drywall	57		ND	30	70

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-2-DW01-034	EM 2021753	A	Off white paint w/ off white resinous material	2	Chrysotile	ND	0	100
		B	Tan/white paint w/ white texture	3		ND	0	100
		C	Off white compound	15		3	0	97
		D	Off white/tan drywall	80		ND	25	75
HP3-2-WP01-035	EM 2021754	A	Off white paint	2	Chrysotile	ND	0	100
		B	Off white joint compound	15		2	0	98
		C	Off white tape	15		ND	95	5
		D	Off white compound	20	Chrysotile	3	0	97
		E	Tan/off white drywall	20		ND	55	45
		F	Tan/off white wall covering	28		ND	30	70

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-2-WP01-036	EM 2021755	A	Tan/off white paint	2	Chrysotile	ND	0	100
		B	Off white compound	20		3	0	97
		C	Off white/tan drywall	28		ND	50	50
		D	Tan/off white wall covering	50		ND	30	70
HP3-2-WP01-037	EM 2021756	A	Tan/off white paint	3	Chrysotile	ND	0	100
		B	Off white joint compound	5		2	0	98
		C	Off white tape	10		ND	95	5
		D	Off white compound	12	Chrysotile	3	0	97
		E	Tan/off white wall covering	35		ND	30	70
		F	Off white/tan drywall	35		ND	25	75

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-2-WP01-038	EM 2021757	A	Off white/tan paint	2	Chrysotile	ND	0	100
		B	Off white compound	2		3	0	97
		C	White joint compound	10		ND	0	100
		D	White compound w/ off white/tan paint	15		ND	0	100
		E	White tape	20		ND	95	5
		F	Tan/off white wall covering	25		ND	30	70
		G	Off white/tan drywall	26		ND	40	60
HP3-2-WP01-039	EM 2021758	A	Off white paint	2	Chrysotile	ND	0	100
		B	Off white compound	10		3	0	97
		C	Tan/off white wall covering	38		ND	30	70
		D	Off white/tan drywall	50		ND	50	50
HP3-2-WP01-040	EM 2021759	A	Tan/off white wall covering	30		ND	30	70
		B	Off white/tan drywall w/ off white paint	70		ND	40	60

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-2-WP01-041	EM 2021760	A	Tan/off white paint	2		ND	0	100
		B	Off white joint compound	3	Chrysotile	2	0	98
		C	Off white compound	5	Chrysotile	4	0	96
		D	Off white tape	10		ND	95	5
		E	Tan/off white wall covering	40		ND	30	70
		F	Off white/tan drywall w/ tan fibrous material	40		ND	30	70
HP3-2-WP01-042	EM 2021761	A	Tan/off white paint	3		ND	0	100
		B	Off white joint compound	3	Chrysotile	2	0	98
		C	Off white compound	5	Chrysotile	4	0	96
		D	Off white tape	5		ND	95	5
		E	Tan/off white wall covering	34		ND	30	70
		F	Off white/tan drywall w/ tan fibrous material	50		ND	40	60

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-2-CD01-043	EM 2021762	A	Off white paint	2	Chrysotile	ND	0	100
		B	Off white compound	2		2	0	98
		C	White texture w/ white paint	4		ND	0	100
		D	White/tan drywall	46		ND	15	85
		E	Off white/tan drywall	46		ND	15	85
HP3-2-CD01-044	EM 2021763	A	Off white compound	2	Chrysotile	2	0	98
		B	Off white paint	2		ND	0	100
		C	White texture w/ white paint	2		ND	0	100
		D	Off white tape	5		ND	95	5
		E	White joint compound	20		ND	0	100
		F	Off white/tan drywall	24		ND	30	70
		G	Off white/tan drywall	45		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-2-CD01-045	EM 2021764	A	Off white paint	2	Chrysotile	ND	0	100
		B	Off white compound	2		4	0	96
		C	White texture w/ white paint	4		ND	0	100
		D	White/tan drywall	46		ND	15	85
		E	White/tan drywall	46		ND	15	85
HP3-2-CD01-046	EM 2021765	A	Off white paint	1	Chrysotile	ND	0	100
		B	Off white compound	2		3	0	97
		C	White texture w/ white paint	3		ND	0	100
		D	Off white tape	7		ND	95	5
		E	White joint compound	9		ND	0	100
		F	Gray/multi-colored drywall	39		ND	18	82
		G	White/tan drywall	39		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-2-CD01-047	EM 2021766	A	White compound w/ white paint	2	Chrysotile	3	0	97
		B	White tape	2		ND	95	5
		C	White compound w/ white paint	3		ND	0	100
		D	White joint compound	3		ND	0	100
		E	Tan/white drywall	90		ND	8	92
HP3-2-CD02-048	EM 2021767	A	White compound	2		ND	0	100
		B	White tape	5		ND	95	5
		C	Off white joint compound	8	Chrysotile	4	0	96
		D	Off white compound w/ cream paint	15	Chrysotile	3	0	97
		E	Tan/white drywall	70		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-2-CD02-049	EM 2021768	A	White compound	3		ND	0	100
		B	White tape	12		ND	95	5
		C	White joint compound	17	Chrysotile	4	0	96
		D	Off white compound w/ off white paint	23	Chrysotile	5	0	95
		E	Tan/white drywall	45		ND	25	75
HP3-2-CD02-050	EM 2021769	A	White tape	5		ND	95	5
		B	White joint compound	8	Chrysotile	4	0	96
		C	White compound w/ white paint	22	Chrysotile	3	0	97
		D	Tan/white drywall	65		ND	12	88
HP3-2-CD02-051	EM 2021770	A	White compound w/ white paint	10	Chrysotile	3	0	97
		B	White tape	10		ND	95	5
		C	White joint compound	10	Chrysotile	3	0	97
		D	Tan/white drywall	70		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-2-CD02-052	EM 2021771	A	White tape	4		ND	95	5
		B	White joint compound	6	Chrysotile	4	0	96
		C	White compound w/ white paint	10	Chrysotile	4	0	96
		D	Tan/white drywall	80		ND	8	92
HP3-2-CD02-053	EM 2021772	A	White tape	10		ND	95	5
		B	White joint compound	10	Chrysotile	4	0	96
		C	White compound w/ white paint	20	Chrysotile	3	0	97
		D	Tan/white drywall	60		ND	15	85
HP3-2-CD02-054	EM 2021773	A	White paint w/ white compound	5	Chrysotile	TR	0	100
		B	Tan/white drywall	95		ND	20	80
HP3-2-CD03-055	EM 2021774	A	White tape	5		ND	95	5
		B	White joint compound	5	Chrysotile	4	0	96
		C	White compound w/ white paint	25	Chrysotile	4	0	96
		D	Tan/white drywall	65		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP3-2-CD03-056	EM 2021775	A	White tape	10		ND	95	5
		B	White compound w/ white paint	25	Chrysotile	3	0	97
		C	White joint compound	25	Chrysotile	3	0	97
		D	Tan/white drywall	40		ND	15	85
HP3-2-CD03-057	EM 2021776	A	White tape	10		ND	95	5
		B	White joint compound	20	Chrysotile	3	0	97
		C	White compound w/ white paint	30	Chrysotile	2	0	98
		D	Tan/white drywall	40		ND	20	80
HP3-2-CP01-058	EM 2021777	A	Green/colorless adhesive	3		ND	0	100
		B	Green/multi-colored carpet w/ tan foam	97		ND	55	45
HP3-2-CP02-059	EM 2021778	A	Yellow adhesive	1		ND	0	100
		B	Green/multi-colored carpet	30		ND	80	20
		C	Pink/multi-colored foam	69		ND	0	100
HP4-1-EP01-060	EM 2021779	A	Brown/white fiberboard	100		ND	60	40

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-DW01-061	EM 2021780	A	White texture w/ tan paint & tan adhesive	2		ND	0	100
		B	Tan paint w/ white compound	2	Chrysotile	2	0	98
		C	White compound	4	Chrysotile	4	0	96
		D	Tan/white drywall	92		ND	8	92
HP4-1-DW01-062	EM 2021781	A	White paint w/ white compound	TR	Chrysotile	TR	0	100
		B	White texture w/ tan paint & tan adhesive	2		ND	0	100
		C	White compound	3	Chrysotile	3	0	97
		D	Tan/white drywall	95		ND	10	90
HP4-1-DW01-063	EM 2021782	A	White paint w/ white compound	TR	Chrysotile	TR	0	100
		B	White texture w/ tan paint & tan adhesive	2		ND	0	100
		C	White compound	2	Chrysotile	3	0	97
		D	Tan/white drywall	96		ND	8	92

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-DW01-064	EM 2021783	A	Tan paint w/ white compound	TR	Chrysotile	2	0	98
		B	White texture w/ tan paint & tan adhesive	3		ND	0	100
		C	White compound	3	Chrysotile	3	0	97
		D	Tan/white drywall	94		ND	8	92
HP4-1-DW01-065	EM 2021784	A	White tape	3		ND	95	5
		B	White texture w/ red/yellow paint & tan adhesive	5		ND	0	100
		C	White compound w/ white paint	5	Chrysotile	2	0	98
		D	White joint compound	7	Chrysotile	3	0	97
		E	Tan/white drywall	80		ND	7	93

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-DW01-066	EM 2021785	A	White texture w/ gold/white paint	3		ND	0	100
		B	White tape	3		ND	95	5
		C	White compound w/ pink paint	7	Chrysotile	3	0	97
		D	Pink joint compound	7	Chrysotile	2	0	98
		E	Tan/white drywall	80		ND	8	92
HP4-1-DW01-067	EM 2021786	A	White tape	3		ND	95	5
		B	White texture w/ cream paint	4		ND	0	100
		C	White joint compound	5		ND	0	100
		D	Tan/white drywall	88		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-DW01-068	EM 2021787	A	White tape	1		ND	95	5
		B	Tan paint w/ white compound	1	Chrysotile	2	0	98
		C	White texture w/ cream paint	2		ND	0	100
		D	White joint compound	2		ND	0	100
		E	White compound	2	Chrysotile	3	0	97
		F	Tan/white drywall	92		ND	8	92
HP4-1-DW01-069	EM 2021788	A	White texture w/ cream/multi-colored paint	5		ND	0	100
		B	White compound	5	Chrysotile	3	0	97
		C	Tan/pink drywall	90		ND	8	92

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-DW01-070	EM 2021789	A	White tape	10		ND	95	5
		B	White texture w/ cream paint	15		ND	0	100
		C	White compound w/ white paint	15	Chrysotile	3	0	97
		D	White joint compound	15	Chrysotile	3	0	97
		E	Tan/white drywall	45		ND	30	70
HP4-1-FT01-071	EM 2021790	A	Brown mastic	2		ND	0	100
		B	Tan/brown tile	98		ND	0	100
HP4-1-CD01-072	EM 2021791	A	White texture w/ white paint	2		ND	0	100
		B	White joint compound	2		ND	0	100
		C	White tape	3		ND	95	5
		D	White compound w/ cream paint	3	Chrysotile	2	0	98
		E	White/off white joint compound	3	Chrysotile	3	0	97
		F	Tan/white drywall	87		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-CD01-073	EM 2021792	A	White paint w/ white compound	2		ND	0	100
		B	White tape	3		ND	95	5
		C	White compound w/ white paint	3		ND	0	100
		D	White joint compound	3		ND	0	100
		E	White compound w/ white paint	5	Chrysotile	2	0	98
		F	Tan/white drywall	84		ND	8	92
HP4-1-CD01-074	EM 2021793	A	White paint w/ white compound	1	Chrysotile	2	0	98
		B	White texture w/ white paint	2		ND	0	100
		C	Tan/white drywall	97		ND	8	92
HP4-1-CD01-075	EM 2021794	A	White texture w/ white paint	2		ND	0	100
		B	White paint w/ white compound	2	Chrysotile	TR	0	100
		C	Tan/pink drywall	48		ND	8	92
		D	Tan/white drywall	48		ND	8	92

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-CD01-076	EM 2021795	A	White texture w/ white paint	3		ND	0	100
		B	White compound	3		ND	0	100
		C	Tan/white drywall	94		ND	8	92
HP4-1-CD02-077	EM 2021796	A	White paint w/ white compound	2		ND	0	100
		B	White compound w/ white paint	15	Chrysotile	2	0	98
		C	Tan/white drywall	83		ND	10	90
HP4-1-CD02-078	EM 2021797	A	White tape	3		ND	95	5
		B	White compound w/ white paint	5	Chrysotile	2	0	98
		C	Pink joint compound	5	Chrysotile	2	0	98
		D	White joint compound	7	Chrysotile	3	0	97
		E	Tan/white drywall	80		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-CD02-079	EM 2021798	A	White paint w/ white compound	3		ND	0	100
		B	White tape	4		ND	95	5
		C	Pink joint compound	5	Chrysotile	2	0	98
		D	White joint compound	8	Chrysotile	3	0	97
		E	White compound w/ white paint	10	Chrysotile	TR	0	100
		F	Tan/white drywall	70		ND	12	88
HP4-1-CD02-080	EM 2021799	A	White paint w/ white compound	10		ND	0	100
		B	White tape	10		ND	95	5
		C	White compound w/ white paint	15	Chrysotile	TR	0	100
		D	White joint compound	17	Chrysotile	3	0	97
		E	Pink joint compound	20	Chrysotile	2	0	98
		F	Tan/white drywall	28		ND	25	75

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-CD02-081	EM 2021800	A	White paint w/ white compound	5		ND	0	100
		B	White compound w/ white paint	20	Chrysotile	2	0	98
		C	Tan/white drywall	75		ND	10	90
HP4-1-CD02-082	EM 2021801	A	White joint compound	10	Chrysotile	2	0	98
		B	Off white joint compound	10	Chrysotile	2	0	98
		C	White tape	15		ND	95	5
		D	Tan/white drywall	15		ND	50	50
		E	White compound w/ white paint	20		ND	0	100
		F	White compound w/ white paint	30		ND	0	100

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-CD02-083	EM 2021802	A	White joint compound	10	Chrysotile	2	0	98
		B	Pink joint compound	10	Chrysotile	2	0	98
		C	White compound w/ white paint	12		ND	0	100
		D	White tape	15		ND	95	5
		E	White compound w/ white paint	23	Chrysotile	TR	0	100
		F	Tan/white drywall	30		ND	35	65
HP4-1-CD02-084	EM 2021803	A	White compound w/ white paint	5		ND	0	100
		B	White tape	7		ND	95	5
		C	White joint compound	10	Chrysotile	3	0	97
		D	Pink joint compound	13	Chrysotile	2	0	98
		E	White compound w/ white paint	20	Chrysotile	TR	0	100
		F	Tan/white drywall	45		ND	12	88

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-CD03-085	EM 2021804	A	White paint w/ white compound	5	Chrysotile	2	0	98
		B	White tape	8		ND	95	5
		C	White joint compound	30	Chrysotile	4	0	96
		D	Tan/white drywall	57		ND	10	90
HP4-1-CD03-086	EM 2021805	A	White tape	8		ND	95	5
		B	White compound w/ white paint	15	Chrysotile	2	0	98
		C	Pink joint compound	17	Chrysotile	2	0	98
		D	Tan/white drywall	60		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-CD03-087	EM 2021806	A	White compound w/ white paint	4	Chrysotile	TR	0	100
		B	White tape	5		ND	95	5
		C	White joint compound	5	Chrysotile	3	0	97
		D	Pink compound	10	Chrysotile	2	0	98
		E	Pink joint compound	16	Chrysotile	2	0	98
		F	Tan/white drywall	60		ND	12	88
HP4-1-CD03-088	EM 2021807	A	White compound w/ white paint	8	Chrysotile	TR	0	100
		B	White tape	10		ND	95	5
		C	Pink joint compound	22	Chrysotile	2	0	98
		D	Tan/white drywall	60		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-CD03-089	EM 2021808	A	White tape	5		ND	95	5
		B	Pink compound	8	Chrysotile	2	0	98
		C	White compound w/ white paint	10	Chrysotile	TR	0	100
		D	White joint compound	12	Chrysotile	3	0	97
		E	Tan/white drywall	65		ND	10	90
HP4-1-CP01-090	EM 2021809	A	Tan adhesive	2		ND	0	100
		B	White leveling compound	2		ND	0	100
		C	Blue adhesive	4		ND	0	100
		D	Tan carpet	40		ND	85	15
		E	Gray/multi-colored fibrous material	52		ND	85	15

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-1-CP02-091	EM 2021810	A	Tan adhesive	TR		ND	0	100
		B	White leveling compound	1		ND	0	100
		C	Blue adhesive	2		ND	0	100
		D	Black/tan carpet	48		ND	85	15
		E	Pink/multi-colored foam	49		ND	0	100
HP4-1-DW02-092	EM 2021811	A	White texture w/ white paint	8		ND	0	100
		B	Gray/tan drywall	92		ND	30	70
HP4-1-DW02-093	EM 2021812	A	White texture w/ white paint	5		ND	0	100
		B	Gray/tan drywall	95		ND	20	80
HP4-1-DW02-094	EM 2021813	A	White texture w/ white paint	12		ND	0	100
		B	Gray/tan drywall	88		ND	30	70

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-2-CD01-095	EM 2021814	A	Off white paint	3		ND	0	100
		B	White compound	5	Chrysotile	2	0	98
		C	White joint compound	10	Chrysotile	2	0	98
		D	Off white tape	17		ND	95	5
		E	Off white/tan drywall	65		ND	40	60
HP4-2-CD01-096	EM 2021815	A	Off white paint	4		ND	0	100
		B	White joint compound	5	Chrysotile	2	0	98
		C	Off white tape	5		ND	95	5
		D	White compound	6	Chrysotile	2	0	98
		E	Off white/tan drywall	80		ND	50	50

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-2-CD01-097	EM 2021816	A	Off white paint	3		ND	0	100
		B	Off white compound	4	Chrysotile	2	0	98
		C	Off white joint compound	4	Chrysotile	2	0	98
		D	Off white tape	9		ND	95	5
		E	Tan/off white drywall	80		ND	60	40
HP4-2-CD01-098	EM 2021817	A	Off white compound	2	Chrysotile	2	0	98
		B	Off white paint	3		ND	0	100
		C	Off white/tan drywall	95		ND	50	50
HP4-2-CD01-099	EM 2021818	A	Off white paint	2		ND	0	100
		B	Off white compound	3	Chrysotile	2	0	98
		C	Off white/tan drywall	95		ND	25	75

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-2-CD01-100	EM 2021819	A	Off white paint	4		ND	0	100
		B	Pink joint compound	6	Chrysotile	2	0	98
		C	Off white compound	15	Chrysotile	2	0	98
		D	Off white tape	15		ND	95	5
		E	Tan/off white drywall	60		ND	55	45
HP4-2-CD01-101	EM 2021820	A	Off white paint	2		ND	0	100
		B	Off white compound	3	Chrysotile	2	0	98
		C	Off white/tan drywall	95		ND	30	70
HP4-2-CD02-102	EM 2021821	A	Off white compound	1	Chrysotile	3	0	97
		B	White paint	6		ND	0	100
		C	Tan/off white drywall	93		ND	65	35

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-2-CD02-103	EM 2021822	A	White paint	5		ND	0	100
		B	Off white compound	5	Chrysotile	2	0	98
		C	Tan/off white drywall	90		ND	60	40
HP4-2-CD02-104	EM 2021823	A	Off white compound	1	Chrysotile	2	0	98
		B	White paint	2		ND	0	100
		C	Off white/tan drywall	97		ND	18	82
HP4-2-CD02-105	EM 2021824	A	Off white compound	2	Chrysotile	2	0	98
		B	White paint	3		ND	0	100
		C	Pink compound	15	Chrysotile	2	0	98
		D	Pink joint compound	15	Chrysotile	2	0	98
		E	Off white tape	15		ND	95	5
		F	Tan/off white drywall	50		ND	60	40

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-2-CD02-106	EM 2021825	A	White paint	5	Chrysotile	ND	0	100
		B	Off white compound	5		2	0	98
		C	Off white/tan drywall	90		ND	45	55
HP4-2-CD02-107	EM 2021826	A	Off white compound	3	Chrysotile	2	0	98
		B	White paint	4		ND	0	100
		C	Tan/off white drywall	93		ND	55	45
HP4-2-CP02-108	EM 2021827	A	White leveling compound	TR		ND	0	100
		B	Off white adhesive	2		ND	0	100
		C	Yellow foam w/ off white fibrous woven material	48		ND	5	95
		D	Red/multi-colored carpet	50		ND	80	20
HP4-2-CP02-109	EM 2021828	A	Tan adhesive	TR		ND	0	100
		B	Green/multi-colored carpet	45		ND	85	15
		C	Gray/multi-colored fibrous material	55		ND	85	15

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP-BW-PC01-110	EM 2021829	A	White paint	1		ND	0	100
		B	Off white paint	3		ND	0	100
		C	Off white compound	3	Chrysotile	3	0	97
		D	Off white joint compound	4	Chrysotile	2	0	98
		E	White micaceous texture	5	Chrysotile	5	0	95
		F	Off white tape	19		ND	95	5
		G	Off white/tan drywall	65		ND	20	80
HP-BW-PC01-111	EM 2021830	A	White paint	1		ND	0	100
		B	Off white paint	2		ND	0	100
		C	White micaceous texture	7	Chrysotile	6	0	94
		D	Off white compound	10	Chrysotile	2	0	98
		E	Off white joint compound	10	Chrysotile	2	0	98
		F	Off white tape	15		ND	95	5
		G	Off white/tan drywall	55		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP-BW-PC01-112	EM 2021831	A	White paint	1		ND	0	100
		B	Off white paint	3		ND	0	100
		C	Off white compound	5	Chrysotile	2	0	98
		D	Off white joint compound	5	Chrysotile	2	0	98
		E	White micaceous texture	8	Chrysotile	5	0	95
		F	Off white tape	10		ND	95	5
		G	Off white/tan drywall	68		ND	35	65
HP-BW-WP01-113	EM 2021832	A	Beige/multi-colored paint	2		ND	0	100
		B	Off white compound	5	Chrysotile	2	0	98
		C	Beige/multi-colored wall covering	43		ND	30	70
		D	Off white/tan drywall	50		ND	35	65

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP-BW-WP01-114	EM 2021833	A	Beige/multi-colored paint	2		ND	0	100
		B	Off white compound	5	Chrysotile	2	0	98
		C	Off white joint compound	5	Chrysotile	2	0	98
		D	Off white tape	6		ND	95	5
		E	Beige/multi-colored wall covering	30		ND	30	70
		F	Tan/off white drywall	52		ND	70	30
HP-BW-WP01-115	EM 2021834	A	Beige/multi-colored paint	3		ND	0	100
		B	Off white joint compound	5	Chrysotile	2	0	98
		C	Off white tape	10		ND	95	5
		D	Off white compound	12	Chrysotile	2	0	98
		E	Beige/multi-colored wall covering	35		ND	30	70
		F	Tan/off white drywall	35		ND	85	15

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP-BW-WP01-116	EM 2021835	A	Beige/multi-colored paint	2		ND	0	100
		B	Off white compound	5	Chrysotile	2	0	98
		C	Off white joint compound	10	Chrysotile	2	0	98
		D	Off white tape	13		ND	95	5
		E	Beige/multi-colored wall covering	20		ND	30	70
		F	Tan/off white drywall	50		ND	55	45
HP-BW-WP01-117	EM 2021836	A	Beige/multi-colored paint	2		ND	0	100
		B	Off white compound	6	Chrysotile	2	0	98
		C	Beige/multi-colored wall covering	25		ND	30	70
		D	Off white/tan drywall	67		ND	35	65
HP5-1-PJ01-118	EM 2021837	A	Gray fibrous plaster w/ off white fibrous woven material	100		ND	20	80
HP5-1-PJ01-119	EM 2021838	A	Gray fibrous plaster w/ brown fibrous woven material	100		ND	22	78
HP5-1-PJ01-120	EM 2021839	A	Gray fibrous plaster w/ off white fibrous woven material	100		ND	22	78

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-1-PJ01-121	EM 2021840	A	Gray fibrous plaster w/ off white fibrous woven material	100		ND	20	80
HP4-2-CD03-122	EM 2021841	A	Off white compound	1	Chrysotile	2	0	98
		B	Off white paint	2		ND	0	100
		C	White paint w/ white texture	5		ND	0	100
		D	White joint compound	5		ND	0	100
		E	Off white tape	5		ND	95	5
		F	Gray/tan drywall	41		ND	20	80
		G	Off white/tan drywall	41		ND	15	85
HP4-2-CD03-123	EM 2021842	A	Off white compound	1	Chrysotile	2	0	98
		B	Off white paint	2		ND	0	100
		C	White paint w/ white texture	3		ND	0	100
		D	Gray/tan drywall	47		ND	15	85
		E	Off white/tan drywall	47		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-2-CD03-124	EM 2021843	A	Off white paint	2	Chrysotile	ND	0	100
		B	White paint w/ white texture	2		ND	0	100
		C	Off white compound	2		3	0	97
		D	Off white/tan drywall	47		ND	15	85
		E	Gray/tan drywall	47		ND	15	85
HP4-2-CD03-125	EM 2021844	A	Off white compound	1	Chrysotile	2	0	98
		B	Off white paint	2		ND	0	100
		C	White texture w/ white paint	3		ND	0	100
		D	Off white/tan drywall	47		ND	15	85
		E	Gray/tan drywall	47		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-2-CD03-126	EM 2021845	A	Off white paint	2		ND	0	100
		B	Off white compound	2	Chrysotile	2	0	98
		C	Off white joint compound	2	Chrysotile	3	0	97
		D	Off white tape	3		ND	95	5
		E	White texture w/ white paint	3		ND	0	100
		F	Off white/tan drywall	44		ND	20	80
		G	Gray/tan drywall	44		ND	15	85
HP4-2-DW01-127	EM 2021846	A	Off white compound	1	Chrysotile	2	0	98
		B	Off white paint w/ tan resinous material	2		ND	0	100
		C	Tan/white paint w/ white texture	3		ND	0	100
		D	Off white/tan drywall	47		ND	15	85
		E	Off white/tan drywall	47		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-2-DW01-128	EM 2021847	A	Off white paint w/ tan resinous material	2	Chrysotile	ND	0	100
		B	Off white compound	2		2	0	98
		C	Tan/white paint w/ white texture	4		ND	0	100
		D	Off white/tan drywall	40		ND	15	85
		E	Off white/tan drywall	52		ND	15	85
HP4-2-DW01-129	EM 2021848	A	Off white compound	1	Chrysotile	3	0	97
		B	Off white paint w/ tan resinous material	2		ND	0	100
		C	Tan/white paint w/ white texture	3		ND	0	100
		D	Off white/tan drywall	47		ND	15	85
		E	Off white/tan drywall	47		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-2-DW01-130	EM 2021849	A	Off white paint w/ tan resinous material	1		ND	0	100
		B	Off white compound	1	Chrysotile	2	0	98
		C	White compound	2	Chrysotile	2	0	98
		D	Tan/white paint w/ white texture	3		ND	0	100
		E	Off white/tan drywall	46		ND	15	85
		F	Off white/tan drywall	47		ND	15	85
HP4-2-DW01-131	EM 2021850	A	Off white compound	TR	Chrysotile	2	0	98
		B	Off white paint w/ tan resinous material	1		ND	0	100
		C	White texture w/ tan/white paint	3		ND	0	100
		D	Off white/tan drywall	48		ND	15	85
		E	Off white/tan drywall	48		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-2-WP01-132	EM 2021851	A	Off white joint compound	5	Chrysotile	2	0	98
		B	Beige/multi-colored wall paper w/ off white paint	10		ND	70	30
		C	Off white compound	10	Chrysotile	2	0	98
		D	Off white tape	20		ND	95	5
		E	Off white/tan drywall	55		ND	40	60
HP4-2-WP01-133	EM 2021852	A	Off white compound	1	Chrysotile	2	0	98
		B	Off white compound	2	Chrysotile	2	0	98
		C	Tan/off white wall covering w/ off white paint	8		ND	25	75
		D	Off white/tan drywall	44		ND	15	85
		E	Off white/tan drywall	45		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-2-WP01-134	EM 2021853	A	Off white compound	2	Chrysotile	2	0	98
		B	Tan/off white wall covering w/ off white paint	8		ND	25	75
		C	Off white/tan drywall	45		ND	20	80
		D	Off white/tan drywall	45		ND	15	85
HP4-2-WP01-135	EM 2021854	A	Off white compound	TR	Chrysotile	2	0	98
		B	Tan/off white wall covering w/ off white paint	6		ND	25	75
		C	Off white/tan drywall	94		ND	15	85
HP4-2-WP01-136	EM 2021855	A	Off white compound	TR	Chrysotile	2	0	98
		B	Tan/off white wall covering w/ off white paint	5		ND	25	75
		C	Off white/tan drywall	47		ND	12	88
		D	Off white/tan drywall	48		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-2-WP01-137	EM 2021856	A	Off white compound	2	Chrysotile	2	0	98
		B	Off white joint compound	3	Chrysotile	2	0	98
		C	Off white tape	10		ND	95	5
		D	Tan/off white wall covering w/ off white paint	35		ND	25	75
		E	Off white/tan drywall	50		ND	25	75
HP4-2-WP01-138	EM 2021857	A	Off white compound	TR	Chrysotile	2	0	98
		B	Tan/off white wall covering w/ off white paint	6		ND	25	75
		C	Off white/tan drywall	47		ND	15	85
		D	Off white/tan drywall	47		ND	15	85
HP5-1-CD01-139	EM 2021858	A	Off white compound	2	Chrysotile	2	0	98
		B	White paint	8		ND	0	100
		C	Tan/pink drywall	90		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-1-CD01-140	EM 2021859	A	White tape	5		ND	95	5
		B	White compound w/ white paint	7	Chrysotile	2	0	98
		C	White joint compound	8	Chrysotile	2	0	98
		D	White joint compound	10	Chrysotile	3	0	97
		E	Tan/pink drywall	70		ND	12	88
HP5-1-CD01-141	EM 2021860	A	White tape	5		ND	95	5
		B	White joint compound	5	Chrysotile	2	0	98
		C	White joint compound	10	Chrysotile	3	0	97
		D	White compound w/ white paint	25	Chrysotile	2	0	98
		E	Tan/white drywall	25		ND	15	85
		F	Tan/pink drywall	30		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-1-CD01-142	EM 2021861	A	White paint w/ white compound	2	Chrysotile	TR	0	100
		B	White compound w/ white paint	4		ND	0	100
		C	White tape	5		ND	95	5
		D	White joint compound	10	Chrysotile	3	0	97
		E	White compound w/ white paint	15	Chrysotile	3	0	97
		F	Tan/pink drywall	64		ND	10	90
HP5-1-CD01-143	EM 2021862	A	White tape	5		ND	95	5
		B	White joint compound	5	Chrysotile	4	0	96
		C	White compound w/ white paint	12	Chrysotile	2	0	98
		D	White/pink drywall	78		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-1-WP01-144	EM 2021863	A	White compound w/ white paint	2	Chrysotile	3	0	97
		B	White compound w/ white paint	5	Chrysotile	2	0	98
		C	Pink/green wall covering w/ yellow adhesive	5		ND	25	75
		D	Tan/pink drywall	88		ND	8	92
HP5-1-WP01-145	EM 2021864	A	Pink/green wall covering w/ yellow adhesive	10		ND	25	75
		B	White compound w/ white paint	25	Chrysotile	2	0	98
		C	Tan/pink drywall	65		ND	12	88
HP5-1-WP01-146	EM 2021865	A	White compound	2	Chrysotile	4	0	96
		B	White paint	8		ND	0	100
		C	Pink/green wall covering w/ yellow adhesive	20		ND	25	75
		D	Tan/pink drywall	70		ND	17	83

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-1-WP01-147	EM 2021866	A	White compound	4	Chrysotile	4	0	96
		B	White paint	6		ND	0	100
		C	Pink/green wall covering w/ yellow adhesive	10		ND	25	75
		D	Tan/pink drywall	80		ND	20	80
HP5-1-WP01-148	EM 2021867	A	Off white tape	3	Chrysotile	ND	95	5
		B	White tape	5		ND	95	5
		C	White compound	7		ND	0	100
		D	White joint compound	10		ND	0	100
		E	White joint compound	15		4	0	96
		F	Tan wall covering w/ colorless adhesive	25		ND	25	75
		G	Tan/pink drywall	35		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-1-WP01-149	EM 2021868	A	Tan wall covering w/ brown adhesive	5		ND	23	77
		B	White tape	8		ND	95	5
		C	Pink joint compound	10	Chrysotile	2	0	98
		D	White joint compound	12	Chrysotile	3	0	97
		E	White compound w/ white paint	20	Chrysotile	2	0	98
		F	Tan/pink drywall	45		ND	12	88
HP5-1-WP01-150	EM 2021869	A	Off white compound	2	Chrysotile	5	0	95
		B	White paint	5		ND	0	100
		C	White compound	13		ND	0	100
		D	Tan wall covering w/ yellow adhesive	20		ND	25	75
		E	Tan/pink drywall	60		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-1-WP01-151	EM 2021870	A	White compound	3		ND	0	100
		B	White tape	5		ND	95	5
		C	Tan wall covering w/ yellow/colorless adhesive	7		ND	22	78
		D	White compound w/ white paint	10	Chrysotile	2	0	98
		E	White joint compound	20	Chrysotile	3	0	97
		F	Tan/pink drywall	55		ND	12	88
HP5-1-WP01-152	EM 2021871	A	White tape	3		ND	95	5
		B	White compound w/ white paint	5		ND	0	100
		C	White compound w/ white paint	5	Chrysotile	2	0	98
		D	White joint compound	5	Chrysotile	3	0	97
		E	Tan wall covering w/ colorless adhesive	10		ND	25	75
		F	Tan/white drywall	72		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-1-WP01-153	EM 2021872	A	Tan wall covering w/ yellow adhesive	10		ND	25	75
		B	White compound w/ white paint	40	Chrysotile	2	0	98
		C	Tan/pink drywall	50		ND	15	85
HP5-1-PC01-154	EM 2021873	A	White compound	5	Chrysotile	2	0	98
		B	White perlitic texture w/ white paint	7	Chrysotile	4	0	96
		C	White compound w/ white paint	13	Chrysotile	2	0	98
		D	Pink/tan drywall	75		ND	13	87
HP5-1-PC01-155	EM 2021874	A	White joint compound	5	Chrysotile	2	0	98
		B	White tape	5		ND	95	5
		C	White perlitic texture w/ white paint	10	Chrysotile	4	0	96
		D	Pink/tan drywall	80		ND	12	88

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-1-PC01-156	EM 2021875	A	Pink joint compound	3	Chrysotile	2	0	98
		B	White tape	5		ND	95	5
		C	White perlitic texture w/ white paint	7	Chrysotile	4	0	96
		D	White compound	10	Chrysotile	2	0	98
		E	White joint compound	10	Chrysotile	2	0	98
		F	White/tan drywall	65		ND	17	83
HP5-1-PC01-157	EM 2021876	A	White perlitic texture w/ white paint	5	Chrysotile	4	0	96
		B	White tape	5		ND	95	5
		C	White joint compound	10	Chrysotile	3	0	97
		D	White compound	15	Chrysotile	2	0	98
		E	White/tan drywall	65		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-1-PC01-158	EM 2021877	A	White tape	5		ND	95	5
		B	White perlitic texture w/ white paint	10	Chrysotile	4	0	96
		C	White joint compound	10	Chrysotile	2	0	98
		D	White compound	25	Chrysotile	2	0	98
		E	White/tan drywall	50		ND	30	70
HP5-1-PC01-159	EM 2021878	A	White perlitic texture w/ white paint	5	Chrysotile	4	0	96
		B	White tape	5		ND	95	5
		C	White texture w/ white white paint	8	Chrysotile	4	0	96
		D	White joint compound	10	Chrysotile	2	0	98
		E	White compound	20	Chrysotile	2	0	98
		F	White/tan drywall	52		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-1-PC01-160	EM 2021879	A	White tape	3		ND	95	5
		B	White perlitic texture w/ white paint	5	Chrysotile	4	0	96
		C	White texture w/ white paint	7	Chrysotile	4	0	96
		D	White joint compound	10	Chrysotile	2	0	98
		E	White compound	20	Chrysotile	2	0	98
		F	White/tan drywall	55		ND	25	75
HP5-1-CP01-161	EM 2021880	A	White perlitic compound	TR	Chrysotile	3	0	97
		B	Yellow adhesive	5		ND	0	100
		C	Tan/multi-colored carpet w/ yellow foam	95		ND	0	100
HP5-1-CP02-162	EM 2021881	A	Yellow adhesive	2		ND	0	100
		B	Gray/multi-colored carpet	40		ND	95	5
		C	Green/multi-colored carpet	58		ND	85	15

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-2-WP01-163	EM 2021882	A	White tape	5		ND	95	5
		B	Pink/gray wall covering	7		ND	25	75
		C	White joint compound	8	Chrysotile	2	0	98
		D	White compound	20	Chrysotile	2	0	98
		E	Pink/tan drywall	60		ND	15	85
HP5-2-WP01-164	EM 2021883	A	White joint compound	3	Chrysotile	2	0	98
		B	White tape	3		ND	95	5
		C	Pink/gray wall covering	5		ND	25	75
		D	White compound	20	Chrysotile	2	0	98
		E	Pink/tan drywall	69		ND	13	87

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-2-WP01-165	EM 2021884	A	White tape	3		ND	95	5
		B	Pink/green wall covering w/ tan adhesive	7		ND	20	80
		C	White compound w/ white paint	10	Chrysotile	2	0	98
		D	White joint compound	10	Chrysotile	3	0	97
		E	Tan/pink drywall	70		ND	10	90
HP5-2-WP01-166	EM 2021885	A	White tape	5		ND	95	5
		B	White compound	6		ND	0	100
		C	Pink wall covering w/ colorless adhesive	7		ND	25	75
		D	White joint compound	8	Chrysotile	TR	0	100
		E	White compound w/ white paint	8	Chrysotile	2	0	98
		F	White joint compound	8		ND	0	100
		G	Tan/pink drywall	58		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-2-WP01-167	EM 2021886	A	Pink/green wall covering w/ yellow/colorless adhesive	10	Chrysotile	ND	25	75
		B	White compound w/ white paint	10		ND	0	100
		C	White compound w/ white paint	15		2	0	98
		D	Tan/pink drywall	65		ND	12	88
HP5-2-WP01-168	EM 2021887	A	Tan wall covering w/ colorless adhesive	5	Chrysotile	ND	25	75
		B	Brown/orange paint w/ white compound	5		ND	0	100
		C	White paint w/ white compound	5		2	0	98
		D	Tan/pink drywall	85		ND	15	85
HP5-2-WP01-169	EM 2021888	A	White compound w/ white paint	20	Chrysotile	3	0	97
		B	Pink wall covering w/ yellow adhesive	30		ND	20	80
		C	Tan/pink drywall	50		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-2-WP01-170	EM 2021889	A	Tan wall covering w/ yellow adhesive	20	Chrysotile	ND	20	80
		B	White compound w/ white paint	25		3	0	97
		C	Tan/pink drywall	55		ND	15	85
HP5-2-WP01-171	EM 2021890	A	White compound w/ white paint	2	Chrysotile	2	0	98
		B	White/off white tape	8		ND	95	5
		C	White compound	10		ND	0	100
		D	White joint compound	10		ND	0	100
		E	Tan wall covering w/ colorless adhesive	20		ND	25	75
		F	Tan/pink drywall	50		ND	15	85
HP5-2-WP01-172	EM 2021891	A	Tan wall covering w/ colorless adhesive	5	Chrysotile	ND	25	75
		B	White compound w/ white paint	20		2	0	98
		C	Tan/pink drywall	75		ND	12	88

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-2-PC01-173	EM 2021892	A	White perlitic texture w/ white paint	3	Chrysotile	6	0	94
		B	White tape	3		ND	95	5
		C	White compound w/ white paint	5	Chrysotile	2	0	98
		D	White joint compound	5	Chrysotile	4	0	96
		E	Tan/pink drywall	84		ND	10	90
HP5-2-PC01-174	EM 2021893	A	White perlitic texture w/ white paint	3	Chrysotile	6	0	94
		B	White compound w/ white paint	27	Chrysotile	2	0	98
		C	Tan/pink drywall	70		ND	12	88
HP5-2-PC01-175	EM 2021894	A	White compound w/ white paint	1	Chrysotile	2	0	98
		B	White tape	2		ND	95	5
		C	White perlitic texture w/ white paint	3	Chrysotile	6	0	94
		D	White joint compound	4	Chrysotile	4	0	96
		E	Tan/white drywall	90		ND	8	92

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-2-PC01-176	EM 2021895	A	White perlitic texture w/ white paint	3	Chrysotile	6	0	94
		B	Pink tape	5		ND	95	5
		C	White compound w/ white paint	10	Chrysotile	3	0	97
		D	White joint compound	10	Chrysotile	4	0	96
		E	Tan/white drywall	72		ND	10	90
HP5-2-PC01-177	EM 2021896	A	White perlitic texture w/ white paint	4	Chrysotile	6	0	94
		B	White compound w/ white paint	15	Chrysotile	2	0	98
		C	White compound w/ white paint	15		ND	0	100
		D	Tan/white drywall	66		ND	7	93
HP5-2-PC01-178	EM 2021897	A	White perlitic texture	3	Chrysotile	8	0	92
		B	White tape	5		ND	95	5
		C	White joint compound	5	Chrysotile	4	0	96
		D	White compound w/ white paint	12	Chrysotile	2	0	98
		E	Tan/white drywall	75		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-2-PC01-179	EM 2021898	A	White perlitic texture w/ white paint	2	Chrysotile	6	0	94
		B	White tape	2		ND	95	5
		C	White joint compound	2	Chrysotile	4	0	96
		D	White compound w/ white paint	12	Chrysotile	2	0	98
		E	Tan/white drywall	82		ND	10	90
HP5-2-CD01-180	EM 2021899	A	White tape	10		ND	95	5
		B	White joint compound	15	Chrysotile	3	0	97
		C	White compound w/ white paint	30	Chrysotile	2	0	98
		D	Tan/pink drywall	45		ND	12	88
HP5-2-CD01-181	EM 2021900	A	White tape	5		ND	95	5
		B	White joint compound	5	Chrysotile	3	0	97
		C	White compound w/ white paint	20	Chrysotile	2	0	98
		D	Tan/white drywall	70		ND	7	93

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-2-CD01-182	EM 2021901	A	White tape	5		ND	95	5
		B	White joint compound	7	Chrysotile	3	0	97
		C	White compound w/ white paint	18	Chrysotile	2	0	98
		D	Tan/pink drywall	70		ND	10	90
HP5-2-CD01-183	EM 2021902	A	White tape	7		ND	95	5
		B	White joint compound	13	Chrysotile	3	0	97
		C	White compound w/ white paint	20	Chrysotile	2	0	98
		D	Tan/pink drywall	60		ND	12	88
HP45-2-CD01-184	EM 2021903	A	White tape	3		ND	95	5
		B	White joint compound	5	Chrysotile	3	0	97
		C	White compound w/ white paint	12	Chrysotile	2	0	98
		D	Tan/pink drywall	80		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-2-CD01-185	EM 2021904	A	White tape	5		ND	95	5
		B	White joint compound	10	Chrysotile	3	0	97
		C	White compound w/ white paint	15	Chrysotile	2	0	98
		D	Tan/pink drywall	70		ND	12	88
HP5-2-CP01-186	EM 2021905	A	Tan adhesive	TR		ND	0	100
		B	Green/multi-colored carpet	40		ND	75	25
		C	Pink/multi-colored foam	60		ND	0	100
HP5-2-CP02-187	EM 2021906	A	Tan adhesive	1		ND	0	100
		B	Green/multi-colored carpet w/ tan foam	99		ND	50	50
HP-BW-RM01-188	EM 2021907	A	Silver resinous material	5	Chrysotile	2	0	98
		B	Black tar	10	Chrysotile	8	0	92
		C	Brown fibrous material	15		ND	80	20
		D	Black fibrous tar	70		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP4-R-RM01-189	EM 2021908	A	Black fibrous tar	5	Chrysotile	15	0	85
		B	Gray shingle	15		ND	15	85
		C	Gray shingle w/ white coating	25		ND	10	90
		D	Black fibrous tar w/ black tar & black granular material	55		ND	25	75
HP4-R-RF01-190	EM 2021909	A	Black felt w/ silver resinous material	100	Chrysotile Point Count	TR <0.25	65	35
HP4-2-WP01-191	EM 2021910	A	White resinous material	10		ND	0	100
		B	Black fibrous tar	90	Chrysotile	12	0	88
HP1-1-CD01-301	EM 2021911	A	White paint	4		ND	0	100
		B	Off white compound	14	Chrysotile	2	0	98
		C	White/tan drywall	82		ND	12	88
HP1-1-CD01-302	EM 2021912	A	White paint	1		ND	0	100
		B	Off white compound	3	Chrysotile	3	0	97
		C	White/tan drywall	96		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-1-CD01-303	EM 2021913	A	Off white compound	2	Chrysotile	4	0	96
		B	White paint	3		ND	0	100
		C	White/tan drywall	95		ND	10	90
HP1-1-WP01-304	EM 2021914	A	Colorless adhesive	2	Chrysotile	ND	3	97
		B	White paint	2		ND	0	100
		C	Off white compound	2		3	1	96
		D	Light beige wall covering	6		ND	35	65
		E	White/tan drywall	88		TR	10	90
HP1-1-WP01-305	EM 2021915	A	White paint w/ white compound	5	Chrysotile	TR	0	100
		B	Light pink/gray wall covering w/ light tan adhesive	15		ND	35	65
		C	White/tan drywall	80		TR	20	80
HP1-1-WP01-306	EM 2021916	A	Tan/off white wall covering	35	Trem/Act	ND	30	70
		B	Off white/tan drywall	65		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-1-WP01-307	EM 2021917	A	Off white compound	5	Chrysotile	3	0	97
		B	Off white joint compound	5	Chrysotile	3	0	97
		C	Off white tape	10		ND	95	5
		D	Tan/off white wall covering w/ off white paint	20		ND	25	75
		E	Off white/tan drywall	60		ND	25	75
HP1-1-WP01-308	EM 2021918	A	Off white compound	1	Chrysotile	3	0	97
		B	Beige/multi-colored wall covering w/ off white paint	10		ND	20	80
		C	Tan/off white drywall	89		ND	60	40
HP1-1-WP01-309	EM 2021919	A	Off white joint compound	2	Chrysotile	2	0	98
		B	Off white compound	5	Chrysotile	4	0	96
		C	Off white tape	10		ND	95	5
		D	Tan/off white wall covering w/ off white paint	15		ND	25	75
		E	Off white/tan drywall	68		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-1-WP01-310	EM 2021920	A	Off white paint w/ off white resinous material	2		ND	0	100
		B	Off white compound	4	Chrysotile	3	0	97
		C	Off white/tan drywall	94		ND	25	75
HP1-1-WP01-311	EM 2021921	A	Beige/multi-colored wall covering w/ off white paint	20		ND	20	80
		B	Off white compound	20	Chrysotile	2	0	98
		C	Off white/tan drywall	60		ND	30	70
HP1-1-WP01-312	EM 2021922	A	Off white paint w/ off white resinous material	2		ND	0	100
		B	Off white joint compound	2	Chrysotile	2	0	98
		C	Off white compound	3	Chrysotile	3	0	97
		D	Off white tape	3		ND	95	5
		E	Off white/tan drywall	90		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-1-CD02-313	EM 2021923	A	Off white joint compound	2	Chrysotile	2	0	98
		B	Off white paint	3		ND	0	100
		C	Off white compound	3	Chrysotile	2	0	98
		D	Off white tape	4		ND	95	5
		E	White/tan drywall	88		ND	18	82
HP1-1-CD02-314	EM 2021924	A	Off white joint compound	1	Chrysotile	3	0	97
		B	Off white compound	3	Chrysotile	3	0	97
		C	Off white tape	3		ND	95	5
		D	Off white paint	4		ND	0	100
		E	White/tan drywall	89		ND	18	82

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-1-CD02-315	EM 2021925	A	White compound	1		ND	0	100
		B	White paint	2		ND	0	100
		C	Off white joint compound	2	Chrysotile	2	0	98
		D	Tan compound	3	Chrysotile	3	0	97
		E	Off white tape	5		ND	95	5
		F	White/tan drywall	87		ND	18	82
HP1-1-CD02-316	EM 2021926	A	Off white joint compound	2	Chrysotile	3	0	97
		B	Off white paint	3		ND	0	100
		C	Off white compound	3	Chrysotile	2	0	98
		D	Off white tape	5		ND	95	5
		E	White/tan drywall	87		ND	25	75

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-1-CD02-317	EM 2021927	A	Off white joint compound	2	Chrysotile	2	0	98
		B	Off white compound	3	Chrysotile	2	0	98
		C	Off white paint	5		ND	0	100
		D	Off white tape	13		ND	95	5
		E	White/tan drywall	77		ND	50	50
HP1-1-CD02-318	EM 2021928	A	Off white compound	1	Chrysotile	4	0	96
		B	Off white paint	2		ND	0	100
		C	Off white/tan drywall	97		ND	15	85
HP1-1-CD02-319	EM 2021929	A	Off white paint	2		ND	0	100
		B	Off white compound	5	Chrysotile	3	0	97
		C	Off white/tan drywall	93		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-1-CD02-320	EM 2021930	A	Off white joint compound	1	Chrysotile	2	0	98
		B	Off white paint	3		ND	0	100
		C	Off white compound	3	Chrysotile	3	0	97
		D	Off white tape	8		ND	95	5
		E	White/tan drywall	85		ND	30	70
HP1-1-CD02-321	EM 2021931	A	Off white paint	2		ND	0	100
		B	Off white compound	3	Chrysotile	3	0	97
		C	Off white/tan drywall	95		ND	15	85
HP1-1-CD02-322	EM 2021932	A	Off white paint	2		ND	0	100
		B	Off white compound	3	Chrysotile	2	0	98
		C	White/tan drywall	95		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-2-CD01-323	EM 2021933	A	Off white compound	1	Chrysotile	2	0	98
		B	Off white paint	3		ND	0	100
		C	Off white paint w/ white compound	5		ND	0	100
		D	White/tan drywall	91		ND	50	50
HP1-2-CD01-324	EM 2021934	A	Off white paint	2	Chrysotile	ND	0	100
		B	Off white compound	18		3	0	97
		C	Tan/gray drywall	80		ND	60	40
HP1-2-CD01-325	EM 2021935	A	Off white compound	1	Chrysotile	3	0	97
		B	Off white paint	3		ND	0	100
		C	Gray/tan drywall	96		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-2-CD01-326	EM 2021936	A	Off white paint	2		ND	0	100
		B	Off white joint compound	2	Chrysotile	2	0	98
		C	Off white tape	11		ND	95	5
		D	Off white compound	15	Chrysotile	3	0	97
		E	White/tan drywall	70		ND	25	75
HP1-2-CD01-327	EM 2021937	A	Off white paint	2		ND	0	100
		B	Off white compound	18	Chrysotile	2	0	98
		C	Tan/gray drywall	80		ND	65	35
HP1-2-CD01-328	EM 2021938	A	Off white paint	2		ND	0	100
		B	Off white compound	13	Chrysotile	2	0	98
		C	Gray/tan drywall	85		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-2-CD01-329	EM 2021939	A	Off white compound	TR	Chrysotile	2	0	98
		B	Off white paint	2		ND	0	100
		C	White/tan drywall	98		ND	18	82
HP1-2-CD01-330	EM 2021940	A	Off white paint	2		ND	0	100
		B	Tan compound	4	Chrysotile	3	0	97
		C	Off white/tan drywall	94		ND	20	80
HP1-2-CD01-331	EM 2021941	A	Off white paint	3		ND	0	100
		B	Off white compound	3	Chrysotile	4	0	96
		C	White/tan drywall	94		ND	15	85
HP1-2-CD01-332	EM 2021942	A	Off white paint	3		ND	0	100
		B	Off white compound	4	Chrysotile	3	0	97
		C	White/tan drywall	93		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-2-WP01-333	EM 2021943	A	Off white compound	TR	Chrysotile	2	0	98
		B	Tan/off white wall covering w/ off white paint	7		ND	18	82
		C	White/tan drywall	93		ND	20	80
HP1-2-WP01-334	EM 2021944	A	Off white compound	1	Chrysotile	2	0	98
		B	Tan/off white wall covering w/ off white paint	20		ND	20	80
		C	Gray/tan drywall	20		ND	30	70
		D	White/tan drywall	59		ND	15	85
HP1-2-WP01-335	EM 2021945	A	Off white compound	1	Chrysotile	2	0	98
		B	Beige/multi-colored wall covering w/ off white paint	19		ND	20	80
		C	White/tan drywall	80		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-2-WP01-336	EM 2021946	A	Off white compound	1	Chrysotile	2	0	98
		B	Tan/off white wall covering w/ off white	6		ND	20	80
		C	White/tan drywall	33		ND	25	75
		D	Gray/tan drywall	60		ND	35	65
HP1-2-WP01-337	EM 2021947	A	Off white compound	2	Chrysotile	2	0	98
		B	White paint	3		ND	0	100
		C	Cream wall covering w/ off white adhesive	7		ND	25	75
		D	White/tan drywall	88		ND	15	85
HP1-2-WP01-338	EM 2021948	A	White paint	2	Chrysotile	ND	0	100
		B	Off white compound	3		3	0	97
		C	Pink/multi-colored wall covering w/ off white adhesive	10		ND	25	75
		D	White/tan drywall	85		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-2-WP01-339	EM 2021949	A	Cream/white wall covering w/ off white adhesive	8		ND	0	100
		B	Off white compound w/ white paint	10	Chrysotile	3	0	97
		C	White/tan drywall	82		ND	15	85
HP1-2-WP01-340	EM 2021950	A	White joint compound	5	Chrysotile	2	0	98
		B	White joint compound	5	Chrysotile	2	0	98
		C	White paint w/ w/ off white adhesive	5		ND	0	100
		D	White/multi-layered tape	7		ND	95	5
		E	White compound	13	Chrysotile	2	0	98
		F	White/tan drywall	65		ND	17	83
HP1-2-WP01-341	EM 2021951	A	Off white compound w/ white paint	10	Chrysotile	3	0	97
		B	Pink/multi-colored wall covering w/ off white adhesive	10		ND	25	75
		C	White/tan drywall	80		ND	13	87

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-2-CD02-342	EM 2021952	A	White paint	2		ND	0	100
		B	White compound	4	Chrysotile	3	0	97
		C	White/tan drywall	94		ND	15	85
HP1-2-CD02-343	EM 2021953	A	White paint	2		ND	0	100
		B	White compound	3	Chrysotile	4	0	96
		C	White tape	4		ND	95	5
		D	White joint compound	8	Chrysotile	3	0	97
		E	White compound	10	Chrysotile	3	0	97
		F	White/tan drywall	73		ND	12	88
HP1-2-CD02-344	EM 2021954	A	White paint	2		ND	0	100
		B	White compound	3	Chrysotile	4	0	96
		C	White compound	15	Chrysotile	3	0	97
		D	White/tan drywall	80		ND	12	88

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP1-2-CP01-345	EM 2021955	A	Green/pink carpet w/ tan paper	50		ND	85	15
		B	Gray/multi-colored carpet material	50		ND	93	7
HP1-2-CP02-346	EM 2021956	A	Cream adhesive	10		ND	0	100
		B	Red/multi-colored carpet w/ light yellow foam	90		ND	50	50
HP1-2-CP03-347	EM 2021957	A	Pink/multi-colored foam	35		ND	0	100
		B	Green/multi-colored carpet	65		ND	75	25
HP2-2-WP01-348	EM 2021958	A	White paint	2		ND	0	100
		B	White compound	5	Chrysotile	2	0	98
		C	Cream/white wall covering w/ off white adhesive	7		ND	25	75
		D	White/tan drywall	86		ND	13	87

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-2-WP01-349	EM 2021959	A	Off white paint	1	Chrysotile	ND	0	100
		B	Off white compound	2		ND	0	100
		C	Off white compound	2		3	0	97
		D	Beige/multi-colored wall covering	25		ND	30	70
		E	Off white/tan drywall	70		ND	20	80
HP2-2-WP01-350	EM 2021960	A	Off white paint	2	Chrysotile Chrysotile	ND	0	100
		B	Off white joint compound	2		2	0	98
		C	Off white compound	4		3	0	97
		D	Off white tape	4		ND	95	5
		E	Tan/off white wall covering	5		ND	25	75
		F	White compound w/ white fibrous woven material	10		ND	15	85
		G	Off white/tan drywall	73		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-2-WP01-351	EM 2021961	A	Off white paint	2		ND	0	100
		B	Off white compound	2	Chrysotile	2	0	98
		C	Off white joint compound	2	Chrysotile	2	0	98
		D	Tan/off white wall covering	5		ND	25	75
		E	Off white tape	5		ND	95	5
		F	White compound w/ white fibrous woven material	15		ND	18	82
		G	Off white/tan drywall	69		ND	15	85
HP2-2-WP01-352	EM 2021962	A	Off white compound	1	Chrysotile	3	0	97
		B	Tan/off white wall covering w/ off white paint	5		ND	20	80
		C	White/tan drywall	94		ND	20	80
HP2-2-WP01-353	EM 2021963	A	Off white compound	2		ND	0	100
		B	Beige/multi-colored wall covering	7		ND	25	75
		C	Off white/tan drywall w/ off white paint	91		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-2-WP01-354	EM 2021964	A	Off white compound	1	Chrysotile	6	0	94
		B	Tan/off white wall covering	6		ND	25	75
		C	Off white/tan drywall w/ off white paint	93		ND	18	82
HP2-2-WP01-355	EM 2021965	A	Off white compound	2	Chrysotile	4	0	96
		B	Tan/off white wall covering	10		ND	25	75
		C	Off white/tan drywall	88		ND	15	85
HP2-2-WP01-356	EM 2021966	A	Beige/multi-colored wall covering w/ white caulk	30		ND	20	80
		B	Off white/tan drywall w/ off white paint	70		ND	15	85
HP2-2-WP01-357	EM 2021967	A	Off white joint compound	1	Chrysotile	2	0	98
		B	Off white compound	2	Chrysotile	2	0	98
		C	Off white tape	4		ND	95	5
		D	Tan/off white wall covering w/ off white paint	23		ND	70	30
		E	Off white/tan drywall	70		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-2-CD01-358	EM 2021968	A	Off white paint	2		ND	0	100
		B	Off white compound	3	Chrysotile	3	0	97
		C	Off white joint compound	3	Chrysotile	4	0	96
		D	Off white tape	17		ND	95	5
		E	Off white/tan drywall	75		ND	22	78
HP2-2-CD01-359	EM 2021969	A	Off white paint	1		ND	0	100
		B	Off white compound	2	Chrysotile	2	0	98
		C	Off white joint compound	2	Chrysotile	2	0	98
		D	Off white tape	5		ND	95	5
		E	Off white/tan drywall	90		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-2-CD01-360	EM 2021970	A	Off white compound	2	Chrysotile	4	0	96
		B	Off white joint compound	2	Chrysotile	3	0	97
		C	Off white paint	3		ND	0	100
		D	Off white tape	13		ND	95	5
		E	Off white/tan drywall	80		ND	20	80
HP2-2-CD01-361	EM 2021971	A	Off white paint	2		ND	0	100
		B	Off white compound	2	Chrysotile	3	0	97
		C	Off white joint compound	2	Chrysotile	3	0	97
		D	Off white tape	9		ND	95	5
		E	Off white/tan drywall	85		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-2-CD01-362	EM 2021972	A	Off white paint	2		ND	0	100
		B	Off white compound	2	Chrysotile	3	0	97
		C	Off white joint compound	2	Chrysotile	2	0	98
		D	Off white tape	5		ND	95	5
		E	Off white/tan drywall	89		ND	15	85
HP2-2-CD01-363	EM 2021973	A	Off white paint	2		ND	0	100
		B	Off white compound	3	Chrysotile	3	0	97
		C	Off white joint compound	3	Chrysotile	2	0	98
		D	Off white tape	7		ND	95	5
		E	Off white/tan drywall	85		ND	18	82

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-2-CD01-364	EM 2021974	A	Off white joint compound	2	Chrysotile	4	0	96
		B	Off white compound	3	Chrysotile	3	0	97
		C	Off white tape	3		ND	95	5
		D	Off white paint	4		ND	0	100
		E	Off white/tan drywall	88		ND	25	75
HP2-2-CD01-365	EM 2021975	A	Off white compound	2	Chrysotile	3	0	97
		B	Off white tape	2		ND	95	5
		C	Off white paint	3		ND	0	100
		D	Off white joint compound	3	Chrysotile	4	0	96
		E	Off white/tan drywall	90		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-2-CD01-366	EM 2021976	A	Off white paint	2		ND	0	100
		B	Off white compound	2	Chrysotile	3	0	97
		C	Off white joint compound	2	Chrysotile	3	0	97
		D	Off white tape	4		ND	95	5
		E	Off white/tan drywall	90		ND	18	82
HP2-2-CD02-367	EM 2021977	A	Gray/tan drywall w/ white/off white paint	100		ND	15	85
HP2-2-CD02-368	EM 2021978	A	Gray/tan drywall w/ white/off white paint	100		ND	15	85
HP2-2-CD02-369	EM 2021979	A	Gray/tan drywall w/ white/off white paint	100		ND	25	75
HP2-2-DG01-370	EM 2021980	A	Black adhesive	100		ND	TR	100
HP2-2-CP01-371	EM 2021981	A	Yellow adhesive	1		ND	0	100
		B	Green/multi-colored carpet	99		ND	80	20
HP2-2-CP02-372	EM 2021982	A	Yellow adhesive	TR		ND	0	100
		B	Red/multi-colored carpet	100		ND	55	45

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-2-CP03-373	EM 2021983	A	Yellow adhesive	TR		ND	0	100
		B	Pink/multi-colored foam	45		ND	0	100
		C	Green/multi-colored carpet	55		ND	85	15
HP2-1-CD01-374	EM 2021984	A	White tape	2		ND	95	5
		B	White compound w/ white/yellow paint	5	Chrysotile	2	0	98
		C	White joint compound	5	Chrysotile	3	0	97
		D	Tan/white drywall	88		ND	10	90
HP2-1-CD01-375	EM 2021985	A	White tape	5		ND	95	5
		B	White compound w/ white/yellow paint	10	Chrysotile	2	0	98
		C	White joint compound	10	Chrysotile	3	0	97
		D	Tan/white drywall	75		ND	8	92
HP2-1-CD01-376	EM 2021986	A	Tan/white drywall w/ white/yellow paint	100		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-1-CD01-377	EM 2021987	A	White tape	3		ND	95	5
		B	White joint compound	7	Chrysotile	4	0	96
		C	White compound w/ white/yellow paint	10	Chrysotile	3	0	97
		D	Tan/white drywall	80		ND	10	90
HP2-1-CD01-378	EM 2021988	A	White compound w/ white/yellow paint	8	Chrysotile	3	0	97
		B	Tan/white drywall	92		ND	8	92
HP2-1-CD01-379	EM 2021989	A	White tape	1		ND	95	5
		B	White compound w/ white/yellow paint	2	Chrysotile	3	0	97
		C	White joint compound	2	Chrysotile	4	0	96
		D	Tan/white drywall	95		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-1-CD01-380	EM 2021990	A	White tape	5		ND	95	5
		B	White compound w/ white/yellow paint	15	Chrysotile	2	0	98
		C	White joint compound	15	Chrysotile	3	0	97
		D	Tan/white drywall	65		ND	10	90
HP2-1-CD01-381	EM 2021991	A	White tape	2		ND	95	5
		B	White compound w/ white/yellow paint	4	Chrysotile	3	0	97
		C	White joint compound	4	Chrysotile	4	0	96
		D	Tan/white drywall	90		ND	8	92
HP2-1-CD01-382	EM 2021992	A	White compound w/ white/yellow paint	8	Chrysotile	3	0	97
		B	Off white compound w/ white paint	12	Chrysotile	3	0	97
		C	Tan/white drywall	80		ND	8	92

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-1-CD01-383	EM 2021993	A	White tape	2		ND	95	5
		B	White compound w/ white/yellow paint	4	Chrysotile	3	0	97
		C	White joint compound	4	Chrysotile	4	0	96
		D	Tan/white drywall	90		ND	10	90
HP2-1-CD02-384	EM 2021994	A	Off white tape	3		ND	95	5
		B	Off white compound w/ white/yellow paint	7	Chrysotile	3	0	97
		C	Off white joint compound	8	Chrysotile	4	0	96
		D	Tan/white drywall	82		ND	10	90
HP2-1-CD02-385	EM 2021995	A	White compound w/ white paint	5		ND	0	100
		B	White tape	5		ND	95	5
		C	Off white joint compound	5	Chrysotile	4	0	96
		D	White/off white compound w/ white paint	10	Chrysotile	3	0	97
		E	Tan/white drywall	75		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-1-CD02-386	EM 2021996	A	White compound w/ white/yellow paint	3	Chrysotile	2	0	98
		B	White tape	3		ND	95	5
		C	White compound w/ yellow paint	7	Chrysotile	3	0	97
		D	White joint compound	7	Chrysotile	4	0	96
		E	Tan/white drywall	80		ND	10	90
HP2-1-WP01-387	EM 2021997	A	Tan adhesive	2		ND	0	100
		B	Off white compound w/ yellow paint	5	Chrysotile	2	0	98
		C	Tan/white drywall	93		ND	7	93
HP2-1-WP01-388	EM 2021998	A	Tan/white wall covering w/ tan adhesive	7		ND	20	80
		B	Tan/white drywall w/ off white/white paint	93		ND	10	90
HP2-1-WP01-389	EM 2021999	A	Yellow/white paint w/ off white compound	5	Chrysotile	TR	0	100
		B	Tan wall covering w/ yellow adhesive	10		ND	25	75
		C	Tan/white drywall	85		ND	8	92

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-1-WP01-390	EM 2022000	A	Tan wall covering w/ colorless adhesive	2	Chrysotile	ND	25	75
		B	White compound	5		ND	0	100
		C	Off white compound w/ yellow paint	8		3	0	97
		D	Tan/white drywall	85		ND	10	90
HP2-1-WP01-391	EM 2022001	A	Pink/green wall covering w/ yellow adhesive	5	Chrysotile	ND	25	75
		B	Off white compound w/ off white paint	20		3	0	97
		C	Tan/white drywall	75		ND	10	90
HP2-1-WP01-392	EM 2022002	A	Tan wall covering w/ yellow adhesive	10		ND	25	75
		B	Tan/white drywall w/ off white/white paint	90		ND	8	92
HP2-1-WP01-393	EM 2022003	A	Yellow adhesive	3	Chrysotile	ND	0	100
		B	Yellow/white paint w/ off white compound	5		TR	0	100
		C	Tan/white drywall	92		ND	7	93

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP2-1-WP01-394	EM 2022004	A	Yellow adhesive	1		ND	0	100
		B	Tan/yellow paint w/ off white compound	9	Chrysotile	2	0	98
		C	Tan/white drywall	90		ND	10	90
HP2-1-WP01-395	EM 2022005	A	Yellow adhesive	TR	Chrysotile	TR	0	100
		B	Tan wall covering w/ yellow adhesive	5		ND	25	75
		C	Off white/yellow paint w/ off white compound	5	Chrysotile	TR	0	100
		D	Tan/white drywall	90		ND	10	90
HP5-3-PC01-396	EM 2022006	A	White perlitic texture w/ white paint	2	Chrysotile	7	0	93
		B	White compound w/ white paint	2	Chrysotile	2	0	98
		C	White tape	2		ND	95	5
		D	White joint compound	2	Chrysotile	3	0	97
		E	Tan/white drywall	92		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-PC01-397	EM 2022007	A	White tape	1		ND	95	5
		B	White perlitic texture w/ white paint	3	Chrysotile	6	0	94
		C	White compound w/ white paint	3	Chrysotile	2	0	98
		D	White joint compound	3	Chrysotile	3	0	97
		E	Tan/white drywall	90		ND	10	90
HP5-3-PC01-398	EM 2022008	A	White perlitic texture w/ white paint	8	Chrysotile	6	0	94
		B	Tan/white drywall w/ white paint	92		ND	10	90
HP5-3-PC01-399	EM 2022009	A	Off white perlitic texture w/ white paint	5	Chrysotile	7	0	93
		B	Tan/pink drywall w/ off white paint	95		ND	6	94

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-PC01-400	EM 2022010	A	White perlitic texture w/ white paint	5	Chrysotile	6	0	94
		B	White compound w/ white paint	5	Chrysotile	2	0	98
		C	White tape	5		ND	95	5
		D	White joint compound	5	Chrysotile	3	0	97
		E	Tan/pink drywall	80		ND	12	88
HP5-3-PC01-401	EM 2022011	A	White perlitic texture	5	Chrysotile	8	0	92
		B	White compound w/ white paint	5	Chrysotile	2	0	98
		C	Tan/pink drywall	90		ND	7	93
HP5-3-PC01-402	EM 2022012	A	White perlitic texture	3	Chrysotile	8	0	92
		B	White tape	3		ND	95	5
		C	White joint compound	4	Chrysotile	4	0	96
		D	White compound w/ white paint	10	Chrysotile	2	0	98
		E	Tan/pink drywall	80		ND	10	90

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-PC01-403	EM 2022013	A	White perlitic texture	TR	Chrysotile	8	0	92
		B	White compound	1	Chrysotile	3	0	97
		C	White/yellow paint w/ white/gray perlitic texture	4		ND	0	100
		D	White compound w/ white paint	5	Chrysotile	3	0	97
		E	Tan/white drywall	90		ND	7	93
HP5-3-PC01-404	EM 2022014	A	White perlitic texture w/ white paint	5		ND	0	100
		B	White perlitic texture w/ white paint	5	Chrysotile	7	0	93
		C	Tan/pink drywall w/ white paint	90		ND	8	92
HP5-3-PC01-405	EM 2022015	A	White perlitic texture w/ white paint	4	Chrysotile	7	0	93
		B	White paint w/ white compound	4	Chrysotile	2	0	98
		C	Tan/white drywall	92		ND	7	93

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-CD01-406	EM 2022016	A	White paint	2		ND	0	100
		B	Off white compound	2	Chrysotile	2	0	98
		C	Off white joint compound	2	Chrysotile	2	0	98
		D	Off white tape	10		ND	95	5
		E	Off white/tan drywall	84		ND	20	80
HP5-3-CD01-407	EM 2022017	A	White paint	3		ND	0	100
		B	Off white compound	3	Chrysotile	2	0	98
		C	Off white joint compound	3	Chrysotile	2	0	98
		D	Off white tape	6		ND	95	5
		E	White/tan drywall	85		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-CD01-408	EM 2022018	A	Off white joint compound	2	Chrysotile	2	0	98
		B	White paint	3		ND	0	100
		C	Off white compound	3	Chrysotile	2	0	98
		D	Off white tape	5		ND	95	5
		E	White/tan drywall	87		ND	20	80
HP5-3-CD01-409	EM 2022019	A	White paint	2		ND	0	100
		B	Off white compound	2	Chrysotile	2	0	98
		C	Off white joint compound	2	Chrysotile	2	0	98
		D	Off white tape	5		ND	95	5
		E	White/tan drywall	89		ND	30	70

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-CD01-410	EM 2022020	A	White paint	2		ND	0	100
		B	Off white compound	4	Chrysotile	2	0	98
		C	Off white joint compound	4	Chrysotile	2	0	98
		D	Off white tape	10		ND	95	5
		E	White/tan drywall	80		ND	18	82
HP5-3-CD01-411	EM 2022021	A	Off white paint	2		ND	0	100
		B	Off white compound	3	Chrysotile	3	0	97
		C	Off white joint compound	3	Chrysotile	2	0	98
		D	Off white tape	7		ND	95	5
		E	Pink/multi-colored drywall	85		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-CD01-412	EM 2022022	A	Off white paint	5		ND	0	100
		B	Off white compound	5	Chrysotile	3	0	97
		C	Off white joint compound	5	Chrysotile	2	0	98
		D	Off white tape	25		ND	95	5
		E	Off white/tan drywall	60		ND	50	50
HP5-3-WP01-413	EM 2022023	A	Off white compound	1	Chrysotile	2	0	98
		B	Off white paint	3		ND	0	100
		C	Off white/tan drywall	96		ND	30	70
HP5-3-WP01-414	EM 2022024	A	Off white multi-layered paint	2		ND	0	100
		B	Off white compound	4	Chrysotile	2	0	98
		C	Off white/multi-colored drywall	94		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-WP01-415	EM 2022025	A	Off white compound	1	Chrysotile	2	0	98
		B	Off white paint	2		ND	0	100
		C	Beige/multi-colored wall covering	17		ND	25	75
		D	White/tan drywall	80		ND	18	82
HP5-3-WP01-416	EM 2022026	A	Off white paint	2	Chrysotile	ND	0	100
		B	Off white compound	2		2	0	98
		C	Off white/tan drywall	96		ND	35	65
HP5-3-WP01-417	EM 2022027	A	Green/multi-colored paint	3	Chrysotile Chrysotile	ND	0	100
		B	Off white joint compound	3		2	0	98
		C	Off white compound	5		2	0	98
		D	Off white tape	5		ND	95	5
		E	Off white/tan drywall	84		ND	20	80

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-WP01-418	EM 2022028	A	Off white paint	2		ND	0	100
		B	Off white compound	5	Chrysotile	2	0	98
		C	Off white joint compound	5	Chrysotile	3	0	97
		D	Off white tape	5		ND	95	5
		E	Tan/off white wall covering	18		ND	85	15
		F	Off white/tan drywall	65		ND	35	65
HP5-3-WP01-419	EM 2022029	A	Off white compound	1	Chrysotile	2	0	98
					Point Count	1.25		
		B	Tan/multi-colored wall covering w/ off white paint	30		ND	80	20
HP5-3-WP01-420	EM 2022030	C	Off white/tan drywall	69		ND	18	82
		A	Off white compound	1	Chrysotile	2	0	98
		B	Off white multi-layered paint	2		ND	0	100
		C	Off white/tan drywall	97		ND	18	82

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-WP01-421	EM 2022031	A	Off white compound	1	Chrysotile	2	0	98
		B	Beige/multi-colored wall covering w/ off white paint	5		ND	25	75
		C	Off white/tan drywall	94		ND	15	85
HP5-3-CB01-422	EM 2022032	A	Off white paint	1	Chrysotile Point Count	ND	0	100
		B	Off white compound	1		3	0	97
		C	Tan paper	2		2.00	90	10
		D	Tan adhesive	2		ND	0	100
		E	Brown adhesive	3		TR	2	98
						<0.25		
						TR		
		F	Brown cove base	91	Point Count	<0.25	0	100
						ND		

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-CB01-423	EM 2022033	A	Off white paint	1		ND	0	100
		B	Off white compound	1	Chrysotile	2	0	98
					Point Count	1.00		
		C	Tan adhesive	2		ND	0	100
		D	Brown adhesive	2	Trem/Act	TR	0	100
					Point Count	0.50		
HP5-3-CB02-424	EM 2022034				Chrysotile	TR		
					Point Count	<0.25		
		E	Tan paper	3		ND	95	5
		F	Brown cove base	91		ND	0	100
		A	Yellow adhesive	4		ND	0	100
		B	Off white cove base	96		ND	0	100

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-CB03-425	EM 2022035	A	Yellow adhesive	4		ND	0	100
		B	Purple cove base	96		ND	0	100
HP5-3-FT01-426	EM 2022036	A	Yellow mastic	TR		ND	0	100
		B	White/brown tile	100		ND	0	100
HP5-3-FT01-427	EM 2022037	A	Yellow mastic	TR		ND	0	100
		B	White/brown tile	100		ND	0	100
HP5-3-FT02-428	EM 2022038	A	Black mastic	1		ND	0	100
		B	Orange mastic	1		ND	0	100
		C	Green tile	35	Chrysotile	3	0	97
		D	Off white tile	63	Chrysotile	5	0	95
HP5-3-FT03-429	EM 2022039	A	Off white/yellow sheet vinyl w/ gray fibrous backing material & yellow mastic	100		ND	15	85

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-FT04-430	EM 2022040	A	Black mastic	1		ND	0	100
		B	Red tile	99	Chrysotile	4	0	96
HP5-3-FT05-431	EM 2022041	A	Green/multi-colored sheet vinyl w/ gray fibrous backing material & brown mastic	100	Chrysotile	18	2	80
HP5-3-FT06-432	EM 2022042	A	Off white/gray sheet vinyl w/ gray fibrous backing material & white mastic	100		ND	15	85
HP5-3-FT07-433	EM 2022043	A	Off white/gray sheet vinyl w/ gray fibrous backing material & white mastic	100		ND	18	82
HP5-3-FT08-434	EM 2022044	A	Off white sheet vinyl w/ gray fibrous backing material & yellow mastic	100		ND	15	85
HP5-3-CP01-435	EM 2022045	A	Yellow adhesive	TR		ND	0	100
		B	Reddish purple/multi-colored carpet w/ tan foam	100		ND	60	40

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0

TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-CP02-436	EM 2022046	A	Green/yellow foam	45		ND	0	100
		B	Green carpet	55		ND	95	5
HP5-3-CP03-437	EM 2022047	A	Tan carpet	50		ND	80	20
		B	Green/multi-colored foam	50		ND	0	100
HP5-3-CP04-438	EM 2022048	A	Brown fibrous material	3		ND	90	10
		B	Yellow adhesive	5		ND	0	100
		C	Pink/multi-colored fibrous material	40		ND	95	5
		D	Grayish green carpet	52		ND	85	15
HP5-3-CP05-439	EM 2022049	A	Green/pink carpet	50		ND	80	20
		B	Pink/multi-colored foam	50		ND	0	100

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.

RESERVOIRS ENVIRONMENTAL INC.

NVLAP Lab Code 101896-0


TABLE: PLM BULK ANALYSIS, PERCENTAGE COMPOSITION BY VOLUME

RES Job Number: **RES 400635-2R**
 Client: **Weston Solutions, Inc. (CO)**
 Client Project Number / P.O.: **20408.016.003.0555.02**
 Client Project Description: **Hitching Post**
 Date Samples Received: **February 08, 2018**
 Method: **EPA 600/R-93/116 - Point Count, Bulk**
 Turnaround: **3-5 Day**
 Date Samples Analyzed: **February 22, 2018**

ND=None Detected
 TR=Trace, <1% Visual Estimate
 Trem/Act=Tremolite/Actinolite

Client Sample Number	Lab ID Number	L A Y E R	Physical Description	Sub Part (%)	Asbestos Content		Non Asbestos Fibrous Components (%)	Non-Fibrous Components (%)
					Mineral	Visual Estimate (%)		
HP5-3-CP06-440	EM 2022050	A	Yellow adhesive	2		ND	0	100
		B	Brown fibrous material	3		ND	90	10
		C	Tan foam	30		ND	0	100
		D	Tan carpet	65		ND	85	15
HP5-3-CP07-441	EM 2022051	A	White fibrous material	2		ND	95	5
		B	Brown fibrous material	2		ND	90	10
		C	Tan foam	20		ND	0	100
		D	Tan/off white carpet	76		ND	90	10
HP5-3-CP08-442	EM 2022052	A	Yellow adhesive	2		ND	0	100
		B	Green/multi-colored foam	45		ND	0	100
		C	Brownish purple carpet	53		ND	80	20

TEM Analysis recommended for organically bound material (i.e. floor tile) if PLM results are <1%.


Liu Wenlong

Analyst


Que Pham

Analyst


Gregory Hronich

Analyst


Brianne Neumann

Analyst


Michael Scales

Analyst / Data QA

Due Date: 2-13-15
Due Time: _____



Reservoirs Environmental, Inc.

5801 Logan St. Denver, CO 80216 • Ph: 303.964.1985 • Fax 303.477.4275 • Toll Free 866-RESI-ENV

RES 400635

After Hours Cell Phone: 720-339-9228

INVOICE TO: (IF DIFFERENT)

CONTACT INFORMATION:

Company: Weston Solutions, Inc	Company: Weston Solutions, Inc	Contact: Elliott Petri	Contact:
Address: 1435 Garrison St Suite 100	Address:	Phone: 303-729-6156	Phone:
Lakewood, CO 80215		Fax:	Fax:
		Cell/pager: 719-216-2754	Cell/pager:
Project Number and/or P.O. #: 20408.016.003.0555.02		Final Data Deliverable Email Address:	
Project Description/Location: Hitching Post		Elliott.Petri@WestonSolutions.com	

ASBESTOS LABORATORY HOURS: Weekdays: 7am - 7pm		REQUESTED ANALYSIS										VALID MATRIX CODES				LAB NOTES:
PLM / PCM / TEM ☐ RUSH (Same Day) ☐ PRIORITY (Next Day) ☒ STANDARD (Rush PCM = 2hr, TEM = 6hr.)		PLM - Short report, Long report, Point Count	TEM - AHERA, Level II, 7402, ISO, +/-, Quant, Semi-quant, Micro-vac, ISO-Indirect Preps	PCM - 7400A, 7400B, OSHA	DUST - Total, Respirable	METALS - Analyte(s) RCRA 8, TCLP, Welding Fume, Metals Scan	ORGANICS - METH	Salmonella +/- E.coli O157 H7: +/- Listeria +/- Aerobic Plate Count +/- or Quantification E.coli +/- or Quantification Coliforms +/- or Quantification S.aureus +/- or Quantification Y & M +/- or Quantification Mold +/-, Identification, Quantification	MICROBIOLOGY	SAMPLER'S INITIALS OR OTHER NOTES	Air = A	Bulk = B				
CHEMISTRY LABORATORY HOURS: Weekdays: 8am - 5pm											Dust = D	Paint = P				
Metal(s) / Dust ☐ RUSH ☐ 24 hr. ☐ 3-5 Day											Soil = S	Wipe = W				
RCRA 8 / Metals & Welding Fume Scan / TCLP ☐ RUSH ☐ 5 day ☐ 10 day											Swab = SW	F = Food				
Organics ☐ 24 hr. ☐ 3 day ☐ 5 Day											Drinking Water = DW	Waste Water = WW				
MICROBIOLOGY LABORATORY HOURS: Weekdays: 9am - 6pm											O = Other					
E.coli O157:H7, Coliforms, S.aureus ☐ 24 hr. ☐ 2 Day ☐ 3-5 Day											**ASTM E1792 approved wipe media only**					
Salmonella, Listeria, E.coli, APC, Y & M ☐ 48 Hr. ☐ 3-5 Day											Sample Volume (L) / Area	Matrix Code	# Containers	Date Collected mm/dd/yy	Time Collected hh/mm a/p	EM Number (Laboratory Use Only)
Mold ☐ RUSH ☐ 24 Hr ☐ 48 Hr ☐ 3 Day ☐ 5 Day																
Turnaround times establish a laboratory priority, subject to laboratory volume and are not guaranteed. Additional fees apply for afterhours, weekends and holidays.																
Special Instructions:																
Client sample ID number (Sample ID's must be unique)																
1	HP3-1-DW01-001	X										B	1	2/5/2018		202720
2	HP3-1-DW01-002	X										B	1	2/5/2018		1
3	HP3-1-DW01-003	X										B	1	2/5/2018		2
4	HP3-1-DW01-004	X										B	1	2/5/2018		3
5	HP3-1-DW01-005	X										B	1	2/5/2018		4
6	HP3-1-DW02-006	X										B	1	2/5/2018		5
7	HP3-1-DW02-007	X										B	1	2/5/2018		6
8	HP3-1-DW02-008	X										B	1	2/5/2018		7
9	HP3-1-DW02-009	X										B	1	2/5/2018		8
10	HP3-1-DW02-010	X										B	1	2/5/2018		9

Number of samples received: 333 (Additional samples shall be listed on attached long form.)

NOTE: REI will analyze incoming samples based upon information received and will not be responsible for errors or omissions in calculations resulting from the inaccuracy of original data. By signing client/company representative agrees that submission of the following samples for requested analysis as indicated on this Chain of Custody shall constitute an analytical services agreement with payment terms of NET 30 days, failure to comply with payment terms may result in a 1.5% monthly interest surcharge.

Relinquished By: <u>[Signature]</u>		Date/Time: <u>2/8/18 9:40</u>		Sample Condition: On Ice		Sealed		Intact	
Laboratory Use Only		Received By: <u>Elisamur</u>		Date/Time: <u>2-8-18 9:40</u>		Carrier: <u>Nand</u>		Temp. (F°) <u> </u> Yes / No	
Results:		Contact	Phone	Email	Fax	Date	Time	Initials	
		Contact	Phone	Email	Fax	Date	Time	Initials	

RES Job # 400635

Page 2 of 12

Submitted by: Weston

REQUESTED ANALYSIS																		VALID MATRIX CODES				LAB NOTES:	
PLM - Short report, Long report, Point Count	TEM - AHERA, Level II, 7402, ISO, +/-, Quant, Semi-quant, Micro-vac, ISO-Indirect Preps	PCM - 7400A, 7400B, OSHA	DUST - Total, Respirable	METALS - Analyte(s) RCRA 8, TCLP, Welding Fume, Metals Scan	ORGANICS - METH	Salmonella: +/- E coli O157:H7: +/- Listeria: +/- Aerobic Plate Count: +/- or Quantification E coli: +/- or Quantification Coliforms: +/- or Quantification S aureus: +/- or Quantification Y & M: +/- or Quantification Mold: +/- or Quantification	OTHER -	Air = A Bulk = B Dust = D Paint = P Soil = S Wipe = W Swab = SW F = Food Drinking Water = DW Waste Water = WW O = Other **ASTM E1792 approved wipe media only**				Sample Volume (L) / Area	Matrix Code	# Containers	Date Collected mm/dd/yy	Time Collected hh/mm a/p	EM Number (Laboratory Use Only)						
X													B	1	2/5/2018		2021730						
X													B	1	2/5/2018		1						
X													B	1	2/5/2018		2						
X													B	1	2/5/2018		3						
X													B	1	2/5/2018		4						
X													B	1	2/5/2018		5						
X													B	1	2/5/2018		6						
X													B	1	2/5/2018		7						
X													B	1	2/5/2018		8						
X													B	1	2/5/2018		9						
X													B	1	2/5/2018		10						
X													B	1	2/5/2018		11						
X													B	1	2/5/2018		12						
X													B	1	2/5/2018		13						
X													B	1	2/5/2018		14						
X													B	1	2/5/2018		15						
X													B	1	2/5/2018		16						
X													B	1	2/5/2018		17						
X													B	1	2/5/2018		18						
X													B	1	2/5/2018		19						
X													B	1	2/5/2018		20						
X													B	1	2/5/2018		21						
X													B	1	2/5/2018		22						
X													B	1	2/5/2018		23						
X													B	1	2/5/2018		24						
X													B	1	2/5/2018		25						
X													B	1	2/5/2018		26						
X													B	1	2/5/2018		27						
X													B	1	2/5/2018		28						
X													B	1	2/5/2018		29						
X													B	1	2/5/2018		30						
X													B	1	2/5/2018		31						
X													B	1	2/5/2018		32						
X													B	1	2/5/2018		33						
X													B	1	2/5/2018		34						
X													B	1	2/5/2018		35						
X													B	1	2/5/2018		36						
X													B	1	2/5/2018		37						
X													B	1	2/5/2018		38						
X													B	1	2/5/2018		39						
X													B	1	2/5/2018		40						
X													B	1	2/5/2018		41						
X													B	1	2/5/2018		42						
X													B	1	2/5/2018		43						
X													B	1	2/5/2018		44						
X													B	1	2/5/2018		45						
X													B	1	2/5/2018		46						
X													B	1	2/5/2018		47						
X													B	1	2/5/2018		48						
X													B	1	2/5/2018		49						
X													B	1	2/5/2018		50						
X													B	1	2/5/2018		51						
X													B	1	2/5/2018		52						
X													B	1	2/5/2018		53						
X													B	1	2/5/2018		54						
X													B	1	2/5/2018		55						
X													B	1	2/5/2018		56						
X													B	1	2/5/2018		57						
X													B	1	2/5/2018		58						
X													B	1	2/5/2018		59						
X													B	1	2/5/2018		60						
X													B	1	2/5/2018		61						
X													B	1	2/5/2018		62						
X													B	1	2/5/2018		63						
X													B	1	2/5/2018		64						
X													B	1	2/5/2018		65						
X													B	1	2/5/2018		66						
X													B	1	2/5/2018		67						
X													B	1	2/5/2018		68						
X													B	1	2/5/2018		69						
X													B	1	2/5/2018		70						
X													B	1	2/5/2018		71						
X													B	1	2/5/2018		72						
X													B	1	2/5/2018		73						
X													B	1	2/5/2018		74						
X													B	1	2/5/2018		75						
X													B	1	2/5/2018		76						
X													B	1	2/5/2018		77						
X													B	1	2/5/2018		78						
X													B	1	2/5/2018		79						
X													B	1	2/5/2018		80						
X													B	1	2/5/2018		81						
X													B	1	2/5/2018		82						
X													B	1	2/5/2018		83						
X													B	1	2/5/2018		84						
X													B	1	2/5/2018		85						
X													B	1	2/5/2018		86						
X													B	1	2/5/2018		87						
X													B	1	2/5/2018		88						
X													B	1	2/5/2018		89						
X													B	1	2/5/2018		90						
X													B	1	2/5/2018		91						
X													B	1	2/5/2018		92						
X													B	1	2/5/2018		93						
X													B	1	2/5/2018		94						
X													B	1	2/5/2018		95						
X													B	1	2/5/2018		96						
X													B	1	2/5/2018		97						
X													B	1	2/5/2018		98						
X													B	1	2/5/2018		99						
X													B	1	2/5/2018		100						
X													B	1	2/5/2018		101						
X													B	1	2/5/2018		102						
X													B	1	2/5/2018		103						
X													B	1	2/5/2018		104						
X													B	1	2/5/2018		105						
X													B	1	2/5/2018		106						
X													B	1	2/5/2018		107						
X													B	1	2/5/2018		108						
X													B	1	2/5/2018		109						
X													B	1	2/5/2018		110						
X													B	1	2/5/2018		111						
X													B	1	2/5/2018		112						
X													B	1	2/5/2018		113						
X													B	1	2/5/2018		114						
X													B	1	2/5/2018		115						
X													B	1	2/5/2018		116						
X													B	1	2/5/2018		117						
X													B	1	2/5/2018		118						
X													B	1	2/5/2018		119						
X													B	1	2/5/2018		120						
X													B	1	2/5/2018		121						
X													B	1	2/5/2018		122						
X													B	1	2/5/2018		123						
X													B	1	2/5/2018		124						
X													B	1	2/5/2018		125						
X													B	1	2/5/2018		126						
X													B	1	2/5/2018		127						
X													B	1	2/5/2018		128						
X																							

RES Job # 400035

Page 3 of 12

Submitted by: _____

Client sample ID number (Sample ID's must be unique)		REQUESTED ANALYSIS										VALID MATRIX CODES				LAB NOTES:
		PLM - Short report, Long report, Point Count	TEM - AHERA, Level II, 7402, ISO, +/-, Quant, Semi-quant, Micro-vac, ISO-Indirect Preps	PCM - 7400A, 7400B, OSHA	DUST - Total, Respirable	METALS - Analyte(s) RCRA 8, TCLP, Welding Fume, Metals Scan	ORGANICS - METH	Salmonella +/- E coli O157:H7 +/- Listeria +/-	Aerobic Plate Count +/- or Quantification E coli +/- or Quantification Coliforms +/- or Quantification S aureus +/- or Quantification Y & M +/- or Quantification Mold +/- or Quantification	OTHER -	Sample Volume (L) / Area	Matrix Code	# Containers	Date Collected mm/dd/yy	Time Collected hh/mm a/p	EM Number (Laboratory Use Only)
42	HP3-2-WP01-042	X										B	1	2/6/2018		2012761
43	HP3-2-CD01-043	X										B	1	2/6/2018		2
44	HP3-2-CD01-044	X										B	1	2/6/2018		3
45	HP3-2-CD01-045	X										B	1	2/6/2018		5
46	HP3-2-CD01-046	X										B	1	2/6/2018		5
47	HP3-2-CD01-047	X										B	1	2/6/2018		5
48	HP3-2-CD02-048	X										B	1	2/6/2018		5
49	HP3-2-CD02-049	X										B	1	2/6/2018		5
50	HP3-2-CD02-050	X										B	1	2/6/2018		5
51	HP3-2-CD02-051	X										B	1	2/6/2018		5
52	HP3-2-CD02-052	X										B	1	2/6/2018		5
53	HP3-2-CD02-053	X										B	1	2/6/2018		5
54	HP3-2-CD02-054	X										B	1	2/6/2018		5
55	HP3-2-CD03-055	X										B	1	2/6/2018		5
56	HP3-2-CD03-056	X										B	1	2/6/2018		5
57	HP3-2-CD03-057	X										B	1	2/6/2018		5
58	HP3-2-CP01-058	X										B	1	2/6/2018		5
59	HP3-2-CP02-059	X										B	1	2/6/2018		5
60	HP4-1-EP01-060	X										B	1	2/6/2018		5
61	HP4-1-DW01-061	X										B	1	2/6/2018		5
62	HP4-1-DW01-062	X										B	1	2/6/2018		5
63	HP4-1-DW01-063	X										B	1	2/6/2018		5
64	HP4-1-DW01-064	X										B	1	2/6/2018		5
65	HP4-1-DW01-065	X										B	1	2/6/2018		5
66	HP4-1-DW01-066	X										B	1	2/7/2018		5
67	HP4-1-DW01-067	X										B	1	2/6/2018		5
68	HP4-1-DW01-068	X										B	1	2/7/2018		5
69	HP4-1-DW01-069	X										B	1	2/6/2018		5
70	HP4-1-DW01-070	X										B	1	2/6/2018		5
71	HP4-1-FT01-071	X										B	1	2/6/2018		5
72	HP4-1-CD01-072	X										B	1	2/6/2018		5

RES Job # 100235

Page 4 of 12

Submitted by: _____

Client sample ID number		(Sample ID's must be unique)											REQUESTED ANALYSIS											VALID MATRIX CODES		LAB NOTES:
		PLM	TEM Semi	PCM	DUST	METALS RCRA	ORGANICS	MICROBIOLOGY					OTH	Sample (L)	Matrix (L)	# Containers	Date Collected	Time Collected	EM Number (Laboratory Use Only)							
73	HP4-1-CD01-073	X												B	1	2/7/2018		20121791								
74	HP4-1-CD01-074	X												B	1	2/7/2018										
75	HP4-1-CD01-075	X												B	1	2/7/2018										
76	HP4-1-CD01-076	X												B	1	2/7/2018										
77	HP4-1-CD02-077	X												B	1	2/6/2018										
78	HP4-1-CD02-078	X												B	1	2/6/2018										
79	HP4-1-CD02-079	X												B	1	2/6/2018										
80	HP4-1-CD02-080	X												B	1	2/6/2018										
81	HP4-1-CD02-081	X												B	1	2/6/2018										
82	HP4-1-CD02-082	X												B	1	2/6/2018										
83	HP4-1-CD02-083	X												B	1	2/6/2018										
84	HP4-1-CD02-084	X												B	1	2/6/2018										
85	HP4-1-CD03-085	X												B	1	2/6/2018										
86	HP4-1-CD03-086	X												B	1	2/6/2018										
87	HP4-1-CD03-087	X												B	1	2/6/2018										
88	HP4-1-CD03-088	X												B	1	2/6/2018										
89	HP4-1-CD03-089	X												B	1	2/6/2018										
90	HP4-1-CP01-090	X												B	1	2/6/2018										
91	HP4-1-CP02-091	X												B	1	2/6/2018										
92	HP4-1-DW02-092	X												B	1	2/6/2018										
93	HP4-1-DW02-093	X												B	1	2/6/2018										
94	HP4-1-DW02-094	X												B	1	2/6/2018										
95	HP4-2-CD01-095	X												B	1	2/6/2018										
96	HP4-2-CD01-096	X												B	1	2/6/2018										
97	HP4-2-CD01-097	X												B	1	2/6/2018										
98	HP4-2-CD01-098	X												B	1	2/6/2018										
99	HP4-2-CD01-099	X												B	1	2/6/2018										
100	HP4-2-CD01-100	X												B	1	2/6/2018										
101	HP4-2-CD01-101	X												B	1	2/6/2018										
102	HP4-2-CD02-102	X												B	1	2/6/2018										
103	HP4-2-CD02-103	X												B	1	2/6/2018										

RES Job # 400235

Page 5 of 12

Submitted by: _____

Client sample ID number		(Sample ID's must be unique)															PLM	TEM	PCM	DUS	MET	RCR	ORG	MICROBIOLOGY												OTH	Sam	Mat	#	Co	
104	HP4-2-CD02-104																X																		B	1	2/6/2018			20121823 HP4-2-CD02-104-109 HP4-2-CD03-122-129 HP4-2-DW01-127-131 HP4-2-WP01-132-134	
105	HP4-2-CD02-105																X																		B	1	2/6/2018				
106	HP4-2-CD02-106																X																		B	1	2/6/2018				
107	HP4-2-CD02-107																X																		B	1	2/6/2018				
108	HP4-2-CD02-108																X																		B	1	2/6/2018				
109	HP4-2-CD02-109																X																		B	1	2/6/2018				
110	HP-BW-PC01-110																X																		B	1	2/6/2018				
111	HP-BW-PC01-111																X																		B	1	2/6/2018				
112	HP-BW-PC01-112																X																		B	1	2/6/2018				
113	HP-BW-WP01-113																X																		B	1	2/6/2018				
114	HP-BW-WP01-114																X																		B	1	2/6/2018				
115	HP-BW-WP01-115																X																		B	1	2/6/2018				
116	HP-BW-WP01-116																X																		B	1	2/6/2018				
117	HP-BW-WP01-117																X																		B	1	2/6/2018				
118	HP5-1-PJ01-118																X																		B	1	2/6/2018				
119	HP5-1-PJ01-119																X																		B	1	2/6/2018				
120	HP5-1-PJ01-120																X																		B	1	2/6/2018				
121	HP5-1-PJ01-121																X																		B	1	2/6/2018				
122	HP4-2-CD03-122																X																		B	1	2/7/2018				
123	HP4-2-CD03-123																X																		B	1	2/7/2018				
124	HP4-2-CD03-124																X																		B	1	2/7/2018				
125	HP4-2-CD03-125																X																		B	1	2/7/2018				
126	HP4-2-CD03-126																X																		B	1	2/7/2018				
127	HP4-2-DW01-127																X																		B	1	2/7/2018				
128	HP4-2-DW01-128																X																		B	1	2/7/2018				
129	HP4-2-DW01-129																X																		B	1	2/7/2018				
130	HP4-2-DW01-130																X																		B	1	2/7/2018				
131	HP4-2-DW01-131																X																		B	1	2/7/2018				
132	HP4-2-WP01-132																X																		B	1	2/7/2018				
133	HP4-2-WP01-133																X																		B	1	2/7/2018				
134	HP4-2-WP01-134																X																		B	1	2/7/2018				

Page 6 of 12

Submitted by: _____

[illegible]

RES Job # 400035

Page 7 of 12

Submitted by: _____

Client sample ID number		(Sample ID's must be unique)										PLM	TEM	PCM	DUST	METALS	ORGANICS	MICROBIOLOGY										OTHER	Sample (L) /	Matrix	# Col		
166	HP5-2-WP01-166	X																							B	1	2/7/2018		2012188				
167	HP5-2-WP01-167	X																							B	1	2/7/2018						
168	HP5-2-WP01-168	X																							B	1	2/7/2018						
169	HP5-2-WP01-169	X																							B	1	2/7/2018						
170	HP5-2-WP01-170	X																							B	1	2/7/2018						
171	HP5-2-WP01-171	X																							B	1	2/7/2018						
172	HP5-2-WP01-172	X																							B	1	2/7/2018						
173	HP5-2-PC01-173	X																							B	1	2/7/2018						
174	HP5-2-PC01-174	X																							B	1	2/7/2018						
175	HP5-2-PC01-175	X																							B	1	2/7/2018						
176	HP5-2-PC01-176	X																							B	1	2/7/2018						
177	HP5-2-PC01-177	X																							B	1	2/7/2018						
178	HP5-2-PC01-178	X																							B	1	2/7/2018						
179	HP5-2-PC01-179	X																							B	1	2/7/2018						
180	HP5-2-CD01-180	X																							B	1	2/7/2018						
181	HP5-2-CD01-181	X																							B	1	2/7/2018						
182	HP5-2-CD01-182	X																							B	1	2/7/2018						
183	HP5-2-CD01-183	X																							B	1	2/7/2018						
184	HP5-2-CD01-184	X																							B	1	2/7/2018						
185	HP5-2-CD01-185	X																							B	1	2/7/2018						
186	HP5-2-CP01-186	X																							B	1	2/7/2018						
187	HP5-2-CP02-187	X																							B	1	2/7/2018						
188	HP-BW-RM01-188	X																							B	1	2/7/2018						
189	HP4-R-RM01-189	X																							B	1	2/7/2018						
190	HP4-R-RF01-190	X																							B	1	2/7/2018						
191	HP4-R-RS01-191	X																							B	1	2/7/2018						
192	HP1-1-CD01-301	X																							B	1	2/7/2018						
193	HP1-1-CD01-302	X																							B	1	2/7/2018						
194	HP1-1-CD01-303	X																							B	1	2/7/2018						
195	HP1-1-WP01-304	X																							B	1	2/7/2018						
196	HP1-1-WP01-305	X																							B	1	2/7/2018						



5801 Logan St. Denver, CO 80216 • Ph. 303 964-1986 • Fax 303 477-4275 • Toll Free 866 RES-ENV

100035

Page 8 of 12

Submitted by:

Client sample ID number	(Sample ID's must be unique)	PLM	TEM	Semi	PCM	DUS	MET	RCR	ORG	S	E	L	A	E	O	S	Y	N	OTHER	Sam	Matr	# Co	
																				(L) /			
197	HP1-1-WP01-306	X																		B	1	2/7/2018	2061916
198	HP1-1-WP01-307	X																		B	1	2/7/2018	
199	HP1-1-WP01-308	X																		B	1	2/7/2018	
200	HP1-1-WP01-309	X																		B	1	2/7/2018	
201	HP1-1-WP01-310	X																		B	1	2/7/2018	
202	HP1-1-WP01-311	X																		B	1	2/7/2018	
203	HP1-1-WP01-312	X																		B	1	2/7/2018	
204	HP1-1-CD02-313	X																		B	1	2/7/2018	
205	HP1-1-CD02-314	X																		B	1	2/7/2018	
206	HP1-1-CD02-315	X																		B	1	2/7/2018	
207	HP1-1-CD02-316	X																		B	1	2/7/2018	
208	HP1-1-CD02-317	X																		B	1	2/7/2018	
209	HP1-1-CD02-318	X																		B	1	2/7/2018	
210	HP1-1-CD02-319	X																		B	1	2/7/2018	
211	HP1-1-CD02-320	X																		B	1	2/7/2018	
212	HP1-1-CD02-321	X																		B	1	2/7/2018	
213	HP1-1-CD02-322	X																		B	1	2/7/2018	
214	HP1-2-CD01-323	X																		B	1	2/7/2018	
215	HP1-2-CD01-324	X																		B	1	2/7/2018	
216	HP1-2-CD01-325	X																		B	1	2/7/2018	
217	HP1-2-CD01-326	X																		B	1	2/7/2018	
218	HP1-2-CD01-327	X																		B	1	2/7/2018	
219	HP1-2-CD01-328	X																		B	1	2/7/2018	
220	HP1-2-CD01-329	X																		B	1	2/7/2018	
221	HP1-2-CD01-330	X																		B	1	2/7/2018	
222	HP1-2-CD01-331	X																		B	1	2/7/2018	
223	HP1-2-CD01-332	X																		B	1	2/7/2018	
224	HP1-2-WP01-333	X																		B	1	2/7/2018	
225	HP1-2-WP01-334	X																		B	1	2/7/2018	
226	HP1-2-WP01-335	X																		B	1	2/7/2018	
227	HP1-2-WP01-336	X																		B	1	2/7/2018	

RES Job #

4000235

Page 9 of 12

Submitted by:

Client sample ID number		(Sample ID's must be unique)		PLM	TEM	Semi	PCM	DUST	METALS	RCRA	ORGANICS	SAFETY	OTHER	OTH	Sample (L) /	Matrix	# Containers	Date Collected	Time Collected	EM Number
228	HP1-2-WP01-337			X												B	1	2/7/2018		20121947
229	HP1-2-WP01-338			X												B	1	2/7/2018		
230	HP1-2-WP01-339			X												B	1	2/7/2018		
231	HP1-2-WP01-340			X												B	1	2/7/2018		
232	HP1-2-WP01-341			X												B	1	2/7/2018		
233	HP1-2-CD02-342			X												B	1	2/7/2018		
234	HP1-2-CD02-343			X												B	1	2/7/2018		
235	HP1-2-CD02-344			X												B	1	2/7/2018		
236	HP1-2-CP01-345			X												B	1	2/7/2018		
237	HP1-2-CP02-346			X												B	1	2/7/2018		
238	HP1-2-CP03-347			X												B	1	2/7/2018		
239	HP2-2-WP01-348			X												B	1	2/7/2018		
240	HP2-2-WP01-349			X												B	1	2/7/2018		
241	HP2-2-WP01-350			X												B	1	2/7/2018		
242	HP2-2-WP01-351			X												B	1	2/7/2018		
243	HP2-2-WP01-352			X												B	1	2/7/2018		
244	HP2-2-WP01-353			X												B	1	2/7/2018		
245	HP2-2-WP01-354			X												B	1	2/7/2018		
246	HP2-2-WP01-355			X												B	1	2/7/2018		
247	HP2-2-WP01-356			X												B	1	2/7/2018		
248	HP2-2-WP01-357			X												B	1	2/7/2018		
249	HP2-2-CD01-358			X												B	1	2/7/2018		
250	HP2-2-CD01-359			X												B	1	2/7/2018		
251	HP2-2-CD01-360			X												B	1	2/7/2018		
252	HP2-2-CD01-361			X												B	1	2/7/2018		
253	HP2-2-CD01-362			X												B	1	2/7/2018		
254	HP2-2-CD01-363			X												B	1	2/7/2018		
255	HP2-2-CD01-364			X												B	1	2/7/2018		
256	HP2-2-CD01-365			X												B	1	2/7/2018		
257	HP2-2-CD01-366			X												B	1	2/7/2018		
258	HP2-2-CD02-367			X												B	1	2/7/2018		

20121947
 6000235-6000236-6000237-6000238-6000239-6000240-6000241-6000242-6000243-6000244-6000245-6000246-6000247-6000248-6000249-6000250-6000251-6000252-6000253-6000254-6000255-6000256-6000257-6000258-6000259-6000260-6000261-6000262-6000263-6000264-6000265-6000266-6000267-6000268-6000269-6000270-6000271-6000272-6000273-6000274-6000275-6000276-6000277-6000278-6000279-6000280-6000281-6000282-6000283-6000284-6000285-6000286-6000287-6000288-6000289-6000290-6000291-6000292-6000293-6000294-6000295-6000296-6000297-6000298-6000299-6000300-6000301-6000302-6000303-6000304-6000305-6000306-6000307-6000308-6000309-6000310-6000311-6000312-6000313-6000314-6000315-6000316-6000317-6000318-6000319-6000320-6000321-6000322-6000323-6000324-6000325-6000326-6000327-6000328-6000329-6000330-6000331-6000332-6000333-6000334-6000335-6000336-6000337-6000338-6000339-6000340-6000341-6000342-6000343-6000344-6000345-6000346-6000347-6000348-6000349-6000350-6000351-6000352-6000353-6000354-6000355-6000356-6000357-6000358-6000359-6000360-6000361-6000362-6000363-6000364-6000365-6000366-6000367-6000368-6000369-6000370-6000371-6000372-6000373-6000374-6000375-6000376-6000377-6000378-6000379-6000380-6000381-6000382-6000383-6000384-6000385-6000386-6000387-6000388-6000389-6000390-6000391-6000392-6000393-6000394-6000395-6000396-6000397-6000398-6000399-6000400-6000401-6000402-6000403-6000404-6000405-6000406-6000407-6000408-6000409-6000410-6000411-6000412-6000413-6000414-6000415-6000416-6000417-6000418-6000419-6000420-6000421-6000422-6000423-6000424-6000425-6000426-6000427-6000428-6000429-6000430-6000431-6000432-6000433-6000434-6000435-6000436-6000437-6000438-6000439-6000440-6000441-6000442-6000443-6000444-6000445-6000446-6000447-6000448-6000449-6000450-6000451-6000452-6000453-6000454-6000455-6000456-6000457-6000458-6000459-6000460-6000461-6000462-6000463-6000464-6000465-6000466-6000467-6000468-6000469-6000470-6000471-6000472-6000473-6000474-6000475-6000476-6000477-6000478-6000479-6000480-6000481-6000482-6000483-6000484-6000485-6000486-6000487-6000488-6000489-6000490-6000491-6000492-6000493-6000494-6000495-6000496-6000497-6000498-6000499-6000500-6000501-6000502-6000503-6000504-6000505-6000506-6000507-6000508-6000509-6000510-6000511-6000512-6000513-6000514-6000515-6000516-6000517-6000518-6000519-6000520-6000521-6000522-6000523-6000524-6000525-6000526-6000527-6000528-6000529-6000530-6000531-6000532-6000533-6000534-6000535-6000536-6000537-6000538-6000539-6000540-6000541-6000542-6000543-6000544-6000545-6000546-6000547-6000548-6000549-6000550-6000551-6000552-6000553-6000554-6000555-6000556-6000557-6000558-6000559-6000560-6000561-6000562-6000563-6000564-6000565-6000566-6000567-6000568-6000569-6000570-6000571-6000572-6000573-6000574-6000575-6000576-6000577-6000578-6000579-6000580-6000581-6000582-6000583-6000584-6000585-6000586-6000587-6000588-6000589-6000590-6000591-6000592-6000593-6000594-6000595-6000596-6000597-6000598-6000599-6000600-6000601-6000602-6000603-6000604-6000605-6000606-6000607-6000608-6000609-6000610-6000611-6000612-6000613-6000614-6000615-6000616-6000617-6000618-6000619-6000620-6000621-6000622-6000623-6000624-6000625-6000626-6000627-6000628-6000629-6000630-6000631-6000632-6000633-6000634-6000635-6000636-6000637-6000638-6000639-6000640-6000641-6000642-6000643-6000644-6000645-6000646-6000647-6000648-6000649-6000650-6000651-6000652-6000653-6000654-6000655-6000656-6000657-6000658-6000659-6000660-6000661-6000662-6000663-6000664-6000665-6000666-6000667-6000668-6000669-6000670-6000671-6000672-6000673-6000674-6000675-6000676-6000677-6000678-6000679-6000680-6000681-6000682-6000683-6000684-6000685-6000686-6000687-6000688-6000689-6000690-6000691-6000692-6000693-6000694-6000695-6000696-6000697-6000698-6000699-6000700-6000701-6000702-6000703-6000704-6000705-6000706-6000707-6000708-6000709-6000710-6000711-6000712-6000713-6000714-6000715-6000716-6000717-6000718-6000719-6000720-6000721-6000722-6000723-6000724-6000725-6000726-6000727-6000728-6000729-6000730-6000731-6000732-6000733-6000734-6000735-6000736-6000737-6000738-6000739-6000740-6000741-6000742-6000743-6000744-6000745-6000746-6000747-6000748-6000749-6000750-6000751-6000752-6000753-6000754-6000755-6000756-6000757-6000758-6000759-6000760-6000761-6000762-6000763-6000764-6000765-6000766-6000767-6000768-6000769-6000770-6000771-6000772-6000773-6000774-6000775-6000776-6000777-6000778-6000779-6000780-6000781-6000782-6000783-6000784-6000785-6000786-6000787-6000788-6000789-6000790-6000791-6000792-6000793-6000794-6000795-6000796-6000797-6000798-6000799-6000800-6000801-6000802-6000803-6000804-6000805-6000806-6000807-6000808-6000809-6000810-6000811-6000812-6000813-6000814-6000815-6000816-6000817-6000818-6000819-6000820-6000821-6000822-6000823-6000824-6000825-6000826-6000827-6000828-6000829-6000830-6000831-6000832-6000833-6000834-6000835-6000836-6000837-6000838-6000839-6000840-6000841-6000842-6000843-6000844-6000845-6000846-6000847-6000848-6000849-6000850-6000851-6000852-6000853-6000854-6000855-6000856-6000857-6000858-6000859-6000860-6000861-6000862-6000863-6000864-6000865-6000866-6000867-6000868-6000869-6000870-6000871-6000872-6000873-6000874-6000875-6000876-6000877-6000878-6000879-6000880-6000881-6000882-6000883-6000884-6000885-6000886-6000887-6000888-6000889-6000890-6000891-6000892-6000893-6000894-6000895-6000896-6000897-6000898-6000899-6000900-6000901-6000902-6000903-6000904-6000905-6000906-6000907-6000908-6000909-6000910-6000911-6000912-6000913-6000914-6000915-6000916-6000917-6000918-6000919-6000920-6000921-6000922-6000923-6000924-6000925-6000926-6000927-6000928-6000929-6000930-6000931-6000932-6000933-6000934-6000935-6000936-6000937-6000938-6000939-6000940-6000941-6000942-6000943-6000944-6000945-6000946-6000947-6000948-6000949-6000950-6000951-6000952-6000953-6000954-6000955-6000956-6000957-6000958-6000959-6000960-6000961-6000962-6000963-6000964-6000965-6000966-6000967-6000968-6000969-6000970-6000971-6000972-6000973-6000974-6000975-6000976-6000977-6000978-6000979-6000980-6000981-6000982-6000983-6000984-6000985-6000986-6000987-6000988-6000989-6000990-6000991-6000992-6000993-6000994-6000995-6000996-6000997-6000998-6000999-6001000-6001001-6001002-6001003-6001004-6001005-6001006-6001007-6001008-6001009-6001010-6001011-6001012-6001013-6001014-6001015-6001016-6001017-6001018-6001019-6001020-6001021-6001022-6001023-6001024-6001025-6001026-6001027-6001028-6001029-6001030-6001031-6001032-6001033-6001034-6001035-6001036-6001037-6001038-6001039-6001040-6001041-6001042-6001043-6001044-6001045-6001046-6001047-6001048-6001049-6001050-6001051-6001052-6001053-6001054-6001055-6001056-6001057-6001058-6001059-6001060-6001061-6001062-6001063-6001064-6001065-6001066-6001067-6001068-6001069-6001070-6001071-6001072-

Client sample ID number	(Sample ID's must be unique)	PLM	TEM	SEM	PCM	DUS	MET	RCP	ORG	MICROBIOLOGY	OTH	San	Mat	#	C	
259	HP2-2-CD02-368	X											B	1	2/7/2018	2021978 2021978-89 2021978-9000515500-89 2021978-9000515500-89 2021978-9000515500-89
260	HP2-2-CD02-369	X											B	1	2/7/2018	
261	HP2-2-DG01-370	X											B	1	2/7/2018	
262	HP2-2-CP01-371	X											B	1	2/7/2018	
263	HP2-2-CP02-372	X											B	1	2/7/2018	
264	HP2-2-CP03-373	X											B	1	2/7/2018	
265	HP2-1-CD01-374	X											B	1	2/7/2018	
266	HP2-1-CD01-375	X											B	1	2/7/2018	
267	HP2-1-CD01-376	X											B	1	2/7/2018	
268	HP2-1-CD01-377	X											B	1	2/7/2018	
269	HP2-1-CD01-378	X											B	1	2/7/2018	
270	HP2-1-CD01-379	X											B	1	2/7/2018	
271	HP2-1-CD01-380	X											B	1	2/7/2018	
272	HP2-1-CD01-381	X											B	1	2/7/2018	
273	HP2-1-CD01-382	X											B	1	2/7/2018	
274	HP2-1-CD01-383	X											B	1	2/7/2018	
275	HP2-1-CD02-384	X											B	1	2/7/2018	
276	HP2-1-CD02-385	X											B	1	2/7/2018	
277	HP2-1-CD02-386	X											B	1	2/7/2018	
278	HP2-1-WP01-387	X											B	1	2/7/2018	
279	HP2-1-WP01-388	X											B	1	2/7/2018	
280	HP2-1-WP01-389	X											B	1	2/7/2018	
281	HP2-1-WP01-390	X											B	1	2/7/2018	
282	HP2-1-WP01-391	X											B	1	2/7/2018	
283	HP2-1-WP01-392	X											B	1	2/7/2018	
284	HP2-1-WP01-393	X											B	1	2/7/2018	
285	HP2-1-WP01-394	X											B	1	2/7/2018	
286	HP2-1-WP01-395	X											B	1	2/7/2018	
287	HP5-3-PC01-396	X											B	1	2/7/2018	
288	HP5-3-PC01-397	X											B	1	2/7/2018	
289	HP5-3-PC01-398	X											B	1	2/7/2018	

Page 11 of 12

Submitted by: _____

[illegible]

Split Sheet

2021964

Company:

Weston

RES:

400635

SEQ#:

-2

Contact:

Due Date:

2-28

Date/Time:

2-21-81

Time:

EM Number	Analysis/Turnaround	Volume
2021740	P.T C-T 3-5	
029		
2032		
2033		

Taken By:

Mike Ave Greg Bri
Liu

APPENDIX C
INSPECTOR CERTIFICATIONS



CHC Training
Nationwide Training & Certification Experts
www.trainingchc.com
303.412.6360
(855) 60.CERTIFY

1775 West 55th Avenue
Denver, CO 80221,
United States of America

CERTIFICATE OF ACHIEVEMENT

This certificate is awarded to:

ELLIOTT PETRI

In recognition of satisfactory completion of the EPA-approved annual asbestos
refresher training course under section 206 of the Toxic Substance Control Act (TSCA),

Title II entitled:

BUILDING INSPECTOR

COURSE DATE:

DECEMBER 20, 2017

EXPIRATION DATE

DECEMBER 20, 2018

COURSE HOURS:

4.0

Verify Credential



Danaya N. Benedetto

Co-Founder & CEO
Training Program Manager

Credential License ID: 11081150



Frank Hulce

Instructor

CHC Training Certificate No.
R17-2186-AI-CO

Visit our Website



GHP GOBBELL HAYS PARTNERS, INC.

ENVIRONMENTAL
+ ARCHITECTURE

12015 East 46th Avenue #450 ♦ Denver, CO 80239

Ph. (303) 574-0082 ♦ Fax (303) 574-0061

CERTIFIES THAT

Michael Cherny

Has successfully completed

The 4-Hour **EPA-APPROVED AHERA ASBESTOS COURSE** for Building Inspector Refresher.
This course is EPA-approved under Section 206 of the Toxic Substances Control Act (TSCA)
and meets the requirements of Colorado Regulation No. 8.

Gobbell Hays Partners, Inc. purchased MCA Environmental, Inc. and course approval can
be found in the EPA directory under MCA Environmental, Inc. listed as training provider #931.



Course Date: 01/09/2018
Certificate No.: 0118-BIR-GHP01
Expiration Date: 01/09/2019

A handwritten signature in cursive script, reading 'John Peterson'.

John Peterson – Instructor

A handwritten signature in cursive script, reading 'Morgan Douglas'.

Morgan Douglas – Training Coordinator

United States Environmental Protection Agency

This is to certify that



Elliott B Petri

has fulfilled the requirements of the Toxic Substances Control Act (TSCA) Section 402, and has received certification to conduct lead-based paint activities pursuant to 40 CFR Part 745.226 as:

Inspector

In the Jurisdiction of:

All EPA Administered Lead-based Paint Activities Program States, Tribes and Territories

This certification is valid from the date of issuance and expires November 24, 2019

LBP-I-171271-1

Certification #

November 10, 2016

Issued On



Adrienne Priselac, Manager, Toxics Office

Land Division



1775 West 55th Avenue
Denver, CO 80221
303.410.4941
trainingchc.com



Certifies that

Elliott Petri


*Has successfully completed the required training hours and passed the examination required by the
Colorado Department of Public Health and Environment for:*

Lead-Based Paint Inspector Initial


*For the purposes of accreditation under the Colorado Department of Public Health and Environment
Regulation No. 19 and other standard developed by EPA pursuant to Title IV of TSCA*

Course Date: April 25 - 27, 2016
Certificate No.: I16-044-LI-CO
No. of Hours: 24
Expiration Date: April 27, 2019

Certification not valid without watermark

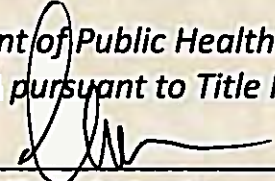

Lauren York - Instructor



Danaya Benedetto - Training Program Manager