

Cabinet: monitoring, closing and shift reports

This is an informational translation. The matching Russian revision is authoritative. Manager's guide for the second half of a shift's life: watching production on the dashboard, closing a shift from the cabinet, data that arrives after the close, reports for GIS MT and the reasons they fail.

Document code	MKR-INS-09
Revision	2026.09/04
Effective from	19 September 2026
Revision verification	https://markiro.app/d/MKR-INS-09/2026.09/04/19.09.2026
Language	EN
Operator	Богатырев Владислав Сергеевич
Contacts	https://markiro.app · hello@v-b.tech · +7 934 355-14-90

1. Purpose

This instruction covers the cabinet manager's work while a shift is running and after it ends: watching production, closing a shift from the cabinet, dealing with data that arrives after the close, and generating reports for GIS MT. Preparing and planning a shift are covered by MKR-INS-08; the operator opens the shift and runs the work cycle on the station — MKR-INS-01 and MKR-INS-02.

A shift goes through the states “Active” — production is under way — and “Closed” — production is over and the reports are available. Everything below concerns these two states; the “Planned” state is covered by MKR-INS-08.


Note: The screenshots use demo data. The numbers, quantities and names in your cabinet will differ. The wordmark in the sidebar keeps its Russian spelling: it is the Markiro logo, not a translated interface string.

2. Watching production

Step 1. Start the day with the overview

The “Overview” section opens the “Production today” dashboard. At the top left is the “Production control” verdict: “Production is under control” means there are no active reasons to step in, and the cabinet says exactly that — “There are no active reasons for intervention.” Below are the counters for the day: “Validated individually”, “Closed boxes”, “Units in boxes”, “Active shifts”, and the “Shifts running now” panel lists the shifts under way with the output of each.



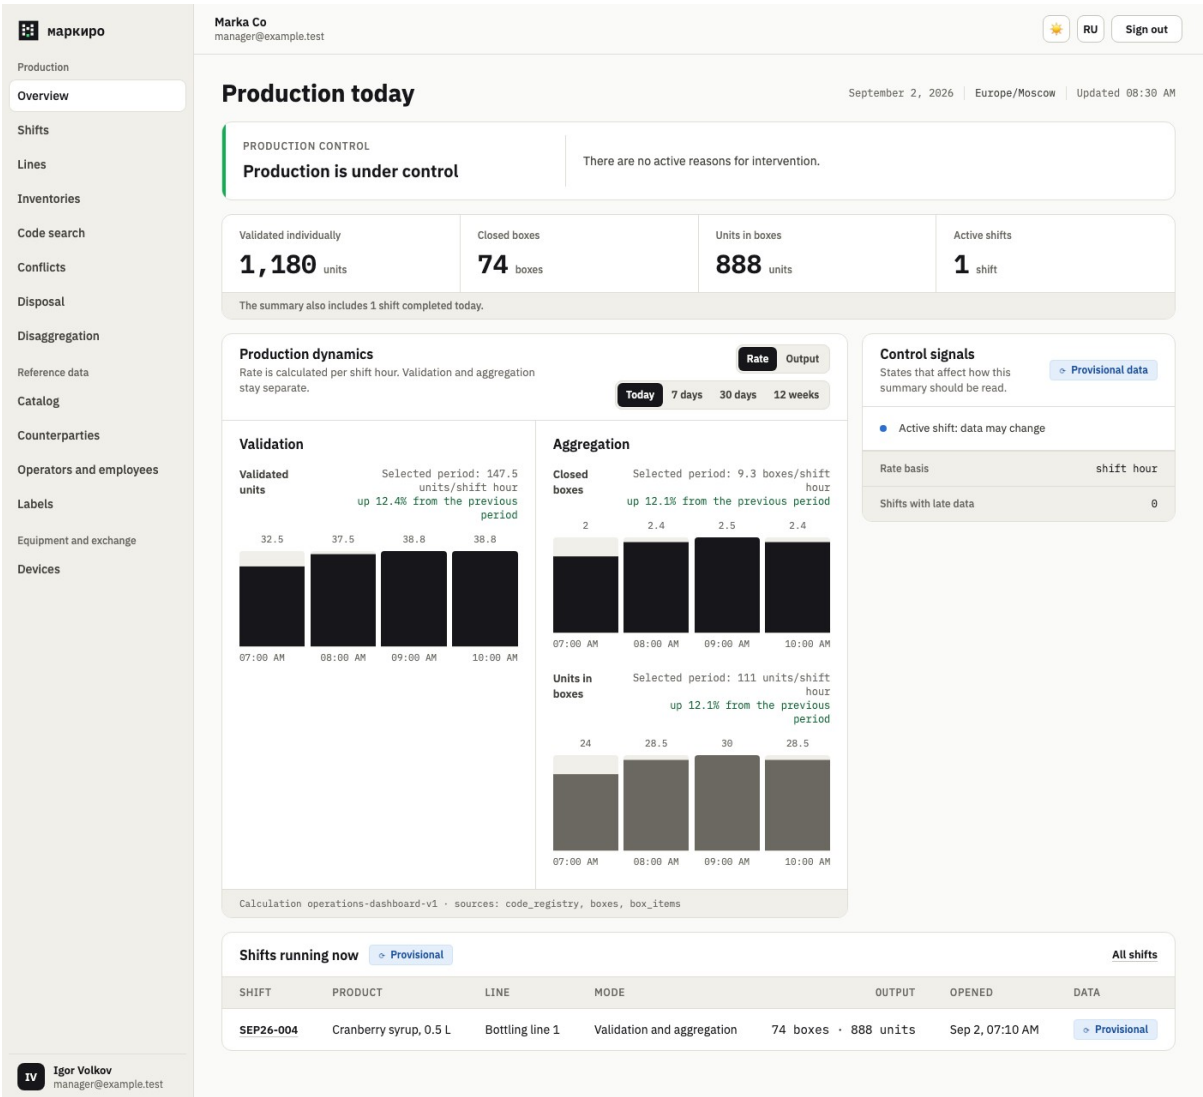


The dashboard: production is under control

Step 2. React to the “Needs attention” verdict

When there are reasons to step in, the verdict changes to “Needs attention” (and for serious problems to “Critical condition”), and the reasons themselves are listed next to it — in the screenshot that is “Late data affected 1 shift”. A reason is a link: it takes you to the affected section. The “Control signals” panel explains how far the current numbers can be trusted.



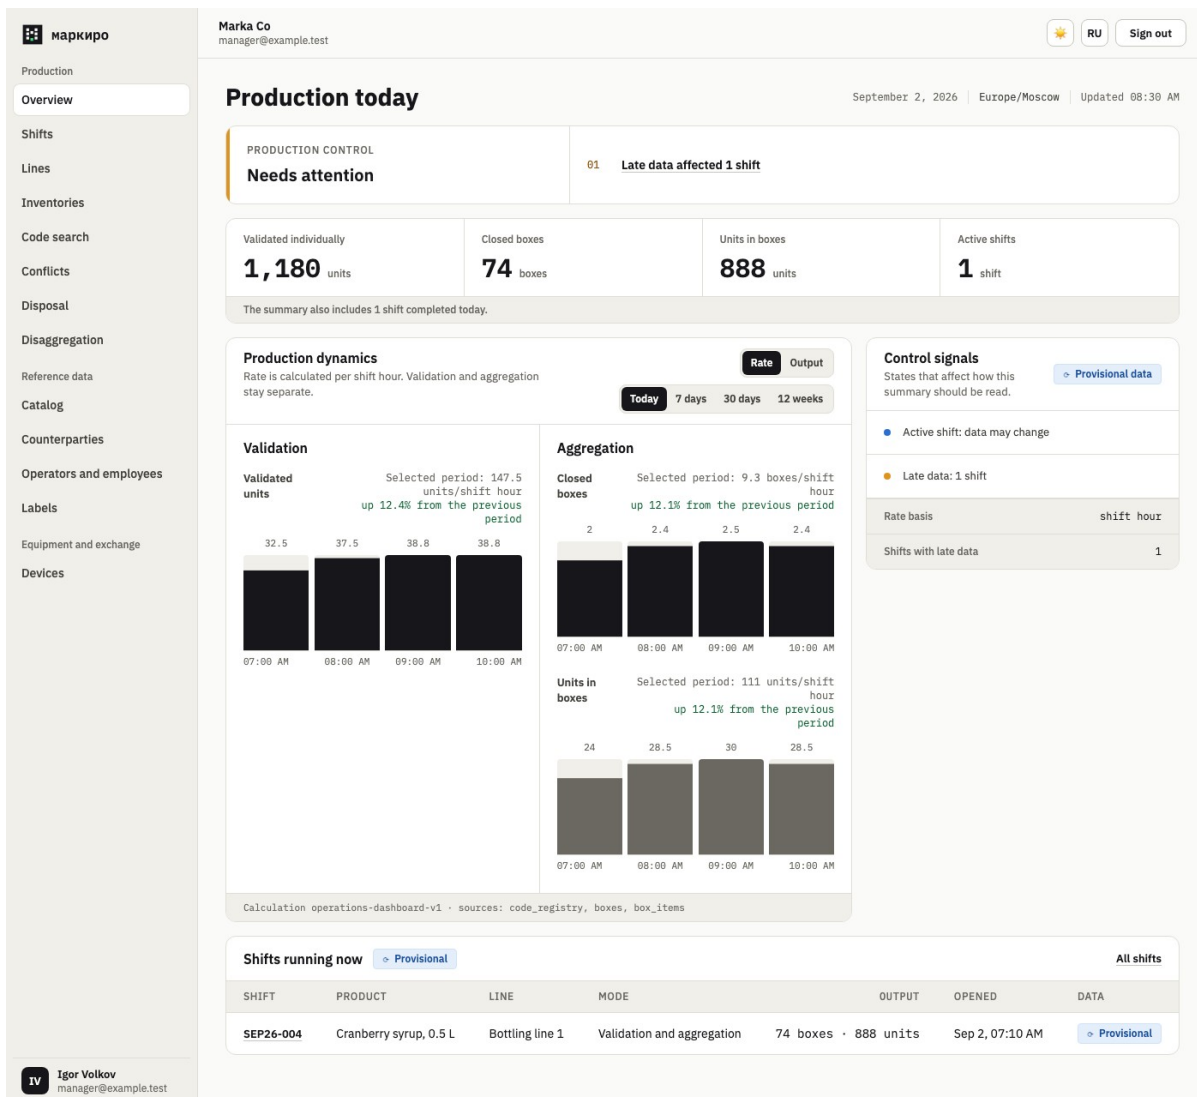

The dashboard: the “Needs attention” verdict and its reason

Note: While shifts are still active, the day's summary is marked “Provisional data” and the signals show “Active shift: data may change” — the stations keep sending scans as the connection allows, and the counters grow. This is not a fault: the numbers become final once the shifts are closed. Production dynamics and rate are outside this document.

3. The shift panel

Everything the cabinet knows about a shift, and every action on it, is gathered in one panel. The row in the list carries a single button, “Details” — that is what opens the panel.

Step 1. Open the shift panel

Press “Details” in the row. The panel opens on the right over the list and is titled with the shift number. “Shift output” comes first: for aggregation that is “Closed boxes” and “Codes in closed boxes”, for validation “Accepted codes”, and “Plan, units” always sits next to them. Below is “Shift parameters” with the dates, the line, the mode and the counterparty.



маркиро

Production

Overview

Shifts

Lines

Inventories

Code search

Conflicts

Disposal

Disaggregation

Reference data

Catalog

Counterparties

Operators and employees

Labels

Equipment and exchange

Devices

Marka Co
manager@example.test

Shifts

StatusAll statusesFromSelect a date

1 shift

SHIFT	PRODUCT
SEP26-004 Shift: 09/02/2026 Production: 09/02/2026	Cranberry syrup, 0 1,152 pcs · 96 bx for: Berry House LLC

Shift SEP26-004

Cranberry syrup, 0.5 L

Shift output

96
Closed boxes

1,152
Codes in closed boxes

4,800
Plan, units

Employees in this shift

4 operations have no employee assigned.

Maria Kuznetsova

Line operator
Activity: 9/2/26, 7:15 AM — 9/2/26, 2:05 PM

Accepted scans
812

Closed boxes
68

Pyotr Smirnov

Role not specified
Activity: 9/2/26, 7:20 AM — 9/2/26, 1:40 PM

Accepted scans
340

Closed boxes
28

Pallets

Placards

SSCC	BOXES	CODES	CLOSED	STATUS
(00)346006820000000014	48	576	8/30/26, 2:20 PM	
(00)346006820000000021	47	564	8/30/26, 3:05 PM	Contents changed after closing
(00)346006820000000038	0	0	8/30/26, 12:40 PM	Taken apart

Shift parameters

Date
09/02/2026

Line
Bottling line 1

Plan, units
4800

Boxes per pallet
48

Production date
09/02/2026

Mode
Aggregation

Counterparty
Berry House LLC

Shift reports

Reports can be requested and downloaded after the shift is closed.

Shift actions

Edit

Close shift

✓ Active

An active shift's panel: output, employees and actions

Expected result: The panel is open and the metrics show the actual output so far.

Step 2. See who worked in the shift

The “Employees in this shift” block lists the operators with their activity and the “Accepted scans” and “Closed boxes” counters. If some of the operations arrived without an employee, the cabinet warns about it on a separate banner — “4 operations have no employee assigned.” in the screenshot above; that is usually what scans made before an operator signs in or after they sign out look like.

Note: If the statistics could not be loaded, the cabinet says so right inside the panel and offers “Retry”. The rest of the shift data and the actions stay available — a statistics failure does not stop you closing the shift.

Step 3. Check the pallets of the shift

The “Pallets” section is shown only for a shift planned with pallets: the “Use pallets” checkbox is set while planning (MKR-INS-08), and other shifts have no such section at all — that is neither a fault nor lost data.



The table describes every pallet in five columns: “SSCC”, “Boxes”, “Codes”, “Closed” and “Status”. There is no separate column for the line — the pallets of one shift are built on one line, and “Shift parameters” below already names it. The SSCC is a link to the pallet's card with its boxes; until an SSCC is assigned, “No SSCC” stands in its place. “Status” carries two independent marks — “Taken apart” and “Contents changed after closing” — and they can appear together. While the shift has no pallets, “No pallets in this shift” stands where the rows would be; if the list could not be requested, the section shows “Could not load this shift's pallets.” and a “Retry” button. An empty list and a failed request are different answers, and the cabinet does not blur them.

Pallets

[Placards](#)

SSCC	BOXES	CODES	CLOSED	STATUS
(00)346006820000000014	48	576	8/30/26, 2:20 PM	
(00)346006820000000021	47	564	8/30/26, 3:05 PM	Contents changed after closing
(00)346006820000000038	0	0	8/30/26, 12:40 PM	Taken apart

The “Pallets” section of the shift panel

Expected result: Every pallet of the shift is visible with its SSCC, its box and code counts, its closing time and its state marks.

Taken apart — The pallet was dismantled — its boxes no longer stand on it; in the screenshot such a pallet shows zeros under “Boxes” and “Codes”. It gets no placard page, and the cabinet will no longer generate a report for that pallet alone (section 7).

No SSCC — An SSCC is assigned to a pallet when it closes, so the absence of one means exactly this: the closing has not reached the cabinet yet — the pallet is still being built on the line, or its closing has not synchronized. Such a row carries a dash under “Closed”, and it gets no placard page.

Contents changed after closing — One of the pallet's boxes was taken apart after the pallet closed: the pallet is a box short and can no longer correct that. The pallet itself stays closed — its placard is still printed, and it goes into reports in its present composition, without the dismantled box.

Step 4. Print the pallet placards

The “Placards” button sits to the right of the “Pallets” heading and opens the “Placards for the shift's pallets” dialog. It asks one thing — “Paper size”: “A4” or “A5”. “Open” hands the document to a new tab, exactly as the dialog warns: “Opens in a new tab — print it on an office printer and attach it to the pallet.”; “Cancel” closes the dialog having printed nothing. One page is printed for every closed, not dismantled pallet of the shift that carries an SSCC — and for no other. So there can be fewer pages than rows in the table: a pallet that was taken apart and a pallet without an SSCC never reach the document, while a pallet marked “Contents changed after closing” is printed like any other. In the screenshot two of the three rows are printed. When there is nothing to print, the “Placards” button is not in the section at all.



Shift SEP26-004
Cranberry syrup, 0.5 L

Shift output

96 Closed boxes	1,152 Codes in closed boxes	4,800 Plan, units
--------------------	--------------------------------	----------------------

Employees in this shift

4 operations have no employee assigned.

Maria Kuznetsova Line operator Activity: 9/2/26, 7:15 AM — 9/2/26, 2:05 PM	Accepted scans 812	Closed boxes 68
Pyotr Smirnov Role not specified Activity: 9/2/26, 7:20 AM — 9/2/26, 1:40 PM	Accepted scans 340	Closed boxes 28

Placards for the shift's pallets

Paper size
☒ A4
☐ A5

Opens in a new tab — print it on an office printer and attach it to the pallet.

Cancel Open

Shift parameters

Date 09/02/2026	Production date 09/02/2026
Line Bottling line 1	Mode Aggregation
Plan, units 4800	Counterparty Berry House LLC
Boxes per pallet 48	

Shift reports

Reports can be requested and downloaded after the shift is closed.

Shift actions

Edit Close shift

✓ Active

The “Placards for the shift's pallets” dialog and its paper size

Expected result: The placard document is open in a new tab and ready to print.

4. Label history

For a shift with Data Matrix duplicate printing enabled (setting it up is covered by MKR-INS-08), the panel gains a “Label history” section. It shows what happened to every printed label: a summary of the send attempts, verifications and reprints, and below it the attempts themselves with their time and state.

Step 1. Check the attempts that need work

The summary tiles — “Sent to printer”, “Verified labels”, “Unfinished jobs”, “Reprint attempts” — show where the shift stands. Records that need work stand out by their state: “Needs attention” instead of “Label verified”, meaning the verification is unfinished or the print was not confirmed. Expand an attempt to see its events. While such records remain, check with the line that every label has been applied.



маркиро

Production

Overview

Shifts

Lines

Inventories

Code search

Conflicts

Disposal

Disaggregation

Reference data

Catalog

Counterparties

Operators and employees

Labels

Equipment and exchange

Devices

Marka Co

manager@example.test

Shifts

Status

All statuses

From

Select a date

1 shift

SHIFT	PRODUCT
SEP26-004	Cranberry syrup, 0
Shift: 09/02/2026	1,240 pcs
Production: 09/02/2026	for: Berry House LLC

Shift SEP26-004

Cranberry syrup, 0.5 L

Shift output

96

Closed boxes

1,152

Codes in closed boxes

4,800

Plan, units

Employees in this shift

4 operations have no employee assigned.

Maria Kuznetsova

Line operator

Activity: 9/2/26, 7:15 AM — 9/2/26, 2:05 PM

Accepted scans

812

Closed boxes

68

Pyotr Smirnov

Role not specified

Activity: 9/2/26, 7:20 AM — 9/2/26, 1:40 PM

Accepted scans

340

Closed boxes

28

Duplicate printing

Product label template

Data Matrix duplicate 58x40 [Short name]

Allow reprocessing codes from previous shifts

Not allowed

Require label verification

The operator must scan the new label before accepting the next unit.

Printing and verification settings were frozen when the shift opened.

Label history

Sending to a printer does not confirm physical printing. Verification is recorded only after scanning the label.

1,240

Sent to printer

1,238

Verified labels

1

Unfinished jobs

3

Reprint attempts

.....0128

Label verified

9/2/26, 2:04:00 PM

1 attempt

.....0129

Needs attention

9/2/26, 2:05:00 PM

2 attempts

Pallets

Placards

SSCC	BOXES	CODES	CLOSED	STATUS
(00)346006820000000014	48	576	8/30/26, 2:20 PM	
(00)346006820000000021	47	564	8/30/26, 3:05 PM	Contents changed after closing
(00)346006820000000038	0	0	8/30/26, 12:40 PM	Taken apart

Shift parameters

Date

09/02/2026

Production date

09/02/2026

Line

Bottling line 1

Mode

Validation

Plan, units

4800

Counterparty

Berry House LLC

Boxes per pallet

48

Shift reports

Reports can be requested and downloaded after the shift is closed.



The label history of a shift with a duplicate

5. Closing a shift

Normally the operator closes the shift from the station at the end of the work — this is covered by MKR-INS-02. Closing from the cabinet is the fallback: the station broke down, lost its connection, or the operator left without closing the shift.

Step 1. Close the shift from the cabinet

Open the shift with the “Details” button and find the “Shift actions” section at the bottom of the panel. The “Close shift” button is there only for an active shift: a planned one has “Delete” in its place, and a closed one has no “Shift actions” section at all.

Step 2. State a reason

In the “Close shift” dialog fill in “Close reason”. While the field holds fewer than three meaningful characters the confirmation button stays disabled — the cabinet will not accept a token entry such as a single full stop. The reason is stored with the shift and shown in the list under the “Closed” status.



Shifts

Status: All statuses From: Select a date

1 shift

SHIFT	PRODUCT
SEP26-004	Cranberry syrup, 0.5 L
Shift: 09/02/2026	1,152 pcs · 96 bx
Production: 09/02/2026	for: Berry House LLC

Shift SEP26-004
Cranberry syrup, 0.5 L

Shift output

96 Closed boxes	1,152 Codes in closed boxes	4,800 Plan, units
--------------------	--------------------------------	----------------------

Employees in this shift

4 operations have no employee assigned.

Maria Kuznetsova Line operator Activity: 9/2/26, 7:15 AM — 9/2/26, 2:05 PM	Accepted scans 812	Closed boxes 68
Pyotr Smirnov Role not specified Activity: 9/2/26, 7:20 AM — 9/2/26, 1:40 PM	Accepted scans 340	Closed boxes 28

Close shift

Close reason

SEP26-004 · Cranberry syrup, 0.5 L

Cancel Close shift

Shift parameters

Date 09/02/2026	Production date 09/02/2026
Line Bottling line 1	Mode Aggregation
Plan, units 4800	Counterparty Berry House LLC
Boxes per pallet 48	

Shift reports

Reports can be requested and downloaded after the shift is closed.

Shift actions

Edit Close shift

✓ Active

Closing a shift with a mandatory reason

Expected result: The shift is in the list with the “Closed” status and the reason underneath.

Important: Close a shift from the cabinet only when you are sure that production is really over. A station left inside a closed shift keeps working with the previous settings until the next sign-in, and its scans will arrive as data after the close (section 6).

6. Data after the close

Step 1. Watch for the badge in the list

If more scans reach the cabinet from the station after the shift was closed — for example, the station had no connection at the moment of closing — the cabinet marks the shift with the “Data after close” badge. The totals of such a shift have changed since the moment it was closed.



Shifts

Status: All statuses (dropdown) | From: Select a date (calendar) | To: Select a date (calendar) | Production from: Select a date (calendar) | Production to: Select a date (calendar)

3 shifts

SHIFT	PRODUCT	PRODUCTION	PLAN AND STATUS	ACTIONS
SEP26-004 Shift: 09/02/2026 Production: 09/02/2026	Cranberry syrup, 0.5 L 1,152 pcs · 96 bx for: Berry House LLC	Bottling line 1 Aggregation	4800 Plan, units ✓ Active	Details
SEP26-002 Shift: 09/01/2026 Production: 09/01/2026	Cranberry syrup, 0.5 L 4,800 pcs · 400 bx for: Berry House LLC	Bottling line 1 Aggregation	4800 Plan, units - Closed Shift finished as planned Data after close	Details
SEP26-003 Shift: 09/01/2026 Production: 09/01/2026	Cranberry syrup, 0.5 L 4,800 pcs · 400 bx for: Berry House LLC	Bottling line 1 Aggregation	4800 Plan, units - Closed Shift finished as planned	Details

A shift with data after the close

The badge on its own calls for no action — the data is already counted. What matters is different: reports generated before that data arrived are out of date. The cabinet marks such reports with the warning “Shift data changed — generate a new report” (section 8) — generate the report again and hand the fresh one to GIS MT.

7. Reports for GIS MT

Step 1. Open the reports of a closed shift

Open the closed shift with the “Details” button: the panel gains a “Shift reports” section. For a shift that is not closed yet, its place is taken by the note “Reports can be requested and downloaded after the shift is closed.” The “Report format” block lists the formats from the approved server catalog. That catalog is maintained in Russian and the cabinet shows it as received, so every format label stays Russian on an English screen, as the screenshot shows: “[TXT][Без коробов] Отчет смены” (shift report, TXT, without boxes), “[TXT][С коробами] Отчет смены” (TXT, with boxes), “[CSV][Без коробов] Отчет смены” (CSV, without boxes), “[CSV][С коробами] Отчет смены” (CSV, with boxes) and “[XML][ГИСМТ] Отчет об агрегации” (the GIS MT aggregation XML). For a shift planned with pallets the catalog is longer: five pallet formats are added to them, described right below, so the list holds ten entries as in the screenshot. A shift without pallets is not offered the pallet formats at all: ordered by mistake, such a report could never have been generated anyway and would only leave a red row in the history. Ticking “Split report into parts” adds a “Maximum lines per part” field — a whole number from 2 to 1,000,000 is allowed; without splitting the report comes out as a single file.



маркиро

Production

Overview

Shifts

Lines

Inventories

Code search

Conflicts

Disposal

Disaggregation

Reference data

Catalog

Counterparties

Operators and employees

Labels

Equipment and exchange

Devices

Marka Co
manager@example.test

Shifts

StatusAll statusesFromSelect a date

1 shift

SHIFT	PRODUCT
SEP26-003 Shift: 09/01/2026 Production: 09/01/2026	Cranberry syrup, 0 4,800 pcs · 400 bx for: Berry House LLC

Shift SEP26-003
Cranberry syrup, 0.5 L

Shift output

96
Closed boxes

1,152
Codes in closed boxes

4,800
Plan, units

Employees in this shift

4 operations have no employee assigned.

Maria Kuznetsova
Line operator
Activity: 9/2/26, 7:15 AM — 9/2/26, 2:05 PM

Accepted scans
812

Closed boxes
68

Pyotr Smirnov
Role not specified
Activity: 9/2/26, 7:20 AM — 9/2/26, 1:40 PM

Accepted scans
340

Closed boxes
28

Pallets

Placards

SSCC	BOXES	CODES	CLOSED	STATUS
(00)346006820000000014	48	576	8/30/26, 2:20 PM	
(00)346006820000000021	47	564	8/30/26, 3:05 PM	Contents changed after closing
(00)346006820000000038	0	0	8/30/26, 12:40 PM	Taken apart

Shift parameters

Date
09/01/2026

Production date
09/01/2026

Line
Bottling line 1

Mode
Aggregation

Plan, units
4800

Counterparty
Berry House LLC

Boxes per pallet
48

Shift reports

Report format

☒ [TXT][Без коробов] Отчет смены

☐ [TXT][С коробами] Отчет смены

☐ [CSV][Без коробов] Отчет смены

☐ [CSV][С коробами] Отчет смены

☐ [XML][ГИСМТ] Отчет об агрегации

☐ [TXT][Паллеты] Отчет смены

☐ [CSV][Паллеты] Отчет смены

☐ [XML][ГИСМТ] Паллетная агрегация

☐ [TXT][Паллеты → коробка] Отчет смены

☐ [XML][ГИСМТ] Агрегация паллет без кодов

☐ Split report into parts

Generate report

Generated reports

No reports have been generated for this shift yet.

- Closed

Choosing a report format and splitting it into parts

Pallets with codes in TXT — “[TXT][Паллеты] Отчет смены” — the pallet's SSCC, then for each of its boxes the box SSCC and the codes inside it. Boxes that reached no closed pallet follow after every pallet.



Pallets with codes in CSV — “[CSV][Паллеты] Отчет смены” — the same content as a table of three columns: pallet SSCC, box SSCC, code. For a box on no pallet the first column is empty.

Pallet aggregation in XML — “[XML][ГИСМТ] Паллетная агрегация” — XML for GIS MT with both levels at once: the boxes with their own codes and the pallets that reference those boxes. Like the other XML, it needs the organization INN.

Pallets and boxes in TXT — “[TXT][Паллеты → коробка] Отчет смены” — the upper level only, with no marking codes: the pallet's SSCC and the SSCCs of its boxes. Boxes on no pallet are not written into this report.

Pallets and boxes in XML — “[XML][ГИСМТ] Агрегация паллет без кодов” — the same upper level as XML for GIS MT: the pallets and the boxes nested in them, without marking codes.

Step 2. Wait for it and download the parts

Press “Generate report” at the bottom of the panel. Every run is visible in the “Generated reports” block: its status (“Queued”, “Processing”, “Ready”, “Failed”), who it was “Created by”, the “Format” and the “Parameters” (“Not split” or “up to 1,000 lines per part”), and the resulting “Codes” and “Boxes”. A ready report lists its parts separately — “Part 1”, “Part 2” — with the number of lines, codes and boxes; each part has its own “Download” button. While a run is “Processing”, the section refreshes itself.





Generated reports: a ready one with parts and one still being generated

Expected result: Every part of the report has been downloaded.

Note: A download link is valid for a few minutes — if the download does not start, press “Download” again. Generation runs on the server: you can close the panel and come back later, the run will not be lost.

The pallet formats have refusals of their own. Failed runs in general are covered by section 8; gathered here is only what happens on pallets.

The shift has no closed pallet — “The shift has no closed pallet: either no box was ever stacked on one, or no pallet has been closed yet.” The cabinet does not tell the two cases apart: in both there is nothing to report on. Wait until at least one pallet closes and try again.

The pallet is not closed yet — “The pallet is not closed yet — an export needs a closed pallet.” This is the answer of a report ordered for a single pallet from its card, when that pallet is still open at the moment the run starts.

The pallet was taken apart — “The pallet was taken apart — it can no longer be exported.” Also about a single-pallet report: the pallet was dismantled between the order and the run.

A pallet does not fit into a part — “A pallet together with its boxes does not fit within the lines-per-part limit.” A pallet is never split across parts away from its boxes: raise “Maximum lines per part” above the size of the largest pallet, or turn splitting off.

8. Why a report is not generated

Step 1. Read the reason on the failed run

A run with the “Failed” status shows the reason in the cabinet's own words — in the screenshot that is “Not every shift code is assigned to a box.” — together with a “Retry” button. “Retry” is offered on every failed run: once the cause is gone, generation can be restarted with the same settings, without picking the format again. The refusals that only the pallet formats produce are covered by section 7.



маркиро

Production

Overview

Shifts

Lines

Inventories

Code search

Conflicts

Disposal

Disaggregation

Reference data

Catalog

Counterparties

Operators and employees

Labels

Equipment and exchange

Devices

Marka Co

manager@example.test

Shifts

Status

All statuses

From

Select a date

1 shift

SHIFT	PRODUCT
SEP26-003	Cranberry syrup, 0.5 L
Shift: 09/01/2026	4,800 pcs · 400 bx
Production: 09/01/2026	for: Berry House LLC

IV

Igor Volkov

manager@example.test

Shift SEP26-003

Cranberry syrup, 0.5 L

Shift output

96

Closed boxes

1,152

Codes in closed boxes

4,800

Plan, units

Employees in this shift

4 operations have no employee assigned.

Maria Kuznetsova

Line operator

Activity: 9/2/26, 7:15 AM — 9/2/26, 2:05 PM

Accepted scans

812

Closed boxes

68

Pyotr Smirnov

Role not specified

Activity: 9/2/26, 7:20 AM — 9/2/26, 1:40 PM

Accepted scans

340

Closed boxes

28

Pallets

Placards

SSCC	BOXES	CODES	CLOSED	STATUS
(00)346006820000000014	48	576	8/30/26, 2:20 PM	
(00)346006820000000021	47	564	8/30/26, 3:05 PM	Contents changed after closing
(00)346006820000000038	0	0	8/30/26, 12:40 PM	Taken apart

Shift parameters

Date

09/01/2026

Production date

09/01/2026

Line

Bottling line 1

Mode

Aggregation

Plan, units

4800

Counterparty

Berry House LLC

Boxes per pallet

48

Shift reports

Report format

[TXT][Без коробов] Отчет смены

[TXT][С коробами] Отчет смены

[CSV][Без коробов] Отчет смены

[CSV][С коробами] Отчет смены

[XML][ГИСМТ] Отчет об агрегации

[TXT][Паллеты] Отчет смены

[CSV][Паллеты] Отчет смены

[XML][ГИСМТ] Паллетная агрегация

[TXT][Паллеты → коробка] Отчет смены

[XML][ГИСМТ] Агрегация паллет без кодов

Split report into parts

Generate report

Generated reports

Failed

9/1/26, 3:47 PM

Created by

Igor Volkov

Time

9/1/26, 3:47 PM

Format

[TXT][С коробами] Отчет смены

Parameters

up to 1,000 lines per part

Not every shift code is assigned to a box.

Retry

MKR-INS-09 · 2026.09/04 · 19 September 2026 · Page 15

A failed report: the reason and the retry

The shift is not closed yet — “The shift must be closed before generating a report.” Reports are available only for a closed shift: wait for the operator to close it, or close the shift from the cabinet (section 5).

Codes are not packed into boxes — “Not every shift code is assigned to a box.” The formats with boxes require every code of the shift to sit in a box. Pack the remaining codes into boxes on the station, or generate “[TXT][Без коробов] Отчет смены” or “[CSV][Без коробов] Отчет смены” instead.

The organization INN is missing — “Set the organization INN in the profile to generate the GIS MT report.” Fill the INN in the organization profile settings and generate the report again.

A box does not fit into a part — “A box does not fit within the lines-per-part limit.” A box is never split across parts: raise “Maximum lines per part” above the size of the largest box, or turn splitting off.

An empty shift or a shift without a date — “The shift has no codes to include in a report.” — there is nothing to report on. “The shift has no date.” — fill the shift date on its card (MKR-INS-08) and try again.

Broken shift data — “One of the boxes has an invalid SSCC, so the report cannot be generated.” and “The shift contains a marking code that could not be parsed for the report.” — the data is damaged; this cannot be fixed from the reports panel, contact support.

A temporary failure — “Could not generate the report. Try again.”, “Could not save the report. Try again.”, “Could not queue the report. Try again.” — infrastructure errors; press “Retry”, and if it happens again, contact support.

Step 2. Refresh out-of-date reports

If data arrived after the report was generated (section 6), the ready report is marked with the warning “Shift data changed — generate a new report”. Files downloaded earlier do not update themselves — start a new run and hand that one to GIS MT.



маркиро

Production

Overview

Shifts

Lines

Inventories

Code search

Conflicts

Disposal

Disaggregation

Reference data

Catalog

Counterparties

Operators and employees

Labels

Equipment and exchange

Devices

Marka Co

manager@example.test

Shifts

Status

All statuses

From

Select a date

1 shift

SHIFT	PRODUCT
SEP26-003	Cranberry syrup, 0
Shift: 09/01/2026	4,800 pcs · 400 bx
Production: 09/01/2026	for: Berry House LLC

Shift SEP26-003

Cranberry syrup, 0.5 L

Shift output

96

Closed boxes

1,152

Codes in closed boxes

4,800

Plan, units

Employees in this shift

4 operations have no employee assigned.

Maria Kuznetsova

Line operator

Activity: 9/2/26, 7:15 AM — 9/2/26, 2:05 PM

Accepted scans

812

Closed boxes

68

Pyotr Smirnov

Role not specified

Activity: 9/2/26, 7:20 AM — 9/2/26, 1:40 PM

Accepted scans

340

Closed boxes

28

Pallets

Placards

SSCC	BOXES	CODES	CLOSED	STATUS
(00) 346006820000000014	48	576	8/30/26, 2:20 PM	
(00) 346006820000000021	47	564	8/30/26, 3:05 PM	Contents changed after closing
(00) 346006820000000038	0	0	8/30/26, 12:40 PM	Taken apart

Shift parameters

Date

09/01/2026

Production date

09/01/2026

Line

Bottling line 1

Mode

Aggregation

Plan, units

4800

Counterparty

Berry House LLC

Boxes per pallet

48

Shift reports

Report format

☒ [TXT][Без коробов] Отчет смены

☐ [TXT][С коробами] Отчет смены

☐ [CSV][Без коробов] Отчет смены

☐ [CSV][С коробами] Отчет смены

☐ [XML][ГИСМТ] Отчет об агрегации

☐ [TXT][Паллеты] Отчет смены

☐ [CSV][Паллеты] Отчет смены

☐ [XML][ГИСМТ] Паллетная агрегация

☐ [TXT][Паллеты → короба] Отчет смены

☐ [XML][ГИСМТ] Агрегация паллет без кодов

☐ Split report into parts

Generate report

Generated reports

✓ Ready

9/1/26, 3:45 PM

Shift data changed — generate a new report

Created by

Igor Volkov

Format

[XML][ГИСМТ] Отчет об агрегации

Codes

888 codes

Time

9/1/26, 4:20 PM

Parameters

up to 1,000 lines per part

Boxes

74 boxes

Part 1

640 lines · 600 codes · 50 boxes · 118,400 B

shift-SEP26-003-aggregation-part1.xml

Download



A report went out of date after late data

9. Frequent questions

The dashboard numbers change on their own — Shifts are active: the stations keep sending scans and the summary is marked “Provisional data”. The final numbers come after the shifts are closed.

The shift has no close button — “Close shift” exists only for an active shift. A planned one can be edited or deleted (MKR-INS-08); a closed one can only be reported on.

You cannot find the report button — “Generate report” appears for a shift with the “Closed” status. An active shift has no reports — close the shift first.

A report was ready and is now marked with a warning — Data arrived from the station after it was generated — the shift is marked “Data after close” and the report is out of date. Generate a new one and use that.

A report part will not download — The download link is short-lived. Press “Download” on the part you need once more and the cabinet will issue a fresh link.

If your problem is not described above, contact Markiro support: hello@v-b.tech.

