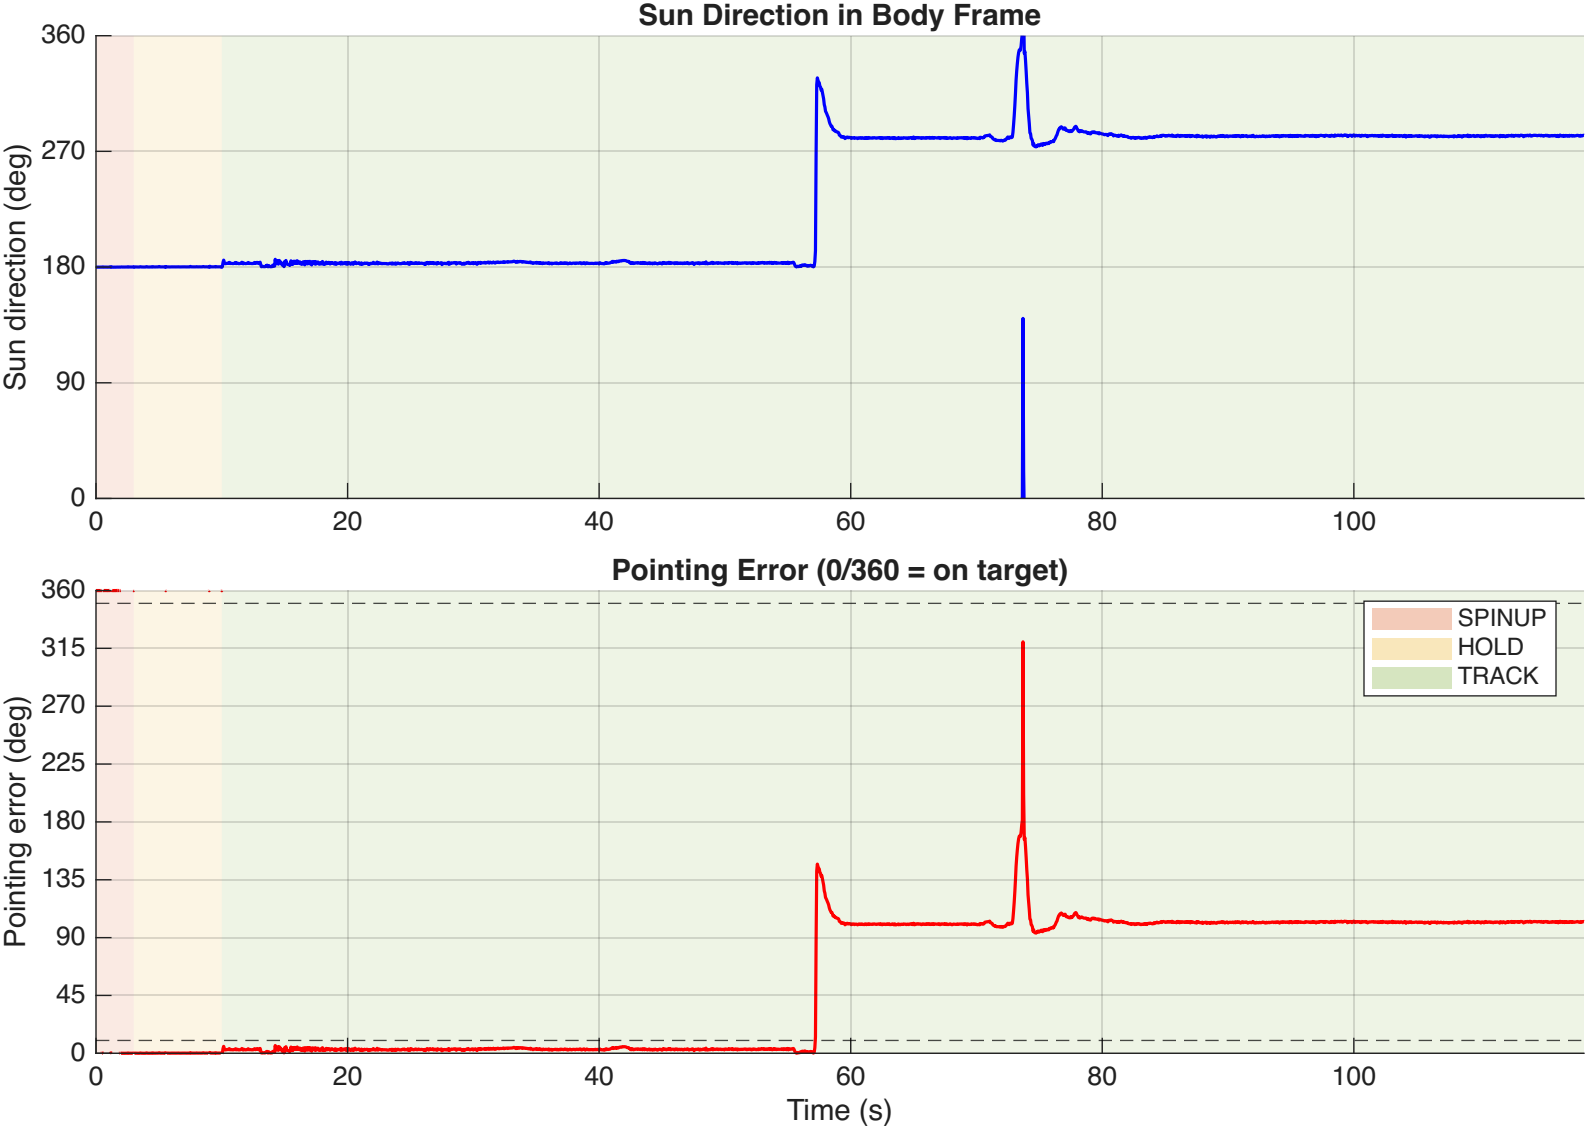
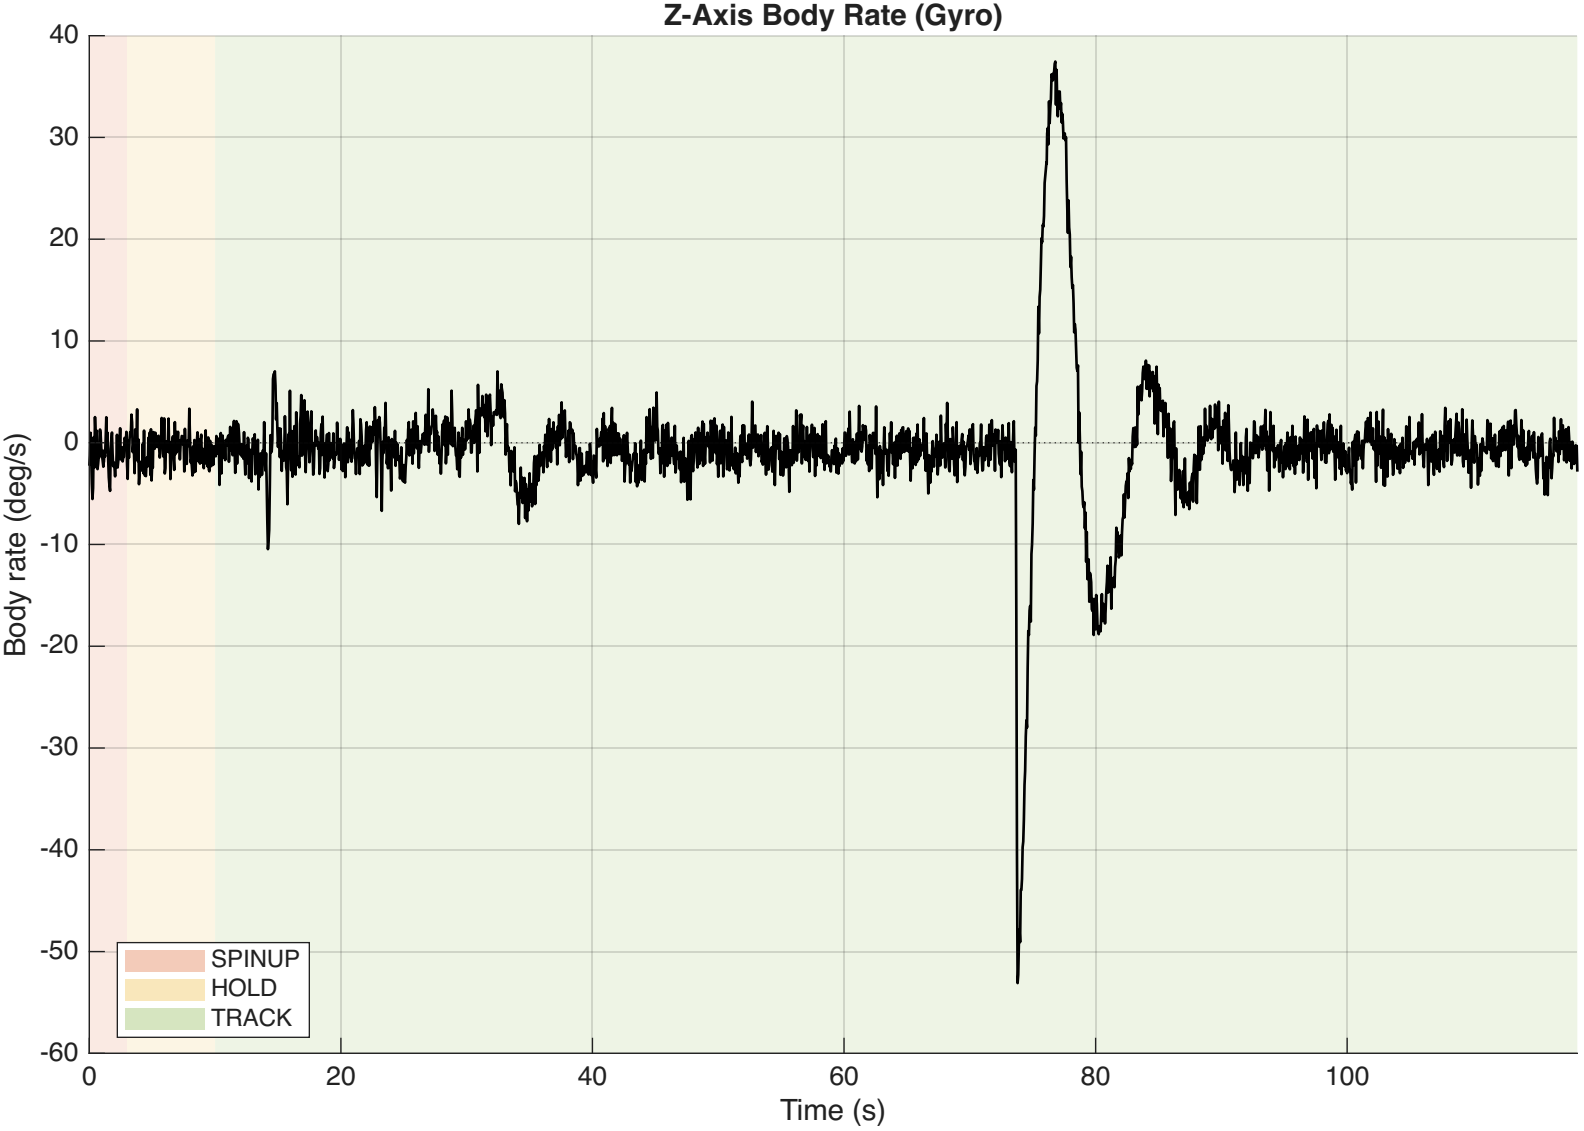
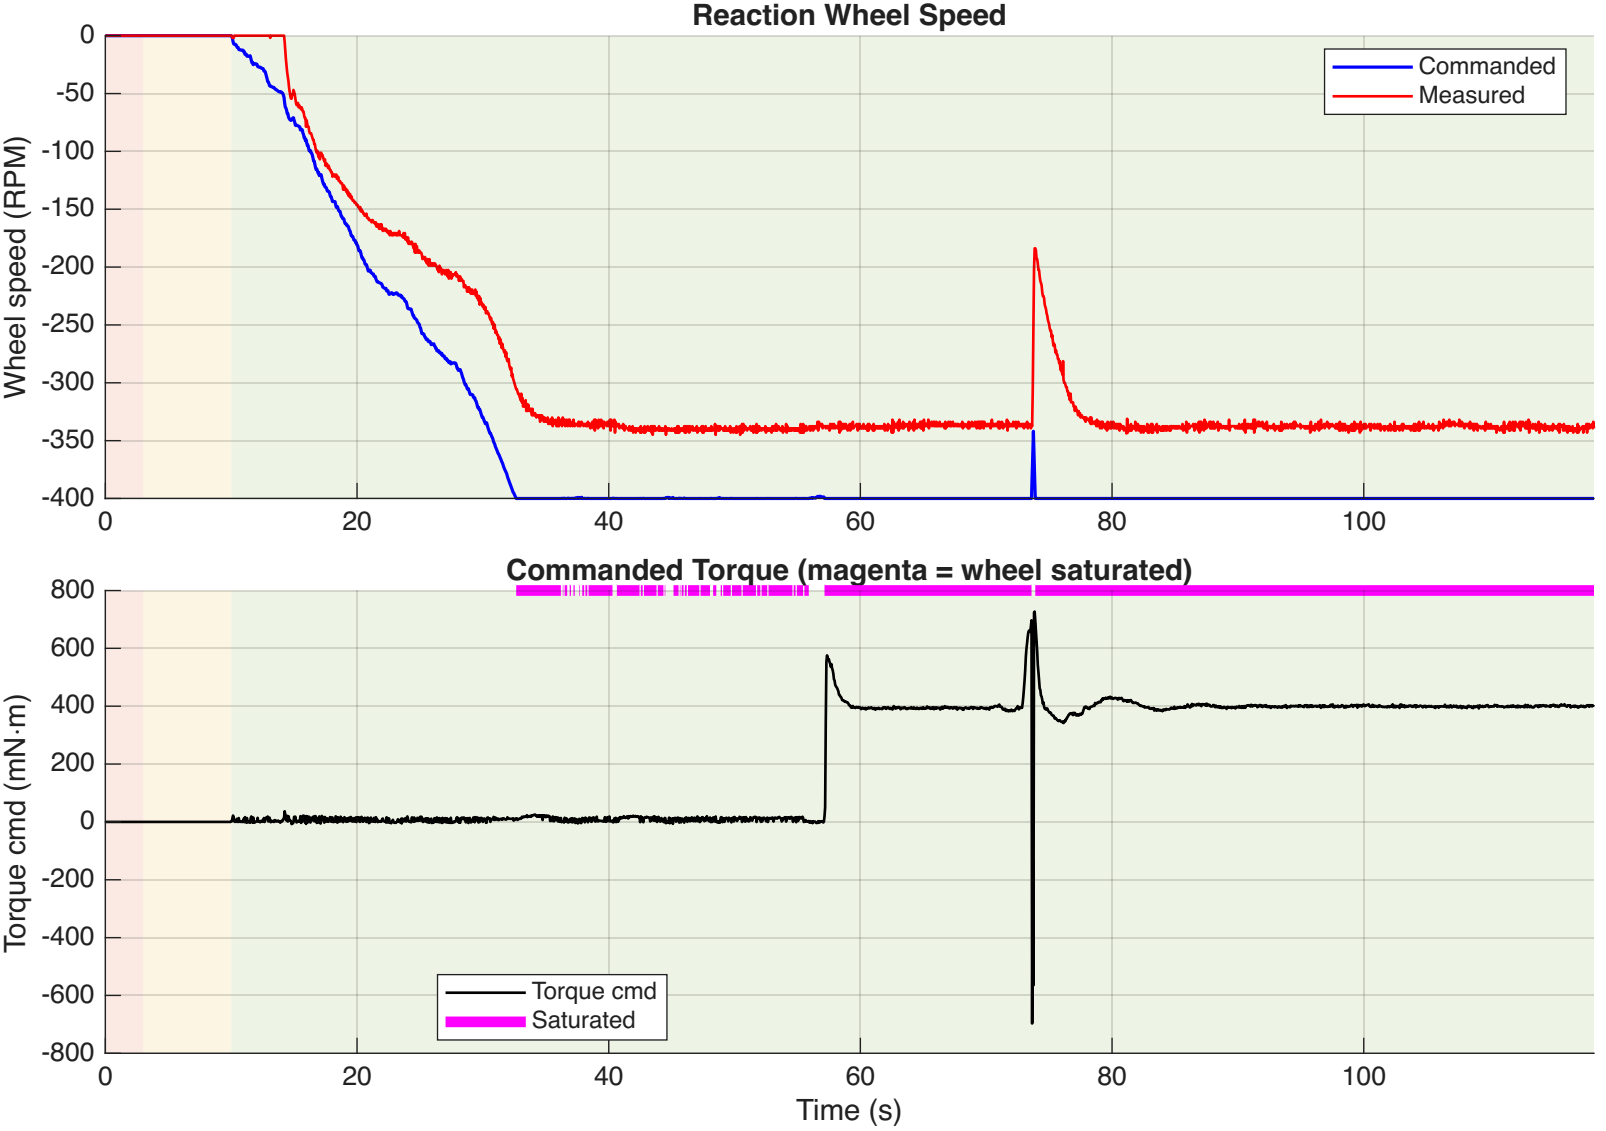
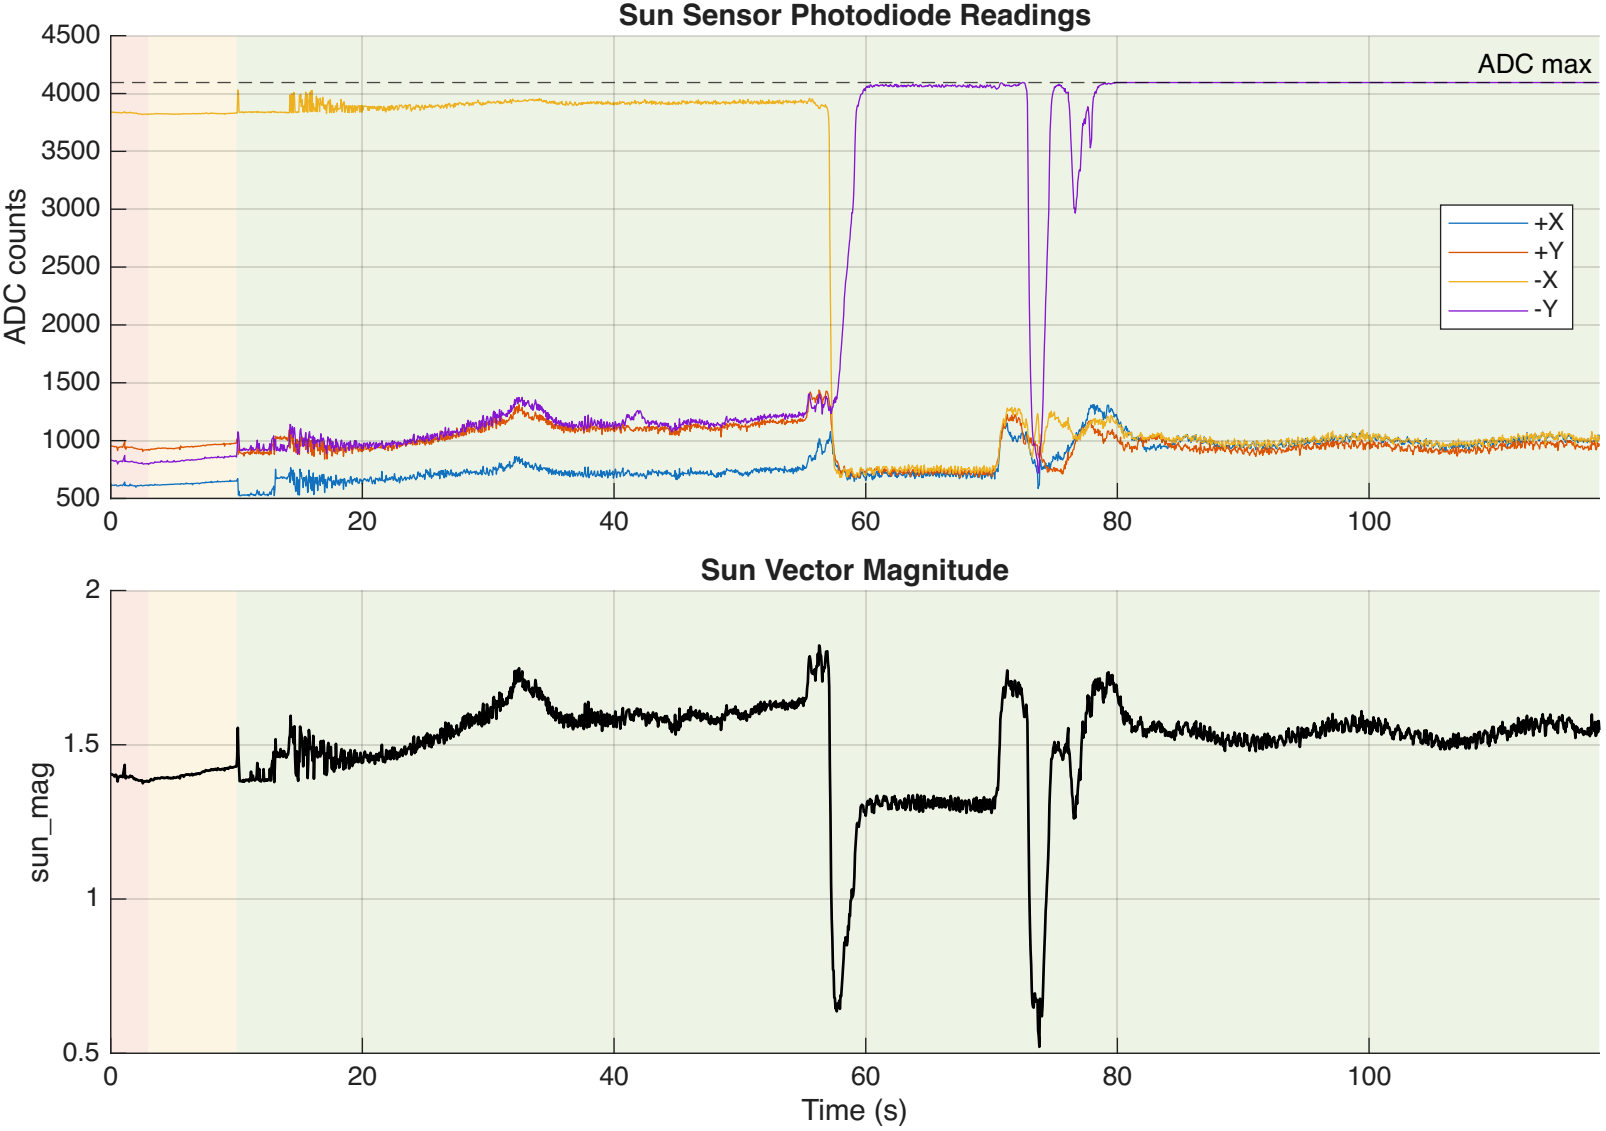
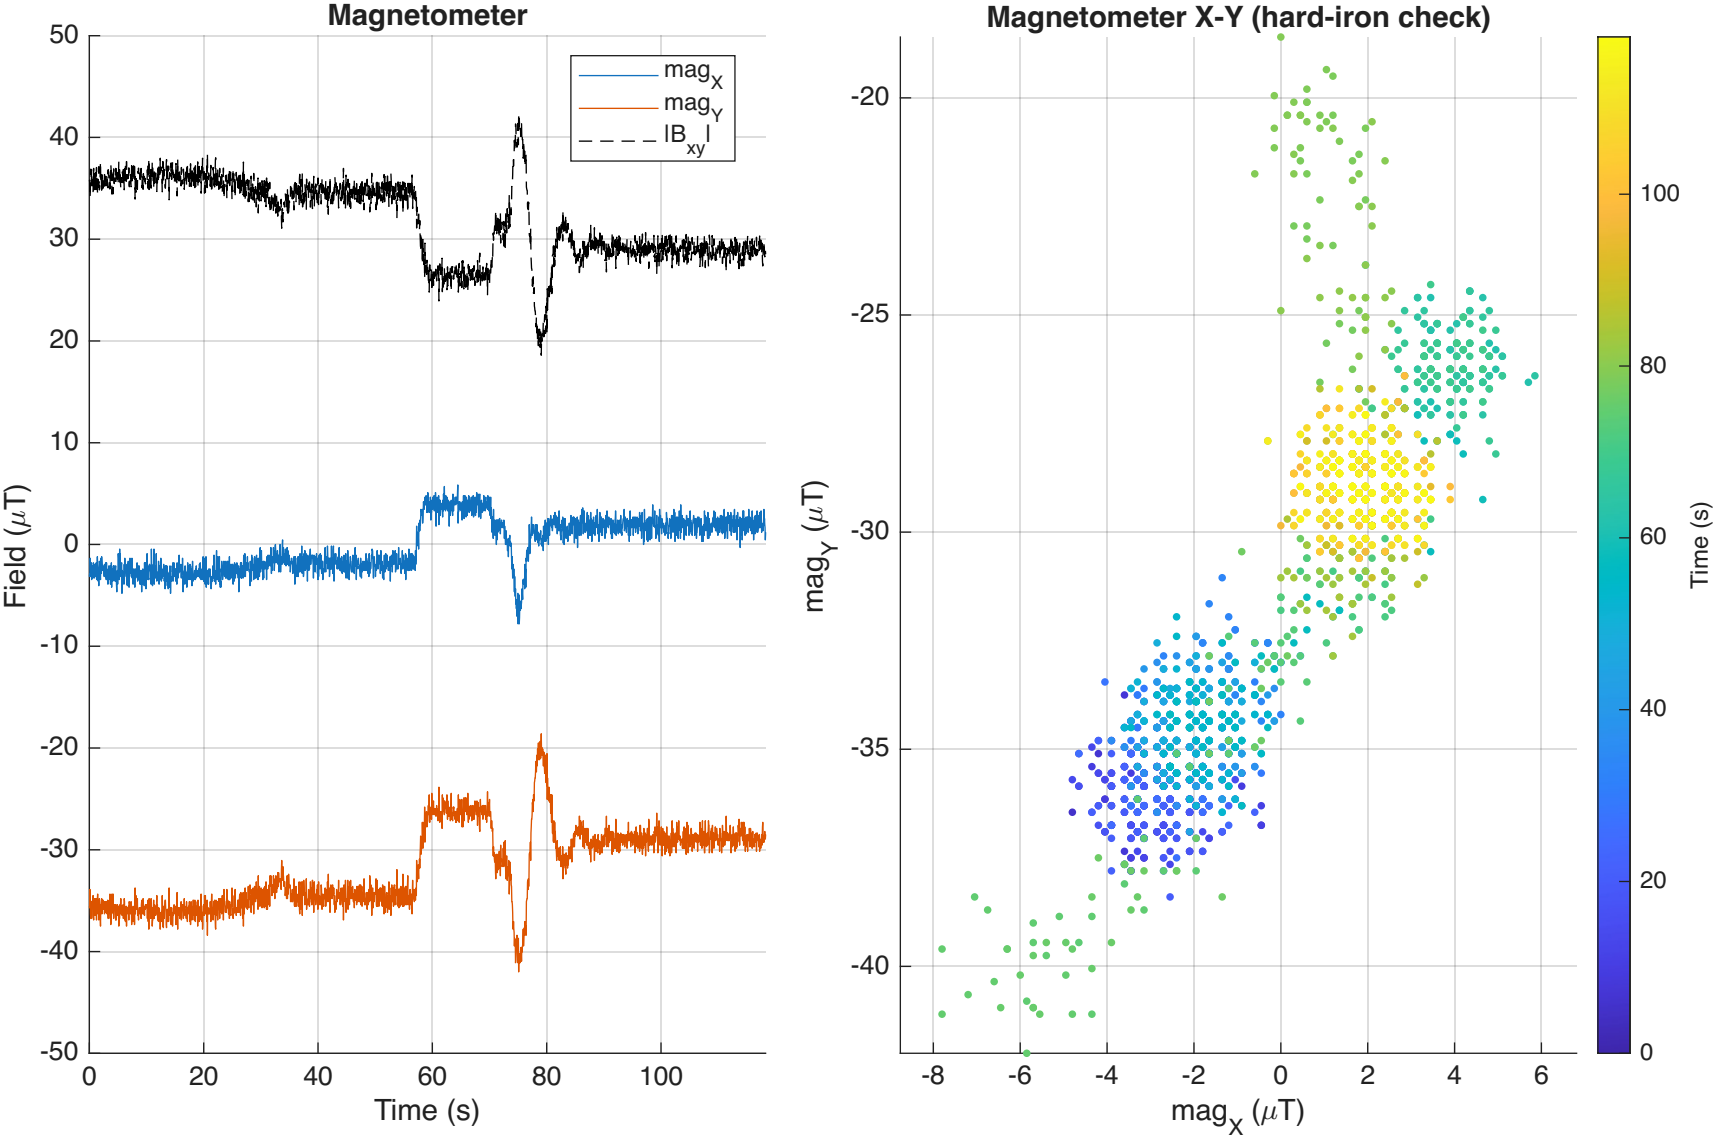
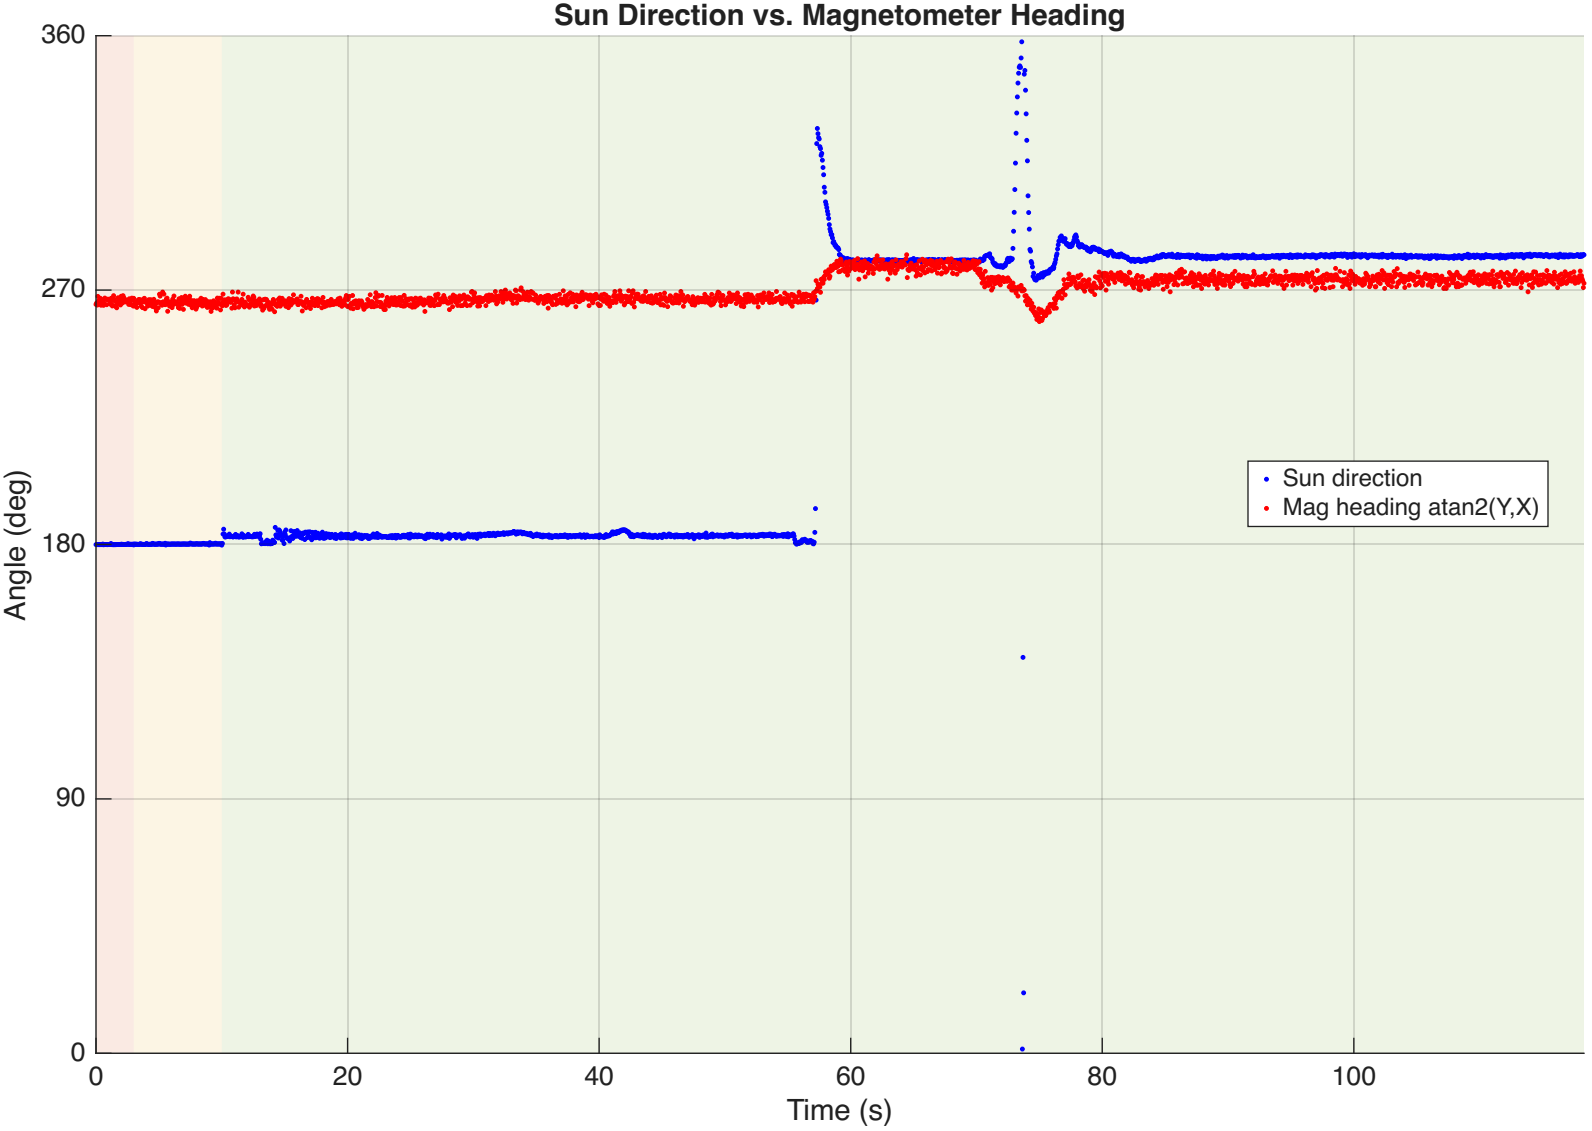

Sun Direction in Body Frame
Sun direction (deg)
360
270
180
90
0
0
20
40
60
80
100
Pointing Error (0/360 = on target)
Pointing error (deg)
360
315
270
225
180
135
90
45
0
SPINUP
HOLD
TRACK
Time (s)

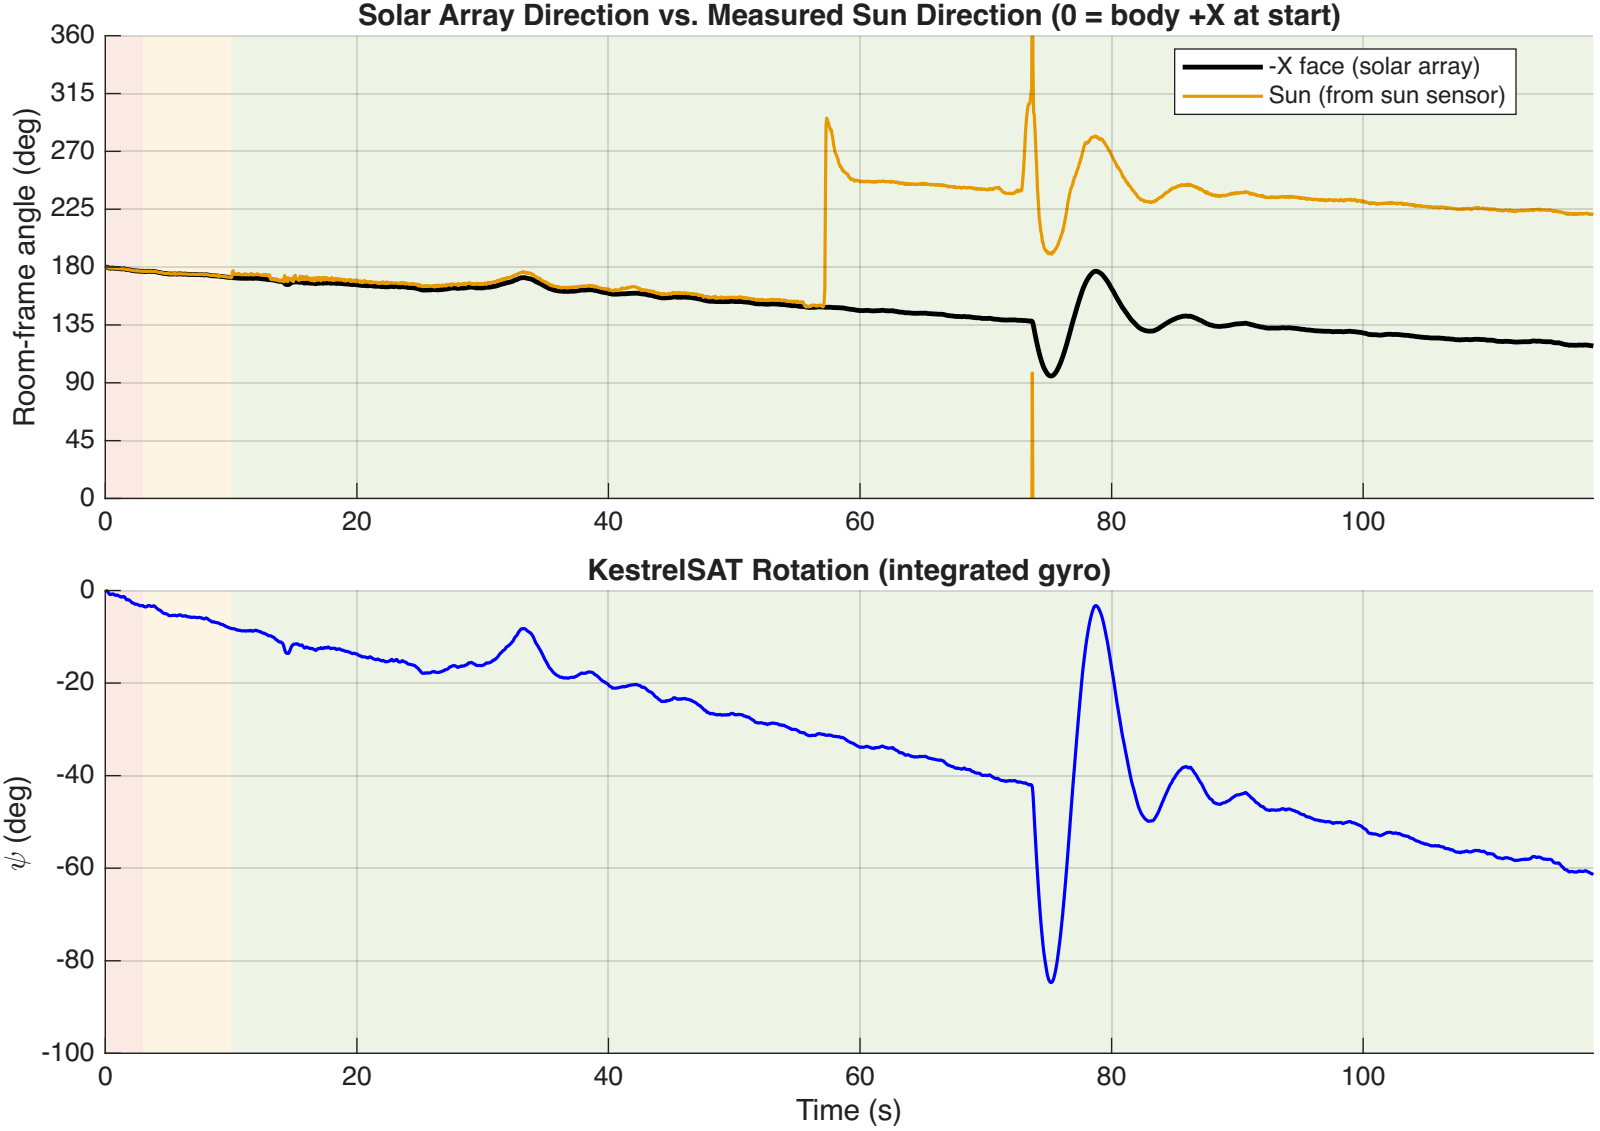

Z-Axis Body Rate (Gyro)
Body rate (deg/s)
Time (s)
SPINUP
HOLD
TRACK
40
30
20
10
0
-10
-20
-30
-40
-50
-60
0
20
40
60
80
100

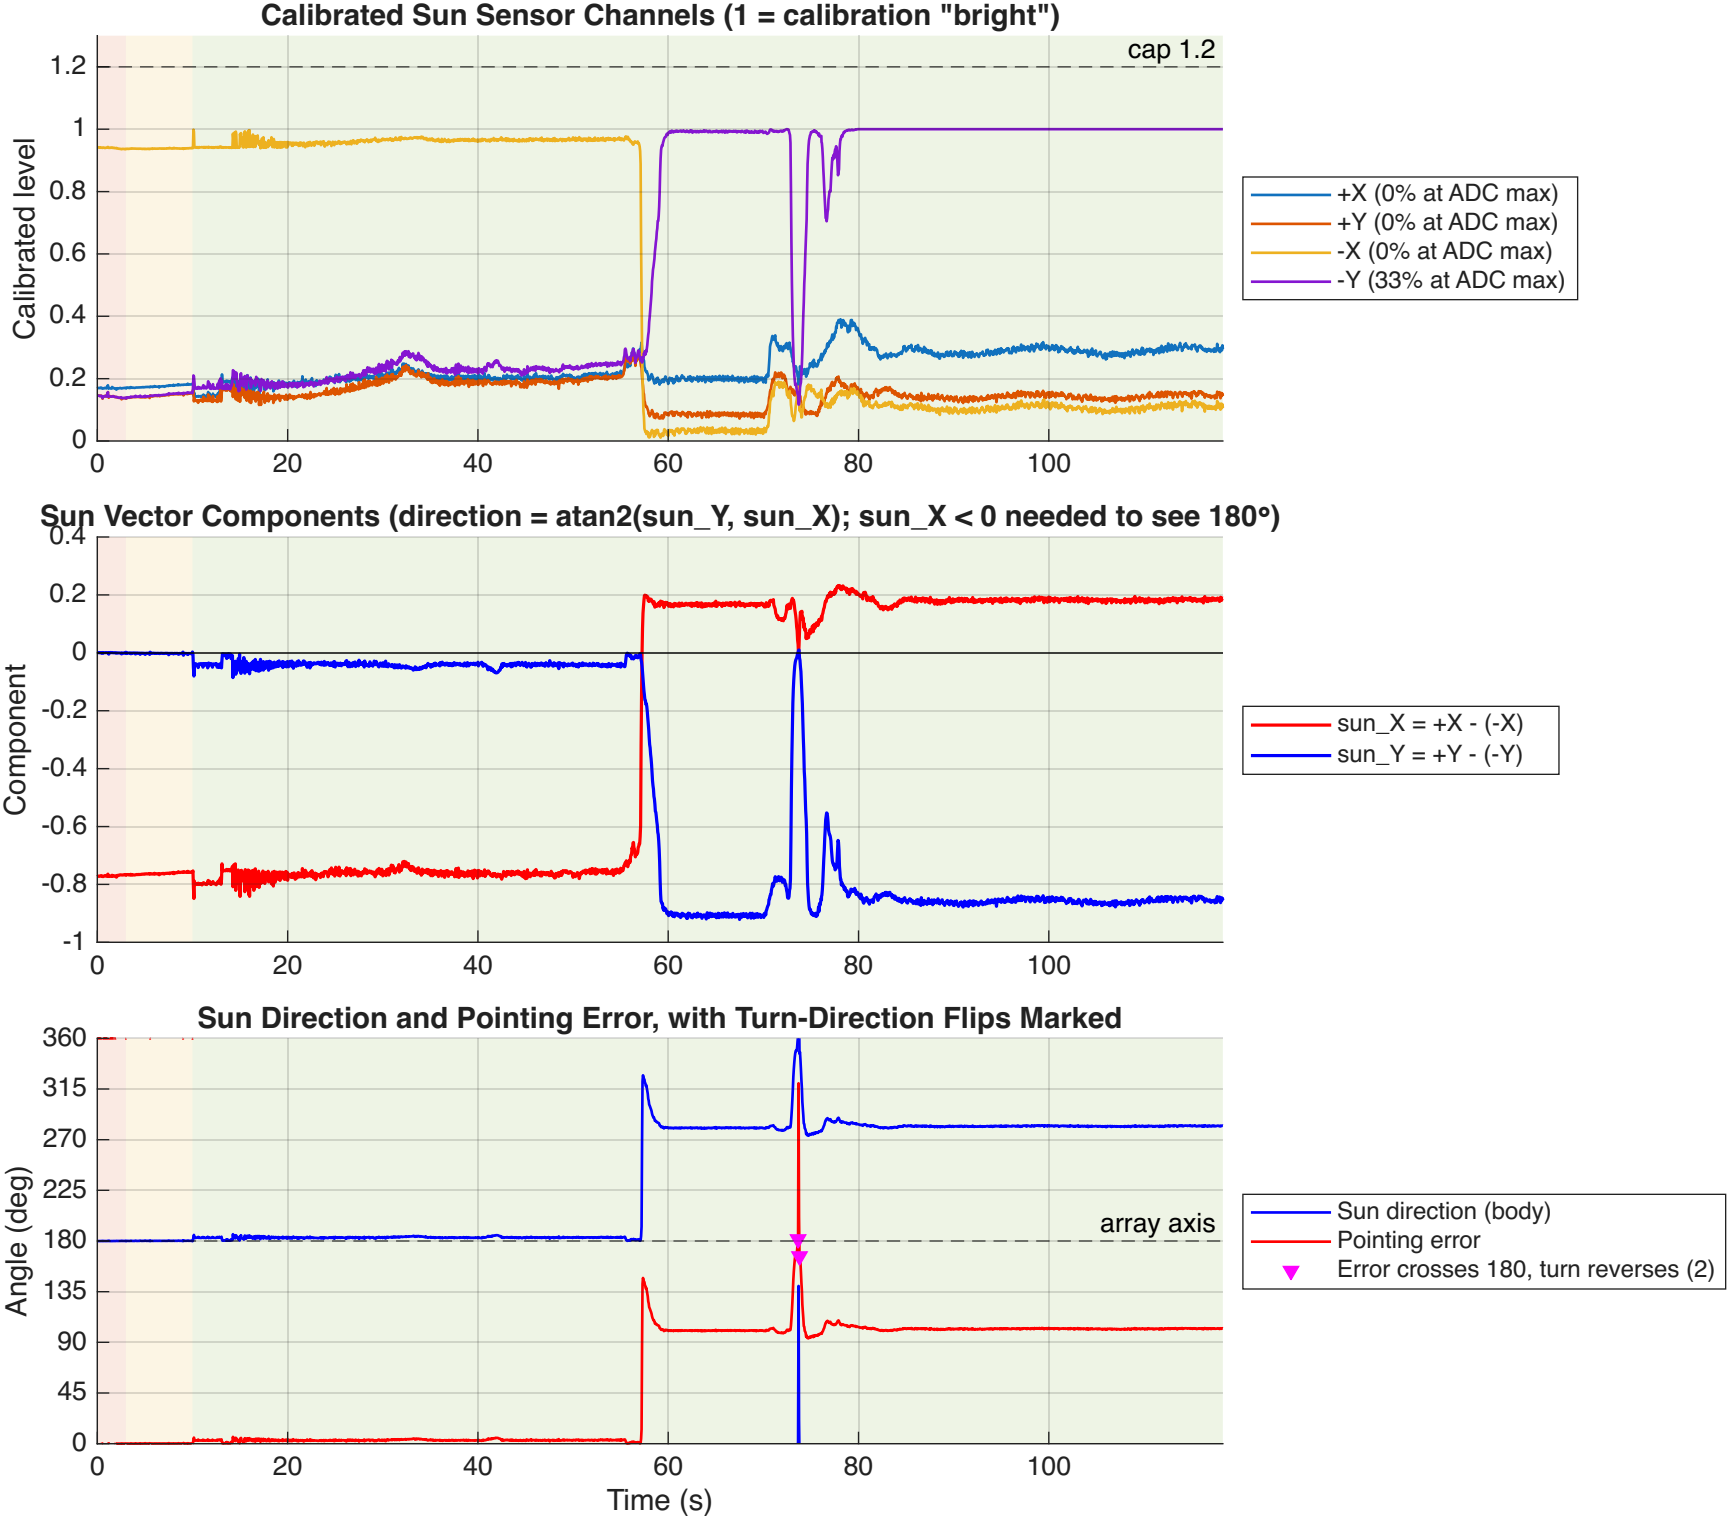

Reaction Wheel Speed
Wheel speed (RPM)
0
-50
-100
-150
-200
-250
-300
-350
-400
Commanded
Measured
Commanded Torque (magenta = wheel saturated)
Torque cmd (mN·m)
800
600
400
200
0
-200
-400
-600
-800
Torque cmd
Saturated
0
20
40
60
80
100
Time (s)

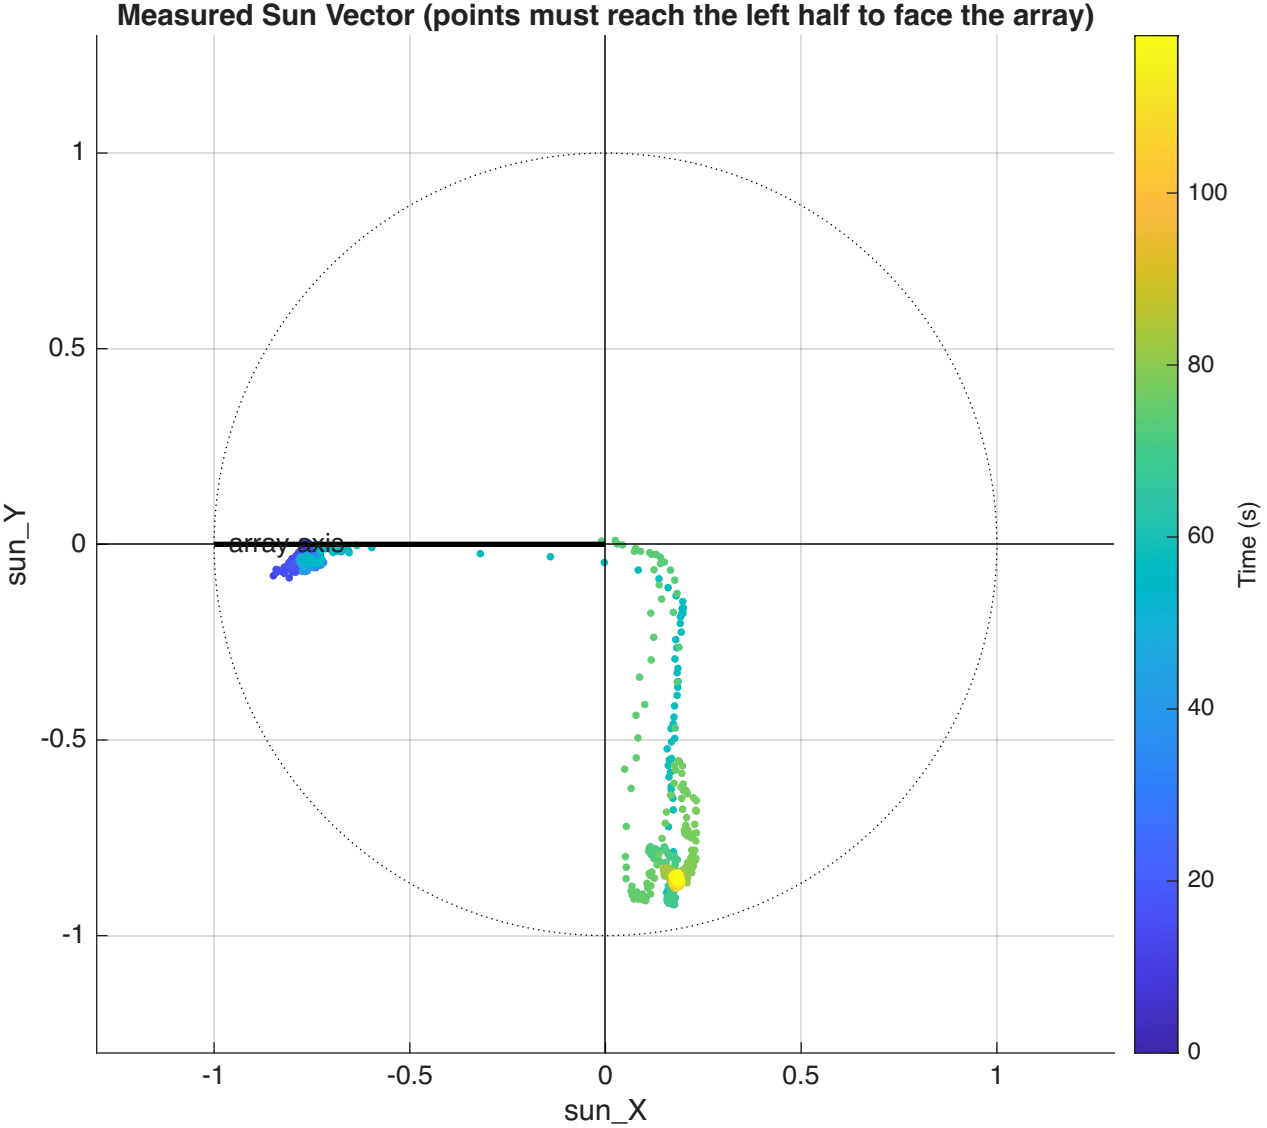

Sun Sensor Photodiode Readings
ADC max
ADC counts
4500
4000
3500
3000
2500
2000
1500
1000
500
+X
+Y
-X
-Y
0
20
40
60
80
100
Sun Vector Magnitude
sun_mag
2
1.5
1
0.5
Time (s)

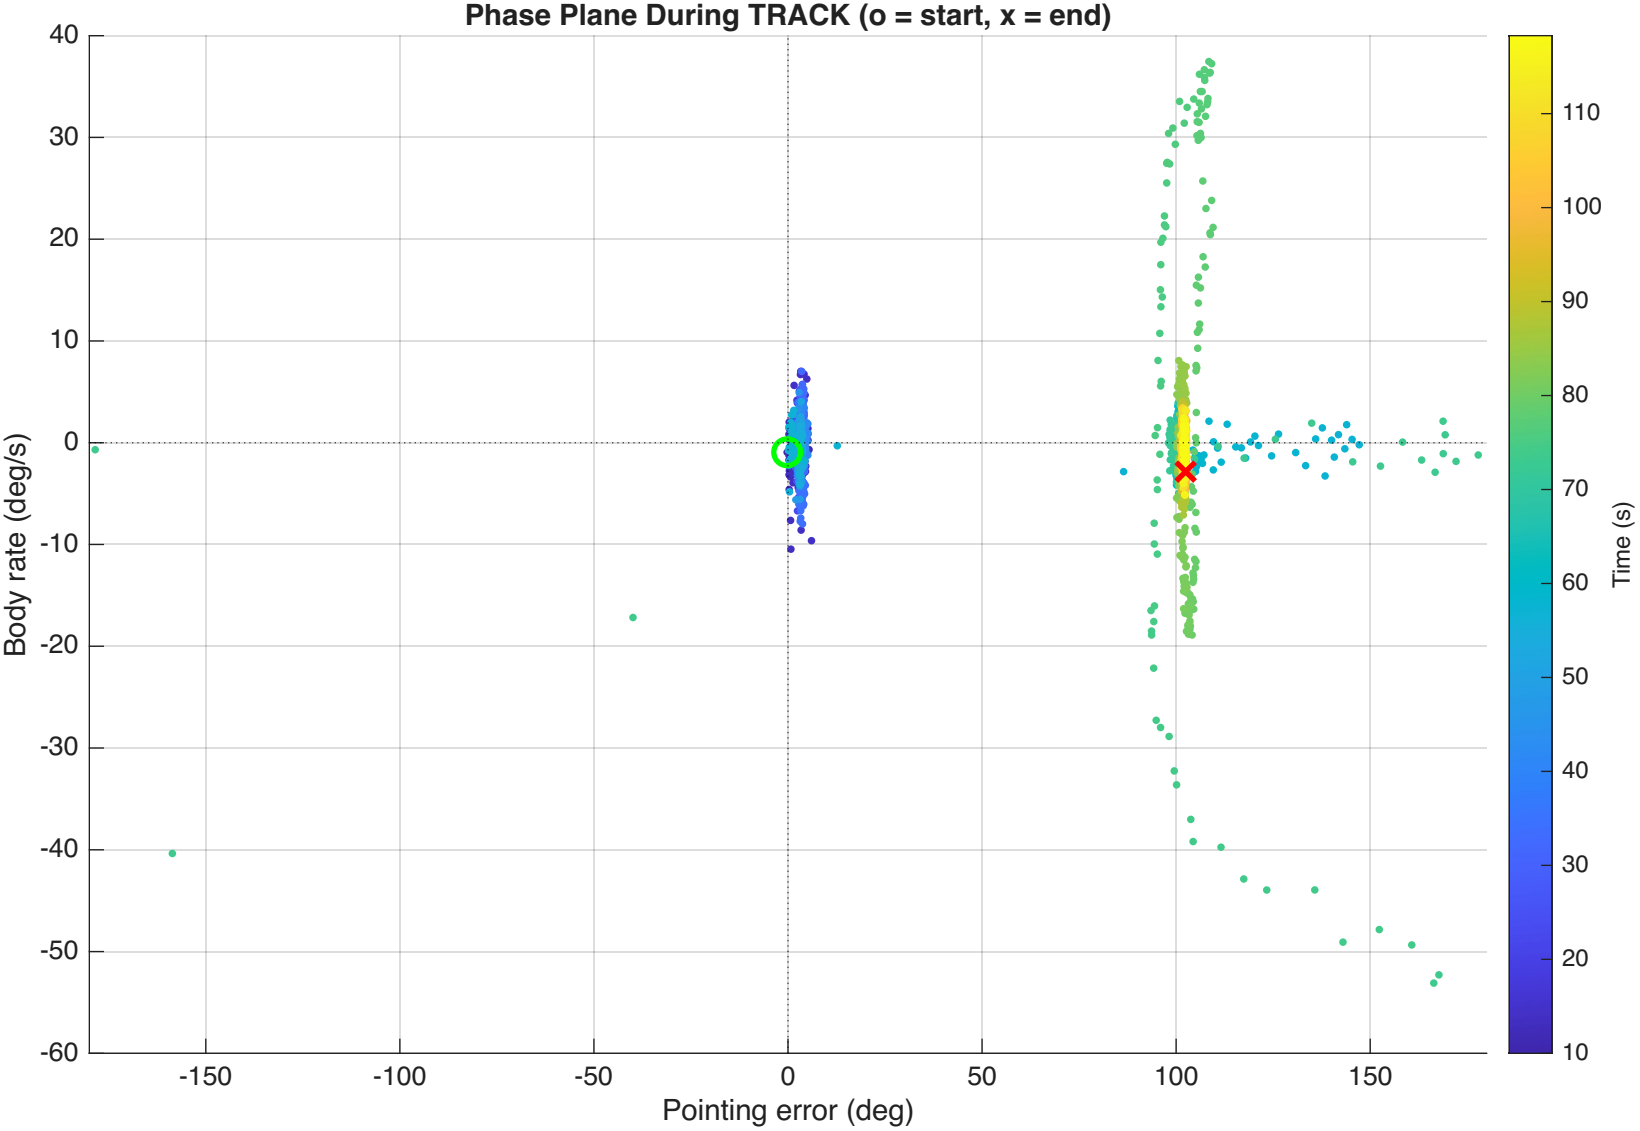

Magnetometer
mag_X
mag_Y
|B_xy|
Field (μT)
Time (s)
Magnetometer X-Y (hard-iron check)
mag_Y (μT)
mag_X (μT)
Time (s)


Sun Direction vs. Magnetometer Heading
360
270
180
90
0
Angle (deg)
0
20
40
60
80
100
Time (s)
Sun direction
Mag heading atan2(Y,X)


Solar Array Direction vs. Measured Sun Direction (0 = body +X at start)
Room-frame angle (deg)
360
315
270
225
180
135
90
45
0
0
20
40
60
80
100
-X face (solar array)
Sun (from sun sensor)
KestrelSAT Rotation (integrated gyro)
ψ (deg)
0
-20
-40
-60
-80
-100
0
20
40
60
80
100
Time (s)


Calibrated Sun Sensor Channels (1 = calibration "bright")
cap 1.2
Calibrated level
+X (0% at ADC max)
+Y (0% at ADC max)
-X (0% at ADC max)
-Y (33% at ADC max)
Sun Vector Components (direction = atan2(sun_Y, sun_X); sun_X < 0 needed to see 180°)
Component
sun_X = +X - (-X)
sun_Y = +Y - (-Y)
Sun Direction and Pointing Error, with Turn-Direction Flips Marked
Angle (deg)
array axis
Sun direction (body)
Pointing error
Error crosses 180, turn reverses (2)
Time (s)


Measured Sun Vector (points must reach the left half to face the array)
array axis
sun_Y
sun_X
Time (s)
1
0.5
0
-0.5
-1
-1
-0.5
0
0.5
1
100
80
60
40
20
0


Phase Plane During TRACK (o = start, x = end)
Body rate (deg/s)
Pointing error (deg)
Time (s)
40
30
20
10
0
-10
-20
-30
-40
-50
-60
-150
-100
-50
0
50
100
150
110
100
90
80
70
60
50
40
30
20
10