MICHIGAN 179

€3

€3 63

€3 €3

€3

43

€3

€3

DOWAGIAC MUNI (C91) 1 NW UTC-5(-4DT) N41°59.58′ W86°07.70′

B TPA-1547(800) NOTAM FILE LAN

RWY 09-27: H4700X100 (ASPH) S-30, D-60 MIRL

RWY 09: REIL. PAPI(P4L)-GA 3.0° TCH 35'. Crops.

RWY 27: REIL. PAPI(P4L)—GA 3.0° TCH 35'. Trees. Rgt tfc.

RWY 04-22: 2176X100 (TURF)

RWY 04: Trees.

RWY 22: Thid dsplcd 388'. Tree. Rgt tfc.

SERVICE: FUEL 100LL LGT ACTIVATE MIRL Rwv 09-27: PAPI Rwv 09 and Rwy 27; REIL Rwys 09 and 27-CTAF.

AIRPORT REMARKS: Unattended. Deer and birds on and invof arpt. Model RC acft ops E side of Rwy 04-22. Self svc fuel avbl 24 hrs. Admin bldg access, depress V, then III-II simultaneous, then I. Rwy 04-22 and dspl thld marked with 3' yellow cones.

AIRPORT MANAGER: 269-591-0054

COMMUNICATIONS: CTAF/UNICOM 122.8

KELLER RCO 122.1R 116.6T (LANSING RADIO)

® SOUTH BEND APP/DEP CON 118.55 (1030-0500Z‡ Sun-Fri,

1030-0445Z‡ Sat), other times ctc ® CHICAGO CENTER APP/DEP CON 127.55


CLEARANCE DELIVERY PHONE: For CD ctc South Bend Apch at

574-251-2609. When South Bend Apch clsd, for CD ctc Chicago ARTCC at 630-906-8921

RADIO AIDS TO NAVIGATION: NOTAM FILE LAN.

KEELER (L) (L) VORW/DME 116.6 ELX Chan 113 N42°08.66′ W86°07.36′ 182° 9.1 NM to fld. 794/0E. DMF unusables

155°-010° byd 30 NM blo 3,500′

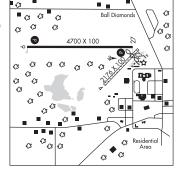

DRUMMOND ISLAND

DRUMMOND ISLAND (DRM)(KDRM) 1 SW UTC-5(-4DT) N46°00.56′ W83°44.64′ B NOTAM FILE DRM

LAKE HURON I-31C

IAP

CHICAGO

L-281

€3

IAP

RWY 08-26: H4000X75 (ASPH) MIRL

RWY 08: PAPI(P2L)—GA 3.0° TCH 35'. Thid dsplcd 650'. Trees.

RWY 26: PAPI(P2L)—GA 3.0° TCH 25'. Thid dsplcd 170'. Road.

RWY 01-19: H2500X150 (ASPH-TURF)

RWY 01: Trees.

RWY 19. Trees

SERVICE: FUEL 100LL, MOGAS LGT ACTIVATE PAPI Rwy 08 and 26 and MIRL Rwv 08-26-CTAF.

AIRPORT REMARKS: Attended Mon-Sat 1300-2200Z‡. Birds and deer invof arpt. Golf carts and pedestrians xng Rwy 08-26 due to golf crs on both sides. D22 SPB lctd 1.5 NM North. Rwy 01-19 center 20 ' of rwy fm int Rwy 08-26 north to the hngr line is asph; rmndr of rwy turf. Rwy 01-19 marked with 3' yellow cones.

AIRPORT MANAGER: 906-493-5411

WEATHER DATA SOURCES: AWOS-3 118.325 (906) 493-6410.

COMMUNICATIONS: CTAF/UNICOM 122.8

R TORONTO CENTER APP/DEP CON 132.65

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at

651-463-5588

RADIO AIDS TO NAVIGATION: NOTAM FILE CIU.

SAULT STE MARIE (VH) (DH) VOR/DME 112.2 SSM Chan 59 N46°24.73′ W84°18.89′ 139° 33.9 NM to fld. 687/4W.

VOR unusable:

007°-034° byd 40 NM

052°-095° byd 40 NM

085°-105° byd 10 NM blo 5,000′

085°-105° byd 20 NM blo 8,000°

124°-134° byd 40 NM

157°-167° byd 40 NM blo 2,900′

157°-167° byd 46 NM

207°-216° byd 40 NM

329°-344° byd 40 NM

354°-004° byd 40 NM

43 €3 03 03 43 **3** a 43 Residential Area €3 €3 N n €3 €3 03 C3 **C3** €3 €3 €3 €3 Golf Cours 61 33 63 2500 X **(3 €**3 **3** 150 ¢ €3 GGolf G n ů €3 63 €3 a €3 €3 €3 G G **43** G G €3 €3 n €3