UNIT 4 | D04 DINING WEST WALL

PANEL + PICTURE-FRAME COORDINATION | 01 NOV 2026 | R1

REVIEW ONLY — NO FRAMING OR CUT RELEASE

WALL ELEVATION • NOT TO SCALE

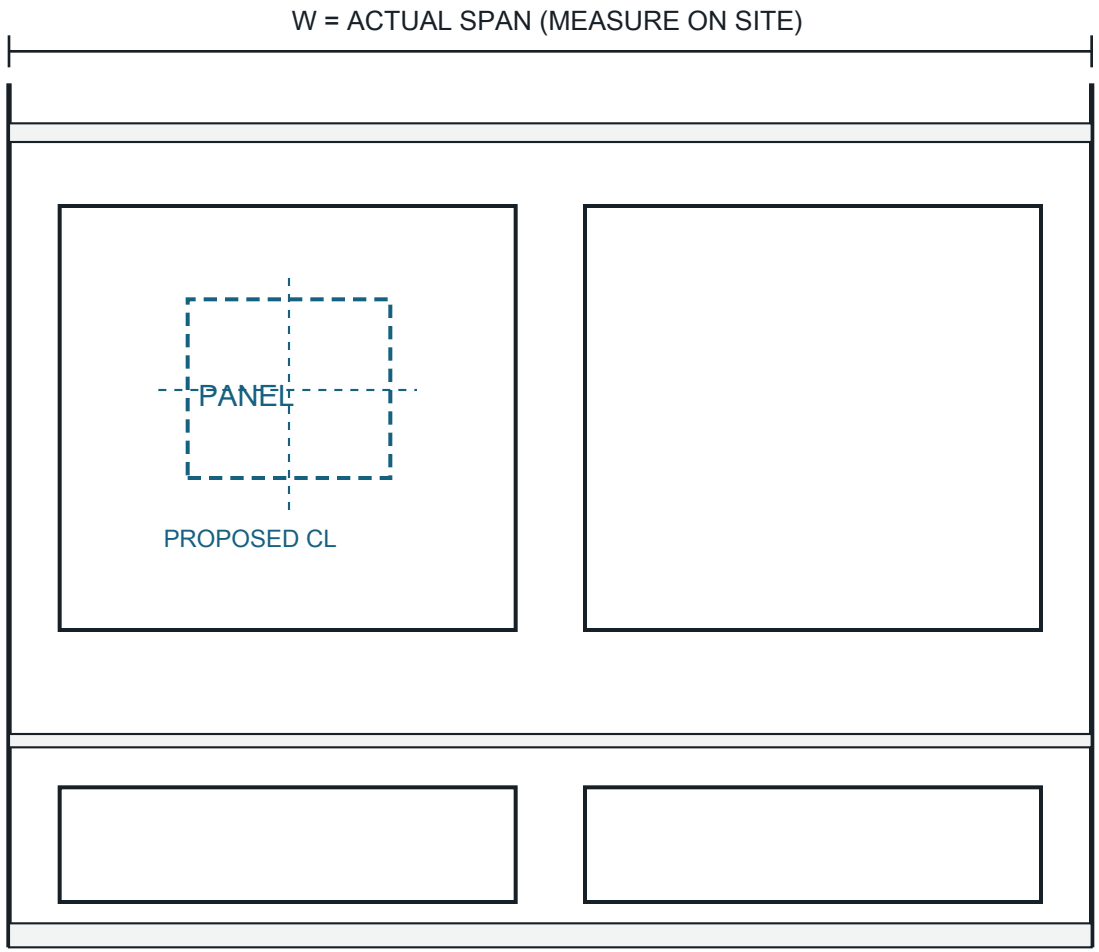

LEFT: OUTER EDGE, RIGHTMOST CASING

RIGHT: INSIDE CORNER

W excludes the transom door on the perpendicular wall.

Upper frames: 41–99 in AFF; lower: 13.5–31 in AFF.

Vertical dimensions are proposed, not field measurements.

Dashed panel is schematic only; not a cover or framing outline.

PANEL PAUSED: no charge Nov 1; no automatic Nov 2; approve quote/payment.

D04: window casing to right inside corner; transom door is on adjacent wall.

PANEL POSITION

x = W/4 + 1 in from left datum

Target CL = 65 in AFF; can/cover TBD

Both are proposals; not field marks.

Finished-floor / subfloor offset: UNKNOWN.

FRAME STRING

4 + B + 4 + B + 4 = W

B = (W – 12) / 2; numeric W unknown.

Two upper + two lower frames.

High rail and chair rail shown schematically.

EQUIPMENT

Eaton BRP20L125G • 20 spaces

Published candidate cover BRPX2A20L1F:

22 in high × 15.3 in wide.

Verify included trim and actual fit in hand.

BEFORE FRAMING

1. Actual box AND matching trim in hand.
2. Verify W, wall depth, studs, floor datum.
3. Electrician confirms cover removal, door swing, working space and feeder.
4. Rough opening: NOT DETERMINED.
5. Coordinate D5 and D02 cabinet return.

Source: Living/Dining Review R2 pp. 3–4, 11, 13; Eaton product and cover references. No site measurements certified.