Unit 4 kitchen work packet

K000

For John and the kitchen trades. Revision C, 2 November 2026. Rev C re-lays the south run per the live Magicplan MASTER plan (John’s 2 November change): dishwasher 51–75, sink base 75–105, sink CL 90, new filler about 6 15/16. Use this packet to walk the room, preserve the chosen cabinet arrangement, prepare materials and resolve the marked hold points before each affected task. Kitchen baseline reviewed 30 October 2026. Panel coordination amendment 1 November 2026 is for review; see K306. Open holds remain.



Current site evidence P02, 26 October. Owner update S15: subfloor installed, walls open, framing incomplete.

Start here

Walk the south, east and west walls using K011–K014. Mark the cabinet stations from K002. Complete framing coordination, then the electrical, plumbing and hood checks before closure. The exact finished floor, cabinet line, sink template and appliance labels still control final fitting.

This is a coordinated working draft. It does not release cutting, purchases, concealed work or construction. Sources, quantities and open decisions are retained with the editable packet.

Contents and how to use this packet

K005

K000 Unit 4 kitchen work packet
K005 Contents and how to use this packet
K010 Current decisions and source rules
K011 Walkthrough at the south wall
K012 Walkthrough at the east wall
K013 Walkthrough at the west range wall
K014 Walkthrough at the recessed pie safe
K001 Magicplan source and measured room register
K002 Cabinet setout and exact base sizes
K101 South elevation and design view
K102 East elevation and design view
K103 West elevation and design view
K104 Recessed storage study and interface
K105 Cabinet massing mockup
K201 Cabinet and finish material schedule
K202 Appliance and fixture schedule
K301 Framing and preparation
K302 Electrical rough in and lighting
K306 Panel interface and framing prerequisites
K303 Plumbing rough in and connections
K304 Range hood and mechanical coordination
K305 Walls flooring cabinetry and finishes
K203 Floor wall and ceiling quantities
K204 Countertop and backsplash quantities
K401 Sequence responsibilities and release checks
K402 Field checklist and final walkthrough
K901 Sources skills and revision record
K902 Linked source index

Each trade page states its prerequisites, material requirements, checks and hold point. Empty checkboxes record work still to verify; they are not statements of completion. All dimensions are inches unless stated. AFF means above finished floor; SF means above subfloor.

Current decisions and source rules

K010

Keep	Current basis
South cabinets	36 corner + 15 trash + 24 dishwasher opening + 30 sink = 105, then filler about 6 15/16 (105 to about 112). Sink center 90 from SE corner. Magicplan 2 Nov
East cabinets	Shared 36 corner + 24 drawer recommendation + 28 refrigerator allocation = 88. No fridge enclosure or cabinet above. S02/S03
West cabinets	18 base + 30 range + 18 base = 66. Retain this arrangement. S02/S03
Upper cabinets and niche	Uppers optional. Recessed pie-safe concept retained; rebuilding/reduction permitted. Conditional niche dimensions on K104.
Finishes and site	Floor undecided. Essex Green is prior cabinet direction; replacement finish unselected. Subfloor in, walls open, framing incomplete. S02/S15

Read the evidence type

Reported field dimensions are dated reports with named endpoints. Model dimensions are labels or calculations, not new field measurements. Proposals are targets awaiting selection or fit. Purchased, received, installed and accepted are separate states. Older 102-inch south and 12-inch trash layouts are superseded by the 105/15 working model. The Rev B order (sink 51–81, dishwasher 81–105, sink CL 66) is superseded by Rev C (dishwasher 51–75, sink 75–105, sink CL 90).

Walkthrough at the south wall

K011



P01 shows the retained window and existing recessed pie-safe. The photo establishes condition, not dimensions.

[ ] Locate the shared southeast finished-wall corner. Mark south stations 0, 36, 51, 75, 105 and about 112 (filler end); mark sink center at 90.

[ ] Check the reported 115-inch usable span to the casing. Do not deduct the casing again. Record finished surfaces, window center, sill and trim.

[ ] Locate the purchased sink and its template. Check the 30-inch sink base (75–105), faucet, disposal and dishwasher routes together. The sink now sits under the window: VERIFY faucet height and swing clear the hopper sash and sill trim (sill 45 15/16 AFF).

[ ] Measure passage with the counter end and dishwasher door open. Filler (about 6 15/16) is scribed on site; about 3 remains to the casing at 115.

Walkthrough at the east wall

K012



P02 owner direction: close the RIGHT opening in this photograph; retain the LEFT opening and the window. No closure is claimed complete.

[ ] Confirm the intended infill on site before framing. Record opening limits, support, services and finish buildup; the photo is wide angle.

[ ] From SE corner mark 36, 60 and 88 northward. Verify the actual casing endpoint; 88.5–89 is still an estimated return allowance.

[ ] Match the Haier physical label to the dimensional sheet. Check both doors, drawers, adjacent casing and moving/service access. Keep it freestanding.

[ ] Do not add refrigerator overhead cabinetry, enclosing panels or an ice-maker water line without a new selection.

Walkthrough at the west range wall

K013



P03 shows existing metal duct and open construction. Its destination and suitability are not established by the photo.

[ ] Retain 18–30–18. Tie the south end of this run to a fixed jamb or wall datum; its absolute location remains to register.

[ ] Check the reported 66 1/4-inch nook leg. A 66-inch nominal run leaves only 1/4 inch before all fit details.

[ ] Verify the range fuel, rear trim, cooking surface, hood label, ceiling and combustible-wall assembly before fixing the alcove.

[ ] Trace the entire duct. Owner reported a connection downstairs; do not assume independent discharge or reuse approval.

Walkthrough at the recessed pie safe

K014



P04 existing coating and wood joints; condition to assess before specifying repairs.




P05 cavity and visible services. Shelf depth must be measured after the planned lining and service protection.

[ ] Preserve recessed storage. Inspect cavity, services, backing, exterior/air interfaces and liner thickness; do not infer a hazard or structural detail from these photos.

[ ] Use the conditional K104 study only after the finished corner and approximate 59-inch edge are reconciled.

Magicplan source and measured room register

K001

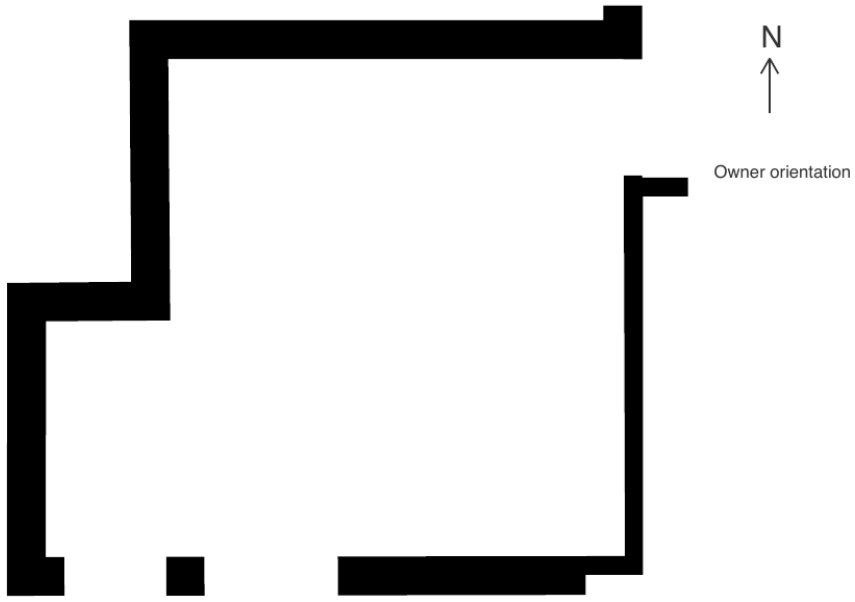


Native wall path from S01, cropped for reading. Original export and all 688 elements retained separately. Display scale only.

Dimension	Value	Evidence type
Full sink wall / overall depth	147 / 126	John Oct 14 plan labels; S13/S14
Nook leg / offset	66 1/4 / 31 1/2	Ervin reported; adopted in model
Opposite / remaining leg	115 1/2 / 59 3/4	Derived: 147−31.5 and 126−66.25
Usable sink span to casing	115	John + Ervin report; not full wall

Physical SVG units and field registration are unresolved. Do not scale this drawing for construction. Locked model depth 126 and gray extent 126 1/4 remain discrepant. Older Oct 13 pencil readings stay in S04; they do not replace later locked geometry.

Cabinet setout and exact base sizes

K002

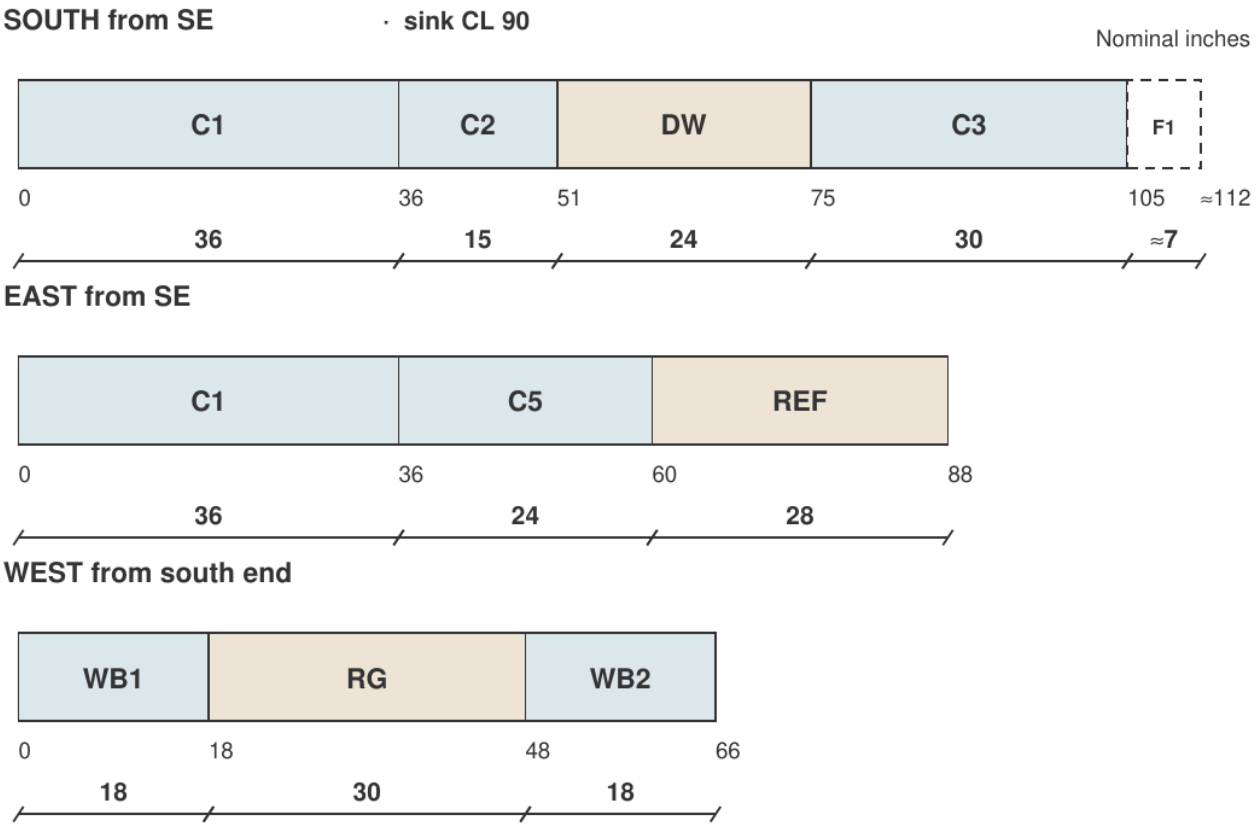


Three station diagrams; nominal inches, independent of the uncalibrated room export.

ID	Qty	Size and placement
C1	1	36 × 36 corner; SOUTH 0–36 and EAST 0–36; count once
C2 / C3	1 / 1	Trash 15 W at SOUTH 36–51; sink 30 W at 75–105
C5	1	Drawer 24 W at EAST 36–60; recommendation
WB1 / WB2	1 / 1	18 W each; WEST 0–18 and 48–66
DW / RG / REF	Openings	SOUTH 51–75 =24; WEST 18–48 =30; EAST 60–88 =28

Six base cabinets total. Widths are fixed for this working arrangement; box height/depth, corner hardware, fillers, finished ends and countertop depth remain unselected. No substitute cabinet fits merely because its nominal width matches.

South elevation and design view

K101

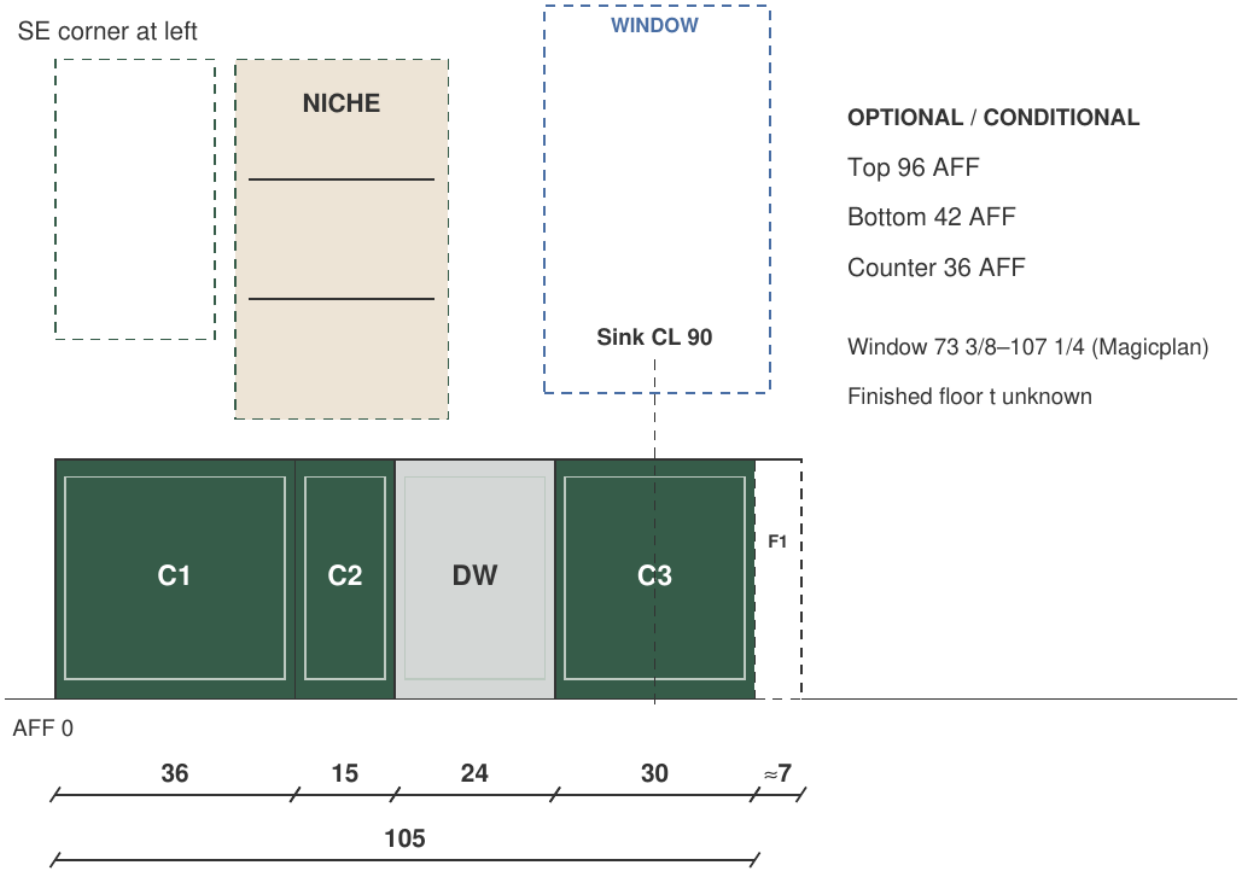

Looking south with SE corner at left. Exact nominal widths; proposed vertical dimensions. Visualization, not a measured as-built.


South station chain: 0–36 C1, 36–51 C2, 51–75 DW, 75–105 C3, 105 to about 112 F1 filler. Sink center is 90. The reported casing endpoint is 115; about 3 remains as fitting space. Window per Magicplan: 73 3/8 to 107 1/4 from SE, CL 90 5/16, so the sink is about centered under it.

Counter 36 AFF is a target. Conditional niche clear opening is 30 W × 54 H, with bottom 42 and top 96 AFF. Optional 42-high uppers align 54–96 AFF. The drawing does not specify cabinet box height, toe kick or rough framing. S02/S03.

[ ] Resolve floor buildup t before marking SF heights: SF mark = AFF target + t. Verify sink/window and niche/counter relationships on site.

East elevation and design view

K102

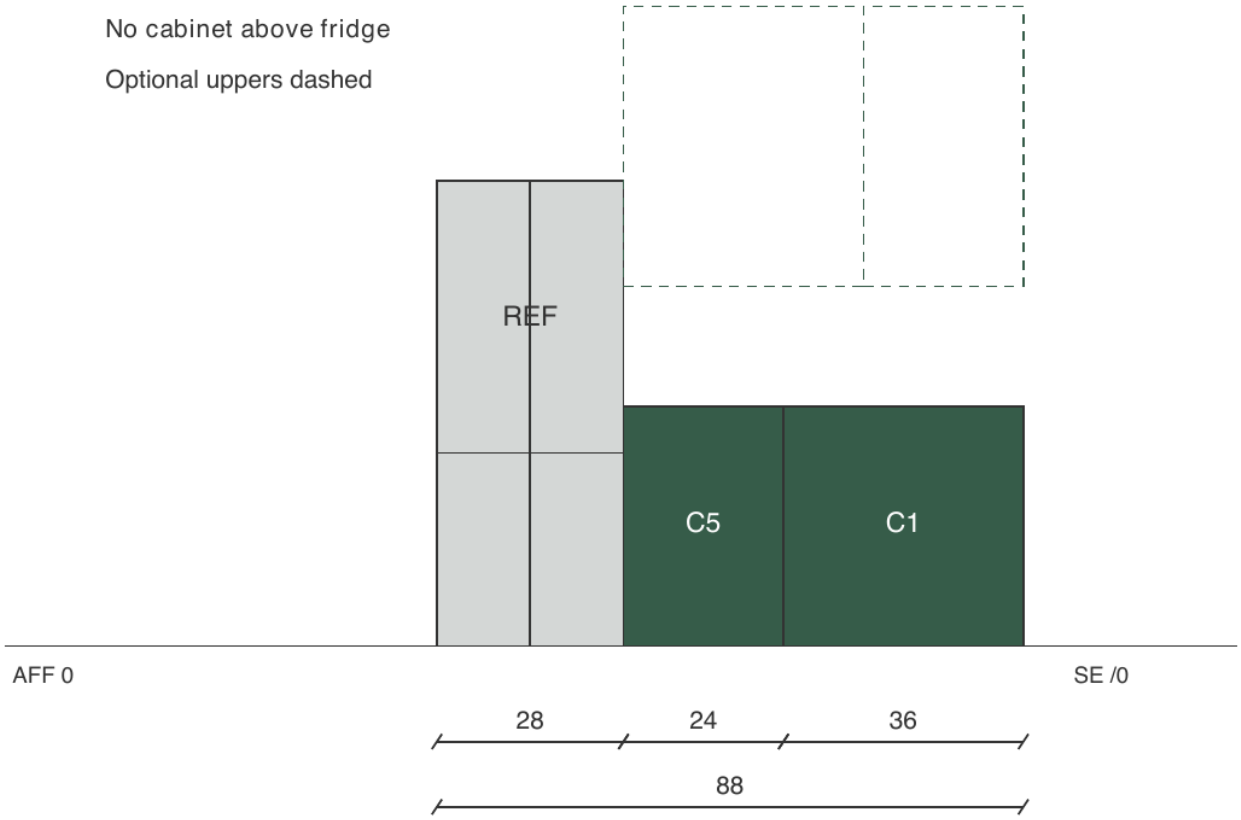

Looking east with SE corner at right. Optional uppers shown with dashed outlines. Refrigerator stays freestanding.


From SE north: shared corner 0–36; drawer 36–60; refrigerator nominal allocation 60–88. Estimated return 88.5–89 leaves 0.5–1 before extra fit details. This is not a verified fitting pass.

Haier S08: body 27 9/16 W × 26 9/16 D × 69 7/8 H; rear space 2; side/top 0. Door-open 90° envelope 29 5/8 W and 38 D from appliance back. These are manufacturer dimensions for that sheet; verify the actual unit revision and surrounding passage.

Other product records show different body sizes. Keep that revision conflict open. Optional corner upper has 24-inch legs; optional straight upper 36 W × 42 H × 12 D. No upper or casing over the fridge.

West elevation and design view

K103

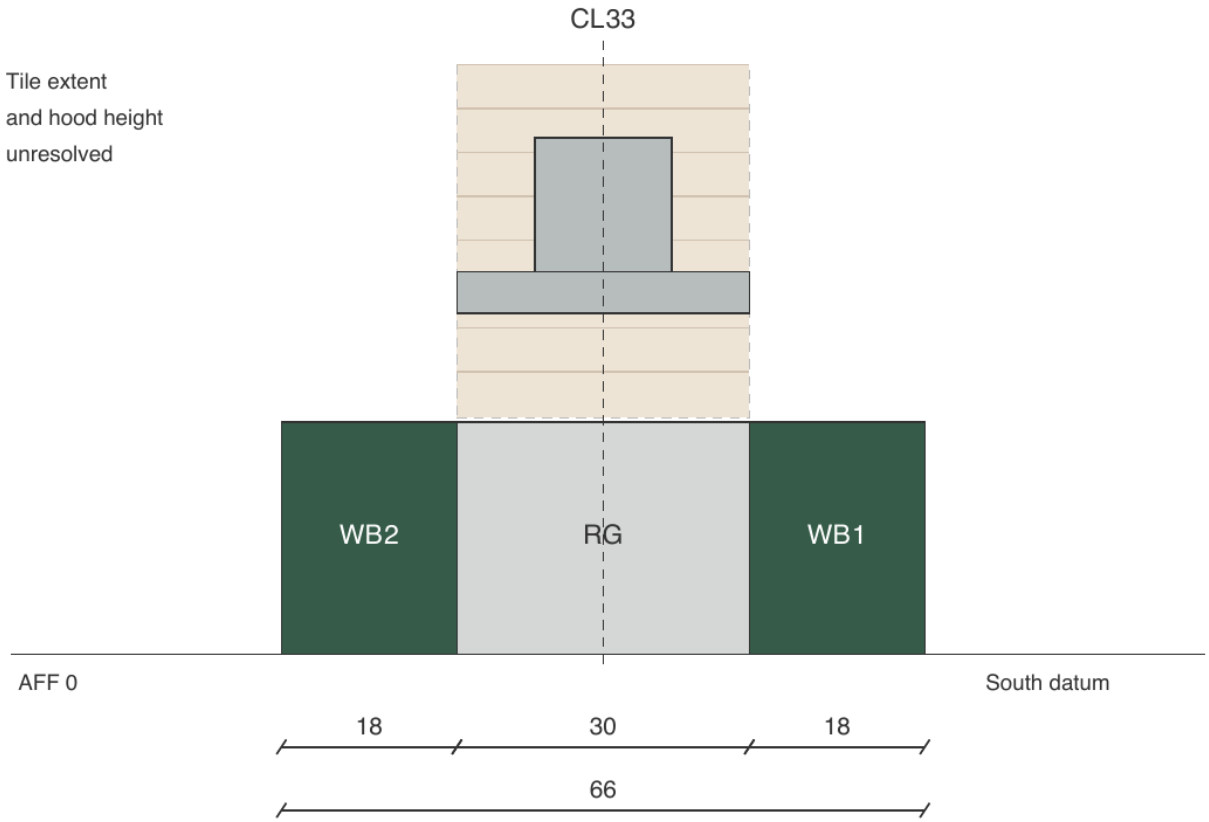

Looking west, run south end at right. Range and hood center 33 from that datum. Tile is an unselected visualization.


Keep 18–30–18. Do not add old 42-inch alcove or 4-inch pilasters inside the 66-inch run without a new dimensioned fit check. Range-to-ceiling tile remains the design direction; actual width, height, returns and trim are open.

Viking S10 recommends hood 30–36 above countertop; Zephyr S11 permits 28–36 above range top. If both datums coincide, their common band is 30–36. Actual cooking surface, counter and hood datums must be measured before selecting a height. No numeric hood AFF is released.

[ ] Resolve combustible side/rear construction, range trim and required hood support before framing or tile. A tile face alone does not establish a noncombustible assembly.

Recessed storage study and interface

K104

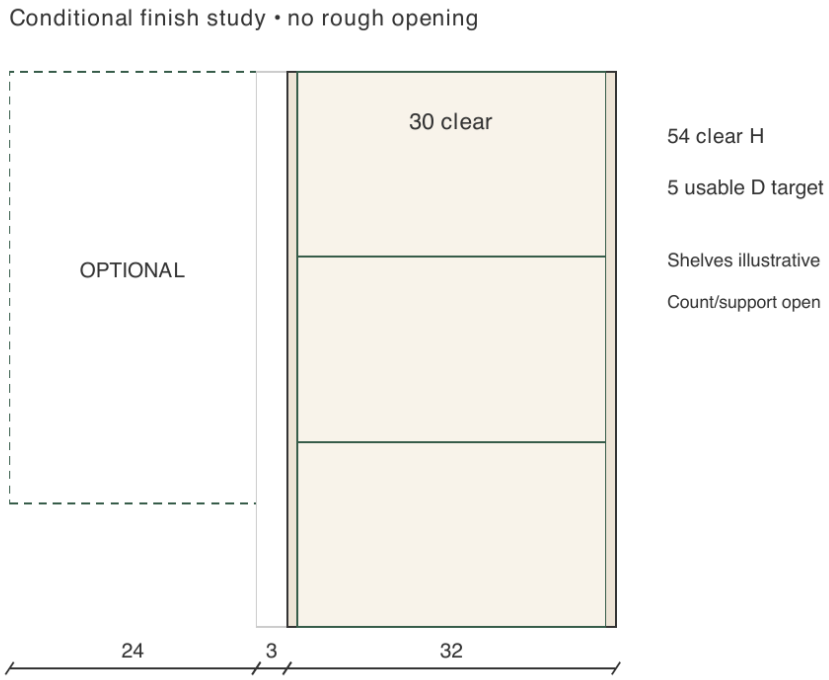

Conditional visual study: 24 optional upper + 3 separation + 32 assembly zone =59. This is not a rough-opening cut plan.




P06 tape near 59 at an edge; the full origin is not visible. Preserve the approximate status.

Target clear opening 30 W × 54 H × 5 usable D. The 32-wide zone includes a provisional total 2 for side finishes. Shelf count, material, thickness, supports and clear depth remain open. Top 96 and bottom 42 AFF are proposals. Resolve optional upper choice and actual corner-to-window edge before fabrication.

Cabinet massing mockup

K105

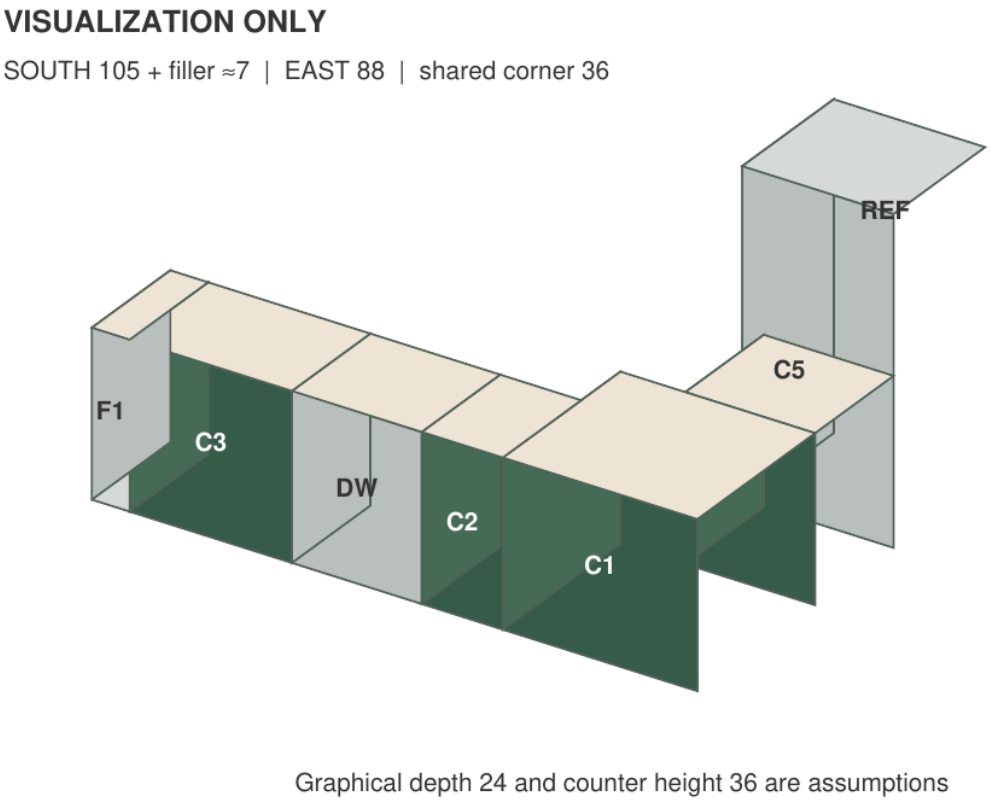

Axonometric visualization of the current nominal L run. Cabinet fronts and colors are illustrative; no room survey or floor finish is implied.

The shared 36 corner appears once. South continues 15 trash, 24 dishwasher opening, 30 sink and about 7 filler. East continues 24 drawer and 28 refrigerator allocation. This mockup uses 24-inch depth and 36-inch counter height only as display assumptions; actual cabinet dimensions and counter depth remain open.

The room walls, openings and walking clearances are deliberately unlocated in this visualization because their field registration is missing. Use K001 for unchanged source geometry and K002 for dimensioned station marks. No overhead refrigerator cabinet is introduced. Optional uppers and the separate west run are shown in their own elevations.

Cabinet and finish material schedule

K201

Material	Quantity basis	Selection and fit requirement
Base cabinet boxes	6 required	C1, C2, C3, C5, WB1, WB2; K002 widths. Product, height/depth, overlay, hinges and support open.
Upper cabinets	0 required; 2 optional	24 corner legs + 36 straight; 42 H study. Choose or omit before backing/UC lighting.
Fillers and panels	Unknown	F1 filler about 6 15/16 at SOUTH 105–112 (Magicplan); field scribe, finished ends, DW support/panels and toe kicks need actual cabinet line.
Countertop	Formula K204; final unknown	Material/color/thickness/edge, support, seams and purchased-sink template open.
Floor and transitions	Model area K203	Undecided; inspect stock, select assembly and thickness before dependent heights.
Range tile and backsplash	Extents unknown	Exact tile, substrate, mortar, grout, movement joints and edge trim open.
Paint and trim	Surface areas unknown	Essex Green prior cabinet direction; other coatings, sheen, preparation and trim profiles open.
Niche and blocking	Unknown	Inspect cavity; select liner/shelves/support and service detail before material takeoff.

Reclaimed cabinet sourcing remains exploration. Confirm matching adjacent box heights/depths and usable pullout interiors; paint does not make unlike profiles compatible. Verify stock before calculating what to buy. No costs or net-buy quantities are invented.

Appliance and fixture schedule

K202

Item and status	Current basis	Next evidence
Sink purchased per owner	Model/mount unknown; 30-inch base allocation. S13	Actual unit, receipt, template, min cabinet, drain/faucet holes, supports.
Haier refrigerator purchased	QJS15HYRFS; S08/S09. No water kit assumed.	Label/revision, received location, door/drawer envelope and ventilation.
Range purchased per owner	Viking VGCC5304BSS adopted for calculation; S10.	Physical model, fuel, trim, anti-tip, clearances and service connections.
Hood purchased per owner	Zephyr ZSA-E30AS adopted; S11.	Label, mounting/support, duct size/route/termination and power.
Bosch DW selected for calculation	SHV9PT53UC; S05. Purchase not proven. Cutout 34 1/8 H × 24 W × 24 D in S06.	Full physical E-Nr and revision; finished opening, door panel/handle and supply conflict.
Disposal proposed only	Badger5 corded SKU 79883A-ISE; not purchased.	Confirm sink mount, space, cord/switch and plumbing interface.
Faucet and lighting	Models and acquisition unverified	Faucet fit under window; 3 task lights (T1 18, T2 54, T3 90 on sink CL) + 1 main + UC driver per KE Rev E; fixture/control compatibility.

Purchase does not establish delivery, installation or acceptance. These later states remain unverified here. Preserve and inspect owned items before proposing replacements.

Framing and preparation

K301

Scope and prerequisites

John coordinates this phase with the relevant trades. Starting state: subfloor installed, walls open, framing incomplete. Walk the room first, confirm finish planes and chosen base stations, then coordinate support and service paths.

Materials to identify before work

Framing/repair members, cabinet and hood backing, niche liners/support, opening-infill materials, fasteners and compatible wall/ceiling assemblies. Sizes and counts follow the actual support and service details; none are inferred from photographs.

[ ] Verify installed subfloor condition and datum; installed does not mean levelness or suitability accepted. Establish planned floor buildup.

[ ] Confirm RIGHT-opening infill in P02 and retained LEFT opening/window. Resolve framing and service conflicts before any alteration. Separate D04 panel framing requires the actual box and matching trim in hand; see K306.

[ ] Locate support for bases, optional uppers, hood, niche and selected ceiling fixtures. Leave required access and coordinate duct/pipe/cable paths.

[ ] Record concealed conditions, actual backing and all penetration locations with dated photos and dimensions before closure.

Done when and hold point

Framing interfaces are resolved, support is confirmed by the responsible trade, rough-in paths fit the accepted layout and required inspection/test evidence is recorded. Hold wall closure where unresolved services, support or inspection remain. Unaffected sourcing and finish sampling can continue.

Electrical rough in and lighting

K302

Scope and prerequisites

Electrician coordinates devices after framing, floor, cabinet and appliance interfaces are marked. Tisa confirms Romex for kitchen branch wiring; actual listed cable, gauge, conductor counts, routing and installation require electrician review. Quantities remain unmeasured. The following are owner design proposals, not circuit approval. Eaton 20 full-size spaces is the owner selection; panel/feeder technical acceptance remains open. See K306 and S02, S05–S11.

Circuit proposal	Devices or station
SA-A 20 A / SA-B 20 A / SA-C 20 A	EAST E1/E2 at 12/48; SOUTH S1/S2 at 36/93; WEST W1/W2 at 9/57. Heights open.
REF / RG / DW / GD / HD	Five separate appliance provisions; HD hardwired proposal. DW and GD separate neutrals, no MWBC proposal.
LT one lighting circuit	3 task lights over sink run (T1 18, T2 54, T3 90 from SE, 15 off south wall), 1 main, UC driver. Entry controls; wireless sink remote controls task group; UC separate control. Per KE Rev E.

[ ] Resolve Bosch conflict: S07 PDF p 8 requires dedicated 15 A; older owner proposal says 20 A. Verify full E-Nr/manual and electrician design before release.

[ ] Provide ceiling boxes for the main light and three task lights (18, 54, 90) and an accessible UC driver. LT route per KE Rev E: panel to attic to entry controls; task lights electrically parallel. Verify actual route and supports.

Materials and done when

Select breakers/protection, conductors/raceways, boxes, receptacles, motor-rated disposal switch, controls and driver from verified loads and installation details. Nine kitchen circuit proposals plus separate HVAC interface; breaker ratings are not load values. Hold closure until required trade checks and photos. Feeder working basis is 100 A copper in conduit; old 80 A/#4 allowance is superseded for takeoff. Installation acceptance and Trane/older Lennox coordination remain with system owners. See K306/S24.

Panel interface and framing prerequisites

K306

1 November 2026 amendment. REVIEW; CUT RELEASE HOLD. This page updates kitchen dependencies on the shared panel. Electrical and interior owners retain D04 design and release. S17–S24.

Settled selection and technical review

Owner selected Eaton BRP20L125G, 20 full-size spaces, 125 A MLO, X2. Matching cover BRPX2A20L1F and ground bar are listed included; verify the supplied assembly in hand. Maximum 40 circuits is not 40 spaces. BRP20L125G125AMLO is unverified descriptive retailer text, not a separate catalog model. S18/S24.

Older >=40/42-space expectations are superseded. Electrical review: 18 current 120V single-pole proposals give preliminary 18 occupied /2 unassigned MLO spaces, without tandems. Upstream feeder uses no branch space; future two-pole equipment may consume reserve. Owner working basis: 100 A copper in conduit; old 80 A/#4 allowance is superseded for takeoff. #3 copper fits published #6–2/0 lugs; final load/protection/termination and installation checks remain held. S24.

D04 reference and dimensional limits

Use R2 D04 dining west entry infill, facing dining. W runs from outside edge of rightmost window casing to right inside corner of west wall; north-wall transom doorway is outside W. Measured W is missing. Proposed x = W/4 + 1 in and 65 in AFF remain unreleased; Can/cover reference and floor buildup need confirmation. Do not substitute E11 living-face approx. 12 in. S19.

Eaton metadata: 21 length/depth, 14.31 width, 3.88 height. Separate reported X2 sketch: 21.10 H × 14.30 W × 3.80 D. Neither defines installation or cuts. Matching cover BRPX2A20L1F is published as 15.3 W × 22 H × 1 D; verify supplied trim and physical fit. Clearances and rough opening remain unverified. See S21 and current D04 review drawing S22.

Work prerequisites and release

[ ] John must have the actual box AND matching trim in hand before D04 framing. Obtain verified field datums, framing detail and responsible technical release before cutting or closing affected work.


[ ] Electrical owner supplies source-backed cable quantities from measured routes, conductor/gauge counts, allowed method, waste and existing stock. Kitchen quantities stay on hold where those inputs are missing. Panel purchase paused until Monday 2 November 2026. Current quote/payment approval is required; no automatic purchase. S23.

Plumbing rough in and connections

K303

Scope and prerequisites

Plumber starts from the purchased sink, its template, the 30-inch sink base at 75–105 and sink center 90 from the SE corner. The drain/trap arm and vent move about 24 west from the old center 66 and now sit directly under the window (sill 45 15/16 AFF, head about 104): the vent cannot rise straight up through the window opening or header and must offset — plumbing review. Dishwasher (51–75) is LEFT of the sink; its drain hose and supply enter the sink base from the left. Confirm floor buildup, counter underside, disposal and actual dishwasher instructions. Current pipe centers and connection heights are not established.

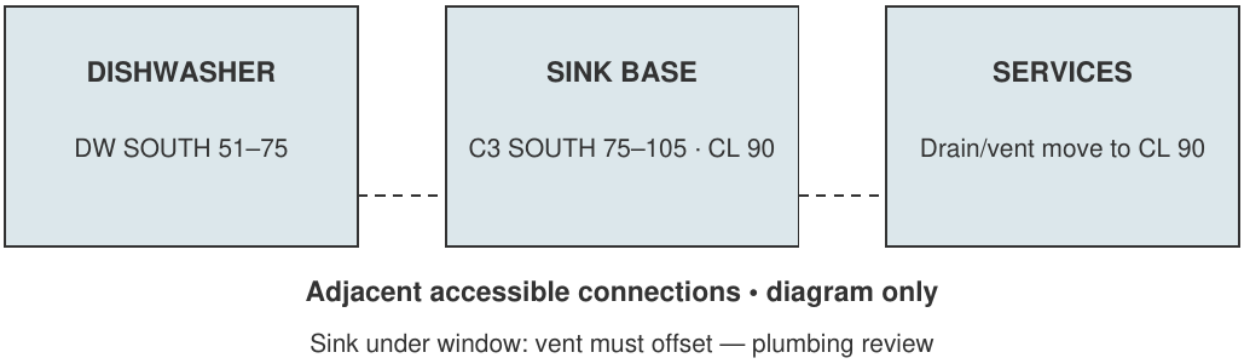

Functional relationship only. No pipe route, fall, diameter or rough-in height is specified.

Materials to identify

Sink supports/mounting kit, faucet and supply connectors, accessible isolation valves, drain/strainer/trap parts, dishwasher hose/drain connection and required drain protection, disposal flange and compatible fittings. Inventory included parts; quantities depend on verified routes and the actual products.

[ ] Keep dishwasher electrical connection accessible in the adjacent sink base as instructed by S07 (KE Rev E: DW + GD 2-gang at 79 from SE, 14 AFF, two circuits); coordinate wet services and disposal/sink space.

[ ] Record actual hot/cold, waste/vent, isolation and dishwasher routes; confirm drain protection with responsible plumbing review. No refrigerator water line is selected.

Done when and hold point

Trade verifies layout, access and required testing/inspection with dated evidence. Hold closure and counter cutout until affected fit and plumbing details are resolved. Final test method/duration follows applicable product and trade requirements; this packet invents none.

Range hood and mechanical coordination

K304

Scope and prerequisites

Hood/mechanical installer coordinates with electrician and range installer. Match actual Viking/Zephyr labels and range trim to S10/S11; verify cooking/counter datums, ceiling, framing and wall assembly. Preserve 30-inch range opening and center 33 on the west run.

Source requirement	Current consequence
Zephyr S11 PDF p 3	28–36 above range top; overall hood assembly height 30–45, including body and telescopic cover. Confirm ceiling compatibility before mounting.
Viking S10 pp 10–11	Hood recommendation 30–36 above counter; side trim 3/8 above adjacent counter; 6 minimum to combustible sides above 36 counter. Actual assembly review needed.
Viking rear and upper conditions	Rear island trim versus backguard/high shelf have different conditions. Upper cabinet depth max 13 and 18 above counter in specified zone. No generic tile clearance exemption.
Zephyr duct basis	Minimum 6 round or 3 1/4 × 10 rigid metal; 100 ft equivalent limit with fittings/cap deductions. Surveyed route is missing.

Checklist and materials

[ ] Trace origin to exterior termination, measure sizes/lengths/elbows, identify any downstairs connection and establish intended independent use.

[ ] Specify compatible duct, transitions, damper/cap, sealing/support, hood mounting and range anti-tip/connection parts after the route and manuals are reconciled.

Done when and hold point

Hold duct reuse, hood height and alcove closure until the complete route, clearances, support and required checks are resolved. No shared exhaust or gas/electrical installation is approved by this packet.

Walls flooring cabinetry and finishes

K305

Scope and prerequisites

After framing and required rough-in checks, the finish and cabinet trades coordinate wall planes, finished-floor thickness and selected cabinet instructions. The floor/cabinet sequence depends on the selected assembly; do not assume a floating floor can be pinned beneath fixed bases.

[ ] Close only released wall/ceiling areas, preserve service access, complete compatible preparation and finish surfaces to the selected product requirements.

[ ] Confirm floor material, stock, thickness, substrate conditions and transitions. Document the accepted floor/cabinet sequence and appliance removal path.

[ ] Dry fit the six bases to K002 stations. Verify corner operation, sink template, pullout interior, actual panels/fillers and dishwasher opening before fixing.

[ ] Template countertop after accepted base setting and physical sink details. Resolve supports, seams, cutout, overhangs and edge profile with fabricator.

[ ] Any selected kitchen tile work requires correct materials on site. John establishes the intended finish and initializes/approves the actual dry layout, including counter, window, hood, outlet and transition interfaces. Confirm substrate, mortar/grout, joints and edges. CONTINUE only in the bounded released area under John’s oversight; at most 1 helper if later assigned. STOP for changed material/fit or missing John startup approval.

[ ] Install fixtures, hardware and final trim after surfaces are ready. Protect finished work per selected material cure and handling instructions.

Materials and done when

Use K201 and K203–K204 to identify measured material needs; exact products and quantities remain open where inputs are missing. Finish phase is complete when surfaces, cabinet/door operation, counter fit, service access and fixture function are checked and dated punch items closed.

Floor wall and ceiling quantities

K203

Surface	Current quantity	Basis and limitation
Kitchen floor	114.08 sq ft model	S01 label 189 / P07 screenshot. Full-room model display; not net exposed floor or new field area.
Planning allowance	10%: 125.49 sq ft 15%: 131.19 sq ft	Scenarios 114.08 × 1.10/1.15; neither waste rate selected. Actual cutting layout governs.
Historical tile stock report	8 × 1.440 m² =124.00 sq ft	S02 report; 8.70% above model area. Availability, lot, condition and selection unverified. 9 cartons not established available.
Walls and ceiling finish	Unknown	Actual heights, all segments, openings and returns absent. No rectangle inferred from bounding room dimensions.

Editable takeoff formulas

Wall net area = [sum of each wall length × height – measured openings + measured returns] /144, with dimensions in inches. Ceiling area requires the actual ceiling shape and slopes. 114.08 is only a possible horizontal model projection, not a verified ceiling takeoff.

Older owner area 116 sq ft in S13 is retained as a different dated basis. It is not silently merged with 114.08. Baseboard/trim length = measured exposed segments minus door/covered exclusions plus returns. Paint quantity requires product coverage/coats and actual surface condition; no gallon count is assigned.

[ ] Record measurements, selected product coverage, carton size, cutting allowance and usable stock before net-buy quantity is calculated. Unknown is not zero.

Countertop and backsplash quantities

K204

Component	Formula or scenario	What is still missing
Straight countertop portions	SOUTH 69 Ds + EAST 24 De + WEST 36 Dw, divided by 144	Depths Ds, De, Dw unknown. Shared corner is excluded from these straight portions.
Depth 24 illustration only	(69 + 24 + 36) × 24/144 =21.50 sq ft	Excludes corner surface, overhangs, cutouts and seams. Not final order/slab quantity.
Gross fabricated surface	[69Ds + 24De + 36Dw + Acorner + Aoverhang]/144	Actual corner shape, overhangs and seam/support plan. Sink cutout separately; do not assume material saving.
South backsplash strip scenario	105 × 18/144 =13.125 sq ft	18 derives from optional upper 54 minus counter 36; deduct actual window/niche openings and add returns.
East backsplash strip scenario	60 × 18/144 =7.50 sq ft	Same conditional height; actual covered extent/end detail unresolved.
West range to ceiling tile	Walcove × (Hceiling–Hcounter)/144 + returns	All actual extents and hood/trim/opening deductions missing. Do not reuse old 42-inch alcove width.

These scenario areas are separate checks, not an additive tile or countertop order. Clear niche 30 × 54 =11.25 sq ft is only opening area; lining, shelves and returns need separate measurements. All unknown final quantities remain blank/null in editable data.

Sequence responsibilities and release checks

K401

Phase	Lead and work	Done when
1 Walk and reconcile	Producer + John + trades: field datums, owned items, finish planes and locked layout.	Measurements tied to endpoints; product/selection gaps assigned.
2 Complete framing coordination	John + relevant trades: support, doorway infill, niche, hood and service routes.	Required support/routes verified; affected work released. D04 box and matching trim in hand before framing; K306 holds apply.
3 Rough in and inspect	Electrical, plumbing, mechanical: install approved details and record concealed work.	Required tests/inspections and photo record complete before closure.
4 Close and prepare finishes	Finish trades: walls/ceiling; floor preparation and agreed cabinet/floor order.	Assemblies ready under selected product requirements; datum t fixed.
5 Set bases and template	Cabinet installer + counter fabricator: dry fit, fix, template actual sink.	Fit, support, openings, service access and seam plan accepted.
6 Finish and connect	Tile/finish trades + appliance/plumbing/electrical installers.	Compatible finishes and connections complete; functional checks recorded.
7 Punch and hand over	John + owner + producer: inspect work, record exceptions and manuals.	Dated punch closed or explicitly retained; no implied acceptance.

Durations, crew bookings and lead times are not verified. Do not import Unit 2 time/cost allowances. Owner retains spending approval. Producer maintains this packet; no duplicate project, financial or Todoist ledger is created.

Field checklist and final walkthrough

K402

Resolve before affected fabrication or rough in

[ ] Finished corner/casing/window coordinates and west-run origin registered; actual door and appliance-open passage measured.

[ ] Floor product and buildup t selected; cabinet line, box sizes, fillers/panels and counter depth confirmed.

[ ] Purchased sink and actual appliance labels found; templates/manual revisions matched; Bosch 15 A/20 A conflict resolved by responsible electrical review.

[ ] Niche cavity/services, hood/range trim and complete duct route resolved; no unsupported shared-exhaust assumption.

[ ] Required permit/inspection steps confirmed by responsible trade and project lead before affected work.

Final walkthrough after work is actually complete

[ ] Open every cabinet, pullout, appliance and retained door; confirm service/removal access and protected finished edges.

[ ] Check plumbing, appliance operation, lighting controls, disposal switch and hood operation using required product/trade methods; record actual results.

[ ] Inspect floor transitions, backsplash edges/joints, counter/sink seals, niche shelves, paint and trim. Record punch items with photo, owner and closure date.

[ ] Keep manuals, model/serial photos, concealed-work record, inspection/test evidence and warranties with the shared kitchen folder.

Field record: Date _____ Trade/person _____ Item ID _____ Observation _____ Evidence/photo _____ Open or closed _____. A checkmark needs supporting evidence; it is not authorization to spend or build.

Sources skills and revision record

K901

Revision C, 2 November 2026: south run re-laid to match the live Magicplan MASTER plan abb 2d2c6 after John changed the layout. Dishwasher opening 51–75 (Magicplan appliance 23 3/4), sink base 75–105, sink center 90, new F1 filler about 6 15/16 at 105–112 (Magicplan Base Filler 0.17621 m). Corner and trash, east and west runs, walls, window, niche and doors unchanged. Plumbing drain/vent relocation, faucet/window clearance and countertop cutout follow. Electrical per KE Rev E. All holds unchanged.

Revision B preserves source files and the accepted working dimensions. Revision A remains archived. Its cabinet footprint placement on raw SVG used an unverified inch conversion; that placement is withdrawn. Revision B separates the unchanged native wall view from dimensioned cabinet diagrams. No native Magicplan model was edited.

Source preservation demonstrated

Reviewed Magicplan instruction package 0.2.1 and geometry utility 0.1.0 were read and used locally. Nineteen utility tests passed. Actual project smoke run retained all 688 source elements and checked 159 wall vertices with maximum residual 0 SVG pixels. This tests preservation, not field accuracy. Physical scale and registration remain null/unverified.

No live Magicplan connector or CAD engine was exposed. Instruction files do not create those capabilities. The raw SVG exports no native objectIDs; source element/vertex indices are recorded without inventing vendor identifiers. No software installation or new account was used. Exact paths, hashes, versions and test commands are in skills/ADOPTION-RECEIPT.json and qa/.

Source guide

S01 native export; S02 latest sequential owner decisions; S03 current cabinet study; S04 older field record; S05 Bosch confirmation; S06–S11 manufacturer documents; S12 fridge review; S13 dated master; S14 connected-model audit; S15 latest site state; S16 Unit 2 structure precedent. P01–P06 are site photos; P07 is a Magicplan screenshot.

The linked source index and editable JSON/CSV carry provenance and open values. Unit 2 supplied headings, trade organization and completion checks only; its scope, quantities, costs and durations were not transferred. Kitchen baseline reviewed 30 October 2026. Panel coordination amendment 1 November 2026 is for review; see K306. Open holds remain.

Linked source index

K902

S01 S01-floor-plan-original.svg

S02 S02-Owner-Inputs-2026-10-26.md

S03 S03-Current-Model-Dimensions.md

S04 S04-source-accepted-measurements-2026-10-13.md

S05 S05-Owner-Selection-Confirmation-2026-10-27.md

S06 S06-Bosch-SHV9PT53UC-specsheet.pdf

S07 S07-Bosch-SHV9PT53UC-installation-9000901316_A.pdf

S08 S08-Haier-QJS15HYRFS-dimension-sheet.pdf

S09 S09-Haier-QJS15HYRFS-manual-Rev1-11-25.pdf

S10 S10-Viking-VGCC530-F20543-EN-installation.pdf

S11 S11-Zephyr-ZSA-E30AS-savonaa-manual.pdf

S12 S12-Haier-Clearance-Review.md

S13 S13-Master-Current-Kitchen-2026-10-26.txt

S14 S14-source-geometry-failed-audit-2026-10-14.md

P01 P01-IMG_5151.png

P02 P02-E9EF3A08-6201-4954-9469-6E6E78FAACC2.jpeg

P03 P03-IMG_5152.jpeg

P04 P04-IMG_5156.jpeg

P05 P05-IMG_5157.jpeg

P06 P06-IMG_5184.jpeg

P07 P07-IMG_5179.jpeg

S15 S15-Latest-owner-instructions-2026-10-29.md

S16 S16-Unit2-structure-reference.json

S17 S17-Owner-panel-coordination-2026-11-01.md

S18 S18-Eaton-BRP20L125G-page-check-2026-11-01.json

S19 S19-D04-interior-coordination-2026-11-01.md

S20 S20-Whole-unit-circuit-reference-2026-11-01.json

S21 S21-Eaton-cover-page-check-2026-11-01.json

S22 S22-D04-review-handoff-2026-11-01.json

S23 S23-Owner-panel-purchase-hold-2026-11-01.json

S24 S24-Independent-electrical-review-2026-11-01.md

Local source links require this shared folder. Manufacturer links open the source website. Complete hashes and original paths: source-register.json.