Lead Based Paint Inspections

At

Santa Fe Service Unit
Santa Fe, New Mexico

for

Albuquerque Area Indian Health Service
Division of Health Facilities
5300 Homestead Road, NE
Albuquerque, New Mexico 87110

By

U.S. Public Health Service
Federal Occupational Health
2201 Sixth Avenue, M/S Rx-21
Seattle, Washington 98121-2500

September 2007

TABLE OF CONTENTS

Section	Title	Page No.
1.0	INTRODUCTION	1
2.0	SURVEY METHODS	1
2.1	XRF INSTRUMENTATION	1
2.2	XRF CALIBRATION CHECK	2
2.3	SUBSTRATE CORRECTION	2
2.4	FIELD DOCUMENTATION	2
3.0	LEAD-BASED PAINT DEFINITIONS	2
4.0	RESULTS SUMMARY	3
5.0	DISCUSSION AND RECOMMENDATIONS	4
6.0	PROJECT LIMITATIONS	5

Appendices

A	TABLES OF XRF FIELD DATA AND CALIBRATIONS
B	XRF SPECTRUM ANALYZER RESULTS & PROGRAMMING COST ESTIMATES
C	SITE MAPS
D	CERTIFICATIONS

1.0 INTRODUCTION

As requested by the Albuquerque Area Indian Health Service (IHS), a Lead-Based Paint (LBP) Inspection was conducted on eight (8) facility buildings at the Santa Fe Service Unit in Santa Fe, New Mexico between December 10 - 21, 2006. The purpose of the inspection was to identify lead in paint on interior and exterior painted surfaces of each building. Measurements were made using a Niton X-ray Fluorescence (XRF) Spectrum Analyzer. Confirmatory chip sampling for laboratory analysis proved to be unnecessary. The inspections were conducted by Mr. Donovan Denny, Mr. Landon Johnson, Ms. Stephanie Jury, Mr. James Marshall, and Mrs. Suzette Numkena, Lead Inspectors and/or Risk Assessors, representing Federal Occupational Health (FOH).

Sampling procedures similar to the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing*, dated June 1995, and revised in 1997, were followed for each of the buildings. Within each area sampled, procedures similar to the HUD multifamily housing inspection, as outlined in Chapter 7 of the HUD Guidelines, were employed.

The Santa Fe Service unit consists of eight (8) medical facility buildings. This includes a main hospital, dental clinic, maintenance building, and other medical and administrative support buildings. The majority of the buildings are modular style buildings. The main hospital (Building 2000) is a large structure built slab on grade. Building 333 is also a former clinic building, which is non-modular. All buildings are located on the same medical complex grounds. Refer to Appendix A, for a list of painted building components found and tested at each building. Appendix C contains the site maps for each building.

2.0 SURVEY METHODS

2.1 XRF Instrumentation

Measurements of lead in paint were made using a Niton XRF Spectrum Analyzer (serial number XL309-U3978NR6814). The XRF Lead Paint Analyzer non-destructively measures lead concentrations of painted surfaces. The XRF system includes three main components: (1) the XRF analyzer, which is a portable analytical instrument operating on the principles of X-ray fluorescence; (2) forms for recording of field data; and (3) report generation software, which allows for generation of data tables.

The criteria for classifying results obtained using the XRF are as shown in Table 1 below. These results are taken from the HUD/EPA Performance Characteristics Sheet, specific for the XRF system used in this survey.

Table 1: LBP Classification Criteria, K-Shell Value

Substrate	Negative	Inconclusive	Positive
Brick	≤ 0.9	None	≥ 1.0
Concrete	≤ 0.9	None	≥ 1.0
Drywall	≤ 0.9	None	≥ 1.0
Metal	≤ 0.9	None	≥ 1.0
Plaster	≤ 0.9	None	≥ 1.0
Wood	≤ 0.9	None	≥ 1.0

*Values Reported as Milligrams per Square Centimeter (mg/cm^2)

FOH Lead Inspectors are licensed by the State of Utah Department of Environmental Quality, Division of Radiation Control, to own and operate x-ray fluorescence analyzers in Utah. FOH representatives

obtained a Reciprocity Agreement with the State of Arizona Radiation Regulatory Agency, which allows operation of XRF instruments in New Mexico under the Utah license. Mr. Denny, Mr. Johnson, Ms. Jury, Mr. Marshall, and Mrs. Numkena, are certified by the United States Environmental Protection Agency (EPA) to perform LBP inspections. Copies of certifications for the Lead Inspectors and/or Risk Assessors can be found in Appendix D.

2.2 XRF Calibration Check

Standard quality control procedures with respect to the XRF were performed during the survey. The internal calibration of the XRF was checked by taking a minimum of three consecutive measurements on a National Institute for Standards and Technology (NIST) standard with a known concentration of lead. The results of the calibration checks were then used to verify that the instrument was operating within acceptable limits. These calibration checks are reported within the XRF data tables found in Appendix A of this report and are maintained in a file to detect changes in instrument performance over time.

2.3 Substrate Correction

For some XRF instruments, it is necessary to make corrections for bias in XRF readings made on some painted surfaces or "substrates". In accordance with the HUD/EPA Performance Characteristics Sheet for the XRF analyzer used, it is not necessary to correct for substrate bias.

2.4 Field Documentation

Field data forms were used to manually record information about individual XRF measurements. This information included the room number, the building component (such as wall, ceiling, door, baseboard, cabinet, etc.), component substrate (for example drywall, wood, metal, concrete), and paint condition. The field data forms were then used by the inspector to couple measurement-specific descriptive information to the sequential data once the instrument's electronic memory was downloaded to a personal computer. This information was then manipulated by the instrument's software to generate data tables for the written report.

According to the HUD Guidelines, each enclosed space in a structure (e.g., room, stairway, hallway, etc.) is considered a separate "room equivalent" and must be tested separately. To keep track of where individual measurement locations were made, interior and exterior walls of a structure were designated as A, B, C, and D, as shown in the attached drawings. The A wall was designated as the North wall in this inspection, and the B, C, and D walls are in clockwise order from the A wall. The wall and position on the wall (i.e., left, right, or center) was also recorded when readings were taken on components such as windows or doors. Any comments regarding a particular room were also recorded and may be found in the data tables located in Appendix A.

Paint color and condition are noted and included in the data tables. Under Paint Condition an "I" indicates intact or sound paint; an "F" indicates fair condition (paint surfaces show minor damage); a "P" indicates poor condition (paint is peeling, cracking, or blistering or shows other significant damage).

The report generation software combined the lead readings stored in the XRF analyzer with the test sample location information recorded in the field to produce data tables. The transfer of data from the analyzer to the computer was made through an interface cable supplied as part of the XRF system.

3.0 LEAD-BASED PAINT DEFINITIONS

The U.S. Department of Housing and Urban Development (HUD) considers paint to be lead-based paint (LBP) if the concentration is 1.0 milligram of lead per square centimeter (1.0 mg/cm^2) or greater, or if the lead concentration is greater than 5000 parts per million (ppm) or 0.5% by weight. The Consumer

Product Safety Commission (CPSC) currently considers paint to be lead-containing if the concentration of lead exceeds 600 ppm (0.06% by weight). In 1978, the CPSC banned the sale of lead-based paint to consumers and its application to areas where consumers have direct access to painted surfaces. This survey classified LBP on the basis of the HUD 1.0 mg/cm^2 criteria and 0.5% by weight (5000 ppm).

By contrast, the mission of the Occupational Safety and Health Administration (OSHA), with respect to lead in paint, is to protect workers during construction activities that may generate elevated airborne lead concentrations. OSHA states that construction work (including renovation, maintenance, and demolition) carried-out on structures coated with paints that have lead concentrations lower than the HUD or CPSC limits can still result in airborne lead concentrations in excess of regulatory limits. For this reason, OSHA has not defined lead-containing paint, but states that paint having any measurable level of lead may pose a substantial exposure hazard during construction work, depending upon the work performed. The owner or employers must be aware of the OSHA Lead in Construction Standard (29 CFR 1926.62) and the Respiratory Protection Standard (29 CFR 1910.134).

4.0 RESULTS SUMMARY

Table 2 summarizes the results and information for each building inspected and provides hyperlinks (electronic copy) to XRF Results Tables and Programming Cost Estimates and XRF Field Data Results.

XRF Field Data Results are located in Appendix A of this report. The tables show all lead measurements in the order taken for each of the structures and sampling areas tested. Descriptions of the columns found in the data tables are also described in Appendix A.

Table 2: Santa Fe Service Unit Summary of Units Inspected and Associated Hyperlinks *(electronic version only)*

Location	Building Number	Unit Type *(Appendix C)*	Lead Present	XRF Results and Programming Cost Estimate *(Appendix B)*	XRF Field Data Results *(Appendix A)*
Santa Fe	**333**	**Service**	**Yes**	✓	☐
Santa Fe	334	Office	No	*Not Applicable*	☐
Santa Fe	**335**	**Service**	**Yes**	✓	☐
Santa Fe	336	Service	No	*Not Applicable*	☐
Santa Fe	**2000**	Hospital	**Yes**	✓	☐
Santa Fe	**2001**	**Service**	**Yes**	✓	☐
Santa Fe	**2002**	**Storage**	**Yes**	✓	☐
Santa Fe	2003	Clinic	No	*Not Applicable*	☐

According to HUD Guidelines, lead-based paint was identified at or above 1.0 mg/cm^2 on interior and/or exterior building components sampled in Buildings 333, 335, 2000, 2001, and 2002 during the survey. The XRF Results Table located in Appendix B identifies the room number, building component, paint color and condition, and approximate square footage of lead-based paint materials.

Programming Cost Estimates (Appendix B) were developed for the removal of lead based paint building components. The Programming Cost Estimates were derived by use of the Means Cost Guide and by consultation with experienced local contractors. The pricing reflects current industry rates. Future fluctuations in industry pricing, both natural and seasonal, may affect this estimate. In addition, Service Units outside of metropolitan areas may incur additional costs due to travel requirements on the part of abatement contractors. For purposes of this estimate, an 18% mark-up for logistical costs is included.

This estimate is for abatement contractor costs only. Additional costs, which are not included in this estimate, are those of an environmental consultant and replacement of building materials that have been removed. The total estimated cost for the chemical removal of lead based paint at the Santa Fe Service Unit is **$230,773.49**. The total estimated cost for the component demolition of building materials applied with lead based paint at the Santa Fe Service Unit is **$13,494.83**.

5.0 DISCUSSION AND RECOMMENDATIONS

Lead-based paint (LBP) was detected on interior and exterior building components during sampling conducted by FOH on December 10-December 21 2006. The interior LBP components were in good condition. Much of the exterior LBP components on building 333 were in poor or deteriorating condition. Due to the observed good condition of the interior LBP components, FOH does not recommend abatement or maintenance attention to the LBP unless they will be disturbed by renovation or demolition activities. However, FOH does recommend stabilization of the damaged exterior LBP by encapsulation with additional non-lead containing paint. FOH's estimate for stabilizing the damaged paint by encapsulation with additional paint is approximately six (6) days of maintenance work.

The mere presence of LBP in a building poses no health hazard so long as the paint remains intact. Lead is only a hazard to adults and workers when it is inhaled, as fine dust or fume, or when it is ingested, when a painted surface is mouthed or chewed by a child, or inadvertently through contamination of surfaces, hands, and food by lead-contaminated dust. Therefore, to minimize the potential hazards associated with the presence of LBP, the following procedures should be implemented.

- Identification (through testing) of all known or suspect LBP surfaces and communication of the presence of LBP surfaces to workers potentially affected by the presence of LBP. Although the LBP testing has been completed, completion of a specific Operations and Maintenance (O&M) Program is suggested to organize a coherent, continuous program outlining procedures for routine inspections, maintenance, and immediate clean-up of damaged LBP surfaces. The O&M Program should address periodic inspections, maintenance activities, methods of safe and prompt clean-up when a licensed lead abatement contractor is not used, work procedures which are likely to create lead hazards, and a program of standard work procedures which are designed to minimize lead contamination. Development of an O&M Program was not part of FOH's original Scope of Work.

The on-site maintenance should perform periodic inspections to assess the condition of LBP (i.e. chip, peel, or flake). If areas of LBP become damaged or deteriorated, a licensed lead abatement contractor should be contacted regarding removal or abatement. Maintenance activities which should be avoided in areas where known or suspect LBP is located include, but are not limited to:

- Scraping, sanding, or using a heat gun on painted surfaces before repainting;
- Making holes in walls to access at pipes, install electrical outlets, etc.;
- Removing building components for renovation activities;
- Repeatedly bumping furniture or other objects into painted components;
- Unnecessarily opening and closing windows with LBP components.

Major work or renovation performed on LBP components should be completed by a licensed LBP abatement contractor. However, if minor repair or immediate clean-up is necessary for a specific LBP component, at a minimum, the following work and clean-up procedures should be incorporated:

- Move children and pregnant women to another area of the facility until work is completed and the area is properly cleaned;

- Cover exposed areas using plastic to seal off entrances and ducts and protect furniture, carpets, rugs, and floors from paint dust and chips. Plastic should be carefully disposed;
- Wet the painted surface with soapy water prior to working;
- Thoroughly clean area following work. Clean-up dust and chips with wet mops or rags soaked in a solution of trisodium phosphate (TSP) or phosphate containing powdered dishwashing detergent. Use two buckets of water – one for wash and one for rinse. To prevent recontamination of cleaned surfaces, wash mops and rags thoroughly after each use. Dust, chips, debris, mops, and rags should be contained in plastic bags and disposed of properly by a licensed lead abatement contractor;
- Avoid sweeping or vacuuming the work area. Sweeping and vacuuming spread lead dust particles, since the filters are not fine enough to contain LBP particles;
- If an entire LBP component (such as a window sill or door frame) requires removal, a representative sample should be taken of the LBP-coated component and this sample should be analyzed via the Toxic Characteristic Leaching Process (TCLP) method to determine whether the component must be disposed of as a hazardous waste. A licensed lead contractor should take the sample and a certified, licensed laboratory should provide the analysis for the TCLP method.

There are three general control strategies for controlling lead paint. These are component replacement, encapsulation, and paint removal. The most cost effective up front control strategy is to encapsulate LBP by repainting areas of chipped, damaged, or deteriorating paint. Cleaning of the component and surface using procedures described above should be completed prior to encapsulation activities. Safe and prompt clean-up of LBP debris or dust when damage or deterioration is encountered should be completed by a licensed lead abatement contractor when possible. LBP component removal and paint removal are considered LBP abatement and would need to be completed by a licensed lead abatement contractor. Should removal or abatement be completed, an exposure assessment should be performed during the work, as required by the OSHA lead-in-construction standard.

FOH recommends personnel responsible for conducting maintenance of LBP components in the facility meet the training requirements for maintenance workers on LBP hazards. This training includes procedures that minimize lead dust generation and soil contamination during maintenance activities, as defined by the EPA and the United States Department HUD. Portions of the OSHA 29 CFR 1910.1025 General Lead Industry Standard apply to maintenance activities that involve making or keeping a structure, fixture, or foundation in proper condition in a routine, scheduled, or anticipated fashion.

6.0 PROJECT LIMITATIONS

This Project was performed using, as a minimum, practices consistent with standards acceptable within the industry at this time, and a level of diligence typically exercised by industrial hygiene and environmental consultants performing similar services.

The procedures used in this investigation attempt to establish a balance between the competing goals of limiting investigative and reporting costs and time, and reducing the uncertainty about unknown conditions. Therefore, because the findings of this report were derived from the scope, costs, time, and other limitations, the conclusions should not be construed as a guarantee that all environmental or occupational hazards have been identified and fully evaluated. Where sample collection and testing have been performed, FOH's professional opinions are based in part on the interpretation of data from discrete sampling locations that may not represent conditions at non-sampled locations. FOH assumes no responsibility for omissions or errors resulting from inaccurate information, or data, provided by sources outside of FOH or from omissions or errors in public records.

Furthermore, it is emphasized that the final decision on how much risk to accept always remains with the client since FOH is not in a position to fully understand all of the client's needs. Clients with a greater aversion to risk may want to take additional actions while others, with less aversion to risk, may want to take no further action.

APPENDIX A

Tables of XRF Field Data & Calibrations

DATA TABLE HEADING DESCRIPTIONS

Column Heading	Description
XL No.	Sequential number of each lead measurement
Site	Building number or name
Insp	Inspector initials
Side	Wall (A, B, C, or D) the measurement was taken on
Room	Room number shot was taken in
Sub	Substrate of tested material (wood, concrete, etc.)
Feat	The actual component tested (door, window, etc.)
Cnd	Condition of paint (Intact, Fair, Poor)
Clr	Color of Paint
Result	Negative or Positive for lead content over 1.0mg/cm^2
Pbc±Prec	Result reported in milligrams per centimeter squared (mg/cm^2).

Serial #XL309-U3987NR6814 Site: Date: 12/19/2006 to 12/20/2006

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
670	**670**	**SF333**	**SN**				**Calibration**			**POS**	**1.14 ± 0.10**
671	**671**	**SF333**	**SN**				**Calibration**			**POS**	**1.26 ± 0.19**
672	**672**	**SF333**	**SN**				**Calibration**			**POS**	**1.13 ± 0.09**
673	**673**	**SF333**	**SN**	**A**	**Exterior**	**Concrete**	**Wall**	**Intact**	**White**	**POS**	**3.20 ± 1.16**
674	**674**	**SF333**	**SN**	**A**	**Exterior**	**Wood**	**Door**	**Intact**	**Brown**	**POS**	**5.10 ± 1.05**
675	**675**	**SF333**	**SN**	**A Left**	**Exterior**	**Wood**	**L Door Jamb**	**Intact**	**Brown**	**POS**	**5.10 ± 1.99**
676	676	SF333	SN	A Left	Exterior	Wood	Door Header	Intact	Brown	NEG	0.20 ± 0.33
677	**677**	**SF333**	**SN**	**A Right**	**Exterior**	**Wood**	**Window Screen**	**Intact**	**Brown**	**POS**	**5.10 ± 1.84**
678	**678**	**SF333**	**SN**	**A Left**	**Exterior**	**Wood**	**R Window Casing**	**Intact**	**Brown**	**POS**	**5.10 ± 1.70**
679	679	SF333	SN	A Left	Extrerior	Wood	Window Header	Intact	Brown	NEG	0.05 ± 0.37
680	680	SF333	SN	A Right	Exterior	Wood	Railing	Intact	Brown	NEG	0.08 ± 0.26
681	681	SF333	SN	A Right	Exterior	Wood	Balusters	Intact	Brown	NEG	0.08 ± 0.16
682	682	SF333	SN	A Right	Exterior	Wood	Level Post	Intact	Brown	NEG	0.20 ± 0.52
683	683	SF333	SN	A Right	Exterior	Wood	Porch Post	Intact	Brown	NEG	0.00 ± 0.12
684	**684**	**SF333**	**SN**	**A**	**Exterior**	**Concrete**	**Wall**	**Intact**	**Brown**	**POS**	**3.73 ± 1.73**
685	685	SF333	SN	A	Exterior	Stucco	Wall	Intact	Beige	NEG	0.00 ± 0.01
686	686	SF333	SN	A Left	Exterior	Wood	Window Sash	Intact	Beige	NEG	0.16 ± 0.34
687	**687**	**SF333**	**SN**	**A Left**	**Exterior**	**Wood**	**Window Sill**	**Poor**	**Beige**	**POS**	**3.92 ± 1.55**
688	688	SF333	SN	A Left	Exterior	Wood	Window Header	Intact	Beige	NEG	0.01 ± 0.04
689	689	SF333	SN	B	Exterior	Stucco	Wall	Intact	Beige	NEG	0.00 ± 0.09
690	690	SF333	SN	B Center	Exterior	Wood	Door Cover	Intact	Brown	NEG	0.00 ± 0.13
691	691	SF333	SN	B Left	Exterior	Wood	Window Sash	Intact	Brown	NEG	0.00 ± 0.07
692	**692**	**SF333**	**SN**	**B Left**	**Exterior**	**Wood**	**L Window Casing**	**Intact**	**Brown**	**POS**	**11.42 ± 4.59**
693	693	SF333	SN	B Left	Exterior	Wood	Window Sill	Intact	Brown	NEG	0.70 ± 0.40
694	694	SF333	SN	C	Exterior	Stucco	Wall	Intact	Beige	NEG	0.01 ± 0.89
695	695	SF333	SN	C Center	Exterior	Wood	Window Well	Intact	Brown	NEG	0.26 ± 0.19
696	**696**	**SF333**	**SN**	**C Center**	**Exterior**	**Wood**	**R Window Casing**	**Intact**	**Brown**	**POS**	**2.53 ± 1.16**
697	**697**	**SF333**	**SN**	**C Center**	**Exterior**	**Wood**	**Window Sill**	**Intact**	**Brown**	**POS**	**2.89 ± 1.17**
698	698	SF333	SN	C Left	Exterior	Metal	Gas Meter	Intact	Gray	NEG	0.13 ± 0.06
699	699	SF333	SN				NULL			INCOM	0.00 ± 0.11
700	700	SF333	SN	D	Exterior	Stucco	Wall	Intact	Beige	NEG	0.00 ± 0.01
701	**701**	**SF333**	**SN**	**D Right**	**Exterior**	**Wood**	**Door**	**Intact**	**White**	**POS**	**5.10 ± 1.94**
702	**702**	**SF333**	**SN**	**D Right**	**Exterior**	**Wood**	**L Door Casing**	**Poor**	**White**	**POS**	**14.07 ± 4.40**
703	**703**	**SF333**	**SN**	**D Right**	**Exterior**	**Wood**	**Window Well**	**Intact**	**Beige**	**POS**	**5.10 ± 1.75**
704	704	SF333	SN	D Right	Exterior	Metal	Conduit	Intact	Beige	NEG	0.06 ± 0.05
705	705	SF333	SN	D Right	Exterior	Metal	Balusters	Intact	Peach	NEG	0.20 ± 0.40
706	**706**	**SF333**	**SN**	**D Left**	**Exterior**	**Wood**	**Window Sash**	**Poor**	**Beige**	**POS**	**5.10 ± 1.64**
707	**707**	**SF333**	**SN**	**D Left**	**Exterior**	**Wood**	**L Window Casing**	**Intact**	**Beige**	**POS**	**11.45 ± 5.10**
708	708	SF333	SN	D Left	Exterior	Wood	Window Sill	Intact	Beige	NEG	0.27 ± 0.69
709	**709**	**SF333**	**SN**	**D Right**	**Exterior**	**Wood**	**Gutter Spout**	**Intact**	**Beige**	**POS**	**14.76 ± 5.51**
710	710	SF333	SN	A Center	Exterior	Wood	Porch Ceiling	Intact	Brown	NEG	0.06 ± 0.42
711	711	SF333	SN	A Center	Exterior	Wood	Porch Ceiling Beam	Intact	Brown	NEG	0.01 ± 0.03
712	712	SF333	SN	A Center	Exterior	Wood	Porch Soffit	Intact	Brown	NEG	0.03 ± 0.42
713	713	SF333	SN	A Center	Exterior	Wood	Porch Rafter	Intact	Brown	NEG	0.01 ± 0.02
714	714	SF333	SN	A Right	Exterior	Metal	Fence Post	Intact	Green	NEG	-0.08 ± 0.91
715	**715**	**SF333**	**SN**	**A Right**	**Exterior**	**Concrete**	**Curb Paint**	**Intact**	**Yellow**	**POS**	**2.09 ± 0.97**
716	**716**	**SF333**	**SN**	**A Right**	**Exterior**	**Concrete**	**Curb Paint**	**Intact**	**Red**	**POS**	**9.88 ± 3.46**
717	717	SF333	SN	A Right	Exterior	Asphalt	Sidewalk Paint	Intact	White	NEG	0.00 ± 0.01
718	718	SF333	SN	A Right	Exterior	Asphalt	Parking Lot Handicap	Intact	Blue	NEG	0.00 ± 0.11
719	719	SF333	SN	A Right	Exterior	Concrete	Light Post Base	Intact	Beige	NEG	0.00 ± 0.01
720	720	SF333	SN	A Left	Exterior	Metal	Fence Post	Intact	Lt Green	NEG	-0.35 ± 0.98
721	721	SF333	SN				Calibration			...	NA
722	**722**	**SF333**	**SN**				**Calibration**			**POS**	**1.17 ± 0.10**
723	**723**	**SF333**	**SN**				**Calibration**			**POS**	**1.15 ± 0.10**
724	**724**	**SF333**	**SN**				**Calibration**			**POS**	**1.39 ± 0.26**
725	725	SF333	SN	A	1	Plaster	Wall	Intact	White	NEG	-0.52 ± 1.12
726	726	SF333	SN	B	1	Plaster	Wall	Intact	White	NEG	0.09 ± 0.15
727	727	SF333	SN	C Right	1	Plaster	Wall	Intact	White	NEG	-0.57 ± 1.19
728	728	SF333	SN	D	1	Plaster	Wall	Intact	White	NEG	0.14 ± 0.26
729	729	SF333	SN	A	1	Plaster	Ceiling	Intact	White	NEG	0.11 ± 0.31
730	730	SF333	SN	A Right	1	Wood	Floor	Intact	Stained	NEG	0.00 ± 0.02
731	**731**	**SF333**	**SN**	**A Right**	**1**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**5.10 ± 1.77**
732	**732**	**SF333**	**SN**	**A Right**	**1**	**Wood**	**Toe Kick**	**Intact**	**White**	**POS**	**10.62 ± 4.20**

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
733	**733**	**SF333**	**SN**	**D Right**	**1**	**Wood**	**Molding**	**Intact**	**White**	**POS**	**8.22 ± 2.83**
734	734	SF333	SN	B Left	1	Wood	Window Sash	Intact	White	NEG	0.04 ± 0.12
735	**735**	**SF333**	**SN**	**B Left**	**1**	**Wood**	**L Window Casing**	**Intact**	**White**	**POS**	**11.64 ± 4.43**
736	**736**	**SF333**	**SN**	**B Left**	**1**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**9.59 ± 3.99**
737	**737**	**SF333**	**SN**	**B Left**	**1**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**7.96 ± 2.72**
738	738	SF333	SN				NULL			INCOM	0.72 ± 0.96
739	739	SF333	SN	B Center	1	Metal	Radiator	Intact	Silver	NEG	0.46 ± 0.26
740	740	SF333	SN	C Left	1	Metal	Conduit	Intact	White	NEG	0.20 ± 0.27
741	**741**	**SF333**	**SN**	**D Right**	**1**	**Wood**	**Door**	**Intact**	**White**	**POS**	**5.10 ± 1.90**
742	**742**	**SF333**	**SN**	**D Right**	**1**	**Wood**	**L Door Jamb**	**Intact**	**White**	**POS**	**6.20 ± 2.40**
743	743	SF333	SN	A	2	Plaster	Wall	Intact	White	NEG	0.15 ± 0.79
744	744	SF333	SN	B	2	Plaster	Wall	Intact	White	NEG	-0.39 ± 1.01
745	745	SF333	SN	C	2	Plaster	Wall	Intact	White	NEG	-0.51 ± 1.17
746	746	SF333	SN	D Left	2	Plaster	Wall	Intact	White	NEG	0.00 ± 0.02
747	747	SF333	SN	D Left	2	Wood	Baseboard	Intact	White	NEG	0.00 ± 0.02
748	748	SF333	SN	A	2	Plaster	Ceiling	Intact	White	NEG	0.00 ± 0.01
749	**749**	**SF333**	**SN**	**A Center**	**2**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**4.48 ± 1.68**
750	**750**	**SF333**	**SN**	**A Right**	**2**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**8.24 ± 3.53**
751	**751**	**SF333**	**SN**	**A Right**	**2**	**Wood**	**Toe Kick**	**Intact**	**White**	**POS**	**5.55 ± 2.17**
752	**752**	**SF333**	**SN**	**B Left**	**2**	**Wood**	**Door**	**Intact**	**White**	**POS**	**7.03 ± 2.59**
753	**753**	**SF333**	**SN**	**B Left**	**2**	**Wood**	**R Door Jamb**	**Intact**	**White**	**POS**	**5.10 ± 1.88**
754	754	SF333	SN	D Center	2	Metal	Conduit	Intact	White	NEG	0.08 ± 0.40
755	755	SF333	SN	D Center	2	Metal	Radiator	Intact	Silver	NEG	0.22 ± 0.28
756	**756**	**SF333**	**SN**	**D Center**	**2**	**Wood**	**Window Sash**	**Fair**	**White**	**POS**	**9.54 ± 3.63**
757	**757**	**SF333**	**SN**	**D Center**	**2**	**Wood**	**L Window Casing**	**Fair**	**White**	**POS**	**5.09 ± 1.82**
758	**758**	**SF333**	**SN**	**D Center**	**2**	**Wood**	**Window Sill**	**Fair**	**White**	**POS**	**5.03 ± 2.01**
759	**759**	**SF333**	**SN**	**D Center**	**2**	**Wood**	**Window Apron**	**Fair**	**White**	**POS**	**9.67 ± 4.02**
760	760	SF333	SN	A Right	2	Wood	Closet Shelf	Intact	Peach	NEG	0.00 ± 0.02
761	**761**	**SF333**	**SN**	**A Right**	**2**	**Wood**	**Shelf Support**	**Intact**	**Peach**	**POS**	**5.10 ± 1.91**
762	762	SF333	SN	A Center	2	Wood	Shelf Support	Intact	White	NEG	0.00 ± 0.01
763	763	SF333	SN	A Right	2	Concrete	Closet Floor	Intact	Gray	NEG	0.04 ± 0.06
764	**764**	**SF333**	**SN**	**A Right**	**2**	**Wood**	**Closet Door**	**Intact**	**Peach**	**POS**	**7.17 ± 2.97**
765	765	SF333	SN	A	3	Plaster	Wall	Intact	Blue	NEG	0.08 ± 0.22
766	766	SF333	SN	B	3	Plaster	Wall	Intact	Blue	NEG	0.09 ± 0.19
767	767	SF333	SN	C	3	Plaster	Wall	Intact	Beige	NEG	0.23 ± 0.67
768	768	SF333	SN	D Left	3	Plaster	Wall	Intact	Beige	NEG	-0.20 ± 0.95
769	769	SF333	SN	B	3	Plaster	Ceiling	Intact	Gray	NEG	-0.51 ± 1.06
770	770	SF333	SN	Center	3	Wood	Floor	Intact	White	NEG	0.00 ± 0.02
771	**771**	**SF333**	**SN**	**D Left**	**3**	**Wood**	**Crown Molding**	**Intact**	**Beige**	**POS**	**6.31 ± 2.59**
772	**772**	**SF333**	**SN**	**D Left**	**3**	**Wood**	**Baseboard**	**Intact**	**Beige**	**POS**	**5.10 ± 2.00**
773	**773**	**SF333**	**SN**	**D Left**	**3**	**Wood**	**Toe Kick**	**Intact**	**Beige**	**POS**	**6.84 ± 2.77**
774	**774**	**SF333**	**SN**	**A Center**	**3**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**5.10 ± 2.04**
775	**775**	**SF333**	**SN**	**A Center**	**3**	**Wood**	**L Window Casing**	**Intact**	**White**	**POS**	**9.10 ± 3.90**
776	**776**	**SF333**	**SN**	**A Center**	**3**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**8.63 ± 2.90**
777	**777**	**SF333**	**SN**	**A Center**	**3**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**7.73 ± 2.58**
778	778	SF333	SN	A Center	3	Metal	Electrical Conduit	Intact	Blue	NEG	0.08 ± 0.15
779	779	SF333	SN	A Center	3	Metal	Radiator	Intact	Silver	NEG	0.33 ± 0.31
780	**780**	**SF333**	**SN**	**C Left**	**3**	**Wood**	**Closet Door**	**Intact**	**White**	**POS**	**7.81 ± 2.33**
781	781	SF333	SN	C Left	3	Wood	Closet Shelf	Intact	White	NEG	0.01 ± 0.22
782	**782**	**SF333**	**SN**	**C Left**	**3**	**Wood**	**Shelf Support**	**Intact**	**White**	**POS**	**7.46 ± 2.58**
783	**783**	**SF333**	**SN**	**C Center**	**3**	**Wood**	**Hanger Rod**	**Intact**	**White**	**POS**	**4.54 ± 1.73**
784	**784**	**SF333**	**SN**	**D Left**	**3**	**Wood**	**Door**	**Intact**	**White**	**POS**	**6.46 ± 1.98**
785	**785**	**SF333**	**SN**	**D Left**	**3**	**Wood**	**R Door Casing**	**Fair**	**White**	**POS**	**7.37 ± 2.89**
786	786	SF333	SN	B	7	Plaster	Wall	Intact	White	NEG	0.10 ± 0.11
787	787	SF333	SN	C	7	Plaster	Wall	Intact	White	NEG	0.11 ± 0.12
788	788	SF333	SN	D	7	Plaster	Wall	Intact	White	NEG	0.19 ± 0.24
789	789	SF333	SN	Center	7	Plaster	Ceiling	Intact	White	NEG	0.06 ± 0.10
790	790	SF333	SN	Center	7	Wood	Floor	Intact	White	NEG	0.00 ± 0.02
791	**791**	**SF333**	**SN**	**D Center**	**7**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**9.32 ± 3.91**
792	**792**	**SF333**	**SN**	**B Center**	**7**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**5.10 ± 1.89**
793	**793**	**SF333**	**SN**	**B Center**	**7**	**Wood**	**Toe Kick**	**Intact**	**White**	**POS**	**4.12 ± 1.47**
794	794	SF333	SN	B Left	7	Metal	Radiator	Intact	Silver	NEG	0.41 ± 0.20
795	795	SF333	SN	A	8	Plaster	Wall	Intact	White	NEG	-0.38 ± 1.02
796	796	SF333	SN	C	8	Plaster	Wall	Intact	White	NEG	0.20 ± 0.33

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
797	797	SF333	SN	D	8	Plaster	Wall	Intact	White	NEG	-0.59 ± 1.08
798	**798**	**SF333**	**SN**	**C Center**	**8**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**7.44 ± 2.71**
799	799	SF333	SN	Center	8	Wood	Floor	Intact	White	NEG	0.02 ± 0.05
800	**800**	**SF333**	**SN**	**A Center**	**8**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**5.10 ± 1.71**
801	**801**	**SF333**	**SN**	**A Center**	**8**	**Wood**	**Toe Kick**	**Intact**	**White**	**POS**	**2.56 ± 0.71**
802	**802**	**SF333**	**SN**	**A Right**	**8**	**Wood**	**Door**	**Intact**	**White**	**POS**	**5.10 ± 1.84**
803	**803**	**SF333**	**SN**	**A Right**	**8**	**Wood**	**L Door Casing**	**Intact**	**White**	**POS**	**7.04 ± 2.37**
804	**804**	**SF333**	**SN**	**C Left**	**8**	**Wood**	**Closet Shelf**	**Intact**	**White**	**POS**	**5.10 ± 1.61**
805	**805**	**SF333**	**SN**	**C Left**	**8**	**Wood**	**Shelf Support**	**Fair**	**White**	**POS**	**5.10 ± 1.80**
806	806	SF333	SN	C Left	8	Concrete	Closet Floor	Intact	Gray	NEG	0.10 ± 0.28
807	**807**	**SF333**	**SN**	**A Left**	**8**	**Wood**	**Closet Door Casing**	**Intact**	**White**	**POS**	**5.10 ± 1.73**
808	**808**	**SF333**	**SN**	**C Left**	**8**	**Wood**	**Closet Door**	**Intact**	**White**	**POS**	**8.74 ± 3.77**
809	**809**	**SF333**	**SN**	**A**	**6**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**5.18 ± 1.74**
810	810	SF333	SN	B	6	Wood	Wall	Intact	White	NEG	0.00 ± 0.01
811	**811**	**SF333**	**SN**	**C Left**	**6**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**5.44 ± 2.09**
812	**812**	**SF333**	**SN**	**D**	**6**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**4.54 ± 1.85**
813	813	SF333	SN	A	6	Plaster	Ceiling	Intact	White	NEG	0.01 ± 0.01
814	**814**	**SF333**	**SN**	**B**	**6**	**Concrete**	**Floor**	**Poor**	**Gray**	**POS**	**2.30 ± 0.57**
815	**815**	**SF333**	**SN**	**C Center**	**6**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**15.01 ± 4.67**
816	**816**	**SF333**	**SN**	**C Center**	**6**	**Wood**	**L Window Casing**	**Intact**	**White**	**POS**	**5.71 ± 2.12**
817	**817**	**SF333**	**SN**	**C Center**	**6**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**2.53 ± 0.81**
818	**818**	**SF333**	**SN**	**C Center**	**6**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**5.10 ± 1.97**
819	819	SF333	SN	C Center	6	Metal	Radiator	Intact	Silver	NEG	0.11 ± 0.16
820	820	SF333	SN	A Center	6	Metal	Bathroom Stall Wall	Intact	Brown	NEG	0.39 ± 0.29
821	**821**	**SF333**	**SN**	**A Center**	**6**	**Wood**	**Stall Door**	**Intact**	**Brown**	**POS**	**5.10 ± 1.99**
822	822	SF333	SN	A Center	6	Metal	Stall Support Beam	Intact	Brown	NEG	0.42 ± 0.31
823	**823**	**SF333**	**SN**	**B center**	**6**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**5.10 ± 1.67**
824	**824**	**SF333**	**SN**	**A Left**	**6**	**Wood**	**Door**	**Poor**	**White**	**POS**	**5.10 ± 1.81**
825	**825**	**SF333**	**SN**	**A Left**	**6**	**Wood**	**R Door Jamb**	**Poor**	**White**	**POS**	**5.10 ± 1.89**
826	826	SF333	SN	D	11	Plaster	Wall	Intact	White	NEG	0.23 ± 0.43
827	827	SF333	SN	B	11	Plaster	Wall	Intact	White	NEG	0.09 ± 0.11
828	828	SF333	SN	D	11	Plaster	Ceiling	Intact	White	NEG	0.16 ± 0.28
829	**829**	**SF333**	**SN**	**D Center**	**11**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**8.87 ± 3.72**
830	830	SF333	SN	Center	11	Wood	Floor	Intact	Stained	NEG	0.00 ± 0.02
831	**831**	**SF333**	**SN**	**D Center**	**11**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**11.21 ± 4.06**
832	**832**	**SF333**	**SN**	**D Center**	**11**	**Wood**	**R Window Casing**	**Intact**	**White**	**POS**	**8.95 ± 2.92**
833	**833**	**SF333**	**SN**	**D Center**	**11**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**9.54 ± 3.52**
834	**834**	**SF333**	**SN**	**D Center**	**11**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**9.47 ± 2.99**
835	**835**	**SF333**	**SN**	**B Center**	**11**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**5.59 ± 2.10**
836	**836**	**SF333**	**SN**	**B Center**	**11**	**Wood**	**Toe Kick**	**Poor**	**White**	**POS**	**1.74 ± 0.59**
837	**837**	**SF333**	**SN**	**D Right**	**11**	**Wood**	**Door**	**Intact**	**White**	**POS**	**5.10 ± 1.94**
838	**838**	**SF333**	**SN**	**D Right**	**11**	**Wood**	**L Door Casing**	**Intact**	**White**	**POS**	**13.80 ± 4.67**
839	839	SF333	SN	A	9	Plaster	Wall	Intact	White	NEG	-0.55 ± 1.16
840	840	SF333	SN	B	9	Plaster	Wall	Intact	White	NEG	0.02 ± 0.03
841	841	SF333	SN	C	9	Plaster	Wall	Intact	White	NEG	0.09 ± 0.19
842	842	SF333	SN	D	9	Plaster	Wall	Intact	White	NEG	0.03 ± 0.06
843	843	SF333	SN	D	9	Plaster	Ceiling	Intact	White	NEG	0.05 ± 0.09
844	**844**	**SF333**	**SN**	**D Right**	**9**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**8.81 ± 3.28**
845	845	SF333	SN	B	9	Plaster	Ceiling	Intact	White	NEG	0.00 ± 0.02
846	**846**	**SF333**	**SN**	**D Right**	**9**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**5.10 ± 1.80**
847	**847**	**SF333**	**SN**	**D Right**	**9**	**Wood**	**Toe Kick**	**Fair**	**White**	**POS**	**5.59 ± 1.92**
848	848	SF333	SN	B Center	9	Metal	Electrical Conduit	Intact	White	NEG	0.09 ± 0.11
849	849	SF333	SN	B Center	9	Metal	Radiator	Intact	Silver	NEG	0.27 ± 0.26
850	**850**	**SF333**	**SN**	**B Center**	**9**	**Wood**	**Window Sash**	**Poor**	**White**	**POS**	**5.10 ± 1.58**
851	**851**	**SF333**	**SN**	**B Center**	**9**	**Wood**	**L Widnow Casing**	**Poor**	**White**	**POS**	**7.18 ± 2.41**
852	**852**	**SF333**	**SN**	**B Center**	**9**	**Wood**	**Window Sill**	**Poor**	**White**	**POS**	**5.82 ± 1.87**
853	**853**	**SF333**	**SN**	**B Center**	**9**	**Wood**	**Window Apron**	**Poor**	**White**	**POS**	**5.10 ± 2.02**
854	854	SF333	SN	A Left	9	Wood	Closet Shelf	Intact	White	NEG	0.00 ± 0.13
855	855	SF333	SN	A Left	9	Wood	Shelf Support	Intact	White	NEG	0.00 ± 0.10
856	**856**	**SF333**	**SN**	**A Left**	**9**	**Wood**	**Hanger Rod**	**Intact**	**White**	**POS**	**5.77 ± 2.09**
857	**857**	**SF333**	**SN**	**A Left**	**9**	**Wood**	**Closet Door**	**Intact**	**White**	**POS**	**5.10 ± 1.73**
858	**858**	**SF333**	**SN**	**A Left**	**9**	**Wood**	**Closet Door Casing**	**Intact**	**White**	**POS**	**5.10 ± 1.96**
859	**859**	**SF333**	**SN**	**D Right**	**9**	**Wood**	**Door**	**Intact**	**White**	**POS**	**5.10 ± 1.72**
860	**860**	**SF333**	**SN**	**D Right**	**9**	**Wood**	**L Door Jamb**	**Intact**	**White**	**POS**	**5.10 ± 1.88**

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
861	861	SF333	SN	A	13	Plaster	Wall	Intact	White	NEG	0.17 ± 0.29
862	862	SF333	SN	B left	13	Plaster	Wall	Intact	White	NEG	0.19 ± 0.26
863	**863**	**SF333**	**SN**	**C**	**13**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**5.65 ± 2.06**
864	864	SF333	SN	D	13	Plaster	Ceiling	Intact	White	NEG	-0.25 ± 0.97
865	**865**	**SF333**	**SN**	**D Center**	**13**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**6.59 ± 2.68**
866	866	SF333	SN	D Left	13	Plaster	Wall	Intact	White	NEG	0.21 ± 0.30
867	867	SF333	SN	D	13	Wood	Floor	Intact	Stained	NEG	0.00 ± 0.02
868	**868**	**SF333**	**SN**	**D Center**	**13**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**7.36 ± 2.64**
869	**869**	**SF333**	**SN**	**D Center**	**13**	**Wood**	**Toe Kick**	**Fair**	**White**	**POS**	**5.34 ± 2.16**
870	870	SF333	SN	A Center	13	Metal	Electrical Conduit	Intact	White	NEG	0.14 ± 0.35
871	871	SF333	SN	B Left	13	Metal	Radiator	Intact	Silver	NEG	0.12 ± 0.10
872	**872**	**SF333**	**SN**	**B Center**	**13**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**9.08 ± 3.90**
873	**873**	**SF333**	**SN**	**B Center**	**13**	**Wood**	**R Window Casing**	**Intact**	**White**	**POS**	**6.43 ± 2.44**
874	**874**	**SF333**	**SN**	**B Center**	**13**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**6.22 ± 2.53**
875	**875**	**SF333**	**SN**	**B Center**	**13**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**6.36 ± 2.04**
876	876	SF333	SN	C Right	13	Wood	Closet Shelf	Intact	White	NEG	0.00 ± 0.13
877	**877**	**SF333**	**SN**	**C Right**	**13**	**Wood**	**Shelf Support**	**Intact**	**White**	**POS**	**7.21 ± 2.58**
878	878	SF333	SN	C Right	13	Wood	Hanger Rod	Intact	White	NEG	0.09 ± 0.37
879	**879**	**SF333**	**SN**	**C Right**	**13**	**Wood**	**Closet Door**	**Intact**	**White**	**POS**	**9.74 ± 3.75**
880	**880**	**SF333**	**SN**	**C Right**	**13**	**Wood**	**Closet Door Casing**	**Intact**	**White**	**POS**	**5.10 ± 1.67**
881	**881**	**SF333**	**SN**	**D Center**	**13**	**Wood**	**Door**	**Intact**	**White**	**POS**	**10.24 ± 3.76**
882	**882**	**SF333**	**SN**	**D Center**	**13**	**Wood**	**R Door Casing**	**Fair**	**White**	**POS**	**5.10 ± 1.61**
883	883	SF333	SN	A	16	Plaster	Wall	Intact	White	NEG	0.08 ± 0.09
884	884	SF333	SN	B	16	Plaster	Wall	Intact	White	NEG	0.09 ± 0.10
885	885	SF333	SN	C	16	Plaster	Wall	Intact	White	NEG	0.14 ± 0.17
886	886	SF333	SN	B	16	Wood	Floor	Intact	Stained	NEG	0.00 ± 0.02
887	887	SF333	SN	D	16	Plaster	Ceiling	Intact	White	NEG	0.05 ± 0.17
888	**888**	**SF333**	**SN**	**C Center**	**16**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**5.82 ± 2.07**
889	**889**	**SF333**	**SN**	**C Center**	**16**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**5.10 ± 1.86**
890	**890**	**SF333**	**SN**	**C Center**	**16**	**Wood**	**Toe Kick**	**Poor**	**White**	**POS**	**3.15 ± 1.03**
891	891	SF333	SN	B Center	16	Wood	Door	Intact	White	NEG	-0.38 ± 0.79
892	**892**	**SF333**	**SN**	**B Center**	**16**	**Wood**	**L Door Casing**	**Intact**	**White**	**POS**	**11.02 ± 4.29**
893	893	SF333	SN	B	16	Plaster	Wall	Intact	White	NEG	0.17 ± 0.25
894	894	SF333	SN	C Center	16	Metal	Radiator	Intact	Silver	NEG	0.55 ± 0.22
895	**895**	**SF333**	**SN**	**A**	**14**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**1.84 ± 0.67**
896	**896**	**SF333**	**SN**	**B**	**14**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**2.62 ± 1.25**
897	**897**	**SF333**	**SN**	**C**	**14**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**2.04 ± 0.92**
898	**898**	**SF333**	**SN**	**D**	**14**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**2.67 ± 1.24**
899	**899**	**SF333**	**SN**	**D**	**14**	**Plaster**	**Ceiling**	**Intact**	**White**	**POS**	**8.06 ± 3.35**
900	900	SF333	SN	B	14	Wood	Floor	Intact	Varnish	NEG	0.00 ± 0.02
901	901	SF333	SN	C Center	14	Wood	Baseboard	Intact	White	NEG	0.00 ± 0.11
902	**902**	**SF333**	**SN**	**C Right**	**14**	**Wood**	**Door**	**Intact**	**White**	**POS**	**5.10 ± 1.93**
903	**903**	**SF333**	**SN**	**C Right**	**14**	**Wood**	**L Door Casing**	**Intact**	**White**	**POS**	**7.23 ± 3.09**
904	904	SF333	SN	A Center	14	Metal	Electrical Conduit	Intact	White	NEG	0.01 ± 0.16
905	**905**	**SF333**	**SN**	**A Center**	**14**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**6.98 ± 2.73**
906	**906**	**SF333**	**SN**	**A Center**	**14**	**Wood**	**L Window Casing**	**Intact**	**White**	**POS**	**6.40 ± 2.47**
907	**907**	**SF333**	**SN**	**A Center**	**14**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**9.13 ± 2.99**
908	**908**	**SF333**	**SN**	**B Left**	**14**	**Wood**	**Closet Door**	**Intact**	**White**	**POS**	**7.53 ± 2.63**
909	**909**	**SF333**	**SN**	**B Left**	**14**	**Wood**	**Closet Door Casing**	**Intact**	**White**	**POS**	**7.41 ± 2.63**
910	910	SF333	SN	B Left	14	Wood	Closet Shelf	Intact	White	NEG	0.01 ± 0.21
911	**911**	**SF333**	**SN**	**B Left**	**14**	**Wood**	**Shelf Support**	**Intact**	**White**	**POS**	**5.10 ± 1.60**
912	**912**	**SF333**	**SN**	**A**	**17**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**1.23 ± 0.37**
913	**913**	**SF333**	**SN**	**B**	**17**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**7.42 ± 3.19**
914	**914**	**SF333**	**SN**	**C**	**17**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**12.07 ± 4.27**
915	**915**	**SF333**	**SN**	**D**	**17**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**7.64 ± 2.68**
916	**916**	**SF333**	**SN**	**A**	**17**	**Wood**	**Floor**	**Intact**	**Stained**	**POS**	**5.53 ± 2.25**
917	917	SF333	SN	D	17	Plaster	Ceiling	Intact	White	NEG	0.00 ± 0.02
918	**918**	**SF333**	**SN**	**D Center**	**17**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**7.13 ± 2.93**
919	**919**	**SF333**	**SN**	**D**	**17**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**6.78 ± 2.39**
920	**920**	**SF333**	**SN**	**D Center**	**17**	**Wood**	**Toe Kick**	**Fair**	**White**	**POS**	**6.76 ± 2.77**
921	**921**	**SF333**	**SN**	**C Right**	**17**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**7.71 ± 2.65**
922	**922**	**SF333**	**SN**	**C Right**	**17**	**Wood**	**R Window Casing**	**Intact**	**White**	**POS**	**8.17 ± 3.45**
923	**923**	**SF333**	**SN**	**C Right**	**17**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**8.73 ± 3.72**
924	**924**	**SF333**	**SN**	**C Right**	**17**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**8.28 ± 3.61**

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
925	925	SF333	SN	B	17	Wood	Door	Intact	White	POS	8.06 ± 2.79
926	926	SF333	SN	B	17	Wood	L Door Casing	Intact	White	POS	9.14 ± 3.58
927	927	SF333	SN	D Center	17	Wood	Closet Shelf	Intact	White	NEG	0.00 ± 0.02
928	928	SF333	SN	D Center	17	Wood	Shelf Support	Intact	White	POS	9.36 ± 2.80
929	929	SF333	SN	D Center	17	Wood	Closet Toe Kick	Intact	Stained	NEG	0.03 ± 0.47
930	930	SF333	SN	D Center	17	Wood	Closet Door	Intact	White	NEG	0.05 ± 0.16
931	931	SF333	SN	D Center	17	Wood	Closet Door Casing	Intact	White	NEG	0.05 ± 0.08
932	932	SF333	SN	A	19	Plaster	Wall	Intact	White	POS	3.97 ± 1.59
933	933	SF333	SN	B	19	Plaster	Wall	Intact	White	POS	5.12 ± 2.00
934	934	SF333	SN	C	19	Plaster	Wall	Intact	White	POS	2.59 ± 1.18
935	935	SF333	SN	D	19	Plaster	Wall	Intact	White	POS	4.89 ± 1.82
936	936	SF333	SN	D	19	Plaster	Ceiling	Intact	White	POS	2.68 ± 1.10
937	937	SF333	SN	D Right	19	Wood	Crown Molding	Intact	White	POS	15.30 ± 5.30
938	938	SF333	SN	A	19	Wood	Baseboard	Intact	White	POS	7.51 ± 2.46
939	939	SF333	SN	A Center	19	Wood	Toe Kick	Fair	White	POS	9.58 ± 3.88
940	940	SF333	SN	B Left	19	Wood	Window Sill	Fair	White	POS	6.75 ± 2.55
941	941	SF333	SN	B Left	19	Wood	L window Casing	Fair	White	POS	9.32 ± 2.89
942	942	SF333	SN	B Left	19	Wood	Window Sash	Fair	White	POS	11.79 ± 4.36
943	943	SF333	SN	B Left	19	Wood	Window Apron	Fair	White	POS	7.29 ± 2.58
944	944	SF333	SN	A Right	19	Wood	Closet Door	Intact	White	POS	5.10 ± 1.84
945	945	SF333	SN	A Right	19	Wood	Closet Shelf	Intact	White	NEG	0.00 ± 0.02
946	946	SF333	SN	A Right	19	Wood	Shelf Support	Intact	White	POS	5.10 ± 1.97
947	947	SF333	SN	A Right	19	Wood	Hanger Rod	Intact	White	POS	5.10 ± 2.01
948	948	SF333	SN	A Right	19	Wood	Closet Door Casing	Intact	White	POS	8.44 ± 2.97
949	949	SF333	SN	B Center	19	Metal	Electrical Conduit	Intact	White	NEG	0.13 ± 0.40
950	950	SF333	SN	B Center	19	Metal	Radiator	Intact	Silver	NEG	0.50 ± 0.25
951	951	SF333	SN	A	21	Plaster	Wall	Intact	White	POS	4.42 ± 1.66
952	952	SF333	SN	B	21	Plaster	Wall	Intact	White	NEG	0.03 ± 0.20
953	953	SF333	SN	C	21	Plaster	Wall	Intact	White	POS	3.61 ± 1.47
954	954	SF333	SN	D	21	Plaster	Wall	Intact	White	POS	6.27 ± 2.05
955	955	SF333	SN	A Center	21	Wood	Window Sill	Intact	White	POS	7.41 ± 2.79
956	956	SF333	SN	A Center	21	Wood	L Window Casing	Intact	White	POS	6.22 ± 2.51
957	957	SF333	SN	A Center	21	Wood	Window Sash	Intact	White	POS	10.57 ± 2.99
958	958	SF333	SN	A Center	21	Wood	Window Apron	Intact	White	POS	4.66 ± 1.74
959	959	SF333	SN	C	21	Plaster	Ceiling	Intact	White	POS	5.06 ± 1.75
960	960	SF333	SN	C Center	21	Wood	L Door Casing	Intact	White	POS	6.26 ± 2.51
961	961	SF333	SN	A Center	21	Wood	Toe Kick	Intact	White	NEG	0.03 ± 0.23
962	962	SF333	SN	A Left	17	Plaster	Fireplace Base	Intact	Red	POS	1.52 ± 0.34
963	963	SF333	SN	A Left	17	Plaster	Fireplace	Intact	White	POS	7.70 ± 2.85
964	964	SF333	SN	A	22	Plaster	Wall	Intact	White	NEG	0.14 ± 0.15
965	965	SF333	SN	B	22	Plaster	Wall	Intact	White	NEG	0.06 ± 0.08
966	966	SF333	SN	C	22	Plaster	Wall	Intact	White	NEG	0.13 ± 0.25
967	967	SF333	SN	D	22	Plaster	Wall	Intact	White	NEG	0.07 ± 0.13
968	968	SF333	SN	C	22	Wood	Ceiling	Intact	Stained	NEG	0.07 ± 0.19
969	969	SF333	SN	C Left	22	Wood	Ceiling Beam	Intact	Stained	NEG	0.01 ± 0.31
970	970	SF333	SN	B	22	Wood	Floor	Intact	Stained	NEG	0.00 ± 0.02
971	971	SF333	SN	B Center	22	Wood	Toe Kick	Intact	White	NEG	0.10 ± 0.34
972	972	SF333	SN	A Right	22	Wood	Window Sill	Intact	White	POS	8.93 ± 3.59
973	973	SF333	SN	A Right	22	Wood	R Window Casing	Intact	White	POS	9.61 ± 2.85
974	974	SF333	SN	A Right	22	Wood	Window Sash	Intact	White	POS	14.20 ± 5.46
975	975	SF333	SN	A Right	22	Wood	Window Apron	Intact	White	POS	5.61 ± 2.04
976	976	SF333	SN	C Left	22	Metal	Electrical Conduit	Intact	White	NEG	0.04 ± 0.22
977	977	SF333	SN	C Left	22	Metal	Radiator	Intact	Silver	NEG	0.19 ± 0.18
978	978	SF333	SN	A Left	22	Wood	Door	Intact	White	POS	8.50 ± 3.30
979	979	SF333	SN	A Left	22	Wood	R Door Casing	Intact	White	POS	6.82 ± 2.44
980	980	SF333	SN	C Right	22	Plaster	Fireplace Base	Intact	Red	POS	1.64 ± 0.50
981	981	SF333	SN	C Right	22	Plaster	Fireplace	Intact	White	NEG	0.20 ± 0.28
982	982	SF333	SN	A Left	22	Wood	Door Casing	Intact	White	POS	6.01 ± 2.13
983	983	SF333	SN	A Left	22	Wood	Door Header	Intact	Stained	NEG	0.00 ± 0.02
984	984	SF333	SN				Calibration			POS	1.20 ± 0.16
985	985	SF333	SN				Calibration			POS	1.52 ± 0.18
986	986	SF333	SN				Calibration			POS	1.17 ± 0.13
987	987	SF333	SN				Calibration			NEG	0.02 ± 0.26
988	988	SF333	SN				Calibration			POS	1.18 ± 0.14

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
989	**989**	**SF333**	**SN**				**Calibration**			**POS**	**1.24 ± 0.19**
990	**990**	**SF333**	**SN**				**Calibration**			**POS**	**1.17 ± 0.13**
991	**991**	**SF333**	**SN**				**Calibration**			**POS**	**1.14 ± 0.09**
992	992	SF333	SN	A	24	Plaster	Wall	Intact	White	NEG	-0.69 ± 1.15
993	993	SF333	SN	B	24	Plaster	Wall	Intact	White	NEG	0.03 ± 0.04
994	994	SF333	SN	C	24	Plaster	Wall	Intact	White	NEG	0.10 ± 0.11
995	995	SF333	SN	D	24	Plaster	Wall	Intact	White	NEG	0.12 ± 0.16
996	**996**	**SF333**	**SN**	**A Center**	**24**	**Wood**	**Closet Door**	**Intact**	**White**	**POS**	**7.23 ± 2.37**
997	**997**	**SF333**	**SN**	**A Center**	**24**	**Wood**	**Closet Door Casing**	**Intact**	**White**	**POS**	**6.91 ± 2.54**
998	998	SF333	SN	B	24	Wood	Floor	Intact	Stained	NEG	0.00 ± 0.02
999	999	SF333	SN	B	24	Plaster	Ceiling	Intact	White	NEG	0.05 ± 0.10
1000	1000	SF333	SN	C Right	24	Wood	Toe Kick	Intact	White	NEG	0.06 ± 0.27
1001	**1001**	**SF333**	**SN**	**A**	**23**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**4.85 ± 1.80**
1002	**1002**	**SF333**	**SN**	**B**	**23**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**1.96 ± 0.94**
1003	**1003**	**SF333**	**SN**	**C**	**23**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**5.67 ± 1.96**
1004	**1004**	**SF333**	**SN**	**D**	**23**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**5.10 ± 1.87**
1005	**1005**	**SF333**	**SN**	**B**	**23**	**Plaster**	**Ceiling**	**Intact**	**White**	**POS**	**6.56 ± 2.42**
1006	**1006**	**SF333**	**SN**	**B Left**	**23**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**10.03 ± 3.80**
1007	**1007**	**SF333**	**SN**	**B Center**	**23**	**Wood**	**Upper Cabinet Door**	**Intact**	**White**	**POS**	**10.98 ± 4.18**
1008	**1008**	**SF333**	**SN**	**B Center**	**23**	**Wood**	**Counter Molding**	**Intact**	**White**	**POS**	**6.28 ± 2.07**
1009	**1009**	**SF333**	**SN**	**B Center**	**23**	**Wood**	**Lower Cabinet Door**	**Intact**	**White**	**POS**	**9.66 ± 3.81**
1010	**1010**	**SF333**	**SN**	**B Center**	**23**	**Wood**	**Drawer**	**Intact**	**White**	**POS**	**5.10 ± 1.92**
1011	1011	SF333	SN	A	23	Wood	Floor	Intact	Stained	NEG	0.03 ± 0.07
1012	**1012**	**SF333**	**SN**	**B**	**23**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**5.89 ± 2.29**
1013	**1013**	**SF333**	**SN**	**C Center**	**23**	**Wood**	**Toe Kick**	**Fair**	**White**	**POS**	**2.99 ± 0.90**
1014	**1014**	**SF333**	**SN**	**C Center**	**23**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**1.83 ± 0.51**
1015	**1015**	**SF333**	**SN**	**C Center**	**23**	**Wood**	**L Window Casing**	**Intact**	**White**	**POS**	**7.69 ± 2.49**
1016	**1016**	**SF333**	**SN**	**C Center**	**23**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**11.40 ± 4.68**
1017	**1017**	**SF333**	**SN**	**C Center**	**23**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**7.14 ± 2.54**
1018	1018	SF333	SN	A	26	Plaster	Wall	Intact	White	NEG	0.11 ± 0.23
1019	1019	SF333	SN	B	26	Plaster	Wall	Intact	White	NEG	-0.38 ± 1.09
1020	1020	SF333	SN	C	26	Plaster	Wall	Intact	White	NEG	-0.24 ± 0.91
1021	1021	SF333	SN	D	26	Plaster	Wall	Intact	White	NEG	0.11 ± 0.13
1022	1022	SF333	SN	D	26	Wood	Floor	Intact	Stained	NEG	0.01 ± 0.03
1023	1023	SF333	SN	B	26	Wood	Ceiling	Intact	Stained	NEG	0.05 ± 0.36
1024	1024	SF333	SN	A Center	26	Wood	Ceiling Beam	Intact	Stained	NEG	0.03 ± 0.31
1025	1025	SF333	SN	A Right	26	Wood	Toe Kick	Intact	White	NEG	0.03 ± 0.15
1026	**1026**	**SF333**	**SN**	**A Left**	**26**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**4.19 ± 1.30**
1027	**1027**	**SF333**	**SN**	**A Left**	**26**	**Wood**	**L Window Casing**	**Intact**	**White**	**POS**	**7.54 ± 3.08**
1028	**1028**	**SF333**	**SN**	**A Left**	**26**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**10.76 ± 3.03**
1029	**1029**	**SF333**	**SN**	**A Left**	**26**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**6.79 ± 2.36**
1030	1030	SF333	SN	A Left	26	Wood	Window Header	Intact	Stained	NEG	0.02 ± 0.29
1031	1031	SF333	SN	A Left	26	Metal	Radiator	Intact	White	NEG	0.33 ± 0.27
1032	**1032**	**SF333**	**SN**	**A Right**	**26**	**Wood**	**Door**	**Intact**	**White**	**POS**	**7.20 ± 2.55**
1033	**1033**	**SF333**	**SN**	**A Right**	**26**	**Wood**	**R Door Casing**	**Intact**	**White**	**POS**	**13.50 ± 5.03**
1034	1034	SF333	SN	A Right	26	Wood	Door Header	Intact	Stained	NEG	0.01 ± 0.25
1035	1035	SF333	SN	C Left	26	Metal	Electrical Conduit	Intact	White	NEG	0.04 ± 0.22
1036	1036	SF333	SN	C Right	26	Plaster	Fireplace	Intact	Brown	NEG	0.08 ± 0.12
1037	1037	SF333	SN	C Right	26	Plaster	Fireplace Base	Intact	Brown	NEG	0.38 ± 0.23
1038	1038	SF333	SN	C Right	26	Plaster	Fireplace	Intact	White	NEG	0.18 ± 0.16
1039	1039	SF333	SN	A	27	Plaster	Wall	Intact	White	NEG	0.09 ± 0.79
1040	1040	SF333	SN	B	27	Plaster	Wall	Intact	White	NEG	0.04 ± 0.11
1041	1041	SF333	SN	C	27	Plaster	Wall	Intact	White	NEG	0.11 ± 0.14
1042	1042	SF333	SN	D	27	Plaster	Wall	Intact	White	NEG	0.04 ± 0.15
1043	1043	SF333	SN	B	27	Plaster	Ceiling	Intact	White	NEG	-0.17 ± 0.88
1044	**1044**	**SF333**	**SN**	**B Center**	**27**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**3.04 ± 1.24**
1045	1045	SF333	SN	A	27	Wood	Floor	Intact	Stained	NEG	0.00 ± 0.02
1046	**1046**	**SF333**	**SN**	**A**	**27**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**6.27 ± 2.36**
1047	**1047**	**SF333**	**SN**	**A Right**	**27**	**Wood**	**Toe Kick**	**Intact**	**White**	**POS**	**5.39 ± 1.83**
1048	**1048**	**SF333**	**SN**	**C Left**	**27**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**4.68 ± 1.60**
1049	**1049**	**SF333**	**SN**	**C Left**	**27**	**Wood**	**L Window Casing**	**Intact**	**White**	**POS**	**5.13 ± 1.68**
1050	**1050**	**SF333**	**SN**	**C Left**	**27**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**7.56 ± 2.91**
1051	**1051**	**SF333**	**SN**	**C Left**	**27**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**6.79 ± 2.16**
1052	**1052**	**SF333**	**SN**	**A Center**	**27**	**Wood**	**Closet Door**	**Intact**	**White**	**POS**	**5.49 ± 1.95**

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
1053	**1053**	**SF333**	**SN**	**A Center**	**27**	**Wood**	**Closet Door Casing**	**Intact**	**White**	**POS**	**8.82 ± 2.60**
1054	1054	SF333	SN	A Center	27	Wood	Closet Shelf	Intact	White	NEG	0.00 ± 0.14
1055	**1055**	**SF333**	**SN**	**A Center**	**27**	**Wood**	**Shelf Support**	**Intact**	**White**	**POS**	**3.89 ± 1.40**
1056	1056	SF333	SN				NULL			INCOM	1.03 ± 0.36
1057	**1057**	**SF333**	**SN**	**A Center**	**27**	**Wood**	**Hanger Rod**	**Intact**	**White**	**POS**	**4.76 ± 1.79**
1058	1058	SF333	SN	C Left	27	Metal	Radiator	Intact	Silver	NEG	0.33 ± 0.27
1059	**1059**	**SF333**	**SN**	**A Right**	**27**	**Wood**	**Door**	**Intact**	**White**	**POS**	**6.68 ± 2.52**
1060	**1060**	**SF333**	**SN**	**A Right**	**27**	**Wood**	**L Door Casing**	**Intact**	**White**	**POS**	**4.74 ± 1.63**
1061	1061	SF333	SN	C Right	27	Metal	Conduit	Intact	White	NEG	0.07 ± 0.23
1062	1062	SF333	SN	A	31	Plaster	Wall	Intact	White	NEG	0.15 ± 0.23
1063	1063	SF333	SN	B	31	Plaster	Wall	Intact	White	NEG	0.04 ± 0.07
1064	1064	SF333	SN	C	31	Plaster	Wall	Intact	White	NEG	0.08 ± 0.14
1065	1065	SF333	SN	D	31	Plaster	Wall	Intact	White	NEG	-0.48 ± 1.13
1066	1066	SF333	SN	D	31	Wood	Floor	Intact	Stained	NEG	0.00 ± 0.02
1067	1067	SF333	SN	C	31	Plaster	Ceiling	Intact	White	NEG	0.08 ± 0.13
1068	**1068**	**SF333**	**SN**	**B Left**	**31**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**9.43 ± 3.84**
1069	**1069**	**SF333**	**SN**	**C**	**31**	**Wood**	**Basboard**	**Intact**	**White**	**POS**	**7.69 ± 2.34**
1070	**1070**	**SF333**	**SN**	**D Right**	**31**	**Wood**	**Toe Kick**	**Intact**	**White**	**POS**	**6.20 ± 2.43**
1071	1071	SF333	SN	A Center	31	Wood	Door Header	Intact	White	NEG	0.01 ± 0.25
1072	**1072**	**SF333**	**SN**	**B**	**31**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**6.18 ± 2.28**
1073	**1073**	**SF333**	**SN**	**B**	**31**	**Wood**	**R Window Casing**	**Intact**	**White**	**POS**	**8.09 ± 3.44**
1074	**1074**	**SF333**	**SN**	**B**	**31**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**14.53 ± 4.51**
1075	**1075**	**SF333**	**SN**	**B**	**31**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**5.10 ± 1.91**
1076	**1076**	**SF333**	**SN**	**A Center**	**31**	**Wood**	**Stair Riser**	**Intact**	**White**	**POS**	**5.10 ± 1.60**
1077	1077	SF333	SN	B Lefr	31	Metal	Radiator	Intact	Silver	NEG	0.50 ± 0.24
1078	1078	SF333	SN	A	30	Plaster	Wall	Intact	White	NEG	0.08 ± 0.11
1079	1079	SF333	SN	B	30	Plaster	Wall	Intact	White	NEG	-0.39 ± 1.04
1080	1080	SF333	SN	C	30	Plaster	Wall	Intact	White	NEG	0.17 ± 0.30
1081	1081	SF333	SN	D	30	Plaster	Wall	Intact	White	NEG	0.22 ± 0.27
1082	1082	SF333	SN	A	30	Wood	Floor	Intact	Stained	NEG	0.00 ± 0.16
1083	1083	SF333	SN	B	30	Plaster	Ceiling	Intact	White	NEG	0.11 ± 0.23
1084	**1084**	**SF333**	**SN**	**B Center**	**30**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**6.86 ± 2.83**
1085	**1085**	**SF333**	**SN**	**C**	**30**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**5.10 ± 1.64**
1086	**1086**	**SF333**	**SN**	**C Center**	**30**	**Wood**	**Toe Kick**	**Intact**	**White**	**POS**	**2.89 ± 1.27**
1087	1087	SF333	SN	C Center	30	Metal	Conduit	Intact	White	NEG	0.10 ± 0.19
1088	1088	SF333	SN	D Center	30	Metal	Radiator	Intact	Silver	NEG	0.19 ± 0.26
1089	**1089**	**SF333**	**SN**	**C Center**	**30**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**8.33 ± 2.80**
1090	**1090**	**SF333**	**SN**	**C Center**	**30**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**7.26 ± 2.64**
1091	**1091**	**SF333**	**SN**	**C Center**	**30**	**Wood**	**L Window Casing**	**Intact**	**White**	**POS**	**8.32 ± 3.59**
1092	**1092**	**SF333**	**SN**	**C Center**	**30**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**13.17 ± 4.78**
1093	**1093**	**SF333**	**SN**	**A Left**	**30**	**Wood**	**Door**	**Intact**	**White**	**POS**	**8.17 ± 3.08**
1094	**1094**	**SF333**	**SN**	**A Left**	**30**	**Wood**	**L Door Casing**	**Intact**	**White**	**POS**	**6.44 ± 2.37**
1095	**1095**	**SF333**	**SN**	**A Right**	**30**	**Wood**	**Closet Door Casing**	**Intact**	**White**	**POS**	**5.10 ± 1.86**
1096	1096	SF333	SN	A Right	30	Wood	Closet Shelf	Intact	White	INCOM	0.01 ± 0.05
1097	1097	SF333	SN				NULL			NEG	0.00 ± 0.02
1098	**1098**	**SF333**	**SN**	**A Right**	**30**	**Wood**	**Shelf Support**	**Intact**	**White**	**POS**	**5.78 ± 2.31**
1099	**1099**	**SF333**	**SN**	**A Right**	**30**	**Wood**	**Hanger Rod**	**Intact**	**White**	**POS**	**2.29 ± 0.85**
1100	**1100**	**SF333**	**SN**	**A**	**29**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**4.42 ± 1.75**
1101	**1101**	**SF333**	**SN**	**B**	**29**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**5.14 ± 1.99**
1102	**1102**	**SF333**	**SN**	**C**	**29**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**6.25 ± 2.61**
1103	**1103**	**SF333**	**SN**	**D**	**29**	**Plaster**	**Wall**	**Intact**	**White**	**POS**	**5.10 ± 1.96**
1104	**1104**	**SF333**	**SN**	**C**	**29**	**Plaster**	**Ceiling**	**Intact**	**White**	**POS**	**5.47 ± 1.84**
1105	1105	SF333	SN	A	29	Concrete	Floor	Poor	Gray	NEG	0.06 ± 0.06
1106	**1106**	**SF333**	**SN**	**D Center**	**29**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**3.43 ± 1.40**
1107	**1107**	**SF333**	**SN**	**D Center**	**29**	**Wood**	**L Window Casing**	**Intact**	**White**	**POS**	**7.97 ± 2.63**
1108	**1108**	**SF333**	**SN**	**D Center**	**29**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**8.20 ± 2.64**
1109	**1109**	**SF333**	**SN**	**D Center**	**29**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**5.98 ± 2.14**
1110	1110	SF333	SN	D Center	29	Metal	Radiator	Intact	Silver	NEG	0.36 ± 0.25
1111	**1111**	**SF333**	**SN**	**C Center**	**29**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**6.15 ± 2.50**
1112	**1112**	**SF333**	**SN**	**C Center**	**29**	**Wood**	**Stall Door**	**Intact**	**Brown**	**POS**	**10.57 ± 4.05**
1113	1113	SF333	SN	C Center	29	Metal	Stall Frame	Intact	Brown	NEG	0.01 ± 0.23
1114	1114	SF333	SN	C Center	29	Metal	Stall Frame Support	Intact	Brown	NEG	0.34 ± 0.30
1115	1115	SF333	SN	C Right	29	Wood	Closet Shelf	Intact	White	NEG	0.00 ± 0.15
1116	1116	SF333	SN	C Right	29	Wood	Shelf Support	Intact	White	NEG	0.00 ± 0.15

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
1117	**1117**	**SF333**	**SN**	**C Right**	**29**	**Wood**	**Closet Door**	**Intact**	**White**	**POS**	**5.10 ± 1.78**
1118	**1118**	**SF333**	**SN**	**C Right**	**29**	**Wood**	**Closet Door Casing**	**Intact**	**White**	**POS**	**5.10 ± 1.71**
1119	1119	SF333	SN	A	28	Plaster	Wall	Intact	White	NEG	-0.15 ± 0.89
1120	1120	SF333	SN	B	28	Plaster	Wall	Intact	White	NEG	0.13 ± 0.24
1121	1121	SF333	SN	C	28	Plaster	Wall	Intact	White	NEG	0.09 ± 0.18
1122	1122	SF333	SN	D	28	Plaster	Wall	Intact	White	NEG	0.10 ± 0.19
1123	1123	SF333	SN	D Right	28	Metal	Conduit	Intact	White	NEG	0.01 ± 0.18
1124	**1124**	**SF333**	**SN**	**C Right**	**28**	**Wood**	**Window Sill**	**Intact**	**White**	**POS**	**3.27 ± 1.18**
1125	**1125**	**SF333**	**SN**	**C Right**	**28**	**Wood**	**L Window Casing**	**Intact**	**White**	**POS**	**5.07 ± 1.90**
1126	**1126**	**SF333**	**SN**	**C Right**	**28**	**Wood**	**Window Sash**	**Intact**	**White**	**POS**	**15.24 ± 5.05**
1127	**1127**	**SF333**	**SN**	**C Right**	**28**	**Wood**	**Window Apron**	**Intact**	**White**	**POS**	**5.79 ± 2.04**
1128	1128	SF333	SN	D Right	28	Metal	Radiator	Intact	Silver	NEG	0.48 ± 0.22
1129	1129	SF333	SN	D	28	Wood	Floor	Intact	Stained	NEG	0.00 ± 0.02
1130	**1130**	**SF333**	**SN**	**D**	**28**	**Wood**	**Baseboard**	**Intact**	**White**	**POS**	**6.28 ± 2.28**
1131	**1131**	**SF333**	**SN**	**D Right**	**28**	**Wood**	**Toe Kick**	**Intact**	**White**	**POS**	**6.55 ± 2.05**
1132	1132	SF333	SN	B	28	Plaster	Ceiling	Intact	White	NEG	0.27 ± 0.23
1133	**1133**	**SF333**	**SN**	**B Center**	**28**	**Wood**	**Crown Molding**	**Intact**	**White**	**POS**	**11.11 ± 3.43**
1134	**1134**	**SF333**	**SN**	**A Center**	**28**	**Wood**	**Closet Door**	**Intact**	**White**	**POS**	**4.46 ± 1.64**
1135	**1135**	**SF333**	**SN**	**A Center**	**28**	**Wood**	**Closet Door Casing**	**Intact**	**White**	**POS**	**9.51 ± 3.31**
1136	1136	SF333	SN	A Center	28	Wood	Closet Shelf	Intact	White	NEG	0.00 ± 0.10
1137	1137	SF333	SN	A Center	28	Wood	Shelf Support	Intact	White	NEG	0.00 ± 0.11
1138	**1138**	**SF333**	**SN**	**A Center**	**28**	**Wood**	**Hanger Rod**	**Intact**	**White**	**POS**	**1.04 ± 0.16**
1139	**1139**	**SF333**	**SN**	**A Center**	**28**	**Concrete**	**Closet Floor**	**Intact**	**Red**	**POS**	**2.32 ± 0.62**
1140	1140	SF333	SN	A Center	28	Wood	Hatch Door	Intact	White	NEG	0.00 ± 0.14
1141	**1141**	**SF333**	**SN**	**A Center**	**28**	**Wood**	**Hatch Door Frame**	**Intact**	**White**	**POS**	**7.07 ± 2.62**
1142	**1142**	**SF333**	**SN**	**A Center**	**28**	**Wood**	**Door**	**Intact**	**White**	**POS**	**6.73 ± 2.19**
1143	**1143**	**SF333**	**SN**	**A Center**	**28**	**Wood**	**L Door Casing**	**Intact**	**White**	**POS**	**9.06 ± 3.93**
1144	**1144**	**SF333**	**SN**				**Calibrate**			**POS**	**1.24 ± 0.18**
1145	**1145**	**SF333**	**SN**				**Calibrate**			**POS**	**1.30 ± 0.20**
1146	**1146**	**SF333**	**SN**				**Calibrate**			**POS**	**1.11 ± 0.09**
1147	1147	SF333	SN		Shutter Cal 1			Intact		...	NA
1148	**1148**	**SF333**	**SN**				**Calibration**			**POS**	**1.17 ± 0.14**
1149	**1149**	**SF333**	**SN**				**Calibration**			**POS**	**1.28 ± 0.19**
1150	**1150**	**SF333**	**SN**				**Calibration**			**POS**	**1.26 ± 0.19**
1151	**1151**	**SF333**	**SN**	**A**	**32**	**Plaster**	**Wall**	**Poor**	**Green**	**POS**	**5.10 ± 2.00**
1152	**1152**	**SF333**	**SN**	**B**	**32**	**Plaster**	**Wall**	**Poor**	**Green**	**POS**	**3.03 ± 0.75**
1153	**1153**	**SF333**	**SN**	**C**	**32**	**Plaster**	**Wall**	**Poor**	**Green**	**POS**	**5.10 ± 1.84**
1154	**1154**	**SF333**	**SN**	**D**	**32**	**Plaster**	**Wall**	**Intact**	**Green**	**POS**	**5.10 ± 1.32**
1155	**1155**	**SF333**	**SN**	**B**	**32**	**Plaster**	**Ceiling**	**Intact**	**White**	**POS**	**5.10 ± 1.92**
1156	1156	SF333	SN	A	32	Concrete	Floor	Intact	Green	NEG	0.19 ± 0.09
1157	**1157**	**SF333**	**SN**	**D Right**	**32**	**Wood**	**Window Sill**	**Poor**	**Lt. Green**	**POS**	**5.90 ± 2.12**
1158	**1158**	**SF333**	**SN**	**D Right**	**32**	**Metal**	**Window Sash**	**Intact**	**Green**	**POS**	**2.40 ± 0.64**
1159	**1159**	**SF333**	**SN**	**D Right**	**32**	**Metal**	**L Window Casing**	**Intact**	**Green**	**POS**	**4.43 ± 1.67**
1160	**1160**	**SF333**	**SN**	**A Center**	**32**	**Metal**	**Horizontal Pipe**	**Intact**	**Red**	**POS**	**1.02 ± 0.15**
1161	1161	SF333	SN	A Center	32	Metal	Pipe	Intact	Green	NEG	0.28 ± 0.14
1162	**1162**	**SF333**	**SN**	**A Left**	**32**	**Wood**	**Door**	**Intact**	**Green**	**POS**	**5.10 ± 1.08**
1163	**1163**	**SF333**	**SN**	**A Left**	**32**	**Wood**	**R Door Jamb**	**Intact**	**Green**	**POS**	**6.20 ± 2.44**
1164	1164	SF333	SN	A	Basement Hall	Plaster	Wall	Intact	Beige	NEG	0.00 ± 0.09
1165	1165	SF333	SN	B	36	Plaster	Wall	Intact	Beige	NEG	0.02 ± 0.19
1166	1166	SF333	SN	C	36	Plaster	Wall	Intact	Beige	NEG	0.01 ± 0.17
1167	1167	SF333	SN	D	36	Plaster	Wall	Intact	Beige	NEG	0.02 ± 0.17
1168	1168	SF333	SN	A	36	Plaster	Ceiling	Intact	Beige	NEG	0.01 ± 0.18
1169	1169	SF333	SN	A	36	Concrete	Floor	Intact	Blue	NEG	-0.31 ± 0.90
1170	**1170**	**SF333**	**SN**	**B Center**	**36**	**Wood**	**Door**	**Intact**	**Beige**	**POS**	**5.10 ± 1.97**
1171	**1171**	**SF333**	**SN**	**B Center**	**36**	**Wood**	**L Door Jamb**	**Intact**	**Beige**	**POS**	**5.10 ± 1.97**
1172	1172	SF333	SN	B Center	36	Metal	Pipe	Intact	Black	NEG	0.04 ± 0.12
1173	1173	SF333	SN	A	33	Plaster	Wall	Intact	White	NEG	0.00 ± 0.01
1174	1174	SF333	SN	B	33	Plaster	Wall	Intact	White	NEG	0.00 ± 0.01
1175	1175	SF333	SN	C	33	Plaster	Wall	Intact	White	NEG	0.01 ± 0.04
1176	1176	SF333	SN	D	33	Plaster	Wall	Intact	White	NEG	0.00 ± 0.01
1177	1177	SF333	SN	D	33	Concrete	Floor	Intact	Blue	NEG	0.00 ± 0.02
1178	**1178**	**SF333**	**SN**	**A Center**	**33**	**Wood**	**Door**	**Intact**	**Green**	**POS**	**2.90 ± 0.84**
1179	**1179**	**SF333**	**SN**	**A Center**	**33**	**Wood**	**L Door Jamb**	**Intact**	**Green**	**POS**	**5.10 ± 1.82**
1180	**1180**	**SF333**	**SN**	**A**	**35**	**Plaster**	**Wall**	**Poor**	**Green**	**POS**	**2.48 ± 0.65**

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
1181	1181	SF333	SN	B	35	Plaster	Wall	Intact	Green	POS	2.45 ± 0.56
1182	1182	SF333	SN	C	35	Plaster	Wall	Poor	Green	POS	5.10 ± 1.69
1183	1183	SF333	SN	D	35	Plaster	Wall	Poor	Green	POS	3.40 ± 1.05
1184	1184	SF333	SN	B	35	Plaster	Ceiling	Intact	White	POS	5.10 ± 1.85
1185	1185	SF333	SN	D	35	Concrete	Floor	Intact	Green	NEG	0.06 ± 0.05
1186	1186	SF333	SN	C Left	35	Wood	Door	Intact	White	POS	5.10 ± 1.80
1187	1187	SF333	SN	C Left	35	Wood	R Door Casing	Intact	Green	POS	5.10 ± 1.06
1188	1188	SF333	SN	D Center	35	Concrete	Window Sill	Intact	Green	POS	5.10 ± 1.85
1189	1189	SF333	SN	D Center	35	Metal	L Window Casing	Intact	Green	POS	5.10 ± 1.53
1190	1190	SF333	SN	D Center	35	Metal	Window Sash	Intact	Green	POS	2.14 ± 0.53
1191	1191	SF333	SN	A Left	35	Wood	Closet Door	Intact	Green	POS	6.47 ± 2.56
1192	1192	SF333	SN	A Left	35	Wood	Closet Door Casing	Intact	Green	POS	5.10 ± 1.18
1193	1193	SF333	SN	A Left	35	Wood	Closet Shelf	Intact	Beige	POS	5.10 ± 2.01
1194	1194	SF333	SN	A Left	35	Metal	Pipe	Intact	Lt. Green	POS	5.10 ± 1.99

Serial #XL309-U3987NR6814 Site: Date: 12/20/2006

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
1342	**1342**	**SF334**	**SN**				**Calibration**			**1.0**	**POS**	**1.25 ± 0.19**
1343	**1343**	**SF334**	**SN**				**Calibration**			**1.0**	**POS**	**1.12 ± 0.08**
1344	**1344**	**SF334**	**SN**				**Calibration**			**1.0**	**POS**	**1.13 ± 0.09**
1345	1345	SF334	SN	A	1	Wood	Wall	Intact	White	3.1	NEG	0.04 ± 0.11
1346	1346	SF334	SN	B	1	Wood	Wall	Intact	White	1.5	NEG	0.01 ± 0.04
1347	1347	SF334	SN	C	1	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.02
1348	1348	SF334	SN	D	1	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.02
1349	1349	SF334	SN	D	1	Fiberbaord	Ceiling Tile	Intact	White	2.8	NEG	0.01 ± 0.04
1350	1350	SF334	SN	Ceiling C	1	Metal	Ceiling Grid	Intact	Gray	1.3	NEG	0.01 ± 0.02
1351	1351	SF334	SN	D Right	1	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.15
1352	1352	SF334	SN	D Right	1	Wood	R Door Jamb	Intact	White	1.0	NEG	0.00 ± 0.13
1353	1353	SF334	SN	D Right	1	Wood	R Door Casing	Intact	White	1.0	NEG	0.00 ± 0.10
1354	1354	SF334	SN	B Center	1	Wood	Window Sill	Intact	White	1.7	NEG	0.01 ± 0.05
1355	1355	SF334	SN	B Right	1	Wood	Closet Door	Intact	White	1.0	NEG	0.00 ± 0.02
1356	1356	SF334	SN	B Right	1	Wood	Closet Shelf	Intact	White	1.0	NEG	0.00 ± 0.14
1357	1357	SF334	SN	B Right	1	Wood	Closet Door Jam	Intact	White	1.0	NEG	0.00 ± 0.13
1358	1358	SF334	SN	A Center	1	Drywall	Closet Walls	Intact	White	1.0	NEG	0.00 ± 0.12
1359	1359	SF334	SN	B Center	1	Drywall	Closet Walls	Intact	White	1.0	NEG	0.00 ± 0.01
1360	1360	SF334	SN	C Center	1	Drywall	Closet Walls	Intact	White	1.0	NEG	0.00 ± 0.05
1361	1361	SF334	SN	Ceiling C	1	Drywall	Closet	Intact	White	1.0	NEG	0.00 ± 0.01
1362	1362	SF334	SN	A Right	1	Metal	Electrical Conduit	Intact	White	1.0	NEG	-0.68 ± 0.89
1363	1363	SF334	SN	A	2	Wood	Wall	Intact	White	6.5	NEG	0.09 ± 0.25
1364	1364	SF334	SN	B	2	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.11
1365	1365	SF334	SN	C	2	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.08
1366	1366	SF334	SN	D	2	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.02
1367	1367	SF334	SN	D	2	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	0.18 ± 0.60
1368	1368	SF334	SN	Ceiling C	2	Metal	Ceiling Grid	Intact	Gray	7.5	NEG	0.11 ± 0.24
1369	1369	SF334	SN	D Right	2	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.01
1370	1370	SF334	SN	D Right	2	Metal	L Door Casing	Intact	White	1.0	NEG	0.00 ± 0.01
1371	1371	SF334	SN	D Right	2	Metal	L Door Jamb	Intact	White	1.0	NEG	0.00 ± 0.13
1372	1372	SF334	SN	B Center	2	Metal	Window Sill	Intact	White	10.0	NEG	-0.15 ± 0.87
1373	1373	SF334	SN	A	3	Wood	Wall	Intact	White	2.6	NEG	0.04 ± 0.35
1374	1374	SF334	SN	A	3	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.02
1375	1375	SF334	SN	B	3	Wood	Wall	Intact	White	2.4	NEG	0.02 ± 0.07
1376	1376	SF334	SN	C	3	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.02
1377	1377	SF334	SN	D	3	Wood	Wall	Intact	White	2.7	NEG	0.03 ± 0.08
1378	1378	SF334	SN	A	3	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	-0.26 ± 0.75
1379	1379	SF334	SN	A Center	3	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.00 ± 0.01
1380	1380	SF334	SN	D Center	3	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
1381	1381	SF334	SN	D Center	3	Metal	R Door Casing	Intact	White	1.0	NEG	0.00 ± 0.13
1382	1382	SF334	SN	D Center	3	Metal	R Door Jamb	Intact	White	1.0	NEG	0.00 ± 0.01
1383	1383	SF334	SN	D Right	3	Wood	Wood Corner Decor	Intact	White	1.0	NEG	0.00 ± 0.13
1384	1384	SF334	SN	B Center	3	Metal	Window Sill	Intact	White	2.3	NEG	0.02 ± 0.07
1385	1385	SF334	SN	A	4	Wood	Wall	Intact	White	1.3	NEG	0.01 ± 0.04
1386	1386	SF334	SN	B	4	Wood	Wall	Intact	White	1.6	NEG	0.01 ± 0.04
1387	1387	SF334	SN	C Right	4	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.06
1388	1388	SF334	SN	D	4	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.13
1389	1389	SF334	SN	D	4	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.01
1390	1390	SF334	SN	D Center	4	Metal	Ceiling Grid	Intact	White	1.0	NEG	0.00 ± 0.14
1391	1391	SF334	SN	D Center	4	Wood	Wood Baseboard	Intact	White	1.0	NEG	0.00 ± 0.14
1392	1392	SF334	SN	C Center	4	Metal	Door	Intact	Brown	1.6	NEG	0.09 ± 0.27
1393	1393	SF334	SN	C Center	4	Metal	R Door Jamb	Intact	White	1.0	NEG	0.00 ± 0.11
1394	1394	SF334	SN	D Center	4	Wood	Crown Molding	Intact	White	1.0	NEG	0.00 ± 0.12
1395	1395	SF334	SN	D Center	4	Wood	Window Sill	Intact	White	1.0	NEG	0.00 ± 0.12
1396	1396	SF334	SN	D Center	4	Wood	Part Bead	Intact	White	1.0	NEG	0.00 ± 0.13
1397	1397	SF334	SN	B Center	4	Wood	Door	Intact	Varnish	1.0	NEG	0.01 ± 0.03
1398	1398	SF334	SN	B Center	4	Wood	Door Jam	Intact	White	1.0	NEG	0.00 ± 0.12
1399	1399	SF334	SN	D Center	4	Metal	Metal Conduit	Intact	White	10.0	NEG	0.29 ± 0.67
1400	1400	SF334	SN	B Right	4	Metal	Vent	Intact	White	1.0	NEG	0.00 ± 0.10
1401	1401	SF334	SN	B Right	4	Wood	Entry Hall Frame	Intact	White	1.0	NEG	0.00 ± 0.02
1402	1402	SF334	SN	B Right	4	Wood	Entry Wall Door	Intact	White	1.0	NEG	0.00 ± 0.13
1403	1403	SF334	SN	A	5	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.15
1404	1404	SF334	SN	B	5	Wood	Wall	Intact	White	7.2	NEG	0.11 ± 0.29
1405	1405	SF334	SN	C	5	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.02
1406	1406	SF334	SN	D	5	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.16
1407	1407	SF334	SN	A	5	Fiberboard	Ceiling Tile	Intact	White	1.3	NEG	-0.12 ± 0.84
1408	1408	SF334	SN	D Center	5	Metal	Electrical Conduit	Intact	White	1.0	NEG	0.01 ± 0.09
1409	1409	SF334	SN	A Right	5	Metal	Ceiling Grid	Intact	White	1.7	NEG	0.27 ± 0.32

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
1410	1410	SF334	SN	D Right	5	Metal	Pipe (Waterheater)	Intact	White	10.0	NEG	0.10 ± 0.62
1411	1411	SF334	SN	D Right	5	Wood	Wall Molding Door	Intact	White	1.0	NEG	0.00 ± 0.14
1412	1412	SF334	SN	B Left	5	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.01
1413	1413	SF334	SN	B Left	5	Wood	L Door Jamb	Intact	White	1.0	NEG	0.00 ± 0.11
1414	1414	SF334	SN	B Left	5	Wood	L Door Casing	Intact	White	1.0	NEG	0.00 ± 0.17
1415	1415	SF334	SN	A	Exterior	Metal	Wall	Intact	Beige	4.9	NEG	0.04 ± 0.17
1416	1416	SF334	SN	A Center	Exterior	Metal	Beam Foundation	Intact	Beige	3.8	NEG	0.10 ± 0.44
1417	1417	SF334	DD	A Center	Exterior	Metal	Duct	Intact	Beige	10.0	NEG	0.19 ± 0.51
1418	1418	SF334	SN	A Center	Exterior	Metal	HVAC Unit	Intact	Tan	1.0	NEG	0.01 ± 0.02
1419	1419	SF334	SN	A Center	Exterior	Metal	Electrical Switch	Intact	Beige	1.0	NEG	0.00 ± 0.05
1420	1420	SF334	SN	B	Exterior	Metal	Wall	Intact	Beige	1.0	NEG	0.00 ± 0.02
1421	1421	SF334	SN	B Right	Exterior	Metal	Window Apron	Intact	Brown	1.0	NEG	0.00 ± 0.02
1422	1422	SF334	SN	B Right	Exterior	Metal	R Window Casing	Intact	Brown	2.2	NEG	0.10 ± 0.35
1423	1423	SF334	SN	B Left	Exterior	Metal	Gas Pipe	Intact	Gray	6.5	NEG	0.16 ± 0.37
1424	1424	SF334	SN	B Left	Exterior	Metal	Gas Gauge	Intact	Gray	1.0	NEG	0.04 ± 0.03
1425	1425	SF334	SN	C	Exterior	Metal	Wall	Intact	Beige	1.0	NEG	0.00 ± 0.02
1426	1426	SF334	SN	C Right	Exterior	Metal	Metal Brace	Intact	Beige	1.9	NEG	0.04 ± 0.21
1427	1427	SF334	SN	C Center	Exterior	Metal	Porch Post	Intact	Brown	3.1	NEG	0.03 ± 0.23
1428	1428	SF334	SN	C Center	Exterior	Metal	Stair Rail	Intact	Brown	1.9	NEG	0.08 ± 0.32
1429	1429	SF334	SN	C Center	Exterior	Metal	Stair	Intact	Brown	1.1	NEG	0.01 ± 0.29
1430	1430	SF334	SN	C Center	Exterior	Metal	Porch Ceiling	Intact	White	1.0	NEG	0.02 ± 0.10
1431	1431	SF334	SN	C Left	Exterior	Metal	Door	Intact	Beige	1.0	NEG	0.02 ± 0.17
1432	1432	SF334	SN	C Left	Exterior	Wood	R Door Casing	Intact	Brown	1.1	NEG	0.01 ± 0.18
1433	1433	SF334	SN	C Left	Exterior	Metal	Newel Post	Intact	Brown	1.0	NEG	0.01 ± 0.02
1434	1434	SF334	SN	D Center	Exterior	Metal	Wall	Intact	Beige	1.0	NEG	0.02 ± 0.35
1435	**1435**	**SF334**					**Calibration**			**1.0**	**POS**	**1.13 ± 0.09**
1436	**1436**	**SF334**					**Calibration**			**1.0**	**POS**	**1.23 ± 0.19**
1437	**1437**	**SF334**					**Calibration**			**1.0**	**POS**	**1.24 ± 0.19**

Serial #XL309-U3987NR6814 Site: Date: 12/21/2006

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
1439	**1439**	**SF335**	**DD**				**Calibrate**			**POS**	**1.19 ± 0.13**
1440	**1440**	**SF335**	**DD**				**Calibrate**			**POS**	**1.17 ± 0.12**
1441	**1441**	**SF335**	**DD**				**Calibrate**			**POS**	**1.19 ± 0.15**
1442	1442	SF335	DD	A	1	Wood	Wall	Intact	White	NEG	0.00 ± 0.02
1443	1443	SF335	DD	B	1	Wood	Wall	Intact	White	NEG	0.00 ± 0.03
1444	1444	SF335	DD	C	1	Wood	Wall	Intact	White	NEG	0.12 ± 0.33
1445	1445	SF335	DD	C	1	Fiberboard	Ceiling Tile	Intact	White	NEG	0.00 ± 0.01
1446	1446	SF335	DD	B Right	1	Metal	Ceiling Tile Grid	Intact	White	NEG	0.08 ± 0.24
1447	1447	SF335	DD	C Left	1	Wood	Door	Intact	Stain	NEG	0.00 ± 0.16
1448	1448	SF335	DD	C Left	1	Wood	R Door Jamb	Intact	White	NEG	0.00 ± 0.15
1449	1449	SF335	DD	A	2	Wood	Wall	Intact	White	NEG	0.04 ± 0.27
1450	1450	SF335	DD	B	2	Wood	Wall	Intact	White	NEG	0.00 ± 0.02
1451	1451	SF335	DD	C	2	Wood	Wall	Intact	White	NEG	0.09 ± 0.24
1452	1452	SF335	DD	D	2	Wood	Wall	Intact	White	NEG	0.02 ± 0.33
1453	1453	SF335	DD	A	2	Fiberboard	Ceiling Tile	Intact	White	NEG	0.01 ± 0.13
1454	1454	SF335	DD	A Center	2	Metal	Ceiling Tile Grid	Intact	White	NEG	0.00 ± 0.14
1455	1455	SF335	DD	A Right	2	Metal	Door	Intact	Brown	NEG	0.13 ± 0.32
1456	1456	SF335	DD	A Right	2	Wood	L Door Jamb	Intact	White	NEG	0.01 ± 0.20
1457	1457	SF335	DD	A Center	2	Metal	Window Sill	Intact	White	NEG	0.02 ± 0.05
1458	1458	SF335	DD	D Center	2	Wood	Closet Door	Intact	Stain	NEG	0.00 ± 0.02
1459	1459	SF335	DD	D Center	2	Wood	Closet Door Casing	Intact	White	NEG	0.00 ± 0.10
1460	1460	SF335	DD	A	3	Wood	Wall	Intact	White	NEG	0.00 ± 0.02
1461	1461	SF335	DD	C	3	Wood	Wall	Intact	White	NEG	0.00 ± 0.02
1462	1462	SF335	DD	D	3	Wood	Wall	Intact	White	NEG	0.00 ± 0.02
1463	1463	SF335	DD	D	3	Fiberboard	Ceiling Tile	Intact	White	NEG	-0.53 ± 0.82
1464	1464	SF335	DD	D Left	3	Metal	Ceiling Tile Grid	Intact	White	NEG	0.00 ± 0.01
1465	1465	SF335	DD	D Center	3	Wood	Door	Intact	Stain	NEG	0.00 ± 0.16
1466	1466	SF335	DD	D Center	3	Wood	L Door Jamb	Intact	White	NEG	0.00 ± 0.06
1467	1467	SF335	DD	A	10	Wood	Wall	Intact	White	NEG	0.01 ± 0.23
1468	1468	SF335	DD	B	10	Wood	Wall	Intact	White	NEG	0.02 ± 0.28
1469	1469	SF335	DD	C	10	Wood	Wall	Intact	White	NEG	0.04 ± 0.11
1470	1470	SF335	DD	D	10	Drywall	Wall	Intact	White	NEG	0.00 ± 0.10
1471	1471	SF335	DD	C	10	Fiberboard	Ceiling Tile	Intact	White	NEG	0.02 ± 0.10
1472	1472	SF335	DD	C Left	10	Metal	Ceiling Tile Grid	Intact	White	NEG	0.00 ± 0.15
1473	1473	SF335	DD	D Center	10	Wood	Closet Door	Intact	Stain	NEG	0.01 ± 0.10
1474	1474	SF335	DD	D Center	10	Wood	Closet Door Casing	Intact	White	NEG	0.00 ± 0.12
1475	1475	SF335	DD	D Center	10	Wood	Closet Shelf	Intact	White	NEG	0.00 ± 0.14
1476	1476	SF335	DD	D Center	10	Wood	Closet Shelf Support	Intact	White	NEG	0.00 ± 0.13
1477	1477	SF335	DD	D Center	10	Wood	Electrical Box Frame	Intact	White	NEG	0.00 ± 0.12
1478	1478	SF335	DD	B	9	Wood	Wall	Intact	White	NEG	0.08 ± 0.22
1479	1479	SF335	DD	C	9	Wood	Wall	Intact	White	NEG	0.00 ± 0.21
1480	1480	SF335	DD	D	9	Wood	Wall	Intact	White	NEG	0.00 ± 0.02
1481	1481	SF335	DD	A Center	9	Metal	Door	Intact	Brown	NEG	0.04 ± 0.04
1482	1482	SF335	DD	A Center	9	Wood	R Door Casing	Intact	White	NEG	0.06 ± 0.24
1483	1483	SF335	DD	C	9	Fiberboard	Ceiling Tile	Intact	White	NEG	0.12 ± 0.66
1484	1484	SF335	DD	C Center	9	Metal	Ceiling Tile Grid	Intact	White	NEG	0.01 ± 0.24
1485	1485	SF335	DD	B Right	9	Wood	Closet Door	Intact	Stain	NEG	0.00 ± 0.02
1486	1486	SF335	DD	B Right	9	Wood	Closet Door Casing	Intact	White	NEG	0.00 ± 0.12
1487	1487	SF335	DD	B Right	9	Wood	Closet Shelf	Intact	White	NEG	0.03 ± 0.13
1488	1488	SF335	DD	B Right	9	Wood	Closet Shelf Support	Intact	White	NEG	0.00 ± 0.02
1489	1489	SF335	DD	A	7	Wood	Wall	Intact	White	NEG	0.36 ± 0.33
1490	1490	SF335	DD	B	7	Wood	Wall	Intact	White	NEG	0.00 ± 0.02
1491	1491	SF335	DD	C	7	Wood	Wall	Intact	White	NEG	0.12 ± 0.34
1492	1492	SF335	DD		7		NULL			INCOM	0.12 ± 0.33
1493	1493	SF335	DD	D	7	Wood	Wall	Intact	White	NEG	0.01 ± 0.02
1494	1494	SF335	DD	A	7	Fiberboard	Ceiling Tile	Intact	White	NEG	0.03 ± 0.76
1495	1495	SF335	DD	A Center	7	Metal	Ceiling Tile Grid	Intact	White	NEG	0.00 ± 0.01
1496	1496	SF335	DD	A Center	7	Wood	Door	Intact	Stain	NEG	0.00 ± 0.11
1497	1497	SF335	DD	A Center	7	Wood	R Door Casing	Intact	White	NEG	0.00 ± 0.02
1498	1498	SF335	DD	A	6	Wood	Wall	Intact	White	NEG	0.05 ± 0.29
1499	1499	SF335	DD	B	6	Wood	Wall	Intact	White	NEG	0.01 ± 0.32
1500	1500	SF335	DD	C	6	Wood	Wall	Intact	White	NEG	0.01 ± 0.35
1501	1501	SF335	DD	D	6	Wood	Wall	Intact	White	NEG	0.01 ± 0.03
1502	1502	SF335	DD	A	6	Fiberboard	Ceiling Tile	Intact	White	NEG	0.00 ± 0.01
1503	1503	SF335	DD	A Center	6	Metal	Ceiling Tile Grid	Intact	White	NEG	0.01 ± 0.21
1504	1504	SF335	DD	A Center	6	Wood	Door	Intact	Stain	NEG	0.00 ± 0.02
1505	1505	SF335	DD	A Center	6	Wood	L Door Casing	Intact	White	NEG	0.00 ± 0.15

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
1506	1506	SF335	DD	A	12	Wood	Wall	Intact	White	NEG	0.09 ± 0.23
1507	1507	SF335	DD	B	12	Wood	Wall	Intact	White	NEG	0.00 ± 0.02
1508	1508	SF335	DD	C	12	Wood	Wall	Intact	White	NEG	0.06 ± 0.40
1509	1509	SF335	DD	D	12	Wood	Wall	Intact	White	NEG	0.12 ± 0.32
1510	1510	SF335	DD	A	12	Fiberboard	Ceiling Tile	Intact	White	NEG	0.00 ± 0.01
1511	1511	SF335	DD	A Center	12	Metal	Ceiling Tile Grid	Intact	White	NEG	0.00 ± 0.01
1512	1512	SF335	DD	A Center	12	Metal	Window Sill	Intact	White	NEG	0.21 ± 0.79
1513	1513	SF335	DD	A	Ext A	Metal	Siding	Intact	Beige	NEG	0.07 ± 0.37
1514	1514	SF335	DD	A Right	Ext A	Metal	Door	Intact	Brown	NEG	0.07 ± 0.43
1515	1515	SF335	DD	A Right	Ext A	Metal	L Door Casing	Intact	Brown	NEG	0.01 ± 0.25
1516	1516	SF335	DD	A Right	Ext A	Metal	Railing Cap	Intact	Brown	NEG	0.00 ± 0.13
1517	1517	SF335	DD	A Right	Ext A	Metal	Stringer	Intact	Brown	NEG	0.11 ± 0.29
1518	1518	SF335	DD	A	Ext A	Concrete	Foundation	Intact	Beige	NEG	0.04 ± 0.15
1519	1519	SF335	DD	A Center	Ext A	Metal	Cabana Post	Intact	Brown	NEG	0.00 ± 0.10
1520	1520	SF335	DD	A Center	Ext A	Metal	Canopy	Intact	White	NEG	0.02 ± 0.12
1521	1521	SF335	DD	A Center	Ext A	Metal	Electric Pipe	Intact	Beige	NEG	0.08 ± 0.24
1522	**1522**	**SF335**	**DD**	**A Center**	**Ext A**	**Metal**	**Gas Meter**	**Intact**	**Gray**	**POS**	**1.73 ± 0.69**
1523	1523	SF335	DD	A Right	Ext A	Metal	R Window Casing	Intact	Brown	NEG	0.39 ± 0.34
1524	1524	SF335	DD	B	Ext B	Metal	Siding	Intact	Beige	NEG	0.01 ± 0.03
1525	1525	SF335	DD	B Center	Ext B	Metal	HVAC	Intact	Beige	NEG	0.01 ± 0.12
1526	1526	SF335	DD	B Right	Ext B	Metal	Electric Box	Intact	Beige	NEG	0.00 ± 0.09
1527	1527	SF335	DD	B Right	Ext B	Metal	Conduit	Intact	Beige	NEG	0.05 ± 0.23
1528	1528	SF335		B Right	Ext B	Metal	HVAC Fan Unit	Intact	Gray	NEG	0.01 ± 0.12
1529	1529	SF335		C	Ext C	Metal	Siding	Intact	Beige	NEG	0.01 ± 0.22
1530	1530	SF335		D	Ext D	Metal	Siding	Intact	Beige	NEG	0.00 ± 0.02
1531	1531	SF335		D Center	Ext D	Metal	Electric Box	Intact	Beige	NEG	0.05 ± 0.31
1532	1532	SF335		D Center	Ext D	Metal	Electric Box Brace	Intact	Beige	NEG	0.23 ± 0.32
1533	**1533**	**SF335**					**Calibrate**			**POS**	**1.12 ± 0.14**
1534	**1534**	**SF335**					**Calibrate**			**POS**	**1.10 ± 0.10**
1535	**1535**	**SF335**					**Calibrate**			**POS**	**1.20 ± 0.15**

Serial #XL309-U3987NR6814 Site: Date: 12/20/2006

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
1249	**1249**	**SF336**	**SN**				**Calibrate**			**1.0**	**POS**	**1.19 ± 0.12**
1250	**1250**	**SF336**	**SN**				**Calibrate**			**1.0**	**POS**	**1.15 ± 0.10**
1251	**1251**	**SF336**	**SN**				**Calibrate**			**1.0**	**POS**	**1.21 ± 0.18**
1252	1252	SF336	SN	A	1	Wood	Wall	Intact	White	2.4	NEG	0.09 ± 0.39
1253	1253	SF336	SN	B	1	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
1254	1254	SF336	SN	C Right	1	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.07
1255	1255	SF336	SN	D Left	1	Wood	Wall	Intact	White	1.5	NEG	0.10 ± 0.28
1256	1256	SF336	SN	C Right	1	Metal	Ceiling Grid	Intact	White	3.3	NEG	0.05 ± 0.30
1257	1257	SF336	SN	C Right	1	Fiberboard	Ceiling Tile	Intact	White	2.1	NEG	-0.11 ± 0.78
1258	1258	SF336	SN	C Center	1	Wood	R Door Casing	Intact	White	1.0	NEG	0.00 ± 0.20
1259	1259	SF336	SN	C Center	1	Wood	R Door Jamb	Intact	White	1.0	NEG	0.00 ± 0.02
1260	1260	SF336	SN	C Center	1	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
1261	1261	SF336	SN	C	2	Wood	Wall	Intact	White	1.0	NEG	0.03 ± 0.09
1262	1262	SF336	SN	D Right	2	Wood	Wall	Intact	White	1.0	NEG	0.05 ± 0.09
1263	1263	SF336	SN	A Left	2	Wood	Wall	Intact	White	1.0	NEG	0.06 ± 0.16
1264	1264	SF336	SN	B Left	2	Wood	Wall	Intact	White	1.0	NEG	0.05 ± 0.07
1265	1265	SF336	SN	C Center	2	Metal	Ceiling Grid	Intact	White	1.2	NEG	0.01 ± 0.20
1266	1266	SF336	SN	C Center	2	Fiberboard	Ceiling Tile	Intact	White	10.0	NEG	-0.02 ± 0.73
1267	1267	SF336	SN	A Center	2	Metal	Window Sill	Intact	White	6.3	NEG	0.09 ± 0.25
1268	1268	SF336	SN	D Right	2	Metal	Urinal Divider	Intact	Peach	1.2	NEG	0.24 ± 0.26
1269	1269	SF336	SN	C Center	2	Wood	L Door Casing	Intact	White	1.0	NEG	0.00 ± 0.08
1270	1270	SF336	SN	C Center	2	Wood	L Door Jamb	Intact	White	1.0	NEG	0.00 ± 0.12
1271	1271	SF336	SN	C Center	2	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
1272	1272	SF336	SN	C	3	Wood	Wall	Intact	White	3.2	NEG	0.17 ± 0.41
1273	1273	SF336	SN	D Left	3	Wood	Wall	Intact	White	1.8	NEG	0.14 ± 0.36
1274	1274	SF336	SN	A Left	3	Wood	Wall	Intact	White	1.5	NEG	0.12 ± 0.29
1275	1275	SF336	SN	B Left	3	Wood	Wall	Intact	White	4.4	NEG	0.31 ± 0.45
1276	1276	SF336	SN	A Center	3	Metal	Ceiling Grid	Intact	White	1.6	NEG	0.01 ± 0.20
1277	1277	SF336	SN	A Center	3	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	0.11 ± 0.68
1278	1278	SF336	SN	A Center	3	Metal	Window Sill	Intact	White	1.6	NEG	0.03 ± 0.33
1279	1279	SF336	SN	C Right	3	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
1280	1280	SF336	SN	C Right	3	Wood	Door Header	Intact	White	1.0	NEG	0.00 ± 0.12
1281	1281	SF336	SN	C Right	3	Wood	R Door Jamb	Intact	White	1.0	NEG	0.00 ± 0.02
1282	1282	SF336	SN	C	4	Drywall	Wall	Intact	White	2.1	NEG	0.08 ± 0.34
1283	1283	SF336	SN	D	4	Drywall	Wall	Intact	White	1.8	NEG	0.10 ± 0.25
1284	1284	SF336	SN	A Left	4	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.08
1285	1285	SF336	SN	B	4	Wood	Wall	Intact	White	1.0	NEG	0.00 ± 0.11
1286	1286	SF336	SN	C	4	Drywall	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.01
1287	1287	SF336	SN	C Center	4	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
1288	1288	SF336	SN	C Center	4	Wood	L Door Casing	Intact	White	1.0	NEG	0.00 ± 0.15
1289	1289	SF336	SN	C Center	4	Wood	L Door Jamb	Intact	White	1.0	NEG	0.00 ± 0.12
1290	1290	SF336	SN	B Center	4	Wood	Shelf	Intact	Beige	2.0	NEG	0.02 ± 0.05
1291	1291	SF336	SN	D Center	4	Metal	Pipe Sink	Intact	White	2.0	NEG	0.14 ± 0.21
1292	1292	SF336	SN	D Center	4	Wood	Corner Molding	Intact	White	1.0	NEG	0.00 ± 0.10
1293	1293	SF336	SN	B Right	4	Wood	Crown Molding	Intact	White	1.0	NEG	0.00 ± 0.02
1294	1294	SF336	SN	A	5	Wood	Wall	Intact	White	3.1	NEG	0.14 ± 0.28
1295	1295	SF336	SN	B Left	5	Wood	Wall	Intact	White	1.4	NEG	0.04 ± 0.43
1296	1296	SF336	SN	C	5	Wood	Wall	Intact	White	5.4	NEG	0.25 ± 0.52
1297	1297	SF336	SN	D Left	5	Wood	Wall	Intact	White	9.5	NEG	0.46 ± 0.40
1298	1298	SF336	SN	B Center	5	Metal	Ceiling Grid	Intact	White	4.3	NEG	0.05 ± 0.20
1299	1299	SF336	SN	B Center	5	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.01
1300	1300	SF336	SN	D Right	5	Metal	Door	Intact	Brown	3.6	NEG	0.07 ± 0.37
1301	1301	SF336	SN	D Right	5	Metal	R Door Jamb	Intact	White	1.0	NEG	0.00 ± 0.06
1302	1302	SF336	SN	A Left	5	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.14
1303	1303	SF336	SN	A Left	5	Wood	Door Frame	Intact	White	1.0	NEG	0.00 ± 0.01
1304	1304	SF336	SN	B Center	5	Metal	Window Sill	Intact	White	1.0	NEG	0.00 ± 0.01
1305	1305	SF336	SN	C Center	5	Wood	Rm Dividing Wall	Intact	White	2.7	NEG	0.13 ± 0.30
1306	1306	SF336	SN	C Right	5	Metal	Vent	Intact	White	1.4	NEG	0.01 ± 0.19
1307	1307	SF336	SN	C Right	5	Wood	Dining Wall Molding	Intact	White	1.0	NEG	0.00 ± 0.02
1308	1308	SF336	SN	A	6	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.08
1309	1309	SF336	SN	B	6	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.11
1310	1310	SF336	SN	C	6	Wood	Wall	Intact	White	1.6	NEG	0.15 ± 0.17
1311	1311	SF336	SN	D	6	Wood	Wall	Intact	White	1.0	NEG	0.06 ± 0.14
1312	1312	SF336	SN	B	6	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.01
1313	1313	SF336	SN	A Center	6	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.13
1314	1314	SF336	SN	A Center	6	Wood	R Door Jamb	Intact	White	1.0	NEG	0.00 ± 0.12
1315	1315	SF336	SN	A Center	6	Wood	R Door Casing	Intact	White	1.0	NEG	0.00 ± 0.20
1316	1316	SF336	SN	A Center	6	Metal	Toe Kick	Intact	White	7.0	NEG	0.12 ± 0.37

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
1317	1317	SF336	SN	A	Ext	Metal	Siding	Intact	Beige	3.6	NEG	0.02 ± 0.10
1318	1318	SF336	SN	A	Ext	Metal	Apron	Intact	Brown	2.1	NEG	0.13 ± 0.36
1319	1319	SF336	SN	A Center	Ext	Metal	Metal Beam	Intact	Beige	2.3	NEG	0.28 ± 0.29
1320	1320	SF336	SN	A	Ext	Concrete	Foundation	Intact	Beige	6.7	NEG	0.04 ± 0.10
1321	1321	SF336	SN	A Center	Ext	Metal	HVAC Duct	Intact	Beige	7.3	NEG	0.13 ± 0.35
1322	1322	SF336	SN	A Center	Ext	Metal	HVAC Unit	Intact	Tan	1.0	NEG	0.01 ± 0.06
1323	1323	SF336	SN	A Left	Ext	Metal	Electrical Box	Intact	Beige	1.1	NEG	0.03 ± 0.34
1324	1324	SF336	SN	A Left	Ext	Metal	Electrical Conduit	Intact	Beige	1.0	NEG	0.00 ± 0.01
1325	1325	SF336	SN	B	Ext	Metal	Siding	Intact	Beige	10.0	NEG	0.15 ± 0.63
1326	1326	SF336	SN	B Center	Ext	Metal	Riser Support	Intact	Beige	1.0	NEG	0.02 ± 0.05
1327	1327	SF336	SN	B	Ext	Metal	Risers	Intact	Brown	2.0	NEG	0.02 ± 0.21
1328	1328	SF336	SN	B	Ext	Metal	Balusters	Intact	Brown	1.0	NEG	0.00 ± 0.10
1329	1329	SF336	SN	B Center	Ext	Metal	Porch Post	Intact	Brown	1.0	NEG	0.00 ± 0.03
1330	1330	SF336	SN	B Center	Ext	Metal	Porch Ceiling	Intact	White	1.0	NEG	0.01 ± 0.02
1331	1331	SF336	SN	B	Ext	Metal	Door	Intact	Brown	4.0	NEG	0.04 ± 0.23
1332	1332	SF336	SN	B	Ext	Metal	R Door Casing	Intact	Brown	7.7	NEG	0.12 ± 0.19
1333	1333	SF336	SN	B Center	Ext	Concrete	Foundation Pad	Intact	Beige	3.2	NEG	0.01 ± 0.03
1334	1334	SF336	SN	B Right	Ext	Metal	Gas Pipe	Intact	White	3.9	NEG	0.10 ± 0.39
1335	1335	SF336	SN	B Right	Ext	Metal	Gas Gage	Intact	Gray	3.7	NEG	-0.06 ± 0.77
1336	1336	SF336	SN	C	Ext	Metal	Siding	Intact	Beige	4.3	NEG	0.04 ± 0.13
1337	1337	SF336	SN	D	Ext	Metal	Siding	Intact	Beige	3.4	NEG	0.03 ± 0.11
1338	**1338**	**SF336**					**Calibrate**			**1.0**	**POS**	**1.09 ± 0.08**
1339	**1339**	**SF336**					**Calibrate**			**1.0**	**POS**	**1.12 ± 0.09**
1340	**1340**	**SF336**					**Calibrate**			**1.0**	**POS**	**1.18 ± 0.15**

Serial #XL309-U3987NR6814 Site: Date: 12/12/2006 to 12/14/2006

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
1	1	SF2000	JM				Calibration	Intact		0.0	...	NA
2	**2**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.0**	**POS**	**1.13 ± 0.09**
3	**3**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.1**	**POS**	**1.32 ± 0.20**
4	**4**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.0**	**POS**	**1.13 ± 0.11**
5	5	SF2000	JM	A	312	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.08
6	6	SF2000	JM	B	312	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
7	7	SF2000	JM	C	312	Drywall	Wall	Intact	White	1.0	NEG	-0.95 ± 1.07
8	8	SF2000	JM	D	312	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
9	9	SF2000	JM	B	312	Fiberboard	Ceiling	Intact	White	6.9	NEG	0.03 ± 0.09
10	10	SF2000	JM	B	312	Metal	Grid	Intact	White	1.0	NEG	0.00 ± 0.09
11	11	SF2000	JM	B Center	312	Metal	Door Header	Intact	Brown	1.0	NEG	0.00 ± 0.08
12	12	SF2000	JM	B Center	312	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
13	13	SF2000	JM	A	330	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.08
14	14	SF2000	JM	A Center	330	Metal	Door Header	Intact	Brown	1.0	NEG	0.00 ± 0.15
15	15	SF2000	JM	A Center	330	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
16	16	SF2000	JM	A	316	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
17	17	SF2000	JM	B	316	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.12
18	18	SF2000	JM	C	316	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
19	19	SF2000	JM	D	316	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
20	20	SF2000	JM	A	316	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
21	21	SF2000	JM	A Center	316	Metal	Shelf	Intact	Orange	1.0	NEG	0.49 ± 0.20
22	22	SF2000	JM	C	316	Metal	Door Header	Intact	Brown	1.0	NEG	0.01 ± 0.20
23	23	SF2000	JM	C	316	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.15
24	24	SF2000	JM	A	326	Drywall	Wall	Intact	White	1.7	NEG	0.01 ± 0.14
25	25	SF2000	JM	B	326	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.07
26	26	SF2000	JM	C	326	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
27	27	SF2000	JM	D	326	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.08
28	28	SF2000	JM	D	326	Fiberbaord	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.08
29	29	SF2000	JM	C Left	326	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.00 ± 0.12
30	30	SF2000	JM	B Center	326	Metal	Door Header	Intact	Brown	4.0	NEG	0.05 ± 0.24
31	31	SF2000	JM	B Center	326	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.01
32	32	SF2000	JM	A	05	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
33	33	SF2000	JM	B	05	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.09
34	34	SF2000	JM	C	05	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.09
35	35	SF2000	JM	D	05	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
36	36	SF2000	JM	A	05	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.10
37	37	SF2000	JM	C Center	05	Metal	Door Header	Intact	Gray	1.0	NEG	0.01 ± 0.03
38	38	SF2000	JM	C Center	05	Metal	Door	Intact	Gray	1.8	NEG	0.01 ± 0.21
39	39	SF2000	JM	B	G-1	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.11
40	40	SF2000	JM	C	G-1	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
41	41	SF2000	JM	D	G-1	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
42	42	SF2000	JM	A	G-1	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.09
43	43	SF2000	JM	C Right	G-1	Wood	Stairs	Intact	Red	1.0	NEG	0.00 ± 0.13
44	44	SF2000	JM	C Right	G-1	Wood	Stair Ramp	Intact	Red	1.0	NEG	0.00 ± 0.13
45	**45**	**SF2000**	**JM**	**D Left**	**G-1**	**Metal**	**Ladder**	**Intact**	**Orange**	**1.2**	**POS**	**1.99 ± 0.46**
46	46	SF2000	JM	D Left	G-1	Metal	Roof Hatch	Intact	Orange	10.0	NEG	0.24 ± 0.65
47	47	SF2000	JM	C Center	G-1	Metal	Door Header	Intact	Gray	1.3	NEG	0.02 ± 0.35
48	48	SF2000	JM	C Center	G-1	Metal	Door	Intact	Gray	2.1	NEG	0.04 ± 0.35
49	49	SF2000	JM	A	294	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.11
50	50	SF2000	JM	B	294	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
51	51	SF2000	JM	C	294	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
52	52	SF2000	JM	D	294	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
53	53	SF2000	JM	C	294	Fiberboard	Ceiling	Intact	White	10.0	NEG	0.09 ± 0.69
54	54	SF2000	JM	C Center	294	Metal	Ceiling Grid	Intact	White	1.5	NEG	0.01 ± 0.20
55	55	SF2000	JM	C Center	294	Wood	Cabinet	Intact	Stained	1.0	NEG	0.00 ± 0.14
56	56	SF2000	JM	A Left	294	Metal	Door Header	Intact	Brown	2.9	NEG	0.03 ± 0.22
57	57	SF2000	JM	A Left	294	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
58	58	SF2000	JM	A	298	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.13
59	59	SF2000	JM	B	298	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
60	60	SF2000	JM	C	298	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
61	61	SF2000	JM	D	298	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
62	62	SF2000	JM	A	298	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
63	63	SF2000	JM	A Center	298	Metal	Door Header	Intact	Brown	5.0	NEG	0.07 ± 0.28
64	64	SF2000	JM	A Center	298	Wood	L Door Casing	Intact	Stained	1.0	NEG	0.00 ± 0.02

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
65	65	SF2000	JM	A	284	Drywall	Wall	Intact	White	1.6	NEG	0.01 ± 0.14
66	66	SF2000	JM	B	284	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
67	67	SF2000	JM	C	284	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.08
68	68	SF2000	JM	D	284	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
69	69	SF2000	JM	A	284	Fiberboard	Ceiling	Intact	White	1.3	NEG	0.00 ± 0.01
70	70	SF2000	JM	C	284	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.00 ± 0.10
71	71	SF2000	JM	B left	284	Metal	Door Header	Intact	Brown	1.0	NEG	0.00 ± 0.01
72	72	SF2000	JM	B Left	284	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
73	73	SF2000	JM	A Left	284	Metal	Door window Casing	Intact	Green	1.2	NEG	0.04 ± 0.11
74	74	SF2000	JM	A	282	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
75	75	SF2000	JM	B	282	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.12
76	76	SF2000	JM	C	282	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.10
77	77	SF2000	JM	D	282	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
78	78	SF2000	JM	B	282	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.09
79	79	SF2000	JM	B Center	282	Metal	Door Header	Intact	Brown	1.6	NEG	0.01 ± 0.20
80	80	SF2000	JM	B Center	282	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
81	81	SF2000	JM	B Center	282	Metal	Door Window Casing	Intact	Green	1.4	NEG	0.04 ± 0.14
82	82	SF2000	JM	A	277	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.11
83	83	SF2000	JM	B	277	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
84	84	SF2000	JM	C	277	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.12
85	85	SF2000	JM	D	277	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
86	86	SF2000	JM	A	277	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.01
87	87	SF2000	JM	D Center	277	Metal	Door Header	Intact	Orange	1.6	NEG	0.02 ± 0.24
88	88	SF2000	JM	D Center	277	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
89	89	SF2000	JM	A	256	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.09
90	90	SF2000	JM	B	256	Drywall	Wall	Intact	White	2.5	NEG	0.02 ± 0.18
91	91	SF2000	JM	C	256	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
92	92	SF2000	JM	D	256	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.10
93	93	SF2000	JM	D	256	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.08
94	94	SF2000	JM	A Right	256	Wood	Bumper	Intact	Stained	1.0	NEG	0.00 ± 0.02
95	95	SF2000	JM	C Right	256	Wood	Cabinet Door	Intact	Stained	1.0	NEG	0.00 ± 0.01
96	96	SF2000	JM	B Right	256	Wood	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.07
97	97	SF2000	JM	B Right	256	Metal	Ceiling Tile Grid	Intact	White	1.1	NEG	0.01 ± 0.18
98	98	SF2000	JM	B Right	256	Metal	Door Header	Intact	Brown	1.8	NEG	0.01 ± 0.20
99	99	SF2000	JM	B Right	256	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
100	100	SF2000	JM	A	260	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
101	101	SF2000	JM	B	260	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
102	102	SF2000	JM	C	260	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
103	103	SF2000	JM	D	260	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.09
104	104	SF2000	JM	B	260	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.01
105	105	SF2000	JM	C Right	260	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.00 ± 0.07
106	106	SF2000	JM	D Left	260	Metal	Window Sill	Intact	White	1.0	NEG	0.00 ± 0.09
107	107	SF2000	JM	D Right	260	Wood	Closet Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
108	108	SF2000	JM	B Center	260	Metal	Door Header	Intact	Brown	1.0	NEG	0.01 ± 0.18
109	109	SF2000	JM	B Center	260	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
110	**110**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.0**	**POS**	**1.17 ± 0.13**
111	**111**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.0**	**POS**	**1.22 ± 0.15**
112	**112**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.1**	**POS**	**1.33 ± 0.20**
113	113	SF2000	JM				Calibration	Intact		0.0	...	NA
114	**114**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.0**	**POS**	**1.16 ± 0.14**
115	**115**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.1**	**POS**	**1.26 ± 0.19**
116	**116**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.0**	**POS**	**1.16 ± 0.14**
117	117	SF2000	JM	A	271	Drywall	Wall	Intact	Beige	1.0	NEG	0.00 ± 0.01
118	118	SF2000	JM	B	271	Drywall	Wall	Intact	Beige	1.0	NEG	0.00 ± 0.01
119	119	SF2000	JM	C	271	Drywall	Wall	Intact	Beige	1.0	NEG	0.00 ± 0.08
120	120	SF2000	JM	D	271	Drywall	Wall	Intact	Beige	1.0	NEG	-0.21 ± 0.96
121	121	SF2000	JM	C	271	Tile	Ceiling	Intact	White	1.0	NEG	-0.45 ± 0.84
122	122	SF2000	JM	C Right	271	Metal	Ceiling Tile Grid	Intact	White	5.7	NEG	0.05 ± 0.18
123	123	SF2000	JM	A Center	271	Concrete	Bench	Intact	Orange	1.0	NEG	0.00 ± 0.19
124	124	SF2000	JM	A Right	271	Metal	L Door Casing	Intact	Brown	1.0	NEG	0.00 ± 0.09
125	125	SF2000	JM	A Right	271	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.12
126	126	SF2000	JM	D Left	271	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.14
127	127	SF2000	JM	D Left	271	Metal	R Door Casing	Intact	Brown	1.4	NEG	0.01 ± 0.20
128	128	SF2000	JM	C Left	271	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
129	129	SF2000	JM	C Left	271	Metal	Door Window Casing	Intact	Green	1.6	NEG	0.04 ± 0.17

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
130	130	SF2000	JM	C Left	271	Metal	Door Casing	Intact	Brown	1.0	NEG	0.00 ± 0.02
131	131	SF2000	JM	D Right	271	Wood	Window Case Frame	Intact	Beige	1.0	NEG	0.00 ± 0.07
132	132	SF2000	JM	A Right	271A	Drywall	Wall	Intact	Beige	1.0	NEG	-0.40 ± 0.87
133	133	SF2000	JM	B Left	271A	Drywall	Wall	Intact	Beige	1.4	NEG	0.00 ± 0.01
134	134	SF2000	JM	C	271A	Drywall	Wall	Intact	Beige	1.0	NEG	0.00 ± 0.01
135	135	SF2000	JM	D Right	271A	Drywall	Wall	Intact	Beige	7.8	NEG	0.02 ± 0.06
136	136	SF2000	JM	A	271A	Fiberboard	Ceiling Tile	Intact	White	2.1	NEG	0.01 ± 0.02
137	137	SF2000	JM	A Left	271A	Metal	Ceiling Tile Grid	Intact	White	6.0	NEG	0.05 ± 0.21
138	138	SF2000	JM	A Left	271A	Concrete	Bench	Intact	Orange	1.0	NEG	0.00 ± 0.05
139	139	SF2000	JM	A Center	271A	Metal	Window Sill	Intact	White	1.0	NEG	-0.86 ± 1.06
140	140	SF2000	JM	B Left	271A	Wood	Window Case Frame	Intact	Beige	1.0	NEG	0.00 ± 0.16
141	141	SF2000	JM	B Center	271A	Wood	Cabinet Shelf Support	Intact	Beige	1.0	NEG	0.00 ± 0.13
142	142	SF2000	JM	B Center	271A	Wood	Cabinet Shelf	Intact	Beige	1.0	NEG	0.00 ± 0.02
143	143	SF2000	JM	B Left	271A	Metal	Door Case Frame	Intact	Beige	1.0	NEG	0.00 ± 0.08
144	144	SF2000	JM	B Left	271A	Metal	Door Case	Intact	Beige	1.0	NEG	0.00 ± 0.13
145	145	SF2000	JM	A Right	271A	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.10
146	146	SF2000	JM	A Right	271A	Metal	R Door Casing	Intact	Brown	1.0	NEG	0.00 ± 0.09
147	**147**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.0**	**POS**	**0.99 ± 0.08**
148	**148**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.0**	**POS**	**1.03 ± 0.12**
149	**149**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.1**	**POS**	**1.25 ± 0.18**
150	150	SF2000	JM				Calibration	Intact		0.0	...	NA
151	**151**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.0**	**POS**	**1.14 ± 0.11**
152	**152**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.2**	**POS**	**1.42 ± 0.27**
153	**153**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.0**	**POS**	**1.15 ± 0.10**
154	**154**	**SF2000**	**JM**				**Calibration**	**Intact**		**1.0**	**POS**	**1.24 ± 0.19**
155	155	SF2000	JM	A	C-1	Concrete	Wall	Intact	White	5.3	NEG	0.02 ± 0.09
156	156	SF2000	JM	B	C-1	Concrete	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
157	157	SF2000	JM	C	C-1	Concrete	Wall	Intact	White	1.0	NEG	0.00 ± 0.06
158	158	SF2000	JM	D	C-1	Concrete	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
159	159	SF2000	JM	A	C-1	Concrete	Ceiling	Intact	White	6.7	NEG	0.02 ± 0.07
160	160	SF2000	JM	A Center	C-1	Concrete	Beam	Intact	White	4.8	NEG	0.02 ± 0.06
161	**161**	**SF2000**	**JM**	**A Center**	**C-1**	**Metal**	**I-Beam**	**Intact**	**White**	**2.1**	**POS**	**5.10 ± 1.84**
162	162	SF2000	JM	A	C-1	Concrete	Floor	Intact	Lt. Blue	1.0	NEG	0.00 ± 0.12
163	163	SF2000	JM	D Left	C-1	Metal	Pipe	Intact	White	1.8	NEG	0.16 ± 0.30
164	164	SF2000	JM	D Left	C-1	Metal	Pipe Support Stand	Intact	White	1.0	NEG	0.00 ± 0.09
165	165	SF2000	JM	A Center	C-1	Concrete	Water Tank Pad	Intact	Green	6.7	NEG	0.09 ± 0.16
166	166	SF2000	JM	A Center	C-1	Metal	Water Tank	Intact	White	1.3	NEG	0.05 ± 0.20
167	167	SF2000	JM	A Center	C-1	Metal	Ladder	Intact	Orange	1.4	NEG	0.08 ± 0.21
168	168	SF2000	JM	C Center	C-1	Metal	Pipe Valve	Intact	Green	1.0	NEG	0.01 ± 0.17
169	169	SF2000	JM		C-1		NULL			3.1	INCOM	0.13 ± 0.63
170	170	SF2000	JM	D Left	C-1	Metal	UST-Valve	Intact	Orange	1.5	NEG	0.04 ± 0.28
171	171	SF2000	JM	D Right	C-1	Metal	Support Pole	Intact	Red	1.9	NEG	0.04 ± 0.40
172	172	SF2000	JM	B Right	C-1	Metal	L Door Casing	Intact	Gray	1.0	NEG	0.01 ± 0.28
173	173	SF2000	JM	B Right	C-1	Metal	Door	Intact	Gray	2.2	NEG	0.02 ± 0.21
174	174	SF2000	JM	A	P-1	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.09
175	175	SF2000	JM	B Right	P-1	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
176	176	SF2000	JM	C Left	P-1	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
177	177	SF2000	JM	D	P-1	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.08
178	178	SF2000	JM	A	P-1	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.01
179	179	SF2000	JM	A	P-1	Concrete	Floor	Intact	Gray	1.0	NEG	0.00 ± 0.12
180	180	SF2000	JM	A Left	P-1	Concrete	Concrete Pad	Intact	Red	1.0	NEG	0.00 ± 0.01
181	181	SF2000	JM	A Center	P-1	Metal	Pipe	Intact	White	1.0	NEG	0.00 ± 0.11
182	182	SF2000	JM	A Center	P-1	Metal	Duct	Intact	White	2.8	NEG	0.04 ± 0.09
183	**183**	**SF2000**	**JM**	**A Center**	**P-1**	**Metal**	**Pipe Hanger**	**Intact**	**White**	**2.8**	**POS**	**5.10 ± 1.47**
184	184	SF2000	JM	C Center	P-1	Metal	Pipe Flange	Intact	White	1.3	NEG	0.10 ± 0.21
185	185	SF2000	JM	C Center	P-1	Metal	Pipe Support Stand	Intact	White	1.0	NEG	0.01 ± 0.04
186	**186**	**SF2000**	**JM**	**C Center**	**P-1**	**Metal**	**Roof Hatch Stairs**	**Intact**	**Orange**	**1.4**	**POS**	**3.13 ± 0.99**
187	187	SF2000	JM	C Center	P-1	Metal	Roof Hatch Door	Intact	Orange	10.0	NEG	0.07 ± 0.48
188	188	SF2000	JM	C Center	P-1	Metal	Roof Hatch Frame	Intact	Orange	1.0	NEG	0.00 ± 0.01
189	189	SF2000	JM	C Center	P-1	Metal	Valve Control	Intact	Green	1.0	NEG	0.03 ± 0.11
190	190	SF2000	JM	A Center	P-1	Drywall	Column	Intact	White	1.0	NEG	0.00 ± 0.01
191	191	SF2000	JM	C Center	P-1	Metal	Tank	Intact	Red	1.8	NEG	0.02 ± 0.24
192	192	SF2000	JM	D Center	P-1	Metal	Duct Hanger Supprt	Intact	Red	1.0	NEG	0.00 ± 0.10
193	193	SF2000	JM	D Center	P-1	Metal	Conduit Bracket	Intact	White	1.0	NEG	0.00 ± 0.01
194	194	SF2000	JM	A Center	P-1	Metal	Air Handler Blower	Intact	Gray	1.0	NEG	0.01 ± 0.05

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
195	195	SF2000	JM	A Center	P-1	Metal	Electrical Box	Intact	White	10.0	NEG	0.08 ± 0.79
196	196	SF2000	JM	A	149A	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
197	197	SF2000	JM	B	149A	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.08
198	198	SF2000	JM	C	149A	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.11
199	199	SF2000	JM	D	149A	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
200	200	SF2000	JM	A	149A	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.01
201	201	SF2000	JM	A Center	149A	Metal	I-Beam	Intact	White	1.0	NEG	0.00 ± 0.09
202	202	SF2000	JM	A Center	149A	Metal	Pipe hanger	Intact	White	1.0	NEG	0.00 ± 0.09
203	203	SF2000	JM	A Center	149A	Metal	Electrical Conduit	Intact	White	7.8	NEG	0.05 ± 0.29
204	204	SF2000	JM	A Center	149A	Metal	Pipe Valve	Intact	Red	1.0	NEG	0.47 ± 0.25
205	205	SF2000	JM	C Center	149A	Metal	Boiler	Intact	Green	1.0	NEG	0.14 ± 0.12
206	206	SF2000	JM	C Center	149A	Concrete	Boiler Pad	Intact	Red	1.0	NEG	0.00 ± 0.01
207	207	SF2000	JM	C Center	149A	Metal	Pipe	Intact	Blue	1.0	NEG	0.00 ± 0.08
208	208	SF2000	JM	C Center	149A	Metal	Pipe Stand	Intact	Blue	1.0	NEG	0.00 ± 0.09
209	209	SF2000	JM	C Center	149A	Metal	Column	Intact	White	1.0	NEG	0.01 ± 0.18
210	210	SF2000	JM	C Center	149A	Metal	Pipe	Intact	White	1.0	NEG	0.00 ± 0.09
211	211	SF2000	JM	B Center	149A	Metal	Tank	Intact	Red	5.2	NEG	0.31 ± 0.25
212	212	SF2000	JM	D Center	149A	Metal	Cabinet Door Casing	Intact	Brown	1.5	NEG	0.03 ± 0.35
213	213	SF2000	JM	D Center	149A	Metal	Cabinet Door	Intact	Brown	1.0	NEG	0.01 ± 0.22
214	214	SF2000	JM	A Left	149A	Metal	Door Header	Intact	Brown	4.0	NEG	0.07 ± 0.34
215	215	SF2000	JM	A Left	149A	Metal	Door	Intact	Brown	2.7	NEG	0.06 ± 0.40
216	216	SF2000	JM	A	139	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
217	217	SF2000	JM	B	139	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
218	218	SF2000	JM	C	139	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
219	219	SF2000	JM	D	139	Drywall	Wall	Intact	White	1.4	NEG	0.00 ± 0.02
220	220	SF2000	JM	D	139	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.11
221	221	SF2000	JM	D Center	139	Metal	Duct	Intact	White	1.3	NEG	0.02 ± 0.31
222	222	SF2000	JM	C Left	139	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.14
223	223	SF2000	JM	C Left	139	Metal	Door Header	Intact	Brown	1.0	NEG	0.00 ± 0.01
224	224	SF2000	JM	C Right	139	Metal	Door	Intact	Pink	1.0	NEG	0.00 ± 0.06
225	225	SF2000	JM	C Right	139	Metal	Door Casing	Intact	Brown	1.0	NEG	0.00 ± 0.14
226	226	SF2000	JM	A	139 B	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.12
227	227	SF2000	JM	B	139 B	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
228	228	SF2000	JM	C	139 B	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.08
229	229	SF2000	JM	D	139 B	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
230	230	SF2000	JM	D Center	139 B	Drywall	Ceiling Beam	Intact	White	1.0	NEG	-0.88 ± 1.14
231	231	SF2000	JM	D Center	139 B	Fiberboard	Ceiling Tile	Intact	White	10.0	NEG	-0.44 ± 0.90
232	232	SF2000	JM	D Center	139 B	Metal	Ceiling Tile Grid	Intact	White	6.9	NEG	0.11 ± 0.26
233	233	SF2000	JM	B Right	139 B	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.14
234	234	SF2000	JM	B Right	139 B	Metal	Door Header	Intact	Brown	1.4	NEG	0.01 ± 0.23
235	235	SF2000	JM	A	132	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
236	236	SF2000	JM	B	132	Drywall	Wall	Intact	White	3.0	NEG	0.02 ± 0.05
237	237	SF2000	JM	C	132	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.18
238	238	SF2000	JM	D	132	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
239	239	SF2000	JM	B Center	132	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	0.23 ± 0.59
240	240	SF2000	JM	B Center	132	Metal	Ceiling Grid	Intact	White	1.0	NEG	0.00 ± 0.14
241	241	SF2000	JM	B Center	132	Metal	Door Header	Intact	Brown	1.0	NEG	0.00 ± 0.02
242	242	SF2000	JM	B Center	132	Wood	Door	Intact	Stained	1.0	NEG	0.01 ± 0.23
243	243	SF2000	JM	A	400A	Drywall	Wall	Intact	White	1.0	NEG	0.02 ± 0.02
244	244	SF2000	JM	B	400A	Drywall	Wall	Intact	White	1.0	NEG	0.02 ± 0.02
245	245	SF2000	JM	C	400A	Drywall	Wall	Intact	White	1.0	NEG	0.02 ± 0.04
246	246	SF2000	JM	D	400A	Drywall	Wall	Intact	White	1.0	NEG	0.02 ± 0.01
247	247	SF2000	JM	A Center	400A	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.01
248	248	SF2000	JM	A Center	400A	Metal	Ceiling Tile Grid	Intact	White	2.4	NEG	0.02 ± 0.22
249	249	SF2000	JM	A Center	400A	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
250	250	SF2000	JM	A Center	400A	Metal	Door Header	Intact	Brown	1.0	NEG	0.00 ± 0.15
251	251	SF2000	JM	A Right	400A	Metal	Window Frame	Intact	Brown	5.6	NEG	0.09 ± 0.27
252	252	SF2000	JM	D	121	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
253	253	SF2000	JM	A	121	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.08
254	254	SF2000	JM	B	121	Drywall	Wall	Intact	White	7.7	NEG	0.07 ± 0.16
255	255	SF2000	JM	C	121	Drywall	Wall	Intact	White	1.9	NEG	0.01 ± 0.23
256	256	SF2000	JM	D Center	121	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.01
257	257	SF2000	JM	D Center	121	Metal	Ceiling Tile Grid	Intact	White	4.1	NEG	0.05 ± 0.24
258	258	SF2000	JM	B Center	121	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
259	259	SF2000	JM	B Center	121	Metal	L Door Jamb	Intact	Brown	1.0	NEG	0.00 ± 0.04

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
260	260	SF2000	JM	C Center	121	Metal	Window	Intact	Brown	1.7	NEG	0.02 ± 0.23
261	261	SF2000	JM	A	121E	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.07
262	262	SF2000	JM	B	121E	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
263	263	SF2000	JM	C	121E	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
264	264	SF2000	JM	D	121E	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
265	265	SF2000	JM	B Center	121E	Wood	Crown Molding	Intact	White	1.0	NEG	0.00 ± 0.09
266	266	SF2000	JM	B Center	121E	Fiberboard	Ceiling Tile	Intact	White	5.4	NEG	0.04 ± 0.08
267	267	SF2000	JM	B Center	121E	Metal	Ceiling Tile Grid	Intact	White	1.3	NEG	0.01 ± 0.19
268	268	SF2000	JM	A Center	121E	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.13
269	269	SF2000	JM	A Center	121E	Metal	R Door Casing	Intact	Brown	1.0	NEG	0.01 ± 0.17
270	270	SF2000	JM	A	196	Drywall	Wall	Intact	White	2.1	NEG	0.07 ± 0.15
271	271	SF2000	JM	B	196	Drywall	Wall	Intact	White	1.7	NEG	0.31 ± 0.13
272	272	SF2000	JM	C	196	Drywall	Wall	Intact	White	1.0	NEG	0.01 ± 0.01
273	273	SF2000	JM	D	196	Drywall	Wall	Intact	White	10.0	NEG	-0.21 ± 0.79
274	274	SF2000	JM	A Left	196	Fiberboard	Ceiling Tile	Intact	White	1.5	NEG	0.01 ± 0.20
275	275	SF2000	JM	A Left	196	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.01 ± 0.20
276	276	SF2000	JM	A Center	196	Metal	Door Jamb	Intact	Brown	1.0	NEG	0.01 ± 0.18
277	277	SF2000	JM	D Center	196	Wood	Wall Trim	Intact	Stained	1.0	NEG	0.00 ± 0.16
278	278	SF2000	JM	D Center	196	Metal	Window Casing	Intact	Brown	1.0	NEG	0.00 ± 0.08
279	279	SF2000	JM	A	178	Drywall	Wall	Intact	White	1.9	NEG	0.01 ± 0.02
280	280	SF2000	JM	B	178	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
281	281	SF2000	JM	C	178	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
282	282	SF2000	JM	D	178	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
283	283	SF2000	JM	A Right	178	Fiberboard	Ceiling Tile	Intact	White	10.0	NEG	0.32 ± 0.48
284	284	SF2000	JM	A Right	178	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.00 ± 0.14
285	285	SF2000	JM	B Left	178	Wood	Door	Intact	Stained	1.0	NEG	0.00 ± 0.02
286	286	SF2000	JM	B Left	178	Metal	R Door Casing	Intact	Brown	1.0	NEG	0.01 ± 0.17
287	287	SF2000	JM	A Left	172	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
288	288	SF2000	JM	B	172	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.09
289	289	SF2000	JM	C	172	Drywall	Wall	Intact	White	1.6	NEG	0.01 ± 0.03
290	290	SF2000	JM	D	172	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
291	291	SF2000	JM	B Center	172	Metal	Electircal Conduit	Intact	White	4.9	NEG	0.07 ± 0.16
292	292	SF2000	JM				NULL			10.0	INCOM	0.12 ± 0.53
293	293	SF2000	JM	B Center	172	Metal	Electrical Box	Intact	White	10.0	NEG	0.15 ± 0.82
294	294	SF2000	JM	A	200C	Drywall	Wall	Intact	White	1.9	NEG	0.51 ± 0.21
295	295	SF2000	JM	B	200C	Drywall	Wall	Intact	White	1.0	NEG	0.02 ± 0.07
296	296	SF2000	JM	C	200C	Drywall	Wall	Intact	White	1.0	NEG	0.01 ± 0.07
297	297	SF2000	JM	D	200C	Drywall	Wall	Intact	White	1.0	NEG	0.02 ± 0.02
298	298	SF2000	JM	A Center	200C	Fiberboard	Ceiling Tile	Intact	White	1.4	NEG	0.01 ± 0.13
299	299	SF2000	JM	A Center	200C	Metal	Ceiling Grid	Intact	White	1.4	NEG	0.01 ± 0.20
300	300	SF2000	JM	A Center	200C	Metal	Window Sill	Intact	Brown	1.0	NEG	0.01 ± 0.28
301	301	SF2000	JM	D Right	200C	Metal	Door	Intact	Beige	1.0	NEG	0.00 ± 0.16
302	302	SF2000	JM	D Right	200C	Metal	Door Casing	Intact	Brown	1.0	NEG	0.00 ± 0.01
303	303	SF2000	JM	B Center	200C	Metal	Door	Intact	Beige	1.0	NEG	0.00 ± 0.07
304	304	SF2000	JM	B Center	200C	Metal	Door header	Intact	Brown	6.7	NEG	0.10 ± 0.24
305	305	SF2000	JM	C Left	200C	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.12
306	306	SF2000	JM	C Left	200C	Metal	Door Casing	Intact	Brown	1.0	NEG	0.00 ± 0.12
307	307	SF2000	JM	A	210	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.08
308	308	SF2000	JM	B	210	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
309	309	SF2000	JM	C	210	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.07
310	310	SF2000	JM	D	210	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.11
311	311	SF2000	JM	C	210	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.01
312	312	SF2000	JM	C Right	210	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
313	313	SF2000	JM	C Right	210	Metal	R Door Casing	Intact	Brown	1.0	NEG	0.00 ± 0.07
314	314	SF2000	JM	B Left	210	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
315	315	SF2000	JM	B Left	210	Metal	Door Casing	Intact	Brown	1.6	NEG	0.04 ± 0.31
316	316	SF2000	JM	C Center	210	Wood	Window Sill	Intact	White	2.8	NEG	0.03 ± 0.22
317	317	SF2000	JM	A	203	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
318	318	SF2000	JM	B	203	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
319	319	SF2000	JM	C	203	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.00
320	320	SF2000	JM	D	203	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
321	321	SF2000	JM	C	203	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.01
322	322	SF2000	JM	C Right	203	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
323	323	SF2000	JM	C Right	203	Metal	R Door Casing	Intact	Brown	1.0	NEG	0.00 ± 0.09
324	324	SF2000	JM	A	201	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.07

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
325	325	SF2000	JM	B	201	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
326	326	SF2000	JM	C	201	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
327	327	SF2000	JM	D	201	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.08
328	328	SF2000	JM	D	201	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
329	329	SF2000	JM	C Left	201	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
330	330	SF2000	JM	C Left	201	Metal	R Door Casing	Intact	Brown	1.0	NEG	0.01 ± 0.18
331	331	SF2000	JM	A	202	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
332	332	SF2000	JM	B	202	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
333	333	SF2000	JM	C	202	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.09
334	334	SF2000	JM	D	202	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.11
335	335	SF2000	JM	C	202	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.01
336	336	SF2000	JM	A Right	202	Wood	Door	Intact	Varnish	2.0	NEG	0.02 ± 0.27
337	337	SF2000	JM	A Right	202	Metal	L Door Casing	Intact	Brown	1.0	NEG	0.01 ± 0.19
338	338	SF2000	JM	D Right	202	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
339	339	SF2000	JM	D Right	202	Metal	Door Casing	Intact	Brown	4.1	NEG	0.05 ± 0.24
340	340	SF2000	JM	B Left	202	Wood	Window Sill	Intact	White	1.0	NEG	0.00 ± 0.12
341	341	SF2000	JM	A	242	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.11
342	342	SF2000	JM	B	242	Drywall	Wall	Intact	White	2.5	NEG	0.01 ± 0.04
343	343	SF2000	JM	C	242	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
344	344	SF2000	JM	D	242	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.11
345	345	SF2000	JM	D Center	242	Fiberboard	Ceiling Tile	Intact	White	2.9	NEG	-0.72 ± 0.81
346	346	SF2000	JM	D Center	242	Metal	Ceiling Grid	Intact	White	2.0	NEG	0.02 ± 0.21
347	347	SF2000	JM	A Left	242	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
348	348	SF2000	JM	A Left	242	Metal	R Door Casing	Intact	Brown	1.0	NEG	0.00 ± 0.16
349	349	SF2000	JM	A Right	242	Metal	Window Sill	Intact	Brown	1.0	NEG	0.00 ± 0.10
350	350	SF2000	JM	C Right	242	Wood	Window Sill	Intact	White	1.0	NEG	0.00 ± 0.01
351	351	SF2000	JM	A	238	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
352	352	SF2000	JM	B	238	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
353	353	SF2000	JM	C	238	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
354	354	SF2000	JM	D	238	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
355	355	SF2000	JM	B	238	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.01
356	356	SF2000	JM	A Center	238	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
357	357	SF2000	JM	A Center	238	Metal	R Door Casing	Intact	Brown	1.0	NEG	0.00 ± 0.15
358	358	SF2000	JM	A Left	238	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
359	359	SF2000	JM	A Left	238	Metal	Door Frame	Intact	Brown	1.0	NEG	0.01 ± 0.15
360	360	SF2000	JM	C Left	238	Wood	Window Sill	Intact	White	1.0	NEG	0.00 ± 0.13
361	361	SF2000	JM	A	212	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
362	362	SF2000	JM	B	212	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
363	363	SF2000	JM	C	212	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
364	364	SF2000	JM	A	212	Drywall	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.01
365	365	SF2000	JM	A Left	212	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.13
366	366	SF2000	JM	A left	212	Metal	L Door Casing	Intact	Brown	2.5	NEG	0.03 ± 0.29
367	367	SF2000	JM	C Center	212	Wood	Window Sill	Intact	White	1.1	NEG	0.01 ± 0.18
368	368	SF2000	JM	D Right	212	Wood	Door	Intact	Varnish	1.0	NEG	0.00 ± 0.02
369	369	SF2000	JM	D right	212	Wood	Door Frame	Intact	White	3.0	NEG	0.03 ± 0.23
370	370	SF2000	JM	D	212	Drywall	Wall	Intact	White	1.0	NEG	0.00 ± 0.01
371	**371**	**SF2000**	**JM**				**Calibration**			**1.0**	**POS**	**1.22 ± 0.17**
372	**372**	**SF2000**	**JM**				**Calibration**			**1.0**	**POS**	**1.24 ± 0.19**
373	**373**	**SF2000**	**JM**				**Calibration**			**1.0**	**POS**	**1.14 ± 0.08**
374	374	SF2000	JM				Calibration			0.0	...	NA
375	**375**	**SF2000**	**JM**				**Calibration**			**1.2**	**POS**	**1.45 ± 0.27**
376	**376**	**SF2000**	**JM**				**Calibration**			**1.0**	**POS**	**1.17 ± 0.12**
377	**377**	**SF2000**	**JM**				**Calibration**			**1.0**	**POS**	**1.13 ± 0.09**
378	378	SF2000	JM	A	P-1 Exterior	Metal	Wall	Intact	Beige	1.1	NEG	0.04 ± 0.33
379	379	SF2000	JM	B	P-1 Exterior	Metal	Wall	Intact	Beige	1.0	NEG	0.05 ± 0.06
380	380	SF2000	JM	B	P-1 Exterior	Metal	Door	Intact	Beige	1.9	NEG	0.03 ± 0.33
381	381	SF2000	JM	B	P-1 Exterior	Metal	R Door Jamb	Intact	Beige	1.0	NEG	-0.21 ± 0.83
382	382	SF2000	JM	C	P-1 Exterior	Metal	Wall	Intact	Beige	1.0	NEG	0.02 ± 0.20
383	383	SF2000	JM	D	P-1 Exterior	Metal	Wall	Intact	Beige	1.3	NEG	0.05 ± 0.20
384	384	SF2000	JM	D	P-1 Exterior	Metal	Door	Intact	Beige	1.0	NEG	0.01 ± 0.03
385	385	SF2000	JM	D	P-1 Exterior	Metal	Door Frame	Intact	Beige	1.0	NEG	0.01 ± 0.23
386	386	SF2000	JM	A	Exterior	Stucco	Wall	Intact	Tan	1.0	NEG	0.00 ± 0.01
387	387	SF2000	JM	A Right	Exterior	Metal	Vent	Intact	Tan	1.0	NEG	0.00 ± 0.11
388	388	SF2000	JM	A Right	Exterior	Metal	Electrical Conduit	Intact	Tan	1.0	NEG	0.00 ± 0.01
389	389	SF2000	JM	A Right	Exterior	Metal	Door	Intact	Purple	3.0	NEG	0.04 ± 0.28

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
390	390	SF2000	JM	A Right	Exterior	Metal	R Door Casing	Intact	Purple	1.0	NEG	0.01 ± 0.16
391	391	SF2000	JM	A Right	Exterior	Cement	Doorway Wall	Intact	Tan	10.0	NEG	0.06 ± 0.81
392	392	SF2000	JM	A Right	Exterior	Metal	Gas Meter Pipe	Intact	Gray	1.1	NEG	0.01 ± 0.26
393	393	SF2000	JM	A Right	Exterior	Metal	Pipe Rack	Intact	Gray	1.0	NEG	0.01 ± 0.06
394	394	SF2000	JM	A Right	Exterior	Metal	Metal Bricket	Intact	Green	1.7	NEG	0.13 ± 0.19
395	395	SF2000	JM	A Center	Exterior	Cement	Window Panel	Intact	Tan	3.6	NEG	0.01 ± 0.04
396	396	SF2000	JM	A Center	Exterior	Concrete	Storage Wall	Intact	Tan	2.4	NEG	0.02 ± 0.16
397	**397**	**SF2000**	**JM**	**A Center**	**Exterior**	**Metal**	**Railing Cap**	**Intact**	**Tan**	**1.5**	**POS**	**2.96 ± 0.96**
398	398	SF2000	JM	A Center	Exterior	Metal	Down Spout	Intact	Tan	3.7	NEG	0.04 ± 0.11
399	399	SF2000	JM	A Center	Exterior	Metal	Guard Rail	Intact	Pink	1.7	NEG	0.01 ± 0.20
400	400	SF2000	JM	A Center	Exterior	Metal	Platform Support	Intact	Pink	1.0	NEG	0.01 ± 0.17
401	401	SF2000	JM	A Center	Exterior	Metal	Platform	Intact	Pink	1.0	NEG	0.00 ± 0.12
402	402	SF2000	JM	A Center	Exterior	Metal	Grate	Intact	Orange	1.3	NEG	0.41 ± 0.21
403	403	SF2000	JM	A Center	Exterior	Metal	Parking Post	Intact	Pink	1.1	NEG	0.16 ± 0.18
404	404	SF2000	JM	A Center	Exterior	Drywall	Overhang Support	Intact	White	10.0	NEG	0.05 ± 0.75
405	405	SF2000	JM	A Center	Exterior	Cement	Porch Beam	Intact	Tan	1.0	NEG	0.00 ± 0.09
406	406	SF2000	JM	A Center	Exterior	Metal	Garage Door	Intact	Purple	3.3	NEG	0.06 ± 0.13
407	**407**	**SF2000**	**JM**	**A Center**	**Exterior**	**Metal**	**Garage Door Frame**	**Intact**	**Purple**	**1.2**	**POS**	**5.24 ± 1.80**
408	408	SF2000	JM	A Center	Exterior	Metal	Metal Box	Intact	Purple	1.0	NEG	0.02 ± 0.03
409	409	SF2000	JM	A Center	Exterior	Concrete	Property Wall	Intact	Tan	1.0	NEG	0.00 ± 0.01
410	**410**	**SF2000**	**JM**	**A Center**	**Exterior**	**Concrete**	**Light Post**	**Intact**	**Tan**	**2.1**	**POS**	**1.29 ± 0.24**
411	411	SF2000	JM	A Center	Exterior	Concrete	Parking Curb	Intact	Red	1.8	NEG	0.01 ± 0.15
412	**412**	**SF2000**	**JM**	**A Center**	**Exterior**	**Asphalt**	**Parking Stripe**	**Intact**	**Yellow**	**3.5**	**POS**	**7.68 ± 2.86**
413	413	SF2000	JM	A Center	Exterior	Concrete	Parking Curb	Intact	Blue	3.8	NEG	0.02 ± 0.05
414	414	SF2000	JM	A Center	Exterior	Cement	Overhang Trim	Intact	Pink	1.0	NEG	0.00 ± 0.01
415	415	SF2000	JM	A Center	Exterior	Cement	Overhang Wall	Intact	Maroon	6.7	NEG	0.04 ± 0.11
416	416	SF2000	JM	A Center	Exterior	Cement	Porch Support	Intact	Tan	1.0	NEG	0.00 ± 0.01
417	**417**	**SF2000**	**JM**	**A Left**	**Exterior**	**Metal**	**Fire Hydrant**	**Intact**	**Yellow**	**1.3**	**POS**	**2.24 ± 0.52**
418	418	SF2000	JM	A Left	Exterior	Metal	Pipe	Intact	Tan	1.0	NEG	0.00 ± 0.03
419	419	SF2000	JM	B	Exterior	Stucco	Wall	Intact	Tan	5.9	NEG	0.02 ± 0.08
420	**420**	**SF2000**	**JM**	**B Center**	**Exterior**	**Concrete**	**Parking Curb**	**Intact**	**Yellow**	**3.9**	**POS**	**4.51 ± 1.82**
421	421	SF2000	JM	B Center	Exterior	Asphalt	Parking Stripe	Intact	White	1.0	NEG	0.00 ± 0.01
422	422	SF2000	JM	B Center	Exterior	Cement	Bench Wall	Intact	Tan	1.0	NEG	0.00 ± 0.01
423	**423**	**SF2000**	**JM**	**B Left**	**Exterior**	**Metal**	**Spout**	**Intact**	**Tan**	**1.6**	**POS**	**24.49 ± 7.55**
424	**424**	**SF2000**	**JM**	**B left**	**Exterior**	**Metal**	**Fire Hydrant**	**Intact**	**Red**	**1.6**	**POS**	**1.92 ± 0.45**
425	425	SF2000	JM	C	Exterior	Stucco	Wall	Intact	Tan	1.0	NEG	0.00 ± 0.10
426	426	SF2000	JM	D	Exterior	Stucco	Wall	Intact	Tan	1.0	NEG	0.00 ± 0.02
427	427	SF2000	JM	D Center	Exterior	Metal	Railing Cap	Intact	Brown	1.0	NEG	0.00 ± 0.15
428	**428**	**SF2000**	**JM**	**D Right**	**Exterior**	**Concrete**	**Ramp Wall**	**Intact**	**Yellow**	**1.2**	**POS**	**1.76 ± 0.36**
429	429	SF2000	JM	D	Exterior	Metal	Door	Intact	Beige	5.3	NEG	0.07 ± 0.24
430	430	SF2000	JM	D	Exterior	Metal	R Door Casing	Intact	Beige	1.0	NEG	0.01 ± 0.17
431	431	SF2000	JM	D Right	Exterior	Concrete	Stair Wall	Intact	White	2.1	NEG	0.01 ± 0.09
432	432	SF2000	JM	D Right	Exterior	Concrete	Stair Raiser	Intact	Yellow	1.0	NEG	0.00 ± 0.03
433	**433**	**SF2000**	**JM**	**D Right**	**Exterior**	**Metal**	**Parking Post**	**Intact**	**Yellow**	**1.2**	**POS**	**1.43 ± 0.27**
434	**434**	**SF2000**	**JM**	**D Right**	**Exterior**	**Concrete**	**Low Wall**	**Intact**	**White**	**1.6**	**POS**	**3.26 ± 1.12**
435	435	SF2000	JM	D Right	Exterior	Stucco	Adobe Oven	Intact	Tan	1.0	NEG	0.00 ± 0.08
436	436	SF2000	JM	D Left	Exterior	Concrete	Light Post	Intact	White	1.0	NEG	0.00 ± 0.01
437	437	SF2000	JM	D Left	Exterior	Stucco	Wall	Intact	Brown	1.0	NEG	0.00 ± 0.09

Serial #XL309-U3987NR6814 Site: Date: 12/15/2006

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
462	**462**	**SF2001**	**DD**				**Calibrate**			**POS**	**1.10 ± 0.08**
463	**463**	**SF2001**	**DD**				**Calibrate**			**POS**	**1.21 ± 0.17**
464	**464**	**SF2001**	**DD**				**Calibrate**			**POS**	**1.17 ± 0.12**
465	465	SF2001	DD	A	1	Wood	Wall	Intact	White	NEG	0.02 ± 0.05
466	466	SF2001	DD	B	1	Wood	Wall	Intact	White	NEG	0.00 ± 0.12
467	467	SF2001	DD	C	1	Wood	Wall	Intact	White	NEG	0.04 ± 0.10
468	468	SF2001	DD	D	1	Wood	Wall	Intact	White	NEG	0.00 ± 0.12
469	469	SF2001	DD	C	1	Fiberboard	Ceiling Tile	Intact	White	NEG	0.00 ± 0.01
470	470	SF2001	DD	A Left	1	Metal	Door	Intact	White	NEG	0.01 ± 0.16
471	471	SF2001	DD	A Left	1	Metal	R Door Casing	Intact	White	NEG	0.15 ± 0.41
472	472	SF2001	DD	A Left	1	Wood	R Door Jamb	Intact	Wood	NEG	0.00 ± 0.02
473	473	SF2001	DD	A Left	1	Metal	Electrical Conduit	Intact	White	NEG	0.00 ± 0.09
474	474	SF2001	DD	B Center	1	Wood	Window Sill	Intact	White	NEG	0.00 ± 0.14
475	475	SF2001	DD	B Center	1	Wood	R Window Casing	Intact	White	NEG	0.00 ± 0.13
476	476	SF2001	DD	D Center	1	Wood	Crown Molding	Intact	White	NEG	0.03 ± 0.27
477	477	SF2001	DD	C Center	1	Wood	Door Frame	Intact	White	NEG	0.00 ± 0.10
478	478	SF2001	DD	C Center	1	Wood	Door Jamb	Intact	White	NEG	0.00 ± 0.02
479	479	SF2001	DD	A	2	Wood	Wall	Intact	White	NEG	0.00 ± 0.12
480	480	SF2001	DD	C	2	Wood	Wall	Intact	White	NEG	0.02 ± 0.39
481	481	SF2001	DD	D	2	Wood	Baseboard	Intact	White	NEG	0.00 ± 0.17
482	482	SF2001	DD	A Center	2	Wood	Door	Intact	White	NEG	0.12 ± 0.29
483	483	SF2001	DD	A Center	2	Wood	R Door Casing	Intact	White	NEG	0.00 ± 0.12
484	484	SF2001	DD	A Center	2	Wood	L Door Jamb	Intact	White	NEG	0.00 ± 0.14
485	485	SF2001	DD	D	2	Fiberboard	Ceiling Tile	Intact	White	NEG	0.01 ± 0.74
486	486	SF2001	DD	C Right	2	Wood	Door	Intact	Stain	NEG	-0.47 ± 0.81
487	487	SF2001	DD	C Right	2	Wood	Door Frame	Intact	White	NEG	0.00 ± 0.02
488	488	SF2001	DD	C Right	2	Wood	Door Jamb	Intact	White	NEG	0.00 ± 0.01
489	489	SF2001	DD	C Right	2	Wood	Crown Molding	Intact	White	NEG	0.00 ± 0.14
490	490	SF2001	DD	A	3	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
491	491	SF2001	DD	B	3	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
492	492	SF2001	DD	C	3	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
493	493	SF2001	DD	D	3	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
494	494	SF2001	DD	C	3	Fiberboard	Ceiling Tile	Intact	White	NEG	-0.33 ± 0.86
495	495	SF2001	DD	C Left	3	Wood	Door	Intact	White	NEG	0.00 ± 0.02
496	496	SF2001	DD	C Left	3	Wood	R Door Casing	Intact	Stain	NEG	0.00 ± 0.01
497	497	SF2001	DD	C Left	3	Wood	R Door Jamb	Intact	Stain	NEG	0.00 ± 0.01
498	498	SF2001	DD	C Center	3	Wood	Crown Molding	Intact	Stain	NEG	0.00 ± 0.12
499	499	SF2001	DD	B Right	3	Wood	Baseboard	Intact	White	NEG	0.00 ± 0.01
500	500	SF2001	DD	C Center	3	Metal	Electrical Conduit	Intact	White	NEG	0.00 ± 0.08
501	501	SF2001	DD	A Centet	3	Wood	Window Sill	Intact	Stain	NEG	0.00 ± 0.02
502	502	SF2001	DD	A Center	3	Wood	L Window Jamb	Intact	Stain	NEG	0.00 ± 0.13
503	503	SF2001	DD	C Right	3	Wood	Shelf	Intact	White	NEG	0.00 ± 0.15
504	504	SF2001	DD	C Right	3	Wood	Shelf Support	Intact	White	NEG	0.00 ± 0.05
505	505	SF2001	DD	A	4	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
506	506	SF2001	DD	B	4	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
507	507	SF2001	DD	C	4	Drywall	Wall	Intact	White	NEG	0.00 ± 0.02
508	508	SF2001	DD	D	4	Drywall	Wall	Intact	White	NEG	0.02 ± 0.07
509	509	SF2001	DD	A	4	Drywall	Ceiling Tile	Intact	White	NEG	0.00 ± 0.01
510	510	SF2001	DD	A Center	4	Wood	Door	Intact	Stain	NEG	0.00 ± 0.07
511	511	SF2001	DD	A Center	4	Wood	L Door Jamb	Intact	Stain	NEG	0.00 ± 0.14
512	512	SF2001	DD	A Center	4	Wood	L Door Casing	Intact	Stain	NEG	0.00 ± 0.02
513	513	SF2001	DD	D Center	4	Wood	Cabinet Door	Intact	Pink	NEG	0.04 ± 0.14
514	514	SF2001	DD	D Center	4	Wood	Cabinet Frame	Intact	Pink	NEG	0.05 ± 0.18
515	515	SF2001	DD	D Center	4	Wood	Cabinet Floor	Intact	Pink	NEG	0.01 ± 0.23
516	516	SF2001	DD	A Left	4	Metal	Electrical Conduit	Intact	White	NEG	0.01 ± 0.18
517	517	SF2001	DD	A	5	Wood	Wall	Intact	White	NEG	0.00 ± 0.14
518	518	SF2001	DD	B Left	5	Wood	Wall	Intact	White	NEG	0.00 ± 0.12
519	519	SF2001	DD	C Left	5	Wood	Wall	Intact	White	NEG	0.00 ± 0.12
520	520	SF2001	DD	D	5	Wood	Wall	Intact	White	NEG	0.00 ± 0.02
521	521	SF2001	DD	A	5	Fiberboard	Ceiling Tile	Intact	White	NEG	0.00 ± 0.05
522	522	SF2001	DD	D Right	5	Wood	Door	Intact	Stain	NEG	0.00 ± 0.09
523	523	SF2001	DD	D Right	5	Wood	R Door Casing	Intact	White	NEG	0.00 ± 0.13
524	524	SF2001	DD	D Right	5	Wood	Vent Frame	Intact	White	NEG	0.00 ± 0.13
525	525	SF2001	DD	A Left	5	Metal	Electrical Conduit	Intact	White	NEG	0.00 ± 0.11
526	526	SF2001	DD	A Left	5	Wood	Crown Molding	Intact	White	NEG	0.00 ± 0.02
527	527	SF2001	DD	B Center	5	Wood	Window Sill	Intact	White	NEG	0.00 ± 0.10
528	528	SF2001	DD	B Center	5	Wood	R Window Casing	Intact	White	NEG	0.00 ± 0.01

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
529	529	SF2001	DD	C Center	5	Metal	Support Column	Intact	White	NEG	0.00 ± 0.10
530	530	SF2001	DD	A	6	Wood	Wall	Intact	White	NEG	0.00 ± 0.01
531	531	SF2001	DD	B	6	Wood	Wall	Intact	White	NEG	0.00 ± 0.12
532	532	SF2001	DD	C	6	Wood	Wall	Intact	White	NEG	0.00 ± 0.02
533	533	SF2001	DD	D	6	Wood	Wall	Intact	White	NEG	0.00 ± 0.16
534	534	SF2001	DD	A	6	Wood	Ceiling Tile	Intact	White	NEG	0.00 ± 0.02
535	535	SF2001	DD	D Left	6	Wood	Door	Intact	White	NEG	0.00 ± 0.01
536	536	SF2001	DD	D Left	6	Wood	R Door Jamb	Intact	White	NEG	0.00 ± 0.13
537	537	SF2001	DD	B Left	6	Wood	Door	Intact	Stain	NEG	0.00 ± 0.04
538	538	SF2001	DD	B Left	6	Wood	Door Casing	Intact	White	NEG	0.00 ± 0.14
539	539	SF2001	DD	D Center	6	Wood	Crown Molding	Intact	White	NEG	0.00 ± 0.02
540	540	SF2001	DD	D Center	6	Metal	Electrical Conduit	Intact	White	NEG	0.01 ± 0.26
541	541	SF2001	DD	D Center	6	Metal	Support Column	Intact	White	NEG	0.02 ± 0.21
542	542	SF2001	DD	A	7	Drywall	Wall	Intact	Blue	NEG	0.00 ± 0.01
543	543	SF2001	DD	B	7	Drywall	Wall	Intact	Blue	NEG	0.00 ± 0.01
544	544	SF2001	DD	C Left	7	Drywall	Wall	Intact	Blue	NEG	0.00 ± 0.01
545	545	SF2001	DD	D	7	Wood	Wall	Intact	Blue	NEG	0.00 ± 0.14
546	546	SF2001	DD	C	7	Fiberboard	Ceiling Tile	Intact	White	NEG	0.00 ± 0.01
547	547	SF2001	DD	C Right	7	Metal	Door	Intact	Tan	NEG	0.00 ± 0.02
548	548	SF2001	DD	C Right	7	Wood	R Door Jamb	Intact	Blue	NEG	0.07 ± 0.22
549	549	SF2001	DD	A Left	7	Wood	Door	Intact	White	NEG	0.00 ± 0.11
550	550	SF2001	DD	A Left	7	Wood	Door Casing	Intact	Blue	NEG	0.00 ± 0.11
551	551	SF2001	DD	A Left	7	Wood	Door Frame	Intact	Blue	NEG	0.00 ± 0.14
552	552	SF2001	DD	D Right	7	Metal	Electrical Conduit	Intact	White	NEG	0.00 ± 0.14
553	553	SF2001	DD	B Center	7	Wood	Window Sill	Intact	Blue	NEG	0.00 ± 0.12
554	554	SF2001	DD	B Center	7	Wood	L Window Casing	Intact	Blue	NEG	0.00 ± 0.12
555	555	SF2001	DD	C Right	7	Wood	Crown Molding	Intact	Blue	NEG	0.00 ± 0.02
556	556	SF2001	DD	A	8	Wood	Wall	Intact	White	NEG	0.00 ± 0.12
557	557	SF2001	DD	B	8	Wood	Wall	Intact	White	NEG	0.00 ± 0.02
558	558	SF2001	DD	C	8	Wood	Wall	Intact	White	NEG	0.00 ± 0.12
559	559	SF2001	DD	D	8	Wood	Wall	Intact	White	NEG	0.00 ± 0.02
560	560	SF2001	DD	B Left	8	Wood	Door	Intact	White	NEG	0.00 ± 0.13
561	561	SF2001	DD	B Left	8	Wood	L Door Casing	Intact	White	NEG	0.00 ± 0.11
562	562	SF2001	DD	B Left	8	Wood	L Door Jamb	Intact	White	NEG	0.00 ± 0.14
563	563	SF2001	DD	C	8	Fiberboard	Ceiling Tile	Intact	White	NEG	0.05 ± 0.72
564	564	SF2001	DD	C Center	8	Wood	Window Sill	Intact	White	NEG	0.00 ± 0.14
565	565	SF2001	DD	C Center	8	Wood	R Window Casing	Intact	White	NEG	0.00 ± 0.11
566	566	SF2001	DD	D Left	8	Metal	Electrical Conduit	Intact	White	NEG	0.00 ± 0.09
567	567	SF2001	DD	A Center	8	Wood	Crown Molding	Intact	White	NEG	0.00 ± 0.13
568	568	SF2001	DD				NULL	Intact		INCOM	0.00 ± 0.08
569	569	SF2001	DD	A Right	9	Drywall	Wall	Intact	White	NEG	0.00 ± 0.08
570	570	SF2001	DD	B	9	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
571	571	SF2001	DD	C	9	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
572	572	SF2001	DD	D	9	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
573	573	SF2001	DD	A	9	Fiberboard	Ceiling Tile	Intact	White	NEG	0.00 ± 0.07
574	574	SF2001	DD	A Center	9	Wood	Door	Intact	White	NEG	0.00 ± 0.07
575	575	SF2001	DD	A Center	9	Wood	L Door Casing	Intact	White	NEG	0.00 ± 0.13
576	576	SF2001	DD	A Center	9	Wood	L Door Jamb	Intact	White	NEG	0.01 ± 0.22
577	577	SF2001	DD	A Left	9	Metal	Electrical Conduit	Intact	White	NEG	0.00 ± 0.10
578	578	SF2001	DD	A Center	9	Wood	Shelf	Intact	White	NEG	0.01 ± 0.22
579	579	SF2001	DD	B Center	9	Metal	Vent	Intact	White	NEG	0.00 ± 0.08
580	580	SF2001	DD	A	10	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
581	581	SF2001	DD	B	10	Drywall	Wall	Intact	White	NEG	0.00 ± 0.02
582	582	SF2001	DD	C	10	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
583	583	SF2001	DD	D	10	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
584	584	SF2001	DD	C	10	Drywall	Ceiling Tile	Intact	White	NEG	0.00 ± 0.01
585	585	SF2001	DD	A Left	10	Wood	Door	Intact	White	NEG	0.00 ± 0.01
586	586	SF2001	DD	A Left	10	Wood	R Door Casing	Intact	White	NEG	0.00 ± 0.14
587	587	SF2001	DD	A Left	10	Wood	R Door Jamb	Intact	White	NEG	0.00 ± 0.02
588	588	SF2001	DD	A Left	10	Concrete	Closet Floor	Intact	Gray	NEG	0.00 ± 0.01
589	589	SF2001	DD	C Center	10	Metal	Electrical Conduit	Intact	White	NEG	0.00 ± 0.09
590	590	SF2001	DD	B Center	10	Metal	Vent	Intact	White	NEG	0.01 ± 0.18
591	591	SF2001	DD	A	11	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
592	592	SF2001	DD	B	11	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
593	593	SF2001	DD	C	11	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
594	594	SF2001	DD	D	11	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
595	595	SF2001	DD	D	11	Drywall	Ceiling Tile	Intact	White	NEG	0.01 ± 0.04
596	596	SF2001	DD	B Left	11	Metal	Electrical Conduit	Intact	White	NEG	0.01 ± 0.21

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
597	597	SF2001	DD	B Left	11	Wood	Door	Intact	White	NEG	0.00 ± 0.13
598	598	SF2001	DD	B Left	11	Wood	R Door Casing	Intact	White	NEG	0.00 ± 0.13
599	599	SF2001	DD	B Left	11	Wood	R Door Jamb	Intact	White	NEG	0.00 ± 0.12
600	600	SF2001	DD	A	12	Metal	Wall	Intact	Gray	NEG	0.02 ± 0.42
601	601	SF2001	DD	B	12	Drywall	Wall	Intact	White	NEG	-0.47 ± 0.96
602	602	SF2001	DD	A Center	12	Metal	Garage Door	Intact	Gray	NEG	0.01 ± 0.02
603	603	SF2001	DD	A Right	12	Metal	Structural Beam	Intact	Brown	NEG	0.01 ± 0.21
604	604	SF2001	DD	B Center	12	Wood	Door	Intact	White	NEG	0.01 ± 0.22
605	605	SF2001	DD	B Center	12	Wood	R Door Casing	Intact	White	NEG	0.00 ± 0.13
606	606	SF2001	DD	B Center	12	Wood	R Door Jamb	Intact	White	NEG	0.00 ± 0.13
607	607	SF2001	DD	A	13	Drywall	Wall	Intact	White	NEG	0.00 ± 0.09
608	608	SF2001	DD	B	13	Drywall	Wall	Intact	White	NEG	0.00 ± 0.09
609	609	SF2001	DD	C	13	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
610	610	SF2001	DD	D	13	Drywall	Wall	Intact	White	NEG	0.00 ± 0.08
611	611	SF2001	DD	A	13	Fiberboard	Ceiling Tile	Intact	White	NEG	0.00 ± 0.01
612	612	SF2001	DD		13		NULL			INCOM	0.06 ± 0.39
613	613	SF2001	DD	A Center	13	Metal	Electrical Conduit	Intact	White	NEG	0.00 ± 0.01
614	614	SF2001	DD	A Center	13	Metal	Door	Intact	Gray	NEG	0.00 ± 0.09
615	615	SF2001	DD	A Center	13	Metal	R Door Casing	Intact	Gray	NEG	0.00 ± 0.15
616	616	SF2001	DD	D Center	13	Wood	Window Sill	Intact	White	NEG	0.00 ± 0.15
617	617	SF2001	DD	B Center	13	Wood	Window Sill	Intact	White	NEG	0.00 ± 0.02
618	618	SF2001	DD	B Center	13	Wood	Window Frame	Intact	White	NEG	0.00 ± 0.11
619	619	SF2001	DD	A Right	13	Wood	Door	Intact	Varnish	NEG	0.00 ± 0.02
620	620	SF2001	DD	A Left	13	Wood	Casing	Intact	Varnish	NEG	0.00 ± 0.13
621	621	SF2001	DD	A Right	13	Wood	Jamb	Intact	Varnish	NEG	0.00 ± 0.13
622	622	SF2001	DD	A	14	Wood	Wall	Intact	Stain	NEG	0.00 ± 0.01
623	623	SF2001	DD	B	14	Wood	Wall	Intact	Stain	NEG	0.00 ± 0.13
624	624	SF2001	DD	C	14	Wood	Wall	Intact	Stain	NEG	0.00 ± 0.13
625	625	SF2001	DD	D	14	Wood	Wall	Intact	Stain	NEG	0.00 ± 0.02
626	626	SF2001	DD	D	14	Fiberboard	Ceiling Tile	Intact	Stain	NEG	0.00 ± 0.14
627	627	SF2001	DD	A Center	14	Wood	Window Apron	Intact	Stain	NEG	0.00 ± 0.14
628	628	SF2001	DD	A Center	14	Wood	L Window Casing	Intact	Stain	NEG	0.00 ± 0.01
629	629	SF2001	DD	C Center	14	Wood	Baseboard	Intact	Stain	NEG	0.00 ± 0.15
630	630	SF2001	DD	D Center	14	Wood	Window Casing	Intact	Stain	NEG	0.00 ± 0.14
631	631	SF2001	DD	Ceiling C	14	Metal	Ceiling Tile Grid	Intact	Gray	NEG	0.00 ± 0.15
632	632	SF2001	DD	C Center	14	Wood	Door	Intact	White	NEG	0.00 ± 0.11
633	633	SF2001	DD	C Center	14	Wood	R Door Casing	Intact	White	NEG	0.00 ± 0.14
634	634	SF2001	DD	C Center	14	Wood	R Door Jamb	Intact	White	NEG	0.00 ± 0.02
635	635	SF2001	DD	A	15	Drywall	Wall	Intact	White	NEG	0.00 ± 0.08
636	636	SF2001	DD	B	15	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
637	637	SF2001	DD	C	15	Drywall	Wall	Intact	White	NEG	0.00 ± 0.01
638	638	SF2001	DD	D	15	Drywall	Wall	Intact	White	NEG	0.00 ± 0.07
639	639	SF2001	DD	C	15	Fiberboard	Ceiling Tile	Intact	White	NEG	0.00 ± 0.10
640	640	SF2001	DD	C Center	15	Metal	Ceiling Grid	Intact	Gray	NEG	0.00 ± 0.02
641	641	SF2001	DD	D Center	15	Wood	Baseboard	Intact	White	NEG	0.00 ± 0.01
642	642	SF2001	DD	C Center	15	Wood	Shelf	Intact	White	NEG	0.00 ± 0.02
643	643	SF2001	DD	C Center	15	Wood	Shelf Support	Intact	White	NEG	0.00 ± 0.02
644	644	SF2001	DD	C Center	15	Wood	Door	Intact	Varnish	NEG	0.00 ± 0.06
645	645	SF2001	DD	C Center	15	Wood	L Door Casing	Intact	Varnish	NEG	0.00 ± 0.02
646	646	SF2001	DD	C Center	15	Wood	L Door Jamb	Intact	Varnish	NEG	0.00 ± 0.15
647	647	SF2001	DD	A	Exterior	Metal	Siding	Intact	Yellow	NEG	0.05 ± 0.03
648	648	SF2001	DD	A Right	Exterior	Metal	Door	Intact	Purple	NEG	0.05 ± 0.24
649	649	SF2001	DD	A Right	Exterior	Metal	L Door Casing	Intact	Purple	NEG	0.00 ± 0.09
650	650	SF2001	DD	A Center	Exterior	Metal	Floor Trim	Intact	White	NEG	0.02 ± 0.20
651	651	SF2001	DD	A Center	Exterior	Metal	Garage Door	Intact	White	NEG	0.02 ± 0.17
652	652	SF2001	DD	A Center	Exterior	Metal	Garage Door Frame	Intact	Tan	NEG	0.02 ± 0.09
653	**653**	**SF2001**	**DD**	**A Center**	**Exterior**	**Concrete**	**Parking Lot Curb**	**Intact**	**Yellow**	**POS**	**4.51 ± 1.74**
654	**654**	**SF2001**	**DD**	**A Center**	**Exterior**	**Asphalt**	**Parking Lot Striping**	**Intact**	**Yellow**	**POS**	**1.74 ± 0.45**
655	655	SF2001	DD	A Center	Exterior	Metal	Door-D2	Intact	White	NEG	0.05 ± 0.20
656	656	SF2001	DD	A Center	Exterior	Metal	Door Jamb-D2	Intact	White	NEG	0.03 ± 0.14
657	657	SF2001	DD	A Left	Exterior	Concrete	Parking Lot Curb	Intact	Blue	NEG	0.01 ± 0.05
658	658	SF2001	DD	B	Exterior	Metal	Siding	Intact	Yellow	NEG	0.06 ± 0.04
659	659	SF2001	DD	C	Exterior	Metal	Siding	Intact	Yellow	NEG	0.06 ± 0.03
660	660	SF2001	DD	C Center	Exterior	Metal	Air Hander	Intact	Gray	NEG	0.01 ± 0.20
661	661	SF2001	DD	D	Exterior	Metal	Siding	Intact	Yellow	NEG	0.06 ± 0.06
662	662	SF2001	DD	D Right	Exterior	Metal	Door	Intact	Brown	NEG	0.02 ± 0.29
663	663	SF2001	DD	D Right	Exterior	Metal	R Door Jamb	Intact	White	NEG	0.06 ± 0.21
664	664	SF2001	DD	D Right	Exterior	Metal	R Window Casing	Intact	Silver	NEG	0.04 ± 0.22

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	Result	Pbc ± Prec
665	665	SF2001	DD	D Left	Exterior	Metal	Electrical Box	Intact	Gray	NEG	0.02 ± 0.12
666	**666**	**SF2001**					**Calibration**			**POS**	**1.15 ± 0.11**
667	**667**	**SF2001**					**Calibration**			**POS**	**1.24 ± 0.19**
668	**668**	**SF2001**					**Calibration**			**POS**	**1.16 ± 0.14**

Serial #XL309-U3987NR6814 Site: Date: 12/14/2006

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
442	442	SF2002	DD	Ceiling C	1	Metal	Ceiling Beam	Intact	Gray	1.2	NEG	0.10 ± 0.18
443	443	SF2002	DD	B Center	1	Metal	Window Sill	Intact	Beige	1.4	NEG	0.04 ± 0.34
444	444	SF2002	DD	A Left	Ext	Metal	Garage Door	Intact	Brown	1.3	NEG	0.17 ± 0.20
445	445	SF2002	DD	A Left	Ext	Metal	Garage Door Casing	Intact	Brown	1.0	NEG	0.08 ± 0.04
446	446	SF2002	DD	A Left	Ext	Metal	Gutter Downspout	Intact	Beige	2.0	NEG	0.19 ± 0.38
447	**447**	**SF2002**	**DD**	**A Right**	**Ext**	**Metal**	**Post**	**Intact**	**Yellow**	**1.2**	**POS**	**1.44 ± 0.26**
448	448	SF2002	DD	D Left	Ext	Concrete	Border Wall	Fair	White	1.0	NEG	0.00 ± 0.08
449	449	SF2002	DD	Ceiling R	1	Metal	Pipe Conduit	Intact	Gray	1.0	NEG	0.00 ± 0.05
450	450	SF2002	DD	A Center	Ext	Metal	Overhang	Intact	Brown	1.0	NEG	0.02 ± 0.02
451	451	SF2002	DD	A Center	Ext	Metal	Door	Intact	Brown	1.0	NEG	0.00 ± 0.05
452	452	SF2002	DD	A Center	Ext	Metal	L Door Casing	Intact	Brown	1.0	NEG	0.02 ± 0.10
453	453	SF2002	DD	A Center	1	Metal	Door	Intact	White	1.0	NEG	0.01 ± 0.18
454	454	SF2002	DD	C Center	Ext	Metal	Emergency Vent	Intact	Beige	1.0	NEG	0.00 ± 0.09
455	455	SF2002	DD	C Center	Ext	Metal	Conduit	Intact	Beige	1.0	NEG	0.06 ± 0.14
456	456	SF2002	DD	C Center	Ext	Metal	Bracket	Intact	Beige	1.0	NEG	0.00 ± 0.05
457	457	SF2002	DD	C Center	Ext	Metal	Ladder	Intact	Black	1.0	NEG	0.00 ± 0.05
458	**458**	**SF2002**					**Calibrate**			**1.0**	**POS**	**1.14 ± 0.14**
459	**459**	**SF2002**					**Calibrate**			**1.0**	**POS**	**1.15 ± 0.11**
460	**460**	**SF2002**					**Calibrate**			**1.0**	**POS**	**1.11 ± 0.09**

Serial #XL309-U3987NR6814 Site: Date: 12/20/2006

No	XLNo	Site	Insp	Side	Room	Sub	Feat	Cnd	Clr	DI	Result	Pbc ± Prec
1196	**1196**	**SF2003**	**SJ**				**Calibration**			**1.0**	**POS**	**1.14 ± 0.11**
1197	**1197**	**SF2003**	**SJ**				**Calibration**			**1.0**	**POS**	**1.09 ± 0.08**
1198	**1198**	**SF2003**	**SJ**				**Calibration**			**1.0**	**POS**	**1.14 ± 0.11**
1199	1199	SF2003	SJ	A	1	Fiberbaord	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.01
1200	1200	SF2003	SJ	A Center	1	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.00 ± 0.03
1201	1201	SF2003	SJ				NULL	Intact		1.0	INCOM	0.00 ± 0.01
1202	1202	SF2003	SJ	B	2	Fiberboard	Ceiling Tile	Intact	White	1.1	NEG	0.19 ± 0.61
1203	1203	SF2003	SJ	A Center	2	Metal	Ceiling Tile Grid	Intact	White	3.3	NEG	0.02 ± 0.13
1204	1204	SF2003	SJ	A Center	2	Wood	Ceiling	Intact	White	1.0	NEG	0.00 ± 0.01
1205	1205	SF2003	SJ	D	3	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.07
1206	1206	SF2003	SJ	D Center	3	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.00 ± 0.14
1207	1207	SF2003	SJ	D Right	3	Wood	Door	Intact	Yllw/Brwn	1.0	NEG	0.00 ± 0.14
1208	1208	SF2003	SJ	C Center	3	Wood	Cabinet Door Inner	Intact	Beige	1.0	NEG	0.00 ± 0.14
1209	1209	SF2003	SJ	A	4	Fiberboard	Ceiling Tile	Intact	White	6.9	NEG	-0.09 ± 0.75
1210	1210	SF2003	SJ	A Left	4	Metal	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.01
1211	1211	SF2003	SJ	B	5	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	-0.09 ± 0.73
1212	1212	SF2003	SJ	B Left	5	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.00 ± 0.08
1213	1213	SF2003	SJ	A Right	5	Metal	Electrical Conduit	Intact	Beige	2.0	NEG	0.02 ± 0.22
1214	1214	SF2003	SJ	D Left	5	Metal	Electrical Box	Intact	Gray	1.0	NEG	0.00 ± 0.09
1215	1215	SF2003	SJ	B	6	Fiberboard	Ceiling Tile	Intact	White	2.2	NEG	0.01 ± 0.03
1216	1216	SF2003	SJ	B Left	6	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.00 ± 0.13
1217	1217	SF2003	SJ	A Right	6	Metal	Door	Intact	Gray	1.0	NEG	0.01 ± 0.17
1218	1218	SF2003	SJ	A Right	6	Metal	L Door Jamb	Intact	Brown	1.0	NEG	0.00 ± 0.02
1219	1219	SF2003	SJ	D	7	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.06
1220	1220	SF2003	SJ	D Center	7	Metal	Ceiling Tile Grid	Intact	White	1.2	NEG	0.01 ± 0.25
1221	1221	SF2003	SJ	C	8	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.01
1222	1222	SF2003	SJ	C Right	8	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.01 ± 0.11
1223	1223	SF2003	SJ	C	9	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.01
1224	1224	SF2003	SJ	C Center	9	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.00 ± 0.11
1225	1225	SF2003	SJ	C	10	Fiberboard	Ceiling Tile	Intact	White	1.0	NEG	0.00 ± 0.06
1226	1226	SF2003	SJ	C Right	10	Metal	Ceiling Tile Grid	Intact	White	1.0	NEG	0.01 ± 0.17
1227	1227	SF2003	SJ	A Right	Ext	Metal	Balusters	Intact	Brown	1.0	NEG	0.00 ± 0.10
1228	1228	SF2003	SJ	A Center	Ext	Metal	Vent	Intact	Brown	1.3	NEG	0.01 ± 0.19
1229	1229	SF2003	SJ	A Center	Ext	Metal	Window Cover	Intact	Brown	1.0	NEG	0.01 ± 0.18
1230	1230	SF2003	SJ	A	Ext	Metal	Siding	Intact	Beige	1.0	NEG	0.00 ± 0.01
1231	1231	SF2003	SJ	A	Ext	Metal	Skirt Board	Intact	Brown	4.4	NEG	0.04 ± 0.16
1232	1232	SF2003	SJ	A	Ext	Wood	Foundation	Intact	Brown	1.0	NEG	0.00 ± 0.02
1233	1233	SF2003	SJ	B	Ext	Metal	Siding	Intact	Beige	5.3	NEG	0.06 ± 0.13
1234	1234	SF2003	SJ	B	Ext	Metal	Skirt Board	Intact	Brown	1.0	NEG	0.01 ± 0.22
1235	1235	SF2003	SJ	B	Ext	Wood	Foundation	Intact	Brown	1.0	NEG	0.00 ± 0.14
1236	1236	SF2003	SJ	B Left	Ext	Metal	Post	Intact	Yellow	1.0	NEG	0.00 ± 0.01
1237	1237	SF2003	SJ	C	Ext	Metal	Siding	Intact	Beige	2.0	NEG	0.02 ± 0.06
1238	1238	SF2003	SJ	C	Ext	Metal	Skirt Board		Brown	1.3	NEG	0.01 ± 0.03
1239	1239	SF2003	SJ	C	Ext	Wood	Foundation		Brown	1.0	NEG	0.00 ± 0.14
1240	1240	SF2003	SJ	C	Ext	Metal	Gutter		Brown	10.0	NEG	0.10 ± 0.71
1241	1241	SF2003	SJ				NULL			1.4	NEG	0.01 ± 0.03
1242	1242	SF2003	SJ	D	Ext	Metal	Siding		Beige	3.2	NEG	0.02 ± 0.10
1243	1243	SF2003	SJ	D	Ext	Metal	Skirt Board		Brown	3.6	NEG	0.07 ± 0.14
1244	1244	SF2003	SJ	D	Ext	Wood	Foundation		Brown	1.0	NEG	0.00 ± 0.14
1245	**1245**	**SF2003**	**SJ**				**Calibrate**			**1.1**	**POS**	**1.24 ± 0.19**
1246	**1246**	**SF2003**	**SJ**				**Calibrate**			**1.0**	**POS**	**1.21 ± 0.16**
1247	**1247**	**SF2003**	**SJ**				**Calibrate**			**1.0**	**POS**	**1.25 ± 0.19**

APPENDIX B

XRF Spectrum Analyzer Results & Programming Cost Estimates

Santa Fe Building 333
Santa Fe Service Unit
XRF Spectrum Analyzer Results
December 19, 2006

Room No.	Building Component	Color/Condition	Approx. ft2
Exterior	Concrete Walls	White/Intact	5,000
Exterior	Wood Window Components	Brown/Intact Beige/Fair	600
Exterior	Wood Door Components	Brown/Intact White/Poor	280
Exterior	Wood Gutter Spout	Beige/Intact	16
Exterior	Concrete Curb Paint	Yellow/Red/Intact	120
Interior	Wood Baseboards & Toe Kicks	White/Intact	350
Interior	Wood Door Components	White/Fair	1,400
Interior	Wood Window Components	White/Interior	600
Interior	Wood Stall Door Components	Brown/Intact	240
Interior	Wood Closet Shelf Components	White/Intact	300
Interior	Wood Crown Molding Components	White/Intact	350
Interior	Wood Hanger Rods	White/Intact	75
Interior	Wood Closet Door Components	Peach/White/Intact	360
2-Closet, 6, 29, 28-Closet	Concrete Floor	Gray/Poor Red/Intact	132
35	Concrete Window Sill	Green/Intact	5
32	Metal Horizontal Pipe	Red/Intact	10
32, 35	Metal Window Casing	Green/Intact	10
35	Metal Pipe	Light Green/Intact	5
32, 35	Metal Window Sash	Green/Intact	5
Interior	Plaster Walls	White/Intact	16,000
Interior	Plaster Ceilings	Green/Intact	4,015
17, 22	Plaster Fireplace	Red/Intact	20
17, 22	Plaster Fireplace Base	Red/Intact	10
23	Wood Counter Molding	White/Intact	7
23	Wood Drawer	White/Intact	3
17	Wood Floor	Stained/Intact	165
28	Wood Hatch Door Frame	White/Intact	5
23-B	Wood Lower Cabinet Door	White/Intact	6
31	Wood Stair Riser	White/Intact	3
23	Wood Upper Cabinet Door	White/Intact	171

Table 2:
Building 333
Lead Dust Wipe Samples

Sample #	Sample Date	Location	Wipe Area (ft^2)	$\mu g/ft^2$
IHS-SF333-1	**12/20/06**	**Exterior front center door step**	**1**	**328**
IHS-SF333-2	**12/20/06**	**Room 17-Floor under SW window**	**1**	**379**
IHS-SF333-3	**12/20/06**	**Room 29- Floor NW by door**	**1**	**20.6**
IHS-SF333-5	**12/20/06**	**Room 2-Floor under window**	**1**	**135**
IHS-SF333-6	**12/20/06**	**Room 8-Floor by NE door**	**1**	**1,020**
IHS-SF333-7	**12/20/06**	**Room 6-Floor at threshold**	**1**	**1,200**
IHS-SF333-8	**12/20/06**	**Room 27-Floor at threshold**	**1**	**63.0**
IHS-SF333-10	**12/20/06**	**Room 22-Floor at threshold**	**1**	**1,100**
IHS-SF333-11	**12/20/06**	**Basement floor at main door**	**1**	**2,550**
IHS-SF333-12	**12/20/06**	**Basement RT. Rm. floor at main door**	**1**	**650**

*Reported in Micrograms per Square Foot ($\mu g/ft^2$)

Laboratory analysis indicates that all of the lead dust wipe samples collected from Santa Fe Building 333 were above the EPA and HUD hazard/clearance levels of 40 mg/ ft^2.

Building 333
Santa Fe Service Unit
Programming Cost Estimate

Santa Fe Building 333			Chemical Removal		Component Demolition	
Room Number	**Building Component**	**Quantity (sf)**	**Unit Cost (sf)**	**Total***	**Unit Cost (sf)**	**Total***
Exterior	Concrete Walls	5,000	$3.73	$22,007.00	NA	NA
Exterior	Wood Window Components	600	$10.00	$7,080.00	$0.40	$283.20
Exterior	Wood Door Components	280	$18.80	$6,211.52	$1.88	$621.15
Exterior	Wood Gutter Spout	16	$13.33	$251.67	$3.98	$75.14
Exterior	Concrete Curb Paint	120	$3.73	$528.17	NA	NA
Interior	Wood Baseboards & Toe Kicks	350	$5.19	$2,143.47	$1.61	$664.93
Interior	Wood Door Components	1,400	$9.22	$15,231.44	$0.81	$1,338.12
Interior	Wood Window Components	600	$10.00	$7,080.00	$0.40	$283.20
Interior	Wood Stall Door Components	240	$13.33	$3,775.06	$3.98	$1,127.14
Interior	Wood Closet Shelf Components	300	$3.73	$1,320.42	$2.02	$715.08
Interior	Wood Crown Molding Components	350	$13.33	$5,505.29	$0.41	$169.33
Interior	Wood Hanger Rods	75	$3.73	$330.11	$2.02	$178.77
Interior	Wood Closet Door Components	360	$10.41	$4,422.17	$1.37	$581.98
2-Closet, 6, 29, 28-Closet	Concrete Floor	132	$3.73	$580.98	N/A	N/A
35	Concrete Window Sill	5	$13.33	$78.65	$3.98	$23.48
32	Metal horizontal Pipe	10	$10.10	$119.18	N/A	N/A
32, 35	Metal Window Casing	10	$13.31	$157.06	$5.32	$62.78
35	Metal Pipe	5	$10.10	$59.59	N/A	N/A
32, 35	Metal Window Sash	5	$13.31	$78.53	$5.32	$31.39
Interior	Plaster Walls	16,000	$3.99	$75,331.20	$0.20	$3,776.00
Interior	Plaster Ceilings	4,015	$7.98	$37,806.85	$0.51	$2,416.23
17, 22	Plaster Fireplace	20	$13.33	$314.59	$3.98	$93.93
17, 22	Plaster Fireplace Base	10	$13.33	$157.29	$3.98	$46.96
23	Wood Counter Molding	7	$6.96	$57.49	$0.13	$1.07
23	Wood Drawer	3	$10.41	$36.85	$1.37	$4.85
17	Wood Floor	165	$3.99	$776.85	$0.41	$79.83
28	Wood Hatch Door Frame	5	$3.99	$23.54	$1.88	$11.09
23-B	Wood Lower Cabinet Door	6	$10.41	$73.70	$1.37	$9.70
31	Wood Stair Riser	3	$9.11	$32.25	$10.90	$38.59
23	Wood Upper Cabinet Door	171	$10.32	$2,082.37	$1.37	$276.44
Total*				**$193,653.29**		**$12,910.85**

*Total includes 18% markup.

Santa Fe Building 335
Santa Fe Service Unit
XRF Spectrum Analyzer Results
December 19, 2006

Room No.	Building Component	Color/Condition	Approx. ft^2
Exterior	Metal Gas Meter	Gray/Intact	3

Building 335
Santa Fe Service Unit
Programming Cost Estimate

Santa Fe Building 335

			Chemical Removal		Component Demolition	
Room Number	Building **Component**	**Quantity (sf)**	**Unit Cost (sf)**	**Total***	**Unit Cost (sf)**	**Total***
Exterior	Metal Gas Meter	3	$16.62	$58.83	NA	NA
Total*				**$58.83**		**NA**

*Total includes 18% markup.

Santa Fe Hospital 2000
Santa Fe Service Unit
XRF Spectrum Analyzer Results
December 12, 2006

Room No.	Building Component	Color/Condition	Approx. ft^2
G-1	Metal Ladder	Orange/Intact	25 sf
C-1	Metal I-Beam	White/Intact	240 sf
P-1	Metal Pipe Hanger	White/Intact	200 sf
P-1	Metal Roof Hatch Stairs	Orange/Intact	40 sf
Exterior	Metal Railing Cap	Tan/Intact	10 sf
Exterior	Metal Garage Door Frame	Purple/Intact	75 sf
Exterior	Concrete Light Post	Tan/Intact	1,440 sf
Exterior	Asphalt Parking Stripe	Yellow/Intact	2,000 sf
Exterior	Metal Fire Hydrant	Yellow/Intact	485 sf
Exterior	Concrete Parking Curb	Intact Yellow	500 sf
Exterior	Metal Spout	Tan/Intact	160 sf
Exterior	Concrete Ramp Wall	Yellow/Intact	200 sf
Exterior	Metal Parking Post	Yellow/Intact	50 sf
Exterior	Concrete Low Wall	White/Intact	800 sf

Hospital 2000
Santa Fe Service Unit
Programming Cost Estimate

Santa Fe Hospital 2000

Room Number	Building Component	Quantity (sf)	Chemical Removal		Component Demolition	
			Unit Cost (sf)	Total*	Unit Cost (sf)	Total*
G-1	Metal Ladder	25	$16.62	$490.29	$5.32	$156.94
C-1	Metal I-Beam	240	$16.62	$4706.78	N/A	N/A
P-1	Metal Pipe Hanger	200	$10.10	$2383.60	N/A	N/A
P-1	Metal Roof Hatch Stairs	40	$16.62	$784.46	$5.32	$251.10
Exterior	Metal Railing Cap	10	$3.73	$44.01	$0.81	$9.56
Exterior	Metal Garage Door Frame	75	$18.80	$1663.80	$1.88	$166.38
Exterior	Concrete Light Post	1,440	$3.73	$6,338.02	N/A	N/A
Exterior	Asphalt Parking Stripe	2,000	$3.73	$8,802.80	N/A	N/A
Exterior	Metal Fire Hydrant	485	$3.73	$2134.68	N/A	N/A
Exterior	Concrete Parking Curb	500	$3.73	$2200.70	N/A	N/A
Exterior	Metal Spout	160	$10.10	$1906.88	N/A	N/A
Exterior	Concrete Ramp Wall	200	$3.73	$880.28	N/A	N/A
Exterior	Metal Parking Post	50	$3.73	$220.07	N/A	N/A
Exterior	Concrete Low Wall	800	$3.73	$3521.12	N/A	N/A
Total*				**$36,077.49**		**$583.98**

*Total includes 18% markup.

Santa Fe Building 2001
Santa Fe Service Unit
XRF Spectrum Analyzer Results
December 15, 2006

Room No.	Building Component	Color/Condition	Approx. ft^2
Exterior	Concrete Parking Lot Curb	Yellow/Intact	60
Exterior	Asphalt Parking Lot Striping	Yellow/Intact	150

Building 2001
Santa Fe Service Unit
Programming Cost Estimate

Santa Fe Building 2001

			Chemical Removal		Component Demolition	
Room Number	**Building Component**	**Quantity (sf)**	**Unit Cost (sf)**	**Total***	**Unit Cost (sf)**	**Total***
Exterior	Concrete Parking Lot Curb	60	$3.73	$264.08	NA	NA
Exterior	Asphalt Parking Lot Striping	150	$3.73	$660.21	NA	NA
Total*				**$924.29**		**NA**

*Total includes 18% markup.

Santa Fe Building 2002
Santa Fe Service Unit
XRF Spectrum Analyzer Results
December 14, 2006

Room No.	Building Component	Color/Condition	Approx. ft^2
Exterior	Metal Post	Yellow/Intact	5

Building 2002
Santa Fe Service Unit
Programming Cost Estimate


Santa Fe Building 2002

			Chemical Removal		Component Demolition	
Room Number	**Component**	**Quantity (sf)**	**Unit Cost (sf)**	**Total***	**Unit Cost (sf)**	**Total***
Exterior	Metal Post	5	$10.10	$59.59	NA	NA
Total*				**$59.59**		**NA**


*Total includes 18% markup.

APPENDIX C


Site Maps

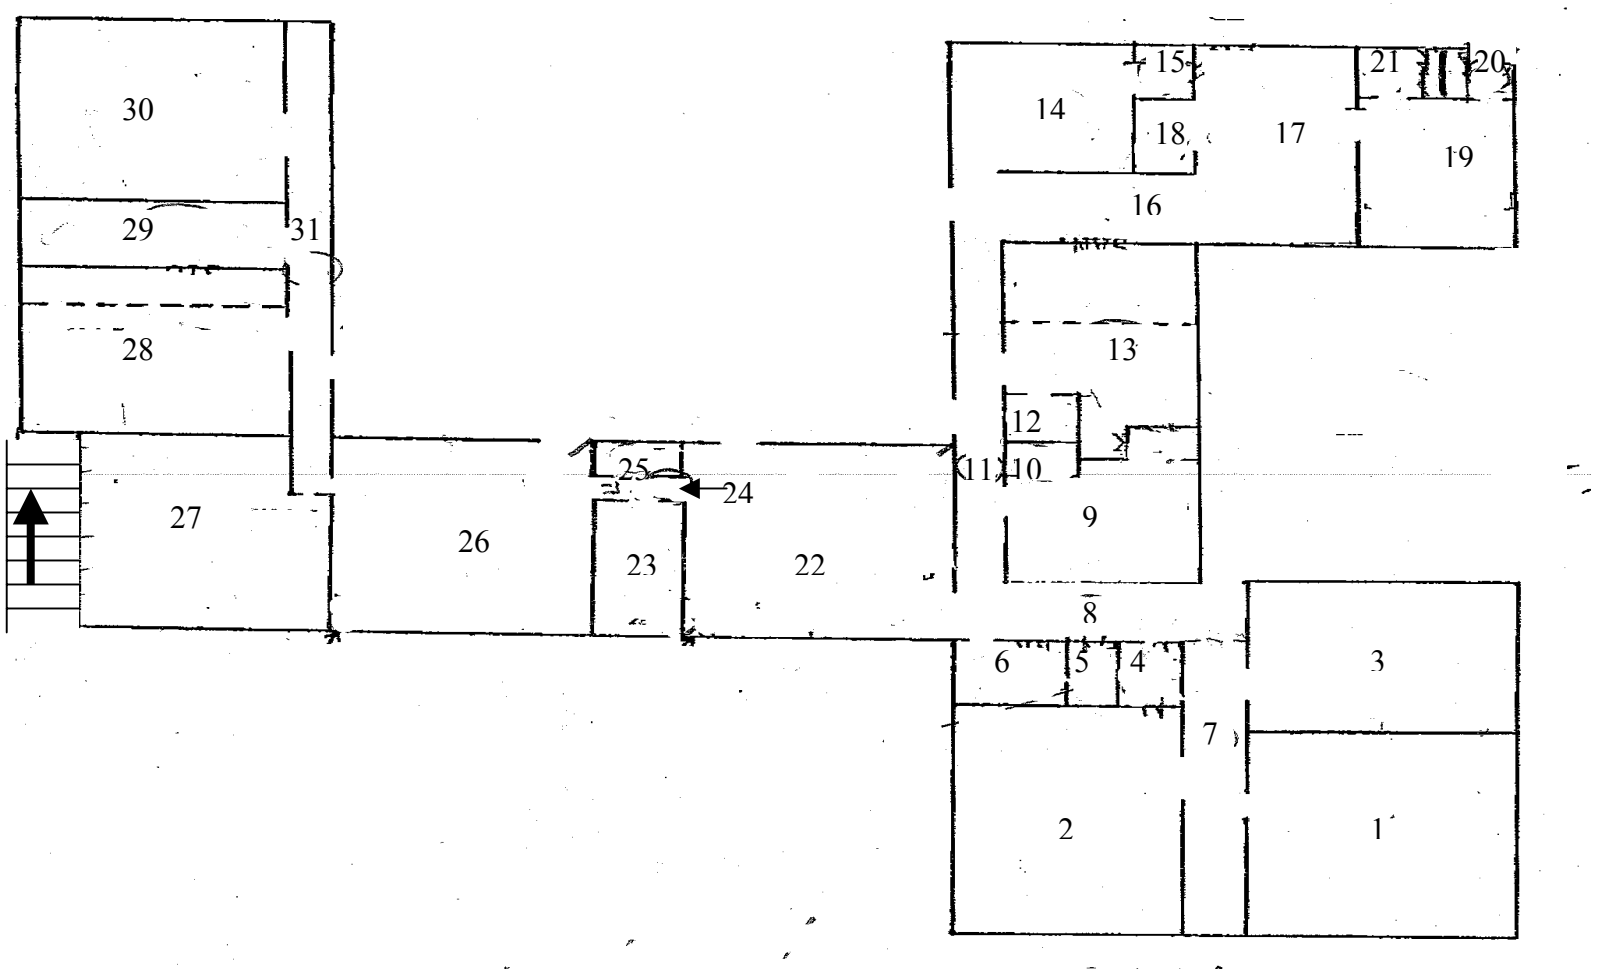

U.S. Public Health Service Federal Occupational Health 2201 Sixth Avenue, M/S Rx21 Seattle, Washington 98121-2500	Project: ALBUQUERQUE AREA INDIAN HEALTH SERVICE SANTA FE SERVICE UNIT Santa Fe, New Mexico	**Functional Space Map** Building 333

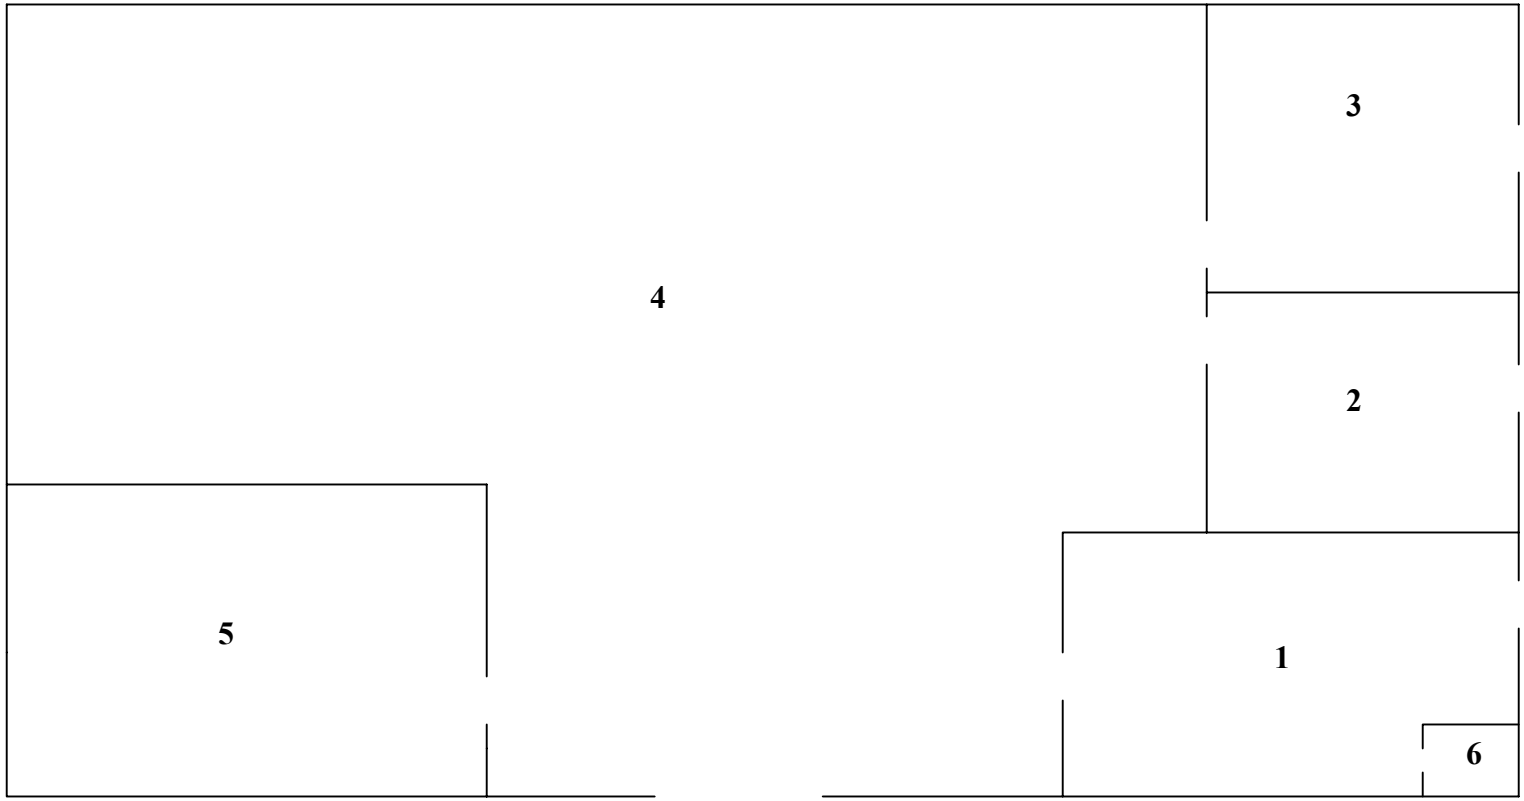


U.S. Public Health Service Federal Occupational Health 2201 Sixth Avenue, M/S Rx21 Seattle, Washington 98121-2500	Project: ALBUQUERQUE AREA INDIAN HEALTH SERVICE SANTA FE SERVICE UNIT Santa Fe, New Mexico	**Functional Space Map** Building 334

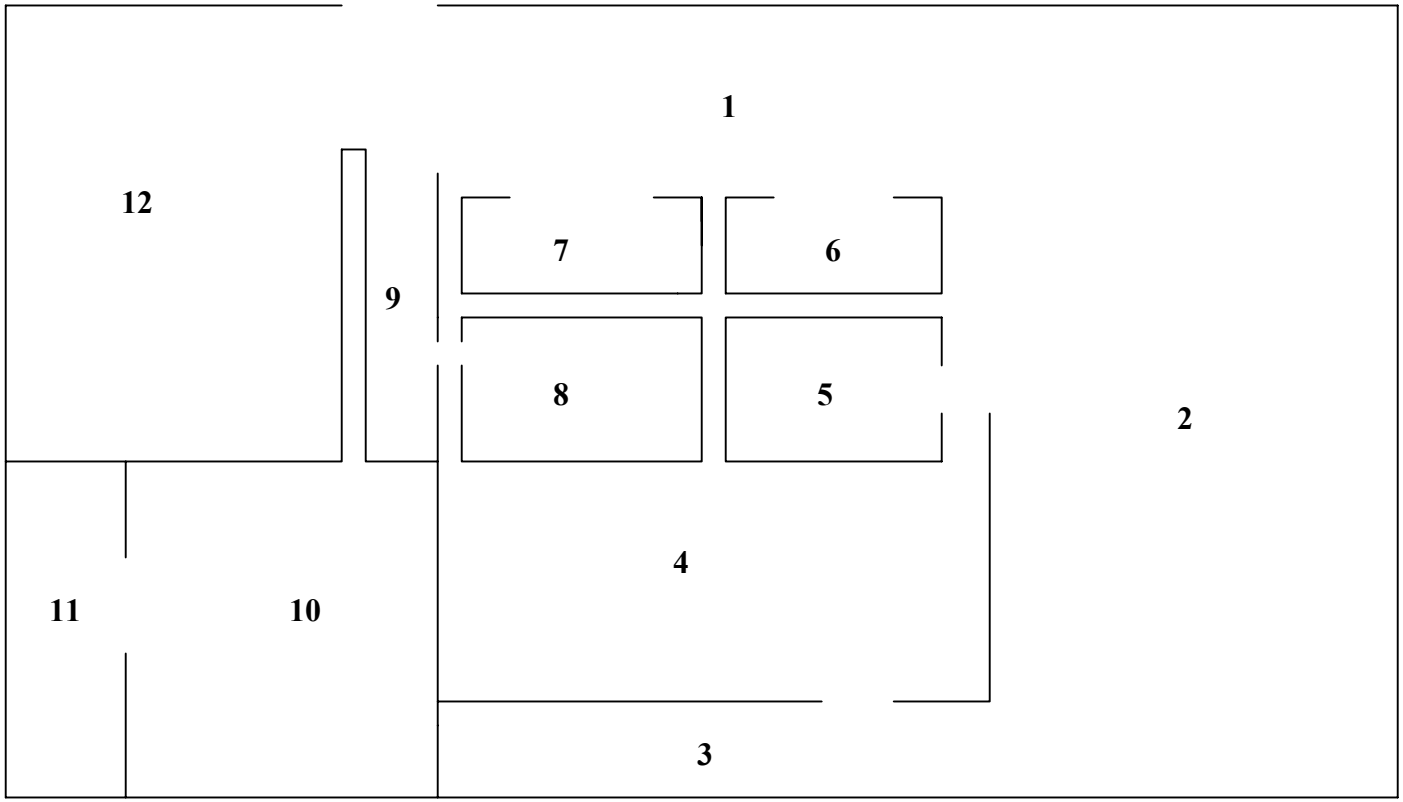


NORTH

U.S. Public Health Service Federal Occupational Health 2201 Sixth Avenue, M/S Rx21 Seattle, Washington 98121-2500	Project: ALBUQUERQUE AREA INDIAN HEALTH SERVICE SANTA FE SERVICE UNIT Santa Fe, New Mexico	**Functional Space Map** Building 335




NORTH

U.S. Public Health Service Federal Occupational Health 2201 Sixth Avenue, M/S Rx21 Seattle, Washington 98121-2500	Project: ALBUQUERQUE AREA INDIAN HEALTH SERVICE SANTA FE SERVICE UNIT Santa Fe, New Mexico	**Functional Space Map** Building 336

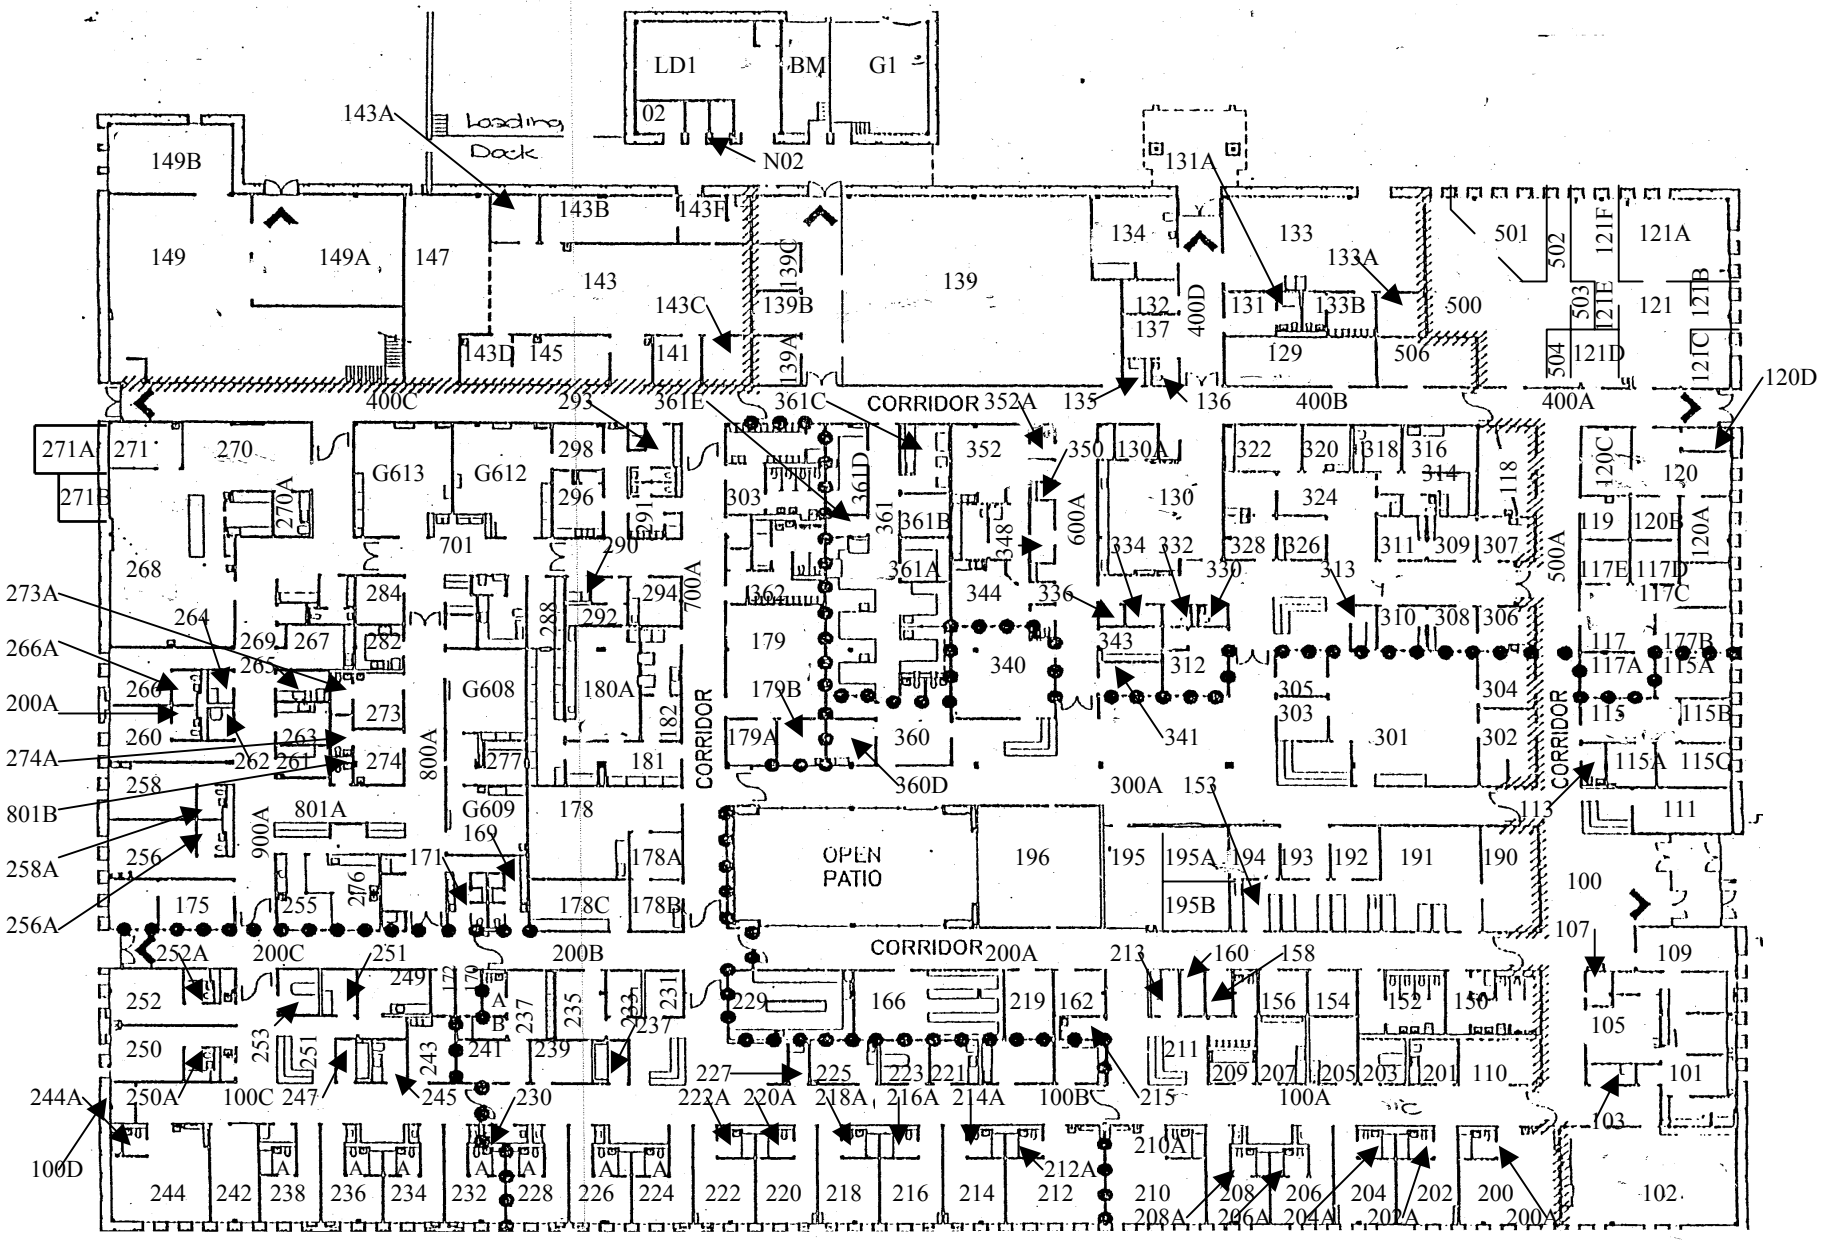


U.S. Public Health Service Federal Occupational Health 2201 Sixth Avenue, M/S Rx21 Seattle, Washington 98121-2500	Project: ALBUQUERQUE AREA INDIAN HEALTH SERVICE SANTA FE SERVICE UNIT Santa Fe, New Mexico	**Functional Space Map** Santa Fe Hospital Building 2000

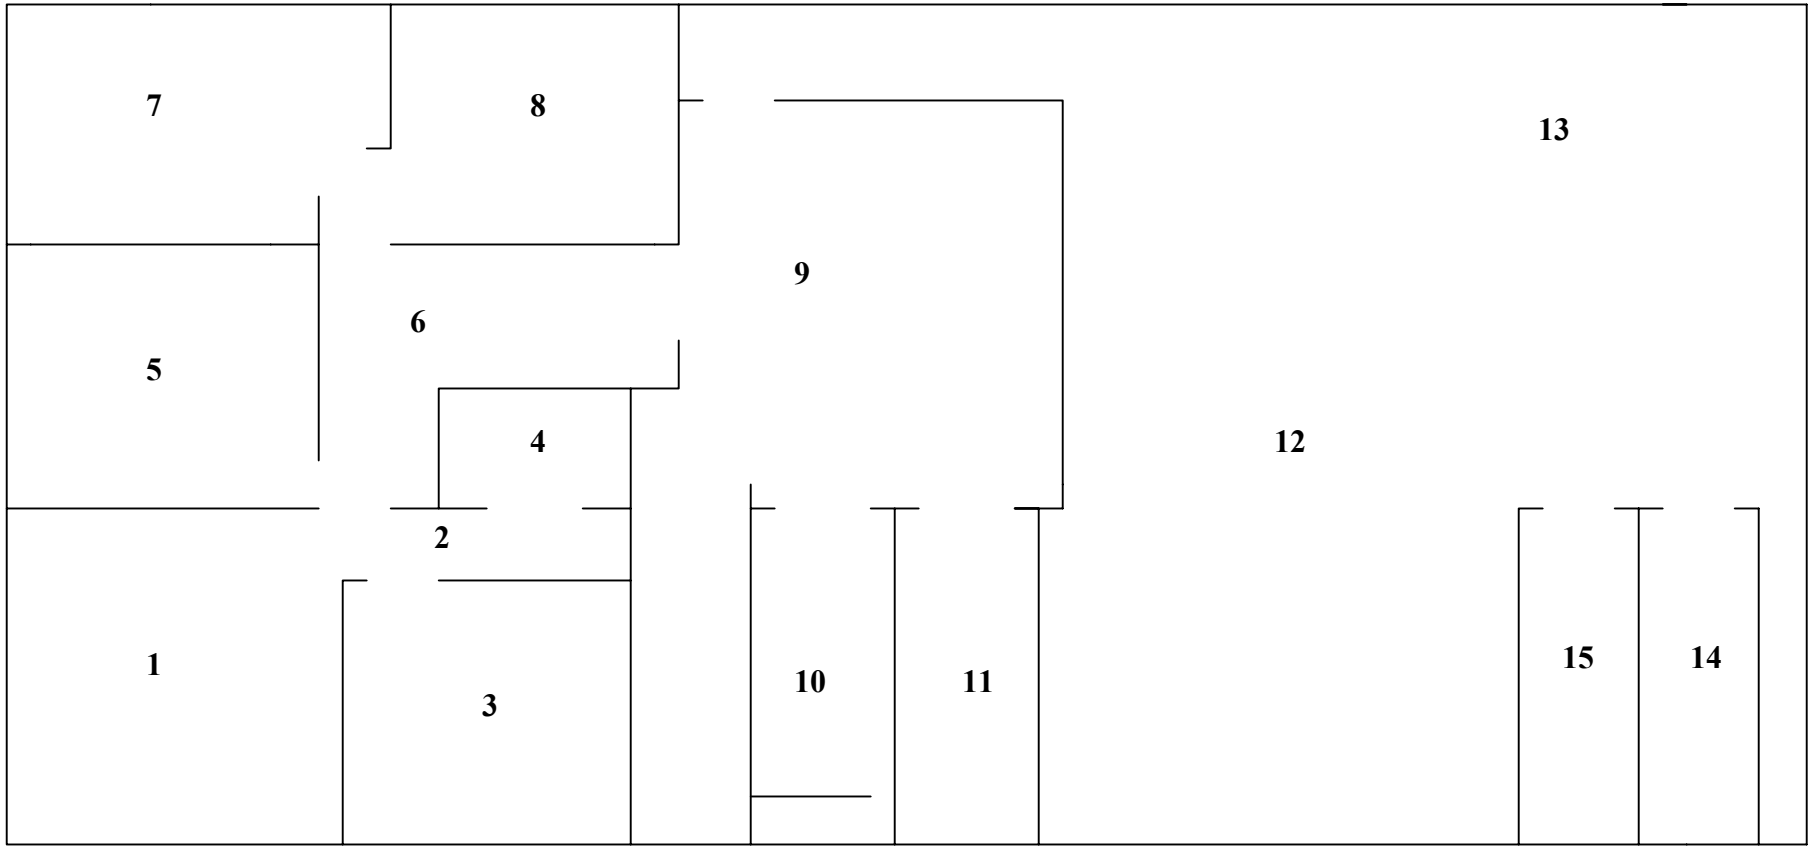


NORTH

U.S. Public Health Service Federal Occupational Health 2201 Sixth Avenue, M/S Rx21 Seattle, Washington 98121-2500	Project: ALBUQUERQUE AREA INDIAN HEALTH SERVICE SANTA FE SERVICE UNIT Santa Fe, New Mexico	**Functional Space Map** Building 2001

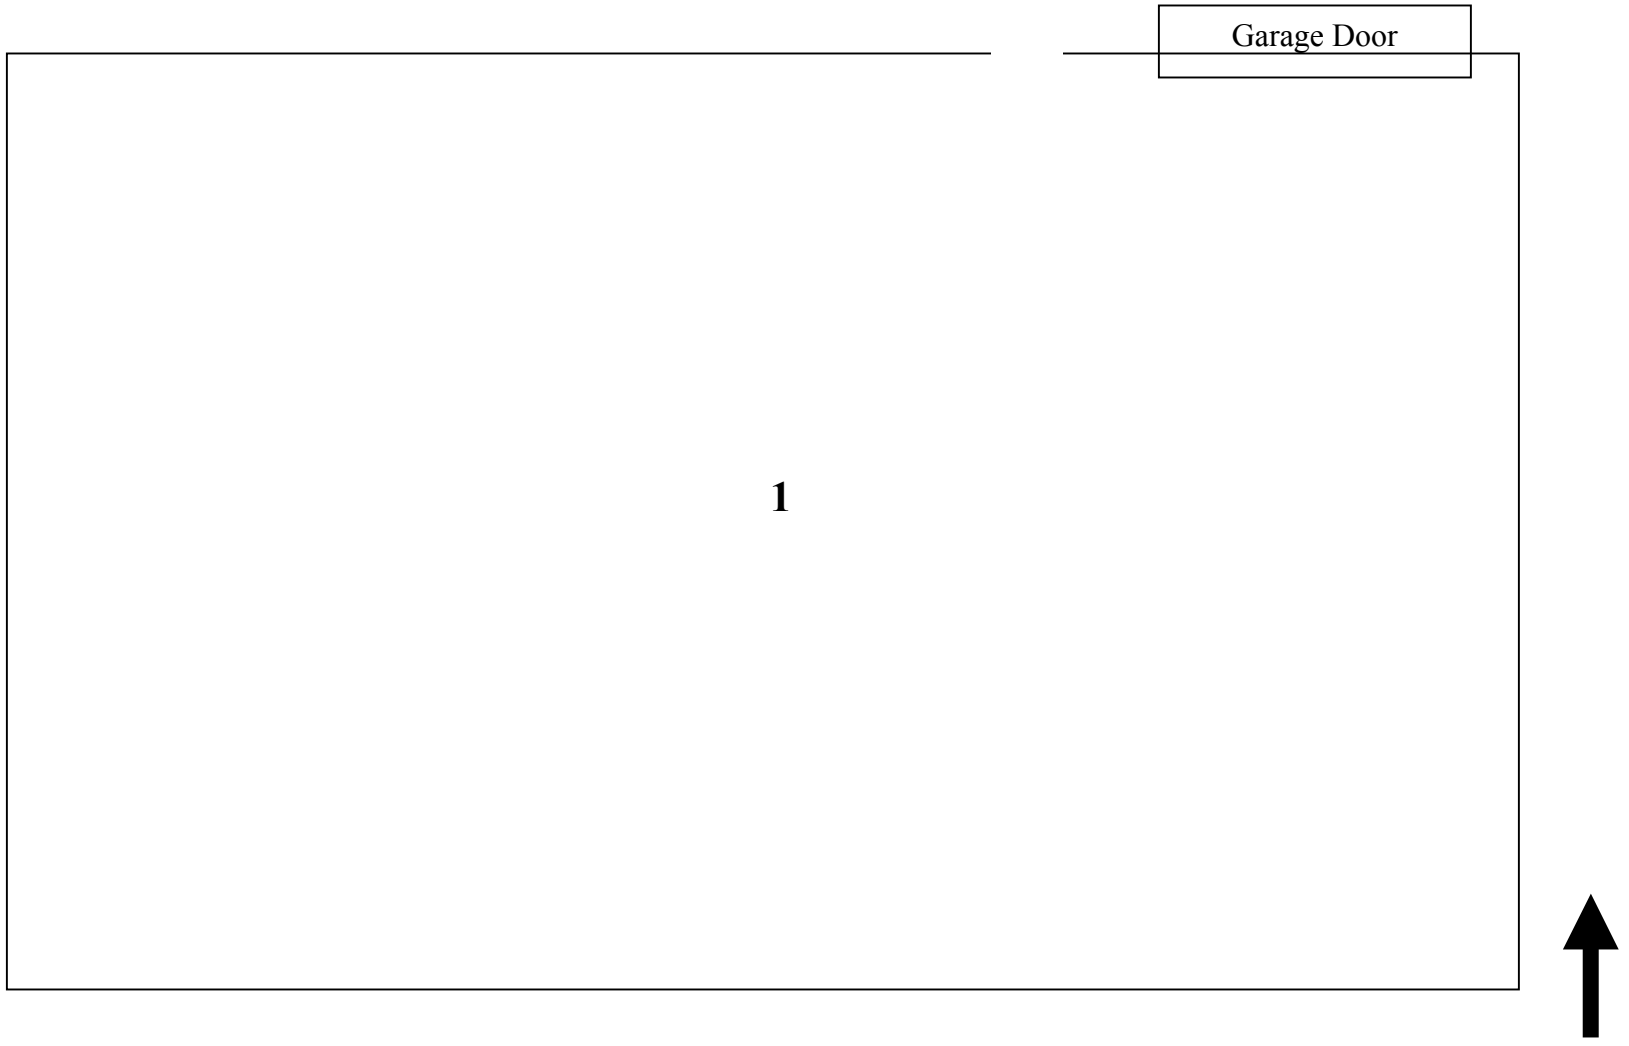

U.S. Public Health Service Federal Occupational Health 2201 Sixth Avenue, M/S Rx21 Seattle, Washington 98121-2500	Project: ALBUQUERQUE AREA INDIAN HEALTH SERVICE SANTA FE SERVICE UNIT Santa Fe New Mexico	**Functional Space Map** Building 2002

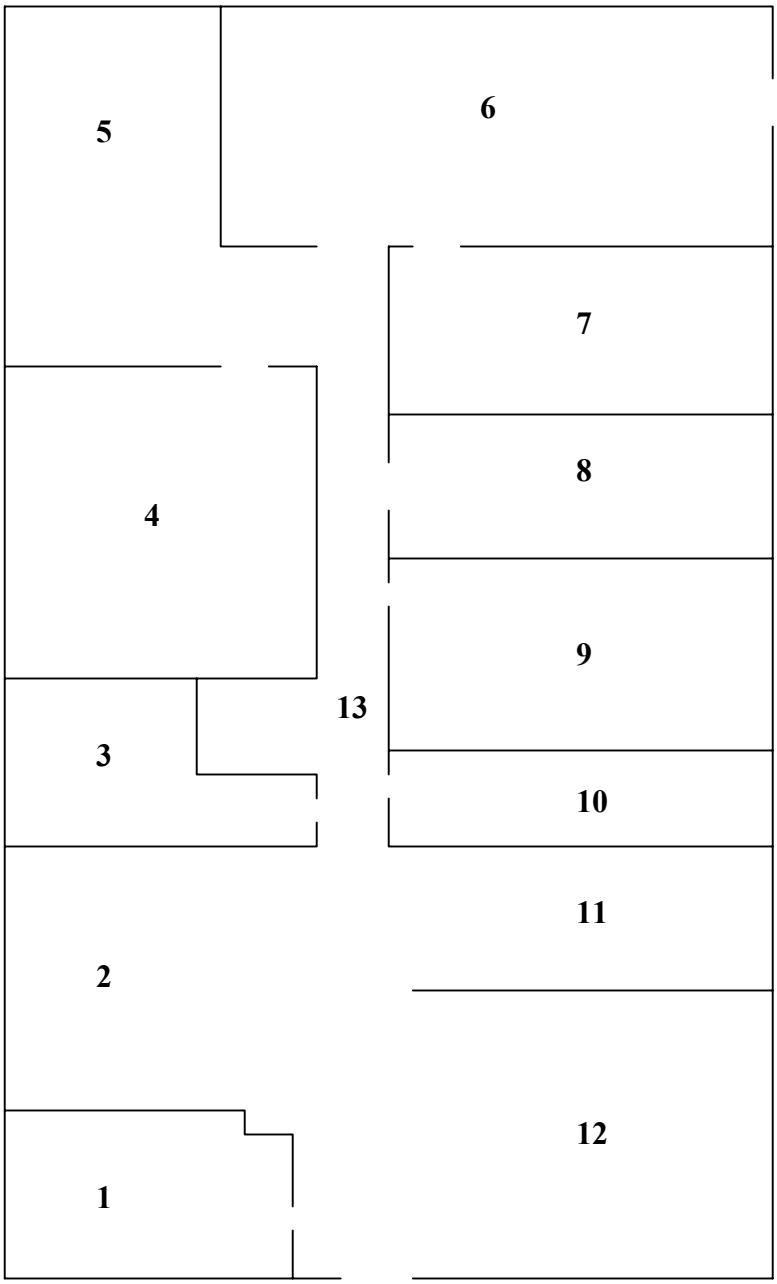

NORTH ➡

U.S. Public Health Service Federal Occupational Health 2201 Sixth Avenue, M/S Rx21 Seattle, Washington 98121-2500	Project: ALBUQUERQUE AREA INDIAN HEALTH SERVICE SANTA FE SERVICE UNIT Santa Fe, New Mexico	**Functional Space Map** Building 2003

APPENDIX D

Certifications

Certificate of Completion

Donavan E. Denny

3730 S Mill Ave #M-103
Tempe, AZ 85282

Has completed the EPA Accredited Lead Course:

24 Hour Inspector

February 20-22, 2006

This certificate serves as EPA interim certificate for six months and expires on:

August 22, 2006

February 22, 2006
Course Completion Date

Steven J. Travers
Training Manager

Allstate Services Environmental, Inc.
3030 North Central Avenue, Suite 409
Phoenix, AZ 85012-2715
(800) 320-5323
(LEAD)

AS 3104

LITHO. IN U.S.A.

Certificate of Completion

Landon Johnson
4527 N. 16th Street, #105, Phoenix, AZ 85016

Has completed the EPA Accredited Lead Course:

24 Hour Inspector
October 16-18, 2006

This certificate serves as EPA interim certificate for six months and expires on:

April 18, 2007

Steven Travers

October 18, 2006
Course Completion Date

Steven J. Travers
Training Manager

Allstate Services Environmental, Inc.
7528 North 19th Avenue, Suite 13
Phoenix, AZ 85012-2715
(800) 320-5323

AS 3532

©1998 GOES 34625

LITHO. IN U.S.A.

Certificate of Completion

Stephanie Jury

4527 N. 16th Street, #105, Phoenix, AZ 85016

Has completed the EPA Accredited Lead Course:

24 Hour Inspector
October 16-18, 2006

This certificate serves as EPA interim certificate for six months and expires on:

April 18, 2007

October 18, 2006
Course Completion Date

Steven J. Travers
Training Manager

Allstate Services Environmental, Inc.
7528 North 19th Avenue, Suite 13
Phoenix, AZ 85012-2715
(800) 320-5323

AS 3534

LITHO. IN U.S.A.

United States Environmental Protection Agency

This is to certify that

James Michael Marshall, Jr.

has fulfilled the requirements of the Toxic Substances Control Act (TSCA) Section 402(a)(1), and has received certification to conduct lead-based paint activities pursuant to 40 CFR Part 745.226 as a:

Risk Assessor

In the Jurisdiction of:

Region 9 Tribal Lands

This certification is valid from the date of issuance and expires September 21, 2007

T9-R-10173-1

Certification #

SEP 0 8 2004

Issued On

Paula Bisson

Paula Bisson, Manager, Toxics Office

Cross Media Division

Certificate of Completion

Suzette Numkena
4312 N. 112th Lane, Phoenix, AZ 85037

Has completed the EPA Accredited Lead Course:

24 Hour Inspector
October 16-18, 2006

This certificate serves as EPA interim certificate for six months and expires on:

April 18, 2007

Steven Travers

October 18, 2006
Course Completion Date

Steven J. Travers
Training Manager

Allstate Services Environmental, Inc.
7528 North 19th Avenue, Suite 13
Phoenix, AZ 85012-2715
(800) 320-5323

AS 3529

LITHO. IN U.S.A.