

CR30 ELECTRONIC-CAM DATA READOUT

SELECTED CARD 01 - RECORDED BASELINE

Machine: KOSME TOP II AD TANDEM 20/1056 CE SA4 E2 **Registration:** L05358

Source procedure: OEM Operator Manual, Chapter 7, Section 7.18, page 76

Code	Recorded display	Meaning
En	0144.2 deg	Selected head-position angle
Tc	00000 pcs/h	Output/speed; zero during the captured stopped condition
Pc	0374	Program counter / instruction pointer
Nc	1.45	Last analog sample from motor-pitch photocell
Tp	036 C	Electronic-cam card temperature
Sx	01	AUX/digital-signal status code
Ve	02.8	Electronic-cam card firmware/version
HV	161	High-voltage reading; unit not displayed
LV	25.0 V	Low-voltage supply
LA	07.4 mH	Channel A inductance
IA	02.8 A	Channel A current
LB	07.0 mH	Channel B inductance
IB	02.8 A	Channel B current

CURRENT INTERPRETATION

- **Communication:** Card 01 is online and returning detailed live data to the CR30.
- **Temperature:** 36 C is far below the manual's approximate 85 C high-temperature threshold.
- **Low-voltage supply:** 25.0 V is consistent with a nominal 24 V control supply.
- **Motor-channel balance:** IA and IB are both 2.8 A. LA is 7.4 mH and LB is 7.0 mH; the two channels are close, with no obvious missing phase in this snapshot.
- **Program activity:** Pc was captured at 374. A second reading while the machine operates is required to prove that the instruction pointer advances.
- **Sensor/input behavior:** Nc=1.45 and Sx=01 are snapshots. Their diagnostic meaning depends on whether they change with the associated photocell and input states.
- **Address versus physical head:** CARD 01 is confirmed as network address 01. It must not be assumed to be physical platform/head 1 until the DIP-switch address or physical mapping is verified.

COMPARISON REQUIRED FOR THE SUSPECTED CARD

Capture the same complete sequence under the same machine condition. Compare Ve, LV, LA/LB, IA/IB, Tp, Pc, Nc, Sx and En. A firmware mismatch, abnormal supply, missing motor channel, high temperature, frozen program counter, or missing sensor response will materially narrow the fault.

PHOTO 1 OF 15

Card-data readout menu opened by holding Enter for approximately 3 seconds.



PHOTO 2 OF 15

Selected electronic-cam network address: CARD 01.



PHOTO 3 OF 15

En - head position: 0144.2 degrees.

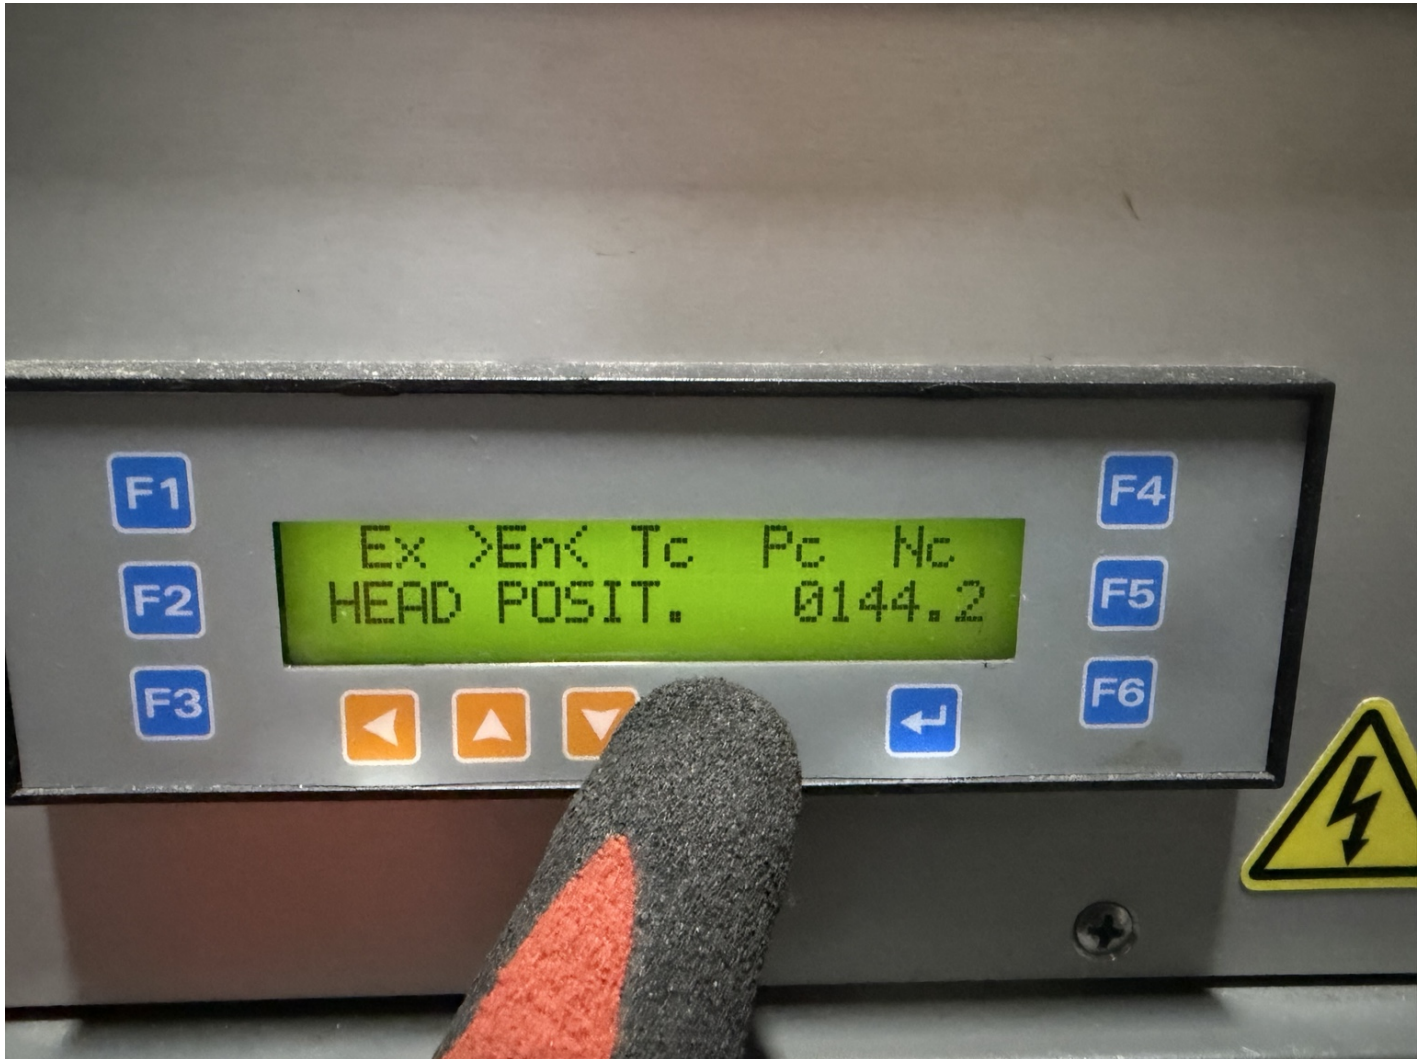


PHOTO 4 OF 15

Tc - speed/output: 00000 pieces per hour.

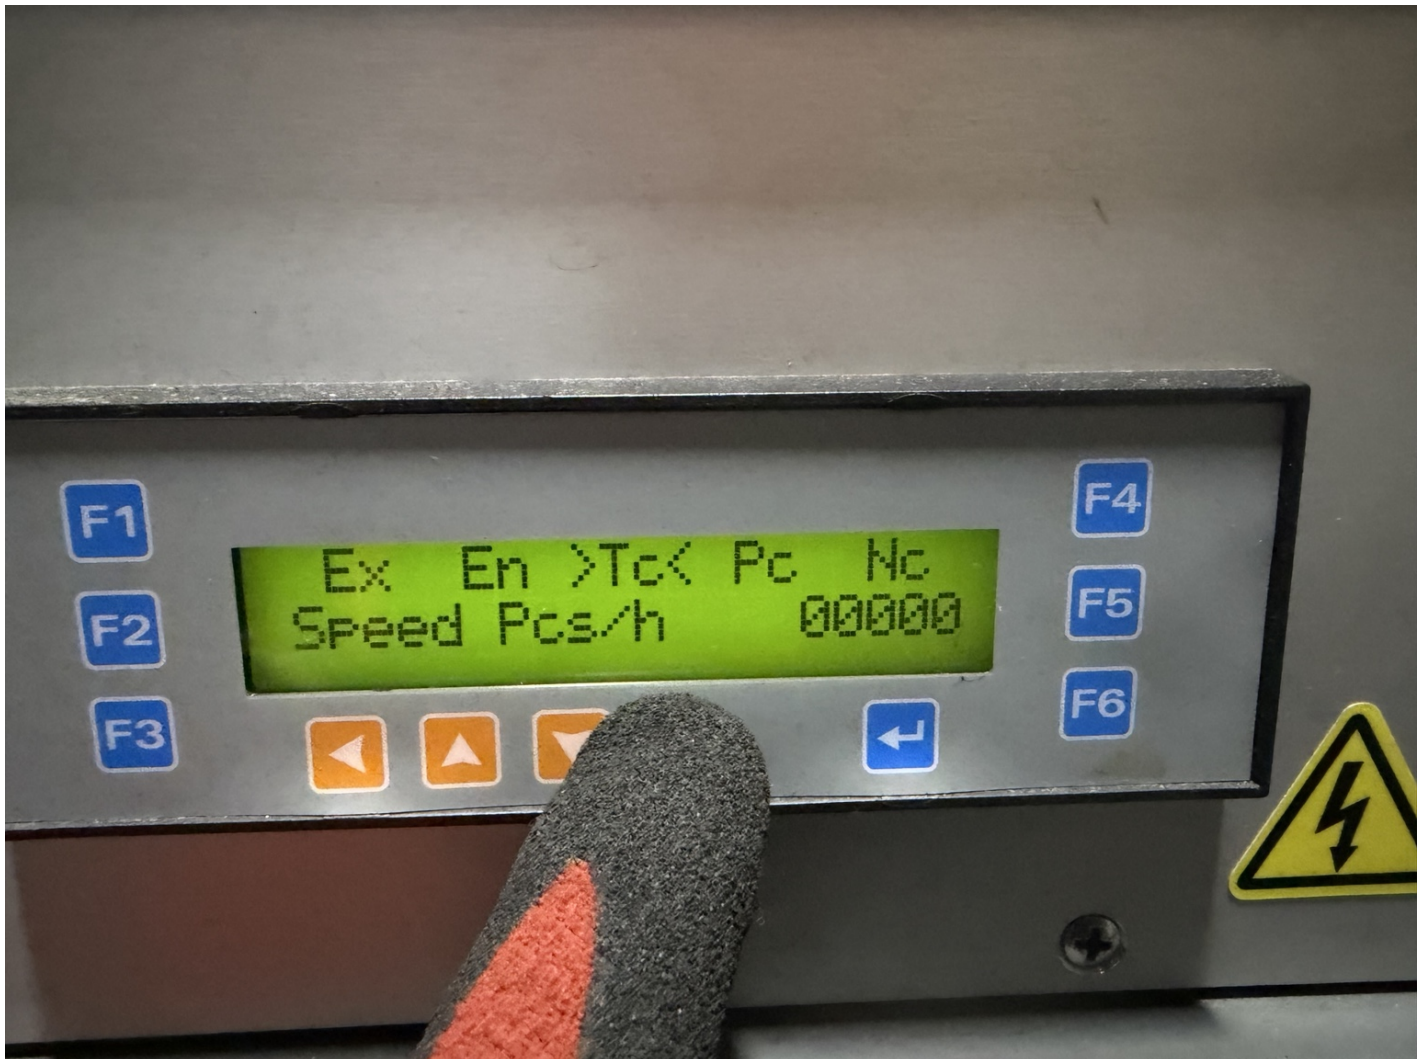


PHOTO 5 OF 15

Pc - program counter: 0374.



PHOTO 6 OF 15

Nc - new analog sample: 1.45.



PHOTO 7 OF 15

Tp - electronic-cam card temperature: 036 C.



PHOTO 8 OF 15

Sx - auxiliary/digital-signal status: 01.



PHOTO 9 OF 15

Ve - card firmware/version: 02.8.



PHOTO 10 OF 15

HV - high-voltage reading: 161 (display provides no unit).



PHOTO 11 OF 15

LV - low-voltage supply: 25.0 V.



PHOTO 12 OF 15

LA - channel A inductance: 07.4 mH.



PHOTO 13 OF 15

IA - channel A current: 02.8 A.



PHOTO 14 OF 15

LB - channel B inductance: 07.0 mH.



PHOTO 15 OF 15

IB - channel B current: 02.8 A.

