

Field-Effect Transistors

Jim Bechtold/Editor

Introduction

The field-effect transistor (or FET) is a three-terminal device that can be used in a multitude of applications ranging from signal amplification to logic and memory functions. The FET's basic principle involves using voltage between two terminals to control the current flowing in the third terminal. In this way a FET can be the basis for an amplifier or a switch. There are two fundamental types of FETs to look at, the junction field-effect transistor (JFET) and the metal-oxide-semiconductor FET, or MOSFET.

The name field-effect transistor arises from the fact that current flow between two of the device terminals is controlled by an electric field, which in turn is established by a voltage applied to the third terminal. FETs are also called unipolar transistors because current is conducted by charge carriers (electrons or holes) flowing through one type of semiconductor material (either *n*-type or *p*-type). This is in contrast to bipolar transistors where current passes through both *n*-type and *p*-type semiconductor materials in series.

JFET Physical Operation

Figure 1 shows the basic structure (simplified and idealized) of the *n*-channel JFET. It consists of a slab of *n*-type silicon with *p*-type silicon diffused on both sides. The *n* region is called the channel, while the *p*-type regions are electrically connected together and form the gate. Metal contacts are made to both ends of the channel, with the terminals called the source (S) and the drain (D). Similarly, a metal contact is made to the

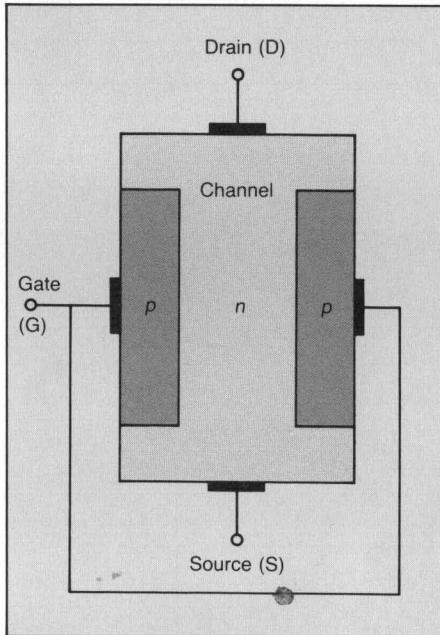


Figure 1. Basic structure of *n*-channel JFET.

p-type region to provide the gate terminal (G). The *p*-channel FET works in a similar manner except for a reversal of polarities of all currents and voltages.

Figure 2 shows the circuit symbol for the *n*-channel JFET. Note that the gate line has an arrowhead whose direction indicates the type of the device. The arrow points inward if the substrate is made from *n* material, and points away from the substrate if made from *p* material.

It can be seen from Figure 1 that the JFET has one *pn* junction, the gate-to-channel junction. In almost all applications this junction will be reverse-biased and hence only a very small leakage current will flow in the gate terminal. This also means that the input impedance looking into the gate will be very high.

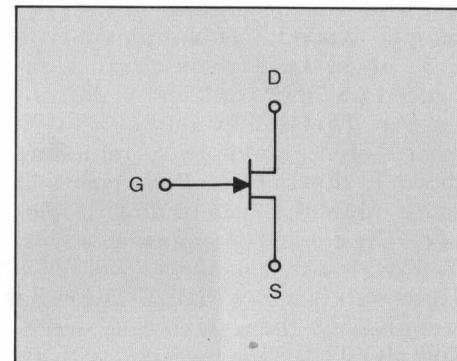


Figure 2. Circuit symbol for *n*-channel JFET.

Although only one *pn* junction exists, operation of the JFET is dependent on establishing different values of reverse bias at the two ends (source and drain) of this junction. Because of this, references are sometimes made to gate-to-drain junction and gate-to-source junction.

Comparisons

Referring to Figure 3, you see that a vacuum tube is voltage sensitive. By controlling the voltage on the grid, current flow through the tube can be regulated. Very little current flows in the grid circuit; that is, a vacuum tube has a very high input impedance. A bipolar transistor, however, responds to current flow in its base-emitter circuit. Appreciable current must flow to saturate the transistor. Thus the input impedance is rather low. Notice also that the tube needs a bias more negative than its cathode, whereas the base voltage on a transistor is somewhere between the emitter and collector. The JFET has a gate, source, and drain. These are analogous to the base, emitter, and collector, respectively, on a bipolar transistor and also to the grid, cathode, and anode, re-

spectively, on a vacuum tube. The FET responds to the electric field created by the voltage on the gate. Varying the gate voltage will vary current flow ("channel current") between source and drain.

Enhancement vs. Depletion

A significant difference between JFETs and MOSFETs is that all JFETs are of the depletion type while MOSFETs can be either depletion or enhancement type.

Simply stated, enhancement-type FETs must have their channel enhanced (or improved) to obtain conduction. That is, they must be actively biased on to promote current flow through the device. Zero bias will cause minimum current flow. Depletion FETs are just the opposite—with 0V bias, maximum current will flow. These two types of MOSFETs can be identified by their symbol. A depletion MOSFET is diagrammed with an unbroken line, indicating the presence of a channel. That is, conduction will occur with zero bias. An enhancement MOSFET has its channel diagrammed with a broken line, signifying that no channel exists in the enhancement device until a positive voltage improves or enhances the channel.

FETs can be made out of *p*-doped (positive) material or *n*-doped (negative) material, just as bipolar transistors can be PNP or NPN. The direction of the arrow on the symbol indicates *p* or *n*. The arrow points to *n*-channel, just as in the bipolar case. That is, in a PNP bipolar transistor the arrow points to *n* material (the base). In an NPN transistor the arrow points toward the emitter (again *n* material).

In FETs the arrow points inward if the substrate is made from *n* material (and points away from the substrate if made from *p* material). See Figure 4.

Depletion-Type MOSFET Physical Operation

Figure 5 shows the basic structure (simplified and idealized) of an *n*-channel depletion-type MOSFET. As shown, the *n*-channel device is formed on a *p*-type silicon substrate.

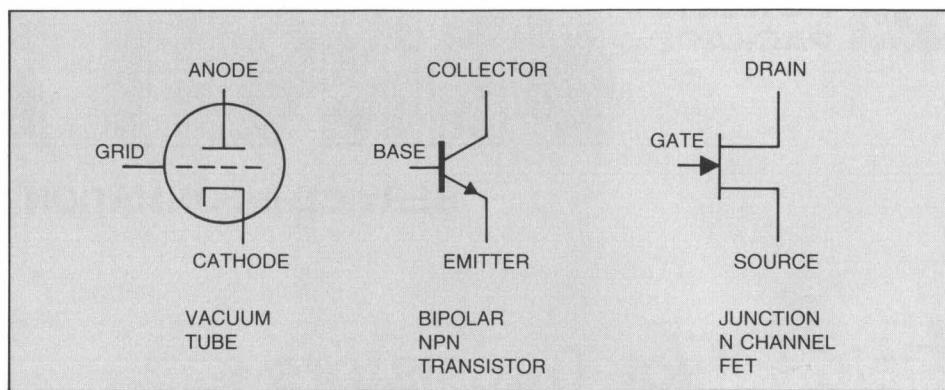


Figure 3. Vacuum tube, bipolar transistor and JFET.

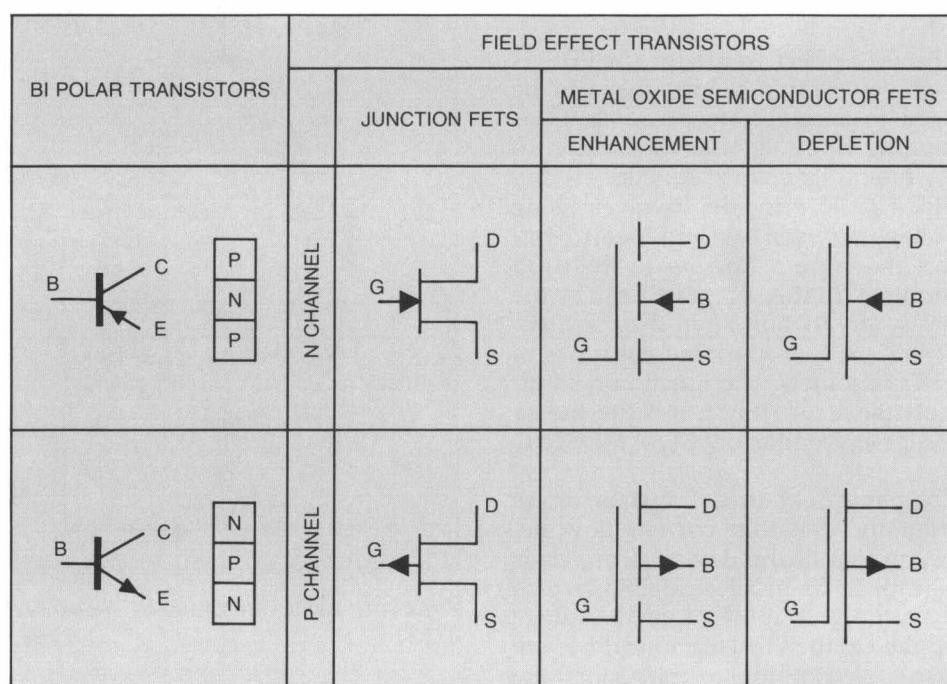


Figure 4. Transistor types.

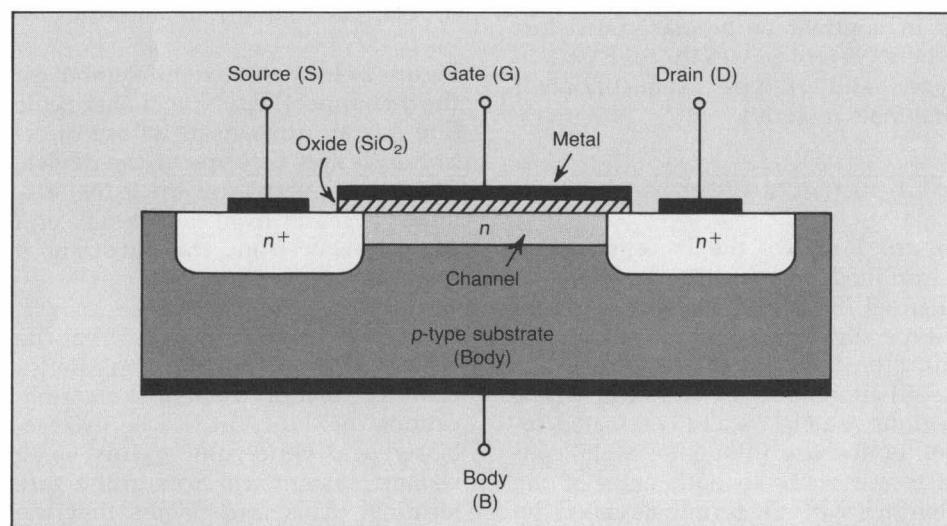


Figure 5. Basic structure of *n*-channel depletion-type MOSFET.

The two heavily doped n^+ wells form low-resistance connections between the ends of the n channel and the metal contacts of the source (S) and the drain (D). A thin oxide layer is grown on the surface of the channel, and metal (aluminum) is deposited on it to form the gate (G). At this point it should be clear that the name MOS is derived from the structure of the device.

Whereas the JFET is controlled by the gate-to-channel pn junction, this is not the case in the MOSFET. Here the oxide layer acts as an insulator that causes the gate current to be negligibly small (10^{-12} to 10^{-15}). This gives the MOS transistor its extremely high input resistance under all conditions.

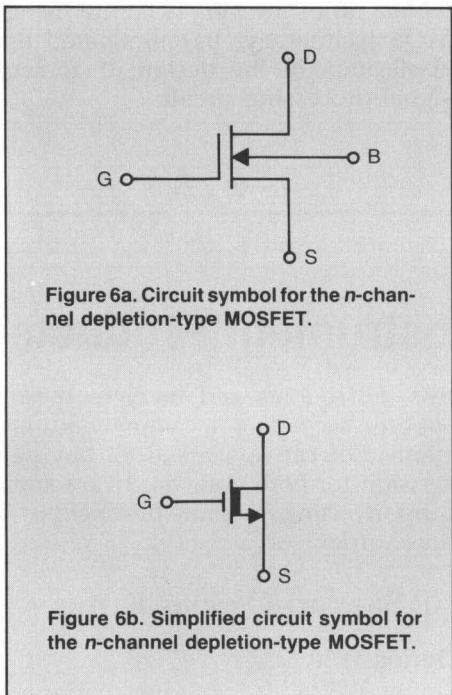


Figure 6. Simplified circuit symbol for depletion-type MOSFET.

As mentioned before, the depletion-type MOSFET operates much like the JFET. The fundamental difference is that in the JFET the channel is depleted by reverse-biasing the gate-to-channel junction. In the MOSFET control of the channel width is effected by an electric field created by the voltage on the gate. The more negative the gate the less current flows.

Figure 6a shows the circuit symbol of the n -channel depletion-type MOSFET. Note that the space between the line

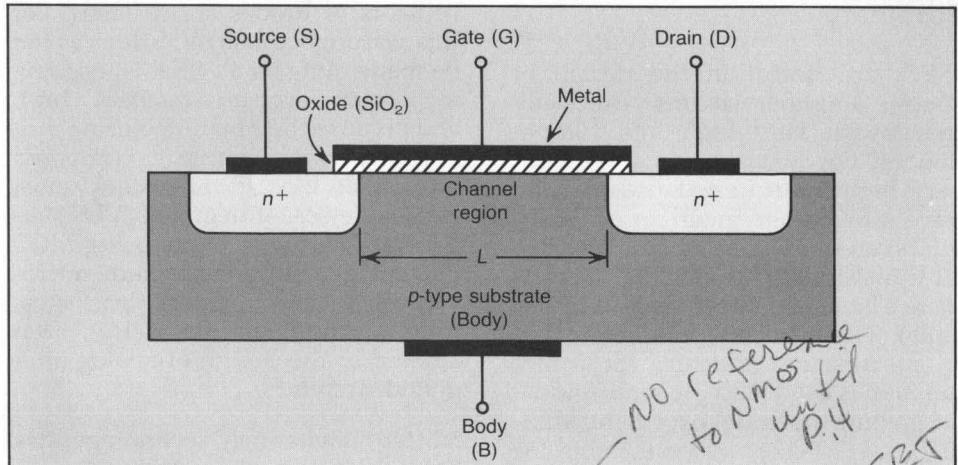


Figure 7. Basic structure of enhancement-type NMOS transistor.

representing the gate electrode and the line representing the channel denotes the insulating oxide layer. The arrow on the substrate line points in the forward direction of the substrate-to-channel pn junction and hence indicates the polarity of the device (n -channel in this case).

In many applications the substrate is electrically connected to the source. Since the drain voltage will be positive with respect to the source, the substrate-to-channel junction will always be reverse-biased and hence the substrate current will be almost zero.

Figure 6b is a simplified symbol of Figure 6a. Note that the polarity of the device is indicated by the direction of the arrowhead on the source line; the arrowhead points in the normal direction of current flow in the source lead.

Enhancement-Type MOSFET Physical Operation

The enhancement-type MOSFET shown in Figure 7 is the most widely used device in the design of MOS integrated circuits. As shown in Figure 7, the structure looks quite similar to that of the depletion device shown in Figure 5, with one exception: there is no channel.

It follows that if the gate is left floating, or if the voltage between the gate and source equals zero, the path from drain to source includes two series diodes back-to-back, which means that no drain current can flow. To cause current to flow from drain to

source we first have to create an n channel. This can be done by applying a positive voltage between the gate and source that is greater than the positive threshold voltage of the particular MOSFET.

Figure 8 shows the circuit symbol of the n -channel enhancement-type MOSFET. The only difference between this symbol and that of the depletion-type shown in Figure 6 is that here the channel is represented by a broken line, which signifies that no channel exists in the enhancement device.

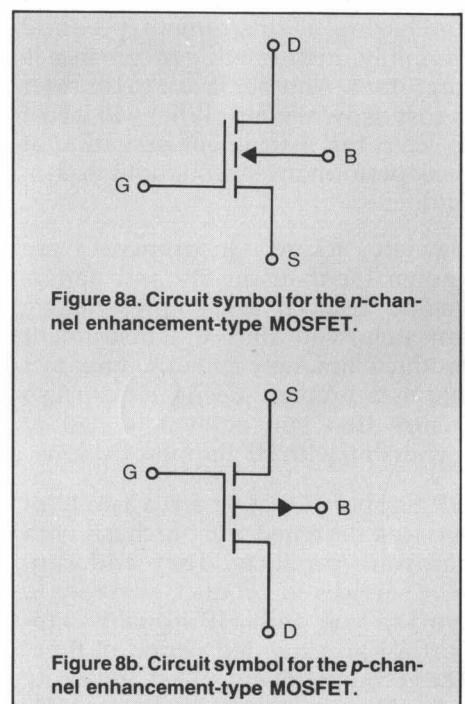


Figure 8. Simplified circuit symbol for the enhancement-type MOSFET.

Summary

JFETs are useful in the design of special amplifier circuits, especially those with very high input impedances. For instance, op amps with very high input impedances usually have a first stage made up of JFETs. JFETs can also be combined with bipolar transistors to provide high-performance linear circuits (called BIFET circuits). The JFET structure employing a metal-semiconductor (Schottky) junction is used with the semiconductor gallium arsenide to form the MESFET, a JFET-like device suitable for application in amplifiers and logic circuits in the gigahertz range. The JFET is also used as an analog switch and in a variety of other analog circuit applications.

Digital logic and memory functions can be implemented with circuits that exclusively use MOSFETs (that is, no

resistors or diodes are needed). For this reason, because MOS devices can be made quite small (that is, occupying a small silicon area on the IC chip), and because their manufacturing process is relatively simple (as compared to that of bipolar transistors), most very-large-scale-integrated (VLSI) circuits are currently made using MOS technology. Examples include microprocessor and memory packages. MOS technology has also been applied to the design of analog integrated circuits.

NMOS (*n*-channel) technology has been perfected where faster devices are occupying smaller silicon area. The other dominant VLSI technology is complementary-symmetry MOS (or CMOS). As the name implies, CMOS circuits use both *n*-channel and *p*-channel devices on the same IC chip. CMOS logic circuits are currently quite popular and are sometimes re-

ferred to as the "ideal" logic family. Moreover, CMOS is capable of implementing a variety of analog circuit functions; therefore, CMOS is the technology of choice whenever analog and digital functions are to be implemented on the same VLSI circuit chip.

MOS transistors have very high input impedance and consume little static power. This makes them quite useful in the design of micropower circuits, both digital and linear. Needless to say, the MOS transistor is also very useful in the design of amplifiers with extremely high input impedance. MOS transistors can also be used as analog switches. This together with the ability to manufacture capacitors whose ratios are very accurate using MOS technology, has motivated its application in the design of analog signal-processing circuits. □

Lock-in Low Cost of Ownership for Your HP Instrument Products

Terry Owen/Hewlett-Packard
Product Support Division

What factors do you consider when purchasing an instrument product? Certainly, instrument performance is important. Another factor to consider is cost of ownership. What will it cost to keep the instrument operating at peak performance throughout its useful life?

Hewlett-Packard instruments are known for their quality and performance. Your HP sales representative can help you find the instrument products uniquely suited to your test and measurement needs. He can also ensure that you enjoy low cost of ownership with HP Support Options.

HP Support Options are a family of services designed for purchase with hardware products. They add support services to product warranty to provide you with HP's quality support for an extended period of time. These competitively priced and easily ordered services demonstrate HP's commitment to quality and low cost of ownership.

Ensure Low Cost of Ownership

HP Support Options offer you excellent support value. Each option is competitively priced and more economical than per-incident services. By purchasing HP Support Options, you benefit by locking-in your cost savings for an extended period. You also save time and money by eliminating unexpected expenses and the associated paperwork.

Maximize Your Hardware Uptime

HP Support Options extend the benefits of warranty coverage. Your products enjoy "head of the queue" priority service from highly trained, factory-backed service technicians. With HP Support Options, you're back in business fast.

Simplify Your Purchase Decision

HP Support Options are designed to fit with your hardware purchase pro-

cess. HP quotes and invoices these options according to your requirements. You can now make one buying decision for both your hardware and support, using the same product purchase order.

HP Support Options Features

Option W30

Option W30 adds to product warranty to provide you with a total of three years of customer return repair service from the time of hardware delivery.

Under Option W30, HP provides all labor, parts, and materials necessary to maintain your product in good operating condition. In addition, HP will perform preventive maintenance and install factory-recommended improvements and modifications, when appropriate, at the time of product repair.

Option W31

Option W31 offers you the convenience of quick, on-site service at an economical price. Option W31 adds to product warranty to provide you

with a total of three years of next-day on-site repair coverage from the time of hardware delivery.

Under Option W31, HP provides all labor, parts and materials necessary to maintain in good operating condition products covered at your designated site. This option is limited to products located within 200 miles of an HP Support Responsible Office. After receipt of your service request, HP responds within the next HP working day. HP also performs preventive maintenance and installs factory-recommended improvements and modifications, when appropriate, at the time of product repair.

Option W32

Hewlett-Packard is known worldwide for the quality, reliability, and integrity of its measurements. HP

calibration services keep your HP instruments operating with precision. Option W32 provides three years of customer return calibration service from the time of hardware delivery. This coverage includes scheduled calibration at HP's recommended calibration cycle, as well as calibration after a required repair performed by HP.

Option W32 is available on hundreds of HP instruments, offering you superior calibration that leads to confidence in measurements. HP manages the recommended calibration cycle, providing you with dependable, thorough calibration to verify that your equipment meets the product's published specifications.

All measurement made by HP in performing calibrations are traceable to

the appropriate national standards organization. HP makes any adjustment necessary for the instrument to meet specifications and performs preventive maintenance. We issue a Certificate of Calibration and place a calibration decal on the instrument, indicating the calibration date and the next calibration due date.

Specify HP Support Options with Your Next Order

HP Support Options are available for most HP test and measurement products. They are available only at the time of hardware purchase, and allow you to extend the benefits of warranty coverage and lock in low support costs. Ask your HP sales rep. to include HP Support Options coverage on your next hardware order. □

Safety-Related Service Notes

Service notes from HP relating to personal safety and possible equipment damage are of vital importance to our customers. To make you more aware of these important notes, they are printed on paper with a red border, and the service note number has an "-S" suffix. In order to make you immediately aware of any potential safety problems, we are highlighting safety-related service notes here with a brief description of each problem. Also, in order to draw your attention to safety-related service notes in the service note index, each appropriate safety-related service note is highlighted with a contrasting color.

Safety Service Note for HP 5450X and 165X Products

A safety service note has been issued for the HP 54501A, 54502A, 54503A, 54504A, 1650A, 1650B, 1651A, 1651B and 1654B products in the following serial number ranges:

The 54510A, 1652B and 1653B are not affected by this service note.

This service note indicates that units falling in the above serial number

| MODEL # | PSSN NUMBER | STARTING S/N | ENDING S/N |
|---------|-------------|--------------|------------|
| 1650A | 1650A-12-S | 2814A04504 | 2814A04573 |
| 1650B | 1650B-04-S | 2924A00461 | 2924A00890 |
| | | 2945A00891 | 2945A02066 |
| 1651A | 1651A-12-S | 2814A02437 | 2814A02470 |
| 1651B | 1651B-04-S | 2924A00241 | 2924A00520 |
| | | 2945A00521 | 2945A01220 |
| 1654B | 1654B-03-S | 3010A00100 | 3010A00141 |
| 54501A | 54501A-05-S | 2930A08612 | 2930A12803 |
| 54502A | 54502A-05-S | 2934A00771 | 2934A03989 |
| 54503A | 54503A-04-S | 2929A00565 | 2929A02997 |
| 54504A | 54504A-01-S | 2944A00100 | 2944A01099 |

ranges should have the resistance of their safety ground checked. This is done by making a simple resistance measurement between the safety ground terminal of the line filter and the rear panel of the instrument. If the resistance (minus multimeter lead resistance) is less than or equal to 0.1 Ohm, the unit passes. If the resistance is greater than 0.1 Ohm, the unit should be sent to an HP Service Center to have the line filter replaced.

The percentage of units with suspect line filters is quite small. There are also two alternate grounding mechanisms that tend to clamp the chassis voltage at a safe level. This resistance measurement should be made to assure the user of complete safety.

Please see the appropriate service note for full details.

HP 4951C Protocol Analyzer

HP 4951Cs with serial numbers 0000F00000/2846F52818 may have an earth ground/rear panel connection that does not meet HP standards. Note that not all instruments within the serial number range require rework, but will require inspection for the possibility of the fault. Please order Safety Service Note 4951C-13-S for more information.

HP 4952A Protocol Analyzer

HP 4952As with serial numbers 0000F00000/2945F23385 may have an earth ground/rear panel connection that does not meet HP safety standards. Note that not all instruments within the serial number range require rework, but will require inspection for the possibility of the fault. Please order Safety Service Note 4952A-14-S for more information.

(See "Service Notes," page 39)

Replacement Part Cross Reference

When selecting replacement parts for your HP products, you may notice that many manuals list only an HP part number for the part, even though it appears that this part is manufactured by one of the large semiconductor manufacturers. Service personnel often ask why only HP part numbers are listed.

It is recommended that HP replacement parts be used to ensure that the original performance of the product will be maintained. While some parts used in HP instruments are identical to those that can be purchased at a local electronics distributor, many times parts will be selected for certain characteristics, such as gain, bandwidth, capacitance, etc. There may also be slight mechanical differences, such as the shaping or length of leads, and in some cases special

quality checks are employed to ensure that only the highest reliability parts are used.

Therefore, we suggest obtaining replacement parts from HP to maintain the quality that you have paid for in your instrument. There may be situations however, where HP replacement parts are not in stock and substituting parts will allow you to return the product to service immediately. In these cases it may be worthwhile to see if a substitute part will work in the circuit. Perhaps an HP part could be ordered and installed at some later date.

To help you in these situations, here is a cross-reference of HP integrated circuit part numbers to manufacturers "generic type" part numbers (whom in most cases is the originator of the

part). Even though the cross-reference only lists one manufacturer, there may actually be several approved sources for an HP part. While every attempt was made to ensure the accuracy of the list, it is advisable to compare the description of the device being replaced with the description of the substituted part. For example, if the service manual describes the device being replaced as a "dual J-K flip-flop", check this against the description of the replacement part.

NOTE

This is not a comprehensive list. If the part number you are looking for is not listed here, the semiconductor is made exclusively for Hewlett-Packard and there is no substitute — it must be replaced with the same HP part number. □

Manufacturers' Code Number Cross Reference

No. Manufacturer

| | |
|-------|------------------------------------|
| 00039 | NEC ELECTRONICS INC |
| 00046 | UNITRODE CORP |
| 00350 | EXAR INTEGRATED SYSTEMS INC |
| 00575 | WESTERN DIGITAL CORP |
| 01425 | STANDARD MICROSYSTEMS CORP |
| 01542 | HP DIV 01 SAN JOSE COMPONENTS |
| 01590 | PLESSEY SEMICONDUCTORS |
| 01698 | TEXAS INSTRUMENTS INC |
| 01795 | SYNERTEK |
| 01876 | HP DIV 02 SCP IC'S |
| 01921 | RCA CORP |
| 01973 | GE CO SEMICONDUCTOR PROD DEPT |
| 02023 | ITW SWITCHES |
| 02037 | MOTOROLA INC |
| 02280 | PRECISION MONOLITHICS INC |
| 02237 | FAIRCHILD SEMICONDUCTOR CORP |
| 02290 | RAYTHEON CO SEMICONDUCTOR DIV HQ |
| 02598 | UNITRODE CORP |
| 02686 | WATKINS-JOHNSON CO |
| 02713 | GENERAL INSTRUMENT CORP (DIODE) |
| 02739 | MINI-CIRCUITS LAB |
| 02763 | TELEDYNE INDUSTRIES INC |
| 02838 | DYNAMIC MEASUREMENTS CORP |
| 02883 | SILICONIX INC |
| 02910 | SIGNETICS CORP |
| 03174 | ANZAC ELEK DIV ADAMS-RUSSEL CO INC |
| 03285 | ANALOG DEVICES INC |
| 03291 | AVANTEK INC |
| 03406 | NATIONAL SEMICONDUCTOR CORP |
| 03545 | TELEDYNE PHILBRICK NEXUS |
| 03677 | AMERICAN MICRO SYSTEMS INC |
| 03688 | ANALOGIC CORP |
| 03714 | INTERSIL INC |
| 03755 | HYBRID SYSTEMS CORP |
| 03780 | INTECH INC |
| 03793 | SILICON GENERAL INC |
| 03794 | ADVANCED MICRO DEVICES INC |
| 03799 | HARRIS CORP |
| 03811 | INTEL CORP |
| 03921 | NMB CORP |
| 03947 | NR CORP |
| 04077 | CERMETEK INC DIV REPUBLIC CORP |
| 04078 | SGS-THOMSON MICROELECTRONICS INC |
| 04092 | MONOLITHIC MEMORIES INC |
| 04183 | NITRON DIV MCDONNELL DOUGLAS CORP |
| 04200 | SPRAGUE ELECTRIC CO |
| 04507 | TRW INC |
| 05450 | GENERAL ELECTRIC CO |
| 05456 | BURR-BROWN CORP |
| 05542 | HONEYWELL INC |
| 05917 | RIFA AB |
| 05946 | VALVO GMBH |
| 06121 | SIEMENS AG |
| 06338 | SGS ATES |
| 06344 | FUJITSU MICROELECTRONICS INC |
| 06347 | HITACHI AMERICA LTD |
| 06352 | TKT CORPORATION OF AMERICA |
| 06353 | TOYO INC |
| 06354 | TOSHIBA CORP |
| 06394 | FERRANTI LTD ELECTRONICS DIV |

No. Manufacturer

| | |
|-------|------------------------------------|
| 06545 | LAMBDA ELECTRONICS CORP |
| 06861 | MICRO NETWORKS CORP |
| 06916 | SONY CORP |
| 07050 | MICRO POWER SYSTEMS |
| 07221 | SUPERTEX INC |
| 07371 | SANYO ELECTRIC INC |
| 07397 | ENGINEERED COMPONENTS CO |
| 08323 | HP DIV 49 CICO |
| 08507 | INTERDESIGN |
| 08608 | SILICON SYSTEMS INC |
| 08779 | MITSUBISHI ELECTRONICS AMERICA |
| 08818 | ROCKWELL INTERNATIONAL |
| 08831 | GTE MICROCIRCUITS |
| 09161 | MITEL SEMICONDUCTOR |
| 09283 | TOPAZ SEMICONDUCTOR |
| 09768 | OKI SEMICONDUCTOR |
| 10253 | INTEGRATED DEVICE TECHNOLOGY, INC |
| 10321 | DATTEL-INTERSIL |
| 10420 | INMOS |
| 10421 | EPSON |
| 10443 | HP DIV 64 NID |
| 10572 | XICOR, INC |
| 10858 | LINEAR TECHNOLOGY CORP |
| 10881 | THOMSON-CSF |
| 11111 | SEQQ TECHNOLOGY INC |
| 11187 | VLSI TECHNOLOGY INC |
| 11302 | MAXIM INTEGRATED PRODUCTS |
| 11320 | ATT TECHNOLOGY |
| 11345 | CYPRESS SEMICONDUCTOR CORP |
| 11452 | ANAREN AUTOMATION PRODUCTS DIV |
| 11561 | RELIABILITY INC |
| 11596 | CIRCUIT TECHNOLOGY INC |
| 11601 | COMLINEAR CORP |
| 11661 | ROCKWELL INT'L, SEMICONDUCTOR DIV. |
| 11681 | CALEX MANUFACTURING CO INC |
| 11777 | ELANTEC INC |
| 11825 | ANALOG SOLUTIONS |
| 11899 | RICOH CORP |
| 11943 | SIERRA SEMICONDUCTOR |
| 11966 | ILC DATA DEVICE CORP |
| 11967 | AT & T TECHNOLOGIES INC |
| 12125 | SAMSUNG SEMICONDUCTOR INC |
| 12126 | VTC INC |
| 12147 | TELMSO INC |
| 12186 | DALLAS SEMICONDUCTOR CORP |
| 12253 | GAMMA HIGH VOLTAGE RESEARCH |
| 12276 | NIPPON GAKKI CO LTD |
| 12382 | LATTICE SEMICONDUCTOR CORP |
| 12385 | S-MOS SYSTEMS |
| 12404 | XILINX INC |
| 12461 | BROOKTREE CORP |
| 12521 | ENDICOTT RESEARCH GROUP |
| 12717 | UNIVERSAL SEMICONDUCTOR INC |
| 12760 | SEIKO EPSON CORP |
| 12880 | ALTERA CORP |
| 12881 | CRYSTAL SEMICONDUCTOR CORP |
| 12882 | CONVERSION DEVICES INC |
| 12905 | ACTEL CORP |
| 12962 | MICRO LINEAR CORP |
| 13053 | MICROCHIP TECHNOLOGY INC |
| 13136 | SYNERGY SEMICONDUCTOR CORP |

Needs title IC Cross Reference

| H P/P/N | Mfr. | Desc. | H P/P/N | Mfr. | Desc. | H P/P/N | Mfr. | Desc. | H P/P/N | Mfr. | Desc. |
|-----------|-------|-------------------------|-----------|-------|-------------------------------|-----------|-------|------------------|-----------|-------|-----------------|
| 0960-0397 | 03285 | ADC12QZ003 | 1816-1008 | 01698 | TBP28S42J | 1816-1712 | 06344 | MB7124HMP | 1818-1757 | 0271 | ER2055 |
| 0960-0790 | 08779 | MF#4128F3 DAP00 | 1816-1032 | 02910 | N82S123N | 1816-1717 | 03794 | AM27S4D0C-T | 1818-1758 | 03811 | D2764-4 |
| 1813-0016 | 06436 | 3112/120 | 1816-1054 | 02910 | N82S185P | 1816-1720 | 06344 | MM10474A-7Z | 1818-1768 | 06347 | HM6116LP-3 |
| 1813-0034 | 03714 | IH5010CPD | 1816-1055 | 01698 | TBP28S42N | 1816-1721 | 06344 | MM10474A-10Z | 1818-1774 | 03811 | P2114AL-4 |
| 1813-0041 | C406 | LH0042CH | 1816-1089 | 03406 | DM74LS189N | 1816-1722 | 03794 | AM27S19APC | 1818-1775 | 06344 | MB8118-12P |
| 1813-0048 | 03285 | 751N | 1816-1137 | 01698 | TBP28S410N | 1816-1725 | 03794 | AM27LS19PC | 1818-1776 | 06344 | MB8118-15P |
| 1813-0054 | 03406 | AH0154D | 1816-1141 | 01698 | SN74188AN | 1816-1726 | 11345 | CY10E474L-5JC | 1818-1784 | 06354 | TC5518CP-20 |
| 1813-0057 | 03406 | LH0024CH | 1816-1142 | 02910 | N82S141P | 1816-1727 | 11345 | 10E422L-5JC | 1818-1785 | 02037 | MCM68764C |
| 1813-0058 | 03406 | LH0022CK | 1816-1153 | 01698 | TBP18S030N | 1816-1728 | 13136 | SY10422-3HCF | 1818-1790 | 06347 | HM6116LP-2 |
| 1813-0082 | 00046 | PIC646 | 1816-1160 | 02910 | N82S181P | 1816-1729 | 06344 | MM10484A-8C-G | 1818-1813 | 01795 | SYP2111A |
| 1813-0083 | 00046 | PIC601 | 1816-1162 | 02910 | N82S141P | 1818-0036 | 02910 | CG725Y MASKED | 1818-1814 | 06354 | TC5514APL-3 |
| 1813-0084 | 00046 | PIC611 | 1816-1163 | 02910 | N82S141P | 1818-0061 | 03406 | MM5241ABLW | 1818-1822 | 02037 | MCM6876C |
| 1813-0092 | 05430 | DAC80-CDD-V | 1816-1174 | 01698 | TBP18S030N | 1818-0093 | 02327 | 331DC | 1818-1824 | 06354 | TM514AP-1 |
| 1813-0093 | 02237 | UAT7H12SC | 1816-1193 | 02910 | N82S2708F | 1818-0094 | 00575 | PR1472B-01 | 1818-1845 | 06344 | MBM8128A-10P |
| 1813-0094 | 05436 | DAC80-CBI-I (SEL'D) | 1816-1299 | 02910 | N82S191P | 1818-0095 | 00575 | PT14B2B-01 | 1818-1877 | 06344 | MB8128-15P |
| 1813-0098 | 05436 | D9217 | 1816-1308 | 02237 | 93L422PC | 1818-0102 | 01698 | TM51403NC | 1818-1887 | 03811 | D2148HL-3 #7511 |
| 1813-0100 | 02237 | UAT7H05SC | 1816-1329 | 01698 | TBP28S46N | 1818-0103 | 01698 | TM54030JL | 1818-1888 | 01698 | TMS2532-10 |
| 1813-0105 | 06861 | DAC80-CBI-V | 1816-1334 | 02237 | 93L422DC | 1818-0108 | 02037 | 66051-1 | 1818-1960 | 04078 | MK4801AN-2 |
| 1813-0109 | 00046 | PIC625 | 1816-1335 | 02037 | MCM10152L | 1818-0115 | 03811 | P1103A | 1818-1966 | 03811 | D2764-3 |
| 1813-0110 | 00046 | PIC626 | 1816-1338 | 02237 | F10145ADC | 1818-0135 | 02037 | MCW68A10S | 1818-1967 | 0078 | MK4801AN-4 |
| 1813-0114 | 02589 | PIC645 | 1816-1339 | 03406 | DM86S64CAB/N | 1818-0140 | 03811 | P2112A-4 | 1818-1968 | 06354 | TC5517CPL-20 |
| 1813-0115 | 00046 | PIC600 | 1816-1358 | 01698 | TBP28S410N | 1818-0146 | 01698 | TM54050JL SELCTD | 1818-1969 | 06347 | HM6267P |
| 1813-0118 | 05436 | DAC80-CBI-I (SEL'D) | 1816-1371 | 04092 | 635281J | 1818-0165 | 03811 | C2107C SELECTED | 1818-1974 | 09768 | MSM5128AS-15 |
| 1813-0123 | 02237 | UAT7H05KC | 1816-1382 | 03799 | HM7-7621-5 | 1818-0197 | 03794 | AM9111BD | 1818-1981 | 06354 | TC5518CPL-20 |
| 1813-0124 | 02237 | UAT7H15KC | 1816-1388 | 01698 | TBP28L22N DISCONTINUED IN USA | 1818-0198 | 03406 | M2102AN-4L | 1818-1982 | 06344 | MBM2732A-30 |
| 1813-0127 | 02237 | UAT7H09KC | 1816-1390 | 02037 | MCM10147L | 1818-0199 | 03794 | AM9112APC | 1818-1985 | 03811 | D2815-4 |
| 1813-0132 | 06861 | MNDAC71CSB-I | 1816-1406 | 03794 | AM27S27DC | 1818-0215 | 02379 | AM9112CDC | 1818-1988 | 01698 | TMS2564-45JL |
| 1813-0133 | 02838 | T162 | 1816-1411 | 03799 | HM7-7611-556I | 1818-0237 | 02910 | N2513N | 1818-1999 | 03811 | D2764-2 |
| 1813-0138 | 02037 | MWH592 | 1816-1418 | 02910 | N82S129P | 1818-0254 | 02910 | N2516N | 1818-2702 | 03811 | D2716-2 |
| 1813-0140 | 05436 | SDM857KG | 1816-1420 | 02037 | MCM10145L | 1818-0277 | 03794 | AM2813ADC | 1818-3005 | 08779 | M5K1614AP-15 |
| 1813-0150 | 03714 | TIC7209PA | 1816-1434 | 02037 | MCM10146L | 1818-0294 | 03794 | AM9112CPC | 1818-3006 | 06347 | HM4846-3 |
| 1813-0155 | 10321 | ADC-H21BGCC (SELECTED) | 1816-1435 | 02037 | MCM10143L | 1818-0317 | 02037 | NCM4027AC2 | 1818-3013 | 06347 | HM6147HP-35 |
| 1813-0177 | 03285 | ADAC80-V | 1816-1436 | 03406 | DM74S288N | 1818-0318 | 03811 | C2101-1 | 1818-3021 | 03811 | D27128-4 |
| 1813-0211 | 02037 | MWA110 | 1816-1446 | 03794 | AM27S03DC | 1818-0320 | 03811 | P2101-2 | 1818-3022 | 10443 | 1818-3022 |
| 1813-0212 | 02037 | MWA120 | 1816-1447 | 02037 | MCM10139L | 1818-0323 | 03794 | AM9112APC | 1818-3023 | 03811 | D2732A |
| 1813-0213 | 02037 | MWA130 | 1816-1451 | 02290 | 29631ADC | 1818-0332 | 03811 | D2115AL | 1818-3044 | 03811 | D2817 |
| 1813-0214 | 02037 | MWA210 | 1816-1456 | 02037 | MCM10149L | 1818-0336 | 02037 | CMC6572L | 1818-3052 | 03811 | D2149H-2 |
| 1813-0215 | 02037 | MWA220 | 1816-1458 | 02910 | N82S191P | 1818-0340 | 03643 | HM4716A-4 | 1818-3059 | 08779 | M5K1614NP-15 |
| 1813-0216 | 02037 | MWA230 | 1816-1459 | 03647 | HM10470 | 1818-0342 | 03811 | P2101A-4 | 1818-3076 | 03811 | D27128 |
| 1813-0217 | 02037 | MWA310 | 1816-1460 | 06344 | HM10415AHZ | 1818-0343 | 03794 | AM9101DPC | 1818-3118 | 10420 | IMS1420S-55 |
| 1813-0218 | 02037 | MWA320 | 1816-1461 | 02910 | N10149F | 1818-0348 | 03794 | AM9102DPC | 1818-3136 | 06344 | MBM27C64-25Z |
| 1813-0219 | 02037 | MWA330 | 1816-1462 | 06347 | HM1042A | 1818-0349 | 03811 | P2111A-2 | 1818-3138 | 00039 | UPD2167D-2 |
| 1813-0232 | 03285 | AD545J | 1816-1467 | 03794 | HM7-7614-5 | 1818-0390 | 03794 | HM5X081JE | 1818-3154 | 03811 | D27128-3 |
| 1813-0251 | 04546 | DAC71-CSB-I | 1816-1468 | 03794 | AM27S19DC | 1818-0425 | 03811 | P2101A-2 | 1818-3159 | 06347 | HM6147LP-5 |
| 1813-0257 | 03285 | AD574AKD | 1816-1469 | 02237 | F100142DC | 1818-0438 | 03811 | P211A-5 | 1818-3160 | 03406 | NMC27C16Q-45 |
| 1813-0264 | 05436 | ADC80AG2-12(PER HP DWG) | 1816-1475 | 02910 | N82S137AN | 1818-0439 | 03794 | HM1-6561B-9 | 1818-3162 | 04078 | MR4801AJ-70 |
| 1813-0283 | 05436 | DAC71-CSB-V | 1816-1481 | 03799 | HM1-7649A-5 | 1818-0443 | 03811 | P211A-6 | 1818-3163 | 01698 | TMS4016-20NL |
| 1813-0310 | 04077 | CH1710-01 | 1816-1482 | 02910 | N82S131P | 1818-0492 | 03811 | P211A-4 | 1818-3164 | 10572 | X2816BP |
| 1813-0311 | 04077 | CH1720-01 | 1816-1492 | 06344 | HM10474H | 1818-0497 | 03794 | HM1-6551-9 | 1818-3165 | 10572 | X2210D |
| 1813-0312 | 04077 | CH1730-01 | 1816-1495 | 03794 | AM27S07APC | 1818-0498 | 03811 | D2716 | 1818-3166 | 06344 | MBB27C64-35 |
| 1813-0313 | 04077 | CH1740-01 | 1816-1512 | 03794 | AM27S291DC | 1818-0500 | 03794 | HM4716A-2 | 1818-3172 | 02037 | MCM6876C-35 |
| 1813-0315 | 03291 | GPD-1003 | 1816-1513 | 03406 | DM75191J | 1818-0533 | 03811 | P2112A | 1818-3174 | 06347 | HM6267LP-45 |
| 1813-0316 | 03291 | UT0-507 | 1816-1516 | 03794 | AM27S25DC | 1818-0562 | 03811 | P211A-5 | 1818-3181 | 00039 | UPD446C-2 |
| 1813-0317 | 03291 | UT0-561 | 1816-1517 | 03794 | AM27S29DC | 1818-0566 | 03947 | 2051 | 1818-3182 | 06347 | HM6264ALP-15 |
| 1813-0318 | 03291 | GPD-410 | 1816-1518 | 03647 | HM2112 | 1818-0630 | 04018 | NCM7040L | 1818-3184 | 10420 | IMS1420P-45 |
| 1813-0322 | 05436 | ADC76JG | 1816-1538 | 01698 | SN74LS219AN | 1818-0695 | 03811 | P211A-6 | 1818-3185 | 06345 | TC5565PL |
| 1813-0361 | 02237 | UAT7P05SC | 1816-1543 | 06344 | HM10474-A15Z | 1818-0696 | 03811 | D815H5 | 1818-3197 | 10572 | IX210D |
| 1813-0385 | 03291 | GPD-430 | 1816-1544 | 03644 | SB0204C | 1818-0700 | 02037 | CMC6581P | 1818-3198 | 06347 | HM6264AP-15 |
| 1813-0410 | 03755 | DAC9377-16-6 | 1816-1547 | 01698 | TBP28L22J | 1818-0701 | 02037 | CMC68A10P | 1818-3214 | 01698 | TMS1416-15' |
| 1813-0437 | 05436 | PA0111BM | 1816-1548 | 03799 | HM7-7649A-5 | 1818-0708 | 03811 | P5101L | 1818-3220 | 10572 | X2804D-45 |
| 1813-0439 | 03291 | UT0-2022 | 1816-1552 | 02237 | F100422DC | 1818-0757 | 02237 | 21102FPC | 1818-3222 | 06344 | MB81C68A-35P |
| 1813-0445 | 03291 | UT0-2024 | 1816-1552 | 02037 | M1C10145L | 1818-0762 | 01698 | TM52532-45JL | 1818-3229 | 06344 | MBM27C64-25Z |
| 1813-0445 | 03291 | UT0-2025 | 1816-1555 | 06347 | HM10422-7 | 1818-0772 | 03811 | D2115A | 1818-3286 | 06354 | TC5518CPL-20 |
| 1813-0446 | 03291 | UT0-517 | 1816-1556 | 03811 | D3628A-1 | 1818-0794 | 03811 | D2716 | 1818-3298 | 00039 | UPD446C-1 |
| 1813-0447 | 03291 | UT0-533 | 1816-1558 | 03794 | AM27S191DC | 1818-0814 | 03811 | D2147H | 1818-3302 | 03811 | D27256-200V10 |
| 1813-0450 | 05436 | D1021 | 1816-1560 | 03794 | AM27S15DC | 1818-0850 | 03811 | D2732 | 1818-3303 | 10420 | IMS1420P-55 |
| 1813-0468 | 11604 | 630AM | 1816-1562 | 01698 | TPB18S030N | 1818-0851 | 01698 | TM52516-35JL | 1818-3305 | 06354 | TC5565PL-15 |
| 1813-0469 | 11596 | 630HM | 1816-1562 | 03794 | AM27S29DC | 1818-0855 | 03794 | HM5-6514-9 | 1818-3307 | 06344 | MB8125-12P |
| 1813-0474 | 00046 | MN376 | 1816-1563 | 02237 | CT3231 | 1818-0877 | 03811 | AM8100AJ-3 | 1818-3333 | 10572 | X2816ADT-45 |
| 1813-0508 | 11604 | CLC103AI | 1816-1577 | 02910 | N82S2212N | 1818-1114 | 04078 | D2142L | 1818-3335 | 06347 | HM6264LP-10 |
| 1813-0511 | 0436 | 2D1025 | 1816-1578 | 03406 | DM74S288N | 1818-1162 | 04078 | MK8018AP-2 | 1818-3336 | 06344 | TM2018AP-45 |
| 1813-0514 | 11561 | VP5/5 (SELECTED) | 1816-1581 | 03794 | AM93425ADC | 1818-1178 | 04078 | MK8010AN-3 | 1818-3337 | 10420 | IMS1400S-45 |
| 1813-0515 | 11561 | V12P5 | 1816-1586 | 06347 | HM2112-1 | 1818-1206 | 03811 | D2125AL | 1818-3338 | 03794 | D27256-205DC |
| 1813-0516 | 03291 | UT0-2027 (SELECTED) | 1816-1591 | 06347 | HM10474-15 | 1818-1207 | 03811 | | | | |

| HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. |
|-----------|-------|------------------------|-----------|-------|-----------------------|-----------|-------|-------------------|-----------|-------|-------------------------|
| 1818-3507 | 06344 | MBM27C128-20Z | 1818-4107 | 00039 | UPD43256CGU-12L | 1818-4532 | 06354 | TC571000AD-15 | 1818-4803 | 11345 | CY7C199-25PC |
| 1818-3510 | 03794 | AM9150-25DC | 1818-4109 | 08779 | MC6264WP-12 | 1818-4535 | 06354 | TC51832PL-10 | 1818-4804 | 11345 | CY7C150-10VC |
| 1818-3519 | 06354 | TMM2016AP-10 | 1818-4111 | 02037 | MC6264WP-55 | 1818-4548 | 11187 | VT20C79-35JC | 1818-4805 | 06354 | TC514400Z-80 |
| 1818-3536 | 00039 | UPD449C-2 | 1818-4117 | 01698 | TMS2532A-30 | 1818-4549 | 11187 | VT20C79-25JC | 1818-4807 | 02037 | MC6206N3J5 |
| 1818-3537 | 03794 | AM9150-35DC | 1818-4118 | 01698 | TMS2532A-35 | 1818-4560 | 06347 | HM6208HP-25 | 1818-4808 | 11111 | FQ28C64-200 |
| 1818-3538 | 00039 | UPD4164C-12/D4164C-12 | 1818-4119 | 01698 | TMS2532A1L-45 | 1818-4569 | 06354 | TC55416P-25 | 1818-4809 | 06354 | TC528126AJ-10 |
| 1818-3539 | 01698 | TMS4257-12FML | 1818-4123 | 01698 | TMS4256P-12FML | 1818-4578 | 03794 | AM28E4BE-250DC | 1818-4810 | 06354 | TC528128AJ-10 |
| 1818-3540 | 01698 | TMS4164-12NL | 1818-4128 | 02037 | MC6268P35 | 1818-4579 | 06347 | HM6207HP-25 | 1818-4811 | 11345 | CY7C136-55JC |
| 1818-3542 | 03794 | AM9122-25P | 1818-4129 | 02037 | MC6268P25 | 1818-4580 | 03811 | N7C128-200V10 OTP | 1818-4812 | 06347 | HM6708P-20 |
| 1818-3543 | 06354 | TC5565APL-15 | 1818-4130 | 02037 | MC6288P-22 | 1818-4582 | 06354 | TC55465P-30 | 1818-4813 | 06354 | TC514100Z-80 |
| 1818-3544 | 06354 | TC57256AD-20 | 1818-4133 | 06354 | TC514256A-10 (or -80) | 1818-4583 | 10572 | X2816P-25 | 1818-4814 | 11345 | CY7B166-10VC |
| 1818-3547 | 10420 | IMS1400P-45 | 1818-4134 | 06344 | MB81C78A-35PSK | 1818-4584 | 06354 | TC514256A-80 | 1818-4819 | 02037 | MC62981J15 |
| 1818-3554 | 03794 | AM27C512-255DC | 1818-4135 | 03794 | AM130-10DC | 1818-4585 | 06354 | TC524256A2-10 | 1818-4820 | 02037 | MC62980J15 |
| 1818-3555 | 10572 | X244P | 1818-4138 | 06354 | TC511000A-10 (or -80) | 1818-4586 | 01698 | TMSC256-1NL | 1818-4821 | 06354 | TC554165J-20 |
| 1818-3556 | 11111 | Q52B33H-300 | 1818-4142 | 06347 | MC6278HP-35 | 1818-4587 | 02037 | MC62702J0 | 1818-4822 | 12186 | DS1220AB-200 |
| 1818-3557 | 11345 | CY7C190-25PC | 1818-4153 | 03794 | AM28E4BE-255DC | 1818-4590 | 08779 | MS27C102K-15 | 1818-4823 | 06347 | HM6789HAP-15 |
| 1818-3559 | 06347 | HM6267P-35 | 1818-4162 | 06347 | HM6264AP-12 | 1818-4591 | 08779 | HM62536AJ-10 | 1818-4824 | 06347 | HM6789HAJ-12 |
| 1818-3560 | 03794 | AM21L48-55DC | 1818-4163 | 06344 | MBM2212-20 | 1818-4592 | 08779 | MS27C101K-12 | 1818-4828 | 06347 | HM6287HP-25 |
| 1818-3604 | 03794 | AM27C128-205DC | 1818-4196 | 03811 | D27C512-150V10 | 1818-4598 | 03794 | AM27C102-150VDC | 1818-4829 | 03794 | AM27C256-125DC |
| 1818-3605 | 04078 | MB4820B-20 | 1818-4197 | 02037 | MC6268P-35 | 1818-4599 | 08779 | MS5256BFP-85L | 1818-4830 | 11345 | CY7C128A-55VC |
| 1818-3614 | 11345 | CY7C128A-55PC | 1818-4198 | 10572 | X2804AD-35 | 1818-4601 | 11345 | CY7C264-55WC | 1818-4831 | 06354 | TC574200D-150 |
| 1818-3617 | 11345 | CY7C147-35PC | 1818-4201 | 03811 | N7C256-200V10 | 1818-4602 | 06354 | TC51832PL-85 | 1818-4832 | 06347 | HM628128P-10 |
| 1818-3618 | 06347 | HM6268HP-45 | 1818-4208 | 11345 | CY7C281-30PC | 1818-4604 | 06347 | HM628128P-12 | 1818-4840 | 02037 | MC4180J20 |
| 1818-3619 | 03406 | NM9306EN | 1818-4210 | 03811 | D27C210-200V10 | 1818-4605 | 06347 | HM6256LFP-10SLT | 1818-4842 | 06347 | HM6207HJP-25 |
| 1818-3620 | 11345 | CY7C169A-25PC | 1818-4211 | 03811 | N7C256-200V10 | 1818-4606 | 03406 | NM9346M8 | 1818-4855 | 03794 | AM27C512-175PC |
| 1818-3641 | 03811 | D27128A | 1818-4213 | 06354 | TC511001AD-20 | 1818-4610 | 06354 | TC514400J-70 | 1818-4857 | 10572 | X28C64S-175 |
| 1818-3642 | 10572 | X2212D | 1818-4215 | 03811 | D27C513-200V10 | 1818-4611 | 06354 | TC514400J-80 | 1818-4858 | 03406 | NM93C9H6M8 |
| 1818-3662 | 06344 | MBM27C256-25 | 1818-4217 | 00039 | UDP4256CGU-15L | 1818-4612 | 06354 | TC514100J-10 | 1818-4859 | 02037 | MC6264DNJ35 |
| 1818-3667 | 06354 | TMM2018AP-35 | 1818-4218 | 06347 | HM6256LFP-10T | 1818-4613 | 06354 | TC514100J-80 | 1818-4861 | 06354 | TC514258A-80 |
| 1818-3735 | 11345 | CY7C168A-35PC | 1818-4225 | 06354 | TC5564ALFP-15 | 1818-4614 | 06354 | TC514101J-10 | 1818-4864 | 06354 | TC554165J-25 |
| 1818-3736 | 11345 | CY7C148-35PC | 1818-4226 | 06354 | TC518CPL-20 | 1818-4615 | 06354 | TC514101J-80 | 1818-4867 | 06916 | CXK7701J-30 |
| 1818-3758 | 06354 | TC57256AD-20 | 1818-4227 | 10572 | X2816P-20 | 1818-4620 | 11698 | TMS446-10NL | 1818-4868 | 11345 | CY7C128A-35SC |
| 1818-3759 | 10420 | IMS14023-35 | 1818-4228 | 06347 | HM6256LFP-12SL | 1818-4621 | 12404 | XCT136A-P8C | 1818-4869 | 10572 | X28C56J-25 |
| 1818-3760 | 06354 | TC5564APL-15 | 1818-4233 | 02037 | MCM2018AN35 | 1818-4629 | 10253 | TD7165S30T | 1818-4870 | 13053 | 28C64-25 |
| 1818-3767 | 03794 | AM9968-45DC | 1818-4234 | 03406 | NM9306EN | 1818-4630 | 11698 | TMSC256-20NL | 1818-4871 | 11345 | CY7C128A-20SC |
| 1818-3768 | 06347 | HM6116FP-4 | 1818-4236 | 08779 | MSM21C68P-45 | 1818-4631 | 11698 | TMSC256-4NL | 1818-4872 | 10253 | IDT715021J35J |
| 1818-3801 | 06347 | HN5806P-40 | 1818-4243 | 06344 | MSM21C7A-35PF | 1818-4642 | 06354 | TC55417J-15 | 1818-4873 | 11345 | CY7C167-25PC |
| 1818-3813 | 06344 | MBM27C256-30Z | 1818-4244 | 11345 | CY7C261-55WC | 1818-4643 | 11698 | MS27C123-173L | 1818-4875 | 04078 | MX41H79N-25 |
| 1818-3814 | 06347 | HM6116ALP-15 | 1818-4249 | 11698 | TMS426-10ML | 1818-4644 | 03046 | NM9306EN | 1818-4876 | 02037 | MC62350J22 |
| 1818-3825 | 03811 | P27C512-200V10 | 1818-4250 | 01698 | TMSC464-10PLM | 1818-4645 | 06354 | TC514256A2-80 | 1818-4877 | 13053 | 28C64-25 |
| 1818-3835 | 03811 | P27128A | 1818-4251 | 06354 | TC514256A-10J | 1818-4646 | 11698 | TMSC252-2NL | 1818-4878 | 06347 | HB56D51232B-8 |
| 1818-3837 | 03811 | D7110A2-1 | 1818-4252 | 02037 | MC6264WP-45 | 1818-4647 | 11698 | TMSC256-6NL | 1818-4879 | 06347 | HB56D132B-8 |
| 1818-3838 | 11345 | CY7C149-35PC | 1818-4263 | 02037 | MC6264WP45 | 1818-4648 | 11698 | TMS27PC128NL | 1818-4880 | 04078 | ST93C46AM1 |
| 1818-3839 | 03811 | P27128A-25 OTP | 1818-4268 | 03921 | HM5210J95-07 | 1818-4652 | 03811 | P2F8512-200 | 1818-4881 | 11345 | CY7C171A-15VC |
| 1818-3880 | 02037 | MCM687GEC-30 | 1818-4269 | 08779 | HM1M09A0J-10 | 1818-4653 | 10572 | X28C56P-20 | 1818-4882 | 04078 | MX41H79N-25 |
| 1818-3901 | 03811 | 51C66-25 | 1818-4270 | 00039 | MC9156A9B-10 | 1818-4654 | 11345 | CY7C123-7PC | 1818-4883 | 04078 | AM27C128-90DC |
| 1818-3909 | 03811 | P27C256-200V10 | 1818-4272 | 06344 | MB8164A-10LPF | 1818-4655 | 03794 | AM27C010-175DC | 1818-4884 | 06347 | TC514200ASJL-80 |
| 1818-3921 | 03406 | NM9346EN | 1818-4284 | 03811 | N7C256-200V10 | 1818-4657 | 03811 | D27C010-120V10 | 1818-4885 | 06347 | TC514256A-10 |
| 1818-3922 | 03811 | P27256-1 | 1818-4293 | 06347 | HM6264ALFP-10 | 1818-4658 | 11345 | CY7C123-7VC | 1818-4886 | 06121 | HYB514100-80 |
| 1818-3928 | 06344 | MBM1C79A-15Z | 1818-4297 | 06344 | MSM21C7A-25P | 1818-4660 | 11698 | TMSC45251-10SD | 1818-4887 | 10253 | IDT715021J35J |
| 1818-3929 | 03794 | AM27C1024-250DC | 1818-4298 | 06344 | MSM21C7A-25P | 1818-4671 | 03046 | NM93C56M | 1818-4888 | 06347 | TC514258A-80 |
| 1818-3930 | 03811 | P27128A-2 OTP | 1818-4299 | 03811 | D27C512-200V10 | 1818-4672 | 06354 | TC55464-15J | 1818-4889 | 06121 | HYB511000AJ-10 (or -80) |
| 1818-3931 | 03811 | P2764A-2 OTP | 1818-4312 | 06354 | TMW2018AP-25 | 1818-4673 | 08779 | MSM27C101JK-15 | 1818-4890 | 06121 | HYB514256A-80 (or -70) |
| 1818-3932 | 06347 | HM6264LPF-15 | 1818-4313 | 06347 | NQ28C64-250 | 1818-4674 | 06347 | TC55475-15J | 1818-4891 | 06121 | HYB51400ASJL-80 |
| 1818-3933 | 03406 | P27C256-200V10 | 1818-4314 | 06347 | TC514256A-20 | 1818-4675 | 11345 | CY7C147-25PC | 1818-4892 | 06347 | TC514256A-10 |
| 1818-3938 | 03406 | NM9346EN | 1818-4315 | 06347 | TC514256A-15 | 1818-4676 | 11345 | TC514150-12SC | 1818-4893 | 06347 | TC514256A-20SC |
| 1818-3943 | 06347 | MS2256L-8P | 1818-4355 | 06347 | TC51709S35P | 1818-4677 | 11345 | TC514256A-20SC | 1818-4894 | 04078 | ST93C46AB-1 |
| 1818-3956 | 03811 | P27256-3 | 1818-4356 | 02037 | IDT7125645P | 1818-4683 | 03794 | AM27C128-255DC | 1818-4895 | 08779 | M5M27C101JK-12 |
| 1818-3957 | 06347 | HM6264LPF-12T | 1818-4357 | 02037 | IDT7125645P | 1818-4686 | 06354 | MC62605L25P-10 | 1818-4896 | 06354 | TC551001PL-10 |
| 1818-3976 | 06354 | TMM2015BP-15 | 1818-4359 | 06347 | NQ28C64-250 | 1818-4687 | 06347 | HM6787HP-15 | 1818-4897 | 06916 | CXK5864BM-70L |
| 1818-3977 | 00039 | UPD4326C-45 | 1818-4360 | 01698 | TMSC256-2JL | 1818-4688 | 06354 | TC514256A-15P | 1818-4898 | 06347 | HM6208HJ-135 |
| 1818-3978 | 06347 | MS2278P-45 | 1818-4374 | 11345 | CY7C166-45PC | 1818-4692 | 06354 | TC55464-17J | 1818-4899 | 06347 | TC514256A-10 |
| 1818-3979 | 08779 | TC55615P-70 | 1818-4376 | 03794 | TC5564APL-15 | 1818-4693 | 06354 | TMSC346M8-6 | 1818-4900 | 08779 | TC514256A-10 |
| 1818-3990 | 06347 | TC511000AP-10 (or -80) | 1818-4423 | 03811 | N7C201-250V05 | 1818-4694 | 03794 | AM27C504-205DC | 1818-4901 | 06347 | TC551001PL-10 |
| 1818-3991 | 06347 | TC511001AP-10 (or -80) | 1818-4424 | 03811 | N7C256-150V10 | 1818-4695 | 11345 | TC55328P-25 | 1818-4902 | 06347 | TC551001PL-80 |
| 1818-3993 | 06347 | TC511001AP-10 (or -80) | 1818-4425 | 01698 | TMS27PC256-2NL | 1818-4696 | 11111 | P28064-250 | 1818-4903 | 06347 | TC551001PL-80 |
| 1818-3995 | 00039 | UPD4126C-15 | 1818-4427 | 06347 | TC514256A-15 | 1818-4697 | 06347 | MB8287-25 | 1818-4904 | 06347 | TC551001PL-80 |
| 1818-3996 | 06347 | TC511001AP-10 (or -80) | 1818-4429 | 03811 | N7C256-150V10 | 1818-4698 | 11345 | TC5588J-15 | 1818-4905 | 03794 | AM27C256-105DC |
| 1818-3997 | 03794 | AM2732B-305DC | 18 | | | | | | | | |

| HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. |
|-----------|-------|--------------------|-----------|-------|------------|-----------|-------|------------|-----------|-------|------------|
| 1820-0127 | 02237 | 9002DC | 1820-0375 | 01698 | SN74H30N | 1820-0610 | 02037 | MC8309P | 1820-0805 | 02037 | MC10107P |
| 1820-0128 | 02237 | 937DC | 1820-0376 | 01698 | SN74H40N | 1820-0611 | 01698 | SN74L82N | 1820-0806 | 02037 | MC10109P |
| 1820-0132 | 02237 | 9016DC | 1820-0377 | 01698 | SN74H50N | 1820-0612 | 02237 | 9030DC | 1820-0807 | 02037 | MC10110P |
| 1820-0134 | 02237 | 9300PC | 1820-0378 | 01698 | SN74H51N | 1820-0613 | 01698 | SN74H05N | 1820-0808 | 02037 | MC10111P |
| 1820-0137 | 01921 | CA3026B | 1820-0379 | 01698 | SN74H52N | 1820-0614 | 02237 | 93L08PC | 1820-0809 | 02037 | MC10115P |
| 1820-0138 | 03545 | S52 | 1820-0380 | 01698 | SN74H53N | 1820-0615 | 02037 | MC8312P | 1820-0810 | 02037 | MC10116P |
| 1820-0140 | 02037 | MC3026P | 1820-0381 | 01698 | SN74H54N | 1820-0616 | 02237 | 93Z2PC | 1820-0811 | 02037 | MC10117P |
| 1820-0141 | 02037 | MC3001P | 1820-0382 | 01698 | SN74H55N | 1820-0617 | 02037 | MC3022P | 1820-0812 | 02037 | MC10118P |
| 1820-0142 | 02037 | MC1004P | 1820-0383 | 01698 | SN74H60N | 1820-0618 | 01698 | SN74L7N | 1820-0813 | 02037 | MC10119P |
| 1820-0143 | 02037 | MC1027P | 1820-0384 | 01698 | SN74H61N | 1820-0619 | 01698 | SN74H22N | 1820-0815 | 02037 | MC10121P |
| 1820-0144 | 02037 | MC1018P | 1820-0385 | 01698 | SN74H62N | 1820-0620 | 01698 | SN74L53N | 1820-0816 | 02037 | MC10130P |
| 1820-0145 | 02037 | MC1010P | 1820-0387 | 01698 | SN74H72N | 1820-0621 | 01698 | SN74S8N | 1820-0817 | 02037 | MC10131P |
| 1820-0146 | 02037 | MC1017P | 1820-0391 | 01698 | SN74H73N | 1820-0622 | 01698 | SN74L51AN | 1820-0818 | 02037 | MC10133L |
| 1820-0157 | 02037 | MC1023P | 1820-0396 | 01698 | TL7020MJ | 1820-0623 | 03406 | DM200N | 1820-0819 | 02037 | MC10134L |
| 1820-0158 | 03406 | LM3023P | 1820-0398 | 01698 | SN72T21ON | 1820-0625 | 02037 | MC666P | 1820-0820 | 02037 | MC10135L |
| 1820-0160 | 02037 | MC1431P | 1820-0400 | 02910 | N8281N | 1820-0626 | 02237 | 9314PC | 1820-0821 | 02037 | MC10136L |
| 1820-0162 | 03406 | LM709H | 1820-0410 | 03406 | MM507 | 1820-0627 | 02237 | 93L01PC | 1820-0822 | 02037 | MC10137L |
| 1820-0174 | 01698 | SN7404N | 1820-0411 | 02037 | MC817P | 1820-0628 | 01698 | SN7489N | 1820-0825 | 02037 | MC10141L |
| 1820-0175 | 01698 | SN7405N | 1820-0412 | 01876 | A139A-0100 | 1820-0629 | 01698 | SN74S112N | 1820-0826 | 02037 | MC10160L |
| 1820-0180 | 02037 | MC1015P | 1820-0417 | 01921 | CA3002 | 1820-0630 | 02037 | MC4044P | 1820-0827 | 02037 | MC10161P |
| 1820-0181 | 02037 | MC1433P | 1820-0418 | 02037 | MC812P | 1820-0631 | 01698 | SN74H108N | 1820-0828 | 02037 | MC10162P |
| 1820-0186 | 02237 | 9856D6 | 1820-0419 | 02910 | SB280F | 1820-0634 | 01876 | B091-0100 | 1820-0829 | 02037 | MC10164L |
| 1820-0187 | 02237 | 9852D6 | 1820-0420 | 01698 | SN74W04N | 1820-0639 | 02037 | MC4001P | 1820-0830 | 02037 | MC10179L |
| 1820-0192 | 01921 | CA 3001 | 1820-0425 | 01698 | SN74L100N | 1820-0640 | 01698 | SN74L50N | 1820-0831 | 02037 | MC10181L |
| 1820-0195 | 02910 | N8780N | 1820-0427 | 02037 | MC1496G | 1820-0655 | 01698 | SN74S25N | 1820-0832 | 03406 | MH0007CH |
| 1820-0196 | 02237 | 723HC | 1820-0429 | 03406 | LM309H | 1820-0656 | 01698 | SN74L98N | 1820-0833 | 02237 | 9334PC |
| 1820-0197 | 03406 | LM709AH | 1820-0430 | 03406 | LM309K | 1820-0657 | 02237 | 9318PC | 1820-0834 | 02037 | MC4038P |
| 1820-0200 | 02037 | MC1030P | 1820-0433 | 01921 | CA3023 | 1820-0658 | 02237 | 93L12PC | 1820-0836 | 02037 | MC4010P |
| 1820-0201 | 02037 | MC1439P | 1820-0435 | 01698 | SN74L80N | 1820-0659 | 02237 | 93L00PC | 1820-0837 | 02910 | N8815M |
| 1820-0203 | 02237 | UA741HC | 1820-0437 | 02037 | MC4015P | 1820-0661 | 01698 | SN7432N | 1820-0839 | 01698 | SN74L75N |
| 1820-0204 | 02037 | MC3006P | 1820-0439 | 02237 | UA723PC | 1820-0665 | 02037 | MC1814P | 1820-0842 | 02037 | MC4008P |
| 1820-0205 | 02037 | MC3003P | 1820-0440 | 02037 | MC1016P | 1820-0668 | 01698 | SN7407N | 1820-0843 | 02037 | MC4002P |
| 1820-0207 | 02237 | 9601P | 1820-0441 | 02037 | MC1801P | 1820-0669 | 02237 | 93L10PC | 1820-0844 | 02037 | MC426P |
| 1820-0211 | 01698 | TMS3002LR | 1820-0443 | 01698 | SN74L93N | 1820-0670 | 01698 | SN74500N | 1820-0846 | 03406 | DM8094N |
| 1820-0212 | 02037 | MC1020P | 1820-0447 | 02037 | MC3060P | 1820-0682 | 01698 | SN74S03N | 1820-0847 | 01698 | SN74H183N |
| 1820-0213 | 02037 | MC1014P | 1820-0450 | 02910 | N8290N | 1820-0683 | 01698 | SN74S04N | 1820-0856 | 02237 | 7400DC |
| 1820-0214 | 01698 | SN74L22AN | 1820-0451 | 02037 | MC3062P | 1820-0684 | 01698 | SN74S05N | 1820-0857 | 02237 | 7420DC |
| 1820-0216 | 02237 | UA741TC (SELECTED) | 1820-0454 | 02037 | MC1805P | 1820-0685 | 01698 | SN74S10N | 1820-0858 | 02237 | 7476DC |
| 1820-0217 | 02237 | UA741TC (SELECTED) | 1820-0455 | 02910 | WB288N | 1820-0686 | 01698 | SN74S11N | 1820-0859 | 02237 | 7477DC |
| 1820-0218 | 03285 | 106A | 1820-0456 | 02910 | N8855N | 1820-0687 | 01698 | SN74S15N | 1820-0860 | 02237 | 951DC |
| 1820-0223 | 03406 | LM301AH | 1820-0459 | 02910 | N8440N | 1820-0688 | 01698 | SN74S20N | 1820-0862 | 02237 | 946DC |
| 1820-0224 | 03406 | LM0020CH | 1820-0460 | 02910 | N8480N | 1820-0689 | 01698 | SN74S22N | 1820-0863 | 02237 | 9158DC |
| 1820-0231 | 02237 | 9316PC | 1820-0461 | 02910 | N8880N | 1820-0690 | 01698 | SN74540N | 1820-0864 | 02237 | 7403DC |
| 1820-0233 | 03406 | DM74193N | 1820-0462 | 02910 | N8881N | 1820-0691 | 01698 | SN74564N | 1820-0865 | 02237 | 944DC |
| 1820-0234 | 02037 | MC1810P | 1820-0468 | 01698 | SN74L55N | 1820-0692 | 01698 | SN74565N | 1820-0866 | 02237 | 949DC |
| 1820-0247 | 03406 | LM305H | 1820-0470 | 03285 | 118A | 1820-0693 | 01698 | SN74586N | 1820-0867 | 02237 | 74H40DC |
| 1820-0252 | 02037 | MC1026P | 1820-0471 | 01698 | SN74O6N | 1820-0695 | 01698 | SN74S113N | 1820-0868 | 02237 | 1801DC |
| 1820-0253 | 02037 | MC1035P | 1820-0473 | 02037 | MC1048P | 1820-0696 | 01698 | SN74S114N | 1820-0869 | 02237 | 935DC |
| 1820-0254 | 01876 | A141A-0100 | 1820-0474 | 01921 | CA3012 | 1820-0697 | 01698 | SN74S140N | 1820-0870 | 02237 | 7408DC |
| 1820-0256 | 02037 | MC858P | 1820-0475 | 03406 | LM306H | 1820-0700 | 02037 | MC3029P | 1820-0875 | 02237 | 9600DC |
| 1820-0257 | 02037 | MC857P | 1820-0476 | 02237 | U715HC | 1820-0701 | 02237 | 93L14PC | 1820-0876 | 01698 | SN74L75N |
| 1820-0258 | 02037 | MC852P | 1820-0477 | 03406 | LM301AN | 1820-0702 | 02237 | 93L11PC | 1820-0879 | 02237 | 7404DC |
| 1820-0259 | 02037 | MC840P | 1820-0478 | 03406 | LM308H | 1820-0704 | 01698 | SN74I22N | 1820-0880 | 02237 | 9305PC |
| 1820-0260 | 02037 | MC839P | 1820-0479 | 02037 | MC835P | 1820-0705 | 02237 | 93L01PC | 1820-0899 | 01698 | SN74L160N |
| 1820-0261 | 01698 | SN74L212N | 1820-0482 | 02237 | 9838DC | 1820-0706 | 02237 | 93Z2PC | 1820-0900 | 02910 | SP370W |
| 1820-0262 | 03406 | DM8590N | 1820-0482 | 02237 | 9816DC | 1820-0707 | 01698 | SN74I41N | 1820-0902 | 01698 | SN75450BN |
| 1820-0269 | 01698 | SN7430N | 1820-0491 | 01698 | SN74L45N | 1820-0708 | 02237 | 93L09PC | 1820-0903 | 01698 | SN74L164N |
| 1820-0272 | 02037 | MC1022P | 1820-0493 | 03406 | LM307N | 1820-0710 | 02237 | 93L22PC | 1820-0906 | 03406 | DM821W |
| 1820-0273 | 02037 | MC1806P | 1820-0495 | 02237 | 93L1PC | 1820-0713 | 01698 | SN74I63N | 1820-0907 | 01698 | SN74L12N |
| 1820-0274 | 02037 | MC1808P | 1820-0497 | 01698 | SN74L95N | 1820-0714 | 01876 | E144D-0200 | 1820-0909 | 01698 | SN74L167N |
| 1820-0276 | 02037 | MC1033P | 1820-0498 | 04200 | UM1500 | 1820-0715 | 01698 | SN74H106N | 1820-0910 | 01698 | SN74L583AN |
| 1820-0277 | 02037 | MC1460P | 1820-0505 | 03406 | DM8220N | 1820-0716 | 01698 | SN74I61N | 1820-0911 | 01698 | SN74L192N |
| 1820-0281 | 01698 | SN74L07N | 1820-0506 | 02910 | N8266N | 1820-0717 | 03406 | MM5052 | 1820-0912 | 01698 | SN74L193N |
| 1820-0282 | 01698 | SN7464N | 1820-0507 | 02910 | N8263N | 1820-0718 | 03406 | DS0025C | 1820-0913 | 01698 | SN74L192N |
| 1820-0285 | 01876 | AI59-0200 | 1820-0508 | 02910 | N8202N | 1820-0719 | 02910 | 8242A | 1820-0914 | 02337 | 9307PC |
| 1820-0286 | 01876 | AI59-0200 | 1820-0509 | 02910 | MC1488L | 1820-0720 | 03406 | DS8830N | 1820-0920 | 02037 | MC1650L |
| 1820-0287 | 02037 | MC672P | 1820-0510 | 02037 | MC1489L | 1820-0721 | 03406 | DS8820AN | 1820-0921 | 01698 | CD426AE |
| 1820-0288 | 02037 | MC662P | 1820-0512 | 01698 | SN7408N | 1820-0723 | 01698 | SN75109N | 1820-0923 | 02910 | N8885N |
| 1820-0292 | 01876 | AI52A-0100 | 1820-0512 | 01698 | SN7437N | 1820-0736 | 01876 | B149A-0150 | 1820-0924 | 01921 | CD4018AE |
| 1820-0293 | 01876 | AI52B-0100 | 1820-0514 | 02910 | N8234N | 1820-0737 | 02337 | 9348PC | 1820-0925 | 01921 | CD4020BE |
| 1820-0294 | 03406 | DM5707N | 1820-0515 | 02237 | 9602PC | 1820-0745 | 02337 | 9015DC | 1820-0936 | 01921 | CD4024BE |
| 1820-0296 | 01876 | AI54B-0100 | 1820-0516 | 02237 | 9112DC | 1820-0747 | 02337 | 9321PC | 1820-0937 | 01921 | CD4040BE |
| 1820-0297 | 01921 | CA3000 | 1820-0516 | 02237 | 9112DC | 1820-0749 | 01698 | SN74H101N | 1820-0938 | 01921 | CD4042BE |
| 1820-0298 | 01921 | CA3020 | 1820-0535 | 01698 | SN75451P | 1820-0750 | 01698 | SN74H87N | 1820-0939 | 01921 | CD4013BE |
| 1820-0301 | 01698 | SN7475N | 1820-0536 | 02910 | N8284N | 1820-0751 | 01698 | SN74I96N | 1820-0946 | 01921 | CD4013AE |
| 1820-0302 | 02910 | SP659PN | 1820-0557 | 01698 | SN74I92N | 1820-0752 | 01698 | SN74H76N | 1820-0947 | 01921 | CD4030AE |
| 1820-0311 | 02037 | | | | | | | | | | |

| HP P/N | Mfr. | Desc. | HP P/N | Mfr. | Desc. | HP P/N | Mfr. | Desc. | HP P/N | Mfr. | Desc. |
|-----------|-------|--------------------|-----------|-------|-------------|-----------|-------|---------------|-----------|-------|-------------|
| 1820-0978 | 01921 | CD4007AE | 1820-1181 | 02037 | MC14522BAL | 1820-1322 | 01698 | SN74S02N | 1820-1467 | 02910 | N82S83N |
| 1820-0979 | 01921 | CD4009AF | 1820-1183 | 02037 | MC4016P | 1820-1323 | 01698 | SN74S30N | 1820-1468 | 03406 | DM8542 |
| 1820-0980 | 01921 | CD4010AF | 1820-1184 | 01698 | SN74S28N | 1820-1324 | 01698 | SN74S124N | 1820-1469 | 01698 | SN74LS107AN |
| 1820-0981 | 01921 | CD4016AE | 1820-1185 | 01698 | SN74L62N | 1820-1325 | 01921 | CD4066AE | 1820-1470 | 01698 | SN74LS157N |
| 1820-0982 | 01876 | C164B-0150 | 1820-1188 | 01921 | CD4046AF | 1820-1327 | 02037 | MC14530BCP | 1820-1471 | 02037 | MC14539BCP |
| 1820-0985 | 02037 | MC1800P | 1820-1189 | 02037 | MC14510BCP | 1820-1328 | 02037 | MC14526BCP | 1820-1473 | 01698 | SN74L148P |
| 1820-0986 | 03406 | DM86L75N | 1820-1190 | 03406 | MM74C173N | 1820-1329 | 02037 | MC14515BCP | 1820-1474 | 02883 | LD114CJ |
| 1820-0987 | 02237 | 93L18PC | 1820-1191 | 01698 | SN74S175N | 1820-1331 | 01921 | CD4051BE | 1820-1475 | 02237 | 93S16DC |
| 1820-0989 | 02910 | N8271N | 1820-1192 | 01698 | SN74L173N | 1820-1332 | 02037 | MC4018P | 1820-1476 | 02910 | N8T96N |
| 1820-0990 | 02037 | MC1489AL | 1820-1193 | 01698 | SN74LS197N | 1820-1334 | 02037 | MC1694L | 1820-1477 | 02910 | N8T95N |
| 1820-0992 | 01698 | SNS490AN | 1820-1194 | 01698 | SN74LS193N | 1820-1335 | 02910 | N8T09N | 1820-1478 | 01698 | SN74LS93N |
| 1820-0993 | 04078 | MK636P | 1820-1195 | 01698 | SN74LS175N | 1820-1338 | 02910 | SNS250N | 1820-1479 | 02037 | MC14553BCP |
| 1820-0995 | 01698 | SN74T47AN | 1820-1196 | 01698 | SN74LS174N | 1820-1339 | 02037 | MC14585BCP | 1820-1482 | 02037 | MC10211P |
| 1820-0998 | 01698 | SN74S153N | 1820-1197 | 01698 | SN74LS00N | 1820-1344 | 02037 | MC12040L | 1820-1483 | 01921 | CD4071BE |
| 1820-0999 | 01698 | SN74S181N | 1820-1198 | 01698 | SN74LS03N | 1820-1346 | 01698 | TMS120NC | 1820-1484 | 02237 | 40098PC |
| 1820-1002 | 01698 | SN74T104N | 1820-1199 | 01698 | SN74LS05N | 1820-1347 | 02237 | 9356PC | 1820-1485 | 03406 | MM74C221N |
| 1820-1003 | 01876 | E144C-0200 | 1820-1200 | 01698 | SN74LS05N | 1820-1348 | 03406 | MM5307N | 1820-1486 | 01921 | CD4081BE |
| 1820-1004 | 02037 | MC7404F | 1820-1201 | 01698 | SN74LS08N | 1820-1349 | 03406 | DM85LS4N | 1820-1488 | 01921 | CD4081BE |
| 1820-1005 | 02237 | 9624PC | 1820-1202 | 01698 | SN74LS10N | 1820-1353 | 03714 | IH5024PA | 1820-1490 | 01698 | SN74LS90N |
| 1820-1006 | 03811 | C1201A | 1820-1203 | 01698 | SN74LS11N | 1820-1354 | 01876 | B149A-0150 | 1820-1491 | 01698 | SN74LS367AN |
| 1820-1007 | 02910 | N8T23N | 1820-1204 | 01698 | SN74LS20N | 1820-1355 | 02037 | MC14532BCP | 1820-1492 | 01698 | SN74LS368AN |
| 1820-1008 | 03811 | C3207 | 1820-1205 | 01698 | SN74LS21N | 1820-1356 | 02037 | MC14528BCP | 1820-1493 | 03406 | MM74C163N |
| 1820-1009 | 02237 | 95940DC | 1820-1206 | 01698 | SN74LS27N | 1820-1357 | 03406 | MM4503CD | 1820-1494 | 02037 | MC140402BCP |
| 1820-1015 | 01698 | SN74S158N | 1820-1207 | 01698 | SN74LS30N | 1820-1358 | 02237 | 93L14PC | 1820-1495 | 02037 | MC140408BCP |
| 1820-1016 | 01698 | SNT7453BP | 1820-1208 | 01698 | SN74LS32N | 1820-1359 | 02037 | MC10174P | 1820-1496 | 02037 | MC14027BCP |
| 1820-1017 | 02237 | 93L21PC | 1820-1209 | 01698 | SN74LS38N | 1820-1360 | 02910 | N8T09N | 1820-1497 | 02037 | MC14013BCP |
| 1820-1019 | 01876 | E144D-0200 | 1820-1210 | 01698 | SN74LS51N | 1820-1361 | 02237 | 9374PC | 1820-1498 | 02037 | MC14025UBCP |
| 1820-1021 | 03406 | DS8800H | 1820-1211 | 01698 | SN74LS86AN | 1820-1362 | 03285 | DAC120ZCB | 1820-1499 | 02037 | MC14001UBCP |
| 1820-1022 | 01698 | SNS404N | 1820-1212 | 01698 | SN74LS12AN | 1820-1363 | 03714 | IM5013ACDD | 1820-1500 | 02037 | MC14011UBCP |
| 1820-1023 | 01698 | SN5493N | 1820-1213 | 01698 | SN74LS13AN | 1820-1364 | 03406 | MM5313N (75-) | 1820-1501 | 02037 | MC14012BCP |
| 1820-1024 | 01698 | SNS416ON | 1820-1214 | 01698 | SN74I216N | 1820-1365 | 03406 | MM74C157N | 1820-1502 | 02037 | MC14015BCP |
| 1820-1027 | 01698 | SN74I195N | 1820-1215 | 01698 | SN74LS136N | 1820-1366 | 03406 | DS0026CM | 1820-1503 | 02037 | MC14007UBCP |
| 1820-1032 | 01698 | SN74I196N | 1820-1216 | 01698 | SN74LS138N | 1820-1367 | 01698 | SNS480N | 1820-1504 | 02037 | MC14016BCP |
| 1820-1037 | 01698 | SNT7446AN | 1820-1217 | 01698 | SN74LS151N | 1820-1368 | 03406 | DM8096N | 1820-1505 | 02037 | MC14049UBCP |
| 1820-1038 | 01698 | SN7448N | 1820-1219 | 00575 | TR1602A | 1820-1372 | 02237 | 74S109DC | 1820-1506 | 02037 | MC14024BCP |
| 1820-1042 | 01698 | SNT74165N | 1820-1220 | 02910 | 2532B | 1820-1373 | 02237 | 93S10DC | 1820-1507 | 02037 | MC14012UBCP |
| 1820-1045 | 02910 | N8273N | 1820-1222 | 02237 | 9504DC | 1820-1374 | 03285 | AD75102DIJN | 1820-1508 | 02037 | MC14017BCP |
| 1820-1046 | 01698 | SN74I156N | 1820-1224 | 02037 | MC10216P | 1820-1375 | 02037 | MC13013 | 1820-1509 | 02037 | MC14023UBCP |
| 1820-1047 | 03406 | DM74L42AN | 1820-1225 | 02037 | MC10231P | 1820-1376 | 03406 | DM76L75N | 1820-1510 | 01921 | CD40531B |
| 1820-1048 | 02910 | N8T20N | 1820-1226 | 01876 | F135-0100 | 1820-1377 | 02237 | 93L14DM | 1820-1511 | 02037 | MC14002UBCP |
| 1820-1049 | 03406 | DM8097N | 1820-1229 | 01698 | SN74I111N | 1820-1378 | 01698 | SN54I192N | 1820-1512 | 02037 | MC14028BCP |
| 1820-1050 | 01698 | SNT74514BP | 1820-1230 | 01698 | SN75491N | 1820-1379 | 01698 | SN54I08N | 1820-1513 | 01921 | CD4051BF |
| 1820-1052 | 02037 | MC10125L | 1820-1231 | 01698 | SN75492N | 1820-1383 | 02037 | MC10138L | 1820-1514 | 02037 | MC14014BCP |
| 1820-1053 | 01698 | SN74I141N | 1820-1234 | 03714 | IHS035CPA | 1820-1383 | 01590 | SP8647BDG | 1820-1515 | 01921 | CD4556BE |
| 1820-1056 | 01698 | SNT74132N | 1820-1235 | 01698 | IHS101CPA | 1820-1385 | 02037 | MC14502BCP | 1820-1516 | 01921 | CD4555BE |
| 1820-1057 | 03406 | DM68176N | 1820-1236 | 03406 | MM5050AH | 1820-1386 | 02037 | MC14506BCP | 1820-1518 | 03406 | DM74LQ00N |
| 1820-1060 | 01876 | P2401 | 1820-1238 | 01698 | SN74LS253N | 1820-1387 | 02037 | MC14519BCP | 1820-1519 | 02037 | MC663P |
| 1820-1063 | 02237 | 93L3PC | 1820-1240 | 01698 | SN74S138N | 1820-1388 | 02037 | MC14583BCP | 1820-1520 | 02037 | MC660P |
| 1820-1064 | 01698 | SN74I164N | 1820-1241 | 02037 | MC14512BCP | 1820-1389 | 03406 | MM84C59N | 1820-1521 | 02037 | MC14050BCP |
| 1820-1065 | 03406 | DS0026CG | 1820-1243 | 01698 | SN74S050J | 1820-1390 | 03406 | MM74C160N | 1820-1522 | 02037 | MC3440AP |
| 1820-1066 | 02237 | 7411PC | 1820-1244 | 01698 | SN74LS153N | 1820-1391 | 03406 | MM74C89N | 1820-1525 | 02037 | MC14008BCL |
| 1820-1068 | 01698 | SNS4H303 | 1820-1245 | 01698 | SN74LS155AN | 1820-1392 | 03406 | MM74C89N | 1820-1526 | 02037 | MC14028BCL |
| 1820-1069 | 01698 | SNS4H40J | 1820-1246 | 01698 | SN74LS059N | 1820-1393 | 03749 | AM2505PC | 1820-1528 | 01921 | CD4029BF |
| 1820-1070 | 01698 | SNS4H30J | 1820-1249 | 02910 | N82533N | 1820-1394 | 02037 | MC10176P | 1820-1529 | 01921 | CD4018AF |
| 1820-1071 | 01698 | SNS4H474J | 1820-1250 | 01698 | SN74I163N | 1820-1400 | 02037 | MC10104P | 1820-1530 | 01921 | CD4027AF |
| 1820-1072 | 01698 | SN74S139N | 1820-1251 | 01698 | SN74LS196N | 1820-1402 | 03406 | MM80C95N | 1820-1531 | 01921 | CD4013AF |
| 1820-1073 | 02910 | N8T242N | 1820-1252 | 02883 | LID110CJ | 1820-1403 | 01921 | CD4072BE | 1820-1532 | 01921 | CD4044AF |
| 1820-1074 | 01698 | SN74I128N | 1820-1253 | 01698 | SN54S050J | 1820-1404 | 01921 | CD4069UBE | 1820-1534 | 01921 | CD4001AF |
| 1820-1075 | 01698 | SNT75150P | 1820-1254 | 03406 | DM8095N | 1820-1405 | 01921 | CD4075BE | 1820-1535 | 01921 | CD4025AF |
| 1820-1076 | 01698 | SN74S174N | 1820-1255 | 03406 | DM8098N | 1820-1407 | 01921 | CD4078BE | 1820-1536 | 01921 | CD4030AF |
| 1820-1077 | 01698 | SNT74S157N | 1820-1256 | 01698 | SN74I22N | 1820-1408 | 01921 | CD4073BE | 1820-1537 | 01921 | CD4002AF |
| 1820-1078 | 02237 | 2102L-2PC | 1820-1257 | 01698 | SN74I159N | 1820-1409 | 01921 | CD4082BE | 1820-1538 | 01921 | CD4011AF |
| 1820-1079 | 02037 | MC14501UBCP | 1820-1258 | 01698 | SN74I178N | 1820-1410 | 01921 | CD4066BE | 1820-1539 | 01921 | CD4012AF |
| 1820-1080 | 02910 | N8T13N | 1820-1259 | 01698 | SN74I179N | 1820-1411 | 01698 | SN74LS75N | 1820-1540 | 01921 | CD4042AF |
| 1820-1081 | 02910 | BT26AN | 1820-1260 | 01698 | SN74I221N | 1820-1420 | 02037 | MC14556BCP | 1820-1541 | 01921 | CD4015AF |
| 1820-1082 | 01698 | SNT74117N | 1820-1261 | 01698 | SN74I283N | 1820-1433 | 02037 | MC14511BCP | 1820-1542 | 01921 | CD4049AF |
| 1820-1084 | 02910 | N8T09BN (SELECTED) | 1820-1262 | 01698 | SN74I290N | 1820-1434 | 01698 | SN74LS12N | 1820-1543 | 01921 | CD4050AF |
| 1820-1085 | 02237 | 9L2DC | 1820-1264 | 01698 | SN74I293N | 1820-1435 | 01698 | SN74LS12N | 1820-1544 | 01921 | CD4076BF |
| 1820-1086 | 04200 | UHP-402 | 1820-1265 | 02037 | MC14527BCP | 1820-1436 | 01698 | SN74LS12N | 1820-1545 | 01921 | CD4053BY |
| 1820-1087 | 01698 | SNT74279N | 1820-1266 | 03406 | MM80C97N | 1820-1437 | 01698 | SN74LS12N | 1820-1546 | 02037 | MC14052BCP |
| 1820-1089 | 01698 | SNT74279N | 1820-1267 | 01698 | SN74I157N | 1820-1438 | 01698 | SN74LS12N | 1820-1547 | 02037 | MC14051BCP |
| 1820-1090 | 01698 | SNT74164N | 1820-1268 | 01698 | SN74I158N | 1820-1439 | 01698 | SN74LS154N | 1820-1548 | 03406 | P8216 |
| 1820-1091 | 03811 | P3101A | 1820-1269 | 01698 | SN74I159N | 1820-1440 | 01698 | SN74LS92N | 1820-1549 | 02037 | MC3441AP |
| 1820-1092 | 01698 | SNT74166N | 1820-1270 | 01698 | SN74I161N | 1820-1441 | 01698 | SN74LS96N | 1820-1550 | 01921 | CD4071BF |
| 1820-1093 | 02037 | MC164B | 1820-1271 | 01698 | SN74I162N | 1820-1 | | | | | |

| H P / N | Mfr. | Desc. | H P / N | Mfr. | Desc. | H P / N | Mfr. | Desc. | H P / N | Mfr. | Desc. |
|-----------|-------|-------------|-----------|-------|-------------|-----------|-------|-----------------|-----------|-------|----------------|
| 1820-1628 | 00350 | XR-2240 | 1820-1865 | 03794 | AM25LS08PC | 1820-2044 | 01698 | SN75461P | 1820-2232 | 02037 | MC14034BCP |
| 1820-1632 | 02037 | MC10178P | 1820-1867 | 03794 | AM25LS09PC | 1820-2046 | 01698 | SN74LS53N | 1820-2233 | 01921 | CD40998F |
| 1820-1633 | 01698 | SN74LS240N | 1820-1868 | 01698 | SN74S197N | 1820-2047 | 01590 | SP8620BDG | 1820-2234 | 03406 | DS3619N |
| 1820-1635 | 02037 | MC14502BAL | 1820-1869 | 01698 | SN74S196N | 1820-2048 | 01921 | C4D0115D | 1820-2236 | 01698 | SN55453BJQ |
| 1820-1638 | 01698 | SN74S280N | 1820-1870 | 03406 | DS8839N | 1820-2049 | 02237 | 74LS196PC | 1820-2237 | 01698 | SN74LS132N |
| 1820-1639 | 01698 | SN74S135N | 1820-1871 | 01698 | SN74S283N | 1820-2050 | 02037 | MC14552BCP | 1820-2239 | 03406 | DP8304BN |
| 1820-1640 | 01698 | SN74LS366AN | 1820-1872 | 03406 | DM81LS96N | 1820-2051 | 02037 | MC14528BCL | 1820-2241 | 01921 | CD40103BF |
| 1820-1641 | 01698 | SN74LS365AN | 1820-1873 | 03406 | DM81LS98N | 1820-2053 | 03406 | DM74LS15N | 1820-2242 | 02237 | 95003DC |
| 1820-1642 | 01698 | SN74LS324N | 1820-1874 | 03406 | DM8556N | 1820-2054 | 02037 | MC14040BCL | 1820-2243 | 01698 | SN75469N |
| 1820-1643 | 01698 | SN74LS249N | 1820-1875 | 03406 | DS8838N | 1820-2055 | 02037 | MC14015BCL | 1820-2244 | 01698 | SN74LS379N |
| 1820-1644 | 01698 | SN74LS248N | 1820-1876 | 03794 | AM74S161N | 1820-2056 | 01698 | SN74LS378N | 1820-2245 | 03406 | MM5369AA/N |
| 1820-1645 | 01698 | SN74LS126AN | 1820-1878 | 01698 | SN54J23J | 1820-2058 | 02037 | MC3448AL | 1820-2247 | 02910 | PLS1000 UNPRGM |
| 1820-1646 | 01921 | CD4055BE | 1820-1879 | 01698 | SN54LS050J | 1820-2061 | 01698 | SN54LS174J | 1820-2248 | 01698 | SN54LS08J |
| 1820-1647 | 01698 | SN74LS02J | 1820-1880 | 01698 | SN54LS27J | 1820-2065 | 03406 | MM74C151N | 1820-2249 | 01698 | SN54LS10J |
| 1820-1648 | 00350 | XR-2207CP | 1820-1881 | 01921 | CD4097BF | 1820-2066 | 02037 | MC10178L | 1820-2250 | 01698 | SN54LS30J |
| 1820-1649 | 01921 | CD4059AD | 1820-1882 | 02037 | MC10113L | 1820-2067 | 02037 | MC10162L | 1820-2251 | 01698 | SN54LS196J |
| 1820-1650 | 01921 | CD4098BE | 1820-1884 | 02910 | N8T97N | 1820-2068 | 01698 | SN74LS325N | 1820-2252 | 01698 | SN54S30J |
| 1820-1651 | 03406 | MM74C901N | 1820-1885 | 03406 | DM74LS173AN | 1820-2071 | 03811 | DD401 | 1820-2253 | 01698 | SN54S40J |
| 1820-1652 | 03406 | MM74C902N | 1820-1887 | 01698 | TS75361AP | 1820-2075 | 01698 | SN74LS245N | 1820-2254 | 03406 | DS75492N |
| 1820-1653 | 03406 | MM74C903N | 1820-1888 | 02037 | MC10231L | 1820-2076 | 03811 | D342 | 1820-2255 | 02037 | MC14503BCP |
| 1820-1654 | 01698 | MM74C904N | 1820-1889 | 01698 | SN74LS26N | 1820-2078 | 01698 | SN74LS490N | 1820-2258 | 02037 | MC14174BCP |
| 1820-1655 | 03406 | MM74C906N | 1820-1890 | 01698 | SN74LS258N | 1820-2079 | 02037 | MC14020BCP | 1820-2259 | 01698 | AC5947NF |
| 1820-1656 | 03406 | MM74C907N | 1820-1891 | 01698 | SN74LS00N | 1820-2080 | 02037 | MC14035BCP | 1820-2261 | 01698 | SN54LS11J |
| 1820-1657 | 02037 | MC14572UBCP | 1820-1892 | 01698 | SN74LS367AN | 1820-2082 | 01698 | SN54H2AJ | 1820-2264 | 02237 | 40408PC |
| 1820-1658 | 02037 | MC14541BCP | 1820-1897 | 01921 | CD4024BF | 1820-2083 | 03406 | CD4029BCN | 1820-2265 | 02237 | 40088PC |
| 1820-1659 | 02037 | MC14582BCP | 1820-1898 | 01921 | CD4021BF | 1820-2084 | 02037 | MC14018BCP | 1820-2266 | 02910 | NE590F |
| 1820-1661 | 01921 | CD4067BE | 1820-1899 | 02037 | MC14516BCL | 1820-2085 | 03406 | CD4019BCN | 1820-2267 | 02910 | NE591F |
| 1820-1662 | 01921 | CD4094BE | 1820-1900 | 02037 | MC14520BCB | 1820-2086 | 02037 | MC14006BCP | 1820-2268 | 01698 | SN74LS45N |
| 1820-1663 | 01921 | CD4095BE | 1820-1901 | 02327 | 9368PC | 1820-2087 | 03714 | IM64021DL | 1820-2270 | 03791 | AM25LS2569DC |
| 1820-1664 | 01921 | CD4096BE | 1820-1905 | 02910 | 74LS260N | 1820-2089 | 02037 | MC14082BCP | 1820-2273 | 04200 | UDN-2981A |
| 1820-1665 | 01921 | CD4099BE | 1820-1907 | 02037 | MC14077BCB | 1820-2091 | 02037 | MC14075BCP | 1820-2274 | 04200 | ULN-2068B |
| 1820-1666 | 02037 | MC14581BCP | 1820-1908 | 02037 | MC14070BCB | 1820-2092 | 01698 | TMS3129NC | 1820-2275 | 03406 | MM74C90N |
| 1820-1668 | 02037 | MC14582BCP | 1820-1909 | 02037 | MC14075BCL | 1820-2093 | 02237 | F10010DC | 1820-2276 | 03406 | MM74C86N |
| 1820-1669 | 01698 | SN74LS174AJ | 1820-1910 | 02037 | MC14073BCB | 1820-2094 | 02377 | 9336HCKD | 1820-2277 | 02037 | MC14022BAL |
| 1820-1670 | 03406 | DS75492N | 1820-1910 | 02037 | MC14073BCB | 1820-2095 | 02237 | 9627PC | 1820-2279 | 02037 | MC14175BCP |
| 1820-1672 | 01921 | CD4077BE | 1820-1911 | 00575 | TR16028-05 | 1820-2096 | 01698 | SN74LS393N | 1820-2281 | 01698 | SN54M61JJG |
| 1820-1673 | 01698 | SN75322N | 1820-1912 | 02037 | MC14042BCP | 1820-2097 | 02037 | MC14543BCP | 1820-2287 | 03406 | DM74S253N |
| 1820-1674 | 03406 | MM74C30N | 1820-1913 | 01698 | SN74S174N | 1820-2102 | 01698 | SN74LS373N | 1820-2289 | 03406 | DS6329N |
| 1820-1675 | 01921 | CD4016AF | 1820-1917 | 01698 | SN74LS240N | 1820-2103 | 03794 | DS056CN | 1820-2292 | 01590 | SP6161BDG |
| 1820-1677 | 01698 | SN74S374N | 1820-1922 | 01698 | SN74LS166AN | 1820-2106 | 02237 | F11C06DC | 1820-2297 | 02037 | MC8500P |
| 1820-1681 | 01698 | TM56011NC | 1820-1924 | 02910 | N8T93N | 1820-2107 | 02237 | 474LS00PC | 1820-2304 | 01698 | SN7422J |
| 1820-1682 | 05946 | SAA1027 | 1820-1930 | 02037 | MC14078BCP | 1820-2110 | 01698 | SN75477P | 1820-2305 | 01698 | SN74LS123J |
| 1820-1683 | 02037 | MC14514BCP | 1820-1931 | 02037 | MC14068BCP | 1820-2111 | 01698 | SN75468W | 1820-2306 | 02037 | MC14490P |
| 1820-1685 | 02037 | MC10195P | 1820-1932 | 02037 | MC14538BCP | 1820-2114 | 02237 | FCM7002PC | 1820-2309 | 03406 | MM74C923N |
| 1820-1686 | 02037 | MC10103P | 1820-1933 | 03406 | MM74C74J | 1820-2117 | 02237 | 9636ATC | 1820-2310 | 04078 | MKS309N |
| 1820-1687 | 02037 | MC3443AF | 1820-1934 | 02180 | DAC-08EQ | 1820-2118 | 02237 | 96S02PC | 1820-2311 | 03791 | AM25LS2521PC |
| 1820-1688 | 01698 | SN74LS247N | 1820-1935 | 03406 | MM74C905N | 1820-2120 | 03794 | AM25LS144DC | 1820-2313 | 01698 | SN74LS673N |
| 1820-1689 | 02037 | MC14046BC | 1820-1936 | 02037 | MC14093BCL | 1820-2121 | 01698 | SN74LS348N | 1820-2321 | 02237 | 95102DC |
| 1820-1693 | 02037 | MC14508BCL | 1820-1937 | 03406 | MM74C83J | 1820-2122 | 02037 | MC14043BCP | 1820-2322 | 04078 | MKS009 |
| 1820-1699 | 03794 | AM25LS175PC | 1820-1942 | 03406 | LF3201N | 1820-2123 | 0237 | 40163BCP | 1820-2323 | 02037 | MC10166L |
| 1820-1700 | 03794 | AM25LS174PC | 1820-1942 | 01698 | SN74S163J | 1820-2125 | 03406 | MM5313N (76+) | 1820-2324 | 02037 | MC10114P |
| 1820-1700 | 03406 | DM25040CN | 1820-1943 | 01698 | SN74S169J | 1820-2127 | 01698 | SN74267N | 1820-2326 | 02037 | MC14504BCP |
| 1820-1721 | 02037 | MC14549BCP | 1820-1944 | 02037 | MC14030L | 1820-2128 | 01698 | SN75151N | 1820-2327 | 02037 | MC10114P |
| 1820-1722 | 02037 | MC14599BCP | 1820-1945 | 02037 | MC10115L | 1820-2129 | 04200 | UHL-407 | 1820-2331 | 01921 | CD4068BF |
| 1820-1725 | 02883 | DG508ACJ | 1820-1946 | 02037 | MC10117L | 1820-2130 | 04200 | ULN-2074B | 1820-2338 | 01590 | SP6617BDG |
| 1820-1728 | 01698 | SN74278N | 1820-1947 | 02037 | MC14490FP | 1820-2132 | 03714 | ICM7218A | 1820-2343 | 03406 | MM74C83N |
| 1820-1729 | 01698 | SN74LS259N | 1820-1948 | 01698 | TL607CP | 1820-2133 | 02037 | MC10123P | 1820-2344 | 02037 | MC14575BCP |
| 1820-1730 | 01698 | SN74LS2123N | 1820-1950 | 02037 | MC10212P | 1820-2134 | 01698 | SN75234N | 1820-2345 | 02883 | D139BP |
| 1820-1732 | 03794 | AM74LS138N | 1820-1951 | 02037 | MC14008BCP | 1820-2136 | 03406 | DS8973N | 1820-2346 | 0237 | SN74LS221J |
| 1820-1733 | 03794 | MM74LS175N | 1820-1952 | 02037 | MC14042BCP | 1820-2138 | 03406 | DS8871N | 1820-2347 | 02037 | MC10159L |
| 1820-1735 | 03406 | MM74C42N | 1820-1954 | 02037 | MC14511BCP | 1820-2139 | 02377 | 11C050DC | 1820-2351 | 01698 | SN74S38J |
| 1820-1738 | 03406 | DS8884AN | 1820-1958 | 02037 | MC14016BCP | 1820-2141 | 03406 | DS8835N | 1820-2352 | 01698 | SN75119P |
| 1820-1740 | 03406 | DS8831N | 1820-1959 | 02037 | MC14028BCP | 1820-2145 | 02037 | MC348TP | 1820-2359 | 02237 | F10014PC |
| 1820-1745 | 03811 | D2425 | 1820-1970 | 02037 | MC14017BCP | 1820-2146 | 03832 | IAA7-6002 | 1820-2361 | 01698 | SN75237N |
| 1820-1759 | 03406 | DM74LS646N | 1820-1971 | 02883 | DG201CJ | 1820-2147 | 02037 | MC10129D | 1820-2362 | 01698 | SN75159N |
| 1820-1778 | 03406 | MM74C914N | 1820-1973 | 01698 | TL6041P | 1820-2149 | 02037 | MC6861P/MC3449P | 1820-2363 | 03406 | DS8676N |
| 1820-1779 | 02037 | MC14111P | 1820-1974 | 01698 | SN74S181J | 1820-2150 | 02037 | MC14112P | 1820-2366 | 02237 | 74LS659PC |
| 1820-1780 | 02237 | 11C09DC | 1820-1975 | 01698 | SN74LS165AN | 1820-2152 | 03406 | DS8973N | 1820-2369 | 01698 | SN74LS629N |
| 1820-1781 | 03799 | H12-2020-5 | 1820-1976 | 02037 | MC14050BCP | 1820-2153 | 02037 | MC10201P | 1820-2375 | 03794 | MM5808PC |
| 1820-1782 | 03794 | AM25LS02PC | 1820-1977 | 02037 | MC12061P | 1820-2154 | 03406 | DS8640N | 1820-2376 | 02037 | MC10195L |
| 1820-1784 | 01698 | SN74LS91N | 1820-1979 | 02910 | N8T75N | 1820-2155 | 02037 | MC6881P/ | 1820-2383 | 02037 | MC14569CP |
| 1820-1786 | 02037 | MC3495CP | 1820-1980 | 02910 | N8T231N | 1820-2156 | 02037 | MC14112P | 1820-2384 | 01698 | SN74LS399N |
| 1820-1787 | 02237 | 7427DC | 1820-1981 | 03794 | AM25S09PC | 1820-2157 | 02037 | MC3450P | 1820-2385 | 02037 | MC10189P |
| 1820-1788 | 02237 | F10016DC | 1820-1982 | 01698 | SN75363N | 1820-2158 | 02037 | MC1426CP | 1820-2386 | 02237 | 100116PC |
| 1820-178 | | | | | | | | | | | |

| H P P / N | Mfr. | Desc. | H P P / N | Mfr. | Desc. | H P P / N | Mfr. | Desc. | H P P / N | Mfr. | Desc. |
|-----------|-------|---------------------|-----------|-------|---------------------|-----------|-------|--------------------|-----------|-------|-----------------|
| 1820-2465 | 03794 | AM25LS2538PC | 1820-2689 | 02237 | 74F20PC | 1820-2899 | 01698 | SN74AS885NT | 1820-3167 | 01698 | SN74LS592N |
| 1820-2466 | 03714 | ICM75515PA | 1820-2690 | 02237 | 74F32PC | 1820-2900 | 02037 | MC10H10P9 | 1820-3168 | 00575 | WD1010BLB |
| 1820-2473 | 04200 | ULN-2065B | 1820-2691 | 02237 | 74F74PC | 1820-2903 | 03794 | AM2964BDC | 1820-3169 | 02037 | MC74HC42 |
| 1820-2474 | 02037 | MC10179P | 1820-2692 | 02237 | 74F86PC | 1820-2906 | 03794 | AM25LS299PC | 1820-3170 | 03406 | MM74HC75N |
| 1820-2475 | 02037 | MC10133P | 1820-2693 | 02237 | 74F100PC | 1820-2907 | 03654 | TC40H38P | 1820-3171 | 02037 | MC74HC85 |
| 1820-2476 | 02037 | MC10132P | 1820-2694 | 02237 | 74F112PC | 1820-2908 | 06354 | TC40H002P | 1820-3172 | 02037 | MC74HC109N |
| 1820-2477 | 02037 | MC10170P | 1820-2695 | 02237 | 74F158PC | 1820-2909 | 06354 | TC40H000P | 1820-3173 | 03406 | MM74HC112N |
| 1820-2478 | 02037 | MC10182P | 1820-2696 | 02237 | 74F175PC | 1820-2913 | 02037 | SN74ALS245N | 1820-3174 | 02037 | MC74HC132N |
| 1820-2479 | 02037 | MC10183L | 1820-2697 | 02237 | 74F194PC | 1820-2914 | 01590 | SP8691A | 1820-3175 | 03406 | MM74HC47N |
| 1820-2480 | 02037 | MC10194P | 1820-2698 | 02237 | 74F240PC | 1820-2921 | 03406 | MM74HC04N | 1820-3176 | 03406 | MM74HC151N |
| 1820-2481 | 02037 | MC10160P | 1820-2699 | 02237 | 74F241PC | 1820-2922 | 02037 | MC74HC00N | 1820-3177 | 02037 | MC74HC157N |
| 1820-2482 | 02037 | MC10129L | 1820-2700 | 02237 | 74F373PC | 1820-2923 | 02037 | MC74HC158N | 1820-3178 | 02037 | MC74HC158N |
| 1820-2483 | 01698 | SN75161AN | 1820-2701 | 02237 | 74F374PC | 1820-2924 | 02037 | MC74HC02N | 1820-3179 | 02037 | MC74HC160N |
| 1820-2485 | 01698 | SN75160AN | 1820-2702 | 02037 | MC1521BPC | 1820-2925 | 02037 | MC74HC161N | 1820-3180 | 03406 | MM74HC164N |
| 1820-2487 | 01921 | CD4056BE | 1820-2703 | 01698 | SN75174N (SELECTED) | 1820-2926 | 03794 | AM25LS2568FC | 1820-3181 | 02037 | MC74HC165N |
| 1820-2488 | 01698 | SN74ALS74AN | 1820-2710 | 01698 | SN75185N | 1820-2933 | 01590 | SP8606G | 1820-3182 | 02037 | MC74HC173N |
| 1820-2495 | 02037 | MC10210P | 1820-2711 | 01698 | SN751854LN | 1820-2934 | 02037 | MC12009P | 1820-3183 | 02037 | MC74HC03N |
| 1820-2496 | 02037 | MC10175L | 1820-2712 | 03714 | ICM72181BJI | 1820-2935 | 02037 | MC12011P | 1820-3184 | 03406 | MM74HC11N |
| 1820-2497 | 02037 | MC10174L | 1820-2713 | 01698 | SN751862N | 1820-2936 | 02237 | 74F151PC | 1820-3185 | 03406 | MM74HC14N |
| 1820-2498 | 02037 | MC10173L | 1820-2715 | 01698 | SN751874P | 1820-2937 | 01698 | SN74LS691N | 1820-3186 | 02037 | MC74HC194N |
| 1820-2499 | 02037 | MC10172L | 1820-2716 | 02037 | MC1513BCL | 1820-2939 | 01698 | SN74LS224N | 1820-3187 | 02037 | MC74HC195N |
| 1820-2500 | 02037 | MC10171L | 1820-2719 | 0409 | SN751874N | 1820-2943 | 09161 | MD74SC244AC | 1820-3188 | 02037 | MC74HC242N |
| 1820-2501 | 02037 | MC10170L | 1820-2720 | 01698 | SN751885N | 1820-2945 | 01921 | CD4502B | 1820-3189 | 02037 | MC74HC243N |
| 1820-2502 | 02037 | MC10165L | 1820-2721 | 03406 | AM2537N | 1820-2947 | 01698 | SN74LS292N | 1820-3190 | 03406 | MM74HC251N |
| 1820-2503 | 02037 | MC10163L | 1820-2722 | 01698 | SN74LS604N | 1820-2950 | 01921 | CD4016BE | 1820-3191 | 02037 | MC74HC257N |
| 1820-2504 | 02037 | MC10161L | 1820-2723 | 01698 | SN74LS620N | 1820-2951 | 01698 | SN74ALS240AN | 1820-3192 | 02037 | MC74HC266N |
| 1820-2506 | 02237 | 74F04PC | 1820-2724 | 01698 | SN74ALS573CN | 1820-2952 | 01698 | UA9638CP SELECTED | 1820-3193 | 02037 | MC74HC280N |
| 1820-2507 | 02037 | MC10153L | 1820-2729 | 02910 | 74LS243N | 1820-2953 | 01698 | UA9637ACP SELECTED | 1820-3194 | 02037 | MC74HC333N |
| 1820-2508 | 02037 | MC10113P | 1820-2735 | 00350 | XK-22W2C | 1820-2954 | 03794 | AM2960DC | 1820-3195 | 02037 | MC74HC343N |
| 1820-2509 | 02237 | 100122DC | 1820-2736 | 02910 | PLS105N UNPRGM | 1820-2955 | 02237 | 74F182PC | 1820-3196 | 02037 | MC74HC4002N |
| 1820-2510 | 02237 | 100136DC | 1820-2738 | 03794 | AM2503PC | 1820-2956 | 02037 | MC10H10P7 | 1820-3197 | 02037 | MC74HC4020N |
| 1820-2511 | 02237 | 100163DC | 1820-2739 | 01698 | SN74ALS02N | 1820-2957 | 03406 | DS865W | 1820-3198 | 02037 | MC74HC4024N |
| 1820-2512 | 02237 | 100164DC | 1820-2740 | 03794 | AM252521PC | 1820-2958 | 01698 | SN74LS423N | 1820-3199 | 02037 | MC74HC4040N |
| 1820-2513 | 02237 | 100179DC | 1820-2742 | 02037 | MC3242AP | 1820-2959 | 02037 | MC10H158P | 1820-3200 | 02037 | MC74HC4060N |
| 1820-2514 | 02237 | 100181DC | 1820-2749 | 03794 | AM26LS31PC | 1820-2960 | 01425 | COM816T | 1820-3201 | 02037 | MC74HC4075N |
| 1820-2515 | 02237 | 100114DC | 1820-2755 | 04200 | UDN-2957A | 1820-2962 | 02037 | MC10H10P3 | 1820-3202 | 02037 | MC74HC514N |
| 1820-2516 | 02037 | MC10211L | 1820-2757 | 01698 | SN74ALS74BN | 1820-2963 | 02037 | MC10H210P | 1820-3203 | 02037 | MC74HC538N |
| 1820-2517 | 02037 | MC10100P | 1820-2758 | 01698 | SN74ALS109AN | 1820-2964 | 01698 | SN74LS422N | 1820-3204 | 03406 | MM74HC192N |
| 1820-2520 | 01698 | SN751643P | 1820-2759 | 01698 | SN74ALS49N | 1820-2967 | 01698 | SN74LS621N | 1820-3205 | 03406 | MM74HC193N |
| 1820-2521 | 04092 | 675376J | 1820-2760 | 02237 | 74F191PC | 1820-2973 | 0406 | DS3686N | 1820-3206 | 03406 | MM74HC259N |
| 1820-2522 | 02910 | 10188N | 1820-2763 | 02237 | 74F258APC | 1820-2978 | 00575 | TR1865B | 1820-3207 | 03406 | MM74HC390N |
| 1820-2526 | 04092 | 74S534N | 1820-2764 | 01698 | SN74LS386AN | 1820-2981 | 03794 | AM2665PC | 1820-3208 | 03406 | MM74HC393N |
| 1820-2527 | 04092 | 74S533N | 1820-2767 | 02237 | 100131DC | 1820-2989 | 03677 | S2859P | 1820-3209 | 03406 | MM74HC688N |
| 1820-2529 | 01698 | SN51LS138J | 1820-2768 | 02237 | 100166DC | 1820-2990 | 03794 | AM25L02DC | 1820-3213 | 01698 | SN74LS647NT |
| 1820-2536 | 01698 | SN74LS352N | 1820-2769 | 02237 | 74F153PC | 1820-2994 | 00832 | IAF9-6101 | 1820-3215 | 03677 | S1602P |
| 1820-2537 | 03404 | MM74C244N | 1820-2772 | 01698 | SN74ALS112AN | 1820-2996 | 04092 | PAL12L10CNS UNPRGM | 1820-3216 | 02237 | 74F299PC |
| 1820-2538 | 03404 | MM74C240N | 1820-2773 | 01698 | SN74ALS30AN | 1820-2998 | 02037 | MC74HC373N | 1820-3217 | 01698 | SN74ALS696N |
| 1820-2540 | 03404 | MM74C925N | 1820-2774 | 01698 | SN74ALS20AN | 1820-3001 | 03654 | TC40H076P | 1820-3220 | 02237 | 74F139PC |
| 1820-2547 | 01698 | SN75162AN | 1820-2775 | 01698 | SN74ALS10AN | 1820-3002 | 01698 | SN74LS651NT | 1820-3221 | 02237 | 74F181PC |
| 1820-2550 | 01698 | SN74LS137N | 1820-2776 | 01698 | SN74ALS160BN | 1820-3003 | 01698 | SN74ALS80AN | 1820-3222 | 02237 | 74F190PC |
| 1820-2557 | 01698 | SN74AS804BN | 1820-2777 | 01698 | SN74ALS161BN | 1820-3007 | 02037 | MC74HC86N | 1820-3223 | 02237 | 74F243PC |
| 1820-2558 | 01698 | SN74AS808BN | 1820-2778 | 01698 | SN74ALS162BN | 1820-3008 | 03406 | MM74HC04UN | 1820-3224 | 02237 | 74F245PC |
| 1820-2559 | 01698 | SN54LS669J | 1820-2779 | 01698 | SN74ALS163BN | 1820-3012 | 02237 | 74F534PC | 1820-3225 | 02237 | 74F251APC |
| 1820-2563 | 02037 | SN74LS182N | 1820-2780 | 04092 | PAL1108CJ UNPRGM | 1820-3013 | 03794 | AM25LS2568DC | 1820-3226 | 02237 | 74F253PC |
| 1820-2566 | 03406 | MM74C240N | 1820-2782 | 04092 | PAL116C1CJ UNPRGM | 1820-3015 | 06354 | TC40H425P | 1820-3227 | 02237 | 74F257PC |
| 1820-2567 | 01698 | AC594N | 1820-2783 | 0406 | MD70C97J | 1820-3018 | 01921 | CD4029AE | 1820-3228 | 02237 | 74F353PC |
| 1820-2569 | 02037 | MC3453P | 1820-2785 | 0400 | UDN-2982A | 1820-3019 | 03794 | AM29825DC | 1820-3229 | 02237 | 74F379PC |
| 1820-2570 | 01698 | SN75365N | 1820-2786 | 02237 | 74F533PC | 1820-3020 | 03794 | AM29845DC | 1820-3230 | 02237 | 74F381PC |
| 1820-2571 | 02037 | MC14569BC | 1820-2795 | 02237 | 74F244PC | 1820-3022 | 01698 | SN74LS599N | 1820-3232 | 02237 | 74F537PC |
| 1820-2573 | 04092 | PAL14H4CJ UNPRGM | 1820-2796 | 09161 | MD74SC214AC | 1820-3058 | 0406 | MM74HC174N | 1820-3233 | 02237 | 74F299PC |
| 1820-2574 | 04092 | PAL12L6CJ UNPRGM | 1820-2799 | 02037 | MC10H10P2 | 1820-3060 | 03714 | ICM7217CPI | 1820-3234 | 02237 | 74F539PC |
| 1820-2575 | 04092 | PAL16R88-2CJ UNPRGM | 1820-2803 | 02037 | MC14001BC | 1820-3062 | 02237 | 0010117DC | 1820-3235 | 03714 | ICM75561PD |
| 1820-2576 | 02037 | MC14011BCL | 1820-2804 | 02037 | MC14052BCL | 1820-3063 | 02237 | 001018DC | 1820-3236 | 01698 | SN74ALS1623N |
| 1820-2579 | 01698 | SN74LS20J | 1820-2807 | 03811 | 7110-1 | 1820-3064 | 02237 | 0010124DC | 1820-3237 | 01698 | SN74ALS873BNT |
| 1820-2581 | 01698 | SN74LS08J | 1820-2816 | 03811 | D7250 | 1820-3066 | 02237 | 0010141DC | 1820-3238 | 01698 | SN74ALS1245A-1N |
| 1820-2582 | 01698 | SN74LS04J | 1820-2817 | 03811 | D7242 | 1820-3067 | 02237 | 0010155DC | 1820-3239 | 01698 | SN74ALS876ANT |
| 1820-2583 | 01698 | SN74LS00J | 1820-2818 | 03811 | D7230 | 1820-3068 | 02237 | 0010156DC | 1820-3241 | 01698 | SN74LS628N |
| 1820-2584 | 01698 | SN74LS38J | 1820-2819 | 01698 | SN74LS630N | 1820-3069 | 02237 | 0010160DC | 1820-3243 | 01698 | UGN-3020T |
| 1820-2585 | 01698 | SN74LS32J | 1820-2820 | 02910 | PLS105N UNPRGM | 1820-3070 | 02237 | 0010170DC | 1820-3245 | 01698 | TMS2150-LJD |
| 1820-2586 | 02037 | Y-5-2376-006 | 1820-2830 | 03794 | AM26LS32BPC | 1820-3078 | 03406 | MM74HC08N | 1820-3246 | 02037 | MC10H176L |
| 1820-2587 | 01698 | SN74LS137N | 1820-2831 | 01698 | SN74ALS138N | 1820-3079 | 02037 | MC74HC138N | 1820-3247 | 02037 | MC74HC244N |
| 1820-2591 | 03406 | MM74C941N | 1820-2842 | 02037 | MC10189L | 1820-3102 | 02037 | MC10H16L | 1820-3248 | 02037 | MC74HC240N |
| 1820-2594 | 01698 | SN74ALS04BN | 1820-2843 | 02037 | MC10195L | 1820-3104 | 01698 | SN74ALS299N | 1820-3249 | 02037 | MC74HC32N |
| 1820-2635 | 01698 | SN74ALS08N | 1820-2 | | | | | | | | |

| HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. |
|-----------|-------|---------------------|-----------|-------|----------------------|-----------|-------|---------------------|-----------|-------|------------------------|
| 1820-3352 | 01698 | SN74LS697N | 1820-3557 | 03794 | AMPAL16R4ADC UNPRGM | 1820-3751 | 01698 | SN74AS534N | 1820-3907 | 01921 | CD41019BE |
| 1820-3353 | 01698 | SN74ALS169BN | 1820-3558 | 01698 | SN74ALS534N | 1820-3755 | 03794 | AM26LS30DC | 1820-3912 | 01698 | SN74AS574FN |
| 1820-3355 | 03794 | PAL16L8ACN UNPRGM | 1820-3559 | 01698 | SN74ALS632AJD | 1820-3757 | 01698 | SN74ALS1032AN | 1820-3913 | 01698 | SN74S112FN |
| 1820-3356 | 03794 | PAL16L8A-2CN UNPRGM | 1820-3560 | 01698 | SN74ALS804N | 1820-3758 | 01698 | SN74ALS22BN | 1820-3914 | 01698 | SN74AS19FN |
| 1820-3358 | 03794 | PAL16R6A-2CJ UNPRGM | 1820-3562 | 01698 | SN74ALS1005N | 1820-3759 | 01698 | SN74ALS33AN | 1820-3916 | 08810 | 10938P |
| 1820-3359 | 03794 | AMPAL16R4LDC UNPRGM | 1820-3563 | 01698 | SN74AS533N | 1820-3760 | 01698 | SN74ALS40AN | 1820-3917 | 08810 | 10939P |
| 1820-3360 | 02037 | MC145000BCP | 1820-3564 | 02037 | MC74HC174J | 1820-3761 | 01698 | SN74ALS113AN | 1820-3918 | 02037 | MC10H106P |
| 1820-3362 | 01698 | SN74ALS640BN | 1820-3565 | 02037 | MC54HC374J | 1820-3762 | 01698 | SN74ALS168AN | 1820-3920 | 01698 | SN74AS1008AN |
| 1820-3372 | 01698 | SN74ALS133N | 1820-3566 | 03406 | PAL14HC4NC UNPRGM | 1820-3763 | 01698 | SN74ALS190N | 1820-3922 | 01698 | SN74AS23LN |
| 1820-3373 | 03406 | M74HC221AN | 1820-3567 | 03406 | PAL16H2NC UNPRGM | 1820-3764 | 01698 | SN74ALS251N | 1820-3923 | 01698 | SN74AS230N |
| 1820-3374 | 02037 | MC74HC241N | 1820-3568 | 03406 | PAL10L8NC UNPRGM | 1820-3765 | 01698 | SN74ALS258N | 1820-3925 | 01698 | SN74ALS561AN |
| 1820-3375 | 01698 | SN74ALS193N | 1820-3570 | 03406 | PAL12H6NC UNPRGM | 1820-3769 | 03206 | DS3245W | 1820-3931 | 02910 | N8X60N |
| 1820-3376 | 01698 | SN74ALS059N | 1820-3571 | 03406 | PAL16L8NC UNPRGM | 1820-3770 | 01698 | SN74LS382AN | 1820-3933 | 03406 | MM74HC365N |
| 1820-3377 | 02883 | DI690CJ | 1820-3572 | 02037 | MC10H175P | 1820-3771 | 01698 | SN74LS699N | 1820-3934 | 01698 | SN74AS138N |
| 1820-3378 | 03406 | DM74ALS373N | 1820-3577 | 02037 | MC10H186P | 1820-3772 | 03794 | AMPAL16H8LPC UNPRGM | 1820-3935 | 02037 | MC12009L |
| 1820-3379 | 01698 | SN75152N | 1820-3578 | 02037 | MC10H162P | 1820-3776 | 01698 | SN74AS882ANT | 1820-3938 | 06347 | HD6350P |
| 1820-3380 | 01698 | SN74ALS641AN | 1820-3579 | 02037 | MC10H141P | 1820-3778 | 02237 | 9636ATC | 1820-3939 | 02910 | 74F85P |
| 1820-3381 | 01698 | SN74ALS808NT | 1820-3580 | 02037 | MC10H161P | 1820-3779 | 02910 | PLS1590A UNPRGM | 1820-3940 | 01921 | CD7HCT174E |
| 1820-3382 | 01698 | SN74ALS1010AN | 1820-3581 | 03406 | DS3687N | 1820-3781 | 03406 | MM74HC56WN | 1820-3941 | 02910 | SCN2611CC124 |
| 1820-3383 | 01698 | SN74ALS805N | 1820-3587 | 02037 | MC1149HCPC | 1820-3782 | 01698 | SN74ALS240A-1N | 1820-3952 | 01698 | SN7LS161AN |
| 1820-3384 | 01698 | SN74ALS232N | 1820-3588 | 03794 | AM25LS62548PC | 1820-3783 | 03794 | PAL16R8B-2CN UNPRGM | 1820-3953 | 01698 | SN7LS747N |
| 1820-3386 | 01698 | SN74ALS15AN | 1820-3590 | 01698 | SN74ALS432N | 1820-3785 | 02037 | MC74HC163N | 1820-3954 | 01698 | SN7LS123N |
| 1820-3387 | 04092 | PAL1L8C8N UNPRGM | 1820-3591 | 01698 | SN74AS400N | 1820-3786 | 01921 | CD7HWC670E | 1820-3956 | 01698 | SN7LS32N |
| 1820-3388 | 04092 | PAL20L10ACNS UNPRGM | 1820-3593 | 01698 | SN74LS494AN | 1820-3787 | 03406 | MM74HC640N | 1820-3959 | 01698 | SN75478P |
| 1820-3391 | 01698 | SN74ALS151N | 1820-3595 | 03474 | HD100150 | 1820-3788 | 02037 | MC74HC58N | 1820-3960 | 01698 | SN74LS596N |
| 1820-3392 | 01698 | SN74ALS808AN | 1820-3596 | 03406 | PAL16C1NC UNPRGM | 1820-3789 | 03406 | MM74HC574N | 1820-3961 | 03794 | AM29811DC |
| 1820-3393 | 01698 | SN74LS354N | 1820-3597 | 03406 | PAL12L6NC UNPRGM | 1820-3790 | 03406 | MM74HC573N | 1820-3962 | 03794 | AM29843DC |
| 1820-3394 | 01698 | SN74ALS059N | 1820-3598 | 01698 | SN74ALS192N | 1820-3791 | 03406 | MM74HC368N | 1820-3963 | 02237 | F1F416PC |
| 1820-3395 | 02910 | NE587N | 1820-3599 | 04092 | PAL16R6A-2CN UNPRGM | 1820-3792 | 03406 | MM74HC367N | 1820-3964 | 02037 | MC12018P |
| 1820-3396 | 02037 | M74HC51N | 1820-3600 | 04092 | PAL16R4-2CN UNPRGM | 1820-3793 | 01698 | SN74HC21N | 1820-3969 | 03406 | DP8451N |
| 1820-3397 | 01698 | SN74ALS153N | 1820-3601 | 04092 | PAL20X8CSN UNPRGM | 1820-3794 | 03406 | MM74HC191N | 1820-3971 | 01698 | SN74AS640N |
| 1820-3398 | 01698 | SN74ALS157AN | 1820-3602 | 04092 | PAL16R8A-2CN UNPRGM | 1820-3795 | 03406 | MM74HC113N | 1820-3972 | 01698 | SN74LS321N |
| 1820-3399 | 02037 | M74HC273N | 1820-3603 | 01698 | SN74ALS452N | 1820-3796 | 03406 | MM74HC139N | 1820-3973 | 01698 | SN74ALS86N |
| 1820-3400 | 02037 | MC10H211P | 1820-3607 | 02037 | SN74ALS242N | 1820-3797 | 01698 | SN74ALS1004FN | 1820-3975 | 03406 | MM74HC514N |
| 1820-3401 | 01698 | SN74ALS1022AN | 1820-3608 | 01698 | SN74ALS454N | 1820-3798 | 01698 | SN74ALS804FN | 1820-3977 | 03794 | AM29826DC |
| 1820-3402 | 01698 | SN74ALS37AN | 1820-3609 | 03406 | CD4048BCJ | 1820-3799 | 01698 | SN74ALS1010AFN | 1820-3982 | 01698 | SN74ALS166N |
| 1820-3405 | 02037 | MC145146P | 1820-3610 | 03794 | AMPAL16H8APC UNPRGM | 1820-3800 | 01698 | SN74ALS1020AFN | 1820-3983 | 02910 | 74F195N |
| 1820-3410 | 01590 | MJ2818DIP | 1820-3611 | 03794 | MC16H8DAD8PC UNPRGM | 1820-3801 | 01698 | SN74ALS805FN | 1820-3986 | 03794 | PAL16R4ACN UNPRGM |
| 1820-3411 | 01698 | SN74ALS175FN | 1820-3613 | 04092 | PAL20R4ACNS UNPRGM | 1820-3802 | 01698 | SN74ALS272FN | 1820-3989 | 01698 | SN74LS601N |
| 1820-3412 | 01698 | SN74ALS241FN | 1820-3614 | 04092 | PAL20R8ACNS UNPRGM | 1820-3803 | 01698 | SN74ALS808FN | 1820-3991 | 01698 | SN74AS21N |
| 1820-3413 | 01698 | SN74ALS86FN | 1820-3615 | 04092 | PAL20L8ACNS UNPRGM | 1820-3804 | 01698 | SN74ALS1011AFN | 1820-3993 | 01698 | SN74ALS575ANT |
| 1820-3417 | 03406 | DP8340N | 1820-3617 | 03794 | AMPAL22V10APC UNPRGM | 1820-3805 | 01698 | SN74ALS1240FN | 1820-3994 | 01698 | SN74ALS243AN |
| 1820-3418 | 03406 | DP8341N | 1820-3620 | 02037 | MC10192L | 1820-3806 | 01698 | SN74ALS1244AFN | 1820-3995 | 02910 | PLS155N UNPRGM |
| 1820-3421 | 04208 | UDN-6118A | 1820-3621 | 01698 | SN74ALS67N | 1820-3807 | 01698 | SN74ALS74AFN | 1820-3996 | 01698 | TIBPAL16L8-15CN UNPRGM |
| 1820-3423 | 01698 | SN74LS559N | 1820-3626 | 03065 | MH74CT241N | 1820-3808 | 01698 | SN74ALS112AFN | 1820-3997 | 01698 | SN74AS842N |
| 1820-3426 | 03794 | AM29863DC | 1820-3629 | 03046 | MH74CT204N | 1820-3809 | 01698 | SN74ALS12AFN | 1820-3998 | 01698 | CD7HCT173N |
| 1820-3431 | 03406 | DS75160AN | 1820-3630 | 03046 | MH74CT242N | 1820-3810 | 01698 | SN74ALS139PN | 1820-3999 | 01698 | AM29821DC |
| 1820-3435 | 02037 | MC10H209L | 1820-3631 | 03046 | MH74CT688AN | 1820-3811 | 01698 | SN74ALS251FN | 1820-4001 | 02237 | 74F650PC |
| 1820-3437 | 01698 | SN74ALS1035N | 1820-3633 | 01698 | SN74ALS100AN | 1820-3813 | 01698 | SN74ALS165FN | 1820-4033 | 01698 | ICL7667CPA |
| 1820-3438 | 01698 | SN74ALS257N | 1820-3634 | 01698 | SN74ALS867NT | 1820-3814 | 01698 | SN74ALS2919P | 1820-4034 | 03794 | AMPAL22V10PC UNPRGM |
| 1820-3439 | 01698 | SN74ALS253N | 1820-3637 | 04200 | ULN-2069B | 1820-3815 | 01698 | SN74ALS373FN | 1820-4044 | 01698 | TIFFLA839NT UNPRGM |
| 1820-3440 | 03406 | DM74LS74N | 1820-3638 | 01698 | SN74ALS66AN | 1820-3816 | 01698 | SN74ALS160BNF | 1820-4050 | 01698 | TIBPAL16R8-15CN UNPRGM |
| 1820-3441 | 01698 | SN74ALS253N | 1820-3639 | 03406 | MH74CT245N | 1820-3817 | 01698 | SN74ALS374FN | 1820-4051 | 01698 | TIBPAL16R6-15CN UNPRGM |
| 1820-3442 | 01698 | SN74ALS303N | 1820-3666 | 02037 | MC10H115P | 1820-3824 | 01698 | AM7990DC/70 | 1820-4052 | 01698 | AM29822DC |
| 1820-3443 | 03406 | MH74CT676N | 1820-3667 | 03406 | MH74CT245N | 1820-3824 | 01698 | SN74ALS373N | 1820-4053 | 01698 | SN74HC05N |
| 1820-3445 | 01698 | SN74ALS174N | 1820-3670 | 03406 | MH74CT232AN | 1820-3831 | 02037 | MC10H174P | 1820-4054 | 01698 | SN74HC190N |
| 1820-3446 | 01698 | SN74ALS175N | 1820-3672 | 02037 | MC74HC253N | 1820-3834 | 03406 | MH58274CN | 1820-4055 | 02037 | MC7H4C511N |
| 1820-3447 | 01698 | SN74ALS832AN | 1820-3673 | 03046 | MH74HC123AN | 1820-3835 | 01698 | SN74ALS680N | 1820-4056 | 02037 | MC7H4C511N |
| 1820-3448 | 01698 | SN74ALS124AN | 1820-3674 | 03046 | MH74HC125N | 1820-3837 | 01698 | SN74ALS165FN | 1820-4057 | 02910 | 74F38N |
| 1820-3449 | 01698 | SN74ALS304AN | 1820-3675 | 03046 | MH74HC304N | 1820-3838 | 01698 | SN74ALS1645N | 1820-4076 | 01698 | SN74ALS577NT |
| 1820-3450 | 02923 | MC10H100P | 1820-3682 | 02037 | MC10H100P | 1820-3843 | 01698 | SN74AS645N | 1820-4077 | 01698 | SN74AS508N |
| 1820-3451 | 02923 | MC10H100P | 1820-3683 | 02883 | D169CK | 1820-3844 | 01921 | CD7HCT173E | 1820-4078 | 02910 | 74HCT257N |
| 1820-3452 | 02037 | MC12090L | 1820-3686 | 02883 | D169CK | 1820-3845 | 01698 | SN74AS645N | 1820-4079 | 02037 | MC10H125P |
| 1820-3453 | 03794 | CP82C82 | 1820-3688 | 03046 | MH74HC045N | 1820-3846 | 02721 | 74HCT63P | 1820-4080 | 02037 | MC10H125P |
| 1820-3454 | 02037 | MC14410P | 1820-3693 | 03046 | MH74HC046N | 1820-3847 | 03406 | MM74HC138N | 1820-4081 | 02037 | CD7HCT173N |
| 1820-3456 | 01698 | SN74ALS404N | 1820-3703 | 02037 | MC10H189P | 1820-3865 | 03794 | AMPAL16R8A-2MJ/883B | 1820-4110 | 04092 | PAL20R6ACNS UNPRGM |
| 1820-3457 | 02923 | CD7HCT308N | 1820-3704 | 01921 | MC1921A98E | 1820-3866 | 02037 | MC10542BCN SELECTED | 1820-4119 | 03534 | TC7HCO40A |
| 1820-3458 | 02923 | SP74HC74N | 1820-3705 | 03406 | DP846IN | 1820-3868 | 00492 | SN74LS794N | 1820-4120 | 03534 | TC7HCT74F |
| 1820-3459 | 02923 | SP74HC74N | 1820-3706 | 01698 | SN74LS652NT | 1820-3869 | 01698 | SN74ALS32FN | 1820-4121 | 03534 | TC7HCT138F |
| 1820-3460 | 02923 | SP74HC74N | 1820-3707 | 01698 | SN74LS451W1N | 1820-3870 | 01698 | SN74ALS1254FN | 1820-4122 | 03534 | TC7HCT374F |
| 1820-3461 | 01698 | SN74ALS645A-1N | 1820-3708 | 01698 | SN74LS1000AN | 1820-3871 | 01698 | SN74ALS737FN | 1820-4123 | 03534 | TC7HCT244F |
| 1820-3462 | 01698 | SN74ALS174N | 1820-3714 | 01698 | SN74ALS254A-1N | 1820-3872 | 01698 | SN74ALS757FN | 1820-4124 | 03534 | TC7HCT245F |
| 1820-3463 | | | | | | | | | | | |

| HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. |
|-----------|-------|----------------|-----------|-------|--------------------|-----------|--------|---------------------|-----------|--------|-------------------------|
| 1820-4177 | 02910 | SCN2672BC4N40 | 1820-4366 | 02910 | 74LS27D | 1820-4691 | 03406 | DS14C88N | 1820-5024 | 03406 | MM58274CV |
| 1820-4179 | 01698 | SN74HC682N | 1820-4367 | 02910 | 74LS04D | 1820-4692 | 01698 | SN74HC00D | 1820-5025 | 01698 | SN74ALS64BNT |
| 1820-4180 | 01698 | SN74ALS158N | 1820-4368 | 02910 | 74LS175D | 1820-4693 | 01698 | SN74HC08D | 1820-5026 | 01698 | SN7406D |
| 1820-4183 | 02910 | 74F367N | 1820-4369 | 02910 | 74LS74D | 1820-4694 | 01698 | SN74ALS653-1NT | 1820-5027 | 01698 | TIBPAL16L8-25CFN UNPRGM |
| 1820-4185 | 03406 | DS3658N | 1820-4371 | 02910 | 74LS32D | 1820-4705 | 02037 | MCT4HC4351N | 1820-5028 | 01698 | TIBPAL16R8-25CFN UNPRGM |
| 1820-4186 | 03406 | DS3669N | 1820-4372 | 02910 | 74LS10D | 1820-4706 | 03406 | MM74HC4316N | 1820-5029 | 02910 | PLS168AN UNPRGM |
| 1820-4187 | 01698 | SN74LS19N | 1820-4373 | 02910 | 74F10D | 1820-4708 | 01698 | SN74AS756N | 1820-5035 | 01698 | SN74ALS35AN |
| 1820-4188 | 02910 | 74HC245D | 1820-4374 | 01698 | SN74LS612N | 1820-4715 | 01698 | SN74AS825NT | 1820-5038 | 01698 | SN74AS1004AD |
| 1820-4189 | 11111 | DQ8023A | 1820-4375 | 01698 | SN74AS286N | 1820-4716 | 01698 | SN74ALS843NT | 1820-5040 | 02910 | 74F74D |
| 1820-4196 | 03406 | MM74HC157N | 1820-4376 | 02910 | 74LS00D | 1820-4719 | 01698 | SN74HC805N | 1820-5041 | 02910 | 74F109D |
| 1820-4197 | 02037 | MC10H123P | 1820-4377 | 02910 | 74F00D | 1820-4720 | 01698 | SN74ALS564AN | 1820-5042 | 02910 | 74F157AD |
| 1820-4198 | 02037 | MC10H160P | 1820-4391 | 01698 | SN74ALS64NT | 1820-4721 | 02910 | 74HC732N | 1820-5043 | 02910 | 74F175D |
| 1820-4199 | 02037 | MC10H332P | 1820-4392 | 03406 | MM74HC283N | 1820-4724 | 01698 | SN75173N | 1820-5045 | 02910 | 74F64D |
| 1820-4200 | 02037 | MC10807L | 1820-4393 | 04092 | PAL12L6-2CJ UNPRGM | 1820-4735 | 01698 | SN75172N | 1820-5051 | 02910 | 74F273D |
| 1820-4201 | 02037 | MC10H424P | 1820-4394 | 03791 | AM7992BDC | 1820-4737 | 01698 | PAL14HC7240DW | 1820-5051 | 02910 | 74F269D |
| 1820-4202 | 02037 | MC10H133P | 1820-4402 | 01698 | SN74ALS805N | 1820-4738 | 02237 | 74ACT374PC | 1820-5052 | 02910 | 74F151D |
| 1820-4203 | 02037 | MC10H136P | 1820-4403 | 03406 | PAL1016P8JC UNPRGM | 1820-4739 | 02910 | 74F579N | 1820-5053 | 02910 | 74F125D |
| 1820-4204 | 02037 | MC10H350P | 1820-4435 | 03794 | PAL16R8-2CN UNPRGM | 1820-4740 | 02037 | MC10H423P | 1820-5054 | 03406 | MM74HC123AM |
| 1820-4205 | 06318 | L298 | 1820-4436 | 03794 | AMPAL16R8LP UNPRGM | 1820-4741 | 02125 | KST4AHCT64ON | 1820-5055 | 02910 | 74HC7151N |
| 1820-4206 | 02037 | MC10H166P | 1820-4437 | 02037 | MC74HC454N | 1820-4742 | 01698 | KST4AHCT240N | 1820-5056 | 02910 | 74HC7161N |
| 1820-4207 | 01698 | SN74AS1036AN | 1820-4438 | 02037 | MC10192P | 1820-4749 | 01698 | KST4AHCT24N | 1820-5057 | 02910 | 74HC710N |
| 1820-4208 | 01698 | SN74HC377N | 1820-4439 | 02910 | 74F37N | 1820-4750 | 04091 | PAL16R4BCN UNPRGM | 1820-5058 | 02237 | 74AC04PC |
| 1820-4209 | 02037 | MC10177P | 1820-4443 | 03535 | TC74HC4094P | 1820-4751 | 04091 | PAL20R8BCNC UNPRGM | 1820-5059 | 01698 | MC3446N |
| 1820-4211 | 01698 | SN74AS639N | 1820-4445 | 01698 | SN74ALS69NT | 1820-4752 | 012125 | KST4AHCT259N | 1820-5061 | 11302 | ICM7218BIP1 |
| 1820-4212 | 02910 | 74HC7245N | 1820-4446 | 03406 | HL0063CK | 1820-4753 | 012125 | KST4AHCT273N | 1820-5064 | 01698 | SN74AS881ANT |
| 1820-4215 | 02910 | 74HC138D | 1820-4447 | 01590 | SP16F60DG | 1820-4754 | 012125 | KST4AHCT138N | 1820-5065 | 04092 | PAL16L8A-4CN UNPRGM |
| 1820-4216 | 02910 | 74HC240D | 1820-4449 | 02910 | 74S273N | 1820-4755 | 03406 | PAL16L8BN UNPRGM | 1820-5066 | 01698 | TMS2150-4NT |
| 1820-4217 | 02910 | F74T67BT | 1820-4450 | 01698 | SN74ALS821NT | 1820-4756 | 03404 | PAL16R8BNC UNPRGM | 1820-5067 | 02237 | 74AC74PC |
| 1820-4218 | 02910 | 74HC85D | 1820-4454 | 11320 | 229CQ | 1820-4757 | 03404 | PAL16R4BNC UNPRGM | 1820-5068 | 02237 | 74C373PC |
| 1820-4219 | 02910 | 74HC27D | 1820-4458 | 02037 | MC74HC26AN | 1820-4758 | 03406 | PAL16R6BNC UNPRGM | 1820-5069 | 01698 | MM74HC051N |
| 1820-4220 | 02910 | 74HC32D | 1820-4459 | 01698 | SN74ALS1804N | 1820-4760 | 10253 | IDT74AHCT24P | 1820-5070 | 01698 | SN74AS1000AD |
| 1820-4228 | 06347 | HD100131 | 1820-4461 | 01698 | SN75176AP | 1820-4761 | 03711 | LB1246 | 1820-5073 | 02910 | MC10B330P |
| 1820-4229 | 02910 | F74T724BGP | 1820-4462 | 02910 | 74HC737TN | 1820-4770 | 03794 | AM29843PC | 1820-5074 | 02037 | 74HC7132P |
| 1820-4232 | 02037 | MC74HC078N | 1820-4489 | 01698 | SN74ALS603AN | 1820-4776 | 01698 | SN74AS4Z24D | 1820-5075 | 01698 | SN74ALS20AD |
| 1820-4233 | 01698 | SN74ALS244A-1N | 1820-4492 | 02910 | 74F27N | 1820-4777 | 02910 | 74F15N | 1820-5076 | 01698 | SN74ALS153D |
| 1820-4235 | 02910 | 74HC273N | 1820-4493 | 04092 | PAL16R6BCJ UNPRGM | 1820-4778 | 02910 | 74F126N | 1820-5077 | 01698 | SN74HC574DW |
| 1820-4242 | 02910 | 74HC1CT1W | 1820-4494 | 04092 | PAL16R8BCJ UNPRGM | 1820-4779 | 02910 | 74HC1715N | 1820-5078 | 04092 | PAL20R8ACNL UNPRGM |
| 1820-4243 | 01698 | SN74ALS08D | 1820-4496 | 01698 | SN74ALS808N | 1820-4780 | 02910 | 74HC175N | 1820-5079 | 01698 | SN74HC574DW |
| 1820-4244 | 01698 | SN74ALS11AD | 1820-4497 | 01698 | SN74ALS678NT | 1820-4781 | 012125 | KST4AHCT00N | 1820-5080 | 02237 | 74F403DC |
| 1820-4245 | 01698 | SN74ALS02D | 1820-4498 | 01698 | SN74ALS454NT | 1820-4786 | 01698 | SN74LS125AD | 1820-5089 | 012125 | KST4AHCT32P |
| 1820-4246 | 01698 | SN74ALS27D | 1820-4500 | 04092 | 67401N | 1820-4787 | 01698 | SN74ALS244ADW | 1820-5100 | 12125 | KST4AHCT257N |
| 1820-4247 | 01698 | SN74ALS32D | 1820-4501 | 04092 | PAL16L2CN UNPRGM | 1820-4788 | 01698 | SN74ALS244BDW | 1820-5101 | 12125 | KST4AHCT258N |
| 1820-4248 | 01698 | SN74ALS86D | 1820-4503 | 03714 | ICM7218E1JL | 1820-4789 | 01698 | SN74LS393D | 1820-5102 | 01698 | SN75ALS194N |
| 1820-4249 | 01698 | SN74ALS04B | 1820-4507 | 00039 | UPD7210 | 1820-4790 | 01698 | SN74LS245ADW | 1820-5111 | 02910 | 74HC721N |
| 1820-4250 | 01698 | SN74ALS05AD | 1820-4522 | 03799 | HL1-16RC6-9 UNPRGM | 1820-4791 | 00354 | XR-T675CP | 1820-5112 | 01698 | SN74LS148D |
| 1820-4251 | 01698 | SN74LS14D | 1820-4523 | 03799 | HL1-16LC8-9 UNPRGM | 1820-4792 | 01542 | HCTL-2000 | 1820-5113 | 02910 | 74F138D |
| 1820-4252 | 01698 | SN74ALS10AD | 1820-4524 | 03799 | HL1-16RC4-9 UNPRGM | 1820-4793 | 01698 | SN75151N | 1820-5114 | 01698 | SN74AS283N |
| 1820-4253 | 03406 | DL18499N | 1820-4525 | 02037 | DS3695N | 1820-4794 | 02040 | UDN-2585A | 1820-5115 | 01698 | SN74ALS564BDW |
| 1820-4255 | 01698 | SN74ALS85D | 1820-4534 | 01698 | SN74HC7001N | 1820-4795 | 01698 | MS5484N | 1820-5133 | 01698 | SN74AS573DW |
| 1820-4256 | 01698 | SN74LS123D | 1820-4535 | 01698 | SN74ALS814NT | 1820-4796 | 01698 | 74F365N | 1820-5134 | 01698 | SN74AS245DW |
| 1820-4257 | 01698 | SN74ALS138D | 1820-4537 | 02237 | 74F676SD | 1820-4797 | 04092 | PAL16L8-2CJ UNPRGM | 1820-5136 | 02910 | 74F260W |
| 1820-4258 | 01698 | SN74ALS139D | 1820-4551 | 02910 | 74F30N | 1820-4798 | 02910 | SCC2691AC1N24 | 1820-5145 | 01698 | SN74ALS114AN |
| 1820-4259 | 01698 | SN74ALS251D | 1820-4552 | 01698 | SN74LS559N | 1820-4799 | 02910 | 74F240D | 1820-5147 | 12125 | KST4AHCT02N |
| 1820-4260 | 01698 | SN74ALS253D | 1820-4554 | 01698 | THCT2000 | 1820-4800 | 02910 | 74F38D | 1820-5148 | 01698 | SN74ALS845NT |
| 1820-4262 | 01698 | SN74ALS257D | 1820-4565 | 11111 | 8023A | 1820-4801 | 02910 | CDT4HCT154E | 1820-5149 | 02237 | 74F573PC |
| 1820-4263 | 01698 | SN74ALS283D | 1820-4566 | 01698 | SN74ALS876N | 1820-4802 | 02910 | 74HC703N | 1820-5150 | 11668 | R8070P-22 |
| 1820-4263 | 01698 | SN74ALS259D | 1820-4567 | 02037 | 74HC725N | 1820-4804 | 01698 | 74F310-100C | 1820-5155 | 03285 | ADSP-101K1 |
| 1820-4265 | 01698 | SN74ALS164D | 1820-4568 | 04000 | UCN-5801A | 1820-4805 | 01698 | CD4048EF | 1820-5157 | 03285 | ADSP-3210KG |
| 1820-4266 | 01698 | SN74ALS165D | 1820-4569 | 02037 | MC74HC454N | 1820-4807 | 03406 | DP8451V4-4 | 1820-5158 | 04092 | PAL16R8B-2CN UNPRGM |
| 1820-4267 | 01698 | SN74LS194D | 1820-4574 | 02037 | MC74HC052N | 1820-4808 | 01698 | SN74ALS533N | 1820-5161 | 03794 | AM7911PC |
| 1820-4268 | 01698 | SN74LS194D | 1820-4575 | 01698 | SN74LS253N | 1820-4809 | 01698 | PAL16L8A-2CN UNPRGM | 1820-5162 | 04092 | PAL16R8ACN UNPRGM |
| 1820-4269 | 01698 | SN74LS194D | 1820-4576 | 02037 | MC74HC052N | 1820-4810 | 01698 | SN74ALS533W | 1820-5163 | 03406 | PAL16R8NC UNPRGM |
| 1820-4277 | 01698 | SN74LS273D | 1820-4587 | 02037 | MC74HC064N | 1820-4811 | 01698 | SN74ALS174D | 1820-5182 | 01698 | SN74ALS2982NT |
| 1820-4278 | 01698 | SN74LS377D | 1820-4588 | 01698 | SN74HC646NT | 1820-4812 | 01698 | SN74ALS38D | 1820-5183 | 01698 | SN751518N |
| 1820-4279 | 01698 | SN74ALS574DW | 1820-4589 | 02910 | 74HC786N | 1820-4813 | 01698 | SN74ALS520D | 1820-5187 | 01698 | SN74ALS621A-1N |
| 1820-4280 | 01698 | SN74AS500D | 1820-4590 | 03406 | MC74HC23AN | 1820-4814 | 01698 | SN74ALS541D | 1820-5188 | 01698 | SN74ALS622A-1N |
| 1820-4281 | 01698 | SN74AS508D | 1820-4591 | 01698 | SN74ALS1034AN | 1820-4815 | 01698 | SN74ALS161BD | 1820-5207 | 020910 | PAL20L10ACNS UNPRGM |
| 1820-4282 | 01698 | SN74AS502D | 1820-4592 | 01698 | SN74ALS353N | 1820-4816 | 01698 | SN74ALS161BD | 1820-5212 | 02910 | 74F404N |
| 1820-4284 | 01698 | SN74AS532D | 1820-4594 | 01698 | SN74LS652NT | 1820-4817 | 01698 | SN74ALS656N | 1820-5213 | 02037 | MC1449ODW |
| 1820-4285 | 01698 | SN74AS525D | 1820-4597 | 02337 | 74F535PC | 1820-4818 | 01698 | SN74ALS163D | 1820-5215 | 04092 | PAL16BDCN UNPRGM |
| 1820-4286 | 01698 | SN74AS194D | 1820-4599 | 04000 | UDN-2543B | 1820-4819 | 02910 | 74HC86D | 1820-5216 | 02910 | PAL179N UNPRGM |
| 1820-4287 | 01698 | SN74AS68D | 1820-4600 | 02037 | MC3405P | 1820-4820 | 03794 | AMPA16R8LP UNPRGM | 1820-5218 | 02910 | 74F244D |
| 1820-4288 | 01698 | SN74AS69D | 1820-4601 | 03406 | MC74HC075N | 1820-4821 | 01698 | SN7 | | | |

| HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. |
|-----------|-------|--------------------------|-----------|-------|---------------------|-----------|-------|--------------------------|-----------|-------|----------------------|
| 1820-5320 | 01698 | SN74AS832BDW | 1820-5608 | 02037 | MC10H135FN | 1820-5808 | 02037 | MC74HC273DW | 1820-6072 | 02237 | 74AC161PC |
| 1820-5321 | 01698 | SN74AS805BDW | 1820-5609 | 02037 | MC10H136FN | 1820-5811 | 02910 | 74F158AD | 1820-6073 | 02237 | 74AC171PC |
| 1820-5322 | 01698 | SN74AS21D | 1820-5610 | 02037 | MC10H141FN | 1820-5812 | 06338 | L298HN | 1820-6074 | 02910 | 74HCT10D |
| 1820-5323 | 01698 | SN74AS6N6DW | 1820-5611 | 02037 | MC10H150FN | 1820-5813 | 11302 | MAX238CNG | 1820-6075 | 02910 | 74HCT390D |
| 1820-5324 | 01698 | SN74LS126AD | 1820-5612 | 01698 | SN74ALS103SD | 1820-5816 | 04092 | PAL16H2-2CN UNPRGMD | 1820-6080 | 00046 | UC3707N |
| 1820-5325 | 01698 | SN74LS244DW | 1820-5613 | 01698 | SN74ALS575DW | 1820-5817 | 04092 | PAL8L14ACN UNPRGMD | 1820-6103 | 10253 | IDT29FC752AP |
| 1820-5326 | 01698 | AM26LS31CD | 1820-5614 | 01698 | SN74AS504D | 1820-5820 | 01698 | SN74ALS527DW | 1820-6105 | 03794 | IDT7203S120P |
| 1820-5327 | 01698 | AM26LS32CD | 1820-5615 | 01698 | SN74AS174D | 1820-5822 | 03794 | AMPAL20XRP4-30PC UNPRGMD | 1820-6105 | 10253 | 74F657N |
| 1820-5328 | 01698 | SN7518BD | 1820-5616 | 01698 | SN74AS175AD | 1820-5823 | 01698 | MC10H350FN | 1820-6109 | 03794 | AM29B21AJC |
| 1820-5329 | 02037 | MC189AD | 1820-5617 | 01698 | SN74AS1109D | 1820-5823 | 02037 | MC10H131FN | 1820-6112 | 01698 | SN74ALS540DW |
| 1820-5330 | 01698 | SN7518LFN | 1820-5618 | 01698 | SN74ALS1005D | 1820-5823 | 11668 | R5325-18 | 1820-6113 | 01698 | SN74ALS832ADW |
| 1820-5331 | 02910 | 74F12H2D | 1820-5619 | 01698 | SN74LS67D0 | 1820-5826 | 11668 | R5310-18 | 1820-6114 | 01698 | SN74ALS157D |
| 1820-5332 | 03106 | PAL16L8B2VC UNPRGMD | 1820-5621 | 01698 | SN74ALS666NT | 1820-5827 | 02237 | 74AC240PC | 1820-6115 | 01698 | SN74ALS151D |
| 1820-5338 | 10858 | LT1081-CN | 1820-5626 | 02910 | 74F168N | 1820-5828 | 02237 | NCR5381 | 1820-6116 | 01698 | SN74ALS805ADW |
| 1820-5339 | 03046 | MM5540N | 1820-5627 | 01698 | SN74HC353N | 1820-5829 | 02910 | SCC2698BC1A84 | 1820-6117 | 02910 | 74F382D |
| 1820-5346 | 03811 | D5C060-35 | 1820-5628 | 01698 | SN74ALS760N | 1820-5830 | 02910 | SN74ALS157D | 1820-6128 | 03406 | MM74HC161CM |
| 1820-5366 | 06344 | MB87030CR | 1820-5629 | 02037 | MC10H131FN | 1820-5831 | 03406 | DS8622AN | 1820-6129 | 03406 | MM74HC164M |
| 1820-5371 | 03406 | DS8922AN | 1820-5630 | 01698 | SN74ALS153D | 1820-5832 | 03406 | VL8C311 | 1820-6130 | 03406 | SN74ALS5223NT |
| 1820-5374 | 02237 | 74F573A9PC | 1820-5640 | 11187 | | 1820-5833 | 02910 | 74F1245N | 1820-6131 | 02237 | 74ACT08PC |
| 1820-5375 | 02910 | 74F166N | 1820-5641 | 03406 | PAL16L8A8VC UNPRGMD | 1820-5834 | 0237 | 74ACT253PC | 1820-6133 | 02237 | 74ACT109SC |
| 1820-5376 | 02237 | 74AC157SC | 1820-5644 | 03794 | AM29C821SC | 1820-5835 | 0237 | 74F154N | 1820-6134 | 02237 | 74AC541SC |
| 1820-5377 | 02910 | 7F257AD | 1820-5649 | 02237 | 74ACT273PC | 1820-5836 | 0237 | 74ACT377PC | 1820-6135 | 02237 | 74F251D |
| 1820-5383 | 12385 | SED9420MAC | 1820-5650 | 02237 | TA4C158PC | 1820-5837 | 0237 | 74ACT400PC | 1820-6142 | 01698 | TACT2150-30NT |
| 1820-5384 | 10421 | RTC-72421B | 1820-5651 | 02237 | TA4C02PC | 1820-5838 | 0237 | 74F04SC | 1820-6143 | 03794 | AM29CP114DC UNPRGMD |
| 1820-5385 | 10253 | IDT94C606AG | 1820-5652 | 02237 | TA4C11PC | 1820-5839 | 01698 | SN74ALS240WD | 1820-6144 | 01698 | SN74ALS869NT |
| 1820-5387 | 01698 | SN74ALS11D | 1820-5654 | 02237 | TA4C08PC | 1820-5840 | 01698 | SN74ALS37AD | 1820-6145 | 01698 | SN74ALS136N |
| 1820-5390 | 10237 | MC10H125PN | 1820-5655 | 02237 | 74AC32PC | 1820-5841 | 01698 | TC74HC7292P | 1820-6146 | 02237 | 74ACT244SC |
| 1820-5392 | 03406 | PAL16L64AVC UNPRGMD | 1820-5656 | 01698 | SN74LS22D | 1820-5842 | 10253 | IDT74FCT245AP | 1820-6147 | 02910 | SN74ALS804ADW |
| 1820-5393 | 03406 | MM74HC04M | 1820-5657 | 06354 | TC74HC7292P | 1820-5843 | 01698 | PAL16L8DNC UNPRGMD | 1820-6148 | 02910 | 74F191N |
| 1820-5394 | 02037 | MC74HC10D | 1820-5658 | 11187 | VF16E6-25PC UNPRGMD | 1820-5844 | 01698 | TC74HC7292P | 1820-6149 | 01698 | SN74ALS60DW |
| 1820-5395 | 03406 | MM74HC13M | 1820-5659 | 11187 | VF20E8-25PC UNPRGMD | 1820-5845 | 01698 | PAL12L6ANC UNPRGMD | 1820-6150 | 01698 | SN74ALS869NT |
| 1820-5396 | 10253 | IDT74FCT191AP | 1820-5660 | 02910 | PF8C577N | 1820-5846 | 01698 | TA4C10PC | 1820-6151 | 03794 | AM29CP114DC UNPRGMD |
| 1820-5398 | 12382 | GAL16V8-25QF UNPRGMD | 1820-5671 | 00942 | PAL20S10CNS UNPRGMD | 1820-5847 | 01698 | SN74ALS240WD | 1820-6152 | 01698 | SN74ALS233ADW |
| 1820-5402 | 03406 | PAL10L8A2VC UNPRGMD | 1820-5672 | 01698 | SN74ALS103D | 1820-5848 | 01698 | TC5074P | 1820-6153 | 01698 | SN74ALS323N |
| 1820-5403 | 03947 | NCR5380-4PLCC | 1820-5673 | 01698 | SN74ALS81DW | 1820-5849 | 01698 | TM3407ON-36 | 1820-6154 | 01698 | SN74ALS160N |
| 1820-5404 | 01698 | SN74LS629D | 1820-5674 | 01698 | SN74ALS280D | 1820-5850 | 01698 | PAL20L8A-2CN UNPRGMD | 1820-6155 | 01698 | SN74ALS162DW |
| 1820-5411 | 03406 | DP834L | 1820-5675 | 04550 | CD74AC193E | 1820-5851 | 01698 | MC14526DW | 1820-6156 | 01698 | SN74ALS160DW |
| 1820-5417 | 04092 | PAL14L6V8 UNPRGMD | 1820-5677 | 02910 | 7F1513D | 1820-5852 | 02037 | TCM222J | 1820-6157 | 01698 | SN74ALS233ADW |
| 1820-5418 | 02037 | MC14538BDW | 1820-5678 | 02910 | 7F5F39D | 1820-5853 | 0237 | XR-T5670CN | 1820-6158 | 02910 | 74F1363AD |
| 1820-5419 | 03406 | MM74HC906M | 1820-5679 | 02237 | 7F4245SC | 1820-5854 | 01698 | TI8P71AHCT34N | 1820-6159 | 01698 | TI8P719L8CNT UNPRGMD |
| 1820-5420 | 06368 | TIBPAL16L4-12CN UNPRGMD | 1820-5680 | 02910 | 7F8F58 | 1820-5855 | 00942 | PAL16RBB-2CN UNPRGMD | 1820-6160 | 02910 | 74F573D |
| 1820-5421 | 06354 | TC74HC93P | 1820-5681 | 01698 | SN74LS590D | 1820-5856 | 02910 | 74ACT93SC | 1820-6161 | 01698 | SN74ALS21AD |
| 1820-5423 | 02237 | 74AC00PC | 1820-5682 | 01698 | SN74LS15D | 1820-5857 | 02037 | 74ACT244SC | 1820-6162 | 01698 | SN74ALS103ZAD |
| 1820-5424 | 02910 | 74HCT34N | 1820-5683 | 02237 | 7F283SC | 1820-5858 | 01698 | TCR-T5670CN | 1820-6163 | 01698 | 74ACT119PC |
| 1820-5428 | 03811 | PSC090-50 UNPRGMD | 1820-5684 | 01698 | SN74ALS1034D | 1820-5859 | 01698 | PAL20L8C UNPRGMD | 1820-6164 | 01698 | 74ACT109PC |
| 1820-5429 | 01698 | TIBPAL20R-15CNT UNPRGMD | 1820-5685 | 01590 | SP480ODP | 1820-5860 | 01698 | TA4C138SC | 1820-6165 | 01698 | 74ACT119PC |
| 1820-5430 | 00039 | UPD72065L | 1820-5686 | 02910 | 7F298N | 1820-5861 | 01698 | TA4C169SC | 1820-6166 | 01698 | 74ACT136PC |
| 1820-5431 | 00039 | UPD71065G | 1820-5687 | 03794 | PAL18P6ALPC | 1820-5862 | 01698 | TA4C232SC | 1820-6167 | 01698 | 74ACT257SC |
| 1820-5437 | 06347 | HD74HC1449P | 1820-5688 | 10584 | LT1080CN | 1820-5863 | 0237 | 74ACT474SC | 1820-6168 | 01698 | 74ACT109PC |
| 1820-5438 | 03406 | 7F395D | 1820-5689 | 02237 | 7F4ACT245PC | 1820-5864 | 0237 | 74ACT93SC | 1820-6169 | 01698 | 74ACT139PC |
| 1820-5439 | 10253 | IDT74FCT373P | 1820-5690 | 02237 | 7F4ACT175PC | 1820-5865 | 01698 | TA4C08SC | 1820-6170 | 01698 | 74ACT161PC |
| 1820-5440 | 10253 | IDT74FCT374P | 1820-5691 | 02037 | MC74HC10D | 1820-5866 | 01698 | TA4C109SC | 1820-6171 | 01698 | 74ACT163PC |
| 1820-5445 | 11302 | MAX233CPP | 1820-5692 | 02037 | TA4C153PC | 1820-5867 | 01698 | TA4C2445SC | 1820-6172 | 01698 | 74ACT193SC |
| 1820-5461 | 01698 | TIBPAL16L18-25CN UNPRGMD | 1820-5697 | 01698 | SN74LS132D | 1820-5868 | 01698 | TA4C257SC | 1820-6173 | 01698 | 74F573D |
| 1820-5462 | 01698 | TIBPAL20R-15CNT UNPRGMD | 1820-5698 | 02037 | MC74HC431D | 1820-5869 | 01698 | TA4C32SC | 1820-6174 | 01698 | 74ACT2374AP |
| 1820-5463 | 01698 | TIBPAL20L-15CNT UNPRGMD | 1820-5699 | 01698 | SN74ALS580ADW | 1820-5870 | 01698 | TA4C514SC | 1820-6175 | 01698 | BUS-1555 |
| 1820-5467 | 02910 | 7F5647 | 1820-5701 | 02237 | 7F4ACT245PC | 1820-5871 | 01698 | TA4C00SC | 1820-6176 | 01698 | TI8P719L8CNT UNPRGMD |
| 1820-5470 | 02910 | 7F5647 | 1820-5702 | 02237 | 7F4ACT175PC | 1820-5872 | 01698 | TA4C08SC | 1820-6177 | 01698 | 74ACT119PC |
| 1820-5471 | 02910 | 7F5647 | 1820-5714 | 01698 | SN74ALS61A-1 | 1820-5874 | 02910 | 7F4ACT93SC | 1820-6178 | 01698 | 74ACT136AD |
| 1820-5472 | 02910 | 7F5647 | 1820-5715 | 02910 | 7F1244N | 1820-5875 | 01698 | TA4C193D | 1820-6179 | 01698 | 74ACT161AD |
| 1820-5473 | 02910 | 7F5647 | 1820-5726 | 02910 | 7F881N | 1820-5876 | 01698 | TA4C04SC | 1820-6180 | 01698 | 74ACT164AD |
| 1820-5474 | 02910 | 7F5647 | 1820-5731 | 03406 | TM74HC251M | 1820-5877 | 01698 | TA4C08SC | 1820-6181 | 01698 | 74ACT165AD |
| 1820-5476 | 02910 | 7F5647 | 1820-5733 | 03406 | TM74HC30M | 1820-5878 | 01698 | TA4C109SC | 1820-6182 | 01698 | 74ACT166AD |
| 1820-5477 | 02910 | 7F5647 | 1820-5734 | 02037 | MC74HC10D | 1820-5879 | 01698 | TA4C1373P | 1820-6183 | 01698 | 74ACT167AD |
| 1820-5478 | 02910 | 7F5647 | 1820-5736 | 02910 | 7FHC646D | 1820-5880 | 01698 | TA4C1457NT | 1820-6184 | 01698 | 74ACT168AD |
| 1820-5480 | 03794 | PAL18P8QPC UNPRGMD | 1820-5752 | 03406 | MC74HC574WM | 1820-5881 | 01698 | TA4C138PC | 1820-6185 | 01698 | 74ACT169AD |
| 1820-5481 | 06338 | L293B | 1820-5753 | 02037 | MC74HC253D | 1820-5882 | 01698 | TA4C521D | 1820-6186 | 01698 | 74ACT170AD |
| 1820-5486 | 04092 | MD2692AAM | 1820-5754 | 02037 | MC74HC257D | 1820-5883 | 01698 | TA4C168N | 1820-6187 | 01698 | 74ACT171AD |
| 1820-5489 | 06398 | TMS2020GBL | 1820-5755 | 03794 | AM7961DC | 1820-5884 | 01698 | TA4C168N | 1820-6188 | 01698 | 74ACT172AD |
| 1820-5504 | 01698 | TMS320C10FLN | 1820-5760 | 02910 | NE5170A | 1820-5885 | 01698 | TA4C070N | 1820-6189 | 01698 | 74ACT173AD |
| 1820-5505 | 11345 | PALC22V10L-25PC UNPRGMD | 1820-5761 | 02910 | NE5180A | 1820-5886 | 01698 | TM534070NL-66 | 1820-6190 | 01698 | 74ACT174AD |
| 1820-5507 | 03794 | PAL18P8QPC UNPRGMD | 1820-5762 | 02910 | 7F4273DN | 1820-5887 | 01698 | TA4C5577NT | 1820-6191 | 01698 | 74ACT175AD |
| 1820-5533 | 11345 | PALC16L81-25PC UNPRGMD | 1820-5763 | 02910 | 7F4272D | 1820-5888 | 01698 | TA4C259N</ | | | |

| H P P/N | Mfr. | Desc. | H P P/N | Mfr. | Desc. | H P P/N | Mfr. | Desc. | H P P/N | Mfr. | Desc. |
|-----------|-------|--------------------------|-----------|-------|--------------------------|-----------|-------|--------------------------|-----------|-------|--------------------|
| 1820-6332 | 01698 | SN75207BN | 1820-6573 | 12382 | GAL20V8A-10LJ UNPRGMD | 1820-6829 | 00350 | XR-T5650N | 1820-7052 | 12880 | EP610PC-25 UNPRGMD |
| 1820-6337 | 01698 | SN74LS254DW | 1820-6574 | 02910 | PLUS20R6-7A UNPRGMD | 1820-6830 | 04078 | MK5025Q-10 | 1820-7202 | 02037 | MC74HC112D |
| 1820-6341 | 11302 | MAX23BCWG | 1820-6575 | 02910 | PLUS20R4-7A UNPRGMD | 1820-6831 | 12186 | S7218AN | 1820-7202 | 01698 | SN74HC390DW |
| 1820-6347 | 01698 | UA963EACD | 1820-6576 | 11302 | MAX24OCMH | 1820-6833 | 12404 | XC3042-100PC84C UNPRGMD | 1820-7212 | 02910 | NT74F646AN |
| 1820-6354 | 01698 | SN74HC594DW | 1820-6580 | 03794 | PALCE22V10H-25JC UNPRGMD | 1820-6837 | 10253 | IDT74FC7240ASO | 1820-7213 | 02037 | MC74ACT11N |
| 1820-6360 | 01698 | SN75ALS162N | 1820-6581 | 01698 | TS75174DW | 1820-6838 | 01698 | TIBPAL16R8-7CJ PRGMD | 1820-7218 | 01698 | SN74HC166D |
| 1820-6362 | 01698 | SN74AS874DW | 1820-6584 | 02910 | 74HCT0404N | 1820-6839 | 03794 | PALCE22V10Q-25JC UNPRGMD | 1820-7215 | 02910 | 74HCT377D |
| 1820-6363 | 01698 | SN74AS286D | 1820-6588 | 01698 | SN74ACT11253N | 1820-6840 | 03794 | PALC16L8Z-25CNL UNPRGMD | 1820-7216 | 03406 | 74AC251SC |
| 1820-6364 | 01698 | TIBPAL20L8-15CFN UNPRGMD | 1820-6589 | 01698 | SN74ACT11244NT | 1820-6841 | 03794 | PALC16L8Q-25N UNPRGMD | 1820-7217 | 03799 | CD74AC573M |
| 1820-6366 | 01542 | HCTL-1000 | 1820-6601 | 12905 | ACT1020FL-84 | 1820-6843 | 01698 | TIBPAL16L8-7CFN UNPRGMD | 1820-7218 | 03406 | 74AC163SC |
| 1820-6367 | 00039 | UGT707B | 1820-6603 | 02910 | 74F67D | 1820-6844 | 10253 | IDT74PC1257ATP | 1820-7219 | 02910 | 74HCT7030D |
| 1820-6373 | 03406 | UA963EBC | 1820-6605 | 08608 | SSI 32H569-CS | 1820-6845 | 03406 | 74AC50SC | 1820-7220 | 02910 | 74F113D |
| 1820-6374 | 03406 | UA963TASC | 1820-6606 | 03794 | MO64-70CNL68 UNPRGMD | 1820-6846 | 03406 | 74AC373C | 1820-7221 | 02910 | 74F378D |
| 1820-6381 | 03406 | DMT4AS873NT | 1820-6607 | 03794 | M3020-70JC68 | 1820-6848 | 10253 | IDT74FC7821ATP | 1820-7228 | 02910 | 74F1162A |
| 1820-6382 | 04507 | TMC2210-2G8C | 1820-6608 | 10253 | IDT74FC753AP | 1820-6849 | 01698 | SN74AS534D | 1820-7230 | 02037 | MC74HC163D |
| 1820-6383 | 03406 | 74ACT573SC | 1820-6609 | 02910 | 74F241D | 1820-6850 | 02037 | MC74F14BD | 1820-7231 | 02037 | MC10H1262N |
| 1820-6384 | 06344 | MB811AZ | 1820-6610 | 02910 | HEF069UBP | 1820-6858 | 11967 | T220-EC | 1820-7232 | 02037 | MC12009FN |
| 1820-6391 | 03406 | 74AC86SC | 1820-6611 | 01698 | SN74SBC72827ADW | 1820-6861 | 02910 | JF50109D | 1820-7233 | 10253 | IDT7381L5J |
| 1820-6392 | 03794 | FAL22V10-15PC UNPRGMD | 1820-6612 | 10253 | IDT74FC7514AP | 1820-6862 | 03794 | AM29827APC | 1820-7234 | 02910 | 74HCT366N |
| 1820-6396 | 10858 | LTC1045CN | 1820-6614 | 03794 | PAL10H20EV8-6DC | 1820-6864 | 12382 | TIBPAL16R8-10CN UNPRGMD | 1820-7236 | 01698 | SN74ALS666DW |
| 1820-6399 | 12768 | SED181FLA | 1820-6615 | 02037 | MC10H109FN | 1820-6865 | 02910 | PLUS16L8-TN PRGMD | 1820-7237 | 01698 | SN74ALS677ADW |
| 1820-6401 | 12186 | DS121-20 | 1820-6616 | 03406 | DC34C8TN | 1820-6867 | 02037 | MC10H103FN | 1820-7238 | 10253 | 74FC1540A |
| 1820-6403 | 03794 | PAL16R6B-2CN UNPRGMD | 1820-6618 | 02910 | 74F126D | 1820-6872 | 02037 | MC10H117FN | 1820-7241 | 02910 | 74F786D |
| 1820-6404 | 01698 | SN74LS151D | 1820-6619 | 02910 | 74F54D | 1820-6873 | 03794 | PAL16R6DN UNPRGMD | 1820-7242 | 02910 | 74F160ASC |
| 1820-6405 | 01698 | SN74S151D | 1820-6620 | 01698 | 74ACT11244DW | 1820-6881 | 01698 | PAL20V8-25QVC UNPRGMD | 1820-7243 | 03406 | 74F168SC |
| 1820-6407 | 04550 | CD74ACT14 | 1820-6622 | 02910 | 74HCT0109N | 1820-6882 | 03406 | Gal16V8A-12LVC UNPRGMD | 1820-7243 | 03406 | 74F169SC |
| 1820-6408 | 03406 | 74AC86PC | 1820-6623 | 02910 | 74F786N | 1820-6885 | 03406 | Gal16V8B-25QVC UNPRGMD | 1820-7244 | 03406 | 74AC14SC |
| 1820-6409 | 02910 | 74F657D | 1820-6629 | 10253 | IDT74FC7244ASO | 1820-6886 | 02910 | PLUS20L8-TA UNPRGMD | 1820-7245 | 03406 | 74AC139SC |
| 1820-6410 | 02910 | 74F822D | 1820-6631 | 01698 | SN74BCT620DW | 1820-6887 | 02910 | PLUS20R8-TA UNPRGMD | 1820-7246 | 03406 | 74AC161SC |
| 1820-6411 | 02910 | 74F805D | 1820-6632 | 01698 | SN74ALS156N | 1820-6888 | 02910 | PLUS16R6-TA UNPRGMD | 1820-7247 | 03406 | 74AC191SC |
| 1820-6412 | 02037 | MC1413D | 1820-6633 | 01698 | SN74ALS154NT | 1820-6889 | 02910 | PLUS16R8-TA UNPRGMD | 1820-7248 | 03406 | 74AC240SC |
| 1820-6421 | 02910 | 74H4C538N | 1820-6637 | 02910 | 74HCT0109N | 1820-6890 | 02910 | N5C90-50 UNPRGMD | 1820-7250 | 03406 | 74AC251SC |
| 1820-6422 | 03794 | AM7995DC | 1820-6638 | 03406 | 74F860AN | 1820-6892 | 03406 | PAL16R6B-15PC UNPRGMD | 1820-7251 | 03406 | 74AC257SC |
| 1820-6435 | 01698 | SN74ALS514-1N | 1820-6641 | 03794 | AM26LS30JC | 1820-6894 | 03794 | PALCE16V8B-15PC UNPRGMD | 1820-7252 | 03406 | 74AC273SC |
| 1820-6436 | 02910 | 74F194D | 1820-6642 | 02037 | MC10H016FN | 1820-6902 | 03406 | MM74HC18M | 1820-7253 | 03406 | 74AC574SC |
| 1820-6437 | 01698 | SN74ALS156D | 1820-6643 | 02037 | MC10H123FN | 1820-6904 | 01698 | SN74LS612FN | 1820-7254 | 03406 | 74ACT240SC |
| 1820-6438 | 01698 | SN74ALS158D | 1820-6644 | 02037 | UDN2993BL | 1820-6905 | 02910 | 74F13N | 1820-7255 | 03791 | AM29823ASC |
| 1820-6441 | 02910 | 74H4C538 | 1820-6645 | 01698 | SN74ALS154NT | 1820-6907 | 01698 | SN74HC623N | 1820-7256 | 03406 | DM74LS502N |
| 1820-6442 | 02910 | 74H4C538N | 1820-6646 | 11302 | MAX29C9NG | 1820-6908 | 10253 | IDT74FC7139AP | 1820-7257 | 10253 | IDT74FC752ATP |
| 1820-6443 | 02910 | 74F385N | 1820-6647 | 02037 | MC10E111FN | 1820-6909 | 10253 | IDT74FC7517P | 1820-7258 | 02037 | MC74C175D |
| 1820-6445 | 02910 | 74F822N | 1820-6648 | 03794 | MC10E142FN | 1820-6910 | 02910 | 74F670N | 1820-7259 | 01698 | SN74F381N |
| 1820-6446 | 01698 | SN75164P | 1820-6649 | 03794 | DS6395AM | 1820-6911 | 03406 | 74F540PC | 1820-7260 | 02037 | MC10H101FN |
| 1820-6448 | 02037 | MC12073P | 1820-6650 | 02910 | 74F299D | 1820-6912 | 02910 | 74F642N | 1820-7263 | 02037 | MC10H176FN |
| 1820-6449 | 03406 | 74AC151PC | 1820-6651 | 03406 | 74ACT151SC | 1820-6913 | 02910 | 74F647N | 1820-7264 | 02910 | 74HC365D |
| 1820-6450 | 02037 | MC74F803D | 1820-6652 | 01698 | SN74ALS869DW | 1820-6914 | 02910 | 74F756N | 1820-7265 | 02037 | MC12090FN |
| 1820-6452 | 01698 | SN74ALS756-1N | 1820-6653 | 10253 | IDT74FC7517P | 1820-6915 | 02910 | 74F760N | 1820-7266 | 11302 | MAX691PCF |
| 1820-6454 | 02910 | 74H4C538 | 1820-6654 | 03406 | 74HCT0103N | 1820-6916 | 02910 | 74F838N | 1820-7267 | 03406 | 74ACT163SC |
| 1820-6456 | 04077 | CH1B12A | 1820-6655 | 02037 | MC74ACT514N | 1820-6917 | 02910 | 74F862N | 1820-7268 | 02910 | 74F193D |
| 1820-6457 | 02910 | 74F804N | 1820-6656 | 03794 | PAL20R4-10JC UNPRGMD | 1820-6918 | 02910 | 74F1894N | 1820-7269 | 02910 | 74HCT259D |
| 1820-6457 | 03794 | PAL20R4-10PC UNPRGMD | 1820-6657 | 02910 | 74HCT0118P | 1820-6919 | 02910 | 74F1895N | 1820-7270 | 00339 | UPB581C |
| 1820-6462 | 04550 | CD74ACT08E | 1820-6658 | 02037 | MC10H118P | 1820-6920 | 02910 | 74F1896N | 1820-7271 | 02910 | 74HC640D |
| 1820-6465 | 01698 | SN74ALS873BDW | 1820-6670 | 01698 | TIBPAL16R8-7CN UNPRGMD | 1820-6929 | 03406 | 74ACT646PC | 1820-7272 | 01698 | 74ACT11245DW |
| 1820-6466 | 01698 | SN74ALS1004D | 1820-6671 | 03406 | 74ACT1046PC | 1820-6930 | 03406 | 74ACT1164PC | 1820-7273 | 01698 | 74ACT11373DW |
| 1820-6468 | 03406 | DM74LS374N | 1820-6672 | 03406 | 74M74HCT148PC | 1820-6931 | 03634 | 74ACT1072P | 1820-7274 | 03406 | 74ACT175SC |
| 1820-6469 | 03406 | DM74LS245N | 1820-6673 | 03406 | 74M74HCT166PC | 1820-6932 | 02910 | 74ACT7412AP | 1820-7275 | 02910 | 74F193D |
| 1820-6470 | 02910 | 74HCT14D | 1820-6674 | 02037 | MC74ACT514N | 1820-6933 | 03406 | 74ACT744PC | 1820-7276 | 02910 | 74F194D |
| 1820-6471 | 01698 | SN74BCT652DW | 1820-6674 | 03406 | 74F550DC | 1820-6935 | 03406 | 74ACT240PC | 1820-7277 | 02910 | 74HC640D |
| 1820-6473 | 03406 | 74ACT74SC | 1820-6675 | 03794 | AM29828APC | 1820-6936 | 03406 | 74ACT240PC | 1820-7278 | 00339 | UPB581C |
| 1820-6475 | 03794 | AM7201-80RC | 1820-6676 | 02037 | MC10H118P | 1820-6937 | 03406 | 74ACT273PC | 1820-7279 | 01698 | SN74ALS223ANT |
| 1820-6476 | 02910 | 74F861N | 1820-6677 | 01698 | SN75151FN | 1820-6938 | 03406 | 74ACT112PC | 1820-7280 | 01698 | SN74BCT373N |
| 1820-6477 | 03406 | SP92701CDP | 1820-6678 | 02037 | MC10H115FN | 1820-6939 | 03406 | 74F171N | 1820-7281 | 01698 | AM7203-208RC |
| 1820-6478 | 01590 | SD95140N | 1820-6679 | 02037 | MC10H164FN | 1820-6940 | 03406 | 74F172N | 1820-7282 | 02037 | MC10H181FN |
| 1820-6488 | 01698 | SN75186FN | 1820-6680 | 02037 | MC10H164FN | 1820-6941 | 03406 | 74F173N | 1820-7283 | 03791 | AM7203-106RN |
| 1820-6493 | 03474 | HD74HC592P | 1820-6681 | 11345 | TC74C21-30PC | 1820-6942 | 02910 | 74F187N | 1820-7284 | 02910 | 74F541D |
| 1820-6495 | 02910 | 74H133N | 1820-6682 | 02037 | MC11464GS | 1820-6943 | 02910 | 74F3024N | 1820-7289 | 02037 | MC10H642FN |
| 1820-6500 | 01698 | SN74ALS883GB | 1820-6683 | 02037 | MC11464GS | 1820-6945 | 02910 | 74F5074N | 1820-7304 | 01698 | SN74ALS866AN |
| 1820-6507 | 02910 | 74F410N | 1820-6684 | 02037 | MC10H111FN | 1820-6946 | 02910 | 74F1762N | 1820-7306 | 02037 | MC10H179FN |
| 1820-6508 | 10253 | IDT73B125G | 1820-6685 | 02037 | MC10H164FN | 1820-6947 | 02910 | 74F509SC | 1820-7307 | 02037 | MC10H158FN |
| 1820-6509 | 03406 | MC10H1505W | 1820-6686 | 03406 | DS36F174CJ | 1820-6948 | 03634 | MB503P | 1820-7311 | 0253 | IDT74FC740ASO |
| 1820-6530 | 01698 | SN74ALS165N | 1820-6687 | 03406 | DS96F175CJ | 1820-6949 | 03634 | MB504L | 1820-7312 | 0253 | IDT74FC744APC |
| 1820-6531 | 03406 | DS96F175CN | 1820-6688 | 03406 | DS96F175CN | 1820-6950 | 02910 | 74F723N | 1820-7313 | 03799 | CD74ACT14M |
| 1820-6532 | 03406 | DS96F175CN | 1820-6689 | 03406 | DS96F175CN | 1820-6951 | 02910 | 74F5075 | 1820-7314 | | |

| HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. |
|-----------|-------|---------------------------|-----------|-------|-----------------------|-----------|-------|------------------|-----------|-------|-----------------------|
| 1820-7481 | 03406 | GAL22V10-15LVC | 1826-0051 | 02037 | MC1414P | 1826-0220 | 03406 | LM320H-05 | 1826-0410 | 01698 | TLO84CN |
| 1820-7482 | 03794 | FAL708-10CJ UNPRGMD | 1826-0055 | 02237 | UA711DC | 1826-0221 | 02037 | MCT912CT | 1826-0411 | 02037 | MC14536BCP |
| 1820-7491 | 11111 | PQ2RA102-45 UNPRGMD | 1826-0056 | 02237 | UA740HC | 1826-0222 | 02290 | RC1436DB | 1826-0412 | 03406 | LM393N |
| 1820-7539 | 02910 | PLUS405-45A UNPRGMD | 1826-0058 | 02910 | NE501A | 1826-0224 | 02910 | SE555CT | 1826-0413 | 03799 | HA2-2605-5 |
| 1820-7601 | 12125 | KST7AHC710N | 1826-0059 | 03406 | LM201AH | 1826-0225 | 03406 | LM322N | 1826-0414 | 03406 | LH0070-2H |
| 1820-7602 | 02037 | MC1480AD | 1826-0060 | 02037 | MC1438R | 1826-0226 | 02237 | UA78M12HC | 1826-0415 | 02910 | SD5000B |
| 1820-7603 | 03794 | AM7202-25RC | 1826-0063 | 02237 | UA711HC SELECTED | 1826-0229 | 02180 | OP-05CJ | 1826-0416 | 03406 | LF13331D |
| 1820-7604 | 01698 | SN74ALS164DW | 1826-0064 | 02237 | UA733DC | 1826-0230 | 01920 | CA3053 | 1826-0417 | 03406 | LF13333D |
| 1820-7607 | 03794 | AM7992BCJC | 1826-0065 | 03406 | LM311N | 1826-0231 | 02237 | UA760HC | 1826-0418 | 03406 | LM320T-12 |
| 1820-7608 | 10253 | IDT74PC7139P | 1826-0067 | 02910 | NE531H | 1826-0232 | 03406 | LM224J | 1826-0419 | 03406 | LM3909N |
| 1820-7610 | 02037 | MC3486D | 1826-0068 | 03406 | LM307N SELECTED | 1826-0233 | 03406 | LM220K-15 | 1826-0420 | 02037 | MC14585P1 |
| 1820-7611 | 03406 | MM74C923WM | 1826-0069 | 03406 | LM301A1-14 | 1826-0234 | 03406 | LM321AH SELECTED | 1826-0421 | 03285 | AD536AJD |
| 1820-7612 | 03406 | MM5451V | 1826-0070 | 02237 | 741DC | 1826-0235 | 03406 | LM220K-12 | 1826-0422 | 03406 | LF298H |
| 1820-7613 | 06344 | MB506PF | 1826-0072 | 03406 | LM208H | 1826-0237 | 00350 | XZ320 | 1826-0423 | 03406 | LM317K |
| 1820-7614 | 01698 | SN74AS304N | 1826-0075 | 01921 | CA3079 | 1826-0238 | 03406 | LM325AS | 1826-0424 | 02037 | MC3405P |
| 1820-7616 | 03706 | 74ACT0245SC | 1826-0078 | 01921 | CA3030 | 1826-0243 | 03406 | LM1558H | 1826-0425 | 03799 | HA2-2655-5 |
| 1820-7617 | 03406 | 9403ACD | 1826-0079 | 03799 | HA2-2625-5 | 1826-0244 | 02910 | NE529N | 1826-0426 | 03791 | AM687ADL |
| 1820-7618 | 01698 | SN74ALS29818NT | 1826-0081 | 03406 | LM318H | 1826-0246 | 02370 | MCT805CK | 1826-0428 | 03793 | SG3542J |
| 1820-7621 | 01698 | SN74ALS621ADW | 1826-0082 | 03285 | AD7411H | 1826-0247 | 03780 | A-1350 | 1826-0429 | 03799 | H1-1818A-5 |
| 1820-7622 | 01698 | SN74LS195AD | 1826-0086 | 02237 | 776HC | 1826-0248 | 02037 | MC1408L-6 | 1826-0430 | 03285 | AD559KD |
| 1820-7627 | 03794 | AM29823APC | 1826-0089 | 03799 | HA2-2525-5 (SELECTED) | 1826-0249 | 03285 | AD504J | 1826-0431 | 02037 | MC14433L |
| 1820-7628 | 03794 | AM29825APC | 1826-0090 | 03285 | AD741KH | 1826-0252 | 03285 | AD7520JN | 1826-0432 | 03714 | ICL 8094 CC PE |
| 1820-7635 | 01698 | SN74F242D | 1826-0097 | 03406 | LM210H SELECTED | 1826-0254 | 02037 | MC1714SP1 | 1826-0433 | 03406 | LM356EN |
| 1820-7636 | 02037 | MC10H060FN | 1826-0098 | 03406 | LM211H | 1826-0256 | 02910 | NE522N | 1826-0435 | 03406 | LM341P-12 |
| 1820-7637 | 02037 | MC10H063FN | 1826-0099 | 02237 | UA7812UC | 1826-0257 | 03406 | LM741CN | 1826-0436 | 03406 | LM341P-24 |
| 1820-7641 | 02910 | 74F5072BD | 1826-0100 | 02237 | 747D | 1826-0258 | 03406 | UA7824KC | 1826-0437 | 02037 | MC1495L |
| 1820-7642 | 02037 | MC10E158FN | 1826-0101 | 03406 | LM565CH | 1826-0264 | 03285 | AD7520LN | 1826-0438 | 03406 | LM340LAH-12 |
| 1820-7644 | 02037 | MC10E166FN | 1826-0103 | 02037 | MC1545BIAJC | 1826-0265 | 03406 | LM309H SELECTED | 1826-0439 | 03406 | LH-0053CG |
| 1820-7645 | 02037 | MC10H351FN | 1826-0105 | 02883 | DGL72BK | 1826-0266 | 02180 | OP-05EJ | 1826-0440 | 02180 | OP-01CJ |
| 1820-7646 | 02037 | MC10E122FN | 1826-0106 | 02237 | UA7815UC | 1826-0267 | 03406 | LM6002CD | 1826-0441 | 02237 | UA790UIC |
| 1820-7647 | 02037 | MC10E143FN | 1826-0108 | 03406 | LH0062CH | 1826-0269 | 02910 | NE566N | 1826-0443 | 02237 | UA780K |
| 1820-7648 | 02037 | MC10E167FN | 1826-0109 | 03799 | HA2-2625-5 (SELECTED) | 1826-0271 | 03406 | MC6471T SELECTED | 1826-0444 | 02237 | UA799GK |
| 1820-7649 | 02037 | MC10E101FN | 1826-0110 | 03406 | LM212H | 1826-0272 | 03406 | LM361H | 1826-0445 | 02237 | UA7905UC |
| 1820-7650 | 02037 | MC10E104FN | 1826-0111 | 02037 | MC1458G | 1826-0274 | 02037 | MC781L5ACP | 1826-0446 | 03714 | ICL8052CPD |
| 1820-7651 | 01698 | SN10KHT543DW | 1826-0112 | 03406 | LM316AH | 1826-0275 | 02037 | MC781L2ACP | 1826-0447 | 03406 | LF257H |
| 1820-7652 | 02037 | MC10E107FN | 1826-0113 | 03406 | LM207H | 1826-0276 | 02037 | MC781L5ACP | 1826-0448 | 03406 | LM320T-8.0 |
| 1820-7653 | 02037 | MC10E171FN | 1826-0114 | 02237 | 710H | 1826-0277 | 03406 | LM320T-15 | 1826-0450 | 01698 | TL497CN |
| 1820-7654 | 02037 | MC10I183FN | 1826-0115 | 02910 | NE526A | 1826-0281 | 02037 | MC791L5ACP | 1826-0451 | 02237 | UA7915KC |
| 1820-7656 | 02037 | MC3405D | 1826-0116 | 02180 | CMP-01-CJ | 1826-0282 | 02037 | MC791L2ACP | 1826-0452 | 02283 | LD130CJ |
| 1820-7660 | 02037 | MC7WHC73N | 1826-0117 | 02237 | UA7812KC | 1826-0283 | 03406 | LM325S | 1826-0453 | 02180 | DAC-100ACQ3 |
| 1820-7661 | 11302 | MAX23CPC | 1826-0119 | 02910 | NE555T | 1826-0284 | 02037 | MC791L06C | 1826-0454 | 02910 | NB527H |
| 1820-7662 | 10858 | LIT180CS | 1826-0120 | 03406 | LM3900N | 1826-0285 | 02037 | MC791L05ACP | 1826-0455 | 02237 | UA780UIC |
| 1820-7664 | 02037 | MC74HC0017D | 1826-0121 | 03714 | 800TC | 1826-0286 | 02037 | MC791L03C | 1826-0456 | 03406 | LM325H |
| 1820-7665 | 12461 | B7624KCJ | 1826-0122 | 02237 | UA7805UC | 1826-0289 | 02037 | MC3476G | 1826-0457 | 03406 | LF255H |
| 1820-7666 | 12461 | B7622KCJ | 1826-0123 | 03406 | LM320K-12 | 1826-0291 | 03406 | LM324P | 1826-0458 | 03406 | LMH042CD |
| 1820-7668 | 01698 | SN74HSC50BD | 1826-0125 | 02037 | MC1511L | 1826-0292 | 01921 | CA3085 | 1826-0460 | 02237 | UA78126AWC |
| 1820-7670 | 10253 | IDT74FC725AS0 | 1826-0126 | 02370 | 7818K | 1826-0293 | 02037 | MC1306P | 1826-0462 | 02037 | MC3410CL |
| 1820-7671 | 02037 | IDT74FC739ASO | 1826-0127 | 02180 | DAC-100BCQ3 | 1826-0294 | 02037 | MC7905CT | 1826-0464 | 02037 | MC7815CT |
| 1820-7672 | 01698 | SN74ALS15-1DW | 1826-0128 | 02037 | MC1468L | 1826-0295 | 03285 | AD533JH | 1826-0465 | 01921 | CA3110T |
| 1820-7675 | 11302 | MAX23CPC | 1826-0129 | 03714 | ICL8001CTZ | 1826-0296 | 01921 | CA207E | 1826-0467 | 02037 | MC1403P1 |
| 1820-7676 | 01698 | SN74BCT38D | 1826-0130 | 02910 | NE550L | 1826-0299 | 03404 | LM320T-24 | 1826-0468 | 02037 | MC3423P1 |
| 1820-7677 | 01698 | SN74BCT2244N | 1826-0131 | 03714 | ICL8008CTY | 1826-0300 | 02237 | UA79M12AHC | 1826-0469 | 03406 | AF120CH |
| 1820-7678 | 01698 | SN74BCT24D4W | 1826-0132 | 02237 | UA760DC | 1826-0302 | 02037 | MC1741SCG | 1826-0471 | 02180 | OP-07CJ SELECTED |
| 1820-7679 | 01698 | SN74LS163AN | 1826-0135 | 03406 | LM747D | 1826-0303 | 01921 | CAT741G | 1826-0472 | 03406 | LH0044ACH |
| 1820-7683 | 02037 | SN74LS183D | 1826-0137 | 02910 | NE550N | 1826-0304 | 03406 | LF355H | 1826-0473 | 02037 | MC3467TP |
| 1820-7684 | 02037 | MC10E112FN | 1826-0138 | 03406 | LM339N | 1826-0306 | 03406 | LM339AJ | 1826-0475 | 02037 | MC3468P |
| 1820-7685 | 02037 | MC10E154FN | 1826-0139 | 02037 | MC1458P1 | 1826-0307 | 01921 | CA3130T | 1826-0476 | 01698 | TL601CP |
| 1820-7686 | 02037 | MC10E167FN | 1826-0140 | 02037 | MC1468R | 1826-0309 | 03285 | AD518J | 1826-0478 | 03406 | LM906T |
| 1820-7689 | 12128 | V74ACT842P | 1826-0141 | 03406 | LM319J | 1826-0311 | 02037 | MC781L2ACP | 1826-0479 | 03799 | HA2-2525-5 |
| 1820-7690 | 02037 | MC10H602FN | 1826-0142 | 02037 | MC1458P1 | 1826-0312 | 02037 | MC7805CT | 1826-0480 | 03406 | LF13333N |
| 1820-7691 | 10253 | IDT7200SA35J | 1826-0144 | 02037 | MC7805CT | 1826-0313 | 02037 | MC3403P | 1826-0481 | 03406 | LMH033CG |
| 1820-7692 | 11345 | CY7C409A-35PC | 1826-0145 | 02037 | MC7806CT | 1826-0315 | 03406 | LM348N | 1826-0482 | 03799 | HA2-2525-5 |
| 1820-7693 | 01542 | HCTL-1100 | 1826-0146 | 02037 | MC7808CT | 1826-0316 | 03406 | LMH070-1H | 1826-0483 | 02237 | UA795GUIC |
| 1820-7695 | 01698 | SN10KHT543NT | 1826-0147 | 02037 | UA7812UC | 1826-0319 | 03406 | LM356H | 1826-0484 | 02237 | UA785GUIC |
| 1820-7696 | 01698 | SN74BCT245N | 1826-0149 | 02037 | MC7818CP | 1826-0320 | 03406 | LM359K | 1826-0485 | 03285 | AD7530LN |
| 1820-7697 | 03406 | XC3042-50PC84C | 1826-0150 | 02037 | MC1321H | 1826-0321 | 01921 | CA3099E | 1826-0486 | 02037 | MC14052BCP |
| 1820-7698 | 12880 | EPM128JC | 1826-0151 | 02237 | 7284UC | 1826-0323 | 02037 | MC14052C | 1826-0487 | 03799 | HA2-2625-5 (SELECTED) |
| 1820-7699 | 01698 | TI2PAL086-15CFCN UNPRGMD | 1826-0152 | 03406 | LM320K-5.2 | 1826-0331 | 02037 | MC3302P SELECTED | 1826-0488 | 03406 | LM201AN |
| 1820-7700 | 02037 | MC10H186FN | 1826-0153 | 03406 | LM319N | 1826-0332 | 02037 | MC3302P | 1826-0489 | 03406 | LF13333N |
| 1820-7701 | 02037 | MC10H145FN | 1826-0154 | 02237 | CA3094AT | 1826-0333 | 02037 | MC14052 | 1826-0490 | 03406 | AD536AKD |
| 1820-8047 | 03794 | PALCE20V8Q-15JC UNPRGMD | 1826-0156 | 03406 | LM320K-15 | 1826-0334 | 02037 | MC1445L | 1826-0501 | 02037 | MC14053BCP |
| 1820-8157 | 12880 | PIE1810G | 1826-0157 | 03406 | LM308N | 1826-0338 | 03794 | AM686HC | 1826-0502 | 02037 | MC14066BCP |
| 1820-8162 | 01698 | TI2PAL21V10-35CNT UNPRGMD | 1826-0158 | 03406 | LM324N | 1826-0339 | 03404 | LM113-2H | 1826-0503 | 02037 | MC79L12ACG |
| 1820-8163 | 12882 | GAL16V8A-15LP UNPRGMD | 1826-0159 | 02037 | MC3302P SELECTED | 1826-0340 | 03406 | LM299H | 1826-0504 | 02037 | MC79L05ACG |
| 1826-0002 | 02037 | MC1510G | 1826-0161 | 03406 | LM319N | 1826-0341 | 02037 | MC1436G</ | | | |

| HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. |
|-----------|-------|---------------------|-----------|-------|-------------------|-----------|--------|----------------------|-----------|--------|--------------------|
| 1826-0551 | 03406 | LM340AT-5 | 1826-0716 | 02910 | NE5532AFE | 1826-0881 | 10321 | ADC-856C | 1826-1053 | 03714 | ICL7109IDL |
| 1826-0552 | 03406 | LF13741H | 1826-0718 | 02037 | MC10404U5 | 1826-0882 | 101698 | TL028CP | 1826-1054 | 02910 | NE564N |
| 1826-0553 | 02180 | OP-08GJ (SELECTED) | 1826-0719 | 03406 | LM346J | 1826-0883 | 03794 | AM685DML | 1826-1055 | 02910 | NE5018N (SELECTED) |
| 1826-0554 | 03406 | LM340LAZ-12 | 1826-0720 | 03406 | LF13202D | 1826-0884 | 02037 | MC14447P | 1826-1058 | 02180 | OP-02CJ |
| 1826-0555 | 03406 | LM340LAZ-5 | 1826-0722 | 03406 | LM317K SELECTED | 1826-0885 | 02237 | UA379PC | 1826-1059 | 02037 | MC1505L |
| 1826-0557 | 03406 | LM348J | 1826-0724 | 03406 | LM350K SELECTED | 1826-0886 | 03406 | LM395T | 1826-1060 | 03677 | S3522P |
| 1826-0558 | 03406 | LM337H | 1826-0725 | 02237 | UA7815KC SELECTED | 1826-0887 | 03406 | LW412CN (SELECTED) | 1826-1061 | 02180 | OP-14CP |
| 1826-0559 | 03406 | LM7824CK | 1826-0726 | 03285 | AD565JD/BIN | 1826-0888 | 03406 | LF353AN | 1826-1062 | 01698 | TL783CKC |
| 1826-0561 | 02180 | OP-02CJ (SEL'D) | 1826-0727 | 02180 | SMP-81FY | 1826-0889 | 02910 | NE5533AF | 1826-1063 | 03799 | HI-0509A-5 |
| 1826-0565 | 01698 | TL494CN | 1826-0728 | 03793 | SG1532J | 1826-0890 | 03406 | LM358AN | 1826-1064 | 03799 | HI-0508A-5 |
| 1826-0567 | 02037 | MLMC101A | 1826-0729 | 03285 | AD7522JN | 1826-0891 | 03285 | AD544JH SELECTED | 1826-1065 | 03406 | LM336Z-5.0 |
| 1826-0568 | 03406 | LM320H-6 | 1826-0730 | 03285 | AD581LH | 1826-0893 | 03285 | AD536AJH (BURNED-IN) | 1826-1066 | 06121 | TDA4700A |
| 1826-0569 | 02910 | NE5534AT | 1826-0731 | 06545 | L6-0V-5 | 1826-0895 | 06338 | L292 | 1826-1067 | 03406 | LH0002CN |
| 1826-0572 | 01698 | TL084ACN | 1826-0732 | 06545 | L6-OV-5 | 1826-0896 | 03285 | AD565JD | 1826-1068 | 03406 | DAC0832LN |
| 1826-0574 | 03714 | ICL8069DCQ | 1826-0733 | 03406 | ADC0803LCJ | 1826-0902 | 02290 | RC3403ADB | 1826-1069 | 02037 | MC1404U6 |
| 1826-0574 | 02237 | UA714LBC | 1826-0735 | 03799 | HA7-2505-5 | 1826-0903 | 02037 | MC1372P | 1826-1070 | 03794 | AM6108 |
| 1826-0575 | 02763 | 9400CJ | 1826-0736 | 03799 | HA3-2625-5 | 1826-0903 | 03406 | LM303T-5.0 | 1826-1071 | 03406 | LF411CH |
| 1826-0576 | 02180 | OP-16E | 1826-0740 | 03799 | HI-15043-5 | 1826-0905 | 03793 | SG3525AJ | 1826-1072 | 02910 | LM324D |
| 1826-0577 | 02180 | DAC-100CCQ4 | 1826-0741 | 03406 | LF353AH | 1826-0906 | 03714 | ICL7606CPA | 1826-1074 | 03406 | LF441CN |
| 1826-0578 | 03794 | AM658HL | 1826-0742 | 03285 | AD581J | 1826-0907 | 02883 | DG308ACJ | 1826-1075 | 03406 | LF442CN |
| 1826-0580 | 03406 | AF134-1CJ | 1826-0745 | 03406 | LM258H | 1826-0908 | 03406 | LF351BH | 1826-1076 | 03406 | LF444CN |
| 1826-0581 | 03406 | LF13508D | 1826-0746 | 03714 | ICL7109CPL | 1826-0909 | 03406 | LM11CH | 1826-1077 | 03406 | LF412ACH |
| 1826-0582 | 03406 | LF13201D | 1826-0748 | 03406 | LM2500 STEEL | 1826-0910 | 03406 | LM336Z | 1826-1079 | 02598 | PIC602 |
| 1826-0584 | 02237 | UA78MGC | 1826-0750 | 03406 | ADC0801LCN | 1826-0912 | 02037 | MC1404BCP | 1826-1080 | 02598 | PIC647 |
| 1826-0585 | 03406 | LM329DZ | 1826-0751 | 03406 | DAC1202HCD | 1826-0913 | 03285 | AD589LH | 1826-1081 | 03406 | LF411ACN |
| 1826-0586 | 02237 | UA78L62AWC | 1826-0752 | 03285 | AD7542BD | 1826-0914 | 02883 | DG180BP | 1826-1082 | 03793 | SG7812AC-K |
| 1826-0587 | 02883 | LD121LC | 1826-0753 | 02037 | MC34004BL | 1826-0915 | 02037 | MC3401BU | 1826-1083 | 03793 | SG7912AC-K |
| 1826-0588 | 02883 | LD120CJ | 1826-0754 | 06545 | LA1915 | 1826-0916 | 03285 | AD7511DIKN | 1826-1084 | 02180 | OP-37EJ |
| 1826-0590 | 03406 | LF13509D | 1826-0755 | 02910 | NE527N | 1826-0921 | 03285 | AD7533CD | 1826-1085 | 03406 | LF357B |
| 1826-0591 | 06545 | LAS-19U | 1826-0756 | 03406 | ADC0804LCN | 1826-0922 | 02290 | RC4153DC | 1826-1086 | 02180 | SW-06GP |
| 1826-0592 | 03406 | LM358AH | 1826-0757 | 01698 | TL170CLP | 1826-0924 | 03714 | IH5108CJE | 1826-1087 | 04200 | ULN-3701ZV |
| 1826-0594 | 03406 | LH004C4H | 1826-0758 | 03285 | AD534JH | 1826-0925 | 02180 | REF-01EJ | 1826-1090 | 03406 | LM2931CT |
| 1826-0597 | 03285 | AD571JD (SEL) | 1826-0759 | 03406 | LM339J | 1826-0927 | 01921 | CA101AE | 1826-1092 | 02237 | UA7885C (SELECTED) |
| 1826-0598 | 02037 | MC12002P | 1826-0760 | 03406 | LM335AZ | 1826-0928 | 02910 | NE5118F | 1826-1093 | 02180 | OP-421HY |
| 1826-0599 | 02037 | MC14568BCP | 1826-0761 | 03714 | ICL705CJN | 1826-0929 | 03799 | HA7-245-5 | 1826-1094 | 03285 | HD51015EM |
| 1826-0600 | 01698 | TL074ACN | 1826-0762 | 03406 | LM261H | 1826-0930 | 01921 | CA3140AS | 1826-1095 | 02910 | MC1496F |
| 1826-0601 | 02180 | OP-16FJ | 1826-0763 | 03406 | LM137K | 1826-0931 | 03793 | SG3234 SELECTED | 1826-1097 | 02180 | OP-17FZ |
| 1826-0602 | 03285 | AD7506KD | 1826-0765 | 03714 | ICL7611BMYT | 1826-0932 | 02180 | OP-27FZ | 1826-1098 | 02180 | OP-37GP |
| 1826-0603 | 02237 | UA78S40PC | 1826-0766 | 03406 | LM236H | 1826-0935 | 03285 | AD636JD | 1826-1099 | 03406 | LM337LZ |
| 1826-0605 | 02883 | DO508ABK | 1826-0767 | 05436 | 3528AM | 1826-0936 | 02910 | NE538N | 1826-1100 | 03285 | AD570JD |
| 1826-0607 | 03406 | LM340AT-15 | 1826-0768 | 02883 | LM258H | 1826-0937 | 02180 | OP-15FJ | 1826-1101 | 03406 | DAC1219LGJ |
| 1826-0609 | 02180 | MUX-08FQ | 1826-0770 | 01698 | TL022CP | 1826-0938 | 02180 | DAC-10FX | 1826-1102 | 03799 | HI-200-4 |
| 1826-0610 | 02180 | MUX-24FQ | 1826-0772 | 02037 | LM317L | 1826-0939 | 03406 | LM2909N | 1826-1104 | 01698 | TL780-05C |
| 1826-0611 | 03406 | LM2904N | 1826-0773 | 03406 | LM10CH | 1826-0945 | 02037 | AD7523AD | 1826-1105 | 02910 | NE5020M |
| 1826-0617 | 02180 | OP-11EY | 1826-0774 | 03406 | LM385BZ-1.2 | 1826-0946 | 01921 | CA3094E | 1826-1106 | 01698 | TL780-15C |
| 1826-0619 | 02237 | UA7815UC (SELECTED) | 1826-0776 | 02883 | DO302ACJ | 1826-0947 | 03406 | LM310J-8 | 1826-1107 | 03285 | AD7528BQ |
| 1826-0620 | 03406 | LM340CJ | 1826-0777 | 02883 | DO303ACJ | 1826-0949 | 03285 | AD642JH | 1826-1108 | 05436 | DAC702KHD |
| 1826-0621 | 01698 | TL702CN | 1826-0778 | 02883 | DO300CJ | 1826-0950 | 02883 | DG390ACK | 1826-1111 | 03285 | AD7118BD |
| 1826-0622 | 02180 | REF-02HJ | 1826-0779 | 03406 | AD7502JN | 1826-0951 | 02883 | DG381CK | 1826-1112 | 04507 | TDC1001B8C |
| 1826-0623 | 03406 | LF1374N | 1826-0780 | 01921 | CA3054 | 1826-0952 | 03799 | HI-504-5 | 1826-1113 | 03406 | DG201ACJ (SEL) |
| 1826-0634 | 03406 | LM343H | 1826-0781 | 04507 | TDCL104AB7C | 1826-0954 | 03406 | LM109H | 1826-1114 | 03765 | HS3120-C2 |
| 1826-0635 | 02180 | OP-07CP | 1826-0782 | 02237 | UA79M08AHC | 1826-0956 | 03793 | SG3524N | 1826-1115 | 01698 | TL431CLP |
| 1826-0636 | 03285 | AD7525KN | 1826-0784 | 01921 | CA324OE | 1826-0957 | 03285 | ADOP0TEH | 1826-1116 | 02290 | RC4166DB |
| 1826-0637 | 03793 | SG3524 SELECTED | 1826-0785 | 02180 | OP-17FJ | 1826-0959 | 03793 | SG3549M | 1826-1118 | 03285 | AD7524LN |
| 1826-0638 | 03406 | LM360N | 1826-0786 | 02883 | SW-01FQ | 1826-0960 | 05946 | TDA2654 | 1826-1119 | 03406 | LM340-12AT |
| 1826-0639 | 03285 | AD7524JN | 1826-0787 | 03285 | AD540-4P | 1826-0961 | 03406 | LF412CN | 1826-1120 | 02180 | CMP-01CP |
| 1826-0640 | 01698 | TL061CP | 1826-0789 | 02910 | NE5018F | 1826-0962 | 03406 | LF412CN | 1826-1123 | 02883 | DG201ACJ |
| 1826-0643 | 01698 | TL431CLP | 1826-0790 | 03406 | LM29A9H | 1826-0963 | 03714 | ICL7613BCTV | 1826-1124 | 063336 | L165V |
| 1826-0644 | 03799 | HA2-2515-5 | 1826-0791 | 03799 | HI-4905-5 | 1826-0964 | 03285 | AD589JH | 1826-1125 | 02180 | OP-16GJ |
| 1826-0645 | 02237 | UA79M12AU | 1826-0792 | 03406 | NE556N | 1826-0966 | 03406 | LM396K | 1826-1126 | 03406 | LM392N |
| 1826-0646 | 03285 | AD581LH | 1826-0793 | 02237 | AD7510H | 1826-0967 | 03714 | ICL76501JD | 1826-1127 | 03406 | LF412CH |
| 1826-0649 | 03406 | CD22100E | 1826-0794 | 06545 | LAS18A15 | 1826-0969 | 03285 | AD536AKH | 1826-1128 | 03406 | LF412ACN |
| 1826-0651 | 01698 | CD4015PC SELECTED | 1826-0795 | 09161 | MT8685XC | 1826-0970 | 03921 | CA330D | 1826-1129 | 03285 | AD642JH |
| 1826-0652 | 03406 | AD590KH | 1826-0796 | 08161 | LF3680XE | 1826-0972 | 03406 | NE5020F | 1826-1130 | 03406 | LM0071-2H |
| 1826-0655 | 03406 | LM3914N | 1826-0797 | 0815 | SG3524L SELECTED | 1826-0973 | 03285 | AD571KD | 1826-1131 | 02237 | UA733DC |
| 1826-0656 | 02237 | 78H05A | 1826-0798 | 03793 | SG3524 SELECTED | 1826-0974 | 02180 | OP-08FP | 1826-1132 | 03406 | ADCB080CCN |
| 1826-0657 | 03406 | LM339AN | 1826-0799 | 03406 | LM399Z | 1826-0978 | 02180 | OP-37FZ | 1826-1134 | 02180 | SMP-10FY |
| 1826-0658 | 03406 | LF3514N | 1826-0802 | 03406 | LM100-1H | 1826-0979 | 03406 | XR-2211CP | 1826-1135 | 03406 | XR-2209CP SELECTED |
| 1826-0659 | 03406 | LM3514N | 1826-0803 | 03406 | OP-15GJ | 1826-0980 | 03406 | LM307J | 1826-1136 | 06121 | TDA4700 |
| 1826-0660 | 03406 | LM358AH | 1826-0804 | 03406 | AD5080PC | 1826-0981 | 03406 | LM2930P-5.0TB | 1826-1137 | 00350 | XR-2209CP |
| 1826-0662 | 03406 | LM337K (SELECTED) | 1826-0805 | 03406 | AD7523D | 1826-0982 | 02180 | TDA2030V | 1826-1138 | 03406 | LM135AH |
| 1826-0663 | 01698 | TL062CP | 1826-0807 | 02180 | REF-02HP | 1826-0983 | 02180 | OP-08FP | 1826-1139 | 03406 | ADCB080CCN |
| 1826-0664 | 03285 | AD7510BD (SEL) | 1826-0808 | 02883 | DO211CJ | 1826-0984 | 02037 | LF357N | 1826-1140 | 02180 | SMP-10FY |
| 1826-0685 | 03406 | LF351H | 1826-0809 | 03799 | HA1-245-5 | 1826-0985 | 03794 | AM6080DC | 1826-1141 | 06121 | TDA4700 |
| 1826-0686 | 03406 | REF-01CP | 1826-0810 | 03406 | LM917N | 1826-0986 | 03406 | LM388N | 1826-1142 | 03714 | AD-888EX |
| 1826-0687 | 03406 | LM317HVK | 1826-0811 | 03406 | CA316Z | 1826-0987 | 03406 | AD5010CN | 1826-1143 | 03406 | SG |

| HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. | HPP/N | Mfr. | Desc. |
|-----------|-------|---------------------|-----------|-------|----------------------|-----------|-------|-----------------------|-----------|-------|-----------------------------|
| 1826-1196 | 03285 | AD644JH | 1826-1346 | 03799 | H13-201HS-5 | 1826-1500 | 02763 | TSC911ACPA | 1826-1651 | 01698 | N8592D |
| 1826-1197 | 02180 | OP-15EZ | 1826-1349 | 02180 | OP-02CZ | 1826-1501 | 01698 | TL594IN | 1826-1652 | 02037 | MC3408HAP |
| 1826-1198 | 03285 | AD7581LN | 1826-1350 | 03714 | ICL7660CBA | 1826-1502 | 02910 | NE5150-F | 1826-1653 | 05318 | L1962 |
| 1826-1199 | 06338 | L296P | 1826-1351 | 06121 | TDA4714A | 1826-1503 | 03799 | H11-507A-2 | 1826-1654 | 05436 | OPA606KP |
| 1826-1201 | 03406 | LM2930T-5.0 | 1826-1352 | 03793 | SG3524BN | 1826-1504 | 02037 | MC146818ACP | 1826-1655 | 02883 | DC301ACJ |
| 1826-1202 | 03285 | AD7533(SEL) | 1826-1353 | 05436 | DAC701KH | 1826-1505 | 01200 | ULQ-2065B | 1826-1656 | 03285 | AD7547BQ |
| 1826-1203 | 03406 | LM340LAZ-5 | 1826-1354 | 03406 | LH0075CG | 1826-1506 | 03406 | LM2901N | 1826-1664 | 11604 | CLC221AI |
| 1826-1204 | 03285 | AD7528JN | 1826-1355 | 02290 | RC4193NB | 1826-1507 | 04200 | ULN-8126A | 1826-1665 | 03406 | MFI0CCWM |
| 1826-1205 | 02883 | DG390CJ | 1826-1358 | 00046 | UC3906N | 1826-1508 | 03714 | ICL82111PA (SELECTED) | 1826-1666 | 03406 | MF10CCWM |
| 1826-1206 | 03406 | DAC1006LCJ | 1826-1359 | 03285 | AD573JD | 1826-1509 | 03406 | LM285BYZ-1.2 | 1826-1670 | 10858 | LT337AT |
| 1826-1207 | 02910 | HEF4066BT | 1826-1361 | 02883 | DG212CJ | 1826-1510 | 03714 | TCL709IPL | 1826-1672 | 07050 | MP7684KD |
| 1826-1208 | 02037 | MC3406P | 1826-1362 | 03285 | AD592AN | 1826-1511 | 10858 | OP-27EN8 | 1826-1675 | 05436 | DAC703CH |
| 1826-1209 | 02883 | DG180-BA | 1826-1363 | 03794 | AM7910DC | 1826-1512 | 01698 | TCM3105JE | 1826-1676 | 02910 | NE5568N |
| 1826-1210 | 01698 | TL185CN | 1826-1364 | 01698 | TL070CP | 1826-1513 | 02037 | MC34020BU | 1826-1677 | 05318 | TDA8173 |
| 1826-1211 | 03794 | AM6148DC | 1826-1365 | 03406 | LM35CZ | 1826-1514 | 10858 | TL1021BCN8-10 | 1826-1678 | 03714 | IH5149CPE |
| 1826-1212 | 02037 | MC1776CD | 1826-1366 | 03799 | H11-0539-5 | 1826-1515 | 02883 | S17435CJ | 1826-1679 | 03714 | IH5151CPE |
| 1826-1213 | 01698 | TLC271ACD | 1826-1367 | 02180 | OP-16FZ | 1826-1516 | 03406 | TL13007N | 1826-1683 | 03714 | ICL7673CBA |
| 1826-1214 | 01698 | TLC252LACD | 1826-1368 | 10858 | LT1002CN | 1826-1517 | 05145 | SM10105-1 | 1826-1684 | 02290 | RC4200ADE |
| 1826-1215 | 01698 | TLC271LACD | 1826-1369 | 10858 | LT1021DCN8-10 | 1826-1518 | 02883 | DG200ACJ (SELECTED) | 1826-1685 | 01698 | TL7702ACD |
| 1826-1216 | 10858 | LT350AT | 1826-1370 | 02406 | TL365M | 1826-1519 | 05436 | NA101SG | 1826-1687 | 10858 | LT1021DCS8-10 |
| 1826-1217 | 02180 | PKD-01EY | 1826-1371 | 06394 | ZN1066E | 1826-1520 | 02883 | S17661CJ (SELECTED) | 1826-1688 | 03799 | HA1-5190-2 |
| 1826-1218 | 02037 | MC7824CT | 1826-1372 | 03406 | MM74H4C0406N | 1826-1521 | 03285 | AD380KH | 1826-1689 | 11604 | CLC104AI |
| 1826-1219 | 03285 | AD567KD | 1826-1373 | 03714 | ICL7650CPD | 1826-1524 | 00046 | UC3901N | 1826-1690 | 10858 | LT1022ACR |
| 1826-1220 | 03799 | HA-2525-5 | 1826-1374 | 10858 | LT1037CH | 1826-1525 | 07050 | MP7533QN | 1826-1691 | 03799 | HA1-2539-5 |
| 1826-1221 | 03406 | LM311J-8 | 1826-1378 | 03794 | AM6687DLD | 1826-1526 | 03714 | TCL7673CPA | 1826-1692 | 10858 | LT1056CN8 |
| 1826-1222 | 02037 | MC3407HAL | 1826-1379 | 03285 | AD7266KN | 1826-1527 | 03406 | LM339M | 1826-1693 | 03406 | ADC105B5CJ-1 |
| 1826-1223 | 03406 | LM10BLH | 1826-1381 | 10858 | LT1012CN8 | 1826-1528 | 10858 | LTC104HCN8 | 1826-1694 | 03799 | HA1-5033-5 |
| 1826-1225 | 03406 | LP339P | 1826-1382 | 10858 | LT1001CN8 (SELECTED) | 1826-1529 | 11943 | SC11001CN | 1826-1699 | 03799 | HA1-5002-5 |
| 1826-1226 | 03794 | AM6112DC (SELECTED) | 1826-1383 | 03406 | LM320LZ-5.0 | 1826-1530 | 02037 | MC34072P | 1826-1700 | 03285 | AD7225LP |
| 1826-1227 | 03406 | LM301AJ | 1826-1384 | 02180 | CMP-01CZ | 1826-1531 | 02037 | MC34074P | 1826-1701 | 03406 | DS3695TN |
| 1826-1229 | 01698 | LM393JG | 1826-1385 | 03406 | DAC8020LCN | 1826-1532 | 01921 | CA3140AE | 1826-1702 | 10858 | LT1055CN8 |
| 1826-1231 | 03285 | AD7528XN | 1826-1386 | 03285 | AD7541AKN | 1826-1533 | 03780 | RGBDC43404 | 1826-1703 | 11604 | CLC203AI |
| 1826-1232 | 03285 | AD7528JN | 1826-1387 | 02037 | MCT808CT | 1826-1534 | 10858 | LT1011ACH | 1826-1705 | 04507 | TDC1016B7C8 |
| 1826-1233 | 01590 | SP9676DG16 | 1826-1388 | 03794 | AM7960 | 1826-1540 | 06608 | SS132R501R-6CH | 1826-1706 | 10858 | LT1021BCN8-5 |
| 1826-1234 | 03285 | AD72266Q | 1826-1389 | 03406 | LM1875 | 1826-1541 | 03406 | LM136H | 1826-1707 | 02180 | CMP-05Z |
| 1826-1235 | 03406 | LM385BZ-2.5 | 1826-1390 | 03406 | ADC0833BCN | 1826-1543 | 02037 | MC34072AU | 1826-1710 | 01698 | UL2068NE |
| 1826-1236 | 03794 | AM6012APC | 1826-1391 | 03714 | IH5012CE | 1826-1544 | 02037 | MC34081P | 1826-1711 | 10858 | LT1019AC-5 |
| 1826-1237 | 06916 | CX2005ZA | 1826-1392 | 08608 | TS3M522CP | 1826-1545 | 00046 | UC2842N | 1826-1713 | 02037 | MPC2014 |
| 1826-1238 | 05436 | DAC63CM | 1826-1393 | 03285 | AD7545JN | 1826-1546 | 02910 | NE5534AD | 1826-1714 | 01921 | CA3306E |
| 1826-1239 | 03406 | LM299AH | 1826-1394 | 02910 | SE556N | 1826-1547 | 03794 | AM8151DC | 1826-1715 | 06338 | L9'22 |
| 1826-1240 | 03285 | AD567JD | 1826-1395 | 10858 | LT337AK | 1826-1548 | 03406 | DAC1208LCJ | 1826-1716 | 03285 | AD611KH |
| 1826-1241 | 03714 | IH6108CPE | 1826-1396 | 10858 | LT338AK | 1826-1549 | 05436 | XTR110AG | 1826-1717 | 11302 | MAD64CPA |
| 1826-1242 | 03755 | ADC9331-6 | 1826-1397 | 03406 | LM2931AZ-5.0 | 1826-1550 | 02910 | NE522D | 1826-1720 | 03406 | LM675T |
| 1826-1243 | 03793 | SG3527AW | 1826-1398 | 01698 | TL081CP | 1826-1551 | 02910 | LM131D | 1826-1722 | 03291 | M5A-0185 |
| 1826-1244 | 02180 | SMP-11EY | 1826-1399 | 03285 | AD7534JN | 1826-1552 | 03406 | ADC0802LCN | 1826-1723 | 03291 | M5A-0885 |
| 1826-1245 | 01698 | TL7702A | 1826-1400 | 03285 | AD7545AKN | 1826-1553 | 01085 | LT1014DN | 1826-1724 | 03291 | M5A-0785 |
| 1826-1246 | 03285 | AD667AD | 1826-1401 | 03285 | AD7506KN | 1826-1554 | 05436 | PGAL02AG | 1826-1725 | 03406 | LM833N |
| 1826-1247 | 02883 | DG243CK | 1826-1402 | 02037 | MC76L05ACD | 1826-1555 | 01590 | SL414C | 1826-1726 | 03406 | LF411CN4A+ (SELECTED) |
| 1826-1248 | 03406 | ADC084WCCN | 1826-1403 | 10858 | LT317AT | 1826-1556 | 06916 | CX2020A-1 | 1826-1727 | 10858 | LT1028CJ8 |
| 1826-1249 | 01085 | LM399AH (SEL) | 1826-1404 | 03406 | MM5437N | 1826-1557 | 03406 | LF365BJ | 1826-1728 | 03406 | LM386N-4 |
| 1826-1250 | 03406 | MF10CM | 1826-1405 | 03406 | LF4L24ACN | 1826-1558 | 11825 | ZAD7210 | 1826-1730 | 03285 | AD7578BD |
| 1826-1251 | 03794 | AD6070DC | 1826-1406 | 05436 | AD611AH | 1826-1559 | 03285 | AD625JN | 1826-1731 | 02037 | MC1019L |
| 1826-1254 | 01921 | CA307T | 1826-1407 | 03285 | AD7545GLN | 1826-1560 | 02910 | NE5521D | 1826-1732 | 03037 | LMC660CN |
| 1826-1255 | 02037 | MC34062P1 | 1826-1408 | 06344 | MB4107 | 1826-1561 | 01698 | TL7700ACP | 1826-1733 | 02883 | DG2210CJ |
| 1826-1256 | 02037 | MC34063U | 1826-1409 | 10858 | LT1013CN8 | 1826-1562 | 10858 | LTC1052CJ | 1826-1734 | 02037 | MC780M5CDT |
| 1826-1257 | 02037 | MC78108ACP | 1826-1410 | 05436 | DAC702BH | 1826-1563 | 02180 | OP-37EZ | 1826-1735 | 10858 | LT1007CS |
| 1826-1258 | 02037 | TLC231ACP | 1826-1411 | 03799 | H11-303-5 | 1826-1564 | 03406 | LM3524N | 1826-1736 | 02037 | MC78102CDT |
| 1826-1263 | 01698 | TLC274ACN | 1826-1415 | 03406 | LM333R STEEL | 1826-1565 | 11721 | TL12M4ID | 1826-1737 | 02037 | MC79102CDT |
| 1826-1264 | 01698 | TLC274MACN | 1826-1416 | 03285 | AD7546BD | 1826-1566 | 02910 | TL2913D | 1826-1738 | 02037 | MC790M5CDT |
| 1826-1265 | 01085 | LT318AN8 (SELECTED) | 1826-1417 | 07050 | MP763XNN | 1826-1567 | 03688 | MP260 | 1826-1739 | 03406 | LT318M |
| 1826-1266 | 06338 | L293E | 1826-1418 | 03285 | AD573JN | 1826-1568 | 02858 | AD592BN | 1826-1740 | 11561 | E2128R |
| 1826-1267 | 06338 | L297 | 1826-1419 | 08608 | SS1117-2 PDIP | 1826-1569 | 03406 | LM110H | 1826-1741 | 00350 | RR-88C681/40CP |
| 1826-1268 | 03285 | ADP-27FH | 1826-1420 | 03799 | H47-5130-5 | 1826-1570 | 00446 | UC3846N | 1826-1742 | 02883 | DG271DY |
| 1826-1269 | 01698 | TLC272ACP | 1826-1421 | 06211 | TDA601D | 1826-1571 | 02910 | TA03047 | 1826-1743 | 05436 | OPA606LM |
| 1826-1271 | 03406 | 613S32 | 1826-1422 | 02037 | MC34084P | 1826-1572 | 01280 | OP-17EZ | 1826-1744 | 05436 | MAX1493CPA |
| 1826-1272 | 02180 | CMP-02CJ | 1826-1424 | 03285 | AD6673JN | 1826-1573 | 01247 | TML1842 | 1826-1745 | 03799 | HA1-2541-5 |
| 1826-1273 | 01698 | TL7705CP-B | 1826-1425 | 03285 | AD7224LN | 1826-1574 | 01248 | TM1595AD | 1826-1746 | 10858 | LM385S8-1.2 |
| 1826-1274 | 05436 | PCM53JG-V | 1826-1426 | 02180 | OP-21EZ | 1826-1575 | 02037 | MC34081AP | 1826-1747 | 10858 | LM385S8-2.5 |
| 1826-1276 | 05436 | VCF62BG | 1826-1427 | 03799 | AM6685HL | 1826-1576 | 02037 | MC34082AP | 1826-1748 | 03406 | LM2935T05B |
| 1826-1279 | 02180 | TDC1018DAC | 1826-1428 | 03406 | LM0041CG | 1826-1577 | 03799 | H11-674WDK-5 | 1826-1749 | 06347 | HD63840P |
| 1826-1280 | 03406 | MOH332E | 1826-1429 | 03285 | AD7503KN | 1826-1578 | 01346 | LF3627AM | 1826-1750 | 03406 | DAC1218LCD |
| 1826-1281 | 03406 | LM285H-2.5 | 1826-1430 | 03285 | AD7543JN | 1826-1579 | 02868 | SS132R521R-6CH | 1826-1751 | 03406 | SL1929 |
| 1826-1282 | 03799 | H13-0201-5 | 1826-1431 | 03285 | AD7543JN | 1826-1580 | 01085 | LT1014CN8 | 1826-1752 | 03406 | SL3026 (SELECTED LT1008CN8) |
| 1826-1284 | 03285 | AD7548JN | 1826-1432 | 03285 | AD7549BD | 1826-1581 | 02037 | MC14051BCD | 1826-1753 | 01698 | TL1929AD |
| 1826-1285 | 02037 | MC1403AU (SEL) | 1826-1433 | 03799 | H11-0518-5 | 1826-1582 | 02835 | AD7553AD | 1826-1754 | 02037 | MC14051BCD |
| 1826-128 | | | | | | | | | | | |

| H P P / N | Mfr. | Desc. | H P P / N | Mfr. | Desc. | H P P / N | Mfr. | Desc. | H P P / N | Mfr. | Desc. |
|-----------|-------|---------------------|-----------|-------|--------------------|-----------|-------|--------------|-----------|-------|--------------------|
| 1826-1809 | 03406 | LM13700N | 1826-1946 | 02037 | MC1490P | 1826-2087 | 02037 | MC34063P1 | 1826-2225 | 03291 | IAM-82018 |
| 1826-1810 | 01698 | TLO71D | 1826-1947 | 02037 | MWA0211,L | 1826-2089 | 02180 | OP-2070Z | 1826-2226 | 03291 | MSA-0286 |
| 1826-1811 | 01698 | LM072ACD | 1826-1948 | 03285 | AD7672K05P | 1826-2092 | 05436 | OPA620KP | 1826-2227 | 11604 | CLC231AI |
| 1826-1812 | 00046 | UC3706J | 1826-1949 | 10858 | LT1084CP | 1826-2093 | 03285 | AD770JD | 1826-2228 | 05436 | DAC811JU |
| 1826-1813 | 03406 | LM558M | 1826-1950 | 10858 | LT1016CS8 | 1826-2094 | 05436 | INA117P | 1826-2229 | 03285 | AD96687BP |
| 1826-1814 | 02037 | MC34129D (SELECTED) | 1826-1951 | 05436 | PCM78P | 1826-2095 | 02883 | DG419DJ | 1826-2230 | 02180 | OP-400GS |
| 1826-1815 | 02883 | DG528CJ | 1826-1952 | 02883 | DG412DY | 1826-2096 | 04200 | ULN-3751Z | 1826-2231 | 05436 | 3652MG |
| 1826-1816 | 03406 | LM553M | 1826-1953 | 03291 | MSA-0335 | 1826-2097 | 11601 | CLC410AJP | 1826-2232 | 03406 | LN614CWM |
| 1826-1817 | 11777 | EL2018CN | 1826-1954 | 03291 | MSA-0835 | 1826-2098 | 01698 | TL279CN | 1826-2233 | 03406 | ADC0831CCWM |
| 1826-1818 | 03285 | AD7210JN | 1826-1955 | 02037 | UC3842AN | 1826-2099 | 02883 | DG535DJ | 1826-2234 | 04047 | L149V |
| 1826-1821 | 03406 | LMC7660IN | 1826-1960 | 02180 | OP-200EZ | 1826-2100 | 03406 | LM6325N | 1826-2235 | 11561 | 2SP5U9 |
| 1826-1822 | 06336 | L296HT | 1826-1962 | 10858 | LT1033CT | 1826-2102 | 02037 | LM208AN | 1826-2236 | 02910 | 74HCT7046AD |
| 1826-1823 | 12521 | E915-5..015CT | 1826-1963 | 03406 | LM386M-1 | 1826-2103 | 02037 | MC10E1651 | 1826-2237 | 03285 | ADG509AKN |
| 1826-1824 | 02883 | DG411DJ | 1826-1964 | 03406 | LM660CM | 1826-2104 | 11302 | MAX630CSA | 1826-2238 | 01698 | TL7712ACP |
| 1826-1825 | 03406 | LM833M | 1826-1965 | 05436 | INA110KU | 1826-2105 | 02037 | CA3054D | 1826-2239 | 03285 | AD7542KX |
| 1826-1826 | 03406 | LM317LM | 1826-1966 | 03291 | MSA-0285 | 1826-2106 | 11302 | MAX694CPA | 1826-2240 | 01590 | SP1646MP |
| 1826-1827 | 02180 | FM-7545HP | 1826-1967 | 03291 | MSA-0685 | 1826-2107 | 06352 | CXA-M10M | 1826-2241 | 03285 | AD813KN |
| 1826-1828 | 05436 | FCM56P | 1826-1968 | 03406 | LP2951ACN | 1826-2108 | 12253 | MC100R/M246B | 1826-2242 | 06353 | 12N20DL2 |
| 1826-1829 | 01698 | TL7709ACP | 1826-1969 | 03285 | AD708AQ | 1826-2109 | 03285 | AD7537JP | 1826-2243 | 02037 | MC1377DW |
| 1826-1830 | 01698 | TL197ATC | 1826-1970 | 03285 | AD818JN | 1826-2110 | 02910 | TD4356WN | 1826-2244 | 03285 | AD9618JN |
| 1826-1831 | 03291 | MSA-0910 | 1826-1971 | 12171 | USH5008-AI-K28 | 1826-2111 | 02037 | MC1495D | 1826-2245 | 03406 | LM35DZ OPT. J61Z |
| 1826-1832 | 00046 | UC3637J | 1826-1973 | 02037 | MC34064P-5 | 1826-2112 | 03285 | AD844HN | 1826-2246 | 03285 | AD7878JN |
| 1826-1834 | 02883 | S17660CJ | 1826-1974 | 03285 | AD7672K05N | 1826-2113 | 02037 | MC144110P | 1826-2247 | 10858 | LT1055ACH |
| 1826-1835 | 02883 | DG201ADY | 1826-1975 | 02180 | OP-470EY | 1826-2114 | 10858 | LT1001CS8 | 1826-2248 | 03406 | LM3524DN |
| 1826-1836 | 02883 | DG508ADY | 1826-1976 | 02037 | MC34004BP | 1826-2115 | 03406 | LM308AM | 1826-2249 | 03406 | LFM60C1WM-50 |
| 1826-1837 | 10858 | LT1013DS8 | 1826-1977 | 03291 | MSA-0770 | 1826-2116 | 02037 | MC34182D | 1826-2251 | 03285 | CLX900631-200 |
| 1826-1838 | 10858 | LT1021DS8-5 | 1826-1978 | 03285 | AD7582KX | 1826-2117 | 11604 | CLC501AJP | 1826-2252 | 02180 | OP-270GE |
| 1826-1839 | 10858 | LT10558S | 1826-1979 | 10858 | LT100958 | 1826-2118 | 03285 | AD539KN | 1826-2253 | 03285 | AD816AN |
| 1826-1840 | 10858 | LT1029ACZ | 1826-1980 | 10858 | LM231Z-3 | 1826-2119 | 02883 | DG221DY | 1826-2254 | 03285 | AD618JN |
| 1826-1841 | 03406 | LM337LM | 1826-1981 | 03285 | AD569AD | 1826-2120 | 02686 | WJ-PA1-10 | 1826-2255 | 10858 | LTC1064-4CN |
| 1826-1843 | 02037 | TLJ311P | 1826-1982 | 10858 | LT1038CK | 1826-2121 | 10572 | X9103P | 1826-2256 | 11302 | MAX666CPA |
| 1826-1844 | 02180 | OP-42FZ | 1826-1983 | 03285 | AD7828XN | 1826-2122 | 03285 | AD7846KN | 1826-2258 | 03285 | AD548JN |
| 1826-1845 | 10858 | LT1057CN8 | 1826-1985 | 02883 | DG411DY | 1826-2123 | 02180 | ADC-912HP | 1826-2259 | 03406 | LM795GCCP SELECTED |
| 1826-1847 | 10858 | LT1021CHC-5 | 1826-1986 | 02037 | MWA0304 | 1826-2124 | 02037 | MC34184D | 1826-2260 | 11302 | MAX637ACPA |
| 1826-1848 | 02037 | MC1403D | 1826-1987 | 03285 | AD855JP | 1826-2125 | 01590 | SF9687MP | 1826-2261 | 03406 | LM35DM |
| 1826-1850 | 03285 | AD670JN | 1826-1988 | 02883 | DT57151AJP | 1826-2126 | 02037 | MC7905CT | 1826-2262 | 06344 | MB86022FF |
| 1826-1851 | 03285 | AD42022K | 1826-1989 | 03285 | DT57151AJP | 1826-2127 | 02037 | MC7905CT | 1826-2263 | 10858 | LT107WCT |
| 1826-1852 | 03285 | AD711CQ | 1826-1990 | 03406 | LF444CN | 1826-2128 | 02180 | OP-470GP | 1826-2264 | 02037 | MC34064D-5 |
| 1826-1853 | 01698 | SL6440C | 1826-1991 | 03285 | AD711JR | 1826-2129 | 05436 | OPA621KP | 1826-2265 | 03285 | AD595CQ |
| 1826-1857 | 03406 | LM6361N SELECTED | 1826-1992 | 02180 | OP-200GP | 1826-2130 | 03291 | MSA-1105 | 1826-2266 | 11668 | R5312 |
| 1826-1858 | 12185 | DS1259N | 1826-1993 | 02037 | MC7906CT | 1826-2131 | 01058 | LT1086CT | 1826-2267 | 11668 | R5313 |
| 1826-1859 | 11777 | EL2039CN | 1826-1994 | 02883 | S19102DNN | 1826-2132 | 02910 | PCF5873PN | 1826-2268 | 11668 | 10464 |
| 1826-1861 | 02037 | MC14053BCD | 1826-1995 | 10858 | LT1072HVCT | 1826-2136 | 01698 | LT074BCD | 1826-2269 | 03285 | AD9702BW |
| 1826-1862 | 02037 | TL072CD | 1826-1997 | 02180 | OP-290GP | 1826-2137 | 03285 | AD845JN | 1826-2270 | 00046 | UC3730N |
| 1826-1863 | 10881 | TL062ACFP | 1826-1998 | 03799 | H13-524-5 | 1826-2141 | 03291 | INA-03170 | 1826-2271 | 03406 | UA714TC |
| 1826-1864 | 03285 | AD7524K | 1826-2001 | 05436 | INA105AM | 1826-2142 | 02883 | DG540DJ | 1826-2272 | 01698 | TL7705BCP |
| 1826-1865 | 03285 | AD7548K | 1826-2002 | 02180 | OP-42FJ | 1826-2143 | 02180 | OP-37GS | 1826-2273 | 03406 | LM399H |
| 1826-1866 | 01698 | CA1096M | 1826-2003 | 03406 | LT356N | 1826-2144 | 02883 | DG413DY | 1902-0908 | 03406 | 1902-0928 |
| 1826-1867 | 02037 | MC33079D | 1826-2006 | 03406 | LM125H | 1826-2145 | 02180 | OP-77GS | 1902-0928 | 03406 | LM329 |
| 1826-1868 | 08608 | SS1104..6..1 | 1826-2007 | 02883 | DT413DJ | 1826-2146 | 02883 | DG408DY | 1902-1331 | 03406 | LM329D (SEL) |
| 1826-1869 | 03285 | AD7537JN | 1826-2008 | 05436 | OPA404AG | 1826-2147 | 02910 | NE572D | | | |
| 1826-1870 | 02037 | MC78108AC | 1826-2009 | 02180 | OP-470FY | 1826-2148 | 02883 | DG444DY | | | |
| 1826-1871 | 00039 | UPD5555C | 1826-2010 | 03406 | LM611CN (SELECTED) | 1826-2149 | 02037 | LT1722H | | | |
| 1826-1872 | 03406 | LP2951ACM | 1826-2011 | 11604 | CLC400AJP | 1826-2150 | 02037 | LM211D | | | |
| 1826-1874 | 01698 | TL592BD8 | 1826-2012 | 08608 | SSI 32R104CM-CL | 1826-2151 | 03406 | DS8911VC | | | |
| 1826-1875 | 02037 | MC12040FN | 1826-2013 | 08608 | SSI32R104L04-CL | 1826-2152 | 03406 | LM1965N | | | |
| 1826-1876 | 02037 | MC15106P | 1826-2016 | 02180 | OP-77GS | 1826-2153 | 03285 | AD7545AKP | | | |
| 1826-1877 | 02180 | PM7545HPC | 1826-2017 | 02180 | DAC-043EZ | 1826-2155 | 03406 | AD7848P | | | |
| 1826-1878 | 03285 | AD712JN | 1826-2018 | 02180 | DTLC2M2ACD | 1826-2156 | 03406 | NE5721ACM | | | |
| 1826-1879 | 03285 | AD711JN | 1826-2020 | 02910 | SG3254D | 1826-2157 | 02180 | DTLC2M2ACD | | | |
| 1826-1880 | 03285 | AD569JN | 1826-2021 | 03406 | LM1881M | 1826-2158 | 02180 | DAC-8222H | | | |
| 1826-1881 | 03406 | LM2930T-8.0 | 1826-2022 | 11899 | RP5C15 | 1826-2159 | 03285 | AD526JN | | | |
| 1826-1882 | 02180 | OP-400GP | 1826-2023 | 01590 | SL560C/DP | 1826-2160 | 03285 | ADG529AKN | | | |
| 1826-1883 | 03285 | AD744JN | 1826-2024 | 10858 | LT1057ACN | 1826-2161 | 03050 | XR-8038CP | | | |
| 1826-1884 | 03285 | AD9687BQ | 1826-2025 | 10858 | LT1083CK | 1826-2162 | 02037 | MC1021P | | | |
| 1826-1885 | 10881 | TEA2018A | 1826-2026 | 02883 | DG417DJ | 1826-2163 | 03285 | AD7870KN | | | |
| 1826-1887 | 10881 | TEA2037A | 1826-2027 | 02910 | 74HCT4046AN | 1826-2164 | 01698 | TL3103CLU | | | |
| 1826-1888 | 03285 | AD7245JN | 1826-2028 | 02180 | AMP-05FX | 1826-2165 | 03285 | ADG221KN | | | |
| 1826-1889 | 03291 | MSA-0520 | 1826-2029 | 02037 | UC3843AN | 1826-2166 | 02883 | DG409DYS | | | |
| 1826-1891 | 02180 | PM7543EQ | 1826-2030 | 11302 | MAX8212CPA | 1826-2167 | 03291 | MSA-0486 | | | |
| 1826-1892 | 02910 | AD7537CPC | 1826-2031 | 05436 | OPA451BM | 1826-2168 | 03285 | AD713JN | | | |
| 1826-1893 | 02037 | MC34074D | 1826-2032 | 05436 | OPA445AP | 1826-2169 | 03285 | OPC1473HA | | | |
| 1826-1894 | 02037 | MC34074D | 1826-2033 | 0406 | LM139AJ | 1826-2170 | 03285 | AD7873HA | | | |
| 1826-1895 | 02037 | MC12040FN | 1826-2034 | 03799 | H4-510-4-5 | 1826-2171 | 03285 | AD7545LN | | | |
| 1826-1896 | 02037 | MC15106P | 1826-2035 | 03406 | LM235AH | 1826-2172 | 03285 | AD7770-5CDW | | | |
| 1826-1897 | 02037 | MC15106N | 1826-2036 | 02739 | OP-200FZ | 1826-2173 | 00039 | UPC1108 | | | |
| 1826-1898 | 02037 | MC15204FN | 1826-2037 | 02739 | AD7070K | 1826-2174 | 03285 | AD588AD | | | |
| 1826-1899 | 00046 | UC3717AQ | 1826-2038 | 03406 | LT1085CT | 1826-2175 | 01542 | HPMA-0386T15 | | | |
| 1826-1900 | 02763 | TSC913ACPA | 1826-2039 | 05436 | OPA270P | 1826-2176 | 02037 | AD712JR | | | |
| 1826-1901 | 03285 | AD7534HN | 1826-2040 | 05436 | OPA270P | 1826-2177 | 03285 | AD713JN | | | |
| 1826-1902 | 03285 | AD7534HN</ | | | | | | | | | |

Needs Title

| Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N |
|--------------|-------|-----------|--------------|-------|-----------|------------------|-------|-----------|
| 100101DC | 02237 | 1820-2611 | 7110-1 | 03811 | 1820-2807 | 74ACT377PC | 02237 | 1820-5867 |
| 100101FC | 02237 | 1820-2390 | 7162 | 02838 | 1813-0133 | 74ACT541SC | 02237 | 1820-5946 |
| 100102DC | 02237 | 1820-2614 | 723BE | 02763 | 1826-0177 | 74ACT573PC | 03406 | 1820-7699 |
| 100102FC | 02237 | 1820-2391 | 723HC | 02237 | 1820-0196 | 74ACT573SC | 03406 | 1820-6383 |
| 100107DC | 02237 | 1820-2898 | 725HC | 02237 | 1826-0009 | 74ACT574SC | 02237 | 1820-5947 |
| 100107FC | 02237 | 1820-2392 | 73K222L-I28H | 00806 | 1820-6329 | 74ACT616PC | 03406 | 1820-6929 |
| 100112DC | 02237 | 1820-2878 | 73M3522CP | 08608 | 1826-1392 | 74ACT74PC | 03406 | 1820-6935 |
| 100112FC | 02237 | 1820-2393 | 7400DC | 02237 | 1820-0856 | 74ACT7WSC | 03406 | 1820-6473 |
| 100114DC | 02237 | 1820-2515 | 7403DC | 02237 | 1820-0864 | 74ACT8235PC | 03406 | 1820-6525 |
| 100117DC | 02237 | 1820-3062 | 740WDC | 02237 | 1820-0894 | 74ACTQ24SSC | 03406 | 1820-7616 |
| 100118DC | 02237 | 1820-3063 | 7408DC | 02237 | 1820-0870 | 74ALS2232ANT | 01698 | 1820-7294 |
| 100122DC | 02237 | 1820-2509 | 7411PC | 02237 | 1820-1066 | 74F00D | 02910 | 1820-4377 |
| 100124DC | 02237 | 1820-3064 | 74123N | 02910 | 1820-1585 | 74F00PC | 02237 | 1820-2684 |
| 100125DC | 02237 | 1820-3065 | 7417TD | 02910 | 1820-6733 | 74F02D | 02910 | 1820-4687 |
| 100131DC | 02237 | 1820-2767 | 741DC | 02237 | 1826-0070 | 74F02PC | 02237 | 1820-2685 |
| 100131FC | 02237 | 1820-2394 | 741HM | 02237 | 1826-0011 | 74F04PC | 02237 | 1820-2506 |
| 100136DC | 02237 | 1820-2510 | 7420DC | 02237 | 1820-0857 | 74F04SC | 02237 | 1820-5870 |
| 100136FC | 02237 | 1820-2395 | 7427DC | 02237 | 1820-1787 | 74F07N | 02910 | 1820-6932 |
| 100141DC | 02237 | 1820-3066 | 742PC | 02237 | 1826-0164 | 74F08D | 02910 | 1820-4364 |
| 100141FC | 02237 | 1820-2396 | 7474DC | 02237 | 1820-0859 | 74F08PC | 02237 | 1820-2686 |
| 100151DC | 02237 | 1820-2877 | 7476DC | 02237 | 1820-0858 | 74F109D | 02910 | 1820-5041 |
| 100151FC | 02237 | 1820-2397 | 7477DC | 02237 | 1826-0100 | 74F109PC | 02237 | 1820-2693 |
| 100155DC | 02237 | 1820-3067 | 74AC00PC | 02237 | 1820-5423 | 74F110D | 02910 | 1820-4373 |
| 100158DC | 02237 | 1820-3068 | 74AC00SC | 02237 | 1820-5945 | 74F110PC | 02237 | 1820-2687 |
| 100160DC | 02237 | 1820-3069 | 74AC02PC | 02237 | 1820-5651 | 74F112D | 02910 | 1820-5567 |
| 100163DC | 02237 | 1820-2511 | 74AC02SC | 03406 | 1820-6988 | 74F112PC | 02237 | 1820-2694 |
| 100164DC | 02237 | 1820-2512 | 74AC04PC | 02237 | 1820-5058 | 74F113D | 02910 | 1820-7220 |
| 100164FC | 02237 | 1820-2408 | 74AC04SC | 02237 | 1820-5950 | 74F114PC | 02237 | 1820-4343 |
| 100165DC | 02237 | 1820-2618 | 74AC08PC | 02237 | 1820-5654 | 74F11D | 02910 | 1820-5948 |
| 100166DC | 02237 | 1820-2768 | 74AC08SC | 02237 | 1820-5951 | 74F11PC | 02237 | 1820-2688 |
| 100170DC | 02237 | 1820-3070 | 74AC109SC | 02237 | 1820-5953 | 74F124D | 02910 | 1820-5333 |
| 100171DC | 02237 | 1820-3071 | 74AC10PC | 02237 | 1820-5653 | 74F124ON | 02910 | 1820-6060 |
| 100179DC | 02237 | 1820-2513 | 74AC10SC | 02237 | 1820-5952 | 74F124D | 02910 | 1820-5793 |
| 100180DC | 02237 | 1820-3072 | 74AC1100N | 01694 | 1820-7354 | 74F124d | 02910 | 1820-6000 |
| 100181DC | 02237 | 1820-2514 | 74AC11PC | 02237 | 1820-5652 | 74F124N | 02910 | 1820-5715 |
| 100182DC | 02237 | 1820-3073 | 74AC138PC | 02237 | 1820-5978 | 74F1245D | 02910 | 1820-5764 |
| 100183DC | 02237 | 1820-3074 | 74AC138SC | 02237 | 1820-5934 | 74F1245N | 02910 | 1820-5852 |
| 10188N | 02910 | 1820-2522 | 74AC139SC | 03406 | 1820-7245 | 74F125D | 02910 | 1820-5053 |
| 10464 | 11668 | 1826-k238 | 74AC14SC | 03406 | 1820-7244 | 74F125N | 02910 | 1820-4777 |
| 106A | 03285 | 1820-0218 | 74AC151PC | 03406 | 1820-6149 | 74F126D | 02910 | 1820-6618 |
| 10938P | 08810 | 1820-3916 | 74AC157PC | 02237 | 1820-5560 | 74F126N | 02910 | 1820-4779 |
| 10939P | 08810 | 1820-3917 | 74AC157SC | 02237 | 1820-5376 | 74F132D | 02910 | 1820-6157 |
| 10E422L-JJC | 11345 | 1816-1727 | 74AC158PC | 02237 | 1820-5650 | 74F132N SELECTED | 02910 | 1820-4164 |
| 1141LF | 11320 | 1820-6787 | 74AC161PC | 02237 | 1820-6072 | 74F133N | 02910 | 1820-6518 |
| 1141LG | 11967 | 1820-6788 | 74AC161SC | 03406 | 1820-7246 | 74F138D | 02910 | 1820-5130 |
| 118A | 03285 | 1820-0470 | 74AC163SC | 03406 | 1820-7218 | 74F138PC | 02237 | 1820-2861 |
| 11C01FC | 02237 | 1820-2407 | 74AC169SC | 02237 | 1820-5935 | 74F139D | 02910 | 1820-6309 |
| 11C05DC | 02237 | 1820-2140 | 74AC174PC | 02237 | 1820-6073 | 74F139PC | 02237 | 1820-3220 |
| 11C70DC | 02237 | 1820-1834 | 74AC175SC | 03406 | 1820-6561 | 74F13N | 02910 | 1820-6905 |
| 11C90DC | 02237 | 1820-1780 | 74AC191PC | 02237 | 1820-6310 | 74F1418PC | 02237 | 1820-3963 |
| 11C91DC | 02237 | 1820-2404 | 74AC191SC | 03406 | 1820-7247 | 74F141D | 02910 | 1820-5566 |
| 12N20DL2 | 06353 | 1826-2242 | 74AC20PC | 02237 | 1820-6255 | 74F142AN | 02910 | 1820-4163 |
| 1801DC | 02237 | 1820-0868 | 74AC240PC | 02237 | 1820-5839 | 74F1431AD | 02910 | 1820-6523 |
| 1818-3022 | 10443 | 1818-3022 | 74AC240SC | 03406 | 1820-7248 | 74F1451D | 02910 | 1820-5052 |
| 1AA7-6002 | 08323 | 1820-2146 | 74AC241PC | 02237 | 1820-5561 | 74F1451PC | 02237 | 1820-2936 |
| 1AD5-6101 | 08323 | 1820-3139 | 74AC244PC | 03406 | 1820-6741 | 74F153D | 02910 | 1820-5677 |
| 1AD5-6201 | 08323 | 1820-3140 | 74AC244SC | 02237 | 1820-6242 | 74F153PC | 02237 | 1820-2769 |
| 1AF9-6101 | 08323 | 1820-2994 | 74AC245SC | 02237 | 1820-6066 | 74F154N | 02910 | 1820-5860 |
| 1DC4-0004 | 01876 | 1820-0758 | 74AC251SC | 03406 | 1820-7216 | 74F157AD | 02910 | 1820-5042 |
| 1DC4-0901 | 01876 | 1820-0755 | 74AC251SC | 03406 | 1820-7249 | 74F157PC | 02237 | 1820-2654 |
| 1DC4-0902 | 01876 | 1820-0756 | 74AC253SC | 03406 | 1820-7250 | 74F158AD | 02910 | 1820-5811 |
| 1DC4-0903 | 01876 | 1820-0757 | 74AC257SC | 03406 | 1820-7251 | 74F158PC | 02237 | 1820-2695 |
| 1DH2-0102 | 01876 | 1820-0760 | 74AC273SC | 02237 | 1820-6029 | 74F160APC | 02237 | 1820-3645 |
| 2051 | 03947 | 1818-0566 | 74AC299SC | 03406 | 1820-6945 | 74F160ASC | 03406 | 1820-7241 |
| 2102L-2PC | 02237 | 1820-1078 | 74AC32PC | 02237 | 1820-5655 | 74F161AD | 02910 | 1820-6206 |
| 21L02FPC | 02237 | 1818-0757 | 74AC32SC | 02237 | 1820-5936 | 74F162AN | 02910 | 1820-6229 |
| 229CG | 11320 | 1820-4454 | 74AC373PC | 02237 | 1820-5068 | 74F163AD | 02910 | 1820-6158 |
| 2532B | 02910 | 1820-1220 | 74AC373SC | 03406 | 1820-6846 | 74F163APC | 02237 | 1820-3348 |
| 2533V | 02910 | 1820-1608 | 74AC374PC | 02237 | 1820-6549 | 74F164D | 02910 | 1820-5977 |
| 27C011-20V10 | 03811 | 1818-4780 | 74AC374SC | 03406 | 1820-6549 | 74F164PC | 02237 | 1820-3649 |
| 28CG4-25 | 13053 | 1818-4870 | 74AC520SC | 03406 | 1820-6845 | 74F166N | 02910 | 1820-5375 |
| 29631ADC | 02290 | 1816-1451 | 74AC541SC | 02237 | 1820-6134 | 74F168N | 02910 | 1820-5626 |
| 2D102I | 05436 | 1813-0450 | 74AC577SC | 03406 | 1820-7253 | 74F168SC | 03406 | 1820-7242 |
| 2D102S | 05436 | 1813-0511 | 74AC646SPC | 02237 | 1820-6274 | 74F169PC | 02237 | 1820-3135 |
| 2D917 | 05436 | 1813-0098 | 74AC74PC | 02237 | 1820-5067 | 74F169SC | 03406 | 1820-7243 |
| 2E12R9 | 11561 | 1826-1740 | 74AC74SC | 02237 | 1820-5937 | 74F173D | 02910 | 1820-7270 |
| 2SP59U | 11561 | 1826-2235 | 74AC821SPC | 02237 | 1820-6275 | 74F173N | 02910 | 1820-6947 |
| 2VP59J | 11561 | 1826-1603 | 74AC86PC | 03406 | 1820-6408 | 74F174D | 02910 | 1820-5796 |
| 3112/12C | 05436 | 1813-0016 | 74AC86SC | 03406 | 1820-6391 | 74F174PC | 02237 | 1820-3280 |
| 3311DC | 02237 | 1818-0093 | 74ACT00PC | 02237 | 1820-5869 | 74F175D | 02910 | 1820-5043 |
| 334CJ | 02763 | 1820-1129 | 74ACT00SC | 02237 | 1820-5938 | 74F175PC | 02237 | 1820-2696 |
| 3528AM | 05436 | 1826-0767 | 74ACT04SC | 02237 | 1820-5939 | 74F1762A | 02910 | 1820-7228 |
| 3528BM | 05436 | 1826-1134 | 74ACT08PC | 02237 | 1820-6131 | 74F1762N | 02910 | 1820-6944 |
| 35392CP | 08831 | 1818-1335 | 74ACT08SC | 02237 | 1820-5940 | 74F1804D | 02910 | 1820-6992 |
| 3627AM | 05436 | 1826-1134 | 74ACT109PC | 02237 | 1820-6191 | 74F1805D | 02910 | 1820-6993 |
| 3652MG | 05436 | 1826-2231 | 74ACT109SC | 02237 | 1820-6133 | 74F181PC | 02237 | 1820-3221 |
| 3816FC | 02237 | 1820-2154 | 74ACT1100N | 01698 | 1820-6951 | 74F182PC | 02237 | 1820-2955 |
| 4008BPC | 02237 | 1820-2265 | 74ACT1112N | 02910 | 1820-6982 | 74F1894N | 02910 | 1820-6918 |
| 4009BPC | 02237 | 1820-1484 | 74ACT1244DW | 01698 | 1820-6620 | 74F1895N | 02910 | 1820-6919 |
| 40163BPC | 02237 | 1820-2125 | 74ACT1245DW | 01698 | 1820-7281 | 74F1896N | 02910 | 1820-6920 |
| 4027BDC | 02237 | 1820-1813 | 74ACT1245N | 02910 | 1820-6983 | 74F1897N | 02910 | 1820-6940 |
| 4040BPC | 02237 | 1820-2264 | 74ACT1257N | 02910 | 1820-6984 | 74F189PC | 02237 | 1816-1530 |
| 4104PC | 02237 | 1820-2032 | 74ACT12PC | 03406 | 1820-6938 | 74F190D | 02910 | 1820-6246 |
| 4512BPC | 02237 | 1820-1586 | 74ACT1373D | 02237 | 1820-5868 | 74F1919D | 02910 | 1820-6450 |
| 4702BDC | 02237 | 1820-1854 | 74ACT138PC | 02237 | 1820-5941 | 74F1919N | 02910 | 1820-6160 |
| 4725BPC | 02237 | 1818-1012 | 74ACT138SC | 02237 | 1820-6192 | 74F191PC | 02237 | 1820-2760 |
| 4JX19A555 | 01973 | 1820-0001 | 74ACT139PC | 02237 | 1820-6195 | 74F193D | 02910 | 1820-7290 |
| 5084-0128 | 01876 | 1818-0754 | 74ACT139SC | 02237 | 1820-6195 | 74F193PC | 02237 | 1820-4310 |
| 51066-25 | 03811 | 1818-3901 | 74ACT151PC | 02237 | 1820-6193 | 74F194PC | 02237 | 1820-2697 |
| 5D12.0 | | | | | | | | |

| Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N |
|-----------|-------|-----------|-------------|-------|-------------|-----------|-------|-----------|
| 74F257PC | 02237 | 1820-3227 | 74F821N | 02910 | 1820-6197 | 74LS196PC | 02237 | 1820-2049 |
| 74F258AD | 02910 | 1820-5873 | 74F822D | 02910 | 1820-6410 | 74LS20D | 02910 | 1820-4361 |
| 74F258APC | 02237 | 1820-2763 | 74F822N | 02910 | 1820-6415 | 74LS24D | 02910 | 1820-4359 |
| 74F259N | 02910 | 1820-5986 | 74F823D | 02910 | 1820-6316 | 74LS243N | 02910 | 1820-2729 |
| 74F260D | 02910 | 1820-6322 | 74F823N | 02910 | 1820-6067 | 74LS244D | 02910 | 1820-4360 |
| 74F260N | 02910 | 1820-5136 | 74F825D | 02910 | 1820-7613 | 74LS260N | 02910 | 1820-1905 |
| 74F269D | 02910 | 1820-5051 | 74F827D | 02910 | 1820-6317 | 74LS27D | 02910 | 1820-4366 |
| 74F269N | 02910 | 1820-4125 | 74F827N | 02910 | 1820-6221 | 74LS30D | 02910 | 1820-4362 |
| 74F273D | 02910 | 1820-5050 | 74F828D | 02910 | 1820-6325 | 74LS32D | 02910 | 1820-4371 |
| 74F273N | 02910 | 1820-4235 | 74F838N | 02910 | 1820-6916 | 74LS364N | 02910 | 1820-3696 |
| 74F27D | 02910 | 1820-5763 | 74F85D | 02910 | 1820-5680 | 74LS390PC | 02237 | 1820-1991 |
| 74F27N | 02910 | 1820-4492 | 74F85N | 02910 | 1820-3939 | 74LS393PC | 02237 | 1820-1989 |
| 74F280BD | 02910 | 1820-5791 | 74F861N | 02910 | 1820-6476 | 74LS569PC | 02237 | 1820-2366 |
| 74F280BN | 02910 | 1820-6031 | 74F862N | 02910 | 1820-6917 | 74LS74AD | 02910 | 1820-4369 |
| 74F280PC | 02237 | 1820-3234 | 74F863D | 02910 | 1820-5792 | 74S00D | 02910 | 1820-7359 |
| 74F283PC | 02237 | 1820-3133 | 74F86D | 02910 | 1820-5795 | 74S109DC | 02237 | 1820-1372 |
| 74F283SC | 02237 | 1820-5683 | 74F86PC | 02237 | 1820-2692 | 74S273N | 02910 | 1820-4449 |
| 74F298D | 02910 | 1820-6323 | 74F881N | 02910 | 1820-5726 | 74S553N | 04092 | 1820-2527 |
| 74F298N | 02910 | 1820-5686 | 74F882N | 02910 | 1820-5727 | 74S554N | 04092 | 1820-2526 |
| 74F299D | 02910 | 1820-6722 | 74FC124APC | 03406 | 1820-7317 | 751N | 03285 | 1813-0048 |
| 74F299PC | 02237 | 1820-3216 | 74FC1540AP | 10253 | 1820-7238 | 776HC | 02237 | 1820-0086 |
| 74F3024DN | 02910 | 1820-6941 | 74HC40DC | 02237 | 1820-0867 | 776XC | 02237 | 1826-0325 |
| 74F3037N | 02910 | 1820-5237 | 74HC138D | 02910 | 1820-6215 | 7806KC | 02237 | 1826-0160 |
| 74F3038N | 02910 | 1820-7353 | 74HC151D | 02910 | 1820-5573 | 7815UC | 02237 | 1826-0396 |
| 74F30D | 02910 | 1820-5800 | 74HC191D | 02910 | 1820-6406 | 7818KC | 02237 | 1826-0126 |
| 74F30N | 02910 | 1820-4551 | 74HC193D | 02910 | 1820-5949 | 7824UC | 02237 | 1826-0150 |
| 74F32D | 02910 | 1820-4908 | 74HC21D | 02910 | 1820-5797 | 78H05A | 02237 | 1826-0656 |
| 74F32PC | 02237 | 1820-2690 | 74HC240D | 02910 | 1820-6216 | 78L12AH | 02237 | 1826-0333 |
| 74F350PC | 02237 | 1820-3228 | 74HC245D | 02910 | 1820-6188 | 8007C | 03714 | 1826-0121 |
| 74F352PC | 02237 | 1820-3728 | 74HC27D | 02910 | 1820-4219 | 8023A | 11111 | 1820-4562 |
| 74F353PC | 02237 | 1820-3229 | 74HC32D | 02910 | 1820-4220 | 8242A | 02910 | 1820-0719 |
| 74F365N | 02910 | 1820-4847 | 74HC365D | 02910 | 1820-7264 | 82541A | 02910 | 1820-1862 |
| 74F367N | 02910 | 1820-4183 | 74HC393D | 02910 | 1820-5798 | 8702CN | 02763 | 1826-0621 |
| 74F373D | 02910 | 1820-5219 | 74HC4046AD | 02910 | 1820-2031 | 8857 | 05542 | 1826-1137 |
| 74F373PC | 02237 | 1820-2700 | 74HC4053D | 02910 | 1820-4346 | 8T26AN | 02910 | 1820-1081 |
| 74F374D | 02910 | 1820-4357 | 74HC4094D | 02910 | 1820-5790 | 8T31A | 02910 | 1820-1845 |
| 74F374PC | 02237 | 1820-2701 | 74HC4094D | 02910 | 1820-5008 | 8T98B | 02910 | 1820-1863 |
| 74F377D | 02910 | 1820-5762 | 74HC4538D | 02910 | 1820-6421 | 9000DC | 02237 | 1820-0330 |
| 74F377N | 02910 | 1820-4342 | 74HC610D | 02910 | 1820-7277 | 9002DC | 02237 | 1820-0127 |
| 74F378D | 02910 | 1820-7221 | 74HC646D | 02910 | 1820-5736 | 9015DC | 02237 | 1820-0745 |
| 74F378PC | 02237 | 1820-3863 | 74HC85D | 02910 | 1820-4218 | 9016DC | 02237 | 1820-0132 |
| 74F379PC | 02237 | 1820-3230 | 74HC86D | 02910 | 1820-4938 | 9030DC | 02237 | 1820-0612 |
| 74F37D | 02910 | 1820-5576 | 74HCCT00D | 02910 | 1820-5469 | 905SSH | 12862 | 1826-2067 |
| 74F37N | 02910 | 1820-4439 | 74HCCT02D | 02910 | 1820-5470 | 9094DC | 02237 | 1820-0341 |
| 74F381PC | 02237 | 1820-3231 | 74HCCT02N | 02910 | 1820-6163 | 9097D | 02237 | 1820-0342 |
| 74F382D | 02910 | 1820-6117 | 74HCCT03N | 02910 | 1820-6863 | 9112DC | 02237 | 1820-0516 |
| 74F382PC | 02237 | 1820-3279 | 74HCCT04D | 02910 | 1820-5471 | 911HC | 02237 | 1820-0081 |
| 74F384PC | 03406 | 1820-6686 | 74HCCT08D | 02910 | 1820-5181 | 9158DC | 02237 | 1820-0863 |
| 74F385N | 02910 | 1820-6443 | 74HCCT08N | 02910 | 1820-5183 | 923BC | 02237 | 1820-0052 |
| 74F38D | 02910 | 1820-4861 | 74HCCT10D | 02910 | 1820-5472 | 9300PC | 02237 | 1820-0134 |
| 74F38N | 02910 | 1820-4057 | 74HCCT10N | 02910 | 1820-6223 | 9301PC | 02237 | 1820-0111 |
| 74F393N | 02910 | 1820-5987 | 74HCCT10N | 02910 | 1820-6074 | 9304PC | 02237 | 1820-0357 |
| 74F395D | 02910 | 1820-5436 | 74HCCT11N | 02910 | 1820-5057 | 9305PC | 02237 | 1820-0898 |
| 74F399PC | 02237 | 1820-3278 | 74HCCT11D | 02910 | 1820-6208 | 9307PC | 02237 | 1820-0914 |
| 74F399SC | 03406 | 1820-7362 | 74HCCT123D | 02910 | 1820-4352 | 9308PC | 02237 | 1820-0742 |
| 74F403DC | 02237 | 1820-5080 | 74HCCT123N | 02910 | 1820-5581 | 9310PC | 02237 | 1820-0705 |
| 74F410N | 02910 | 1820-5212 | 74HCCT125D | 02910 | 1820-5473 | 9313PC | 02237 | 1820-1063 |
| 74F410N | 02910 | 1820-6507 | 74HCCT125N | 02910 | 1820-5477 | 9314PC | 02237 | 1820-0626 |
| 74F50109D | 02910 | 1820-6861 | 74HCCT126N | 02910 | 1820-6167 | 9316HDC | 02237 | 1820-2094 |
| 74F5072BD | 02910 | 1820-7641 | 74HCCT132N | 02910 | 1820-5073 | 9316PC | 02237 | 1820-0231 |
| 74F5074D | 02910 | 1820-6766 | 74HCCT138D | 02910 | 1820-5182 | 9318PC | 02237 | 1820-0657 |
| 74F5074N | 02910 | 1820-6951 | 74HCCT139D | 02910 | 1820-6039 | 931HC | 02237 | 1820-0313 |
| 74F51D | 02910 | 1820-5565 | 74HCCT14D | 02910 | 1820-6470 | 9321PC | 02237 | 1820-0727 |
| 74F51N | 02910 | 1820-4778 | 74HCCT14N | 02910 | 1820-6472 | 9322PC | 02237 | 1820-0616 |
| 74F521D | 02910 | 1820-5579 | 74HCCT151N | 02910 | 1820-5055 | 9324PC | 02237 | 1820-0706 |
| 74F521PC | 02237 | 1820-2887 | 74HCCT161N | 02910 | 1820-5056 | 9328PC | 02237 | 1820-0741 |
| 74F524PC | 02237 | 1820-4900 | 74HCCT163N | 02910 | 1820-6130 | 9334PC | 02237 | 1820-0833 |
| 74F525DC | 02237 | 1820-5014 | 74HCCT165D | 02910 | 1820-6038 | 933DC | 02237 | 1820-0346 |
| 74F533PC | 02237 | 1820-2786 | 74HCCT175D | 02910 | 1820-5474 | 93415DC | 02237 | 1816-0914 |
| 74F534D | 02910 | 1820-5799 | 74HCCT175N | 02910 | 1820-6780 | 9342DC | 02237 | 1816-1334 |
| 74F534PC | 02237 | 1820-3012 | 74HCCT191N | 02910 | 1820-6071 | 9348PC | 02237 | 1820-0737 |
| 74F537D | 02237 | 1820-3232 | 74HCCT20N | 02910 | 1820-6495 | 9356PC | 02237 | 1820-1347 |
| 74F538D | 02910 | 1820-7340 | 74HCCT21N | 02910 | 1820-5111 | 935DC | 02237 | 1820-0869 |
| 74F538PC | 02237 | 1820-3092 | 74HCCT238N | 02910 | 1820-5984 | 9368PC | 02237 | 1820-1903 |
| 74F539D | 02910 | 1820-5678 | 74HCCT245N | 02910 | 1820-6212 | 936PC | 02237 | 1820-0307 |
| 74F539PC | 02237 | 1820-3233 | 74HCCT251N | 02910 | 1820-5484 | 9370PC | 02237 | 1820-2002 |
| 74F540PC | 03406 | 1820-6911 | 74HCCT253BN | 02910 | 1820-5485 | 9374PC | 02237 | 1820-1361 |
| 74F541D | 02910 | 1820-7298 | 74HCCT257N | 02910 | 1820-6078 | 937DC | 02237 | 1820-0128 |
| 74F543D | 02910 | 1820-6207 | 74HCCT259D | 02910 | 1820-7276 | 93L00PC | 02237 | 1820-0659 |
| 74F543SPC | 02237 | 1820-4597 | 74HCCT259N | 02910 | 1820-6567 | 93L01PC | 02237 | 1820-0627 |
| 74F544D | 02910 | 1820-6619 | 74HCCT273D | 02910 | 1820-5475 | 93L08PC | 02237 | 1820-0614 |
| 74F550DC | 03406 | 1820-6748 | 74HCCT273N | 02910 | 1820-4086 | 93L09PC | 02237 | 1820-0708 |
| 74F568N | 02910 | 1820-5467 | 74HCCT277N | 02910 | 1820-4946 | 93L10PC | 02237 | 1820-0669 |
| 74F569PC | 02237 | 1820-4031 | 74HCCT299N | 02910 | 1820-6994 | 93L11PC | 02237 | 1820-0702 |
| 74F573D | 02910 | 1820-6169 | 74HCCT32D | 02910 | 1820-5794 | 93L12PC | 02237 | 1820-0658 |
| 74F573PC | 02237 | 1820-5149 | 74HCCT32N | 02910 | 1820-4721 | 93L140M | 02237 | 1820-1377 |
| 74F574D | 02910 | 1820-6311 | 74HCCT365N | 02910 | 1820-6602 | 93L141PC | 02237 | 1820-0701 |
| 74F574N | 02910 | 1820-5821 | 74HCCT366N | 02910 | 1820-7234 | 93L16F | 02237 | 1820-0778 |
| 74F579D | 02910 | 1820-6963 | 74HCCT367N | 02910 | 1820-6070 | 93L18PC | 02237 | 1820-0987 |
| 74F579N | 02910 | 1820-4739 | 74HCCT374D | 02910 | 1820-6065 | 93L21PC | 02237 | 1820-1017 |
| 74F583PC | 02237 | 1820-5386 | 74HCCT377D | 02910 | 1820-7215 | 93L22PC | 02237 | 1820-0710 |
| 74F640N | 02910 | 1820-5840 | 74HCCT377N | 02910 | 1820-4465 | 93L24PC | 02237 | 1820-0904 |
| 74F642N | 02910 | 1820-6912 | 74HCCT390D | 02910 | 1820-6075 | 93L28PC | 02237 | 1820-0709 |
| 74F646D | 02910 | 1820-6312 | 74HCCT393D | 02910 | 1820-6037 | 93L34PC | 02237 | 1820-1358 |
| 74F646N | 02910 | 1820-5789 | 74HCCT393N | 02910 | 1820-4948 | 93L415PC | 02237 | 1816-0723 |
| 74F647N | 02910 | 1820-6913 | 74HCCT402D | 02910 | 1820-5479 | 93L422PC | 02237 | 1816-1308 |
| 74F647D | 02910 | 1820-5045 | 74HCCT402N | 02910 | 1820-4949 | 93S10DC | 02237 | 1820-1373 |
| 74F648PC | 02237 | 1820-2676 | 74HCCT404N | 02910 | 1820-6584 | 93S16DC | 02237 | 1820-1475 |
| 74F657D | 02910 | 1820-6109 | 74HCCT406N | 02910 | 1820-2027 | 9400CJ | 02763 | 1826-0575 |
| 74F657N | 02910 | 1820-6107 | 74HCCT423N | 02910 | 1820-6990</ | | | |

| Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N |
|----------------------|-------|-----------|----------------|-------|-----------|--------------------------|-------|-----------|
| 956DC | 02237 | 1820-0974 | AD589LH | 03285 | 1826-0913 | AD7578BD | 03285 | 1826-1730 |
| 957DC | 02237 | 1820-0957 | AD5901H | 03285 | 1826-1188 | AD7581LN | 03285 | 1826-1198 |
| 959DC | 02237 | 1820-0110 | AD590JH | 03285 | 1826-0698 | AD7582KN | 03285 | 1826-1978 |
| 959H0DC | 02237 | 1820-1009 | AD590KH | 03285 | 1826-0661 | AD7628KN | 03285 | 1826-1934 |
| 9600DC | 02237 | 1820-0875 | AD592AN | 03285 | 1826-1362 | AD7628KP | 03285 | 1826-2084 |
| 9601PC | 02237 | 1820-0207 | AD592BN | 03285 | 1826-1574 | AD7672KN05 | 03285 | 1826-1974 |
| 9602PC | 02237 | 1820-0515 | AD595AD | 03285 | 1826-1579 | AD7672KP05 | 03285 | 1826-1948 |
| 961DC | 02237 | 1820-0350 | AD595CQ | 03285 | 1826-2265 | AD770JD | 03285 | 1826-2093 |
| 9624DC | 02237 | 1820-1005 | AD611KH | 03285 | 1826-1716 | AD7828KN | 03285 | 1826-1902 |
| 9627PC | 02237 | 1820-2095 | AD625CD | 03285 | 1826-1628 | AD7828KP | 03285 | 1826-1984 |
| 9636ATC | 02237 | 1820-2117 | AD625JN | 03285 | 1826-1559 | AD7846KN | 03285 | 1826-1645 |
| 9636ATC | 02237 | 1820-3778 | AD632AH | 03285 | 1826-1287 | AD7846KP | 03285 | 1826-2122 |
| 9637ATC | 02237 | 1820-2198 | AD636JD | 03285 | 1826-0935 | AD7848JP | 03285 | 1826-2154 |
| 9638TC | 02237 | 1820-2199 | AD637JQ | 03285 | 1826-1314 | AD7870KN | 03285 | 1826-2163 |
| 963DC | 02237 | 1820-0351 | AD642JH | 03285 | 1826-0949 | AD7878JN | 03285 | 1826-2246 |
| 964DC | 02237 | 1820-0964 | AD642JH | 03285 | 1826-1129 | AD790JN | 03285 | 1826-2208 |
| 965DC | 02237 | 1820-0965 | AD644JH | 03285 | 1826-1196 | AD813KN | 03285 | 1826-2241 |
| 966DC | 02237 | 1820-0966 | AD648JN | 03285 | 1826-2254 | AD814AN | 03285 | 1826-2112 |
| 967DC | 02237 | 1820-0967 | AD652JH | 03285 | 1826-2071 | AD815JN | 03285 | 1826-2137 |
| 967DC | 02237 | 1820-0975 | AD651JN | 03285 | 1826-1591 | AD816AN | 03285 | 1826-2253 |
| 968DC | 02237 | 1820-0968 | AD667AD | 03285 | 1826-1246 | AD817JN | 03285 | 1826-1940 |
| 96L02DC | 03794 | 1820-0730 | AD667JN | 03285 | 1826-1424 | AD817JR | 03285 | 1826-2199 |
| 96LS02PC | 02237 | 1820-2600 | AD667JP | 03285 | 1826-1752 | AD818JN | 03285 | 1826-1970 |
| 96S02PC | 02237 | 1820-2118 | AD670JN | 03285 | 1826-1850 | AD890JP | 03285 | 1820-6786 |
| 971DC | 02237 | 1820-0971 | AD670JP | 03285 | 1826-1757 | AD890JQ | 03285 | 1820-6559 |
| 9816DC | 02237 | 1820-0485 | AD707KJ | 03285 | 1826-2069 | AD891AP | 03285 | 1820-6827 |
| 9838DC | 02237 | 1820-0482 | AD708AQ | 03285 | 1826-1969 | AD891D | 03285 | 1820-5489 |
| 9852DC | 02237 | 1820-0187 | AD7111KN | 03285 | 1826-1489 | AD891JP | 03285 | 1820-6482 |
| 9856DC | 02237 | 1820-0186 | AD7118BD | 03285 | 1826-1111 | AD892JPP | 03285 | 1820-6800 |
| 9L24DC | 02237 | 1820-1085 | AD711CQ | 03285 | 1826-1852 | AD9012AN | 03285 | 1826-2206 |
| 9L86PC | 02237 | 1820-1117 | AD711CQ | 03285 | 1826-1879 | AD9300KP (SELECTED) | 03285 | 1826-2195 |
| A-1350 | 03780 | 1826-0247 | AD711JR | 03285 | 1826-1991 | AD9618JN | 03285 | 1826-2244 |
| A1010-APL68C | 12905 | 1820-8070 | AD711KN | 03285 | 1826-1915 | AD96685BH | 03285 | 1826-2039 |
| A110A-0100 | 01876 | 1820-0729 | AD712JN | 03285 | 1826-1878 | AD96687BP | 03285 | 1826-2229 |
| A139A-0100 | 01876 | 1820-0412 | AD712JR | 03285 | 1826-2176 | AD96687BP (SELECTED) | 03285 | 1826-2203 |
| A141A-0100 | 01876 | 1820-0119 | AD713JN | 03285 | 1826-2177 | AD96687BQ | 03285 | 1826-1884 |
| A142A-0100 | 01876 | 1820-0254 | AD713KN | 03285 | 1826-2169 | AD9702BW | 03285 | 1826-6550 |
| A148A-0100 | 01876 | 1820-0116 | AD7224CQ | 03285 | 1826-1866 | ADC-856C | 10321 | 1826-0881 |
| A152A-0100 | 01876 | 1820-1060 | AD7224LN | 03285 | 1826-1425 | ADC-912HP | 02180 | 1826-2123 |
| A152B-0100 | 01876 | 1820-0292 | AD7225LP | 03285 | 1826-1700 | ADC-H212BGC (SELECTED) | 10321 | 1813-0155 |
| A154B-0100 | 01876 | 1820-0293 | AD7226BQ | 03285 | 1826-1234 | ADC0800PCD | 03406 | 1826-0517 |
| A159-0150 | 01876 | 1820-0285 | AD7226KN | 03285 | 1826-1379 | ADC0801LCN | 03406 | 1826-0750 |
| A159-0200 | 01876 | 1820-0286 | AD7240BQ | 03285 | 1826-1190 | ADC0802LCN | 03406 | 1826-1552 |
| A165-0100 | 01876 | 1820-0329 | AD7240JN | 03285 | 1826-1818 | ADC0803LCJ | 03406 | 1826-0733 |
| A167A-0100 | 01876 | 1820-0098 | AD741KH (SEL) | 03285 | 1826-0990 | ADC0804LCM | 03406 | 1826-0756 |
| AAA2801J07 | 03921 | 1818-0509 | AD741LL | 03285 | 1826-0082 | ADC0808CCN | 03406 | 1826-1139 |
| AC5947N | 01698 | 1820-2626 | AD744JN | 03285 | 1826-1883 | ADC0809CCN | 03406 | 1826-1477 |
| AC5947NF | 01698 | 1820-2259 | AD7502JN | 03285 | 1826-0779 | ADC0816CCN | 03406 | 1826-0710 |
| AC5948N | 01698 | 1820-2567 | AD7503JN | 03285 | 1826-0878 | ADC0820BCN | 03406 | 1826-1332 |
| ACT1020PL-84 | 12905 | 1820-6601 | AD7503KN | 03285 | 1826-1451 | ADC0831CCW | 03406 | 1826-2233 |
| AD1154BW | 03285 | 1813-0718 | AD7506KD | 03285 | 1826-0602 | ADC0833BCN | 03406 | 1826-1390 |
| AD202JY | 03285 | 1826-2209 | AD7506KN | 03285 | 1826-1401 | ADC0844CCN | 03406 | 1826-1248 |
| AD204KY | 11825 | 1826-2185 | AD7510DIJN | 03285 | 1820-1374 | ADC1205BCJ-1 | 03406 | 1826-1693 |
| AD246TY | 03285 | 1826-2184 | AD7510DIKH | 03285 | 1826-0916 | ADC1205DZ003 | 03285 | 0960-0397 |
| AD2712LN | 03285 | 1826-1793 | AD7512DIJN | 03285 | 1826-0821 | ADC763G | 05436 | 1813-0322 |
| AD380KH | 03285 | 1826-1523 | AD7520JN | 03285 | 1826-0252 | ADC801G2-12 (PER HP DWG) | 05436 | 1813-0264 |
| AD42022KN | 03285 | 1826-1851 | AD7520LN (SEL) | 03285 | 1826-0541 | ADC844KG-12 | 05436 | 1813-0562 |
| AD504J | 03285 | 1826-0249 | AD7520LN | 03285 | 1826-0264 | ADDCA80-V | 03285 | 1813-0177 |
| AD506JH | 03285 | 1826-0176 | AD7522JN | 03285 | 1826-0729 | ADG211AKR | 03285 | 1826-2037 |
| AD518J | 03285 | 1826-0309 | AD7522LN | 03285 | 1826-0857 | ADG221KN | 03285 | 1826-2166 |
| AD518KH | 03285 | 1826-0672 | AD7523AD | 03285 | 1826-0944 | ADG507AKN | 03285 | 1826-6549 |
| AD518KH SELECTED | 03285 | 1826-0327 | AD7523JN | 03285 | 1826-0707 | ADG509AKN | 03285 | 1826-2237 |
| AD524AD | 03285 | 1826-1191 | AD7524AD | 03285 | 1826-0699 | ADG529AKN | 03285 | 1826-2160 |
| AD524CD | 03285 | 1826-1195 | AD7524JN | 03285 | 1826-0639 | ADOF-07CH | 03285 | 1826-1182 |
| AD526JN | 03285 | 1826-2159 | AD7524XP | 03285 | 1826-1864 | ADOF-27FH | 03285 | 1826-1268 |
| AD533JH | 03285 | 1826-0295 | AD7524LN | 03285 | 1826-1118 | ADOPOTCH | 03285 | 1826-0844 |
| AD534JH | 03285 | 1826-0758 | AD7525CD | 03285 | 1826-1303 | ADOPOTEH | 03285 | 1826-0957 |
| AD536AJD | 03285 | 1826-0421 | AD7525KN | 03285 | 1826-1107 | ADSP-1012AJD | 03285 | 1820-3499 |
| AD536AJH (BURNED-IN) | 03285 | 1826-0893 | AD7528BQ | 03285 | 1826-1232 | ADSP-1012AKG | 03285 | 1820-7345 |
| AD536AKD | 03285 | 1826-0500 | AD7528JN | 03285 | 1826-1619 | ADSP-3211KG | 03285 | 1820-5156 |
| AD536AKH | 03285 | 1826-0969 | AD7528JN | 03285 | 1826-1231 | AF120CH | 03406 | 1826-0469 |
| AD539KH | 03285 | 1826-2118 | AD7528KN | 03285 | 1826-0356 | AF134-1CJ | 03406 | 1826-0580 |
| AD540J | 03285 | 1826-0182 | AD7530JD | 03285 | 1826-0504 | AH0019CD | 03406 | 1820-1988 |
| AD542KH | 03285 | 1826-0822 | AD7530LD | 03285 | 1826-0485 | AH015bD | 03406 | 1813-0054 |
| AD542L | 03285 | 1826-0627 | AD7530LN | 03285 | 1826-0874 | AH5010CN | 03406 | 1826-1017 |
| AD544JH SELECTED | 03285 | 1826-0891 | AD7531JN | 03285 | 1826-1202 | AH5020C | 03406 | 1826-1468 |
| AD545J | 03285 | 1813-0232 | AD7533(SEL) | 03285 | 1826-1031 | AM2130-10DC | 03794 | 1818-4135 |
| AD548JN | 03285 | 1826-2258 | AD7533AD | 03285 | 1826-0921 | AM2130-10JC | 03794 | 1818-4394 |
| AD558JD | 03285 | 1826-0858 | AD7533CD | 03285 | 1826-0838 | AM2130-12DC | 03794 | 1818-4108 |
| AD558JZ | 03285 | 1826-1904 | AD7533JN | 03285 | 1826-1620 | AM2149-35DC | 03794 | 1818-3466 |
| AD559KD | 03285 | 1826-0430 | AD7533KP | 03285 | 1826-1861 | AM2149-55DC | 03794 | 1818-3560 |
| AD561J | 03285 | 1826-0508 | AD7533LN | 03285 | 1826-1142 | AM2149-55DC | 03794 | 1818-3560 |
| AD561KD | 03285 | 1820-1984 | AD7534AD | 03285 | 1826-1399 | AM2502PC | 03794 | 1820-2168 |
| AD562KD/BIN | 03285 | 1826-0308 | AD7534JN | 03285 | 1826-1917 | AM2503PC | 03794 | 1820-2738 |
| AD565AIQ | 03285 | 1826-1802 | AD7534LN | 03285 | 1826-1592 | AM2505PC | 03794 | 1820-1398 |
| AD565AJD | 03285 | 1826-1013 | AD7535AD | 03285 | 1826-1869 | AM25L02DC | 03794 | 1820-2998 |
| AD565JD/BIN | 03285 | 1826-0896 | AD7537JN | 03285 | 1826-2109 | AM25L04PC | 03794 | 1820-1978 |
| AD566AJD | 03285 | 1826-0726 | AD7537JP | 03285 | 1826-1620 | AM25L04PC | 03794 | 1820-1700 |
| AD566AJN | 03285 | 1826-1044 | AD7538JN | 03285 | 1826-1935 | AM25L509PC | 03794 | 1820-1867 |
| AD567J | 03285 | 1826-1240 | AD7551A | 03285 | 1826-1158 | AM25L511ADCP | 03794 | 1820-2120 |
| AD567KD | 03285 | 1826-1219 | AD7551ABQ | 03285 | 1826-1169 | AM25L514APC | 03794 | 1820-4600 |
| AD569AD | 03285 | 1826-1981 | AD7551AJP | 03285 | 1826-1989 | AM25L516APC | 03794 | 1820-1992 |
| AD569JN | 03285 | 1826-1880 | AD7551AKN | 03285 | 1826-1386 | AM25L5174PC | 03794 | 1820-2445 |
| AD570J | 03285 | 1826-1100 | AD7551BD (SEL) | 03285 | 1826-0684 | AM25L5175PC | 03794 | 1820-1699 |
| AD571JD (SEL) | 03285 | 1826-0597 | AD7551BD (SEL) | 03285 | 1826-0797 | AM25L5191PC | 03794 | 1820-2863 |
| AD571KD | 03285 | 1826-0973 | AD7551JN | 03285 | 1826-0697 | AM25L52518PC | 03794 | 1820-2190 |
| AD573J | 03285 | 1826-1359 | AD7551KN | 03285 | 1826-0865 | AM25L52520DC | 03794 | 1820-2405 |
| AD573JN | 03285 | 1826-1448 | AD7552BD | 03285 | 1826-2239 | AM25L52512PC | 03794 | 1820-2311 |
| AD574AJD | 03285 | 1826-1296 | AD7553JN | 03285 | 1826-1453 | AM25L52521PC | 03794 | 1820-2741 |
| AD574AKD | 03285 | 1813-0257 | AD7554AKN | 03285 | 1826-1400 | AM25L52538PC | 03794 | 1820-2465 |
| AD578ZD | 03285 | | | | | | | |

| Desc. | Mfr. | H P/P/N | Desc. | Mfr. | H P/P/N | Desc. | Mfr. | H P/P/N |
|------------------------|-------|-----------|-------------------------|-------|-----------|------------------|-------|-----------|
| AM26LS32ACD | 01698 | 1820-5327 | AM29CPL142DC UNPRGMD | 03794 | 1820-6146 | CA3002 | 01921 | 1820-0417 |
| AM26LS32ACN (SELECTED) | 01698 | 1820-2594 | AM29CPL154-1DC UNPRGMD | 03794 | 1820-6569 | CA3010 | 01921 | 1820-0047 |
| AM26LS32BPC | 03794 | 1820-2830 | AM29CPL154-2DC UNPRGMD | 03794 | 1820-6568 | CA3012 | 01921 | 1820-0474 |
| AM26LS32BSC | 03794 | 1820-6550 | AM29CPL154DC | 03794 | 1820-6567 | CA3020 | 01921 | 1820-0298 |
| AM26LS32PC | 03794 | 1820-2203 | AM31L01PC | 03794 | 1816-0913 | CA3023 | 01921 | 1820-0433 |
| AM26LS34PC | 03794 | 1820-3283 | AM6012APC | 03794 | 1826-1236 | CA3028A | 01921 | 1820-0306 |
| AM26LS38DC | 03794 | 1820-4133 | AM6012DC | 03794 | 1826-0705 | CA3028B | 01921 | 1820-0137 |
| AM26S02PC | 03794 | 1820-1782 | AM6012PC | 03794 | 1826-1334 | CA3029 | 01921 | 1820-0326 |
| AM26S10PC | 03794 | 1820-3281 | AM6070ADC | 03794 | 1826-1253 | CA3030 | 01921 | 1826-0078 |
| AM26S11PC | 03794 | 1820-4128 | AM6080APC | 03794 | 1826-0856 | CA3053 | 01921 | 1826-0230 |
| AM26S12PC SELECTED | 03794 | 1820-3077 | AM6080DC | 03794 | 1826-1015 | CA3054 | 01921 | 1826-0780 |
| AM2716B-305DC | 03794 | 1818-4081 | AM6080PC | 03794 | 1826-0832 | CA3054D | 02037 | 1826-2105 |
| AM2716B-455DC | 03794 | 1818-4080 | AM6081PC SELECTED | 03794 | 1826-0659 | CA3059 | 01921 | 1826-0041 |
| AM2732B-205DC | 03794 | 1818-4078 | AM6108 | 03794 | 1826-1070 | CA3060D | 01921 | 1826-0015 |
| AM2732B-305DC | 03794 | 1818-4077 | AM6112DC (SELECTED) | 03794 | 1826-1226 | CA3075 | 01921 | 1826-0153 |
| AM2732EDC | 03794 | 1818-4079 | AM6148DC | 03794 | 1826-1211 | CA3079 | 01921 | 1826-0075 |
| AM27C010-175DC | 03794 | 1818-4655 | AM6685HL | 03794 | 1826-1445 | CA307T | 01921 | 1826-1254 |
| AM27C1024-150DC | 03794 | 1818-4598 | AM6687DL | 03794 | 1826-1378 | CA3080 | 01921 | 1826-0185 |
| AM27C1024-200DC | 03794 | 1818-4432 | AM6685HL | 03794 | 1826-0883 | CA308E | 01921 | 1826-0534 |
| AM27C1024-250DC | 03794 | 1818-3929 | AM6685HL | 03794 | 1826-0578 | CA3085 | 01921 | 1826-0292 |
| AM27C128-205DC | 03794 | 1818-3604 | AM6686CN | 03794 | 1826-0869 | CA3094AEC | 01921 | 1826-0946 |
| AM27C128-255DC | 03794 | 1818-4683 | AM6686HC | 03794 | 1826-0338 | CA3094LAT | 01921 | 1826-0167 |
| AM27C128-90DC | 03794 | 1818-4890 | AM687ADL | 03794 | 1826-0426 | CA3099E | 01921 | 1826-0321 |
| AM27C2048-200DC | 03794 | 1818-4790 | AM7200-25RC | 03794 | 1820-6981 | CA3100T | 01921 | 1826-0218 |
| AM27C256-105DC | 03794 | 1818-4954 | AM7201-80RC | 03794 | 1820-6475 | CA3103AS | 01921 | 1826-0626 |
| AM27C256-125DC | 03794 | 1818-4829 | AM7202-25RC | 03794 | 1820-7603 | CA3130T | 01921 | 1826-0307 |
| AM27C256-175DC | 03794 | 1818-3486 | AM7203-80RC | 03794 | 1820-7308 | CA3140AE | 01921 | 1826-1535 |
| AM27C256-205DC | 03794 | 1818-3329 | AM74L5138N | 03794 | 1820-1732 | CA3140AS | 01921 | 1826-0930 |
| AM27C512-175PC | 03794 | 1818-4855 | AM74L5148N | 03794 | 1820-1851 | CA3140AT | 01921 | 1826-0679 |
| AM27C512-200DC | 03794 | 1818-3448 | AM74L5175N | 03794 | 1820-1733 | CA3140E | 01921 | 1826-0506 |
| AM27C512-255DC | 03794 | 1818-3554 | AM74L5229N | 03794 | 1820-1987 | CA3140H | 01921 | 1826-0549 |
| AM27C64-205DC | 03794 | 1818-4715 | AM74L5374AP | 03794 | 1820-1997 | CA3140T | 01921 | 1826-0465 |
| AM27LS00PC | 03794 | 1816-0902 | AM74L5533PC | 03794 | 1820-2883 | CA3161E | 01921 | 1820-2658 |
| AM27LS18PC | 03794 | 1816-1711 | AM74L5616N | 03794 | 1820-1876 | CA3162E | 01921 | 1826-0854 |
| AM27LS19PC | 03794 | 1816-1725 | AM74L5624N | 03794 | 1820-2565 | CA3189E | 01921 | 1826-1326 |
| AM27S03APC | 03794 | 1816-1599 | AM7910DC | 03794 | 1826-1363 | CA3199E | 01921 | 1820-3704 |
| AM27S03DC SELECTED | 03794 | 1816-1446 | AM7911PC | 03794 | 1820-5161 | CA3240AE | 01921 | 1826-0553 |
| AM27S03F | 03794 | 1816-1565 | AM7960 | 03794 | 1826-1388 | CA3240E | 01921 | 1826-0794 |
| AM27S07APC | 03794 | 1816-1495 | AM7961DC | 03794 | 1820-5755 | CA3290E | 01921 | 1826-0810 |
| AM27S13PC | 03794 | 1816-1624 | AM7990DC/70 | 03794 | 1820-3828 | CA3300D | 01921 | 1826-0970 |
| AM27S180PC | 03794 | 1816-1612 | AM7990PC/80 | 03794 | 1820-6063 | CA3306E | 01921 | 1826-1714 |
| AM27S181APC | 03794 | 1816-1615 | AM7991ADC | 03794 | 1820-3829 | CA339E SELECTED | 01921 | 1826-0347 |
| AM27S185DC | 03794 | 1816-1574 | AM7992BCD | 03794 | 1820-4401 | CA6741T SELECTED | 01921 | 1826-0261 |
| AM27S185PC | 03794 | 1816-1620 | AM7992BDC | 03794 | 1820-7607 | CA7411C | 01921 | 1826-0303 |
| AM27S191ADC | 03794 | 1816-1572 | AM7996DC | 03794 | 1820-6422 | CD22100E | 01921 | 1826-0658 |
| AM27S191AJC | 03794 | 1816-1703 | AM8151DC | 03794 | 1826-1547 | CD4000AE | 01921 | 1820-0926 |
| AM27S191APC | 03794 | 1816-1617 | AM9016DPC | 03794 | 1818-1467 | CD4000BF | 01921 | 1820-2227 |
| AM27S191DC | 03794 | 1816-1558 | AM9016EPC | 03794 | 1818-1396 | CD4001AF | 01921 | 1820-1534 |
| AM27S191PC | 03794 | 1816-1618 | AM9101DPC | 03794 | 1818-1397 | CD4001UBE | 01921 | 1820-0946 |
| AM27S194APC | 03794 | 1816-1722 | AM9102DPC | 03794 | 1818-0343 | CD4002AF | 01921 | 1820-1537 |
| AM27S195DC | 03794 | 1816-1468 | AM9111BDC | 03794 | 1818-0348 | CD4002UBE | 01921 | 1820-0948 |
| AM27S195PC | 03794 | 1816-1611 | AM91112APC | 03794 | 1818-0199 | CD4006AF | 01921 | 1820-0962 |
| AM27S20PC | 03794 | 1816-1622 | AM9112CDC | 03794 | 1818-0215 | CD4007AE | 01921 | 1820-0978 |
| AM27S21APC | 03794 | 1816-1631 | AM9122-25P | 03794 | 1820-3542 | CD4008AF | 01921 | 1820-0926 |
| AM27S21PC | 03794 | 1816-1623 | AM9128-10DC | 03794 | 1818-3505 | CD4009AF | 01921 | 1820-0979 |
| AM27S25DC | 03794 | 1816-1566 | AM9150-25DC | 03794 | 1818-3510 | CD40103BF | 01921 | 1820-2241 |
| AM27S27DC | 03794 | 1816-1406 | AM9150-35DC | 03794 | 1818-3637 | CD40109BE | 01921 | 1820-3907 |
| AM27S281DC | 03794 | 1816-1702 | AM9150-35DC | 03794 | 1818-0197 | CD4010AF | 01921 | 1820-0980 |
| AM27S291ADCP | 03794 | 1816-1701 | AM91112CPC | 03794 | 1818-0322 | CD40115D | 01921 | 1820-2048 |
| AM27S291DC | 03794 | 1816-1512 | AM911122-35PC | 03794 | 1818-0294 | CD40116E | 01921 | 1820-2662 |
| AM27S291PC | 03794 | 1816-1619 | AM911122-35PC | 03794 | 1818-3327 | CD4011AF | 01921 | 1820-1538 |
| AM27S294ADC | 03794 | 1816-1593 | AM93425SDAC | 03794 | 1816-1583 | CD4011UBE | 01921 | 1820-0949 |
| AM27S294APC | 03794 | 1816-1625 | AM93518PC | 03794 | 1818-1968 | CD4012AF | 01921 | 1820-1539 |
| AM27S295DC | 03794 | 1816-1562 | AM9968-45DC | 03794 | 1818-3767 | CD4013AF | 01921 | 1820-1531 |
| AM27S295PC | 03794 | 1816-1567 | AM99C101A-10RC | 03794 | 1818-4909 | CD4013BE | 01921 | 1820-0939 |
| AM27S31PC | 03794 | 1816-1621 | AM99C164-45PC | 03794 | 1818-4280 | CD4014AEC | 01921 | 1820-0970 |
| AM27S33APC | 03794 | 1816-1610 | AMD29823ASC | 03794 | 1820-7255 | CD4015AF | 01921 | 1820-1541 |
| AM27S35DC | 03794 | 1816-1516 | AMP-05FX | 02180 | 1826-2028 | CD4015BEE | 01921 | 1820-0976 |
| AM27S35PC | 03794 | 1816-1614 | AMPA16H8APC UNPRGMD | 03794 | 1820-3610 | CD40163BCN | 03406 | 1820-4166 |
| AM27S38APC | 03794 | 1816-1597 | AMPA16H8LPC UNPRGMD | 03794 | 1820-3772 | CD4016AE | 01921 | 1820-0981 |
| AM27S49DC-T | 03794 | 1816-1562 | AMPA16L8A-2CJ UNPRGMD | 03794 | 1820-3611 | CD4016AF | 01921 | 1820-1675 |
| AM2813ADC | 03794 | 1816-1717 | AMPA16R4AD | 03794 | 1820-3852 | CD4017AE | 01921 | 1820-0933 |
| AM2864AE-350DC | 03794 | 1818-0277 | AMPA16R4LDC UNPRGMD | 03794 | 1820-3557 | CD4018AF | 01921 | 1820-0934 |
| AM2864BE-200DC | 03794 | 1818-4487 | AMPA16R6LPC UNPRGMD | 03794 | 1820-3359 | CD4018AF | 01921 | 1820-1529 |
| AM2864BE-250DC | 03794 | 1818-4153 | AMPA16R8ALPC UNPRGMD | 03794 | 1820-3626 | CD4021AF | 01921 | 1820-0961 |
| AM2864BE-255DC | 03794 | 1818-3920 | AMPA20L8-10PC UNPRGMD | 03794 | 1820-6541 | CD4021BF | 01921 | 1820-1898 |
| AM2960DC | 03794 | 1820-2954 | AMPA20R8P8PC UNPRGMD | 03794 | 1820-5768 | CD4022BE | 01921 | 1820-0929 |
| AM2961BDC | 03794 | 1820-2903 | AMPA20XHP4-30PC UNPRGMD | 03794 | 1820-5822 | CD4023UBE | 01921 | 1820-0943 |
| AM2965PC | 03794 | 1820-3528 | AMPA22P10PC UNPRGMD | 03794 | 1820-5769 | CD4024BEB | 01921 | 1820-0936 |
| AM2966PC | 03794 | 1820-2981 | AMPA22V10ADC UNPRGMD | 03794 | 1820-4975 | CD4024BFF | 01921 | 1820-1897 |
| AM2966PC (SELECTED) | 03794 | 1820-2826 | AMPA22V10APC UNPRGMD | 03794 | 1820-6171 | CD4025AF | 01921 | 1820-1535 |
| AM29821AJC | 03794 | 1820-2109 | AMPA22V101APC UNPRGMD | 03794 | 1820-3616 | CD4025UBE | 01921 | 1820-0944 |
| AM29821DC | 03794 | 1820-4060 | AMPA22V102D | 03794 | 1820-4974 | CD4026AE | 01921 | 1820-0930 |
| AM29822DC | 03794 | 1820-4061 | AMPA22V102D UNPRGMD | 03794 | 1820-4034 | CD4027AF | 01921 | 1820-1530 |
| AM29823APC | 03794 | 1820-7627 | AY-5-2376-006 | 02713 | 1820-2625 | CD4027BE | 01921 | 1820-0938 |
| AM29823DC | 03794 | 1820-3307 | B091-0100 | 01876 | 1820-0634 | CD4028AF | 01921 | 1820-0927 |
| AM29824DC | 03794 | 1820-3306 | B149A-0150 | 01876 | 1820-0736 | CD4029AE | 01921 | 1820-1598 |
| AM29825APC | 03794 | 1820-7628 | B149A-0150 | 01876 | 1820-1354 | CD4029AE | 01921 | 1820-3018 |
| AM29825DC | 03794 | 1820-3019 | B149A-0200 | 01876 | 1820-0557 | CD4029BCN | 03406 | 1820-2083 |
| AM29826DC | 03794 | 1820-3977 | BR1941M-06 | 00575 | 1820-2876 | CD4029BE | 01921 | 1820-0931 |
| AM29827APC | 03794 | 1820-6862 | BT109KC | 12461 | 1826-1798 | CD4029BF | 01921 | 1820-1528 |
| AM29827DC | 03794 | 1820-3440 | BT1431KC | 12461 | 1826-2180 | CD4030AE | 01921 | 1820-0947 |
| AM29828APC | 03794 | 1820-6750 | BT605KPJ | 12461 | 1826-6824 | CD4030AF | 01921 | 1820-1536 |
| AM29828DC | 03794 | 1820-4062 | BT622KJ | 12461 | 1826-6822 | CD4031AE | 01921 | 1820-0963 |
| AM29834DC | 03794 | 1820-4063 | CA 3001 | 01921 | 1820-7666 | CD4031BF | 01921 | 1820-2231 |
| AM29841APC | 03794 | 1820-6751 | C3207 | 12461 | 1826-7665 | CD4034AE | 01921 | 1820-0977 |
| AM29841DC | 03794 | 1820-3961 | C3207 | 12461 | 1826-6179 | CD4035 | | |

| Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N |
|---------------|-------|-----------|---------------------|-------|-----------|-----------------------|-------|-----------|
| CD4048BCJ | 03406 | 1820-3609 | CY7C128A-25VC | 11345 | 1818-4766 | D7234 | 03811 | 1820-4971 |
| CD4049AF | 01921 | 1820-1542 | CY7C128A-35PC | 11345 | 1818-4020 | D7242 | 03811 | 1820-2817 |
| CD4049UBE | 01921 | 1820-1145 | CY7C128A-35SC | 11345 | 1818-4868 | D7245 | 03811 | 1820-4968 |
| CD4050AF | 01921 | 1820-1543 | CY7C128A-45SC | 11345 | 1818-4097 | D7250 | 03811 | 1820-2816 |
| CD4050BCN | 03406 | 1820-2644 | CY7C128A-55PC | 11345 | 1818-3614 | D8155H | 03811 | 1818-0696 |
| CD4050BE | 01921 | 1820-1146 | CY7C128A-55VC | 11345 | 1818-4830 | D8258H | 03811 | 1820-4659 |
| CD4051BCM | 03406 | 1826-2170 | CY7C130-55PC | 11345 | 1818-4770 | DAC-01CY | 02180 | 1826-0020 |
| CD4051BE | 01921 | 1820-1315 | CY7C136-55JC | 11345 | 1818-4811 | DAC-08CP | 02180 | 1826-1035 |
| CD4051BF | 01921 | 1820-1513 | CY7C136-90JC CD1955 | 11345 | 1818-4940 | DAC-08ED | 02910 | 1826-1458 |
| CD4052BE | 01921 | 1820-1314 | CY7C141-25JC | 11345 | 1818-4771 | DAC-08EN | 03791 | 1826-0550 |
| CD4053BE | 01921 | 1820-1313 | CY7C146-25JC | 11345 | 1818-4656 | DAC-08EQ | 02180 | 1820-1934 |
| CD4053BF | 01921 | 1820-1510 | CY7C147-25 | 11345 | 1818-4352 | DAC-100ACQ3 | 02180 | 1826-0453 |
| CD4053BY | 01921 | 1820-1545 | CY7C147-35PC | 11345 | 1818-3617 | DAC-100BCQ3 | 02180 | 1826-0127 |
| CD4054BE | 01921 | 1820-1331 | CY7C148-35PC | 11345 | 1818-3736 | DAC-100CCQ3 | 02180 | 1826-0197 |
| CD4055BE | 01921 | 1820-1646 | CY7C148-45PC | 11345 | 1818-3501 | DAC-100CCQ4 | 02180 | 1826-0577 |
| CD4056BE | 01921 | 1820-2187 | CY7C149-35PC | 11345 | 1818-3838 | DAC-10F | 02180 | 1826-0938 |
| CD4059AD | 01921 | 1820-1649 | CY7C150-10VC | 11345 | 1818-4804 | DAC-20CQ | 02180 | 1826-1304 |
| CD4060BE | 01921 | 1820-2588 | CY7C150-12SC | 11345 | 1818-4679 | DAC-210EX | 02180 | 1826-1155 |
| CD4066AE | 01921 | 1820-1325 | CY7C150-15PC | 11345 | 1818-4530 | DAC-312FR | 02180 | 1826-1036 |
| CD4066AY | 01921 | 1820-1548 | CY7C150-15VC | 11345 | 1818-4918 | DAC-804EZ | 02180 | 1826-2017 |
| CD4067BE | 01921 | 1820-1660 | CY7C150-25PC | 11345 | 1818-4496 | DAC-814FP | 02180 | 1826-2182 |
| CD4068BE | 01921 | 1820-1410 | CY7C166-45PC | 11345 | 1818-4374 | DAC-8222HP | 02180 | 1826-2158 |
| CD4068BF | 01921 | 1820-2330 | CY7C167-25PC | 11345 | 1818-4873 | DAC-888EX | 02180 | 1826-1143 |
| CD4069UBE | 01921 | 1820-1404 | CY7C168A-25PC | 11345 | 1818-4016 | DAC-888FX | 02180 | 1826-1174 |
| CD4070BE | 01921 | 1820-1601 | CY7C168A-35PC | 11345 | 1818-3735 | DAC-89 (SEL) | 02180 | 1826-0864 |
| CD4071BE | 01921 | 1820-1483 | CY7C169A-25PC | 11345 | 1818-3620 | DAC0800LCJ | 03406 | 1826-1331 |
| CD4071BF | 01921 | 1820-1550 | CY7C171A-15VC | 11345 | 1818-4906 | DAC0802LCN | 03406 | 1826-1385 |
| CD4072BE | 01921 | 1820-1403 | CY7C171A-25PC | 11345 | 1818-4038 | DAC0805LCN | 03406 | 1826-1305 |
| CD4073BE | 01921 | 1820-1408 | CY7C171A-35PC | 11345 | 1818-4508 | DAC0832LCN | 03406 | 1826-1068 |
| CD4075BE | 01921 | 1820-1405 | CY7C185-25PC | 11345 | 1818-4711 | DAC1006LCJ | 03406 | 1826-1206 |
| CD4076BE | 01921 | 1820-1578 | CY7C185-45PC | 11345 | 1818-4712 | DAC1006LCN | 03406 | 1826-1342 |
| CD4077BE | 01921 | 1820-1544 | CY7C185-55SC | 11345 | 1818-4748 | DAC1202HCD | 03406 | 1826-0751 |
| CD4078BE | 01921 | 1820-1407 | CY7C190-15PC | 11345 | 1818-4021 | DAC1208LCJ | 03406 | 1826-1548 |
| CD4078BF | 01921 | 1820-2331 | CY7C190-25PC | 11345 | 1818-3557 | DAC1218LCD | 03406 | 1826-1753 |
| CD4081BE | 01921 | 1820-1486 | CY7C195-25PC | 11345 | 1818-4677 | DAC1219LCJ | 03406 | 1826-1101 |
| CD4081BF | 01921 | 1820-1488 | CY7C245-45PC | 11345 | 1818-4434 | DAC1230LCD (SELECTED) | 03406 | 1826-1488 |
| CD4082BE | 01921 | 1820-1551 | CY7C261-55WC | 11345 | 1818-4244 | DAC1266LCJ | 03406 | 1826-1341 |
| CD4085BF | 01921 | 1820-2017 | CY7C264-55WC | 11345 | 1818-4601 | DAC12QZCB | 03285 | 1820-1362 |
| CD4089BE | 01921 | 1820-1661 | CY7C281-45PC | 11345 | 1818-4208 | DAC63CM | 05436 | 1826-1238 |
| CD4093BE | 01921 | 1820-1600 | CY7C291-35PC | 11345 | 1818-4470 | DAC700KH | 05436 | 1826-1649 |
| CD4093BF | 01921 | 1820-1577 | CY7C291-35WC | 11345 | 1818-4098 | DAC701KH | 05436 | 1826-1353 |
| CD4094BE | 01921 | 1820-1662 | CY7C403-25PC | 11345 | 1820-5922 | DAC702BH | 05436 | 1826-1143 |
| CD4094BF | 01921 | 1820-2222 | CY7C404-15PC | 11345 | 1820-4160 | DAC702KX | 05436 | 1826-1110 |
| CD4095BE | 01921 | 1820-1663 | CY7C404-25PC | 11345 | 1820-6775 | DAC703CH | 05436 | 1826-1790 |
| CD4096BE | 01921 | 1820-1664 | CY7C409-15PC | 11345 | 1820-6480 | DAC71-CSB-I | 05436 | 1826-1675 |
| CD4097BF | 01921 | 1820-1881 | CY7C409A-35PC | 11345 | 1820-7692 | DAC71-CSB-V | 05436 | 1813-0283 |
| CD4098BE | 01921 | 1820-1650 | CY7C421-30PC | 11345 | 1820-6776 | DAC80-CBI-I (SEL'D) | 05436 | 1813-0091 |
| CD4099BE | 01921 | 1820-1665 | CY7C428-65PC | 11345 | 1820-6939 | DAC80-CBI-I (SEL'D) | 05436 | 1813-0118 |
| CD4099BF | 01921 | 1820-2233 | D139BP | 02883 | 1820-2345 | DAC80-CBI-V | 06861 | 1813-0105 |
| CD4502BE | 01921 | 1820-2945 | D169CJ | 02883 | 1820-3691 | DAC80-CCD-V | 05436 | 1813-0092 |
| CD4512BF | 01921 | 1820-2229 | D169CK | 02883 | 1820-3685 | DAC800-CBI-I | 05436 | 1826-1450 |
| CD4514BCN | 03406 | 1820-3516 | D2115A | 03811 | 1818-0772 | DAC811AH | 05436 | 1826-1106 |
| CD4555BE | 01921 | 1820-1516 | D2115AL | 03811 | 1818-0332 | DAC811JJ | 05436 | 1826-2228 |
| CD4556BE | 01921 | 1820-1515 | D2125AL | 03811 | 1818-1026 | DAC9331-16-5 | 03755 | 1826-1242 |
| CD4556BF | 01921 | 1820-1555 | D2142L | 03811 | 1818-1153 | DAC9377-16-6 | 03755 | 1813-0110 |
| CD744C193E | 04550 | 1820-5675 | D2147H | 03811 | 1818-4098 | DG133BP | 02883 | 1826-1484 |
| CD744C573M | 03799 | 1820-7217 | D2147H-1 | 03811 | 1818-1586 | DG145BP | 02883 | 1826-1596 |
| CD744ACT0WE | 04550 | 1820-6276 | D2147H-3 | 03811 | 1818-1027 | DG172BK | 02883 | 1826-0105 |
| CD744ACT08E | 04550 | 1820-6162 | D2148H-3 | 03811 | 1818-1212 | DG180-BA | 02883 | 1826-1209 |
| CD744ACT11W | 04550 | 1820-6107 | D2148H-3 #7511 | 03811 | 1818-1468 | DG180BP | 02883 | 1826-0914 |
| CD744ACT14M | 03799 | 1820-7318 | D2149H-2 | 03811 | 1818-1887 | DG182BP | 02883 | 1826-0669 |
| CD74HC6520E | 04550 | 1820-5571 | D21718 | 03811 | 1818-3076 | DG183BK | 03799 | 1826-2045 |
| CD74HC670E | 01921 | 1820-3786 | D21728-3 | 03811 | 1818-3154 | DG200ABA | 02883 | 1826-1020 |
| CD74HC7154E | 01921 | 1820-4862 | D21728-4 | 03811 | 1818-3021 | DG200ACJ (SELECTED) | 02883 | 1826-1161 |
| CD74HC7164E | 01921 | 1820-4865 | D21728A | 03811 | 1818-3147 | DG200BA | 02883 | 1826-1518 |
| CD74HC7173E | 01921 | 1820-3844 | D21728A | 03811 | 1818-3449 | DG200BA | 02883 | 1826-0154 |
| CD74HC7174E | 01921 | 1820-3940 | D21728A | 03811 | 1818-3641 | DG201ABK | 02883 | 1826-0606 |
| CD74HC7193E | 01921 | 1820-4151 | D21728B-150V10 | 03811 | 1818-4059 | DG201AKB | 02883 | 1826-1018 |
| CD74HC7175E | 01921 | 1820-3537 | D21716 | 03811 | 1818-0498 | DG201ACJ (SEL) | 02883 | 1826-1123 |
| CDR125BK | 02883 | 1826-0152 | D21716 | 03811 | 1818-0794 | DG201ADY | 02883 | 1826-1835 |
| CG725Y MASKED | 02910 | 1818-0036 | D21716-2 | 03811 | 1818-2702 | DG201CJ | 02883 | 1820-1840 |
| CH1710-01 | 04077 | 1813-0310 | D27256 | 03811 | 1818-3302 | DG201CJ | 02883 | 1820-1971 |
| CH1720-01 | 04077 | 1813-0311 | D27256 | 03811 | 1818-3465 | DG201CJ | 02883 | 1826-0850 |
| CH1730-01 | 04077 | 1813-0312 | D2732 | 03811 | 1818-0850 | DG211CJ | 02883 | 1826-1609 |
| CH1740-01 | 04077 | 1813-0313 | D2732A | 03811 | 1818-1633 | DG211DY | 02883 | 1826-1361 |
| CH1812A | 04077 | 1820-6454 | D2732A | 03811 | 1818-1648 | DG212CJ | 02883 | 1826-1988 |
| CLC103AI | 11604 | 1813-0508 | D2732A | 03811 | 1818-1721 | DG212DY | 02883 | 1826-1733 |
| CLC104AI | 11604 | 1826-1689 | D2732A | 03811 | 1818-3023 | DG221CJ | 02883 | 1826-2149 |
| CLC110AJP | 11604 | 1826-2221 | D2732A-2 | 03811 | 1818-1755 | DG221DY | 02883 | 1826-1247 |
| CLC203AI | 11604 | 1826-1703 | D2764 | 03811 | 1818-1747 | DG243CK | 02883 | 1826-1487 |
| CLC220AI | 11604 | 1813-0598 | D2764-2 | 03811 | 1818-1999 | DG271CJ | 02883 | 1826-2205 |
| CLC220101G | 11604 | 1813-0476 | D2764-3 | 03811 | 1818-1966 | DG271DY | 02883 | 1826-1742 |
| CLC221AI | 11604 | 1826-1664 | D2764-4 | 03811 | 1818-1758 | DG300CJ | 02883 | 1826-0778 |
| CLC231AI | 11604 | 1826-2227 | D2764A | 03811 | 1818-3384 | DG301ACJ | 02883 | 1826-1655 |
| CLC400AJP | 11604 | 1826-2011 | D2764A | 03811 | 1818-3425 | DG301BA | 02883 | 1826-0879 |
| CLC401AJP | 11604 | 1826-2097 | D2764A | 03811 | 1818-3426 | DG302ACJ | 02883 | 1826-0776 |
| CLC404AJP | 11604 | 1826-2081 | D2764A-2 | 03811 | 1818-3424 | DG303ACJ | 02883 | 1826-0777 |
| CLC410 | 11604 | 1826-2222 | D27C010-120V10 | 03811 | 1818-4657 | DG3030BP | 02883 | 1826-0769 |
| CLC501AJP | 11604 | 1826-2117 | D27C010-200V10 | 03811 | 1818-4061 | DG308ACJ | 02883 | 1826-0907 |
| CLX90631-200 | 03285 | 1826-2251 | D27C010-200V10 | 03811 | 1818-4795 | DG390ACK | 02883 | 1826-0950 |
| CMP-01-CJ | 02180 | 1826-0116 | D27C128-150V10 | 03811 | 1818-4506 | DG390CJ | 02883 | 1826-1205 |
| CMP-01CP | 02180 | 1826-1122 | D27C210-200V10 | 03811 | 1818-4210 | DG403DJ | 02883 | 1826-2179 |
| CMP-01CZ | 02180 | 1826-1384 | D27C240-200V10 | 03811 | 1818-4949 | DG408DJ | 02883 | 1826-2128 |
| CMP-02CJ | 02180 | 1826-1272 | D27C256-200V10 | 03811 | 1818-3319 | DG408DY | 02883 | 1826-2147 |
| CMP-04QP | 02180 | 1826-0787 | D27C256-200V10 | 03811 | 1818-3937 | DG409DY | 02883 | 1826-2167 |
| CMP-05PZ | 02180 | 1826-1708 | D27C256-200V10 | 03811 | 1818-4381 | DG411DJ | 02883 | 1826-1824 |
| COMB816T | 01425 | 1820-2960 | D2815-4 | 03811 | 1818-1985 | DG411DY | 02883 | 1826-1985 |
| CP82C82 | 03799 | 1820-3486 | D27C512-150V10 | 03811 | 1818-4196 | DG412DY | 02883 | 1826-1952 |
| CS5101-KL10 | 12881 | 1826-2055 | | | | | | |

| Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N |
|---------------|-------|-----------|-----------------------|-------|-----------|---------------------|-------|-----------|
| DH0035CG | 03406 | 1820-1797 | DS3245N | 03406 | 1820-3769 | HA3-2625-5 | 03799 | 1826-0736 |
| DM2504CN | 03406 | 1820-1720 | DS3487M | 03406 | 1820-5438 | HA3-2625-5 SELECTED | 03799 | 1826-1309 |
| DM51LS123J | 03406 | 1820-1750 | DS3487N | 03406 | 1820-3445 | HA3-5002-5 | 03799 | 1826-1699 |
| DM71L193N | 03406 | 1820-0233 | DS34C87N | 03406 | 1820-6616 | HA3-5033-5 | 03799 | 1826-1694 |
| DM71L1AN | 03406 | 1820-0100 | DS3611N | 03406 | 1820-1796 | HA3-5033-5 | 03799 | 1826-1760 |
| DM71ALS373N | 03406 | 1820-3378 | DS3612N | 03406 | 1820-2041 | HA3-5104-5 | 03799 | 1826-2052 |
| DM71AS873NT | 03406 | 1820-6381 | DS3630N | 03406 | 1826-0492 | HAT-2505-5 | 03799 | 1826-0735 |
| DM71L00N | 03406 | 1820-0583 | DS3631N | 03406 | 1820-2174 | HAT-2515-5 | 03799 | 1826-1045 |
| DM71L00N | 03406 | 1820-1518 | DS3632N | 03406 | 1820-2290 | HAT-2525-5 | 03799 | 1826-1220 |
| DM71L02N | 03406 | 1820-0584 | DS3649N | 03406 | 1820-2234 | HAT-2645-5 | 03799 | 1826-0929 |
| DM71L03N | 03406 | 1820-0585 | DS3658N | 03406 | 1820-1185 | HAT-5130-5 | 03799 | 1826-1420 |
| DM71L04N | 03406 | 1820-0586 | DS3667N | 03406 | 1820-2862 | HB56D132B-8 | 06347 | 1818-4893 |
| DM71L10N | 03406 | 1820-0587 | DS3669N | 03406 | 1820-1186 | HB56D5123B-8 | 06347 | 1818-4892 |
| DM71L164N | 03406 | 1820-0602 | DS3677N | 03406 | 1820-3658 | HCMP6850 | 05542 | 1826-2034 |
| DM71L20N | 03406 | 1820-0588 | DS3686N | 03406 | 1820-2973 | HCTL-1000 | 01542 | 1820-6366 |
| DM71L30N | 03406 | 1820-0589 | DS3687N | 03406 | 1820-3581 | HCTL-1100 | 01542 | 1820-7693 |
| DM71L22AN | 03406 | 1820-1047 | DS3691N | 03406 | 1820-6556 | HCTL-2000 | 01542 | 1820-1792 |
| DM71L51N | 03406 | 1820-0590 | DS3695AM | 03406 | 1820-6720 | HCTL-2020 | 01542 | 1820-7694 |
| DM71L54N | 03406 | 1820-0591 | DS3695N | 03406 | 1820-1527 | HD100112 | 06347 | 1820-3887 |
| DM71L55N | 03406 | 1820-0592 | DS3695TN | 03406 | 1826-1701 | HD100131 | 06347 | 1820-4228 |
| DM71L71N | 03406 | 1820-0593 | DS36975J | 03406 | 1820-6795 | HD100150 | 06347 | 1820-3595 |
| DM71L72N | 03406 | 1820-0594 | DS3893AV | 03406 | 1820-3756 | HD441020H | 06347 | 1820-3859 |
| DM71L73N | 03406 | 1820-0595 | DS75107NC | 03406 | 1820-6413 | HD441030H | 06347 | 1820-3860 |
| DM71L74N | 03406 | 1820-0596 | DS75160AN | 03406 | 1820-3431 | HD6350P | 06347 | 1820-3938 |
| DM71L85N | 03406 | 1820-0603 | DS75161AN | 03406 | 1820-3513 | HD63840P | 06347 | 1826-1751 |
| DM71L86N | 03406 | 1820-0598 | DS75162AN | 03406 | 1820-3518 | HD74HCT4125P | 06347 | 1820-7336 |
| DM71L90N | 03406 | 1820-0600 | DS75176BN | 03406 | 1820-6789 | HD74HCT592P | 06347 | 1820-6493 |
| DM71L93N | 03406 | 1820-0601 | DS75192N | 03406 | 1820-1670 | HD74HCT7414P | 06347 | 1820-5432 |
| DM71L95N | 03406 | 1820-0599 | DS75192N | 03406 | 1820-2254 | HD74LS390P | 06347 | 1820-2885 |
| DM71LS15N | 03406 | 1820-2053 | DS8640N | 03406 | 1820-2178 | HDS1015EM | 03285 | 1826-1094 |
| DM71LS16N | 03406 | 1820-6563 | DS8641N | 03406 | 1820-5848 | HEF4001BT | 02910 | 1820-4333 |
| DM71LS168AN | 03406 | 1820-3078 | DS8655N | 03406 | 1820-2957 | HEF4066BT | 02910 | 1826-1207 |
| DM71LS173AN | 03406 | 1820-1885 | DS8800H | 03406 | 1820-1021 | HEF4069UBP | 02910 | 1820-6610 |
| DM71LS189N | 03406 | 1816-1089 | DS8820AN | 03406 | 1820-0721 | HEF4069UBT | 02910 | 1820-4332 |
| DM71LS245N | 03406 | 1820-6469 | DS8830N | 03406 | 1820-0720 | HEF4076BT | 02910 | 1820-4217 |
| DM71LS374N | 03406 | 1820-6468 | DS8831N | 03406 | 1820-0780 | HEF4724P | 02910 | 1820-4229 |
| DM71LS465N | 03406 | 1820-1794 | DS8835N | 03406 | 1820-2161 | HI1-0201-4 | 03799 | 1826-1012 |
| DM71LS67N | 03406 | 1820-1759 | DS8838N | 03406 | 1820-1875 | HI1-0508A-5 | 03799 | 1826-0983 |
| DM71LS502N | 03406 | 1820-7256 | DS8839N | 03406 | 1820-1870 | HI1-0509A-5 | 03799 | 1826-1063 |
| DM71LS74N | 03406 | 1820-3459 | DS8859AN | 03406 | 1820-1587 | HI1-0518-5 | 03799 | 1826-1438 |
| DM71WS253N | 03406 | 1820-2287 | DS8863N | 03406 | 1820-1740 | HI1-0539-5 | 03799 | 1826-1366 |
| DM74S288N | 03406 | 1816-1436 | DS8867N | 03406 | 1820-2363 | HI1-1818A-5 | 03799 | 1826-0429 |
| DM74S288N | 03406 | 1816-1578 | DS8871N | 03406 | 1820-2138 | HI1-200-4 | 03799 | 1826-1102 |
| DM76L75N | 03406 | 1820-1376 | DS8884N | 03406 | 1820-1738 | HI1-201HS-5 | 03799 | 1826-2054 |
| DM8090N | 03406 | 1820-1148 | DS88C20N | 03406 | 1820-2417 | HI1-303-5 | 03799 | 1826-1414 |
| DM8093N | 03406 | 1820-1121 | DS8911VC | 03406 | 1826-2151 | HI1-5043-5 | 03799 | 1826-0740 |
| DM8094N | 03406 | 1820-0846 | DS8921M | 03406 | 1820-5774 | HI1-5044-5 | 03799 | 1826-0952 |
| DM8095N | 03406 | 1820-1254 | DS8921N | 03406 | 1820-4890 | HI1-507A-2 | 03799 | 1826-1503 |
| DM8096N | 03406 | 1820-1368 | DS8922M | 03406 | 1820-5542 | HI1-509A-5 | 03799 | 1826-1276 |
| DM8097N | 03406 | 1820-1049 | DS8922AN | 03406 | 1820-5371 | HI1-674AKD-5 | 03799 | 1826-1593 |
| DM8098N | 03406 | 1820-1255 | DS8973N | 03406 | 1820-2136 | H12-0200-5 | 03799 | 1820-1781 |
| DM8123N | 03406 | 1820-1294 | DS9636ACN | 03406 | 1820-6515 | H13-0201-5 | 03799 | 1826-1282 |
| DM8130N | 03406 | 1820-1293 | DS96F174CJ | 03406 | 1820-6796 | H13-0201-5 | 03799 | 1826-1291 |
| DM8160N | 03406 | 1820-1131 | DS96F175CJ | 03406 | 1820-6797 | H13-0508A-5 | 03799 | 1826-1064 |
| DM81123N | 03406 | 1820-1167 | E144C-0200 | 03876 | 1820-1003 | H13-0509-5 | 03799 | 1826-1482 |
| DM8011S96N | 03406 | 1820-1872 | E144D-0200 | 03876 | 1820-0714 | H13-201HS-5 | 03799 | 1826-1346 |
| DM811S98N | 03406 | 1820-1873 | E144D-0200 | 03876 | 1820-1019 | H13-524-5 | 03799 | 1826-1998 |
| DM8200N | 03406 | 1820-0623 | E915-5_015CT | 03251 | 1826-1823 | HML-6514-5 | 03799 | 1818-1370 |
| DM8214N | 03406 | 1820-0906 | EL2018CN | 03251 | 1826-1817 | HML-6514-9 | 03799 | 1818-0990 |
| DM8220N | 03406 | 1820-0505 | EL2039CN | 03251 | 1826-1859 | HML-6514-B9 | 03799 | 1818-4337 |
| DM8520N | 03406 | 1820-1292 | EP1810G | 03280 | 1820-8157 | H12-0200-5 | 03799 | 1820-1781 |
| DM8542 | 03406 | 1820-1468 | EP320PC-1 UNPRGM | 03280 | 1820-6560 | H13-0201-5 | 03799 | 1826-1439 |
| DM8551N | 03406 | 1820-0574 | EP610PC-25 UNPRGM | 03280 | 1820-7052 | H13-6518-9 | 03799 | 1816-0915 |
| DM8552N | 03406 | 1820-1143 | EP610PC-30 UNPRGM | 03280 | 1820-6758 | H13-7603-5 | 03799 | 1816-0916 |
| DM8553N | 03406 | 1820-1113 | EPM5032DC-1 | 03280 | 1820-8164 | H13-7610-5 | 03799 | 1816-0917 |
| DM8554N | 03406 | 1820-1291 | EPM5128C | 03280 | 1820-8084 | H13-7611-5 | 03799 | 1816-0782 |
| DM8556N | 03406 | 1820-1874 | ER2055 | 02713 | 1818-1757 | H13-7611-5561 | 03799 | 1816-1416 |
| DM8570N | 03406 | 1820-0294 | F10010DC | 02237 | 1820-2093 | H13-7620-5 | 03799 | 1816-0918 |
| DM8590N | 03406 | 1820-0262 | F100142DC | 02237 | 1816-1469 | H13-7621-5 | 03799 | 1816-0710 |
| DM8515LN | 03406 | 1820-1166 | F10014PC | 02237 | 1820-2359 | H13-7641A-5 | 03799 | 1816-0929 |
| DM8515WN | 03406 | 1820-1349 | F10016DC | 02237 | 1820-1788 | H13-7643-5 | 03799 | 1816-0931 |
| DM8556BJ | 03406 | 1820-1985 | F100422DC | 02237 | 1816-1552 | H13-7649A-5 | 03799 | 1816-1481 |
| DM86175N | 03406 | 1820-0986 | F10145A5DC | 02237 | 1816-1338 | H13-7649A-5 | 03799 | 1816-1548 |
| DM86176N | 03406 | 1820-1057 | F11C06DPA | 02237 | 1820-2106 | HM10422-7 | 06347 | 1816-1555 |
| DM86566WCAB/N | 03406 | 1816-1339 | F135-0100 | 01876 | 1820-1226 | HM10422-7 | 06347 | 1816-1459 |
| DM875191J | 03406 | 1816-1513 | FCM7002PC | 02237 | 1820-2114 | HM10470 | 06347 | 1816-1591 |
| DM87TS421 | 03406 | 1816-1690 | FDC9229BT | 01425 | 1820-4686 | HM10474-15 | 06347 | 1816-1532 |
| DP8304BN | 03406 | 1820-2239 | GAL16V8-15LVC UNPRGM | 03406 | 1820-6544 | HM2112-1 | 06347 | 1816-1586 |
| DP8340N | 03406 | 1820-3477 | GAL16V8-25LVC UNPRGM | 03406 | 1820-5398 | HM3-6514-5 | 03799 | 1818-0989 |
| DP8331N | 03406 | 1820-3418 | GAL16V8-25QVC UNPRGM | 03406 | 1820-6243 | HM3-6514-9 | 03799 | 1818-0955 |
| DP8392AN | 03406 | 1820-4899 | GAL16V8-25QVC UNPRGM | 03406 | 1820-6885 | HM3-6561-5 | 03799 | 1818-1009 |
| DP8392BN | 03406 | 1820-5591 | GAL16V8A-10LJ UNPRGM | 03406 | 1820-6572 | HM3-7621-5 | 03799 | 1816-1382 |
| DP8392CN | 03406 | 1820-4896 | GAL16V8A-10LP UNPRGM | 03406 | 1820-7019 | HM3-7643-5 | 03799 | 1816-1467 |
| DP8408N | 03406 | 1820-3154 | GAL16V8A-12LVC UNPRGM | 03406 | 1820-6884 | HM4716A-2 | 06347 | 1818-0509 |
| DP8409AN-2 | 03406 | 1820-3142 | GAL16V8A-15LPC UNPRGM | 03406 | 1820-8163 | HM4716A-4 | 06347 | 1818-0340 |
| DP8451N | 03406 | 1820-3969 | GAL20V8-25QPC UNPRGM | 03406 | 1820-6244 | HM4864-3 | 06347 | 1818-1559 |
| DP8451V-4 | 03406 | 1820-4877 | GAL20V8A-10LJ UNPRGM | 03406 | 1820-6883 | HM4864P-3 | 06347 | 1818-3006 |
| DP8459VC | 03406 | 1820-6802 | GAL20V8A-10LP UNPRGM | 03406 | 1820-6573 | HM51296L-12 | 06347 | 1818-4039 |
| DP8461N | 03406 | 1820-3705 | GAL20V8A-10LP UNPRGM | 03406 | 1820-7040 | HM53461P-10 | 06347 | 1818-4294 |
| DP8461N | 03406 | 1820-4334 | GAL22V10-15LP UNPRGM | 03406 | 1820-7020 | HM53461P-15 | 06347 | 1818-4354 |
| DP8464BV-3 | 03406 | 1820-5242 | GAL22V10-15LVC | 03406 | 1820-7481 | HM53461ZP-12 | 06347 | 1818-4420 |
| DP8480AN | 03406 | 1820-6709 | GAL6001-30P UNPRGM | 03406 | 1820-6729 | HM6116ALP-15 | 06347 | 1818-3814 |
| DQ52B33H-300 | 11111 | 1818-3556 | GAP-01FP | 02180 | 1826-1641 | HM6116LP-15 | 06347 | 1818-3379 |
| DQ8001 | 11111 | 1820-5975 | GPD-1003 | 03291 | 1813-0315 | HM6116LP-2 | 06347 | 1818-3768 |
| DQ8023A | 11111 | 1820-4189 | GPD-410 | 03291 | 1813-0318 | HM6116LP-2 | 06347 | 1818-1790 |
| DS0025CN | 03406 | 1820-0718 | GPD-420 | 03291 | 1813-0319 | HM6116LP-3 | 06347 | 1818-1768 |
| DS0026CG | 03406 | 1820-1065 | GPD-430 | 03291 | 1813-0385 | HM6116LP-4 | 06347 | 1818-17 |

| Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N |
|-------------------------|-------|-----------|-----------------------|-------|-----------|----------------------|-------|-----------|
| HM6264ASP-10 | 06347 | 1818-4920 | IDT74FC7C139AP | 10253 | 1820-6908 | L6-OV-5 | 06545 | 1826-0731 |
| HM6264ASP-12 | 06347 | 1818-4162 | IDT74FC7C139P | 10253 | 1820-7608 | L6-OV-5 | 06545 | 1826-0732 |
| HM6264LFP-15 | 06347 | 1818-3933 | IDT74FC7C182AP | 10253 | 1820-6949 | L6203 | 04078 | 1820-6804 |
| HM6264LP-12 | 06347 | 1818-3385 | IDT74FC7C191AP | 10253 | 1820-5396 | L6506 | 06338 | 1820-5991 |
| HM6264P-12 | 06347 | 1818-3330 | IDT74FC7C240ASO | 10253 | 1820-6837 | L7180 | 06338 | 1826-1804 |
| HM6267LP-45 | 06347 | 1818-3174 | IDT74FC7C244AP | 10253 | 1820-5535 | L811-4CJ | 08831 | 1818-1616 |
| HM6267P | 06347 | 1818-1969 | IDT74FC7C244ASO | 10253 | 1820-6690 | LAS-1515-001 | 06545 | 1826-0402 |
| HM6267P-35 | 06347 | 1818-3559 | IDT74FC7C244P | 10253 | 1820-5226 | LAS-1815-001 | 06545 | 1826-0403 |
| HM6268HP-45 | 06347 | 1818-3618 | IDT74FC7C245AP | 10253 | 1820-5874 | LAS-19U | 06545 | 1826-0591 |
| HM6268HP-55 | 06347 | 1818-3506 | IDT74FC7C245ASO | 10253 | 1820-6553 | LAS15A15 | 06545 | 1826-0819 |
| HM628128LFP-10 | 06347 | 1818-4779 | IDT74FC7C245ATP | 10253 | 1820-7325 | LAS18A15 | 06545 | 1826-0820 |
| HM628128LFP-8 | 06347 | 1818-4785 | IDT74FC7C257ATP | 10253 | 1820-6844 | LAS1912 | 06545 | 1826-0784 |
| HM628128LP-10 | 06347 | 1818-4832 | IDT74FC7C373AP | 10253 | 1820-6264 | LAS1915 | 06545 | 1826-0754 |
| HM628128LP-12 | 06347 | 1818-4430 | IDT74FC7C373AP | 10253 | 1820-6199 | LB1246 | 07371 | 1820-4761 |
| HM628128LP-12 | 06347 | 1818-4678 | IDT74FC7C377ASO | 10253 | 1820-7330 | LD110CJ | 02883 | 1820-1252 |
| HM628128LP-20 | 06347 | 1818-4604 | IDT74FC7C399ASO | 10253 | 1820-7671 | LD111CJ | 02883 | 1826-0195 |
| HM6716P-25 | 06347 | 1818-4074 | IDT74FC7C399P | 10253 | 1820-5747 | LD114CJ | 02883 | 1820-1474 |
| HM6716P-25 | 06347 | 1818-4438 | IDT74FC7C521SO | 10253 | 1820-6007 | LD120CJ | 02883 | 1826-0588 |
| HM6787HJP-15 | 06347 | 1818-4687 | IDT74FC7C533AP | 10253 | 1820-6305 | LD1202N | 03406 | 1820-1986 |
| HM6787P-25 | 06347 | 1818-4031 | IDT74FC7C540ASO | 10253 | 1820-7316 | LD1333D | 03406 | 1826-0416 |
| HM6787P-55 | 06347 | 1818-3500 | IDT74FC7C540ATP | 10253 | 1820-6551 | LD1333N | 03406 | 1820-1795 |
| HM65256BLP-12 | 06347 | 1818-4430 | IDT74FC7C541ASO | 10253 | 1820-6612 | LF13007N | 03406 | 1826-0846 |
| HM6708P-20 | 06347 | 1818-4678 | IDT74FC7C543AP | 10253 | 1820-6552 | LF1333D | 03406 | 1826-0582 |
| HM6716P-25 | 06347 | 1818-4074 | IDT74FC7C543ASO | 10253 | 1820-6777 | LF1333D | 03406 | 1826-0417 |
| HM6716P-25 | 06347 | 1818-4438 | IDT74FC7C547AP | 10253 | 1820-6526 | LF1333M | 03406 | 1826-1941 |
| HM6787HJP-15 | 06347 | 1818-4687 | IDT74FC7C547ASO | 10253 | 1820-6522 | LF1333N | 03406 | 1826-0480 |
| HM6787P-25 | 06347 | 1818-4022 | IDT74FC7C547ATP | 10253 | 1820-6909 | LF13508D | 03406 | 1826-0581 |
| HM6788HP-15 | 06347 | 1818-4689 | IDT74FC7C548ASO | 10253 | 1820-5703 | LF13508N | 03406 | 1826-2080 |
| HM6789HAJP-12 | 06347 | 1818-4824 | IDT74FC7C548ATP | 10253 | 1820-6761 | LF13509D | 03406 | 1826-0590 |
| HM6789HAP-15 | 06347 | 1818-4823 | IDT74FC7C646AP | 10253 | 1820-7257 | LF13741H | 03406 | 1826-0552 |
| HNS8064P-30 | 06347 | 1818-3801 | IDT74FC7C646P | 10253 | 1820-6848 | LF1516H | 03406 | 1826-1052 |
| HOS-100A | 03285 | 1813-0486 | IDT74FC7C654ASO | 10253 | 1820-6554 | LF2525H | 03406 | 1826-0458 |
| HPL1-16LC8-9 UNPRGMD | 03799 | 1820-4523 | IDT74FC7C654P | 10253 | 1820-6527 | LF2526H | 03406 | 1826-0371 |
| HPL1-16RC4-9 UNPRGMD | 03799 | 1820-4524 | IDT74FC7C654ASO | 10253 | 1820-7670 | LF256H, SEL NOISE | 03406 | 1826-0358 |
| HPL1-16RC6-9 UNPRGMD | 03799 | 1820-4522 | IDT74FC7C654ATP | 10253 | 1820-5787 | LF257H | 03406 | 1826-0447 |
| HPPM-038615 | 01542 | 1826-2175 | IDT74FC7C654P | 10253 | 1820-6200 | LF258H | 03406 | 1826-0422 |
| HPPM-8256-5D | 03799 | 1816-0409 | IDT74FC7C654P | 10253 | 1820-2224 | LF298H SELECTED | 03406 | 1826-0619 |
| HPPM1-1024-5B | 03799 | 1816-0015 | IDT74FC7C652ATP | 10253 | 1820-1234 | LF311H | 03406 | 1826-0497 |
| HS3120-C2 | 03755 | 1826-1114 | IDT74FC7C821ATP | 10253 | 1820-6527 | LF347BN | 03406 | 1826-0665 |
| HV2116PJ | 07221 | 1826-2082 | IDT74FC7C823AP | 10253 | 1820-6527 | LF351AH | 03406 | 1826-0686 |
| HYB511000AJ-10 (or -80) | 06121 | 1818-4914 | IDT74FC7C825ASO | 10253 | 1820-7670 | LF351BH | 03406 | 1826-0908 |
| HYB511000AP-10 (or -80) | 06121 | 1818-4916 | IDT74FC7C825BP | 10253 | 1820-5787 | LF352H | 03406 | 1826-0358 |
| HYB514100-80 | 06121 | 1818-4912 | IDT74FC7C825BSO | 10253 | 1820-7369 | LF357H | 03406 | 1826-0422 |
| HYB514256AJ-10 (or -80) | 06121 | 1818-4913 | IDT74FC7C814TP | 10253 | 1820-6200 | LF358H | 03406 | 1826-0205 |
| HYB514400J-80 | 06121 | 1818-4915 | IDT74FC7C814TP | 10253 | 1820-2224 | LF359H SELECTED | 03406 | 1826-0619 |
| IAM-82018 | 03291 | 1826-2225 | IDH-5042CTW | 03714 | 1826-1168 | LF353AN | 03406 | 1826-0888 |
| ICL 8049 CC PE | 03714 | 1826-0432 | IDH5010CPD | 03714 | 1813-0034 | LF353BH | 03406 | 1826-0843 |
| ICL 8250 C PE | 03714 | 1826-0387 | IDH5012CJE | 03714 | 1826-1391 | LF353H | 03406 | 1826-0704 |
| ICL7107CPL | 03714 | 1826-0876 | IDH5012CPE | 03714 | 1826-0193 | LF353N | 03406 | 1826-0712 |
| ICL7109CPL | 03714 | 1826-0746 | IDH5020CPA | 03714 | 1826-1235 | LF354H | 03406 | 1826-0304 |
| ICL7109CPL | 11302 | 1826-1455 | IDH5042PA | 03714 | 1826-1353 | LF355H | 03406 | 1826-1180 |
| ICL7109IDL | 03714 | 1826-1053 | IDH5082CPE | 03714 | 1826-0489 | LF355N | 03406 | 1826-0491 |
| ICL7109IPL | 03714 | 1826-1510 | IDH5035CPA | 03714 | 1820-1234 | LF356AH | 03406 | 1826-0668 |
| ICL714C-LN-TY | 03714 | 1826-0391 | IDH5042CJE | 03714 | 1826-1159 | LF356BH | 03406 | 1826-0528 |
| ICL7605CJN | 03714 | 1826-0761 | IDH5104CJE | 03714 | 1826-0924 | LF356H | 03406 | 1826-0205 |
| ICL7611BMTY | 03714 | 1826-0765 | IDH5149CPE | 03714 | 1826-1678 | LF357H | 03406 | 1826-0304 |
| ICL7613BCTV | 03714 | 1826-0963 | IDH5151CPE | 03714 | 1826-1679 | LF358H | 03406 | 1826-0491 |
| ICL7621BCPA | 04550 | 1826-1898 | IDH6108CPE | 03714 | 1826-1241 | LF359AH | 03406 | 1826-1085 |
| ICL7650CPD | 03714 | 1826-1373 | IDH6161CPI | 03714 | 1820-2183 | LF359H | 03406 | 1826-0888 |
| ICL76501JD | 03714 | 1826-0968 | IDM5013ACDD | 03714 | 1820-1363 | LF359H | 03406 | 1826-0843 |
| ICL7660CBA | 03714 | 1826-1350 | IDM6500CFP PROGRAMMED | 03714 | 1816-0053 | LF359H | 03406 | 1826-0433 |
| ICL7660CPA | 03714 | 1826-0851 | IDM6510CPE | 03714 | 1816-0217 | LF359H | 03406 | 1826-1557 |
| ICL7660CPA | 03714 | 1826-0906 | IDM6402-11PL | 03714 | 1820-2204 | LF359H | 03406 | 1826-0319 |
| ICL7663ACPA | 11302 | 1826-1789 | IDM64021DL | 03714 | 1820-2087 | LF359H SELECTED | 03406 | 1826-0340 |
| ICL7663ACSA | 11302 | 1826-1926 | IDM6508X1JE | 03714 | 1818-0390 | LF359H | 03406 | 1826-2005 |
| ICL7665SSACPA | 04550 | 1826-2077 | IDM6551ACPN | 03714 | 1818-1750 | LF359H | 03406 | 1826-1085 |
| ICL7667CPA | 03714 | 1820-1032 | IDM66531JG | 03714 | 1818-1520 | LF357H | 03406 | 1826-0357 |
| ICL7673CBA | 03714 | 1826-1683 | IDM6654-11JG | 03714 | 1818-1351 | LF357J | 02037 | 1826-1280 |
| ICL7673CPA | 03714 | 1826-1526 | IDMS1400P-45 | 10420 | 1818-3547 | LF357N | 02037 | 1826-1024 |
| ICL8001CTZ | 03714 | 1826-0129 | IDMS1400S-45 | 10420 | 1818-3317 | LF398AH | 03406 | 1826-1432 |
| ICL80008CTY | 03714 | 1826-0131 | IDMS1420P-45 | 10420 | 1818-3184 | LF398AN | 03406 | 1826-1440 |
| ICL8038BBCD (SELECTED) | 03714 | 1826-1109 | IDMS1420P-55 | 10420 | 1818-3303 | LF398H | 03406 | 1826-0503 |
| ICL8052CPD | 03714 | 1826-0446 | IDMS1420S-55 | 10420 | 1818-3118 | LF398N | 03406 | 1826-0791 |
| ICL8069DCQ | 03714 | 1826-0573 | IDMS1423S-35 | 10420 | 1818-3759 | LF398S88 | 10858 | 1826-1911 |
| ICL8211C1PA | 03714 | 1826-0978 | IDNA101SG | 03291 | 1826-2141 | LF400CH | 03406 | 1826-1791 |
| ICL8211CTY | 03714 | 1826-0540 | IDNA105AM | 05436 | 1826-1519 | LF411ACH | 03406 | 1826-1148 |
| ICL8211IPL (SELECTED) | 03714 | 1826-1508 | IDNA105KP | 05436 | 1826-2001 | LF411ACN | 03406 | 1826-1081 |
| ICL8212C2PA | 03714 | 1826-0408 | IDNA110KP | 05436 | 1826-1794 | LF411CH | 03406 | 1826-1071 |
| ICM7207/AIPD | 03714 | 1826-1337 | IDNA110KP | 05436 | 1826-1766 | LF411CN | 03406 | 1826-0961 |
| ICM7207/AIPD | 03714 | 1813-0150 | IDNA110KU | 05436 | 1826-1965 | LF411CN A (SELECTED) | 03406 | 1826-1726 |
| ICM7217C1PI | 03714 | 1820-3060 | IDNA117P | 05436 | 1820-2094 | LF412ACH | 03406 | 1826-1077 |
| ICM7218A | 03714 | 1820-2132 | IDSO102 | 05436 | 1813-0630 | LF412ACN | 03406 | 1826-1128 |
| ICM7218A1PI | 11302 | 1820-1688 | IDX2210D | 10572 | 1818-3197 | LF412CD | 02037 | 1826-2218 |
| ICM7218B1IJ | 03714 | 1820-2712 | ID574AHCT00N | 12125 | 1820-4781 | LF412CH | 03406 | 1826-1127 |
| ICM7218B1PI | 11302 | 1820-5060 | ID574AHCT02N | 12125 | 1820-5147 | LF412CN | 03406 | 1826-0962 |
| ICM7218E1IJL | 03714 | 1820-4503 | ID574AHCT10N | 12125 | 1820-7601 | LF412CN | 03406 | 1826-0997 |
| ICM7226A1IDL | 03714 | 1820-2187 | ID574AHCT138N | 12125 | 1820-4754 | LF412CN (SELECTED) | 03406 | 1826-0887 |
| ICM7228B1IJ | 03714 | 1820-4983 | ID574AHCT32N | 12125 | 1820-5099 | LF412CN | 03406 | 1826-1405 |
| ICM75551PA | 03714 | 1820-2466 | ID574AHCT40N | 12125 | 1820-5098 | LF412CN | 03406 | 1826-1075 |
| ICM75551PD | 03714 | 1820-3235 | ID574AHCT44N | 12125 | 1820-4748 | LF414ACN | 03406 | 1826-1302 |
| IDT29FC7C520AP | 10253 | 1820-6173 | ID574AHCT48N | 12125 | 1820-4749 | LF414HCN | 03406 | 1826-1076 |
| IDT29FC7C52AP | 10253 | 1820-7349 | ID574AHCT57N | 12125 | 1820-5100 | LF414CN | 03406 | 1826-1990 |
| IDT29FC7C52ASO | 10253 | 1820-6102 | ID574AHCT58N | 12125 | 1820-4752 | LFM60C1WMM-50 | 03406 | 1826-2249 |
| IDT29FC7C52ASO | 10253 | 1820-7350 | ID574AHCT73N | 12125 | 1820-5099 | LFH002CN | 03406 | 1826-0224 |
| IDT29FC7C53AP | 10253 | 1820-6608 | ID574AHCT53N | 12125 | 1820-5923 | LFH002CN | 03406 | 1826-1067 |
| IDT49C60A0G | 10253 | 1820-5385 | ID574AHCT59N | 12125 | 1820-6061 | LFH0021CK | 03406 | 1826-0058 |
| IDT6116SA35TP | | | | | | | | |

| Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N |
|------------------|-------|-----------|-------------------|-------|-----------|----------------------|-------|-----------|
| LM10BLH | 03406 | 1826-1223 | LM318N | 03406 | 1826-1034 | LM393JG | 01698 | 1826-1229 |
| LM10CH | 03406 | 1826-0773 | LM319D | 02910 | 1826-1551 | LM393N | 03406 | 1826-0412 |
| LM10CN | 03406 | 1826-1004 | LM319H | 03406 | 1826-0191 | LM395K | 03406 | 1826-0320 |
| LM110H | 03406 | 1826-1575 | LM319J | 03406 | 1826-0141 | LM395T | 03406 | 1826-0886 |
| LM113-2H | 03406 | 1826-0329 | LM319M | 03406 | 1826-1623 | LM396K | 03406 | 1826-0966 |
| LM117K | 03406 | 1826-0673 | LM319N | 03406 | 1826-0175 | LM3999Z | 03406 | 1826-0825 |
| LM11CH | 03406 | 1826-0909 | LM320H-05 | 03406 | 1826-0220 | LM399AH (SEL) | 10858 | 1826-1249 |
| LM11CN | 03406 | 1826-1133 | LM320H-12 | 03406 | 1826-0178 | LM399H | 03406 | 1902-0908 |
| LM120K-15 | 03406 | 1826-1157 | LM320H-15 | 03406 | 1826-0192 | LM4250CH | 03406 | 1826-0165 |
| LM120K-5.0 | 03406 | 1826-0397 | LM320H-5.2 | 03406 | 1826-0179 | LM555CN | 03406 | 1826-0373 |
| LM125H | 03406 | 1826-2006 | LM320H-6 | 03406 | 1826-0568 | LM565CH | 03406 | 1826-0101 |
| LM129AH | 03406 | 1826-0802 | LM320K-05 | 03406 | 1826-0202 | LM611CN (SELECTED) | 03406 | 1826-2010 |
| LM12C1K | 03406 | 1826-2063 | LM320K-12 | 03406 | 1826-0123 | LM614CWN | 03406 | 1826-2232 |
| LM135AH | 03406 | 1826-1138 | LM320K-15 | 03406 | 1826-0169 | LM6321N | 03406 | 1826-1808 |
| LM136H | 03406 | 1826-1541 | LM320K-18 | 03406 | 1826-0173 | LM6325N | 03406 | 1826-2100 |
| LM1370N | 03406 | 1826-1809 | LM320LZ-5.0 | 03406 | 1826-1383 | LM6361J | 03406 | 1826-1665 |
| LM137K | 03406 | 1826-0763 | LM320T-12 | 03406 | 1826-0118 | LM6361M | 03406 | 1826-1799 |
| LM138K (STEEL) | 03406 | 1826-0837 | LM320T-15 | 03406 | 1826-0277 | LM6361N | 03406 | 1826-1800 |
| LM139AJ | 03406 | 1826-2051 | LM320T-18 | 03406 | 1826-0377 | LM6361N SELECTED | 03406 | 1826-1857 |
| LM145K-5.2 | 03406 | 1826-1026 | LM320T-24 | 03406 | 1826-0299 | LM6366N | 03406 | 1826-1771 |
| LM155B | 03406 | 1826-0243 | LM320T-8.0 | 03406 | 1826-0449 | LM636SN | 03406 | 1826-2210 |
| LM161J | 03406 | 1826-0548 | LM321AH SELECTED | 03406 | 1826-0234 | LM6757 | 03406 | 1826-1720 |
| LM1875 | 03406 | 1826-1389 | LM321H | 03406 | 1826-0162 | LM709AH | 03406 | 1820-0197 |
| LM1877N-9 | 03406 | 1826-0863 | LM322N | 03406 | 1826-0225 | LM709H | 03406 | 1820-0162 |
| LM1881M | 03406 | 1826-2021 | LM323K | 03406 | 1826-0181 | LM725AH | 03406 | 1826-0711 |
| LM1881N | 03406 | 1826-1942 | LM324N | 03406 | 1826-0524 | LM741CN | 03406 | 1826-0271 |
| LM1965N | 03406 | 1826-2152 | LM325D | 02910 | 1826-1072 | LM747D | 03406 | 1826-0135 |
| LM201ADP | 10881 | 1826-1460 | LM325D | 01698 | 1826-1600 | LM7824CK | 03406 | 1826-0559 |
| LM201AH | 03406 | 1826-0059 | LM325F | 03406 | 1826-0291 | LM7811OACH | 03406 | 1826-0394 |
| LM201AH SELECTED | 03406 | 1826-0045 | LM325N | 03406 | 1826-0161 | LM78115ACM | 03406 | 1826-0353 |
| LM201AJ | 03406 | 1826-1491 | LM325AS | 03406 | 1826-0238 | LM78115ACM | 03406 | 1826-2156 |
| LM201AN | 02037 | 1826-0311 | LM325B | 03406 | 1826-0157 | LM78M05CP | 03406 | 1826-1299 |
| LM201H | 03406 | 1820-0104 | LM325S | 03406 | 1826-0283 | LM7906T | 03406 | 1826-0478 |
| LM207H | 03406 | 1826-0113 | LM326H | 03406 | 1826-0533 | LM7915ACM | 03406 | 1826-2155 |
| LM208AH | 03406 | 1826-0025 | LM329 | 03406 | 1902-0928 | LM79M05CP SELECTED | 03406 | 1826-2259 |
| LM208AN | 02037 | 1826-2102 | LM329D (SEL) | 03406 | 1826-1331 | LM833M | 03406 | 1826-1825 |
| LM208H | 03406 | 1826-0072 | LM329DZ | 03406 | 1826-0585 | LM833N | 03406 | 1826-1725 |
| LM210H SELECTED | 03406 | 1826-0097 | LM330T-5.0 | 03406 | 1826-0904 | LMC660CM | 03406 | 1826-1964 |
| LM211D | 02037 | 1826-2150 | LM333K STEEL | 03406 | 1826-1415 | LMC660CN | 03406 | 1826-1732 |
| LM211H | 03406 | 1826-0998 | LM334H | 03406 | 1826-1046 | LMC7660IN | 03406 | 1826-1821 |
| LM212H | 03406 | 1826-0110 | LM334Z | 03406 | 1826-0623 | LP2950ACZ | 03406 | 1826-1646 |
| LM218H | 03406 | 1826-0488 | LM335AZ | 03406 | 1826-0760 | LP2951ACM | 03406 | 1826-1872 |
| LM220K-12 | 03406 | 1826-0235 | LM335Z | 03406 | 1826-0880 | LP2951ACN | 03406 | 1826-1968 |
| LM220K-15 | 03406 | 1826-0233 | LM336BZ | 03406 | 1826-0910 | LP311N | 03406 | 1826-1162 |
| LM224J | 03406 | 1826-0232 | LM336BZ-5.0 | 03406 | 1826-1297 | LP339M | 03406 | 1826-1225 |
| LM234Z-3 | 10858 | 1826-1980 | LM336Z-5.0 | 03406 | 1826-1065 | LP339N | 03406 | 1826-1289 |
| LM235AH | 03406 | 1826-2053 | LM337H | 03406 | 1826-0558 | LP365N | 03406 | 1826-1370 |
| LM236AH | 03406 | 1826-0855 | LM337H/VVK-STEEL | 03406 | 1826-0870 | LT1001ACH | 10858 | 1826-1479 |
| LM236H | 03406 | 1826-0766 | LM337K | 03406 | 1826-0523 | LT1001ACN8 | 10858 | 1826-1895 |
| LM250K STEEL | 03406 | 1826-0748 | LM337K (SELECTED) | 03406 | 1826-0690 | LT1001CN8 (SELECTED) | 10858 | 1826-1896 |
| LM255AH | 03406 | 1826-0768 | LM337LM | 03406 | 1826-1841 | LT1001CS8 | 10858 | 1826-1382 |
| LM258H | 03406 | 1826-0745 | LM337LZ | 03406 | 1826-0994 | LT1002CN | 10858 | 1826-2114 |
| LM261H | 03406 | 1826-0762 | LM337LZ | 03406 | 1826-1099 | LT1002CN | 10858 | 1826-1368 |
| LM285BYZ-1.2 | 03406 | 1826-1509 | LM337T | 03406 | 1826-0527 | LT1004CZ | 10858 | 1826-1167 |
| LM285BYZ-2.5 | 03406 | 1826-1464 | LM338K | 03406 | 1826-0677 | LT1005CK | 10858 | 1826-1787 |
| LM285H-2.5 | 03406 | 1826-1288 | LM339AD | 01698 | 1826-1775 | LT1007CH | 10858 | 1826-1433 |
| LM2900N | 03406 | 1826-0939 | LM339AN | 03406 | 1826-0666 | LT1007CN8 | 10858 | 1826-1316 |
| LM2901N | 03406 | 1826-1506 | LM339J | 03406 | 1826-0759 | LT1009CZ | 10858 | 1826-1435 |
| LM2909N | 03406 | 1826-0611 | LM339M | 03406 | 1826-1528 | LT1009S8 | 10858 | 1826-1979 |
| LM2917N | 03406 | 1826-0842 | LM339N | 03406 | 1826-0138 | LT10010CT | 10858 | 1826-1788 |
| LM2930P-5.0TB | 03406 | 1826-1005 | LM339N SELECTED | 01698 | 1826-1033 | LT1011AICH | 10858 | 1826-1539 |
| LM2930T-5.0 | 03406 | 1826-1201 | LM340-12AT | 03406 | 1826-1121 | LT1011CN8 | 10858 | 1826-1475 |
| LM2930T-8.0 | 03406 | 1826-1881 | LM340AK-15 | 03406 | 1826-1181 | LT1012CH | 10858 | 1826-1462 |
| LM2931AZ-5.0 | 03406 | 1826-1397 | LM340AK-5 | 03406 | 1826-0536 | LT1012CN8 | 10858 | 1826-1381 |
| LM2931CT | 03406 | 1826-1090 | LM340AKT-15 | 03406 | 1826-0607 | LT1012CS8 | 10858 | 1826-1927 |
| LM2935T | 03406 | 1826-1586 | LM340AT-5 | 03406 | 1826-0551 | LT1013ACJ8 | 10858 | 1826-1436 |
| LM2935T05B | 03406 | 1826-1750 | LM340AT-5 | 03406 | 1826-0370 | LT1013CN8 | 10858 | 1826-1409 |
| LM2940CT-12 | 03406 | 1826-2033 | LM340K | 03406 | 1826-0438 | LT1013DS8 | 10858 | 1826-1837 |
| LM2940CT-15 | 03406 | 1826-2038 | LM340LAH-12 | 03406 | 1826-0554 | LT1014CN | 10858 | 1826-1599 |
| LM2940CT-5.0 | 03406 | 1826-1597 | LM340LAZ-5 | 03406 | 1826-0555 | LT1014DN | 10858 | 1826-1553 |
| LM2941CT | 03406 | 1826-2219 | LM340LAZ-5 | 03406 | 1826-1203 | LT1016CN8 | 10858 | 1826-1763 |
| LM299AH | 03406 | 1826-1239 | LM341IP-12 | 03406 | 1826-0435 | LT1016CS8 | 10858 | 1826-1950 |
| LM299H | 03406 | 1826-0330 | LM341IP-24 | 03406 | 1826-0436 | LT1019ACH-5 | 10858 | 1826-1712 |
| LM300H | 03406 | 1820-0123 | LM341IP-8.0 | 03406 | 1826-0434 | LT1021BCN8-10 | 10858 | 1826-1514 |
| LM301AH | 03406 | 1820-0223 | LM341IP-8.0 | 03406 | 1826-1099 | LT1021BCN8-5 | 10858 | 1826-1706 |
| LM301AJ | 03406 | 1826-1227 | LM342H | 03406 | 1826-0634 | LT1021CH-5 | 10858 | 1826-1847 |
| LM301AJ-14 | 03406 | 1826-0669 | LM346J | 03406 | 1826-0719 | LT1021CN8-10 | 10858 | 1826-1377 |
| LM301AN | 03406 | 1820-0477 | LM348J | 03406 | 1826-0557 | LT1021CN8-10 | 10858 | 1826-1431 |
| LM302H | 03406 | 1820-0158 | LM348W | 03406 | 1826-0315 | LT1021CN8-10 | 10858 | 1826-1369 |
| LM304AH | 03406 | 1826-0004 | LM350K | 03406 | 1826-0631 | LT1021DN8 | 10858 | 1826-1779 |
| LM305H | 03406 | 1820-0247 | LM350K SELECTED | 03406 | 1826-0724 | LT1021DCS8-10 | 10858 | 1826-1687 |
| LM306H | 03406 | 1820-0475 | LM350T | 03406 | 1826-1166 | LT1021DCS8-5 | 10858 | 1826-1838 |
| LM307H | 03406 | 1826-0043 | LM3524DM | 03406 | 1826-2248 | LT1024ACN | 10858 | 1826-1690 |
| LM307J | 03406 | 1826-0989 | LM3524N | 03406 | 1826-1569 | LT1024ACN | 10858 | 1826-1690 |
| LM307N | 03406 | 1820-0493 | LM358AH | 03406 | 1826-0592 | LT1028ACN8 | 10858 | 1826-1608 |
| LM307N SELECTED | 03406 | 1826-0668 | LM358AN | 03406 | 1826-0890 | LT1028ACN8 | 10858 | 1826-1808 |
| LM308AH | 03406 | 1826-0035 | LM358H | 03406 | 1826-0678 | LT1028CJB | 10858 | 1826-1728 |
| LM308AM | 03406 | 1826-2115 | LM358M | 03406 | 1826-1813 | LT1029ACZ | 10858 | 1826-1840 |
| LM308AN | 03406 | 1826-0493 | LM358N | 03406 | 1826-0346 | LT1031DCH | 10858 | 1826-1429 |
| LM308BH | 03406 | 1820-0478 | LM358CAH | 03406 | 1826-1473 | LT1032CN | 10858 | 1820-4311 |
| LM308BN | 03406 | 1826-0172 | LM35CZ | 03406 | 1826-1365 | LT1033CK | 10858 | 1826-1585 |
| LM309H | 03406 | 1820-0429 | LM35DM | 03406 | 1826-2261 | LT1033CT | 10858 | 1826-1962 |
| LM309H SELECTED | 03406 | 1826-0265 | LM35DZ | 03406 | 1826-1816 | LT1036CT | 10858 | 1826-2076 |
| LM309K | 03406 | 1820-0430 | LM35DZ OPT. J61Z | 03406 | 1826-2245 | LT1037CH | 10858 | 1826-1371 |
| LM310H | 03406 | 1826-0021 | LM360J | 03406 | 1826-1640 | LT1037CN8 | 10858 | 1826-1317 |
| LM310H SELECTED | 03406 | 1826-0354 | LM360N | 03406 | 1826-0638 | LT1038CK | 10858 | 1826-1982 |
| LM310H SELECTED | 03406 | 1826-0515 | LM3611H-46 | 03406 | 1826-0375 | LT1039CN | 10858 | 1820-4887 |
| LM310J-8 | 03406 | 1826-0947 | LM361H | 03406 | 1826-0272 | LT1039N-16 | 10858 | 1820-5916 |
| LM311H | 03406 | 1826-0208 | LM361N | 03406 | 1826-0210 | LT1054CN8 | 10858 | 1826-2193 |
| LM311H | 03406 | 1826-0026 | LM377N | 03406 | 1826-0348 | LT1054CS8 | 10858 | 1826-2073 |
| LM311H | 03406 | 1826-1113 | LM3 | | | | | |

| Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N |
|-----------------------|-------|-----------|-------------|-------|-----------|-------------|-------|-----------|
| LT1180CS | 10858 | 1820-7662 | MC1004P | 02037 | 1820-0142 | MC10189L | 02037 | 1820-2842 |
| LT317AT | 10858 | 1826-1403 | MC100H640FN | 02037 | 1820-7000 | MC10189P | 02037 | 1820-2385 |
| LT318AN8 (SELECTED) | 10858 | 1826-1265 | MC100R/M26B | 12253 | 1826-2108 | MC10189P | 02037 | 1820-2450 |
| LT337AK | 10858 | 1826-1395 | MC1010L | 02037 | 1820-1990 | MC1018P | 02037 | 1820-0144 |
| LT337AT | 10858 | 1826-1670 | MC1010P | 02037 | 1820-2517 | MC10192FN | 02037 | 1820-5604 |
| LT338AK | 10858 | 1826-1396 | MC1010L1 | 02037 | 1820-2834 | MC10192L | 02037 | 1820-3620 |
| LT350AT | 10858 | 1826-1216 | MC1010P | 02037 | 1820-0801 | MC10192P | 02037 | 1820-4438 |
| LTC1044CN8 | 10858 | 1826-1529 | MC1010L2 | 02037 | 1820-2835 | MC10194P | 02037 | 1820-2840 |
| LTC1045CN | 10858 | 1820-6396 | MC1010P | 02037 | 1820-0802 | MC10195L | 02037 | 1820-2843 |
| LTC1052CJ | 10858 | 1826-1562 | MC1010J | 02037 | 1820-1831 | MC10195P | 02037 | 1820-1685 |
| LTC1062CN8 | 10858 | 1826-1777 | MC1010J3P | 02037 | 1820-1686 | MC10197L | 02037 | 1820-2844 |
| LTC1064-LCN | 10858 | 1826-2255 | MC1010P | 02037 | 1820-5603 | MC10197P | 02037 | 1820-2023 |
| LTC1090ACN | 10858 | 1826-2057 | MC1010L4 | 02037 | 1820-2836 | MC10198L | 02037 | 1820-2376 |
| M1403A | 03811 | 1820-1579 | MC1010P | 02037 | 1820-1400 | MC1020P | 02037 | 1820-0212 |
| M1404A | 03811 | 1820-0763 | MC1010L5 | 02037 | 1820-2837 | MC10210L | 02037 | 1820-1830 |
| M2064-33CNL UNPRGMD | 04092 | 1820-5496 | MC1010P | 02037 | 1820-0803 | MC10210P | 02037 | 1820-2495 |
| M2064-70CNL68 UNPRGMD | 03794 | 1820-6606 | MC1010L6 | 02037 | 1820-2838 | MC10211L | 02037 | 1820-2845 |
| M3020-70J2C68 | 03794 | 1820-6607 | MC1010P | 02037 | 1820-0804 | MC10211P | 02037 | 1820-1842 |
| MSK1164NAP-15 | 08779 | 1818-3059 | MC1010L7 | 02037 | 1820-2839 | MC10212L | 02037 | 1820-1832 |
| MSK1164NAP-15 | 08779 | 1818-3005 | MC1010T | 02037 | 1820-0805 | MC10212P | 02037 | 1820-1950 |
| MSM21C68P-U5 | 08779 | 1818-4236 | MC10109L | 02037 | 1820-2846 | MC10216FN | 02037 | 1820-6509 |
| MSM27C101JK-12 | 08779 | 1818-4941 | MC10109P | 02037 | 1820-0806 | MC10216L | 02037 | 1820-1320 |
| MSM27C101JK-15 | 08779 | 1818-4673 | MC1010P | 02037 | 1820-0145 | MC10216P | 02037 | 1820-1224 |
| MSM27C101K-12 | 08779 | 1818-4592 | MC10110P | 02037 | 1820-0807 | MC1022P | 02037 | 1820-0272 |
| MSM27C101K-15 | 08779 | 1818-4486 | MC10111P | 02037 | 1820-0808 | MC10231L | 02037 | 1820-2516 |
| MSM27C102J | 08779 | 1818-4497 | MC10113L | 02037 | 1820-1882 | MC10231P | 02037 | 1820-1225 |
| MSM27C102K-15 | 08779 | 1818-4590 | MC10113P | 02037 | 1820-2508 | MC1023P | 02037 | 1820-0157 |
| MSM27C102K-2 | 08779 | 1818-4387 | MC10114P | 02037 | 1820-2324 | MC1024P | 02037 | 1820-0578 |
| MSM27C202K-12 | 08779 | 1818-4749 | MC10115L | 02037 | 1820-1945 | MC1026P | 02037 | 1820-0252 |
| MSM27C402K-12 | 08779 | 1818-4952 | MC10115P | 02037 | 1820-0809 | MC1027P | 02037 | 1820-0143 |
| MSM27C512AK-15 | 08779 | 1818-4745 | MC10115P | 02037 | 1820-3666 | MC1030P | 02037 | 1820-0200 |
| MSM4256AL-15 | 08779 | 1818-4050 | MC10116FN | 02037 | 1820-4957 | MC10319L | 02037 | 1826-1731 |
| MSM4256S-12 | 08779 | 1818-3309 | MC10116L | 02037 | 1820-1308 | MC10321P | 02037 | 1826-2162 |
| MSM4256S-15 | 08779 | 1818-3310 | MC10116P | 02037 | 1820-0810 | MC1032P | 02037 | 1820-0581 |
| MSM4C264L-12 | 08779 | 1818-4109 | MC10116P | 02037 | 1820-4681 | MC1033P | 02037 | 1820-0276 |
| MSM4C264AL-15 | 08779 | 1818-4367 | MC10117L | 02037 | 1820-1946 | MC1034P | 02037 | 1820-0101 |
| MSM5165FP-70 | 08779 | 1818-4951 | MC10117P | 02037 | 1820-0811 | MC1035P | 02037 | 1820-0253 |
| MSM5165P-70 | 08779 | 1818-3990 | MC10118P | 02037 | 1820-0812 | MC10408P | 02037 | 1820-0473 |
| MSM5256AP-70 | 08779 | 1818-4744 | MC10119P | 02037 | 1820-0813 | MC10804L | 02037 | 1820-2409 |
| MSM5256BFP-70L | 08779 | 1818-4777 | MC10121L | 02037 | 1820-2840 | MC10807L | 02037 | 1820-4200 |
| MSM5256BFP-85L | 08779 | 1818-4599 | MC10121P | 02037 | 1820-0815 | MC10E016FN | 02037 | 1820-7310 |
| MAR-2 | 02739 | 1826-2059 | MC10123P | 02037 | 1820-2399 | MC10E011FN | 02037 | 1820-7649 |
| MAR-3 | 02739 | 1826-1768 | MC10124FN | 02037 | 1820-4958 | MC10E014FN | 02037 | 1820-7650 |
| MAR-4 | 02739 | 1826-2062 | MC10124L | 02037 | 1820-1173 | MC10E017FN | 02037 | 1820-7652 |
| MAR-6 | 02739 | 1826-2061 | MC10124P | 02037 | 1820-3124 | MC10E111FN | 02037 | 1820-6718 |
| MAR-8 | 02739 | 1826-2060 | MC10125FN | 02037 | 1820-4959 | MC10E112FN | 02037 | 1820-7684 |
| MAX232CPE | 11302 | 1820-7675 | MC10125L | 02037 | 1820-1052 | MC10E116FN | 02037 | 1820-7648 |
| MAX233CPP | 11302 | 1820-5445 | MC10125P | 02037 | 1820-3125 | MC10E122FN | 02037 | 1820-7646 |
| MAX235CPG | 11302 | 1820-7661 | MC10128L | 02037 | 1820-2400 | MC10E111FN | 02037 | 1820-6946 |
| MAX238CNG | 11302 | 1820-5813 | MC10129L | 02037 | 1820-2482 | MC10E182FN | 02037 | 1820-6719 |
| MAX238CWG | 11302 | 1820-6341 | MC10130L | 02037 | 1820-1944 | MC10E183FN | 02037 | 1820-7647 |
| MAX239CNG | 11302 | 1820-6717 | MC10130P | 02037 | 1820-0816 | MC10E154FN | 02037 | 1820-7685 |
| MAX240CMH | 11302 | 1820-6576 | MC10131FN | 02037 | 1820-4967 | MC10E158FN | 02037 | 1820-7642 |
| MAX4193CPA | 11302 | 1826-1743 | MC10131P | 02037 | 1820-0817 | MC10E165I | 02037 | 1826-2103 |
| MAX630CSA | 11302 | 1826-2104 | MC10132P | 02037 | 1820-2476 | MC10E166FN | 02037 | 1820-7644 |
| MAX634CPA | 11302 | 1826-1717 | MC10133L | 02037 | 1820-0818 | MC10E167FN | 02037 | 1820-7686 |
| MAX374CPA | 11302 | 1826-2260 | MC10133P | 02037 | 1820-2475 | MC10E171FN | 02037 | 1820-7653 |
| MAX666CPA | 11302 | 1826-2256 | MC10134L | 02037 | 1820-0819 | MC10H016FN | 02037 | 1820-6713 |
| MAX691CP | 11302 | 1820-7268 | MC10135L | 02037 | 1820-0820 | MC10H016L | 02037 | 1820-3102 |
| MAX691CWE | 11302 | 1820-6177 | MC10135P | 02037 | 1820-4080 | MC10H013P | 02037 | 1820-4159 |
| MAX693CWE | 11302 | 1826-2064 | MC10136FN | 02037 | 1820-4960 | MC10H010P | 02037 | 1820-3686 |
| MAX694CPA | 11302 | 1826-2106 | MC10136L | 02037 | 1820-0821 | MC10H0101FN | 02037 | 1820-7260 |
| MAX8211CPA-2 | 11302 | 1826-2212 | MC10136P | 02037 | 1820-3126 | MC10H011P | 02037 | 1820-2891 |
| MAX8212CPA | 11302 | 1826-2030 | MC10137L | 02037 | 1820-0822 | MC10H012FN | 02037 | 1820-5605 |
| MB1840 | 06344 | 1820-7015 | MC10138F | 02037 | 1820-7654 | MC10H012P | 02037 | 1820-2823 |
| MB4107 | 06344 | 1826-1408 | MC10138L | 02037 | 1820-1383 | MC10H013FN | 02037 | 1820-6867 |
| MB501LPF | 06344 | 1820-6987 | MC10139P | 02037 | 1820-0102 | MC10H013P | 02037 | 1820-2962 |
| MB503PF | 06344 | 1820-6954 | MC10141L | 02037 | 1820-0825 | MC10H014FN | 02037 | 1820-5606 |
| MB504L | 06344 | 1820-6955 | MC10141P | 02037 | 1820-3127 | MC10H014P | 02037 | 1820-3337 |
| MB506-DIP-8 | 06344 | 1820-5276 | MC10141P | 02037 | 1820-0213 | MC10H015FN | 02037 | 1820-6521 |
| MB506PF | 06344 | 1820-7613 | MC10153L | 02037 | 1820-2507 | MC10H015P | 02037 | 1820-2822 |
| MB7118HZ | 06344 | 1816-1630 | MC10153P | 02037 | 1820-2847 | MC10H016P | 02037 | 1820-3918 |
| MB7124HMP | 06344 | 1816-1712 | MC10158L | 02037 | 1820-1993 | MC10H017FN | 02037 | 1820-2956 |
| MB7142H2 | 06344 | 1816-1695 | MC10158P | 02037 | 1820-3128 | MC10H017P | 02037 | 1820-6615 |
| MB7144HZ | 06344 | 1816-1569 | MC10159L | 02037 | 1820-2347 | MC10H019FN | 02037 | 1820-2900 |
| MB8118-12P | 06344 | 1818-1775 | MC10159P | 02037 | 1820-2821 | MC10H019P | 02037 | 1820-3701 |
| MB8118-15P | 06344 | 1818-1776 | MC10159P | 02037 | 1820-0180 | MC10H0113P | 02037 | 1820-6780 |
| MB811AZ | 06344 | 1820-6384 | MC10160L | 02037 | 1820-0826 | MC10H015FN | 02037 | 1820-3339 |
| MB81256-12P | 06344 | 1818-3307 | MC10160P | 02037 | 1820-4132 | MC10H015P | 02037 | 1820-3461 |
| MB81256-15P | 06344 | 1818-3308 | MC10161L | 02037 | 1820-2504 | MC10H016FN | 02037 | 1820-5607 |
| MB81257-12 | 06344 | 1818-3308 | MC10161P | 02037 | 1820-0827 | MC10H016L | 02037 | 1820-3075 |
| MB81257-15 | 06344 | 1818-3389 | MC10162L | 02037 | 1820-2067 | MC10H016P | 02037 | 1820-2848 |
| MB8128-15P | 06344 | 1818-1877 | MC10162P | 02037 | 1820-0828 | MC10H017FN | 02037 | 1820-6520 |
| MB81164-12PV | 06344 | 1818-4103 | MC10163L | 02037 | 1820-2503 | MC10H017P | 02037 | 1820-3338 |
| MB8167A-55P | 06344 | 1818-3470 | MC10163P | 02037 | 1820-2421 | MC10H018P | 02037 | 1820-6735 |
| MB8168A-35P | 06344 | 1818-3222 | MC10164L | 02037 | 1820-0829 | MC10H019P | 02037 | 1820-3339 |
| MB8169A-25P | 06344 | 1818-4024 | MC10164P | 02037 | 1820-3129 | MC10H0121P | 02037 | 1820-3340 |
| MB81C71A-25P | 06344 | 1818-4297 | MC10165L | 02037 | 1820-2502 | MC10H0123FN | 02037 | 1820-6714 |
| MB81C78A-35P | 06344 | 1818-4243 | MC10165P | 02037 | 1820-2449 | MC10H0123P | 02037 | 1820-4197 |
| MB81C78A-35PSK | 06344 | 1818-4134 | MC10166L | 02037 | 1820-2323 | MC10H0124FN | 02037 | 1820-6524 |
| MB81C79A-45Z | 06344 | 1818-3928 | MC10166P | 02037 | 1820-2381 | MC10H0124L | 02037 | 1820-3521 |
| MB8264A-12P | 06344 | 1818-3166 | MC10168P | 02037 | 1820-2451 | MC10H0124P | 02037 | 1820-4081 |
| MB8287-25 | 06344 | 1818-4697 | MC10169P | 02037 | 1820-0140 | MC10H0125P | 02037 | 1820-5390 |
| MB8464-15L RELAXED | 06344 | 1818-4042 | MC10170L | 02037 | 1820-2501 | MC10H0125L | 02037 | 1820-3522 |
| MB8464-10LPF | 06344 | 1818-4272 | MC10170P | 02037 | 1820-2477 | MC10H0125P | 02037 | 1820-4079 |
| MB86022PF | 06344 | 1826-2262 | MC10171L | 02037 | 1820-2500 | MC10H0130P | 02037 | 1820-2860 |
| MB87030CR | 06344 | 1820-5366 | MC10171P | 02037 | 1820-2420 | MC10H0131FN | 02037 | 1820-5629 |
| MBM10415AHZ | 06344 | 181 | | | | | | |

| Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N |
|-------------|-------|-----------|---------------------|-------|-----------|-------------|-------|-----------|
| MC10H173P | 02037 | 1820-4319 | MC140b9UBCP | 02037 | 1820-1505 | MC14553BCP | 02037 | 1820-1479 |
| MC10H174FN | 02037 | 1820-6872 | MC14049UBCP | 02037 | 1820-1746 | MC14555BCP | 02037 | 1820-2050 |
| MC10H174L | 02037 | 1820-3342 | MC140b0U5 | 02037 | 1826-0718 | MC14556BCP | 02037 | 1820-1412 |
| MC10H174P | 02037 | 1820-3831 | MC140b0U6 | 02037 | 1826-1069 | MC14557BCP | 02037 | 1820-2344 |
| MC10H175P | 02037 | 1820-3576 | MC14050BCP | 02037 | 1820-1521 | MC14559BCP | 02037 | 1820-1722 |
| MC10H176FN | 02037 | 1820-7263 | MC14050BCP | 02037 | 1820-1976 | MC14560BCP | 02037 | 1820-1850 |
| MC10H176L | 02037 | 1820-3296 | MC14051BCD | 02037 | 1826-1607 | MC14561BCP | 02037 | 1820-2033 |
| MC10H176P | 02037 | 1820-3699 | MC14051BCL | 02037 | 1820-1547 | MC14562BCP | 02037 | 1820-2144 |
| MC10H179FN | 02037 | 1820-7306 | MC14051BCP | 02037 | 1820-3719 | MC14566BCP | 02037 | 1820-1588 |
| MC10H179P | 02037 | 1820-4322 | MC14051BCP | 02037 | 1820-2013 | MC14568BCP | 02037 | 1826-0599 |
| MC10H180P | 02037 | 1820-4321 | MC14052BCL | 02037 | 1820-1546 | MC14569BCL | 02037 | 1820-2571 |
| MC10H181FN | 02037 | 1820-7307 | MC14052BCL SELECTED | 02037 | 1820-3866 | MC14569BCP | 02037 | 1820-2383 |
| MC10H181P | 02037 | 1820-4320 | MC14052BCP | 02037 | 1826-0486 | MC1456CG | 02037 | 1826-0003 |
| MC10H186FN | 02037 | 1820-7700 | MC14053BCD | 02037 | 1826-1861 | MC14572UBCP | 02037 | 1820-1657 |
| MC10H186P | 02037 | 1820-3577 | MC14053BCP | 02037 | 1826-0501 | MC14581BCP | 02037 | 1820-1666 |
| MC10H188P | 02037 | 1820-3702 | MC14066BCP | 02037 | 1826-0502 | MC14582BCP | 02037 | 1820-1659 |
| MC10H189P | 02037 | 1820-3703 | MC14066BD | 02037 | 1826-1782 | MC14583BCP | 02037 | 1820-1389 |
| MC10H209FN | 02037 | 1820-6528 | MC14068BCP | 02037 | 1820-1931 | MC14584BCP | 02037 | 1820-2019 |
| MC10H209L | 02037 | 1820-3435 | MC14069UBCL | 02037 | 1820-1592 | MC14585BCP | 02037 | 1820-1340 |
| MC10H209P | 02037 | 1820-4323 | MC14069UBCP | 02037 | 1820-2014 | MC1458CP1 | 02037 | 1826-0142 |
| MC10H210L | 02037 | 1820-3341 | MC14069UBD | 02037 | 1820-5778 | MC1458D | 02037 | 1826-2078 |
| MC10H210P | 02037 | 1820-2963 | MC1406L | 02037 | 1826-0155 | MC1458G | 02037 | 1826-0111 |
| MC10H211P | 02037 | 1820-3400 | MC14070BCL | 02037 | 1820-1908 | MC1458P1 | 02037 | 1826-0139 |
| MC10H330P | 02037 | 1820-5074 | MC14070BCP | 02037 | 1820-2015 | MC1458SP1 | 02037 | 1826-0866 |
| MC10H332P | 02037 | 1820-4199 | MC14071BCP | 02037 | 1820-1970 | MC1458U | 02037 | 1826-0420 |
| MC10H350FN | 02037 | 1820-5833 | MC14071CPC | 02037 | 1820-1388 | MC1460R | 02037 | 1826-0990 |
| MC10H350P | 02037 | 1820-4204 | MC14073BCL | 02037 | 1820-1910 | MC1463R | 02037 | 1826-0277 |
| MC10H351FN | 02037 | 1820-7645 | MC14075BCL | 02037 | 1820-1909 | MC14681ACP | 02037 | 1826-032 |
| MC10H423P | 02037 | 1820-4740 | MC14075BCP | 02037 | 1820-2091 | MC14681 | 02037 | 1826-1504 |
| MC10H424P | 02037 | 1820-4201 | MC14076BCP | 02037 | 1820-2220 | MC1468R | 02037 | 1826-0140 |
| MC10H600FP | 02037 | 1820-7636 | MC14077BCL | 02037 | 1820-1907 | MC1469G | 02037 | 1826-0006 |
| MC10H601FN | 02037 | 1820-7297 | MC14078BCP | 02037 | 1820-1930 | MC1469R | 02037 | 1826-0024 |
| MC10H602FP | 02037 | 1820-7690 | MC14081BCP | 02037 | 1820-2037 | MC1488L | 02037 | 1820-0509 |
| MC10H603FN | 02037 | 1820-7637 | MC14082BCP | 02037 | 1820-2090 | MC1488P | 02037 | 1820-3322 |
| MC10H611FN | 02037 | 1820-7334 | MC1408L-6 | 02037 | 1826-028 | MC1489AD | 02037 | 1820-5329 |
| MC10H642FP | 02037 | 1820-7299 | MC1408L-8 | 02037 | 1826-0188 | MC1489AD | 02037 | 1820-7602 |
| MC12002P | 02037 | 1826-0598 | MC14093BCL | 02037 | 1820-1936 | MC1489AL | 02037 | 1820-0990 |
| MC12009FN | 02037 | 1820-7232 | MC1413D | 02037 | 1820-6412 | MC1489AP | 02037 | 1820-3321 |
| MC12009L | 02037 | 1820-3935 | MC1414P | 02037 | 1826-0051 | MC1489L | 02037 | 1820-0510 |
| MC12009P | 02037 | 1820-2934 | MC14174BCP | 02037 | 1820-2258 | MC1490P | 02037 | 1826-1946 |
| MC12011P | 02037 | 1820-2935 | MC14175BCP | 02037 | 1820-2279 | MC1494L | 02037 | 1826-0036 |
| MC12013L | 02037 | 1820-1888 | MC14194BCP | 02037 | 1820-3587 | MC1495D | 02037 | 1826-2111 |
| MC12015P | 02037 | 1820-3646 | MC1420G | 02037 | 1826-0200 | MC1495L | 02037 | 1826-0437 |
| MC12018P | 02037 | 1820-3964 | MC1431P | 02037 | 1820-0160 | MC1496D | 02037 | 1826-1621 |
| MC12022BDR2 | 02037 | 1820-7311 | MC1433G | 02037 | 1820-0316 | MC1496G | 02037 | 1826-0247 |
| MC12040FN | 02037 | 1826-1875 | MC1433L | 02037 | 1820-0181 | MC1496L | 02037 | 1826-0023 |
| MC12040FN | 02037 | 1826-1906 | MC1433P | 02037 | 1820-0317 | MC1496N | 02037 | 1826-1095 |
| MC12040L | 02037 | 1820-1344 | MC1436G | 02037 | 1826-0343 | MC1505L | 02037 | 1826-0105 |
| MC12061P | 02037 | 1820-1977 | MC1436U | 02037 | 1826-1171 | MC1510G | 02037 | 1826-0002 |
| MC12073P | 02037 | 1820-6448 | MC1437L | 02037 | 1826-0019 | MC1514L | 02037 | 1826-0125 |
| MC12074P | 02037 | 1820-6973 | MC1438R | 02037 | 1826-0060 | MC1515G | 02037 | 1826-0050 |
| MC12090FN | 02037 | 1820-7267 | MC1439G | 02037 | 1820-0201 | MC1516D | 02037 | 1826-0103 |
| MC12090L | 02037 | 1820-3485 | MC1439L | 02037 | 1820-0022 | MC1516G | 02037 | 1826-0028 |
| MC1306P | 02037 | 1826-0293 | MC1441L0P | 02037 | 1820-3487 | MC1519G | 02037 | 1826-0037 |
| MC1350D | 02037 | 1826-2211 | MC1441L10P | 02037 | 1820-2113 | MC1519L | 02037 | 1826-0014 |
| MC1350P | 02037 | 1826-0159 | MC1441L11P | 02037 | 1820-1779 | MC1519L | 02037 | 1826-1758 |
| MC1355P | 02037 | 1826-0382 | MC1441L2P | 02037 | 1820-2166 | MC1648F | 02037 | 1826-1905 |
| MC1372P | 02037 | 1826-0903 | MC1441L6P | 02037 | 1820-5926 | MC1648L | 02037 | 1820-1119 |
| MC1377FN | 02037 | 1826-2243 | MC1443L | 02037 | 1826-0431 | MC1648P | 02037 | 1820-1108 |
| MC1377P | 02037 | 1826-1795 | MC14447P | 02037 | 1826-0884 | MC1650L | 02037 | 1820-0919 |
| MC14001BCL | 02037 | 1820-2803 | MC1445L | 02037 | 1826-0334 | MC1656P | 02037 | 1826-0509 |
| MC14001BCP | 02037 | 1820-1745 | MC14490P | 02037 | 1820-5213 | MC1660L | 02037 | 1820-0790 |
| MC14001UBCP | 02037 | 1820-1499 | MC14508BCP | 02037 | 1820-1947 | MC1662L | 02037 | 1820-0796 |
| MC14002BCP | 02037 | 1820-2079 | MC14500BCP | 02037 | 1820-3360 | MC1664L | 02037 | 1820-0795 |
| MC14002UBCP | 02037 | 1820-1511 | MC14501UBCP | 02037 | 1820-1079 | MC1670L | 02037 | 1820-0794 |
| MC14006BCP | 02037 | 1820-2086 | MC14502BAL | 02037 | 1820-1635 | MC1678L | 02037 | 1820-2664 |
| MC14007UBCP | 02037 | 1820-1503 | MC14502BCP | 02037 | 1820-1385 | MC1692L | 02037 | 1820-0920 |
| MC14008BCL | 02037 | 1820-1525 | MC14503BCP | 02037 | 1820-2257 | MC1694L | 02037 | 1820-1334 |
| MC14008BCP | 02037 | 1820-1955 | MC14504BCP | 02037 | 1820-2326 | MC1697P | 02037 | 1820-1852 |
| MC14011BCL | 02037 | 1820-2576 | MC14506BCP | 02037 | 1820-1386 | MC1723L | 02037 | 1826-0409 |
| MC14011BCP | 02037 | 1820-1747 | MC14508BCL | 02037 | 1820-1693 | MC1733G | 02037 | 1826-1175 |
| MC14011UBCP | 02037 | 1820-1500 | MC14508BCP | 02037 | 1820-1959 | MC1741SCG | 02037 | 1826-0302 |
| MC14012BCP | 02037 | 1820-1960 | MC145106P | 02037 | 1826-1876 | MC1741SCP1 | 02037 | 1826-0254 |
| MC14012UBCP | 02037 | 1820-1507 | MC14510BCP | 02037 | 1820-1189 | MC1776CD | 02037 | 1826-1212 |
| MC14013BCP | 02037 | 1820-1497 | MC14511BCP | 02037 | 1820-1413 | MC1800P | 02037 | 1820-0985 |
| MC14013BCP | 02037 | 1820-1963 | MC14511BCP | 02037 | 1820-1957 | MC1801P | 02037 | 1820-0411 |
| MC14011BCP | 02037 | 1820-1514 | MC14512BCP | 02037 | 1820-1241 | MC1805P | 02037 | 1820-0454 |
| MC14015BCL | 02037 | 1820-2055 | MC14513BCL | 02037 | 1820-2716 | MC1806P | 02037 | 1820-0273 |
| MC14015BCP | 02037 | 1820-1176 | MC14513BCP | 02037 | 1820-2462 | MC1808P | 02037 | 1820-0274 |
| MC14015BCP | 02037 | 1820-1502 | MC145145P | 02037 | 1820-2897 | MC1809P | 02037 | 1820-1137 |
| MC14015BCP | 02037 | 1820-2008 | MC145146P | 02037 | 1820-3405 | MC1810P | 02037 | 1820-0238 |
| MC14016BCP | 02037 | 1820-1504 | MC14514BCP | 02037 | 1820-1683 | MC1812P | 02037 | 1820-0418 |
| MC14016BCP | 02037 | 1820-1958 | MC145151P | 02037 | 1820-2879 | MC1814P | 02037 | 1820-0665 |
| MC14017BCL | 02037 | 1820-2805 | MC145152P | 02037 | 1820-2880 | MC2257L | 02037 | 1820-1156 |
| MC14017BCP | 02037 | 1820-1508 | MC14520BCP | 02037 | 1820-1329 | MC2259L | 02037 | 1820-1157 |
| MC14018BCP | 02037 | 1820-2084 | MC14516BCL | 02037 | 1820-1899 | MC3001P | 02037 | 1820-0141 |
| MC14020BCP | 02037 | 1820-1494 | MC14516BCP | 02037 | 1820-1114 | MC3002P | 02037 | 1820-0239 |
| MC14021BCP | 02037 | 1820-2031 | MC14517BCP | 02037 | 1820-1815 | MC3003P | 02037 | 1820-0205 |
| MC14022BAL | 02037 | 1820-2277 | MC14518BCL | 02037 | 1820-1591 | MC3006P | 02037 | 1820-0204 |
| MC14022BCL | 02037 | 1820-1527 | MC14518BCP | 02037 | 1820-1122 | MC3022P | 02037 | 1820-0617 |
| MC14023BCP | 02037 | 1820-1961 | MC14519BCP | 02037 | 1820-1387 | MC3025P | 02037 | 1820-0604 |
| MC14023UBCP | 02037 | 1820-1509 | MC14520BCP | 02037 | 1820-1900 | MC3026P | 02037 | 1820-0140 |
| MC14024BCP | 02037 | 1820-1506 | MC14521BCP | 02037 | 1820-1150 | MC3029P | 02037 | 1820-0700 |
| MC14025BCP | 02037 | 1820-2804 | MC14522BAL | 02037 | 1820-2702 | MC3060P | 02037 | 1820-0449 |
| MC14025BCP | 02037 | 1820-1965 | MC14522BCP | 02037 | 1820-1181 | MC3061P | 02037 | 1820-0609 |
| MC14025UBCP | 02037 | 1820-1498 | MC14522P | 02037 | 1820-1175 | MC3062P | 02037 | 1820-0451 |
| MC14027BCP | 02037 | 1820-1496 | MC14526BCP | 02037 | 1820-1328 | MC3103L | 02037 | 1820-1375 |
| MC14027BCP | 02037 | 1820-1964 | MC14526BDW | 02037 | 1820-5920 | MC3242AP | 02037 | 1820-274 |

| Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N |
|----------------------|-------|-----------|--------------|-------|-----------|-----------------|-------|-----------|
| MC34064P-5 | 02037 | 1826-1973 | MC74HC243N | 02037 | 1820-3189 | MCM2018AN35 | 02037 | 1818-4233 |
| MC34071D | 02037 | 1826-1776 | MC74HC244ADW | 02037 | 1820-5551 | MCM2018AN55 | 02037 | 1818-3502 |
| MC34072AU | 02037 | 1826-1543 | MC74HC244N | 02037 | 1820-3297 | MCM4027AC2 | 02037 | 1818-0317 |
| MC34072D TAPE & REEL | 02037 | 1826-1912 | MC74HC253D | 02037 | 1820-5753 | MCM1180J20 | 02037 | 1818-k41 |
| MC34072P | 02037 | 1826-1533 | MC74HC253N | 02037 | 1820-3672 | MCM601256AP-10 | 02037 | 1818-4686 |
| MC34074AL | 02037 | 1826-1222 | MC74HC257D | 02037 | 1820-5754 | MCM6206NJ35 | 02037 | 1818-w07 |
| MC34074D | 02037 | 1826-1909 | MC74HC257N | 02037 | 1820-3191 | MCM6208J15 | 02037 | 1818-w699 |
| MC34074P | 02037 | 1826-1534 | MC74HC266N | 02037 | 1820-3192 | MCM62350J22 | 02037 | 1818-w876 |
| MC34081AD | 02037 | 1826-2083 | MC74HC273DW | 02037 | 1820-5808 | MCM626WDNJJ35 | 02037 | 1818-w559 |
| MC34081AP | 02037 | 1826-1581 | MC74HC273N | 02037 | 1820-3399 | MCM626WP45 | 02037 | 1818-h257 |
| MC34081P | 02037 | 1826-1544 | MC74HC280N | 02037 | 1820-3193 | MCM626WP45 | 02037 | 1818-h263 |
| MC34082AP | 02037 | 1826-1582 | MC74HC299N | 02037 | 1820-3546 | MCM626WP55 | 02037 | 1818-h111 |
| MC34082P | 02037 | 1826-1796 | MC74HC356N | 02037 | 1820-4608 | MCM626WP-35 | 02037 | 1818-h197 |
| MC34084AP | 02037 | 1826-1652 | MC74HC373N | 02037 | 1820-2998 | MCM6268P25 | 02037 | 1818-h129 |
| MC34084P | 02037 | 1826-1422 | MC74HC377N | 02037 | 1820-3082 | MCM6270J20 | 02037 | 1818-h589 |
| MC34085P | 02037 | 1826-2065 | MC74HC4002N | 02037 | 1820-3196 | MCM6288P-22 | 02037 | 1818-h130 |
| MC3410CL | 02037 | 1826-0462 | MC74HC4017D | 02037 | 1820-7664 | MCM6288PJ5 | 02037 | 1818-h128 |
| MC3410CP | 02037 | 1826-0529 | MC74HC4017N | 02037 | 1820-3683 | MCM6290J25 | 02037 | 1818-h503 |
| MC34129D (SELECTED) | 02037 | 1826-1814 | MC74HC4020N | 02037 | 1820-3197 | MCM62980J15 | 02037 | 1818-h80 |
| MC34182D | 02037 | 1826-2116 | MC74HC4024N | 02037 | 1820-3198 | MCM62981J15 | 02037 | 1818-h189 |
| MC34184D | 02037 | 1826-2124 | MC74HC4040N | 02037 | 1820-3199 | MCM62990FN-20 | 02037 | 1818-h908 |
| MC3420P | 02037 | 1826-0526 | MC74HC4051N | 02037 | 1820-6965 | MCM6572L | 02037 | 1818-0336 |
| MC3423P1 | 02037 | 1826-0468 | MC74HC4052N | 02037 | 1820-4574 | MCM6581P | 02037 | 1818-0700 |
| MC3425P1 | 02037 | 1826-1485 | MC74HC4053DW | 02037 | 1820-6972 | MCM68764C | 02037 | 1818-1785 |
| MC3431P | 02037 | 1826-0360 | MC74HC4060N | 02037 | 1820-3200 | MCM68766C | 02037 | 1818-1822 |
| MC3440AP | 02037 | 1820-1522 | MC74HC4066D | 02037 | 1820-5788 | MCM68766C-30 | 02037 | 1818-3880 |
| MC3441AP | 02037 | 1820-1814 | MC74HC4075N | 02037 | 1820-3201 | MCM68766C-35 | 02037 | 1818-3172 |
| MC3443AP | 02037 | 1820-1687 | MC74HC4078N | 02037 | 1820-4232 | MCM68A10P | 02037 | 1818-0701 |
| MC3446AP | 02037 | 1820-1689 | MC74HC412N | 02037 | 1820-3169 | MCM68A10S | 02037 | 1818-0135 |
| MC3446N | 01698 | 1820-3329 | MC74HC4316D | 02037 | 1820-5708 | MCM68B10P | 02037 | 1818-1751 |
| MC3446N | 01698 | 1820-5059 | MC74HC4351N | 02037 | 1820-4705 | MD74HCCT373RC | 09161 | 1820-3147 |
| MC3447P3 | 02037 | 1820-2424 | MC74HC4511N | 02037 | 1820-4056 | MD74SC241AC | 09161 | 1820-2796 |
| MC3447P3 | 02037 | 1820-2461 | MC74HC4514N | 02037 | 1820-3202 | MD74SC244AC | 09161 | 1820-2943 |
| MC3448D | 02037 | 1820-4892 | MC74HC4538N | 02037 | 1820-3203 | MD74SC245AC | 09161 | 1820-2866 |
| MC3448L | 02037 | 1820-2058 | MC74HC4539N | 02037 | 1820-4337 | MP10ACN | 03406 | 1826-1580 |
| MC3450P | 02037 | 1820-2157 | MC74HC51N | 02037 | 1820-3396 | MP10CCM | 03406 | 1826-1666 |
| MC3452P | 02037 | 1820-2158 | MC74HC533N | 02037 | 1820-3194 | MP10CN | 03406 | 1826-1250 |
| MC3453P | 02037 | 1820-2569 | MC74HC534N | 02037 | 1820-3195 | MP4128F3 DAP 00 | 08779 | 0960-0790 |
| MC3459CP | 02037 | 1820-1786 | MC74HC540N | 02037 | 1820-4569 | MP5CN | 03406 | 1826-1786 |
| MC3460P | 02037 | 1820-1810 | MC74HC541DW | 02037 | 1820-5563 | MPF4000B | 02037 | 1826-0198 |
| MC3467P | 02037 | 1826-0474 | MC74HC58N | 02037 | 1820-3788 | MH0007CH | 03406 | 1820-0832 |
| MC3468P | 02037 | 1826-0475 | MC74HC59N | 02037 | 1820-3344 | MH1M09A0J-10 | 08779 | 1818-4269 |
| MC3474P | 02037 | 1826-0945 | MC74HC597N | 02037 | 1820-4355 | MH1M36BJ-8 | 08779 | 1818-1728 |
| MC3476P | 02037 | 1826-0289 | MC74HC646N | 02037 | 1820-6218 | MH25636AJ-10 | 08779 | 1818-4591 |
| MC3486D | 02037 | 1820-7610 | MC74HC73N | 02037 | 1820-7660 | MHW592 | 02037 | 1813-0138 |
| MC3486P | 02037 | 1820-2144 | MC74HC74AD | 02037 | 1820-4966 | M2841D1P | 01590 | 1820-3410 |
| MC3487P | 02037 | 1820-2145 | MC74HC74N | 02037 | 1820-3081 | MK2302P | 04078 | 1816-0355 |
| MC4001P | 02037 | 1820-0639 | MC74HC85N | 02037 | 1820-3171 | MK41H79N-25 | 04078 | 1818-4874 |
| MC4002P | 02037 | 1820-0843 | MC74HC86N | 02037 | 1820-3007 | MK41H80N20 | 04078 | 1818-1498 |
| MC4006P | 02037 | 1820-0608 | MC74HC511N | 02037 | 1820-4586 | MK41LS0X12 | 04078 | 1818-4907 |
| MC4007P | 02037 | 1820-0724 | MC74HC640N | 02037 | 1820-4587 | MK4202Q-20 | 04078 | 1818-4740 |
| MC4008P | 02037 | 1820-0842 | MC7546P | 02037 | 1820-2208 | MK4501N-12 | 04078 | 1820-7370 |
| MC4010P | 02037 | 1820-0836 | MC7805CK | 02037 | 1826-0246 | MK4501N-15 | 04078 | 1820-4085 |
| MC4012P | 02037 | 1820-0607 | MC7805CT | 02037 | 1826-0144 | MK4801A1J-3 | 04078 | 1818-1114 |
| MC4015P | 02037 | 1820-0437 | MC7806CT | 02037 | 1826-0145 | MK4801A1J-70 | 04078 | 1818-3162 |
| MC4016P | 02037 | 1820-1183 | MC7808CT | 02037 | 1826-0146 | MK4801A1J-90 | 04078 | 1818-1372 |
| MC4018P | 02037 | 1820-1332 | MC7808CT | 02037 | 1826-1387 | MK4801AN-1 | 04078 | 1818-1214 |
| MC4022P | 02037 | 1820-1109 | MC7818CP | 02037 | 1826-0149 | MK4801AN-2 | 04078 | 1818-1960 |
| MC4024P | 02037 | 1820-0567 | MC7824CT | 02037 | 1826-1218 | MK4801AN-3 | 04078 | 1818-1178 |
| MC4038P | 02037 | 1820-0834 | MC78L05ACD | 02037 | 1826-1402 | MK4801AN-4 | 04078 | 1818-1066 |
| MC4044D | 02037 | 1826-1803 | MC78L05ACP | 02037 | 1826-0276 | MK4801AN-4 | 04078 | 1818-1967 |
| MC4044P | 02037 | 1820-0630 | MC78L08AC | 02037 | 1826-1870 | MK4801AN-90 | 04078 | 1818-1614 |
| MC41256A9B-10 | 00039 | 1818-4270 | MC78L08ACP | 02037 | 1826-1257 | MK4801AN-90 | 04078 | 1818-1162 |
| MC426P | 02037 | 1820-0844 | MC78L12ACD | 02037 | 1826-2202 | MK4801AP-2 | 04078 | 1818-2322 |
| MC54HC374J | 02037 | 1820-3565 | MC78L12ACP | 02037 | 1826-0275 | MK4802N-1 | 04078 | 1818-1718 |
| MC660P | 02037 | 1820-1520 | MC78L15ACP | 02037 | 1826-0274 | MK4802N-3 | 04078 | 1818-1643 |
| MC662P | 02037 | 1820-0288 | MC78L24CP | 02037 | 1826-1499 | MK4802B20-20 | 04078 | 1818-3605 |
| MC663P | 02037 | 1820-1519 | MC78M05CDT | 02037 | 1826-1734 | MK5007P | 04078 | 1820-1239 |
| MC666P | 02037 | 1820-0625 | MC78M05FCG | 02037 | 1826-0367 | MK5009N | 04078 | 1820-1123 |
| MC667P | 02037 | 1820-1606 | MC78M12CDT | 02037 | 1826-1736 | MK5009P | 04078 | 1820-2322 |
| MC668P | 02037 | 1820-1605 | MC78M15CT | 02037 | 1826-0464 | MK5025Q-10 | 04078 | 1820-6830 |
| MC670P | 02037 | 1820-2133 | MC7905CT | 02037 | 1826-0215 | MK5039N | 04078 | 1820-2310 |
| MC672P | 02037 | 1820-0287 | MC7906CT | 02037 | 1826-0294 | MK6036P | 04078 | 1820-0993 |
| MC6875L | 02037 | 1820-2036 | MC7908CT | 02037 | 1826-1993 | MK4401P | 12962 | 1820-6791 |
| MC6881P/MC3449P | 02037 | 1820-2165 | MC7912CT | 02037 | 1826-0344 | MLMC101A | 02037 | 1826-0567 |
| MC7250P | 02037 | 1820-0786 | MC7915CT | 02037 | 1826-0221 | MM2102AJ-6L | 03406 | 1818-1756 |
| MC7704P | 02037 | 1820-1004 | MC7915CT | 02037 | 1826-0214 | MM2102AN-4L | 03406 | 1818-0198 |
| MC774CT11N | 02037 | 1820-7213 | MC7915ACD | 02037 | 1826-0286 | MK2801J9S-07 | 03921 | 1818-4268 |
| MC774CT14DR2 | 02037 | 1820-7312 | MC7915ACG | 02037 | 1826-1783 | MM4503CD | 03406 | 1820-1357 |
| MC774CT511N | 02037 | 1820-6744 | MC7915ACP | 02037 | 1826-0496 | MM5006H | 03406 | 1820-0770 |
| MC774F14D | 02037 | 1820-6850 | MC7915SCP | 02037 | 1826-0285 | MM5035P | 03406 | 1820-2416 |
| MC774F21N | 02037 | 1820-6151 | MC7916SCP | 02037 | 1826-1281 | MM5050AH | 03406 | 1820-1237 |
| MC774FB03D | 02037 | 1820-6141 | MC7916CT | 02037 | 1826-0284 | MM5052 | 03406 | 1820-0717 |
| MC774FB03N | 02037 | 1820-7352 | MC815P | 02037 | 1820-0325 | MM5057N | 03406 | 1820-1162 |
| MC77HC00ON | 02037 | 1820-2922 | MC816P | 02037 | 1820-0106 | MM5057 | 03406 | 1820-0410 |
| MC77HC02AD | 02037 | 1820-5562 | MC817P | 02037 | 1820-0495 | MM5204Q | 03406 | 1820-1336 |
| MC77HC02N | 02037 | 1820-2924 | MC824P | 02037 | 1820-0324 | MM5241ABLN | 03406 | 1820-0061 |
| MC77HC03N | 02037 | 1820-3183 | MC830P | 02037 | 1820-0610 | MM5307ABN | 03406 | 1820-2001 |
| MC77HC107N | 02037 | 1820-5291 | MC831P | 02037 | 1820-0096 | MM5307N | 03406 | 1820-1318 |
| MC77HC109N | 02037 | 1820-3172 | MC832P | 02037 | 1820-0479 | MM5313N (75-) | 03406 | 1820-1364 |
| MC77HC110D | 02037 | 1820-5294 | MC835P | 02037 | 1820-0260 | MM5313N (76+) | 03406 | 1820-2126 |
| MC77HC112D | 02037 | 1820-7201 | MC838P | 02037 | 1820-0259 | MM5315 | 03406 | 1820-2040 |
| MC77HC126AN | 02037 | 1820-4458 | MC848P | 02037 | 1820-0094 | MM5824N | 03406 | 1820-5287 |
| MC77HC132AD | 02037 | 1820-4965 | MC858P | 02037 | 1820-0095 | MM58274NC | 03406 | 1820-3834 |
| MC77HC132N | 02037 | 1820-3174 | MC889P | 02037 | 1820-0323 | MM58274CV | 03406 | 1820-5024 |
| MC77HC137N | 02037 | 1820-4084 | MCLC1670 | 02037 | 1820-2297 | MM5837N | 03406 | 1820-2721 |
| MC77HC138N | 02037 | 1820-3079 | MC893P | 02037 | 1820-2296 | MM5837W | 03406 | 1820-1849 |
| MC77HC157N | 02037 | 1820-3177 | MC840P | 02037 | 1820-0087 | MM5873 | 02023 | 1820-184 |

| Desc. | Mfr. | H P P/N | Desc. | Mfr. | H P P/N | Desc. | Mfr. | H P P/N |
|-------------|-------|-----------|--------------------|-------|-----------|--------------------|-------|-----------|
| MM74C163N | 03406 | 1820-1493 | MM74HC7266N | 03406 | 1820-6564 | N8234W | 02910 | 1820-0542 |
| MM74C164N | 03406 | 1820-1559 | MM74HC75N | 03406 | 1820-3170 | N8243N | 02910 | 1820-0569 |
| MM74C165N | 03406 | 1820-1560 | MM74HC76N | 03406 | 1820-3463 | N8263N | 02910 | 1820-0507 |
| MM74C173N | 03406 | 1820-1190 | MM74HCT00N | 03406 | 1820-3664 | N8266N | 02910 | 1820-0506 |
| MM74C174N | 03406 | 1820-1466 | MM74HCT04N | 03406 | 1820-3629 | N8271N | 02910 | 1820-0989 |
| MM74C175N | 03406 | 1820-1562 | MM74HCT05N | 03406 | 1820-4601 | N8273N | 02910 | 1820-1045 |
| MM74C192N | 03406 | 1820-1575 | MM74HCT112N | 03406 | 1820-4947 | N8280N | 02910 | 1820-0322 |
| MM74C193N | 03406 | 1820-1561 | MM74HCT138N | 03406 | 1820-3847 | N8281N | 02910 | 1820-0400 |
| MM74C20N | 03406 | 1820-1626 | MM74HCT139N | 03406 | 1820-3796 | N8282N | 02910 | 1820-0536 |
| MM74C221J | 03406 | 1820-1612 | MM74HCT148PC | 03406 | 1820-6742 | N8288N | 02910 | 1820-0455 |
| MM74C221N | 03406 | 1820-1485 | MM74HCT155N | 03406 | 1820-6220 | N8290N | 02910 | 1820-0450 |
| MM74C240N | 03406 | 1820-2538 | MM74HCT157N | 03406 | 1820-4196 | N8291N | 02910 | 1820-0492 |
| MM74C240N | 03406 | 1820-2566 | MM74HCT166PC | 03406 | 1820-6743 | N829091F | 02910 | 1816-0728 |
| MM74C244N | 03406 | 1820-2537 | MM74HCT240N | 03406 | 1820-3630 | N82S115P | 02910 | 1816-0605 |
| MM74C30N | 03406 | 1820-1674 | MM74HCT241N | 03406 | 1820-3626 | N82S123N | 02910 | 1816-1032 |
| MM74C32N | 03406 | 1820-2223 | MM74HCT244N | 03406 | 1820-3456 | N82S129P | 02910 | 1816-1418 |
| MM74C373N | 03406 | 1820-2215 | MM74HCT244WM | 03406 | 1820-6307 | N82S131F | 02910 | 1816-1482 |
| MM74C374N | 03406 | 1820-2216 | MM74HCT245N | 03406 | 1820-3665 | N82S135F | 02910 | 1816-1613 |
| MM74C42N | 03406 | 1820-1735 | MM74HCT245M | 03406 | 1820-6306 | N82S137AN | 02910 | 1816-1475 |
| MM74C73N | 03406 | 1820-2605 | MM74HCT373N | 03406 | 1820-3849 | N82S141F | 02910 | 1816-1142 |
| MM74C74J | 03406 | 1820-1933 | MM74HCT373WM | 03406 | 1820-6308 | N82S141F | 02910 | 1816-1163 |
| MM74C74N | 03406 | 1820-1753 | MM74HCT374N | 03406 | 1820-3848 | N82S161 | 02910 | 1816-1564 |
| MM74C76N | 03406 | 1820-2600 | MM74HCT340WM | 03406 | 1820-5273 | N82S181F | 02910 | 1816-1160 |
| MM74C83J | 03406 | 1820-1937 | MM74HCT573N | 03406 | 1820-4147 | N82S181N | 02910 | 1816-1162 |
| MM74C83N | 03406 | 1820-2343 | MM74HCT688N | 03406 | 1820-3631 | N82S185P | 02910 | 1816-1054 |
| MM74C85N | 03406 | 1820-1806 | MM74HCU04N | 03406 | 1820-3008 | N82S191F | 02910 | 1816-1299 |
| MM74C86N | 03406 | 1820-2276 | MM80C059N | 03406 | 1820-1402 | N82S191N | 02910 | 1816-1517 |
| MM74C89N | 03406 | 1820-1392 | MM80C069N | 03406 | 1820-3545 | N82S191F | 02910 | 1816-1458 |
| MM74C901N | 03406 | 1820-1651 | MM80C077J | 03406 | 1820-1823 | N82S212N | 02910 | 1816-1577 |
| MM74C902N | 03406 | 1820-1652 | MM80C079N | 03406 | 1820-1266 | N82S270F | 02910 | 1816-1193 |
| MM74C903N | 03406 | 1820-1653 | MM80C098J | 03406 | 1820-1906 | N82S31N | 02910 | 1820-1980 |
| MM74C904N | 03406 | 1820-1654 | MM82C19N | 03406 | 1820-2413 | N82S33N | 02910 | 1820-1249 |
| MM74C905N | 03406 | 1820-1935 | MM88C29N | 03406 | 1820-2217 | N82S42N | 02910 | 1820-1073 |
| MM74C906N | 03406 | 1820-5419 | MM88C30N | 03406 | 1820-2218 | N82S50N | 02910 | 1820-1338 |
| MM74C906N | 03406 | 1820-1655 | MMH0026CL | 02037 | 1820-1288 | N82S62N | 02910 | 1820-1140 |
| MM74C907N | 03406 | 1820-1656 | MM376 | 00046 | 1813-0501 | N82S83N | 02910 | 1820-1467 |
| MM74C909N | 03406 | 1820-2275 | MMDACT1LCB-SI | 06861 | 1813-0132 | N82S90N | 02910 | 1820-1155 |
| MM74C911N | 03406 | 1820-1778 | MOH026BD | 01590 | 1820-6810 | N8440N | 02910 | 1820-0459 |
| MM74C922N | 03406 | 1820-2156 | MOH0272C | 01590 | 1820-6811 | N8480N | 02910 | 1820-0460 |
| MM74C923N | 03406 | 1820-2309 | MOR3326 | 08507 | 1826-1295 | N8615M | 02910 | 1820-0837 |
| MM74C923NM | 03406 | 1820-7611 | MP260 | 03688 | 1826-1573 | N8855M | 02910 | 1820-0456 |
| MM74C925N | 03406 | 1820-2549 | MP7507JN | 07050 | 1826-1307 | N8880N | 02910 | 1820-0461 |
| MM74C941N | 03406 | 1820-2630 | MP75330N | 07050 | 1826-1525 | N8881N | 02910 | 1820-0467 |
| MM74HC04M | 03406 | 1820-5393 | MP7683XNN | 07050 | 1826-1417 | N8885N | 02910 | 1820-0923 |
| MM74HC04N | 03406 | 1820-2921 | MP7684KD | 07050 | 1826-1672 | N8T09N (SELECTED) | 02910 | 1820-1084 |
| MM74HC08N | 03406 | 1820-3097 | MPC2014 | 02037 | 1826-1713 | N8T09N | 02910 | 1820-1335 |
| MM74HC112N | 03406 | 1820-3173 | MPY016KJ1C | 04507 | 1820-4679 | N8T09N | 02910 | 1820-1360 |
| MM74HC113N | 03406 | 1820-3795 | MSA-0185 | 03291 | 1826-1722 | N8T13N | 02910 | 1820-1080 |
| MM74HC11M | 03406 | 1820-5801 | MSA-0186 | 03291 | 1826-2178 | N8T20N | 02910 | 1820-1048 |
| MM74HC11N | 03406 | 1820-3184 | MSA-0285 | 03291 | 1826-1966 | N8T23N | 02910 | 1820-1007 |
| MM74HC123AM | 03406 | 1820-5054 | MSA-0286 | 03291 | 1826-2226 | N8T28N | 02910 | 1820-1828 |
| MM74HC123AN | 03406 | 1820-3673 | MSA-0335 | 03291 | 1826-1953 | N8T37N | 02910 | 1820-1817 |
| MM74HC125M | 03406 | 1820-5552 | MSA-0370-21 | 03291 | 1826-1321 | N8T75N | 02910 | 1820-1979 |
| MM74HC125N | 03406 | 1820-3674 | MSA-0420 | 03291 | 1826-1612 | N8T80N | 02910 | 1820-0195 |
| MM74HC126N | 03406 | 1820-7313 | MSA-0435 | 03291 | 1826-1322 | N8T92N | 02910 | 1820-0121 |
| MM74HC133N | 03406 | 1820-3670 | MSA-0485 | 03291 | 1826-1323 | N8T93N | 02910 | 1820-1924 |
| MM74HC139M | 03406 | 1820-5557 | MSA-0486 | 03291 | 1826-2168 | N8T95N | 02910 | 1820-1477 |
| MM74HC139N | 03406 | 1820-3014 | MSA-0520 | 03291 | 1826-1889 | N8T97N | 02910 | 1820-1884 |
| MM74HC141N | 03406 | 1820-3175 | MSA-0685 | 03291 | 1826-1967 | N8E60N | 02910 | 1820-3931 |
| MM74HC148M | 03406 | 1820-6902 | MSA-0686 | 03291 | 1826-2204 | NCM7040L | 01183 | 1818-0630 |
| MM74HC151N | 03406 | 1820-3185 | MSA-0735 | 03291 | 1826-2133 | NCR 8310 | 03947 | 1820-5425 |
| MM74HC1513N | 03406 | 1820-3176 | MSA-0770 | 03291 | 1826-1977 | NCR5380-44PLCC | 03947 | 1820-5403 |
| MM74HC1514N | 03406 | 1820-3136 | MSA-0785 | 03291 | 1826-1724 | NCR5381 | 03947 | 1820-5841 |
| MM74HC1517M | 03406 | 1820-5553 | MSA-0835 | 03291 | 1826-1954 | N5E018F | 02910 | 1826-0798 |
| MM74HC161M | 03406 | 1820-6128 | MSA-0885 | 03291 | 1826-1723 | N5E018N (SELECTED) | 02910 | 1826-1055 |
| MM74HC164M | 03406 | 1820-6129 | MSA-0910 | 03291 | 1826-1831 | N5E01A1 | 02910 | 1826-0058 |
| MM74HC164N | 03406 | 1820-3184 | MSA-1105 | 03291 | 1826-2133 | N5E020F | 02910 | 1826-0972 |
| MM74HC1713M | 03406 | 1820-5395 | MSC1162GS | 09768 | 1820-6727 | N5E020N | 02910 | 1826-1105 |
| MM74HC1714M | 03406 | 1820-5555 | MSC1164GS | 09768 | 1820-6778 | N5E118F | 02910 | 1826-0928 |
| MM74HC174N | 03406 | 1820-3058 | MSM5114-2RS | 09768 | 1818-3446 | N5E1510-F | 02910 | 1826-1502 |
| MM74HC191N | 03406 | 1820-3194 | MSM5128AB-15 | 09768 | 1818-1974 | N5E1510A | 02910 | 1820-5760 |
| MM74HC192N | 03406 | 1820-3204 | MT8860XE | 09161 | 1826-0824 | N5E180A | 02910 | 1820-5761 |
| MM74HC193N | 03406 | 1820-3205 | MT8865XC | 09161 | 1826-0823 | N5E20N | 02910 | 1826-1920 |
| MM74HC221AN | 03406 | 1820-3373 | MT8870BC | 09161 | 1820-3490 | N5E205EC | 02910 | 1826-1907 |
| MM74HC237N | 03406 | 1820-3676 | MUX-08FP | 02180 | 1826-1028 | N5E212N | 02910 | 1826-1945 |
| MM74HC245AN | 03406 | 1820-3330 | MUX-08FQ | 02180 | 1826-0609 | N5E21D | 02910 | 1826-1560 |
| MM74HC251M | 03406 | 1820-5731 | MUX-16-FT | 02180 | 1826-1177 | N5E21D | 02910 | 1826-0213 |
| MM74HC251N | 03406 | 1820-3190 | MUX-16ET | 02180 | 1826-0998 | N5E22D | 02910 | 1826-1550 |
| MM74HC259M | 03406 | 1820-5803 | MUX-24FP | 02180 | 1826-1173 | N5E22N | 02910 | 1826-0256 |
| MM74HC259N | 03406 | 1820-3205 | MUX-24FQ | 02180 | 1826-0610 | N5E26A | 02910 | 1826-0115 |
| MM74HC272N | 03406 | 1820-3098 | MUX28ET | 02180 | 1826-1792 | N5E27H | 02910 | 1826-0454 |
| MM74HC283N | 03406 | 1820-4392 | MWA0204 | 02037 | 1826-1614 | N5E27T | 02910 | 1826-0755 |
| MM74HC298N | 03406 | 1820-4148 | MWA0211_L | 02037 | 1826-1947 | N5E29N | 02910 | 1826-0244 |
| MM74HC299NM | 03406 | 1820-6756 | MWA0304 | 02037 | 1826-1986 | N5E513H | 02910 | 1826-0067 |
| MM74HC30M | 03406 | 1820-5733 | MWA110 | 02037 | 1813-0211 | N5F538N | 02910 | 1826-0936 |
| MM74HC30N | 03406 | 1820-3675 | MWA130 | 02037 | 1813-0213 | N5F550L | 02910 | 1826-0130 |
| MM74HC32N | 03406 | 1820-3298 | MWA210 | 02037 | 1813-0214 | N5F550N | 02910 | 1826-0137 |
| MM74HC365N | 03406 | 1820-3933 | MWA220 | 02037 | 1813-0215 | N5F552AT | 02910 | 1826-0716 |
| MM74HC366N | 03406 | 1820-3677 | MWA230 | 02037 | 1813-0216 | N5F5532P | 01698 | 1826-1328 |
| MM74HC367N | 03406 | 1820-3792 | MWA310 | 02037 | 1813-0217 | N5F553AF | 02910 | 1826-0889 |
| MM74HC368N | 03406 | 1820-3791 | MWA320 | 02037 | 1813-0218 | N5F553AN | 02910 | 1826-1319 |
| MM74HC373MM | 03406 | 1820-4895 | MWA330 | 02037 | 1813-0219 | N5F553AD | 02910 | 1826-1546 |
| MM74HC390N | 03406 | 1820-6247 | N1014F | 02910 | 1816-1461 | N5F554AF | 02910 | 1826-0783 |
| MM74HC390N | 03406 | 1820-3207 | N2513W | 02910 | 1818-0237 | N5F554AN | 02910 | 1826-0715 |
| MM74HC393N | 03406 | 1820-3208 | N2516W | 02910 | 1818-0254 | N5F554AT | 02910 | 1826-0569 |
| MM74HC4020M | 03406 | 1820-6975 | N27011-250V10 | 03811 | 1818-4423 | N5F556N | 02910 | 1826-1279 |
| MM74HC4040M | 03406 | 1820-6190 | N27C010-150V10 | 03811 | 1818-4778 | N5F5563M | 02910 | 1826-0625 |
| MM74HC4046N | 03406 | 1820-1372 | N27C128-200V10 OTP | 03811 | 1818-4580 | N5F556JG | 01698 | 1820-2827 |
| MM74HC4049M | 03406 | 1820-5556 | N27C256-150V10 | 03811 | 1818-4424 | | | |

| Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N |
|--------------------|-------|-----------|-----------------------|-------|-----------|--------------------------|-------|-----------|
| NE592H | 02910 | 1826-0546 | P27128A | 03811 | 1818-3835 | PAL20L8B-2CNS UNPRGMD | 03794 | 1820-6211 |
| NE592N | 02910 | 1826-0194 | P27128A-2 OTP | 03811 | 1818-3930 | PAL20L8BCNS UNPRGMD | 04092 | 1820-4970 |
| NE602D | 02910 | 1826-1931 | P27128A-25 OTP | 03811 | 1818-3879 | PAL20R+ -10JC UNPRGMD | 03794 | 1820-6732 |
| NE602N | 02910 | 1826-1913 | P27256-1 OTP | 03811 | 1818-3922 | PAL20R+ -10PC UNPRGMD | 03794 | 1820-6457 |
| NE952AN | 01698 | 1826-2046 | P27256-3 OTP | 03811 | 1818-3956 | PAL20R4ACJ UNPRGMD | 04092 | 1820-4351 |
| NEL-D32-46(5) | 00039 | 1813-0553 | P2732A OTP | 03811 | 1818-3383 | PAL20R4ACNS UNPRGMD | 04092 | 1820-3613 |
| NMC27C16Q-45 | 03406 | 1818-3160 | P2764A-2 OTP | 03811 | 1818-3931 | PAL20R6-10JC UNPRGMD | 03794 | 1820-7479 |
| NMC27C32Q-45 | 03406 | 1818-3186 | P27C256-200V10 | 03811 | 1818-3909 | PAL20R6ACJ UNPRGMD | 04092 | 1820-3553 |
| NMC9306EN | 03406 | 1818-3619 | P27C256-200V10 | 03811 | 1818-3932 | PAL20R6ACNS UNPRGMD | 04092 | 1820-4110 |
| NMC9306M | 03406 | 1818-4644 | P28F010-200P1C4 | 03811 | 1818-4701 | PAL20R6B-2CFN UNPRGMD | 04092 | 1820-6024 |
| NMC9306N | 03406 | 1818-4234 | P28F512-200 | 03811 | 1818-4652 | PAL20R8-10JC UNPRGMD | 03794 | 1820-7482 |
| NMC9346M8 | 03406 | 1818-4606 | P3101A | 03811 | 1820-1106 | PAL20R8-7PC UNPRGMD | 03794 | 1820-8071 |
| NMC9346N | 03406 | 1818-3921 | P3205 | 03811 | 1820-2035 | PAL20R8ACJ UNPRGMD | 04092 | 1820-3324 |
| NMC9346N | 03406 | 1818-3938 | P3212 | 03811 | 1820-1864 | PAL20R8ACNL UNPRGMD | 04092 | 1820-5079 |
| NMC93C46M8 | 03406 | 1818-4729 | P3404 | 03811 | 1820-1395 | PAL20R8ACNS UNPRGMD | 04092 | 1820-3614 |
| NMC93C46M8 | 03406 | 1818-4858 | P3604L-6 MASKED | 03811 | 1816-0868 | PAL20R8BCFN UNPRGMD | 04092 | 1820-6022 |
| NMC93C56M | 03406 | 1818-4671 | P5101L | 03811 | 1818-0708 | PAL20R8BCNS UNPRGMD | 04092 | 1820-4751 |
| NMC93C56N | 03406 | 1818-4792 | P5101L-1 | 03811 | 1818-0695 | PAL20RA10-20CFN UNPRGMD | 03794 | 1820-7033 |
| NMC93C66M | 03406 | 1818-4767 | P5C090-50 UNPRGMD | 03811 | 1820-5428 | PAL20RA10CNS UNPRGMD | 04092 | 1820-6174 |
| NQ28C64-250 | 11111 | 1818-4359 | P6216 | 03811 | 1820-1557 | PAL20S10CNS UNPRGMD | 04092 | 1820-5671 |
| OP-01CJ | 02180 | 1826-0404 | PAL10016P8NC UNPRGMD | 03406 | 1820-5964 | PAL20X10ACNL UNPRGMD | 04092 | 1820-6172 |
| OP-02CJ | 02180 | 1826-1058 | PAL10016P8JC UNPRGMD | 03406 | 1820-4433 | PAL20X8CJ UNPRGMD | 04092 | 1820-3323 |
| OP-02CJ (SEL'D) | 02180 | 1826-0561 | PAL10H20EVB-6DC | 03794 | 1820-6611 | PAL20X8CNS UNPRGMD | 04092 | 1820-3601 |
| OP-02CZ | 02180 | 1826-1349 | PAL10H8CJ UNPRGMD | 04092 | 1820-2677 | PAL22V10-15JC UNPRGMD | 03794 | 1820-6214 |
| OP-01EY | 02180 | 1826-0974 | PAL10L8A2VC UNPRGMD | 03406 | 1820-5402 | PAL22V10-15PC UNPRGMD | 03794 | 1820-6392 |
| OP-05CJ | 02180 | 1826-0229 | PAL10L8CJ UNPRGMD | 04092 | 1820-2780 | PAL32VX10ACNS UNPRGMD | 03794 | 1820-6728 |
| OP-05EJ | 02180 | 1826-0266 | PAL10L8NC UNPRGMD | 03406 | 1820-3568 | PAL6116ACNS UNPRGMD | 03794 | 1820-7005 |
| OP-07CJ SELECTED | 02180 | 1826-0471 | PAL10L8HC UNPRGMD | 04092 | 1820-2671 | PAL8116ACN UNPRGMD | 04092 | 1820-5817 |
| OP-07CP | 02180 | 1826-0635 | PAL12H6NC UNPRGMD | 03406 | 1820-3570 | PALC16L8C-25PC UNPRGMD | 11345 | 1820-5533 |
| OP-07CSB | 10858 | 1826-1635 | PAL12L10CNS UNPRGMD | 04092 | 1820-2996 | PALC16L8Q-25M UNPRGMD | 03794 | 1820-6841 |
| OP-07CZ | 02180 | 1826-1048 | PAL12L6-2CJ UNPRGMD | 04092 | 1820-4393 | PALC16L8Q-25PC UNPRGMD | 03794 | 1820-6840 |
| OP-07EJ | 02180 | 1826-0845 | PAL12L6ANC UNPRGMD | 03406 | 1820-5877 | PALC16R4L-25PC UNPRGMD | 11345 | 1820-6300 |
| OP-07EZ | 02180 | 1826-1149 | PAL12L6CJ UNPRGMD | 04092 | 1820-2574 | PALC16R8L-25PC UNPRGMD | 11345 | 1820-6301 |
| OP-08FP | 02180 | 1826-0986 | PAL12L6NC UNPRGMD | 03406 | 1820-3597 | PALC22V10-25PC UNPRGMD | 11345 | 1820-6299 |
| OP-08GJ (SELECTED) | 02180 | 1826-0553 | PAL114H4CJ UNPRGMD | 04092 | 1820-2573 | PALC22V10-25PC UNPRGMD | 11345 | 1820-6262 |
| OP-11EY | 02180 | 1826-0616 | PAL114H4NC UNPRGMD | 03406 | 1820-3566 | PALC22V10-35PC UNPRGMD | 11345 | 1820-5013 |
| OP-14CJ | 02180 | 1826-0542 | PAL14L8CJ UNPRGMD | 04092 | 1820-2678 | PALC22V10L-25PC UNPRGMD | 11345 | 1820-5505 |
| OP-14CZ | 02180 | 1826-1061 | PAL14L8CN UNPRGMD | 04092 | 1820-3387 | PALCE16V8H-15JC UNPRGMD | 03794 | 1820-7050 |
| OP-14EZ | 02180 | 1826-1298 | PAL16C1-2CJ UNPRGMD | 04092 | 1820-3892 | PALCE20V8Q-15JC UNPRGMD | 03794 | 1820-6894 |
| OP-15EJ | 02180 | 1826-1185 | PAL16C1CJ UNPRGMD | 04092 | 1820-2782 | PALCE22V10H-25JC UNPRGMD | 03794 | 1820-8152 |
| OP-15EZ | 02180 | 1826-1197 | PAL16C1NC UNPRGMD | 03406 | 1820-3596 | PALCE22V10L-25JC UNPRGMD | 03794 | 1820-6580 |
| OP-15FJ | 02180 | 1826-0937 | PAL16H2-2CJ UNPRGMD | 04092 | 1820-5816 | PALCE22V10Q-15JC UNPRGMD | 03794 | 1820-6839 |
| OP-15GJ | 02180 | 1826-0828 | PAL16H2CJ UNPRGMD | 04092 | 1820-2679 | PBL3717 | 05917 | 1826-1901 |
| OP-15GZ | 02180 | 1826-1478 | PAL16H2NC UNPRGMD | 03406 | 1820-3567 | PCF5873PN | 02910 | 1826-2135 |
| OP-16E | 02180 | 1826-0576 | PAL16L2CJ UNPRGMD | 04092 | 1820-2781 | PCF5874P | 02910 | 1820-5896 |
| OP-16EZ | 02180 | 1826-1192 | PAL16L2CN UNPRGMD | 04092 | 1820-4501 | PCF5876TD | 02910 | 1820-5285 |
| OP-16FJ | 02180 | 1826-0601 | PAL16L6CN UNPRGMD | 04092 | 1820-3530 | PCM53JG-V | 05436 | 1826-1274 |
| OP-16FZ | 02180 | 1826-1367 | PAL16L8-7PC UNPRGMD | 03794 | 1820-6479 | PCM53JF-I | 05436 | 1826-1801 |
| OP-16GJ | 02180 | 1826-1125 | PAL16L8A-2CJ UNPRGMD | 04092 | 1820-2670 | PCM56P | 05436 | 1826-1828 |
| OP-16GZ | 02180 | 1826-1047 | PAL16L8A-2CN UNPRGMD | 03794 | 1820-3356 | PCM78P | 05436 | 1826-1951 |
| OP-17GP | 02180 | 1826-2183 | PAL16L8A-2CN UNPRGMD | 01698 | 1820-4879 | PCFB577N | 02910 | 1820-5670 |
| OP-17EZ | 02180 | 1826-1578 | PAL16L8A-4CN UNPRGMD | 04092 | 1820-5065 | PG1A102AG | 05436 | 1826-1554 |
| OP-17FJ | 02180 | 1826-0516 | PAL16L8ACN UNPRGMD | 03794 | 1820-3355 | PIC600 | 00046 | 1813-0115 |
| OP-17EZ | 02180 | 1826-0795 | PAL16L8ACN UNPRGMD | 04092 | 1820-5288 | PIC601 | 00046 | 1813-0083 |
| OP-17FZ | 02180 | 1826-1097 | PAL16L8AVC UNPRGMD | 03406 | 1820-5641 | PIC602 | 02598 | 1826-1079 |
| OP-200EZ | 02180 | 1826-1960 | PAL16L8B-2CJ UNPRGMD | 03794 | 1820-3556 | PIC611 | 00046 | 1813-0084 |
| OP-200FZ | 02180 | 1826-1918 | PAL16L8B-2CJ UNPRGMD | 04092 | 1820-4857 | PIC625 | 00046 | 1813-0109 |
| OP-200GP | 02180 | 1826-1992 | PAL16L8B-2CN UNPRGMD | 04092 | 1820-4969 | PIC626 | 00046 | 1813-0110 |
| OP-215EZ | 02180 | 1826-1426 | PAL16L8B-4CN UNPRGMD | 04092 | 1820-5244 | PIC645 | 02598 | 1813-0114 |
| OP-215FZ | 02180 | 1826-1192 | PAL16L8B2VC UNPRGMD | 03406 | 1820-5336 | PIC646 | 00046 | 1813-0082 |
| OP-220GZ | 02180 | 1826-1151 | PAL16L8B8C UNPRGMD | 04092 | 1820-4972 | PIC647 | 02598 | 1826-1080 |
| OP-227EY | 02180 | 1826-1631 | PAL16L8BN UNPRGMD | 03406 | 1820-4755 | PKD-01EP | 02180 | 1826-1189 |
| OP-227GY | 02180 | 1826-1150 | PAL16L8BNLSTD UNPRGMD | 04092 | 1820-5960 | PKD-01EZ | 02180 | 1826-1217 |
| OP-270EZ | 02180 | 1826-2089 | PAL16L8C0CT UNPRGMD | 04092 | 1820-5215 | PLC18V8Z-35N UNPRGMD | 02910 | 1820-7042 |
| OP-270FZ | 02180 | 1826-2190 | PAL16L8DCNL UNPRGMD | 04092 | 1820-5894 | PLS100F UNPRGMD | 02910 | 1820-2247 |
| OP-270GP | 02180 | 1826-2252 | PAL16L8NC UNPRGMD | 03406 | 1820-3571 | PLS100N UNPRGMD | 02910 | 1820-2457 |
| OP-27EN8 | 10858 | 1826-1511 | PAL16L8VC UNPRGMD | 03406 | 1820-6057 | PLS105F UNPRGMD | 02910 | 1820-2820 |
| OP-27EZ | 07050 | 1826-1135 | PAL16R4-2CJ UNPRGMD | 04092 | 1820-3291 | PLS153AN UNPRGMD | 02910 | 1820-3531 |
| OP-27FZ | 02180 | 1826-0932 | PAL16R4A-2CJ UNPRGMD | 04092 | 1820-2681 | PLS153N UNPRGMD | 02910 | 1820-2864 |
| OP-27GJ | 02180 | 1826-1007 | PAL16R4A-2CN UNPRGMD | 04092 | 1820-3600 | PLS154N UNPRGMD | 02910 | 1820-3995 |
| OP-27GZ | 02180 | 1826-1049 | PAL16R4A-4CN UNPRGMD | 04092 | 1820-4435 | PLS155N UNPRGMD | 02910 | 1820-3779 |
| OP-290GP | 02180 | 1826-1997 | PAL16R4A2VC UNPRGMD | 04092 | 1820-4582 | PLS168AN UNPRGMD | 02910 | 1820-5029 |
| OP-37EY | 02180 | 1826-1084 | PAL16R4A2JC UNPRGMD | 04092 | 1820-4892 | PLS179N UNPRGMD | 02910 | 1820-5216 |
| OP-37EZ | 02180 | 1826-1568 | PAL16R4A3C UNPRGMD | 04092 | 1820-3492 | PLUS16L8-7A UNPRGMD | 02910 | 1820-6570 |
| OP-37FJ | 02180 | 1826-0977 | PAL16R4A3JC UNPRGMD | 03794 | 1820-3986 | PLUS16L8-7B UNPRGMD | 02910 | 1820-6865 |
| OP-37FZ | 02180 | 1826-0987 | PAL16R4B-2CN UNPRGMD | 04092 | 1820-5158 | PLUS16R4-7A UNPRGMD | 02910 | 1820-6888 |
| OP-37GP | 02180 | 1826-1098 | PAL16R4B-4CN UNPRGMD | 04092 | 1820-4750 | PLUS16R8-7A UNPRGMD | 02910 | 1820-6890 |
| OP-37GS | 02180 | 1826-2144 | PAL16R4BCN UNPRGMD | 04092 | 1820-6023 | PLUS20L8-7A UNPRGMD | 02910 | 1820-6886 |
| OP-37GS | 02180 | 1826-0982 | PAL16R4BCNC UNPRGMD | 03406 | 1820-4757 | PLUS20R4-7A UNPRGMD | 02910 | 1820-6575 |
| OP-400GP | 02180 | 1826-1882 | PAL16R4DCNL UNPRGMD | 03794 | 1820-6213 | PLUS20R6-7A UNPRGMD | 02910 | 1820-6574 |
| OP-400GS | 02180 | 1826-2230 | PAL16R6-2CJ UNPRGMD | 04092 | 1820-3290 | PLUS20R6-7B UNPRGMD | 02910 | 1820-6887 |
| OP-421HY | 02180 | 1826-1093 | PAL16R6A-2CJ UNPRGMD | 03794 | 1820-3358 | PLUS20R6-7C UNPRGMD | 02910 | 1820-6887 |
| OP-42FJ | 02180 | 1826-2002 | PAL16R6A-2CN UNPRGMD | 04092 | 1820-3599 | PLUS405-45A UNPRGMD | 02910 | 1820-7539 |
| OP-42FZ | 02180 | 1826-1844 | PAL16R6A-4CN UNPRGMD | 04092 | 1820-5482 | PM-754SEQ | 02180 | 1826-1890 |
| OP-47EY | 02180 | 1826-1975 | PAL16R6AC UNPRGMD | 03794 | 1820-4082 | PM-754SHP | 02180 | 1826-1827 |
| OP-47GP | 02180 | 1826-2131 | PAL16R6AVC UNPRGMD | 03406 | 1820-5392 | PM7545HPC | 02180 | 1826-1877 |
| OP-47LY | 02180 | 1826-1943 | PAL16R6B-2CJ UNPRGMD | 03794 | 1820-3554 | PMAT5709N | 02910 | 1826-1797 |
| OP-50FY | 02180 | 1826-1459 | PAL16R6B-2CN UNPRGMD | 03794 | 1820-6043 | PQ20RA10Z-15 UNPRGMD | 11111 | 1820-7491 |
| OP-77GS | 02180 | 1826-2146 | PAL16R6B-4CN UNPRGMD | 04092 | 1820-5534 | PQ2804A-250 | 11111 | 1818-4969 |
| OP-77GS | 02180 | 1826-2146 | PAL16R6BCJ UNPRGMD | 04092 | 1820-4493 | PQ28C64-200 | 11111 | 1818-4808 |
| OPA111AM | 05436 | 1813-0437 | PAL16R6BNC UNPRGMD | 03406 | 1820-1758 | PR1472B-01 | 00575 | 1818-0094 |
| OPA111EM | 05436 | 1813-1925 | PAL16R6BNL UNPRGMD | 04092 | 1820-6020 | PSB210B1LN | 06121 | 1820-6808 |
| OPA27U | 05436 | 1826-2008 | PAL16R6CJ UNPRGMD | 04092 | 1820-2680 | PT1482B-01 | 00575 | 1818-0095 |
| OPA404AG | 05436 | 1826- | | | | | | |

| Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N |
|------------------------------|-------|-----------|-------------|-----------|-----------|------------------|-------|-----------|
| REF-02EZ | 02180 | 1826-1320 | SN54LS221J | 01698 | 1820-2042 | SN74LS45N | 01698 | 1820-0468 |
| REF-02RJ | 02180 | 1826-0622 | SN54LS27J | 01698 | 1820-1880 | SN7446AN | 01698 | 1820-1037 |
| REF-02HP | 02180 | 1826-0847 | SN54LS30J | 01698 | 1820-2250 | SN7474TAN | 01698 | 1820-0995 |
| REF10JM | 05436 | 1826-1476 | SN54LS669J | 01698 | 1820-2559 | SN7448N | 01698 | 1820-1038 |
| RGB-DAC 3405SW | 03780 | 1826-1928 | SN54LS74AJ | 01698 | 1820-1798 | SN74490N | 01698 | 1820-1465 |
| RGBDAC3404 | 03780 | 1826-1536 | SN54S00J | 01698 | 1820-1253 | SN7450N | 01698 | 1820-0072 |
| RP5C15 | 11899 | 1826-2022 | SN54S30J | 01698 | 1820-2252 | SN7451N | 01698 | 1820-0063 |
| RTC-58321 | 10421 | 1813-0485 | SN54S40J | 01698 | 1820-2253 | SN7453N | 01698 | 1820-0084 |
| RTC-72421A | 10421 | 1820-6809 | SN54S53BZJG | 01698 | 1820-2236 | SN7454N | 01698 | 1820-0074 |
| RTC-72421B | 10421 | 1820-5384 | SN54S61JG | 01698 | 1820-2282 | SN7460N | 01698 | 1820-0085 |
| RV4558DE | 02290 | 1826-0328 | SN72710N | 01698 | 1820-0398 | SN7470N | 01698 | 1820-0065 |
| S1602P | 03677 | 1820-3215 | SN7400N | 01698 | 1820-0054 | SN7472N | 01698 | 1820-0304 |
| S2350-2 | 03677 | 1820-1754 | SN7401N | 01698 | 1820-0327 | SN7473N | 01698 | 1820-0075 |
| S2859P | 03677 | 1820-2989 | SN7402N | 01698 | 1820-0328 | SN7474N | 01698 | 1820-0077 |
| S3522P | 03677 | 1826-1060 | SN7403N | 01698 | 1820-0269 | SN7475N | 01698 | 1820-0301 |
| S52 | 03545 | 1820-0138 | SN7404N | 01698 | 1820-0174 | SN7476N | 01698 | 1820-0076 |
| S5733A | 02910 | 1826-0040 | SN7405N | 01698 | 1820-0175 | SN7480N | 01698 | 1820-0362 |
| S8280F | 02910 | 1820-0419 | SN7406D | 01698 | 1820-5026 | SN7482N | 01698 | 1820-0363 |
| SAA1027 | 05946 | 1820-1682 | SN7406N | 01698 | 1820-0471 | SN7483N | 01698 | 1820-0305 |
| SAA7220N | 02910 | 1820-6573 | SN7406N | 01698 | 1820-3447 | SN7485N | 01698 | 1820-0921 |
| SB74AS808BN | 01698 | 1820-3443 | SN7407D | 01698 | 1820-564 | SN7486N | 01698 | 1820-0282 |
| SB0204C | 06341 | 1816-1544 | SN7407N | 01698 | 1820-0668 | SN7489N | 01698 | 1820-0628 |
| SC11001CN | 11943 | 1826-1532 | SN7408N | 01698 | 1820-0511 | SN7490AN | 01698 | 1820-0055 |
| SCC2691AC1N24 | 02910 | 1820-4859 | SN7409N | 01698 | 1820-0513 | SN7491AN | 01698 | 1820-0364 |
| SCC2699BC1A84 | 02910 | 1820-5846 | SN74100N | 01698 | 1820-0425 | SN7492AN | 01698 | 1820-0056 |
| SCN2641CC1N24 | 02910 | 1820-3941 | SN74104N | 01698 | 1820-1002 | SN7493AN | 01698 | 1820-0099 |
| SCW2652AC1N40 | 02910 | 1820-2163 | SN74107N | 01698 | 1820-0281 | SN7494N | 01698 | 1820-0366 |
| SCW2672BC4N40 | 02910 | 1820-4177 | SN74109N | 01698 | 1820-1116 | SN7495AN | 01698 | 1820-0367 |
| SCN2681AC1A44 | 02910 | 1820-7342 | SN7410N | 01698 | 1820-0068 | SN7496N | 01698 | 1820-0368 |
| SCN2681AC1N28 | 02910 | 1820-6792 | SN7411N | 01698 | 1820-1229 | SN7497N | 01698 | 1820-0744 |
| SCN2681AC1N40 | 02910 | 1820-3538 | SN74116N | 01698 | 1820-1793 | SN74ACT11244NT | 01698 | 1820-6589 |
| SD5000B | 02883 | 1826-0415 | SN74120N | 01698 | 1820-2164 | SN74ACT11253N | 01698 | 1820-6588 |
| SD5400CY | 02883 | 1826-2205 | SN74121N | 01698 | 1820-0261 | SN74ACT7801FN | 01698 | 1820-7292 |
| SDA2506 | 06121 | 1818-4405 | SN74122N | 01698 | 1820-0704 | SN7HALSOAD | 01698 | 1820-4291 |
| SDA6020 | 06121 | 1826-1153 | SN74123N | 01698 | 1820-0579 | SN7HALSO0AN | 01698 | 1820-2656 |
| SDM857XG | 05436 | 1813-0140 | SN74126N | 01698 | 1820-1214 | SN7HALS01N | 01698 | 1820-3335 |
| SE555CT | 02910 | 1826-0224 | SN74128N | 01698 | 1820-1074 | SN7HALS02D | 01698 | 1820-4245 |
| SE556N | 02910 | 1826-1394 | SN7412N | 01698 | 1820-0907 | SN7HALS02N | 01698 | 1820-2739 |
| SED1181FLA | 12768 | 1820-6399 | SN74132N | 01698 | 1820-1056 | SN7HALS03BD | 01698 | 1820-5180 |
| SED9420MAC | 12385 | 1820-5383 | SN74136N | 01698 | 1820-1250 | SN7HALS03BN | 01698 | 1820-3270 |
| SFC2308UC | 10881 | 1826-1144 | SN74138N | 01698 | 1820-0537 | SN7HALS04BD | 01698 | 1820-4249 |
| SG1502N | 03793 | 1826-0258 | SN74141N | 01698 | 1820-0707 | SN7HALS04BN | 01698 | 1820-2634 |
| SG1524J | 03793 | 1826-0872 | SN74143J | 01698 | 1820-1271 | SN7HALS05AD | 01698 | 1820-4250 |
| SG1532J | 03793 | 1826-0728 | SN74145N | 01698 | 1820-0491 | SN7HALS05AFN | 01698 | 1820-3904 |
| SG323K SELECTED | 03793 | 1826-0931 | SN74147N | 01698 | 1820-1082 | SN7HALS05AN | 01698 | 1820-3376 |
| SG3423M SELECTED | 03793 | 1826-0680 | SN74148N | 01698 | 1820-1473 | SN7HALS05BD | 01698 | 1820-4243 |
| SG3503Y | 03793 | 1826-0540 | SN7414N | 01698 | 1820-1053 | SN7HALS08N | 01698 | 1820-2635 |
| SG3524 SELECTED | 03793 | 1826-0637 | SN74150N | 01698 | 1820-0640 | SN7HALS09D | 01698 | 1820-5235 |
| SG3524BN | 03793 | 1826-1352 | SN74151AN | 01698 | 1820-0622 | SN7HALS09N | 01698 | 1820-3394 |
| SG3524D | 02910 | 1826-2020 | SN74153N | 01698 | 1820-0620 | SN7HALS1000AD | 01698 | 1820-6755 |
| SG3524J | 03793 | 1826-0428 | SN74155N | 01698 | 1820-0738 | SN7HALS1000AN | 01698 | 1820-3708 |
| SG3524J SELECTED | 03793 | 1826-0815 | SN74156N | 01698 | 1820-1046 | SN7HALS1002AN | 01698 | 1820-3105 |
| SG3524N | 03793 | 1826-0956 | SN74157N | 01698 | 1820-0762 | SN7HALS1003AN | 01698 | 1820-4349 |
| SG3525AJ | 03793 | 1826-0905 | SN74159N | 01698 | 1820-1257 | SN7HALS1004D | 01698 | 1820-6466 |
| SG3526J | 03793 | 1826-1040 | SN74160N | 01698 | 1820-0899 | SN7HALS1004FN | 01698 | 1820-3797 |
| SG3526N | 03793 | 1826-1446 | SN74161N | 01698 | 1820-0716 | SN7HALS1004N | 01698 | 1820-3633 |
| SG3527AJ | 03793 | 1826-1243 | SN74162N | 01698 | 1820-1185 | SN7HALS1005D | 01698 | 1820-5618 |
| SG353K-12 | 03793 | 1826-1014 | SN74163N | 01698 | 1820-0713 | SN7HALS1005N | 01698 | 1820-3562 |
| SG3543M | 03793 | 1826-1929 | SN74164N | 01698 | 1820-1064 | SN7HALS1008AN | 01698 | 1820-3480 |
| SG3549M | 03793 | 1826-0959 | SN74165N | 01698 | 1820-1042 | SN7HALS1010AFN | 01698 | 1820-3799 |
| SG3627 | 03793 | 1820-2590 | SN74166N | 01698 | 1820-1107 | SN7HALS1010AN | 01698 | 1820-3382 |
| SG3731J | 03793 | 1826-1038 | SN74167N | 01698 | 1820-0909 | SN7HALS1011AFN | 01698 | 1820-3804 |
| SG7812AC-K | 03793 | 1826-1082 | SN74167 | 01698 | 1820-2586 | SN7HALS1011AN | 01698 | 1820-6328 |
| SG7912AC-K | 03793 | 1826-1083 | SN74168N | 01698 | 1820-0577 | SN7HALS1020AN | 01698 | 1820-3800 |
| S17135CJ | 02883 | 1826-1515 | SN74170J | 01698 | 1820-0725 | SN7HALS1032AN | 01698 | 1820-3401 |
| S17660CJ | 02883 | 1826-1831 | SN74170N | 01698 | 1820-1459 | SN7HALS1034D | 01698 | 1820-5672 |
| S17661CJ | 02883 | 1826-1583 | SN74173N | 01698 | 1820-1192 | SN7HALS1034N | 01698 | 1820-3343 |
| S17661CJ (SELECTED) | 02883 | 1826-1991 | SN74174N | 01698 | 1820-0788 | SN7HALS1035D | 01698 | 1820-5612 |
| S19102DN | 02883 | 1826-1991 | SN74175N | 01698 | 1820-1267 | SN7HALS1035N | 01698 | 1820-3137 |
| S19110PJ | 02883 | 1826-2200 | SN74178N | 01698 | 1820-1141 | SN7HALS109AD | 01698 | 1820-4928 |
| SL30226 (SELECTED LT1008CN8) | 10858 | 1826-1767 | SN74179N | 01698 | 1820-1259 | SN7HALS109AN | 01698 | 1820-2758 |
| SLW41A | 01590 | 1826-0676 | SN74179N | 01698 | 1820-0618 | SN7HALS10AD | 01698 | 1820-4252 |
| SLW41C | 01590 | 1826-1555 | SN74180N | 01698 | 1820-0435 | SN7HALS10AN | 01698 | 1820-2775 |
| SL560C/DP | 01590 | 1826-2023 | SN74181N | 01698 | 1820-0606 | SN7HALS112AD | 01698 | 1820-4276 |
| SL6440C | 01590 | 1826-1853 | SN74182N | 01698 | 1820-0611 | SN7HALS112AFN | 01698 | 1820-3808 |
| SL952 | 01590 | 1826-1754 | SN74184N | 01698 | 1820-1267 | SN7HALS112AN | 01698 | 1820-2772 |
| SM10105-1 | 05436 | 1826-1517 | SN74185AN | 01698 | 1820-1141 | SN7HALS113AN | 01698 | 1820-3761 |
| SM4ALS652-1DW | 01698 | 1820-7364 | SN74188AN | 01698 | 1816-1141 | SN7HALS114AN | 01698 | 1820-5145 |
| SMC20 | 11452 | 1820-3861 | SN74190N | 01698 | 1820-0734 | SN7HALS115AD | 01698 | 1820-4244 |
| SMP-10EY | 02180 | 1826-1145 | SN74191N | 01698 | 1820-0545 | SN7HALS115AN | 01698 | 1820-2889 |
| SMP-10FY | 02180 | 1826-1144 | SN74192N | 01698 | 1820-0546 | SN7HALS1212OFN | 01698 | 1820-3805 |
| SMP-11EY | 02180 | 1826-1244 | SN74194N | 01698 | 1820-0743 | SN7HALS1212HA-1N | 01698 | 1820-3239 |
| SMP-11GY | 02180 | 1826-0988 | SN74195N | 01698 | 1820-1027 | SN7HALS1212HAFN | 01698 | 1820-3806 |
| SMP-81FY | 02180 | 1826-0727 | SN74196N | 01698 | 1820-0751 | SN7HALS1212UAN | 01698 | 1820-3277 |
| SN10KH7543D | 01698 | 1820-7651 | SN74197N | 01698 | 1820-0765 | SN7HALS1212SA-1N | 01698 | 1820-3238 |
| SN10KH7543N | 01698 | 1820-7695 | SN74198N | 01698 | 1820-1032 | SN7HALS1212SAFN | 01698 | 1820-3870 |
| SN15830N | 01698 | 1820-0086 | SN74199N | 01698 | 1820-0726 | SN7HALS12125AN | 01698 | 1820-3287 |
| SN15845N | 01698 | 1820-0308 | SN7420N | 01698 | 1820-0069 | SN7HALS122AN | 01698 | 1820-3148 |
| SN15862N | 01698 | 1820-0310 | SN74221N | 01698 | 1820-1260 | SN7HALS131N | 01698 | 1820-4655 |
| SN5400J | 01698 | 1820-1993 | SN7422J | 01698 | 1820-2304 | SN7HALS133D | 01698 | 1820-5234 |
| SN5402J | 01698 | 1820-1103 | SN7422N | 01698 | 1820-1256 | SN7HALS133N | 01698 | 1820-3372 |
| SN5404N | 01698 | 1820-1022 | SN7423N | 01698 | 1820-0538 | SN7HALS136N | 01698 | 1820-6155 |
| SN5408J | 01698 | 1820-1099 | SN7424N | 01698 | 1820-1580 | SN7HALS137N | 01698 | 1820-3258 |
| SN5408N | 01698 | 1820-1379 | SN7425N | 01698 | 1820-0655 | SN7HALS138D | 01698 | 1820-4257 |
| SN5410J | 01698 | 1820-1094 | SN7426N | 01698 | 1820-1460 | SN7HALS138FN | 01698 | 1820-3809 |
| SN5412J | 01698 | 1820-1092 | SN7427N | 01698 | 1820-0514 | SN7HALS138N | 01698 | 1820-3100 |
| SN5413J | 01698 | 1820-1091 | SN74273N | 01698 | 1820-1461 | SN7HALS139D | 01698 | 1820-4258 |
| SN54160N | 01698 | 1820-1024 | SN74276N | 01698 | 1820-2127 | SN7HALS139FN | 01698 | 1820-3810 |
| SN54192N | 01698 | 1820-1378 | SN74278N | 01698</td | | | | |

| Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N |
|-----------------|-------|-----------|-----------------|-------|-----------|--------------|-------|-----------|
| SN74ALS164D | 01698 | 1820-4265 | SN74ALS541N | 01698 | 1820-3707 | SN74AS151N | 01698 | 1820-3736 |
| SN74ALS164FN | 01698 | 1820-3875 | SN74ALS561AN | 01698 | 1820-3925 | SN74AS153D | 01698 | 1820-5630 |
| SN74ALS164N | 01698 | 1820-4313 | SN74ALS563N | 01698 | 1820-3336 | SN74AS153N | 01698 | 1820-3737 |
| SN74ALS165D | 01698 | 1820-4266 | SN74ALS564AN | 01698 | 1820-4720 | SN74AS157D | 01698 | 1820-6114 |
| SN74ALS165FN | 01698 | 1820-3813 | SN74ALS561BDW | 01698 | 1820-5132 | SN74AS157N | 01698 | 1820-3738 |
| SN74ALS165N | 01698 | 1820-6530 | SN74ALS569ADW | 01698 | 1820-5232 | SN74AS158D | 01698 | 1820-6438 |
| SN74ALS166D | 01698 | 1820-4962 | SN74ALS569AN | 01698 | 1820-3217 | SN74AS158N | 01698 | 1820-3739 |
| SN74ALS166N | 01698 | 1820-3982 | SN74ALS573BFN | 01698 | 1820-3876 | SN74AS161N | 01698 | 1820-3740 |
| SN74ALS168AN | 01698 | 1820-3762 | SN74ALS573CDW | 01698 | 1820-4264 | SN74AS162N | 01698 | 1820-3741 |
| SN74ALS168BD | 01698 | 1820-4268 | SN74ALS573CN | 01698 | 1820-2724 | SN74AS163D | 01698 | 1820-4937 |
| SN74ALS168BFN | 01698 | 1820-3818 | SN74ALS574AFN | 01698 | 1820-3872 | SN74AS163N | 01698 | 1820-3742 |
| SN74ALS169D | 01698 | 1820-4269 | SN74ALS574BDW | 01698 | 1820-4279 | SN74AS168D | 01698 | 1820-4287 |
| SN74ALS169BN | 01698 | 1820-3819 | SN74ALS574BN | 01698 | 1820-2757 | SN74AS168FN | 01698 | 1820-3822 |
| SN74ALS169DN | 01698 | 1820-3353 | SN74ALS575ADW | 01698 | 1820-5613 | SN74AS168N | 01698 | 1820-3841 |
| SN74ALS174D | 01698 | 1820-4930 | SN74ALS575ANT | 01698 | 1820-3993 | SN74AS169D | 01698 | 1820-4288 |
| SN74ALS174N | 01698 | 1820-3465 | SN74ALS576AN | 01698 | 1820-2882 | SN74AS169FN | 01698 | 1820-3823 |
| SN74ALS175D | 01698 | 1820-4935 | SN74ALS577NT | 01698 | 1820-4076 | SN74AS169N | 01698 | 1820-3842 |
| SN74ALS175FN | 01698 | 1820-3411 | SN74ALS580ADW | 01698 | 1820-5710 | SN74AS174D | 01698 | 1820-5615 |
| SN74ALS175N | 01698 | 1820-3466 | SN74ALS580AN | 01698 | 1820-3003 | SN74AS174N | 01698 | 1820-3743 |
| SN74ALS1804AN | 01698 | 1820-4167 | SN74ALS5820AN | 01698 | 1820-4170 | SN74AS175D | 01698 | 1820-5616 |
| SN74ALS1805AN | 01698 | 1820-5183 | SN74ALS5821A-1N | 01698 | 1820-5187 | SN74AS175N | 01698 | 1820-3698 |
| SN74ALS190D | 01698 | 1820-4270 | SN74ALS5821ADW | 01698 | 1820-7621 | SN74AS1804N | 01698 | 1820-4459 |
| SN74ALS190FN | 01698 | 1820-3873 | SN74ALS5822A-1N | 01698 | 1820-5188 | SN74AS1805N | 01698 | 1820-4402 |
| SN74ALS190H | 01698 | 1820-3763 | SN74ALS5823ADW | 01698 | 1820-7363 | SN74AS1808N | 01698 | 1820-4496 |
| SN74ALS191D | 01698 | 1820-4271 | SN74ALS5823AN | 01698 | 1820-3905 | SN74AS181BNT | 01698 | 1820-3744 |
| SN74ALS191FN | 01698 | 1820-3906 | SN74ALS5824AJ | 01698 | 1820-3559 | SN74AS191D | 01698 | 1820-4286 |
| SN74ALS191N | 01698 | 1820-3505 | SN74ALS5839N | 02037 | 1820-3308 | SN74AS191FN | 01698 | 1820-3914 |
| SN74ALS192N | 01698 | 1820-3598 | SN74ALS5840B-1N | 01698 | 1820-3498 | SN74AS191N | 01698 | 1820-4059 |
| SN74ALS193N | 01698 | 1820-3375 | SN74ALS5840EON | 01698 | 1820-3362 | SN74AS20D | 01698 | 1820-6321 |
| SN74ALS204D | 01698 | 1820-5075 | SN74ALS5841A-1N | 01698 | 1820-5714 | SN74AS20N | 01698 | 1820-3733 |
| SN74ALS204AN | 01698 | 1820-2774 | SN74ALS5841AN | 01698 | 1820-3380 | SN74AS21D | 01698 | 1820-5322 |
| SN74ALS21AD | 01698 | 1820-6204 | SN74ALS5842AN | 01698 | 1820-3666 | SN74AS21N | 01698 | 1820-3991 |
| SN74ALS21AD | 01698 | 1820-2888 | SN74ALS5845A-1N | 01698 | 1820-3497 | SN74AS23ON | 01698 | 1820-3923 |
| SN74ALS2232NT | 01698 | 1820-6130 | SN74ALS5845AN | 01698 | 1820-3481 | SN74AS231N | 01698 | 1820-3922 |
| SN74ALS2233FN | 01698 | 1820-6968 | SN74ALS5864DW | 01698 | 1820-5318 | SN74AS240DW | 01698 | 1820-5871 |
| SN74ALS22BN | 01698 | 1820-3758 | SN74ALS5864NT | 01698 | 1820-4391 | SN74AS24ON | 01698 | 1820-3543 |
| SN74ALS23AN | 01698 | 1820-4670 | SN74ALS5868NT | 01698 | 1820-5025 | SN74AS24LN | 01698 | 1820-3745 |
| SN74ALS23ADW | 01698 | 1820-6178 | SN74ALS5851NT | 01698 | 1820-5766 | SN74AS242D | 01698 | 1820-6753 |
| SN74ALS236N | 01698 | 1820-5228 | SN74ALS5852-1NT | 01698 | 1820-7355 | SN74AS242N | 01698 | 1820-4171 |
| SN74ALS2404-1N | 01698 | 1820-3782 | SN74ALS5852DW | 01698 | 1820-7367 | SN74AS243D | 01698 | 1820-4776 |
| SN74ALS2404DW | 01698 | 1820-4787 | SN74ALS5852FN | 01698 | 1820-7319 | SN74AS243N | 01698 | 1820-3746 |
| SN74ALS2404FN | 01698 | 1820-4272 | SN74ALS5852NT | 01698 | 1820-4593 | SN74AS244DW | 01698 | 1820-5325 |
| SN74ALS2404N | 01698 | 1820-2951 | SN74ALS5853-1NT | 01698 | 1820-4694 | SN74AS244N | 01698 | 1820-3541 |
| SN74ALS2411 | 01698 | 1820-4162 | SN74ALS5854-1NT | 01698 | 1820-4126 | SN74AS245DW | 01698 | 1820-5134 |
| SN74ALS241BDW | 01698 | 1820-5233 | SN74ALS5854DW | 01698 | 1820-6782 | SN74AS254N | 01698 | 1820-4096 |
| SN74ALS241BFN | 01698 | 1820-3412 | SN74ALS5866DW | 01698 | 1820-7236 | SN74AS250NT | 01698 | 1820-4654 |
| SN74ALS241BN | 01698 | 1820-4350 | SN74ALS5866NT | 01698 | 1820-5625 | SN74AS253D | 01698 | 1820-5314 |
| SN74ALS2423AD | 01698 | 1820-5179 | SN74ALS5867ADW | 01698 | 1820-7237 | SN74AS253N | 01698 | 1820-3747 |
| SN74ALS2423AN | 01698 | 1820-3994 | SN74ALS5877ANT | 01698 | 1820-4649 | SN74AS257D | 01698 | 1820-4285 |
| SN74ALS2444-1N | 01698 | 1820-4233 | SN74ALS5878NT | 01698 | 1820-4497 | SN74AS257N | 01698 | 1820-3890 |
| SN74ALS244BDW | 01698 | 1820-4788 | SN74ALS5879N | 01698 | 1820-4127 | SN74AS257N | 01698 | 1820-3748 |
| SN74ALS244BFN | 01698 | 1820-4273 | SN74ALS5880AN | 01698 | 1820-3835 | SN74AS268N | 01698 | 1820-3749 |
| SN74ALS244BN | 01698 | 1820-3145 | SN74ALS5888DW | 01698 | 1820-5259 | SN74AS268N | 01698 | 1820-3750 |
| SN74ALS244N | 02037 | 1820-3607 | SN74ALS5888NT | 01698 | 1820-3106 | SN74AS27D | 01698 | 1820-4964 |
| SN74ALS245A-1DW | 01698 | 1820-7672 | SN74ALS58874N | 01698 | 1820-5015 | SN74AS27N | 01698 | 1820-3606 |
| SN74ALS245A-1N | 01698 | 1820-3714 | SN74ALS5874AD | 01698 | 1820-4275 | SN74AS30D | 01698 | 1820-5315 |
| SN74ALS245ADW | 01698 | 1820-4790 | SN74ALS5874FN | 01698 | 1820-3807 | SN74AS30N | 01698 | 1820-3734 |
| SN74ALS245AFN | 01698 | 1820-4274 | SN74ALS5874N | 01698 | 1820-2488 | SN74AS32D | 01698 | 1820-4283 |
| SN74ALS245AN | 01698 | 1820-3121 | SN74ALS5875-1N | 01698 | 1820-6142 | SN74AS32N | 01698 | 1820-3590 |
| SN74ALS245N | 02037 | 1820-2913 | SN74ALS5876ON | 01698 | 1820-6142 | SN74AS32D | 01698 | 1820-3760 |
| SN74ALS251D | 01698 | 1820-4259 | SN74ALS5880ADW | 01698 | 1820-6159 | SN74AS286N | 01698 | 1820-4375 |
| SN74ALS251FN | 01698 | 1820-3811 | SN74ALS5880FN | 01698 | 1820-3798 | SN74AS286N | 01698 | 1820-4375 |
| SN74ALS251N | 01698 | 1820-3764 | SN74ALS5880N | 01698 | 1820-3560 | SN74AS304N | 01698 | 1820-7614 |
| SN74ALS252D | 01698 | 1820-4260 | SN74ALS58805DW | 01698 | 1820-6116 | SN74AS304N | 01698 | 1820-6320 |
| SN74ALS253P | 01698 | 1820-3812 | SN74ALS58805AN | 01698 | 1820-3718 | SN74AS32N | 01698 | 1820-3513 |
| SN74ALS253N | 01698 | 1820-3439 | SN74ALS58805FN | 01698 | 1820-3801 | SN74AS352D | 01698 | 1820-7360 |
| SN74ALS2541N | 01698 | 1820-5772 | SN74ALS58808AN | 01698 | 1820-3392 | SN74AS353N | 01698 | 1820-3750 |
| SN74ALS257D | 01698 | 1820-4261 | SN74ALS58808FN | 01698 | 1820-3803 | SN74AS373DW | 01698 | 1820-5316 |
| SN74ALS257N | 01698 | 1820-3874 | SN74ALS58832ADW | 01698 | 1820-6113 | SN74AS373N | 01698 | 1820-3542 |
| SN74ALS257N | 01698 | 1820-3438 | SN74ALS58832AN | 01698 | 1820-3467 | SN74AS374DW | 01698 | 1820-5317 |
| SN74ALS258N | 01698 | 1820-3765 | SN74ALS58832FN | 01698 | 1820-3869 | SN74AS374FN | 01698 | 1820-3824 |
| SN74ALS259D | 01698 | 1820-4263 | SN74ALS58841DW | 01698 | 1820-5673 | SN74AS374N | 01698 | 1820-3695 |
| SN74ALS259N | 01698 | 1820-4075 | SN74ALS58841NT | 01698 | 1820-4535 | SN74AS533N | 01698 | 1820-3563 |
| SN74ALS273D | 01698 | 1820-4277 | SN74ALS58843NT | 01698 | 1820-4716 | SN74AS534DW | 01698 | 1820-6849 |
| SN74ALS273FN | 01698 | 1820-3871 | SN74ALS58845NT | 01698 | 1820-5148 | SN74AS534N | 01698 | 1820-3751 |
| SN74ALS273N | 01698 | 1820-3318 | SN74ALS58867ANT | 01698 | 1820-5169 | SN74AS573DW | 01698 | 1820-5133 |
| SN74ALS272D | 01698 | 1820-4246 | SN74ALS58869NT | 01698 | 1820-6164 | SN74AS573N | 01698 | 1820-3881 |
| SN74ALS272FN | 01698 | 1820-3802 | SN74ALS5886D | 01698 | 1820-4248 | SN74AS574DW | 01698 | 1820-4936 |
| SN74ALS272N | 01698 | 1820-2881 | SN74ALS5886FN | 01698 | 1820-3413 | SN74AS574FN | 01698 | 1820-3912 |
| SN74ALS280D | 01698 | 1820-5674 | SN74ALS5886GN | 01698 | 1820-3973 | SN74AS574N | 01698 | 1820-4318 |
| SN74ALS28AN | 01698 | 1820-3179 | SN74ALS58873DW | 01698 | 1820-6465 | SN74AS575N | 01698 | 1820-4025 |
| SN74ALS29818DW | 01698 | 1820-7351 | SN74ALS58873BNT | 01698 | 1820-3237 | SN74AS576N | 01698 | 1820-4169 |
| SN74ALS29818NT | 01698 | 1820-7618 | SN74ALS58874DW | 01698 | 1820-5310 | SN74AS577NT | 01698 | 1820-5985 |
| SN74ALS29827NT | 01698 | 1820-5185 | SN74ALS58874NT | 01698 | 1820-3143 | SN74AS580N | 01698 | 1820-4077 |
| SN74ALS299D | 01698 | 1820-5711 | SN74ALS58876ANT | 01698 | 1820-3240 | SN74AS5623N | 01698 | 1820-3882 |
| SN74ALS299FN | 01698 | 1820-3814 | SN74ALS58878ANT | 01698 | 1820-6259 | SN74AS5639DW | 01698 | 1820-6228 |
| SN74ALS299N | 01698 | 1820-3104 | SN74ALS58880NT | 01698 | 1820-3381 | SN74AS5639N | 01698 | 1820-4211 |
| SN74ALS30AD | 01698 | 1820-4353 | SN74ALS5996NT | 01698 | 1820-5582 | SN74AS640N | 01698 | 1820-3971 |
| SN74ALS30AN | 01698 | 1820-2773 | SN74ALS5A00D | 01698 | 1820-4280 | SN74AS641N | 01698 | 1820-4129 |
| SN74ALS323D | 01698 | 1820-5312 | SN74ALS5A00N | 01698 | 1820-3591 | SN74AS645N | 01698 | 1820-3843 |
| SN74ALS323N | 01698 | 1820-6165 | SN74ALS5A02D | 01698 | 1820-4282 | SN74AS616DW | 01698 | 1820-5323 |
| SN74ALS32D | 01698 | 1820-4247 | SN74ALS5A02N | 01698 | 1820-3729 | SN74AS616NT | 01698 | 1820-4650 |
| SN74ALS32N | 01698 | 1820-2657 | SN74ALS5A0D | 01698 | 1820-5614 | SN74AS651N | 01698 | 1820-4097 |
| SN74ALS33AN | 01698 | 1820-3759 | SN74ALS5A04N | 01698 | 1820-3608 | SN74AS652NT | 01698 | 1820-4289 |
| SN74ALS352N | 01698 | 1820-4642 | SN74ALS5A08D | 01698 | 1820-4281 | SN74AS74 | | |

| Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N | Desc. | Mfr. | HPP/N |
|-------------------------|-------|-----------|-------------|-------|-----------|-------------|-------|-----------|
| SNT4LS84L1NT | 01698 | 1820-4109 | SNT4LS02J | 01698 | 1820-1647 | SNT4LS273N | 01698 | 1820-1730 |
| SNT4LS84L2NT | 01698 | 1820-4033 | SNT4LS02N | 01698 | 1820-1144 | SNT4LS279AN | 01698 | 1820-1440 |
| SNT4LS84L3NT | 01698 | 1820-4579 | SNT4LS03N | 01698 | 1820-1198 | SNT4LS279AN | 01698 | 1820-3495 |
| SNT4LS84L5NT | 01698 | 1820-4498 | SNT4LS04J | 01698 | 1820-2582 | SNT4LS27J | 01698 | 1820-2579 |
| SNT4LS851AN | 01698 | 1820-4168 | SNT4LS04N | 01698 | 1820-1199 | SNT4LS27N | 01698 | 1820-1206 |
| SNT4LS866N | 01698 | 1820-4594 | SNT4LS05N | 01698 | 1820-1200 | SNT4LS280N | 01698 | 1820-1859 |
| SNT4LS867NT | 01698 | 1820-3634 | SNT4LS07N | 01698 | 1820-1348 | SNT4LS283D | 01698 | 1820-4262 |
| SNT4LS869DW | 01698 | 1820-6716 | SNT4LS08J | 01698 | 1820-2581 | SNT4LS283F | 01698 | 1820-3898 |
| SNT4LS869NT | 01698 | 1820-4445 | SNT4LS08N | 01698 | 1820-1201 | SNT4LS283N | 01698 | 1820-1441 |
| SNT4LS86AD | 01698 | 1820-6241 | SNT4LS09N | 01698 | 1820-1246 | SNT4LS28N | 01698 | 1820-1273 |
| SNT4LS86AN | 01698 | 1820-3884 | SNT4LS10AN | 01698 | 1820-1469 | SNT4LS290N | 01698 | 1820-1442 |
| SNT4LS86AN | 01698 | 1820-7304 | SNT4LS10AN | 01698 | 1820-1282 | SNT4LS292N | 01698 | 1820-2917 |
| SNT4LS870NT | 01698 | 1820-5021 | SNT4LS10N | 01698 | 1820-1202 | SNT4LS293N | 01698 | 1820-1443 |
| SNT4LS873NT | 01698 | 1820-3544 | SNT4LS112AN | 01698 | 1820-1212 | SNT4LS294N | 01698 | 1820-3118 |
| SNT4LS874DW | 01698 | 1820-6362 | SNT4LS113AN | 01698 | 1820-1213 | SNT4LS295BN | 01698 | 1820-1296 |
| SNT4LS874NT | 01698 | 1820-4344 | SNT4LS113AN | 01698 | 1820-1821 | SNT4LS298N | 01698 | 1820-1444 |
| SNT4LS876N | 01698 | 1820-4565 | SNT4LS11N | 01698 | 1820-1203 | SNT4LS30N | 01698 | 1820-1207 |
| SNT4LS878NT | 01698 | 1820-4658 | SNT4LS12N | 01698 | 1820-1422 | SNT4LS30N | 01698 | 1820-3460 |
| SNT4LS879NT | 01698 | 1820-6030 | SNT4LS123D | 01698 | 1820-4256 | SNT4LS31N | 01698 | 1820-1347 |
| SNT4LS881ANT | 01698 | 1820-5064 | SNT4LS123FN | 01698 | 1820-3901 | SNT4LS320N | 01698 | 1820-2592 |
| SNT4LS882ANT | 01698 | 1820-3776 | SNT4LS123J | 01698 | 1820-2305 | SNT4LS321N | 01698 | 1820-3972 |
| SNT4LS883RGB | 01698 | 1820-6506 | SNT4LS123N | 01698 | 1820-1423 | SNT4LS322AN | 01698 | 1820-2201 |
| SNT4LS885DW | 01698 | 1820-6783 | SNT4LS123N | 01698 | 1820-3954 | SNT4LS323N | 01698 | 1820-2202 |
| SNT4LS885MT | 01698 | 1820-2899 | SNT4LS124N | 01698 | 1820-1424 | SNT4LS324N | 01698 | 1820-1642 |
| SNT4BCT224DN | 01698 | 1820-7677 | SNT4LS125AD | 01698 | 1820-4786 | SNT4LS325N | 01698 | 1820-2068 |
| SNT4BCT244DN | 01698 | 1820-7678 | SNT4LS125AN | 01698 | 1820-1568 | SNT4LS32J | 01698 | 1820-2585 |
| SNT4BCT425N | 01698 | 1820-7696 | SNT4LS126D | 01698 | 1820-5324 | SNT4LS32N | 01698 | 1820-1208 |
| SNT4BCT827ADW | 01698 | 1820-6611 | SNT4LS126AN | 01698 | 1820-1645 | SNT4LS32N | 01698 | 1820-3956 |
| SNT4BCT828ADW | 01698 | 1820-6622 | SNT4LS12N | 01698 | 1820-1414 | SNT4LS33N | 01698 | 1820-1272 |
| SNT4BCT982IDW | 01698 | 1820-6950 | SNT4LS132D | 01698 | 1820-5707 | SNT4LS34N | 01698 | 1820-2121 |
| SNT4BCT982TAFN | 01698 | 1820-7358 | SNT4LS132N | 01698 | 1820-1425 | SNT4LS352N | 01698 | 1820-2536 |
| SNT4BCT9861ADW | 01698 | 1820-7365 | SNT4LS132N | 01698 | 1820-2237 | SNT4LS353N | 01698 | 1820-2046 |
| SNT4BCT373M | 01698 | 1820-7676 | SNT4LS132N | 01698 | 1820-3475 | SNT4LS354N | 01698 | 1820-3393 |
| SNT4BCT652ODW | 01698 | 1820-6691 | SNT4LS136N | 01698 | 1820-1215 | SNT4LS356N | 01698 | 1820-2613 |
| SNT4F242D | 01698 | 1820-7635 | SNT4LS137N | 01698 | 1820-2550 | SNT4LS356AN | 01698 | 1820-1641 |
| SNT4F281N | 01698 | 1820-7259 | SNT4LS138D | 02037 | 1820-7683 | SNT4LS364N | 01698 | 1820-1640 |
| SNT4H00N | 01698 | 1820-0370 | SNT4LS138N | 01698 | 1820-1216 | SNT4LS367AN | 01698 | 1820-1491 |
| SNT4H01N | 01698 | 1820-0605 | SNT4LS139AN | 01698 | 1820-1281 | SNT4LS367AN | 01698 | 1820-1892 |
| SNT4H04N | 01698 | 1820-0424 | SNT4LS139N | 01698 | 1820-1415 | SNT4LS368AN | 01698 | 1820-1492 |
| SNT4H05N | 01698 | 1820-0613 | SNT4LS145N | 01698 | 1820-1426 | SNT4LS373N | 01698 | 1820-2102 |
| SNT4H10N | 01698 | 1820-0739 | SNT4LS147N | 01698 | 1820-2200 | SNT4LS374N | 01698 | 1820-2641 |
| SNT4H12N | 01698 | 1820-0469 | SNT4LS148D | 01698 | 1820-5112 | SNT4LS375N | 01698 | 1820-1445 |
| SNT4H13N | 01698 | 1820-0544 | SNT4LS14D | 01698 | 1820-4251 | SNT4LS377D | 01698 | 1820-4278 |
| SNT4H16N | 01698 | 1820-0715 | SNT4LS14F | 01698 | 1820-3900 | SNT4LS377FN | 01698 | 1820-3899 |
| SNT4H18N | 01698 | 1820-0631 | SNT4LS14N | 01698 | 1820-1416 | SNT4LS377N | 01698 | 1820-1858 |
| SNT4H19N | 01698 | 1820-0372 | SNT4LS151N | 01698 | 1820-2117 | SNT4LS378N | 01698 | 1820-2056 |
| SNT4H21N | 01698 | 1820-0847 | SNT4LS153N | 01698 | 1820-1244 | SNT4LS379N | 01698 | 1820-2244 |
| SNT4H22N | 01698 | 1820-0373 | SNT4LS155AN | 01698 | 1820-1245 | SNT4LS37N | 01698 | 1820-1287 |
| SNT4H23N | 01698 | 1820-0374 | SNT4LS156N | 01698 | 1820-1427 | SNT4LS382AN | 01698 | 1820-3770 |
| SNT4H24N | 01698 | 1820-0619 | SNT4LS157D | 01698 | 1820-6404 | SNT4LS384N | 01698 | 1820-3506 |
| SNT4H30N | 01698 | 1820-0375 | SNT4LS157N | 01698 | 1820-1470 | SNT4LS385N | 01698 | 1820-2720 |
| SNT4H40N | 01698 | 1820-0376 | SNT4LS158N | 01698 | 1820-1428 | SNT4LS386AN | 01698 | 1820-2764 |
| SNT4H50N | 01698 | 1820-0377 | SNT4LS160N | 01698 | 1820-1243 | SNT4LS387N | 01698 | 1820-7676 |
| SNT4H51N | 01698 | 1820-0378 | SNT4LS161AN | 01698 | 1820-1429 | SNT4LS388J | 01698 | 1820-2584 |
| SNT4H52N | 01698 | 1820-0379 | SNT4LS161AN | 01698 | 1820-1430 | SNT4LS389N | 01698 | 1820-1209 |
| SNT4H53N | 01698 | 1820-0380 | SNT4LS162AN | 01698 | 1820-1431 | SNT4LS390D | 01698 | 1820-5311 |
| SNT4H54N | 01698 | 1820-0381 | SNT4LS163AN | 01698 | 1820-1432 | SNT4LS393D | 01698 | 1820-4789 |
| SNT4H55N | 01698 | 1820-0382 | SNT4LS163AN | 01698 | 1820-7679 | SNT4LS393N | 01698 | 1820-2096 |
| SNT4H60N | 01698 | 1820-0383 | SNT4LS164D | 01698 | 1820-4680 | SNT4LS395AN | 01698 | 1820-1446 |
| SNT4H61N | 01698 | 1820-0384 | SNT4LS164N | 01698 | 1820-1143 | SNT4LS396N | 01698 | 1820-2026 |
| SNT4H62N | 01698 | 1820-0385 | SNT4LS164N | 01698 | 1820-3837 | SNT4LS396N | 01698 | 1820-2384 |
| SNT4H72N | 01698 | 1820-0387 | SNT4LS165AD | 01698 | 1820-5239 | SNT4LS422N | 01698 | 1820-2964 |
| SNT4H73N | 01698 | 1820-0391 | SNT4LS165AN | 01698 | 1820-1975 | SNT4LS423N | 01698 | 1820-2958 |
| SNT4H74N | 01698 | 1820-0512 | SNT4LS166AD | 01698 | 1820-5313 | SNT4LS42N | 01698 | 1820-1418 |
| SNT4H76N | 01698 | 1820-0752 | SNT4LS166AN | 01698 | 1820-1922 | SNT4LS44N | 01698 | 1820-3650 |
| SNT4H87N | 01698 | 1820-0740 | SNT4LS169AN | 01698 | 1820-2460 | SNT4LS44N | 01698 | 1820-2759 |
| SNT4HCOOD | 01698 | 1820-6162 | SNT4LS170N | 01698 | 1820-1436 | SNT4LS46N | 01698 | 1820-3621 |
| SNT4HCOUD | 01698 | 1820-5220 | SNT4LS174N | 01698 | 1820-1196 | SNT4LS47N | 01698 | 1820-1602 |
| SNT4HC05D | 01698 | 1820-5802 | SNT4LS174N | 01698 | 1820-1914 | SNT4LS48N | 01698 | 1820-1604 |
| SNT4HC05N | 01698 | 1820-4053 | SNT4LS174N | 01698 | 1820-3694 | SNT4LS49N | 01698 | 1820-2078 |
| SNT4HC08D | 01698 | 1820-1693 | SNT4LS175N | 01698 | 1820-1195 | SNT4LS55N | 01698 | 1820-1284 |
| SNT4HC14N | 01698 | 1820-1675 | SNT4LS181N | 01698 | 1820-1280 | SNT4LS55N | 01698 | 1820-5184 |
| SNT4HC14D | 01698 | 1820-5709 | SNT4LS182N | 02037 | 1820-2563 | SNT4LS551N | 01698 | 1820-1210 |
| SNT4HC16D | 01698 | 1820-5714 | SNT4LS190N | 01698 | 1820-1279 | SNT4LS553N | 01698 | 1820-3496 |
| SNT4HC166N | 01698 | 1820-4149 | SNT4LS191N | 01698 | 1820-1278 | SNT4LS554N | 01698 | 1820-2719 |
| SNT4HC190DW | 01698 | 1820-5806 | SNT4LS192N | 01698 | 1820-1277 | SNT4LS554N | 01698 | 1820-2711 |
| SNT4HC190N | 01698 | 1820-4054 | SNT4LS193N | 01698 | 1820-1419 | SNT4LS554N | 01698 | 1820-1285 |
| SNT4HC191DW | 01698 | 1820-5751 | SNT4LS194D | 01698 | 1820-4267 | SNT4LS555N | 01698 | 1820-4262 |
| SNT4HC21N | 01698 | 1820-3793 | SNT4LS194FN | 01698 | 1820-3902 | SNT4LS589N | 01698 | 1820-4644 |
| SNT4HC238N | 01698 | 1820-5559 | SNT4LS194N | 01698 | 1820-1276 | SNT4LS590N | 01698 | 1820-5681 |
| SNT4HC258N | 01698 | 1820-4676 | SNT4LS195AD | 01698 | 1820-7622 | SNT4LS590N | 01698 | 1820-3144 |
| SNT4HC353N | 01698 | 1820-6354 | SNT4LS195N | 01698 | 1820-1205 | SNT4LS592D | 01698 | 1820-5832 |
| SNT4HC368D | 01698 | 1820-7668 | SNT4LS196N | 01698 | 1820-1300 | SNT4LS592N | 01698 | 1820-3167 |
| SNT4HC377DW | 01698 | 1820-5807 | SNT4LS197N | 01698 | 1820-1293 | SNT4LS593N | 01698 | 1820-3160 |
| SNT4HC377N | 01698 | 1820-4208 | SNT4LS198N | 01698 | 1820-4187 | SNT4LS595N | 01698 | 1820-3423 |
| SNT4HC390DW | 01698 | 1820-7202 | SNT4LS20J | 01698 | 1820-2580 | SNT4LS596N | 01698 | 1820-3960 |
| SNT4HC490N | 01698 | 1820-4677 | SNT4LS20N | 01698 | 1820-1204 | SNT4LS597N | 01698 | 1820-3536 |
| SNT4HC590AN | 01698 | 1820-6494 | SNT4LS219AN | 01698 | 1820-1538 | SNT4LS598N | 01698 | 1820-4553 |
| SNT4HC594DW | 01698 | 1820-6354 | SNT4LS21N | 01698 | 1820-1205 | SNT4LS599N | 01698 | 1820-3022 |
| SNT4HC595N | 01698 | 1820-6287 | SNT4LS221D | 01698 | 1820-5656 | SNT4LS601N | 01698 | 1820-3990 |
| SNT4HC623N | 01698 | 1820-6907 | SNT4LS221J | 01698 | 1820-2346 | SNT4LS603AN | 01698 | 1820-4489 |
| SNT4HC652NT | 01698 | 1820-5023 | SNT4LS221N | 01698 | 1820-1437 | SNT4LS604N | 01698 | 1820-2722 |
| SNT4HC682N | 01698 | 1820-4179 | SNT4LS224N | 01698 | 1820-4239 | SNT4LS606N | 01698 | 1820-3161 |
| SNT4HC7001N | 01698 | 1820-4719 | SNT4LS224N | 01698 | 1820-1917 | SNT4LS612FN | 01698 | 1820-6904 |
| SNT4HC805N | 01698 | 1820-4719 | SNT4LS240N | 01698 | 1820-1917 | SNT4LS612N | 01698 | 1820-4374 |
| SNT4HCCT137N | 01698 | 1820-4771 | SNT4LS241N | 01698 | 1820-1918 | SNT4LS620N | 01698 | 1820-2723 |
| SNT4HCCT240DW | 01698 | 1820-4737 | SNT4LS242N | 01698 | 1820-2104 | SNT4LS621N | 01698 | 1820-2967 |
| SNT4HCCT573N (SELECTED) | 01698 | 1820-4150 | SNT4LS243N | 01698 | 1820-1994 | SNT4LS623N | 01698 | 1820-2672 |
| SNT4HCCT574N | 01698 | 1820-5077 | SNT4LS244N | 01698 | 1820-2024 | SNT4LS624D | 01698 | 1820-5001 |
| SNT4HCCT646NT | 0169 | | | | | | | |

| Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N |
|-------------|-------|-----------|---------------------|-------|-----------|-------------------------------|-------|-----------|
| SN74LS673N | 01698 | 1820-2313 | SN75123N | 01698 | 1820-3539 | ST93C46AM1 | 04078 | 1818-4895 |
| SN74LS674N | 01698 | 1820-3669 | SN75129N | 01698 | 1820-3540 | STT1LFMM-222 | 07397 | 1813-0603 |
| SN74LS682N | 01698 | 1820-2713 | SN75146P | 01698 | 1820-6446 | SW-01FQ | 02180 | 1826-0811 |
| SN74LS684N | 01698 | 1820-3305 | SN75150P | 01698 | 1820-1075 | SW-02FQ | 02180 | 1826-0796 |
| SN74LS686NT | 01698 | 1820-2610 | SN75152N | 01698 | 1820-3379 | SW-06GP | 02180 | 1826-1086 |
| SN74LS691N | 01698 | 1820-2937 | SN75153N | 01698 | 1820-3302 | SW-06GQ | 02180 | 1826-1186 |
| SN74LS697N | 01698 | 1820-3352 | SN75155D | 01698 | 1820-4943 | SW-202GP | 02180 | 1826-1774 |
| SN74LS699N | 01698 | 1820-3771 | SN75157P | 01698 | 1820-3304 | SW-219 | 03170 | 1826-1924 |
| SN74LS73AN | 01698 | 1820-1574 | SN75159N | 01698 | 1820-2362 | SY10422-3HCF | 13130 | 1816-1728 |
| SN74LS74AJ | 01698 | 1820-1668 | SN75160AN | 01698 | 1820-2485 | SYP2111A | 01795 | 1818-1813 |
| SN74LS74AN | 01698 | 1820-1112 | SN75161AN | 01698 | 1820-2483 | SZA266 | 02037 | 1826-0507 |
| SN74LS75N | 01698 | 1820-1411 | SN75162AN | 01698 | 1820-2547 | T7220-EC | 11967 | 1820-6858 |
| SN74LS76AN | 01698 | 1820-2464 | SN75172N | 01698 | 1820-4735 | TACT2150-3ONT | 01698 | 1820-6142 |
| SN74LS79AN | 04092 | 1820-3868 | SN75173N | 01698 | 1820-4734 | TBF18S03ON | 01698 | 1816-1153 |
| SN74LS83AN | 01698 | 1820-0910 | SN75174DW | 01698 | 1820-6581 | TBF18S03ON | 01698 | 1816-1571 |
| SN74LS85D | 01698 | 1820-4255 | SN75174N (SELECTED) | 01698 | 1820-2703 | TBF18SA03ON | 01698 | 1816-1174 |
| SN74LS85FN | 01698 | 1820-3897 | SN75174N (SELECTED) | 01698 | 1820-2831 | TBF24SA1ON | 01698 | 1816-1358 |
| SN74LS85N | 01698 | 1820-1119 | SN75175D | 01698 | 1820-5547 | TBF28L22J | 01698 | 1816-1547 |
| SN74LS86AJ | 01698 | 1820-2587 | SN75175N | 01698 | 1820-4138 | TBF28L22N DISCONTINUED IN USA | 01698 | 1816-1388 |
| SN74LS86AN | 01698 | 1820-1211 | SN75176AP | 01698 | 1820-4461 | TBF28S42J | 01698 | 1816-1008 |
| SN74LS89N | 01698 | 1820-1490 | SN75176BD | 01698 | 1820-5548 | TBF28S42N | 01698 | 1816-1055 |
| SN74LS91N | 01698 | 1820-1784 | SN75179AP | 01698 | 1820-3333 | TBF28S6N | 01698 | 1816-1329 |
| SN74LS92N | 01698 | 1820-1420 | SN75186FN | 01698 | 1820-6148 | TC40H000P | 06354 | 1820-2909 |
| SN74LS93N | 01698 | 1820-1478 | SN75188D | 01698 | 1820-5328 | TC40H002P | 06354 | 1820-2908 |
| SN74LS95BN | 01698 | 1820-1283 | SN75207BN | 01698 | 1820-6332 | TC40H032P | 06354 | 1820-3120 |
| SN74LS96N | 01698 | 1820-1421 | SN75207N | 01698 | 1820-6215 | TC40H076P | 06354 | 1820-3001 |
| SN74LS99N | 01698 | 1820-0681 | SN75234N | 01698 | 1820-2134 | TC40H138P | 06354 | 1820-2907 |
| SN74S02N | 01698 | 1820-1322 | SN75322N | 01698 | 1820-1673 | TC40H245P | 06354 | 1820-3015 |
| SN74S02N | 01698 | 1820-3840 | SN75325N | 01698 | 1820-2361 | TC40H373P | 06354 | 1820-2824 |
| SN74S03N | 01698 | 1820-0682 | SN75327N | 01698 | 1820-1887 | TC40H374P | 06354 | 1820-2825 |
| SN74S04N | 01698 | 1820-0683 | SN75361AP | 01698 | 1820-1887 | TC511000AJ-10 (or -80) | 06354 | 1818-4138 |
| SN74S05N | 01698 | 1820-0684 | SN75363N | 01698 | 1820-1982 | TC511000AJ-80 | 06354 | 1818-4511 |
| SN74S08N | 01698 | 1820-1367 | SN75365N | 01698 | 1820-2570 | TC511000AP-10 (or -80) | 06354 | 1818-4032 |
| SN74S08N | 01698 | 1820-3839 | SN75367N | 01698 | 1820-1611 | TC511000AP-10 (or -80) | 06354 | 1818-4033 |
| SN74S09N | 01698 | 1820-1448 | SN75407P | 01698 | 1820-3189 | TC511000AZ-10 (or -80) | 06354 | 1818-4528 |
| SN74S11N | 01698 | 1820-0685 | SN75417NE | 01698 | 1820-2181 | TC511001A2-70 | 06354 | 1818-4721 |
| SN74S112D | 01698 | 1820-5238 | SN75435NE | 01698 | 1820-6754 | TC511001AJ-10 (or -80) | 06354 | 1818-4051 |
| SN74S112FN | 01698 | 1820-3913 | SN75437ANE | 01698 | 1820-3845 | TC511001AJ-10 (or -80) | 06354 | 1818-4409 |
| SN74S112N | 01698 | 1820-0629 | SN75446P | 01698 | 1820-3524 | TC511001AP-10 (or -80) | 06354 | 1818-4035 |
| SN74S113N | 01698 | 1820-0695 | SN75447P | 01698 | 1820-2715 | TC511001AP-10 (or -80) | 06354 | 1818-4034 |
| SN74S114N | 01698 | 1820-0696 | SN75450BN | 01698 | 1820-0908 | TC511003-10 | 06354 | 1818-4612 |
| SN74S115N | 01698 | 1820-0686 | SN75451BP | 01698 | 1820-0535 | TC511003-80 | 06354 | 1818-4613 |
| SN74S124N | 01698 | 1820-1324 | SN75452B2G | 01698 | 1820-1801 | TC511002-80 | 06354 | 1818-4813 |
| SN74S132N | 01698 | 1820-1307 | SN75452BP | 01698 | 1820-0799 | TC511011-10 | 06354 | 1818-4614 |
| SN74S132N | 01698 | 1820-3838 | SN75453BP | 01698 | 1820-1016 | TC511011-80 | 06354 | 1818-4615 |
| SN74S133D | 01698 | 1820-5319 | SN75454BP | 01698 | 1820-1050 | TC51256AJ-10 (or -80) | 06354 | 1818-4133 |
| SN74S133N | 01698 | 1820-1130 | SN75461P | 01698 | 1820-2044 | TC51256AJ-10 (or -80) | 06354 | 1818-4251 |
| SN74S134N | 01698 | 1820-1306 | SN75463P | 01698 | 1820-2520 | TC51256AJ-70 | 06354 | 1818-4688 |
| SN74S135N | 01698 | 1820-1639 | SN75468N | 01698 | 1820-2111 | TC51256AJ-80 | 06354 | 1818-4510 |
| SN74S138N | 01698 | 1820-1240 | SN75469N | 01698 | 1820-2243 | TC51256AP-10 | 06354 | 1818-4037 |
| SN74S139N | 01698 | 1820-1072 | SN75471P | 01698 | 1820-2207 | TC51256AP-10 (or -80) | 06354 | 1818-4036 |
| SN74S140N | 01698 | 1820-0697 | SN75473P | 01698 | 1820-2850 | TC51256AP-80 | 06354 | 1818-4584 |
| SN74S151D | 01698 | 1820-6405 | SN75477D | 01698 | 1820-5568 | TC51256AP-80 (or -80) | 06354 | 1818-4433 |
| SN74S151N | 01698 | 1820-1319 | SN75477P | 01698 | 1820-2110 | TC51256AZ-70 | 06354 | 1818-4722 |
| SN74S153N | 01698 | 1820-0998 | SN75478P | 01698 | 1820-3959 | TC51256AZ-80 | 06354 | 1818-4645 |
| SN74S157N | 01698 | 1820-1077 | SN75491N | 01698 | 1820-1230 | TC51258AP-80 | 06354 | 1818-4861 |
| SN74S158N | 01698 | 1820-1015 | SN75492N | 01698 | 1820-1231 | TC514400ASJL-80 | 06354 | 1818-4910 |
| SN74S159N | 01698 | 1820-5682 | SN75497N | 01698 | 1820-2186 | TC514400J-10 | 06354 | 1818-4610 |
| SN74S159N | 01698 | 1820-0687 | SN75512BN | 01698 | 1820-6793 | TC514400J-20 | 06354 | 1818-4611 |
| SN74S162N | 01698 | 1820-1452 | SN75518FN | 01698 | 1820-5330 | TC514400Z-80 | 06354 | 1818-4805 |
| SN74S163J | 01698 | 1820-1542 | SN75518N | 01698 | 1820-5186 | TC51832PL-10 | 06354 | 1818-4535 |
| SN74S163N | 01698 | 1820-1942 | SN75518W | 01698 | 1820-5186 | TC51832PL-85 | 06354 | 1818-4602 |
| SN74S168N | 01698 | 1820-1454 | SN75518DN | 01698 | 1820-6176 | TC524256AZ-10 | 06354 | 1818-4585 |
| SN74S169J | 01698 | 1820-1943 | SN755161DW | 01698 | 1820-6176 | TC524258AJ-10 | 06354 | 1818-4961 |
| SN74S169N | 01698 | 1820-1455 | SN755161N | 01698 | 1820-6045 | TC528126AJ-10 | 06354 | 1818-4809 |
| SN74S174N | 01698 | 1820-1076 | SN755162DW | 01698 | 1820-6175 | TC528128AJ-10 | 06354 | 1818-4810 |
| SN74S175N | 01698 | 1820-1191 | SN755162N | 01698 | 1820-6366 | TC541000AP-20 | 06354 | 1818-4527 |
| SN74S181J | 01698 | 1820-1974 | SN755164DW | 01698 | 1820-7601 | TC54256FAF-15 | 06354 | 1818-4741 |
| SN74S181N | 01698 | 1820-0999 | SN755164N | 01698 | 1820-7337 | TC544000P-15 | 06354 | 1818-4931 |
| SN74S182N | 01698 | 1820-1305 | SN755164N | 01698 | 1820-5102 | TC551001PL-10 | 06354 | 1818-4942 |
| SN74S189N | 01698 | 1816-0724 | SN755198DR | 01698 | 1820-6826 | TC551001PL-85 | 06354 | 1818-4953 |
| SN74S194N | 01698 | 1820-1304 | SN76194N | 01698 | 1820-3593 | TC55144APL-3 | 06354 | 1818-1814 |
| SN74S195N | 01698 | 1820-1303 | SP1648MP | 01590 | 1820-2240 | TC55144P-10 | 06354 | 1818-1350 |
| SN74S196N | 01698 | 1820-1869 | SP16F60DG | 01590 | 1820-4448 | TC5517APL-2(SEL) | 06354 | 1818-3429 |
| SN74S197N | 01698 | 1820-1868 | SP370N | 02910 | 1820-0900 | TC5517CFL-20 | 06354 | 1818-4030 |
| SN74S200N | 01698 | 1816-0598 | SP374N | 02910 | 1820-0774 | TC5517CP-20 | 06354 | 1818-1968 |
| SN74S202N | 01698 | 1820-2621 | SP4800DP | 01590 | 1820-5685 | TC5518CP-20 | 06354 | 1818-1784 |
| SN74S224N | 01698 | 1820-0689 | SP616N | 02910 | 1820-0318 | TC5518CP-20 | 06354 | 1818-4017 |
| SN74S240N | 01698 | 1820-1633 | SP620N | 02910 | 1820-0078 | TC55257BFL-10 | 06354 | 1818-4484 |
| SN74S241N | 01698 | 1820-1624 | SP629N | 02910 | 1820-0319 | TC55257BFL-10 | 06354 | 1818-3932 |
| SN74S251N | 01698 | 1820-1302 | SP650N | 02910 | 1820-0320 | TC55257BFL-10 | 06354 | 1818-4017 |
| SN74S257N | 01698 | 1820-1301 | SP670N | 02910 | 1820-0302 | TC55328P-25 | 06354 | 1818-4693 |
| SN74S258N | 01698 | 1820-1361 | SP680N | 02910 | 1820-0303 | TC55416P-20 | 06354 | 1818-1981 |
| SN74S260N | 01698 | 1820-1275 | SP74HCT244N | 09283 | 1820-3501 | TC55416P-25 | 06354 | 1818-4569 |
| SN74S280N | 01698 | 1820-1638 | SP74HCT245N | 09283 | 1820-3502 | TC55417J-15 | 06354 | 1818-4642 |
| SN74S281N | 01698 | 1820-1456 | SP74HCT373N | 09283 | 1820-3503 | TC55417J-25 | 06354 | 1818-4676 |
| SN74S283D | 01698 | 1820-5131 | SP74HCT374N | 09283 | 1820-3504 | TC55417P-20 | 06354 | 1818-4478 |
| SN74S283N | 01698 | 1820-1871 | SP86028CBM | 01590 | 1820-5491 | TC55464J-17 | 06354 | 1818-4692 |
| SN74S289N | 01698 | 1816-0787 | SP86060B | 01590 | 1820-2933 | TC55464J-25 | 06354 | 1818-4672 |
| SN74S299N | 01698 | 1820-1457 | SP86118BDG | 01590 | 1820-2292 | TC55464P-20 | 06354 | 1818-4800 |
| SN74S303N | 01698 | 1820-1323 | SP8617BDG | 01590 | 1820-2338 | TC55465J-20 | 06354 | 1818-4821 |
| SN74S32N | 01698 | 1820-1449 | SP86208BDG | 01590 | 1820-2047 | TC55465J-25 | 06354 | 1818-4864 |
| SN74S373J | 04092 | 1820-2185 | SP864V7BDG | 01590 | 1820-1384 | TC55465P-25 | 06354 | 1818-4781 |
| SN74S373N | 01698 | 1820-1676 | SP86808BDG | 01590 | 1820-3517 | TC55465P-30 | 06354 | 1818-4582 |
| SN74S374N | 04092 | 1820-3830 | SP86858BDG | 01590 | 1820-5492 | TC55644FL-15 | 06354 | 1818-4225 |
| SN74S374N | 01698 | 1820-1677 | | | | | | |

| Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N |
|----------------------------|-------|-----------|-------------------|-------|-----------|---------------------|-------|-----------|
| TC74HC04AF | 06354 | 1820-4119 | TL081CD | 01698 | 1826-1636 | TMS4044-45NL | 01698 | 1818-1398 |
| TC74HC138AF | 06354 | 1820-4121 | TL081CJ | 01698 | 1826-1398 | TMS4050JL SELCTD | 01698 | 1818-0146 |
| TC74HC244AF | 06354 | 1820-4123 | TL082ACP | 01698 | 1826-0545 | TMS4103NC | 01698 | 1818-0102 |
| TC74HC245AF | 06354 | 1820-4124 | TL082CD | 01698 | 1826-1627 | TMS4161-15NL | 01698 | 1818-3498 |
| TC74HC374AF | 06354 | 1820-4122 | TL082CP | 01698 | 1826-0882 | TMS4164-15NL | 01698 | 1818-3483 |
| TC74HC4094P | 06354 | 1820-4443 | TL084ACN | 01698 | 1826-0572 | TMS4256-10FML | 01698 | 1818-4249 |
| TC74HC592P | 06354 | 1820-4995 | TL084BCN | 01698 | 1826-0538 | TMS4256-12FMLR | 01698 | 1818-4123 |
| TC74HC593P | 06354 | 1820-5421 | TL084CN | 01698 | 1826-0410 | TMS4257-12FPL | 01698 | 1818-3539 |
| TC74HC7292P | 06354 | 1820-5665 | TL170CLP | 01698 | 1826-0757 | TMS4416-12NL | 01698 | 1818-3540 |
| TC74HC744AF | 06354 | 1820-4120 | TL182CN | 01698 | 1826-0675 | TMS4416-15NL | 01698 | 1818-3214 |
| TCA2465A | 06121 | 1826-2189 | TL185CN | 01698 | 1826-1220 | TMS4461-10FML | 01698 | 1818-4250 |
| TCM222J | 01698 | 1820-5927 | TL3103CLU | 01698 | 1826-2164 | TMS4461-10NL | 01698 | 1818-4620 |
| TCM29C13DW | 01698 | 1820-6821 | TL376CNE | 01698 | 1826-0859 | TMS44C251-10SD | 01698 | 1818-4669 |
| TCM29C13N | 01698 | 1820-6785 | TL431ACD | 02037 | 1826-1643 | TMS6011NC | 01698 | 1820-1681 |
| TCM3105JE | 01698 | 1826-1512 | TL431ACP | 02037 | 1826-1258 | TP3071J | 03406 | 1820-6820 |
| TA01541AN | 02910 | 1826-2035 | TL431CD | 01698 | 1826-1601 | TP3076J | 03406 | 1820-6806 |
| TA01542N | 02910 | 1826-2036 | TL431CLP | 01698 | 1826-0643 | TP3155N | 03406 | 1820-6807 |
| TA02030V | 06358 | 1826-0996 | TL431CLP | 01698 | 1826-1115 | TP5089N | 03406 | 1820-6828 |
| TA02654 | 05946 | 1826-0960 | TL431CP | 01698 | 1826-1343 | TPB24S10N | 01698 | 1816-1137 |
| TA03047 | 02910 | 1826-1577 | TL4311LP | 01698 | 1826-1474 | TR1602A | 00575 | 1820-1219 |
| TA03303 | 02037 | 1826-1470 | TL4311P | 02037 | 1826-1843 | TR1602B-05 | 00575 | 1820-1911 |
| TA03566N | 02910 | 1826-2110 | TL494CD | 01698 | 1826-2048 | TR1863A | 00575 | 1820-2419 |
| TA04600 | 02037 | 1826-1146 | TL494CN | 01698 | 1826-0565 | TR1863B | 00575 | 1820-2423 |
| TA04601D | 06121 | 1826-1421 | TL497AC | 01698 | 1826-1830 | TR1865B | 00575 | 1820-2978 |
| TA04605 | 06121 | 1826-1908 | TL497CN | 01698 | 1826-0450 | TR1865P-00 | 00575 | 1820-3122 |
| TA04700 | 06121 | 1826-1141 | TL500ACN | 01698 | 1826-0651 | TSC500ACPE | 02763 | 1826-1891 |
| TA04700A | 06121 | 1826-1066 | TL5812N | 01698 | 1820-4951 | TSC911ACPA | 02763 | 1826-1500 |
| TA0471A | 06121 | 1826-1351 | TL592BD | 01698 | 1826-1874 | TSC913ACPA | 02763 | 1826-1916 |
| TA0525PN | 02910 | 1826-2207 | TL592D | 01698 | 1826-1769 | TSC914ACPD | 02763 | 1826-1937 |
| TA08173 | 06358 | 1826-1677 | TL592F | 01698 | 1826-1756 | TSC940WCJ | 02763 | 1820-3861 |
| TC0101B8C | 05057 | 1826-1112 | TL594IN | 01698 | 1826-1501 | TS685101P | 10881 | 1826-1632 |
| TC0107 | 05057 | 1826-1025 | TL601CP | 01698 | 1826-0476 | UA711DC | 02237 | 1826-0055 |
| TC0110J | 05057 | 1820-2452 | TL604IP | 01698 | 1820-1973 | UA711HC | 02237 | 1820-0125 |
| TC0123NTC2 | 05057 | 1826-2058 | TL607CP | 01698 | 1820-1948 | UA711HC SELECTED | 02237 | 1826-0063 |
| TC0144B7C | 05057 | 1826-0781 | TL610CP | 01698 | 1826-0477 | UA711HC | 02237 | 1826-0543 |
| TC0167B7C8 | 04507 | 1826-1705 | TL702MJ | 01698 | 1820-0396 | UA711LHC | 02237 | 1826-0574 |
| TC018DAC | 04507 | 1826-1294 | TL7700ACP | 01698 | 1826-1561 | UA714TC | 03406 | 1826-6503 |
| TC0404B6 | 04507 | 1826-1472 | TL7702A | 01698 | 1826-1245 | UA715HC | 02237 | 1820-0476 |
| TEA2018A | 10881 | 1826-1886 | TL7702ACD | 01698 | 1826-1685 | UA723DC | 02237 | 1826-0049 |
| TEA2037A | 10881 | 1826-1887 | TL7705A | 01698 | 1826-1338 | UA723HM | 02237 | 1826-0010 |
| THCT2000 | 01698 | 1820-4554 | TL7705ACD | 01698 | 1826-1897 | UA723PC | 02237 | 1820-0439 |
| THM361020S-80 | 06354 | 1818-4703 | TL7705BCP | 01698 | 1826-6504 | UA726HC | 02237 | 1826-0031 |
| THM362020S-80 | 06354 | 1818-4702 | TL7705CP-B | 01698 | 1826-1273 | UA733DC | 02237 | 1826-0064 |
| THM362500AS-80 | 06354 | 1818-4709 | TL7709ACP | 01698 | 1826-1829 | UA733HC | 02237 | 1826-1131 |
| THM365120AS-80 | 06354 | 1818-4710 | TL7712ACP | 01698 | 1826-2238 | UA734WCH | 02237 | 1820-0270 |
| TIBPA1168-6CN UNPRGMD | 01698 | 1820-8069 | TL7770-5CDW | 01698 | 1826-2198 | UA739DC | 02237 | 1826-0044 |
| TIBPA118N8-6CN UNPRGMD | 01698 | 1820-6502 | TL780-05C | 01698 | 1826-1104 | UA739PC | 02237 | 1826-0885 |
| TIBPA11L1H6P8-6CJT UNPRGMD | 01698 | 1820-6881 | TL780-15C | 01698 | 1826-1106 | UA740HC | 02237 | 1826-0056 |
| TIBPA11L1H6-10CN UNPRGMD | 01698 | 1820-5990 | TL783CK | 01698 | 1826-1062 | UA741HC | 02237 | 1820-0203 |
| TIBPA11L1H6-15CFN UNPRGMD | 01698 | 1820-5972 | TL25204ACD | 01698 | 1826-1214 | UA741LHC SELECTED | 02237 | 1826-0007 |
| TIBPA11L1H6-15CFN UNPRGMD | 01698 | 1820-6452 | TL2711ACD | 01698 | 1826-1213 | UA741LTC (SELECTED) | 02237 | 1820-0216 |
| TIBPA11L1H6-15CN UNPRGMD | 01698 | 1820-3996 | TL2721ACP | 01698 | 1826-1639 | UA741TC (SELECTED) | 02237 | 1820-0217 |
| TIBPA11L1H6-25CFN UNPRGMD | 01698 | 1820-5027 | TL2722ACP | 01698 | 1826-1286 | UA742WCH | 02237 | 1826-0262 |
| TIBPA11L1H6-25CN UNPRGMD | 01698 | 1820-5461 | TL274ACN | 01698 | 1826-1263 | UA747DC | 02237 | 1826-0184 |
| TIBPA11L1H6-5CFN UNPRGMD | 01698 | 1820-8047 | TL274BCN | 01698 | 1826-1919 | UA759T2C | 02237 | 1826-0531 |
| TIBPA11L1H6-7CFN UNPRGMD | 01698 | 1820-6843 | TL279CN | 01698 | 1826-2098 | UA759UIC | 02237 | 1826-0833 |
| TIBPA11L1H6-10CN UNPRGMD | 01698 | 1820-5773 | TL279CP | 01698 | 1826-1215 | UA760DC | 02237 | 1826-0132 |
| TIBPA11L1H6-12CN UNPRGMD | 12382 | 1820-6864 | TL27L7CP | 01698 | 1826-1611 | UA760HC | 02237 | 1826-0231 |
| TIBPA11L1H6-12CN UNPRGMD | 01698 | 1820-5420 | TL27M2ACD | 01698 | 1826-2018 | UA767TC | 02237 | 1826-0212 |
| TIBPA11L1H6-15CN UNPRGMD | 01698 | 1820-4052 | TL27M2ACP | 01698 | 1826-1269 | UA7805UC | 02237 | 1826-0122 |
| TIBPA11L1H6-25CFN UNPRGMD | 01698 | 1820-6028 | TL27M74ACN | 01698 | 1826-1264 | UA7812KC | 02237 | 1826-0117 |
| TIBPA11L1H6-7CN PRGMD | 01698 | 1820-6838 | TL27M74ID | 01698 | 1826-1571 | UA7812UC | 02237 | 1826-0099 |
| TIBPA11L1H6-10CN UNPRGMD | 01698 | 1820-5773 | TL27M55CD | 01698 | 1826-1602 | UA7812UIC | 02037 | 1826-0147 |
| TIBPA11L1H6-15CFN UNPRGMD | 01698 | 1820-5972 | TL2555CP | 01698 | 1826-1439 | UA7815KC SELECTED | 02237 | 1826-0725 |
| TIBPA11L1H6-15CN UNPRGMD | 01698 | 1820-4051 | TL2555D | 01698 | 1826-1610 | UA7815UC | 02237 | 1826-0106 |
| TIBPA11L1H6-25CFN UNPRGMD | 01698 | 1820-6027 | TM2210-2G8C | 04507 | 1820-6382 | UA7815UC (SELECTED) | 02237 | 1826-0617 |
| TIBPA11L1H6-25CN UNPRGMD | 01698 | 1820-5958 | TM1184 | 12147 | 1826-1595 | UA7824WC | 02237 | 1826-0262 |
| TIBPA11L1H6-7CN PRGMD | 01698 | 1820-7001 | TMW2015BP-10 | 06354 | 1818-3977 | UA7885C (SELECTED) | 02237 | 1826-1092 |
| TIBPA11L1H6-10CN UNPRGMD | 01698 | 1820-6566 | TMW2015BP-15 | 06354 | 1818-3976 | UA7885C | 02237 | 1826-0483 |
| TIBPA11L1H6-12CN UNPRGMD | 01698 | 1820-6565 | TMW2016AP-10 | 06354 | 1818-3519 | UA788GUIC | 02237 | 1826-0456 |
| TIBPA11L1H6-15CN UNPRGMD | 01698 | 1820-4050 | TMW2018AP-25 | 06354 | 1818-4312 | UA78905SC | 02237 | 1813-0100 |
| TIBPA11L1H6-25CFN UNPRGMD | 01698 | 1820-5028 | TMW2018AP-35 | 06354 | 1818-3667 | UA78912SC | 02237 | 1813-0093 |
| TIBPA11L1H6-25CN UNPRGMD | 01698 | 1820-5963 | TMW2018AP-45 | 06354 | 1818-3336 | UA78915KC | 02237 | 1813-0124 |
| TIBPA11L1H6-7CN UNPRGMD | 01698 | 1820-6740 | TMW2088P-45 | 06354 | 1818-4485 | UA7894GK | 02237 | 1813-0123 |
| TIBPAL20L10-20CNT UNPRGMD | 01698 | 1820-7471 | TMW2764AD-15 | 06354 | 1818-4377 | UA78L26AWC | 02237 | 1826-0460 |
| TIBPAL20L10-15CFN UNPRGMD | 01698 | 1820-7480 | TMW314AP-1 | 06354 | 1818-1824 | UA78L62AWC | 02237 | 1826-0586 |
| TIBPAL20L10-15CN UNPRGMD | 01698 | 1820-6364 | TMW2510-4JD | 01698 | 1820-3246 | UA78M06HC | 02237 | 1826-0349 |
| TIBPAL20L10-15NT UNPRGMD | 01698 | 1820-5663 | TMW2510-4NT | 01698 | 1820-5066 | UA78M12HC | 02237 | 1826-0226 |
| TIBPAL20L10-25NT UNPRGMD | 01698 | 1820-5988 | TMW2510-5JD | 01698 | 1820-3471 | UA78M12UIC | 02237 | 1826-0345 |
| TIBPAL20L10-25CN UNPRGMD | 01698 | 1820-7032 | TMW2516-35JL | 01698 | 1818-0851 | UA78M15HC | 02237 | 1826-0512 |
| TIBPAL20L10-7CNT UNPRGMD | 01698 | 1820-6542 | TMW2532-30JL | 01698 | 1818-1888 | UA78M9GHC | 02237 | 1826-0584 |
| TIBPAL20R4-15CFN UNPRGMD | 01698 | 1820-6543 | TMW2532-35JL | 01698 | 1818-1581 | UA78MGU1C | 02237 | 1826-0484 |
| TIBPAL20R4-15CN UNPRGMD | 01698 | 1820-5481 | TMW2532-45JL | 01698 | 1818-0762 | UA78PO5SC | 02237 | 1813-0361 |
| TIBPAL20R4-25CNT UNPRGMD | 01698 | 1820-5989 | TMW2532A-30 | 01698 | 1818-4117 | UA78S40PC | 02237 | 1826-0603 |
| TIBPAL20R4-7NT UNPRGMD | 01698 | 1820-7031 | TMW2532A-35 | 01698 | 1818-4118 | UA78S40PC | 02237 | 1826-1785 |
| TIBPAL20R6-15CFN UNPRGMD | 01698 | 1820-8088 | TMW2532AJL-45 | 01698 | 1818-4119 | UA7905UC | 02237 | 1826-0445 |
| TIBPAL20R6-15CNT UNPRGMD | 01698 | 1820-5429 | TMW2564-45JL | 01698 | 1818-1998 | UA7915KC | 02237 | 1826-0701 |
| TIBPAL20R6-5CFN PRGMD | 01698 | 1820-7049 | TMW2564L SELECTED | 01698 | 1818-1558 | UA7924KC | 01698 | 1826-0793 |
| TIBPAL20R6-15CNT UNPRGMD | 01698 | 1820-5462 | TMW2718-2JL | 01698 | 1818-4018 | UA7952UC | 02237 | 1826-0404 |
| TIBPAL20R6-25CNT UNPRGMD | 01698 | 1820-5981 | TMW2725-15JL | 01698 | 1818-4674 | UA799GK | 02237 | 1826-0444 |
| TIBPAL20R6-5CFN UNPRGMD | 01698 | 1820-7048 | TMW2725-2JL | 01698 | 1818-4007 | UA799GU1C | 02237 | 1826-0441 |
| TIBPAL22V10-35CNT UNPRGMD | 01698 | 1820-6180 | TMW2729-23 | 01698 | 1818-4435 | UA799HGC | 02237 | 1813-0127 |
| TIBPAL22V10-20CNT UNPRGMD | 01698 | 1820-6181 | TMW2751-17JL | 01698 | 1818-4643 | UA79M05AHC | 02237 | 1826-1938 |
| TIBPAL19L8CMT UNPRGMD | 01698 | 1820-5999 | TMW2751-2JL | 01698 | 1818-4368 | UA79M06AHC | 02237 | 1826-0300 |
| TIBPAL16L8-55CN UNPRGMD | 01698 | 1820-4044 | TMW2752-18NL | 01698 | 1818-4648 | UA79M08AHC | | |

| Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N | Desc. | Mfr. | HP P/N |
|-------------------------|-------|-----------|---------------------|-------|-----------|------------------------|-------|-----------|
| UC3841ON | 00046 | 1826-1340 | UPD1464V-15 | 00039 | 1818-4358 | X2212D | 10572 | 1818-3642 |
| UC3842AN | 02037 | 1826-1958 | UPD1210ZC-3 | 00039 | 1820-5767 | X2404P | 10572 | 1818-4015 |
| UC3843AN | 02037 | 1826-2029 | UPD43256AC-15L | 00039 | 1818-A086 | X2444P | 10572 | 1818-3555 |
| UC3844N | 00046 | 1826-2056 | UPD43256CGU-12L | 00039 | 1818-A107 | X2444S | 10572 | 1818-4708 |
| UC3846N | 00046 | 1826-1576 | UPD43256CGU-15L | 00039 | 1818-A217 | X2404P | 10572 | 1818-4718 |
| UC3901N | 00046 | 1826-1524 | UPD1362C-45 | 00039 | 1818-3978 | X2404S | 10572 | 1818-4681 |
| UC3906N | 00046 | 1826-1358 | UPD144C | 00039 | 1818-1346 | X2416P | 10572 | 1818-4382 |
| UC494AJ | 00046 | 1826-1039 | UPD144C-1 | 00039 | 1818-1330 | X2804AD-35 | 10572 | 1818-4198 |
| UCN-5800A | 04200 | 1820-3289 | UPD144C-3 | 00039 | 1818-3365 | X2804AD-45 | 10572 | 1818-3220 |
| UCN-5801A | 04200 | 1820-3165 | UPD144C-2 | 00039 | 1818-3181 | X2816AD | 10572 | 1818-4102 |
| UCN-5801A | 04200 | 1820-4568 | UPD144C-2 | 00039 | 1818-3536 | X2816AD-35 | 10572 | 1818-3366 |
| UCN-5810A | 04200 | 1820-5190 | UPD5555C | 00039 | 1826-1871 | X2816AD-45 | 10572 | 1818-3375 |
| UCN-5813A | 04200 | 1820-6964 | UPD65027 | 00039 | 1820-7029 | X2816ADI-45 | 10572 | 1818-3333 |
| UCN5821A | 04200 | 1820-6478 | UPD71065G | 00039 | 1820-5431 | X2816BZ-25 | 10572 | 1818-4739 |
| UDN-2543B | 04200 | 1820-4599 | UPD72065L | 00039 | 1820-5430 | X2816BP | 10572 | 1818-3164 |
| UDN-2585A | 04200 | 1820-4843 | UPD7210 | 00039 | 1820-4520 | X2816BP-20 | 10572 | 1818-4227 |
| UDN-2957A | 04200 | 1820-2755 | UPG110B | 00039 | 1826-2173 | X2816BP-25 | 10572 | 1818-4583 |
| UDN-2981A | 04200 | 1820-2273 | UPG501B | 00039 | 1820-6960 | X2816CJ-20 | 10572 | 1818-4960 |
| UDN-2982A | 04200 | 1820-2785 | UPG502B | 00039 | 1820-6959 | X28256P-35 | 10572 | 1818-4075 |
| UDN-2998W | 04200 | 1820-5253 | UPG707B | 00039 | 1820-6367 | X2864AD | 10572 | 1818-3499 |
| UDN-5703A | 04200 | 1820-2682 | USH5008-AI-K28 | 12717 | 1826-1971 | X28C256J-25 | 10572 | 1818-4869 |
| UDN-5706A | 04200 | 1820-2683 | UT-309 | 04200 | 1826-0868 | X28C256P-20 | 10572 | 1818-4653 |
| UDN-5707A | 04200 | 1820-2020 | UT0-517 | 03291 | 1813-0446 | X28C64J-25 | 10572 | 1818-4950 |
| UDN-6118A | 04200 | 1820-3421 | UT0-1502 | 03291 | 1826-1805 | X28C64S-20 | 10572 | 1818-4857 |
| UDN2993LB | 04200 | 1820-6715 | UT0-1524 | 03291 | 1826-1806 | X9103P | 10572 | 1826-2121 |
| UGN-3020T | 04200 | 1820-3243 | UT0-2012 | 03291 | 1813-0439 | X1C1736A-PD8C | 12404 | 1818-4621 |
| UHP-402 | 04200 | 1820-1120 | UT0-2013 | 03291 | 1826-1324 | X2C018-50PC84C UNPRGM | 12404 | 1820-5876 |
| UHP-407 | 04200 | 1820-2129 | UT0-2023 | 03291 | 1813-0445 | X2C018-70PC68C UNPRGM | 12404 | 1820-7014 |
| UHP-408 | 04200 | 1820-1086 | UT0-2024 | 03291 | 1813-0444 | X2C018-70PC84C UNPRGM | 12404 | 1820-5748 |
| ULN-2061N | 04200 | 1820-3512 | UT0-2027 (SELECTED) | 03291 | 1813-0516 | X3C020-50PC68C UNPRGM | 12404 | 1820-6557 |
| ULN-2061B | 04200 | 1820-2170 | UT0-507 | 03291 | 1813-0316 | X3C020-50PC84C UNPRGM | 12404 | 1820-7017 |
| ULN-2065B | 04200 | 1820-2473 | UT0-533 | 03291 | 1813-0447 | X3C030-70PC44C | 12404 | 1820-8151 |
| ULN-2068B | 04200 | 1820-2274 | UT0-561 | 03291 | 1813-0317 | X3C030-70PC84C UNPRGM | 12404 | 1820-6539 |
| ULN-2069B | 04200 | 1820-3637 | V12P5 | 11561 | 1813-0515 | X3C042-100PC84C UNPRGM | 12404 | 1820-7047 |
| ULN-2071B | 04200 | 1820-2130 | V6366B-J | 12276 | 1820-5222 | X3C042-100PC84C UNPRGM | 12404 | 1820-6833 |
| ULN-2111A | 04200 | 1826-0029 | V744ACT373P | 12128 | 1820-5750 | X3C042-50PC84C | 12404 | 1820-8078 |
| ULN-2114A | 04200 | 1820-2892 | V744ACT564P | 12128 | 1820-5746 | X3C042-70PC84 UNPRGM | 12404 | 1820-6533 |
| ULN-3701ZV | 04200 | 1826-1087 | V744ACT842P | 12128 | 1820-7689 | X7C9105CG | 02037 | 1826-0332 |
| ULN-3751Z | 04200 | 1826-2096 | V744ACT876P | 12128 | 1820-5749 | X7C9112CG | 02037 | 1826-0331 |
| ULN-8126A | 04200 | 1826-1507 | VCF628G | 05436 | 1826-1275 | XR-2207CP | 00350 | 1820-1648 |
| ULQ-2065B | 04200 | 1826-1505 | VFC32K2P | 05436 | 1826-0624 | XR-2209CN | 00350 | 1826-0873 |
| UM1500 | 04200 | 1820-0498 | VL83C11 | 11187 | 1820-5640 | XR-2209CP SELECTED | 00350 | 1826-1142 |
| UNG 3030U | 04200 | 1820-3644 | VP16VBE-25PC UNPRGM | 11187 | 1820-5668 | XR-2211CP | 00350 | 1826-1002 |
| UNL2068NE | 01698 | 1826-1710 | VP20VBE-25PC UNPRGM | 11187 | 1820-5669 | XR-2240 | 00350 | 1820-1628 |
| UPB581C | 00039 | 1820-7278 | VPS/5 (SELECTED) | 11561 | 1813-0514 | XR-2242CN | 00350 | 1820-2735 |
| UPB584Q | 00039 | 1820-6958 | VR-182A | 10321 | 1826-1136 | XR-8038CP | 00350 | 1826-2161 |
| UPB585G | 00039 | 1820-6957 | VT20C79-25JC | 11187 | 1818-4549 | XR-88C681/40CP | 00350 | 1826-1741 |
| UFC1473HA | 00039 | 1826-2186 | VT20C79-35JC | 11187 | 1818-4548 | XR-T5650N | 00350 | 1820-6829 |
| UPD2167D-2 | 00039 | 1818-3138 | WD1010BL | 00575 | 1820-3168 | XR-T5670CN | 00350 | 1820-5928 |
| UPD28664C-20 | 00039 | 1818-4716 | WD1100-13 | 00575 | 1820-3720 | XR-T5675CP | 00350 | 1820-4791 |
| UPD4016C-1 | 00039 | 1818-3298 | WD1943M-06 | 00575 | 1820-3134 | XR320 | 00350 | 1826-0237 |
| UPD4016C-3 | 00039 | 1818-4099 | WD9216PA01 | 00575 | 1820-4673 | XTR110AG | 05436 | 1826-1549 |
| UPD41102C-1 | 00039 | 1820-6286 | WD92C32PA00-02 | 00575 | 1820-6799 | Z50647A | 11825 | 1826-1496 |
| UPD41264C-12 | 00039 | 1818-4044 | WJ-A19-1-16 | 02686 | 1826-1588 | Z4A254DJ-10 | 01698 | 1818-4791 |
| UPD41264C-15 | 00039 | 1818-4043 | WJ-PA10-1 | 02686 | 1826-2120 | ZAD7210 | 11825 | 1826-1558 |
| UPD41464C-12 | 00039 | 1818-4073 | X2210D | 10572 | 1818-3165 | ZN106E | 06394 | 1826-1371 |
| UPD41464C-12/D41464C-12 | 00039 | 1818-3538 | X2210P | 10572 | 1818-3464 | | | |

("Service Notes," continued from page 5)

HP 8971B Noise Figure Test Set

Safety Service Note 8971B-01-S describes an incorrect size primary fuse for 220/240V operation. Serial numbers affected are 0000A00000/2716A00630. The incorrect value fuse is 1.25 amp and does not blow when the transformer secondary is shorted in the 220/240V operation mode.

The correct size fuse is 1.0 amp (HP P/N 2110-0001) and can be ordered from Hewlett-Packard. Also order a new adhesive-backed label for the rear panel (HP P/N 08971-80013) that contains the correct fuse value for 220/240V operation. The new label is applied directly over the silkscreened label on the rear panel.

HP 70004A Display

HP 70004A Displays with serial numbers 0000A00000/3020A00558 may have an insulated number wire on the solder side of the A4 Power Supply board assembly that does not meet HP safety standards. Please order Safety Service Note 70004A-06-S for more information. □

supplement to BENCH BRIEFS SERVICE NOTE INDEX

Important Notice about Service Notes

Service notes contain product-specific service information for Hewlett-Packard's electronic products. Subjects include product improvements, modifications, and procedures for troubleshooting, maintenance, and repair. Service Notes are published as appropriate throughout the life of a product. All new notes are announced in *Bench Briefs*.

Please note that Hewlett-Packard has restructured the procedure for handling and distributing instrument-related service notes through *Bench Briefs* and the microfiche program.

Bench Briefs

If you want to order a service note, refer to the list of service notes in the index, find the service note number belonging to the product you are interested in, and note the package number. Use the form on the last page of *Bench Briefs* to order the number that appears in the "service note package" column. You will receive a package of service notes that includes the one you ordered.

Microfiche

Service notes are still available on microfiche. The part numbers are:

| | |
|----------------|-----------|
| Library | 5951-6511 |
| Update service | 5951-6517 |

Please note that automatic shipments of the update service will no longer be made. If you want to continue to receive quarterly updates to the microfiche library, you must place a new order during the first month of each quarter (May, August, November, February). Note that inventory will be purged at the end of each quarter.

Contact your local HP sales/service office for more information. □

1990/91 Bench Briefs' Instrument Service Note Index

| SN Type | SN No. | Abstract | Service Note Package |
|------------|------------|---|-------------------------|
| MR | 105B-02 | Faulty RF connectors can cause intermittent failures | 027 |
| IO | 432C-05A | Graylex Industries offers to repair defective panel meter display module | 030 |
| MA | 436A-17A | Modification that will correct offsets in the power sensor (zero routine improvement) | 029 |
| MA | 436A-17 | Instructions on how to improve the zeroing margin of the power meter | 024 |
| MR | 437B-05 | Modification to correct "cannot zero" problem | 024 |
| MA | 438A-12A | Modification that will correct offsets in the power sensor (zero routine improvement) | 029 |
| MA | 438A-12 | Instructions on how to improve the zeroing margin of the power meter | 024 |
| IO | 1650A-08A | System Board service procedure when 10449A ACCENT upgrade kit is installed | 026 |
| IO | 1650A-10 | New Threshold Accuracy test no longer fails good boards; works in manual/auto | 028 |
| IO | 1650A-11 | New Performance Test 5 no longer fails good boards that meet min volt swing specs | 028 |
| PS | 1650A-12-S | Potentially defective internal ground can result in shock under certain cond | 028 |
| IO | 1650B-02 | New Threshold Accuracy test no longer fails good boards; works in manual/auto | 028 |
| IO | 1650B-03 | New Performance Test 5 no longer fails good boards that meet min volt swing specs | 028 |
| PS | 1650B-04-S | Potentially defective internal ground can result in shock under certain cond | 028 |
| IO | 1651A-08A | System Board service procedure when 10449A ACCENT upgrade kit is installed | 026 |
| IO | 1651A-10 | New Threshold Accuracy test no longer fails good boards; works in manual/auto | 028 |
| IO | 1651A-11 | New Performance Test 5 no longer fails good boards that meet min volt swing specs | 028 |
| PS | 1651A-12-S | Potentially defective internal ground can result in shock under certain cond | 028 |
| IO | 1651B-02 | New Threshold Accuracy test no longer fails good boards; works in manual/auto | 028 |
| IO | 1651B-03 | New Performance Test 5 no longer fails good boards that meet min volt swing specs | 028 |
| PS | 1651B-04-S | Potentially defective internal ground can result in shock under certain cond | 028 |
| IO | 1652B-01 | New Threshold Accuracy test no longer fails good boards; works in manual/auto | 028 |
| IO | 1652B-02 | New Performance Test 5 no longer fails good boards that meet min volt swing specs | 028 |
| IO | 1653B-01 | New Threshold Accuracy test no longer fails good boards; works in manual/auto | 028 |
| IO | 1653B-02 | New Performance Test 5 no longer fails good boards that meet min volt swing specs | 028 |
| IO | 1654B-01 | New Threshold Accuracy test no longer fails good boards; works in manual/auto | 028 |
| IO | 1654B-02 | New Performance Test 5 no longer fails good boards that meet min volt swing specs | 028 |
| PS | 1654B-03-S | Potentially defective internal ground can result in shock under certain cond | 028 |
| MA | 3324A-01 | New board revisions need new cable assemblies and vice versa | 024 |
| MR | 3325A-23 | Modification adds thermistor to prevent fuse blowing | 027 |
| MR | 3335A-13 | Recommended replacement of quartz oscillator thermal fuse to improve reliability | 027 |
| IO | 3458A-04 | Turn-on failure due to autostart subroutine malfunction | 026 |
| MR | 3458A-05 | Fixes, changes, & enhancements to outguard firmware (Rev 6.0) | 030 |
| MR | 3466A-20 | Mod prevents bad readings in ohms function when operated on battery power | 028 |
| IO | 3552A-19 | Preferred replacement capacitors and diodes | 028 |
| MR | 3562A-12 | Recommended modification extends battery life | 024 |
| MR | 3563A-02 | Recommended modification extends battery life | 024 |
| MR | 3577B-01 | Board mod prevents memory backup batt from discharging after only a few months | 028 |
| IO | 3580A-14 | Mods that must be made when replacing A7 Dig. Storage or A8 Control boards | 024 |
| MR | 3585B-01 | ROM upgrade improves marker noise level reading with gated sweep on | 030 |
| MR | 3588A-02A | Metal flakes on the motherboard may cause intermittent hardware errors | 027 |
| MR | 3588A-03 | Memory upgrade prevents system failures on units with firmware rev A.00.01 | 025 |
| IO | 3702B-54 | Instructions on cleaning attenuator switches | 024 |
| IO | 3710A-25 | Instructions on cleaning attenuator switches | 024 |
| IO | 3730A-07 | Instructions on cleaning attenuator switches | 024 |
| IO | 3776A-34A | Preferred replacement of A13U48 RAM on the processor assembly | 030 |
| IO | 3776A-38 | Preferred replacement of CR3-6 on the A6 analog receiver assembly | 024 |
| IO | 3776B-41A | Preferred replacement of A13U48 RAM on the processor assembly | 030 |
| IO | 3776B-45 | Preferred replacement of CR3-6 on the A6 analog receiver assembly | 024 |
| MA | 3787B-04F | Instructions on retrofitting additional features to older instruments | 024 |
| IO | 3787B-11 | Automatic performance test program for use with Series 200 controllers | 025 |
| IO | 3789B-06 | Instructions on upgrading older 3789Bs to current specs & options | 030 |
| MA | 3852A-03 | Power supply fuse replaced with new slow-blow fuse for improved reliability | 026 |
| IO | 3852A-04 | Recommended replacement power supply | 029 |
| MR | 4193A-05A | Modification to avoid unstable contacts on A20J11 and A20J12 | 026 |
| MR | 4193A-05 | Recommended replacement connectors to avoid unstable contact | 024 |
| MR | 4194A-10A | Modification to remedy blinking Overload lamp for test channel input | 028 |
| MR | 4194A-10 | Modification to remedy blinking overload lamp for test channel input | 026 |
| IO | 4274A-28 | Repair method for A11 and A12 boards | 027 |

| SN Type | SN No. | Abstract | Service Note Package |
|------------|-------------|--|-------------------------|
| IO | 4274A-29 | Preferred replacement for A11CR13/14 bridge diodes | 027 |
| IO | 4275A-24 | Repair method for A11 and A12 boards | 027 |
| IO | 4275A-25 | Preferred replacement for A11CR13/14 bridge diodes | 027 |
| MA | 4284A-10 | Modification to add the HP-IB Interface to Option 109 | 027 |
| MA | 4285A-01A | Opt 002 allows control of 42841A Bias Current Source & 42851A Prec Q Adpt | 028 |
| MR | 4285A-06 | ROM replacement so that instrument will measure 0 m cable length correction data | 025 |
| MA | 4285A-07 | Modification to add the HP-IB Interface to Option 109 | 027 |
| IO | 4329A-08 | Instructions on how to mount a new resistor on the A3 Power Supply Board | 025 |
| MA | 4934A-06A | Retrofit of special Option H05 increases monitor volume by approx 20 dB | 025 |
| IO | 4934A-07A | BT1 battery part number in manual is wrong; should be 1420-0378 | 024 |
| MR | 4934A-10 | Modification to prevent mains fuse failure during power on or off | 025 |
| IO | 4935A-15 | New preferred clamshell case halves for older instruments | 030 |
| IO | 4936A-13 | Preferred replacement diodes on receiver assembly | 024 |
| IO | 4936A-14 | Preferred replacement capacitors on receiver assembly in event of failure | 025 |
| IO | 4947A-09A | Preferred replacement of A13U48 RAM on the processor assembly | 030 |
| MR | 4947A-13 | Modification to correct erroneous output over HP-IB | 024 |
| MR | 4951B-06 | Modification to eliminate "hash" on the screen at turn-on and during run time | 027 |
| SA | 4951C-13-S | Earth ground/rear panel connection does not meet HP standards | 026 |
| MA | 4952A-12A | Firmware upgrade from Revision 1.0 to A.02.01 | 026 |
| MR | 4952A-13 | Firmware upgrade from Revision A.02.00 to A.02.01 | 026 |
| SA | 4952A-14-S | Earth ground/rear panel connection does not meet HP standards | 026 |
| IO | 4972A-06 | New CPU board upgrade and repair process | 026 |
| IO | 4972A-06 | Notification of new CPU board upgrade and repair | 025 |
| MR | 4991A-01 | Modification prevents power on lockup state due to hardware and firmware bugs | 026 |
| MR | 4991A-02 | Modification eliminates errors while determining segment length | 026 |
| MR | 4991A-03 | Modification to power supply output connector prevents intermittent power outages | 026 |
| MR | 4991A-04 | Modification eliminates node location problems during instrument operation | 026 |
| MR | 4991A-05 | Modification eliminates breaking power supply standoffs | 026 |
| MR | 4991A-06 | Modification prevents LanProbe software reset errors due to firmware bugs | 026 |
| MR | 4991A-07 | Modification to main board assembly connectors prevents intermittent power outages | 026 |
| MR | 4991A-08 | Modification eliminates inaccurate data being reported to system user | 026 |
| MR | 4991A-09 | Modification reduces wire tension on the line module connection points | 026 |
| MR | 4991A-10 | Modification to correct activity timeout | 027 |
| MR | 5061B-03 | Faulty RF connectors can cause intermittent failures | 027 |
| MR | 5061B-04 | Modification to prevent the A16 Clock Display assembly from skipping time | 028 |
| MR | 5065A-05 | Faulty RF connectors can cause intermittent failures | 027 |
| MR | 5314A-05 | Modification to fix "dead zone" problem at 10 MHz ± 20 Hz | 030 |
| MR | 5328A-42 | Recommended upgrading of fuses to eliminate needless fuse blowing | 030 |
| MR | 5328B-04 | Recommended upgrading of fuses to eliminate needless fuse blowing | 030 |
| IO | 5334B-06 | MATE Noncertification | 030 |
| MA | 5340A-22C | Preamp retrofit kit installation procedures for HP 5340A | 030 |
| IO | 5345A-42 | MATE Noncertification | 030 |
| MR | 5347A-04 | Modification so that instrument will pass German VDE Emissions Test | 025 |
| MA | 5347A-05 | Opt 006 Microwave Level Limiter provides extra power protection at high freq input | 028 |
| MR | 5348A-04 | Modification so that instrument will pass German VDE Emissions Test | 025 |
| MA | 5348A-05 | Opt 006 Microwave Level Limiter provides extra power protection at high freq input | 028 |
| IO | 5371A-14 | Recommended replacement zero dead time (ZDT) circuits | 029 |
| IO | 5372A-05 | Recommended replacement zero dead time (ZDT) circuits | 029 |
| PS | 54501A-05-S | Potentially defective internal ground can result in shock under certain cond | 028 |
| PS | 54502A-05-S | Potentially defective internal ground can result in shock under certain cond | 028 |
| PS | 54503A-04-S | Potentially defective internal ground can result in shock under certain cond | 028 |
| PS | 54504A-01-S | Potentially defective internal ground can result in shock under certain cond | 028 |
| IO | 6010A-05 | A1T3 Recommended replacement for A1T3 Bias Transformer | 030 |
| IO | 6011A-06 | A1T3 Recommended replacement for A1T3 Bias Transformer | 030 |
| IO | 6012B-04 | A1T3 Recommended replacement for A1T3 Bias Transformer | 030 |
| IO | 6015A-01 | A1T3 Recommended replacement for A1T3 Bias Transformer | 030 |
| IO | 6023A-01 | A1T3 Recommended replacement for A1T3 Bias Transformer | 030 |
| IO | 6030A-11 | A1T3 Recommended replacement for A1T3 Bias Transformer | 030 |
| IO | 6031A-13 | A1T3 Recommended replacement for A1T3 Bias Transformer | 030 |
| IO | 6032A-12 | A1T3 Recommended replacement for A1T3 Bias Transformer | 030 |
| IO | 6033A-09 | A1T3 Recommended replacement for A1T3 Bias Transformer | 030 |
| IO | 6035A-01 | A1T3 Recommended replacement for A1T3 Bias Transformer | 030 |
| IO | 6038A-07 | A1T3 Recommended replacement for A1T3 Bias Transformer | 030 |
| IO | 8082A-05 | Replacing boards requires new sockets or pins on other boards | 028 |
| IO | 8116A-09A | Illegal duty cycle display/frequency can not be increased above 999 kHz | 028 |

| SN Type | SN No. | Abstract | Service Note Package |
|------------|--------------|---|-------------------------|
| IO | 8161A-10 | Replacing boards requires new sockets or pins on other boards | 028 |
| IO | 8360A-01 | Troubleshooting procedure update to 8360 Series assembly level repair manuals | 024 |
| IO | 8510B-02 | Notification of a new CRT replacement kit and installation procedure | 024 |
| IO | 8510B-04 | Rec repl for the cloth antistatic wrist straps shipped with 8510 systems | 024 |
| IO | 8511A-03 | Notification of performance verification software revision to include 8360 sweepers | 024 |
| MR | 8511A-04 | High level noise specification change | 026 |
| MA | 8566B-10A | Option 462 retrofit kit | 026 |
| MR | 8566B-20 | Recommended replacement of two electrolytic capacitors in IF-display section | 024 |
| MR | 8567A-04 | Recommended replacement of two electrolytic capacitors in IF-display section | 024 |
| MR | 8568B-14 | Recommended replacement of two electrolytic capacitors in IF-display section | 024 |
| MR | 8640B-36 | Modification to prevent physical damage to RF oscillator filter feedthroughs | 026 |
| MA | 8660A-32 | Modification that changes Oven Cold indicator from incandescent to LED | 025 |
| MA | 8660A/B/C-01 | Modification that changes Oven Cold indicator from incandescent to LED | 024 |
| MA | 8660B-35 | Modification that changes Oven Cold indicator from incandescent to LED | 025 |
| MA | 8660C-14 | Modification that changes Oven Cold indicator from incandescent to LED | 025 |
| MR | 8671B-07 | Recommended replacement of quartz oscillator thermal fuses to improve reliability | 025 |
| MR | 8672A-24 | Recommended replacement of quartz oscillator thermal fuses to improve reliability | 025 |
| IO | 8673A-02 | List of part numbers for the A1A10 YIG Tuned Multipliers | 029 |
| IO | 8673B-02D | Firmware history | 028 |
| IO | 8673B-06B | New memory board and an EPROM are preferred replacements | 026 |
| IO | 8673B-07B | List of part numbers for the A1A10 YIG Tuned Multipliers | 029 |
| MR | 8673B-19A | Recommended replacement of quartz oscillator thermal fuses to improve reliability | 025 |
| MR | 8673B-20 | Recommended firmware upgrade corrects a problem in master/slave operation | 029 |
| IO | 8673C-02D | Firmware history | 028 |
| IO | 8673C-06B | New memory board and an EPROM are preferred replacements | 026 |
| IO | 8673C-08A | List of part numbers for the A1A10 YIG Tuned Multipliers | 029 |
| MR | 8673C-20 | Recommended firmware upgrade corrects a problem in master/slave operation | 029 |
| IO | 8673C-21 | Front panel assembly change | 030 |
| MR | 8673C-22 | Recommended replacement of quartz oscillator thermal fuses to improve reliability | 025 |
| IO | 8673D-02D | Firmware history | 028 |
| IO | 8673D-06A | New memory board and an EPROM are preferred replacements | 026 |
| IO | 8673D-09A | List of part numbers for the A1A10 YIG Tuned Multipliers | 029 |
| MR | 8673D-21 | Recommended firmware upgrade corrects a problem in master/slave operation | 029 |
| IO | 8673D-22 | Front panel assembly change | 030 |
| MR | 8673D-23 | Recommended replacement of quartz oscillator thermal fuses to improve reliability | 025 |
| IO | 8673E-01A | New memory board and an EPROM are preferred replacements | 026 |
| IO | 8673E-02A | Firmware history | 028 |
| MR | 8673E-12 | Recommended replacement of quartz oscillator thermal fuses to improve reliability | 025 |
| MR | 8673E-13 | Recommended firmware upgrade corrects a problem in master/slave operation | 029 |
| MR | 8673G-01 | Recommended replacement of quartz oscillator thermal fuses to improve reliability | 025 |
| IO | 8673G-02 | Firmware history | 028 |
| MR | 8673G-03 | Recommended firmware upgrade corrects a problem in master/slave operation | 029 |
| MR | 8673H-01 | Recommended replacement of quartz oscillator thermal fuses to improve reliability | 025 |
| IO | 8673H-02 | List of part numbers for the A1A10 YIG Tuned Multipliers | 029 |
| IO | 8673H-03 | Firmware history | 028 |
| MR | 8673H-04 | Recommended firmware upgrade corrects a problem in master/slave operation | 029 |
| MA | 8751A-01 | Option 001 provides a high stability frequency reference for the 8751A | 028 |
| IO | 8751A-02 | Recommended P/Ns to be used when replacing A1 CPU & A2 CPU I/O Cntl boards | 029 |
| MR | 8753B-02 | New firmware corrects problems found in previous revision | 027 |
| MA | 8753B-03 | New firmware provides additional features | 027 |
| MR | 8753C-01A | New firmware corrects problems found in previous revision | 027 |
| MA | 8753C-02 | New firmware provides additional features | 027 |
| MR | 8770A-21 | Recommended replacement of quartz oscillator thermal fuses to improve reliability | 024 |
| MR | 8770A-22 | Modification to replace C309 & C310 on the 08770-60050 DAC board assembly | 026 |
| IO | 8770A-23 | Perf verif test 4-9 correction, Sine Wave Output Power and Attenuator Accuracy | 026 |
| IO | 8780A-05C | A2 RF Output Amplifier troubleshooting and replacement procedure | 024 |
| IO | 8780A-05D | A2 RF Output Amplifier troubleshooting and replacement procedure | 028 |
| IO | 8780A-09A | Instructions for installing current bias adjusting resistor in interface driver board | 024 |
| MR | 8780A-13 | Recommended replacement of quartz oscillator thermal fuses to improve reliability | 024 |
| MR | 8901B-05 | Modification to resolve intermittent instrument lock-up at power-on | 024 |
| MR | 8902A-10 | Modification to resolve intermittent instrument lock-up at power-on | 024 |
| IO | 8903B/E-07 | Assembly exchange program for the 8903B and 8903E | 024 |
| SA | 8971B-01-S | Recommend changing fuse from 1.25 amp to 1.0 amp for 220/240 volt operation | 024 |
| IO | 8971B-02 | Troubleshooting hint for heater DAC readback failure | 025 |

| SN Type | SN No. | Abstract | Service Note Package |
|------------|-------------|---|-------------------------|
| MR | E2500A-03 | Recommended replacement of quartz oscillator thermal fuses to improve reliability | 024 |
| MA | E2500A-04A | System instrument on a disk (SID) software upgrades | 028 |
| MA | E2500A-04 | System instrument on a disk (SID) software upgrades | 025 |
| MR | E2500A-05 | Modification removes C309 & C310 from the 86791-60125 DAC motherboard assy | 026 |
| MR | 11848A-02 | Modification to eliminate peak in noise flatness test | 026 |
| MA | 16451A-01 | Instructions on mounting the Micrometer in the proper position | 028 |
| IO | 16500A-10 | 16500A software, version 3.00 or lower, gives false indication of RAM failures | 024 |
| IO | 16510A-03 | Modified Performance Test 5 provides more accurate test results | 027 |
| IO | 16510A-04A | New Threshold Accuracy test no longer fails good boards; works in manual/auto | 028 |
| IO | 16510A-04 | Modified Threshold Accuracy Test provides more accurate test results | 027 |
| IO | 16510B-02 | Modified Performance Test 5 provides more accurate test results | 027 |
| IO | 16510B-03A | New Threshold Accuracy test no longer fails good boards; works in manual/auto | 028 |
| IO | 16510B-03 | Modified Threshold Accuracy Test provides more accurate test results | 027 |
| MR | 37212B-02A | Firmware upgrade provides more reliable performance | 027 |
| MA | 37212B-02B | New firmware upgrade is available | 030 |
| IO | 37212B-03B | When replacing firmware, order a set of unique part numbers | 027 |
| IO | 37212B-04 | Preferred replacement of ROM A1U1 and microprocessor A1U6 | 030 |
| MR | 37900B/C-01 | New rear panel eliminates broken screws on rear panel of interf & sig cards | 028 |
| MR | 5372A-03 | Modification to prevent possible fuse failure | 028 |
| MR | 5372A-04 | Modification to prevent main rectifier failure | 028 |
| IO | 54501A-04 | Replacing the cabinet requires a new rear panel | 025 |
| MA | 54502A-04 | Repair procedure for instruments with Option 001 enhancements | 024 |
| IO | 54503A-03 | Repair procedure for instruments with Option 001 enhancements | 027 |
| MR | 60501A-03 | Modification reduces source turn-on current overshoot | 025 |
| MR | 60502A-03 | Modification reduces source turn-on current overshoot | 025 |
| MR | 60504A-03A | Modification to reduce source turn-on current overshoot | 029 |
| MR | 60504A-03A | Modification to reduce source turn-on current overshoot | 030 |
| MR | 60504A-03 | Modification reduces source turn-on current overshoot | 025 |
| MR | 70004A-01 | Firmware upgrade kit improves instrument performance and reliability | 025 |
| IO | 70004A-05 | Instructions on using an HP-HIL keyboard with the HP 70004 Display | 024 |
| SA | 70004A-06-S | Insulated jumper wire does not meet safety standards | 026 |
| IO | 70841A-01 | Unusual shock to the generator may cause intermittent clock or data outputs | 029 |
| IO | 70842A-01 | Unusual shock to the detector may cause intermittent clock or data outputs | 029 |
| MR | 70900A-27 | Enhanced Module Verification Software operating instructions - Error 7050 | 027 |
| MA | 70900B-03 | Modifications that may improve 40 kHz and 80 kHz spurious response | 024 |
| MR | 70900B-04 | New RAM/ROM assy eliminates "7050 Hardware Configuration Error" | 024 |
| MR | 70908A-08A | Module verification software modification | 024 |
| MR | 70908A-16 | Prevention of ROM checksum error | 026 |
| IO | 8116A-09 | Instructions on resetting instrument to clear illegal duty cycle display | 027 |
| IO | 83522A-07 | How to make new marker assy compatible with motherboard/AIC assy | 024 |
| IO | 83525A-07 | How to make new marker assy compatible with motherboard/AIC assy | 024 |
| MR | 83572C-01 | Modification to replace defective 2.4mm cables | 029 |
| MR | 83596A-02 | Modification to reduce sideband power, which improves performance | 027 |
| MR | 83597A-01 | Modification to prevent power supply shorting on the motherboard | 026 |
| MR | 83597A-02 | Modification to reduce sideband power, which improves performance | 027 |
| MR | 83597A-03 | Modification to replace defective 2.4mm cables | 029 |
| MR | 836XX-01 | Recommended modifications to improve reliability and performance | 024 |
| MA | 85629A-07C | Modification to upgrade HP 85629A to HP 85629B | 030 |
| MR | 85685A-18 | Recommended replacement A3 Attenuator with added limiter circuit | 024 |
| MR | 8662A-12D | Modification to prevent occurrence of Errors 03 and/or 04 | 028 |
| MR | 8663A-06D | Modification to prevent occurrence of Errors 03 and/or 04 | 028 |
| MR | 86792A-05A | Modification prevents Q6 from shorting on the 134 MHz Phase Lock Loop Assy A5 | 026 |
| MR | 86792A-05 | Modification prevents Q6 from shorting on the 134 MHz Phase Lock Loop Assy A5 | 025 |

Service Note Types

| | | | |
|----|--------------------------|----|------------------------|
| IO | Information Only | MA | Modification Available |
| MR | Modification Recommended | SA | Safety |
| PR | Priority Safety | | |

Service Note Order Form

If you want to order a service note, refer to the list of service notes in the index and find the service note number belonging to the product you are interested in. Using the form on this page, order the number that appears in the "service note package" column. You will receive a package of service notes that includes the one you ordered.

Hewlett-Packard
Worldwide Customer Support
Operation
100 Mayfield Ave.
Mtn. View, California 94043
Attn: Bench Briefs

NAME _____

COMPANY NAME _____

ADDRESS _____

CITY _____

STATE/COUNTRY _____ ZIP _____

Service Note Packages

- | | |
|------------------------------|------------------------------|
| <input type="checkbox"/> 024 | <input type="checkbox"/> 028 |
| <input type="checkbox"/> 025 | <input type="checkbox"/> 029 |
| <input type="checkbox"/> 026 | <input type="checkbox"/> 030 |
| <input type="checkbox"/> 027 | |

Please photocopy this order form if you do not want to cut off the page.

Hewlett-Packard (Canada) Ltd.
6877 Goreway Drive
Mississauga, Ontario L4V 1M8

BENCH BRIEFS
3RD & 4TH QUARTERS 1990
Volume 30 Numbers 3 & 4


Service Information from
Hewlett-Packard Company

To obtain a qualification form for a free subscription, send your request to the above address.

Reader comments or technical article contributions are welcomed.

Please send them to the Bench Briefs Editor at the above address.

Editor: Jim Bechtold
Hewlett-Packard

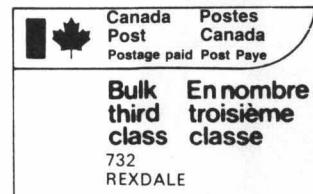

Postage Guaranteed if Undeliverable