


Device pinout

This section provides a detailed overview of the XBee module’s pinout for each layout, explaining the function and purpose of each pin to help you correctly integrate the device into your design.

Through-hole (TH) module

The following drawing shows the through-hole pin locations.

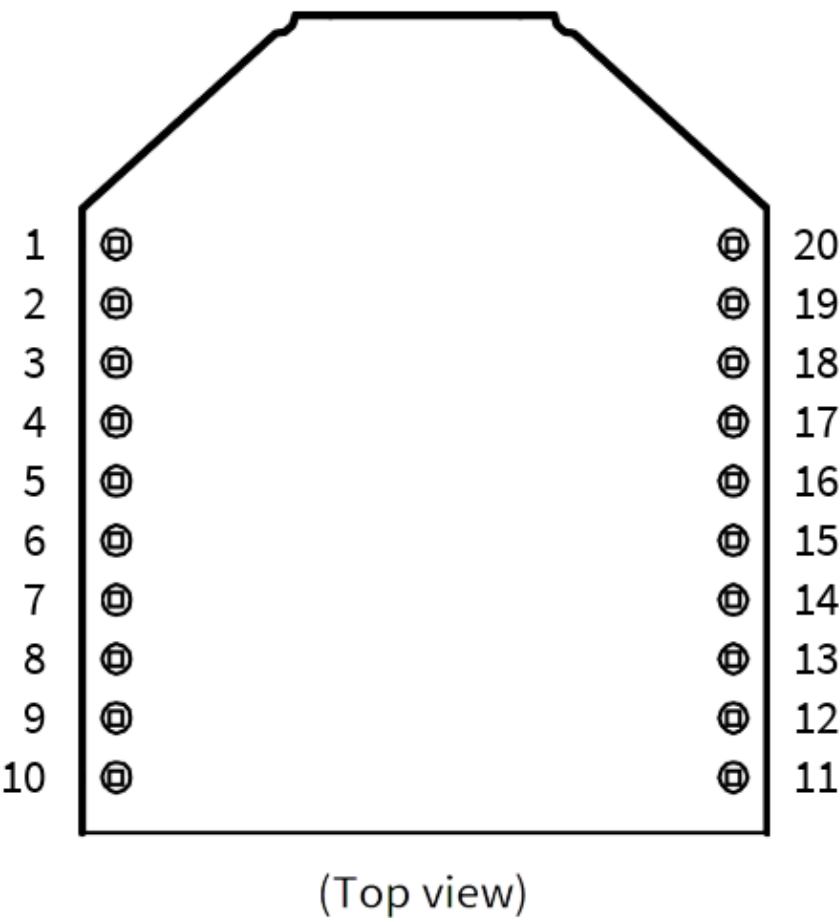

The following table shows the pin signals and their descriptions for the XBee 3 BLU through-hole device:

Pi n#	Name	Direction	Default state	Description
1	VCC	-	-	Power supply.
2	DOUT/DIO13	Both	Output	UART data out / GPIO.
3	DIN/CONFIG/DIO14	Both	Input	UART data in / GPIO.
4	DIO12/SPI_MISO	Both	-	GPIO/SPI data out.
5	RESET	Input	-	Device reset.
6	-	-	-	Connected to Pin 7 with 4.7 K resistor
7	-	-	-	Connected to Pin 6 with 4.7 K resistor
8	[reserved]	-	Disabled	Power supply.
9	DTR/SLEEP_RQ/DIO8	Both	Input	Pin sleep control Line / GPIO.
10	GND	-	-	Ground.
11	DIO4/SPI_MOSI	Both	Disabled	GPIO / Serial peripheral interface data in.
12	CTS/DIO7	Both	Output	Clear to send flow control / GPIO.
13	ON/SLEEP/DIO9	Both	Output	Device status indicator / GPIO.
14	[reserved]	-	Disabled	Do not connect or connect to Ground.

Pi n#	Name	Direction	Default state	Description
15	ASSOCIATE/DIO5	Both	Output	Associate Indicator / GPIO.
16	$\overline{\text{RTS}}$ /DIO6	Both	Input	Request to send flow control / GPIO.
17	AD3/DIO3/SPI_ $\overline{\text{SSE}}$ $\overline{\text{L}}$	Both	Disabled	Analog input / GPIO / SPI not select.
18	AD2/DIO2/SPI_CLK	Both	Disabled	Analog input / GPIO / SPI clock.
19	AD1/DIO1/SPI_ $\overline{\text{ATT}}$ $\overline{\text{N}}$ /I2C_SCL	-	-	Analog input/GPIO/SPI attention / I2C_SCL.
20	AD0/DIO0	Both	Input	Analog input/GPIO/Commissioning button.
Signal direction is specified with respect to the device.				



You must connect pins 4 and 7 together to enable I2C functionality on the device.

Micro-mount (MMT) module

The following drawing shows the micro-mount pin locations.