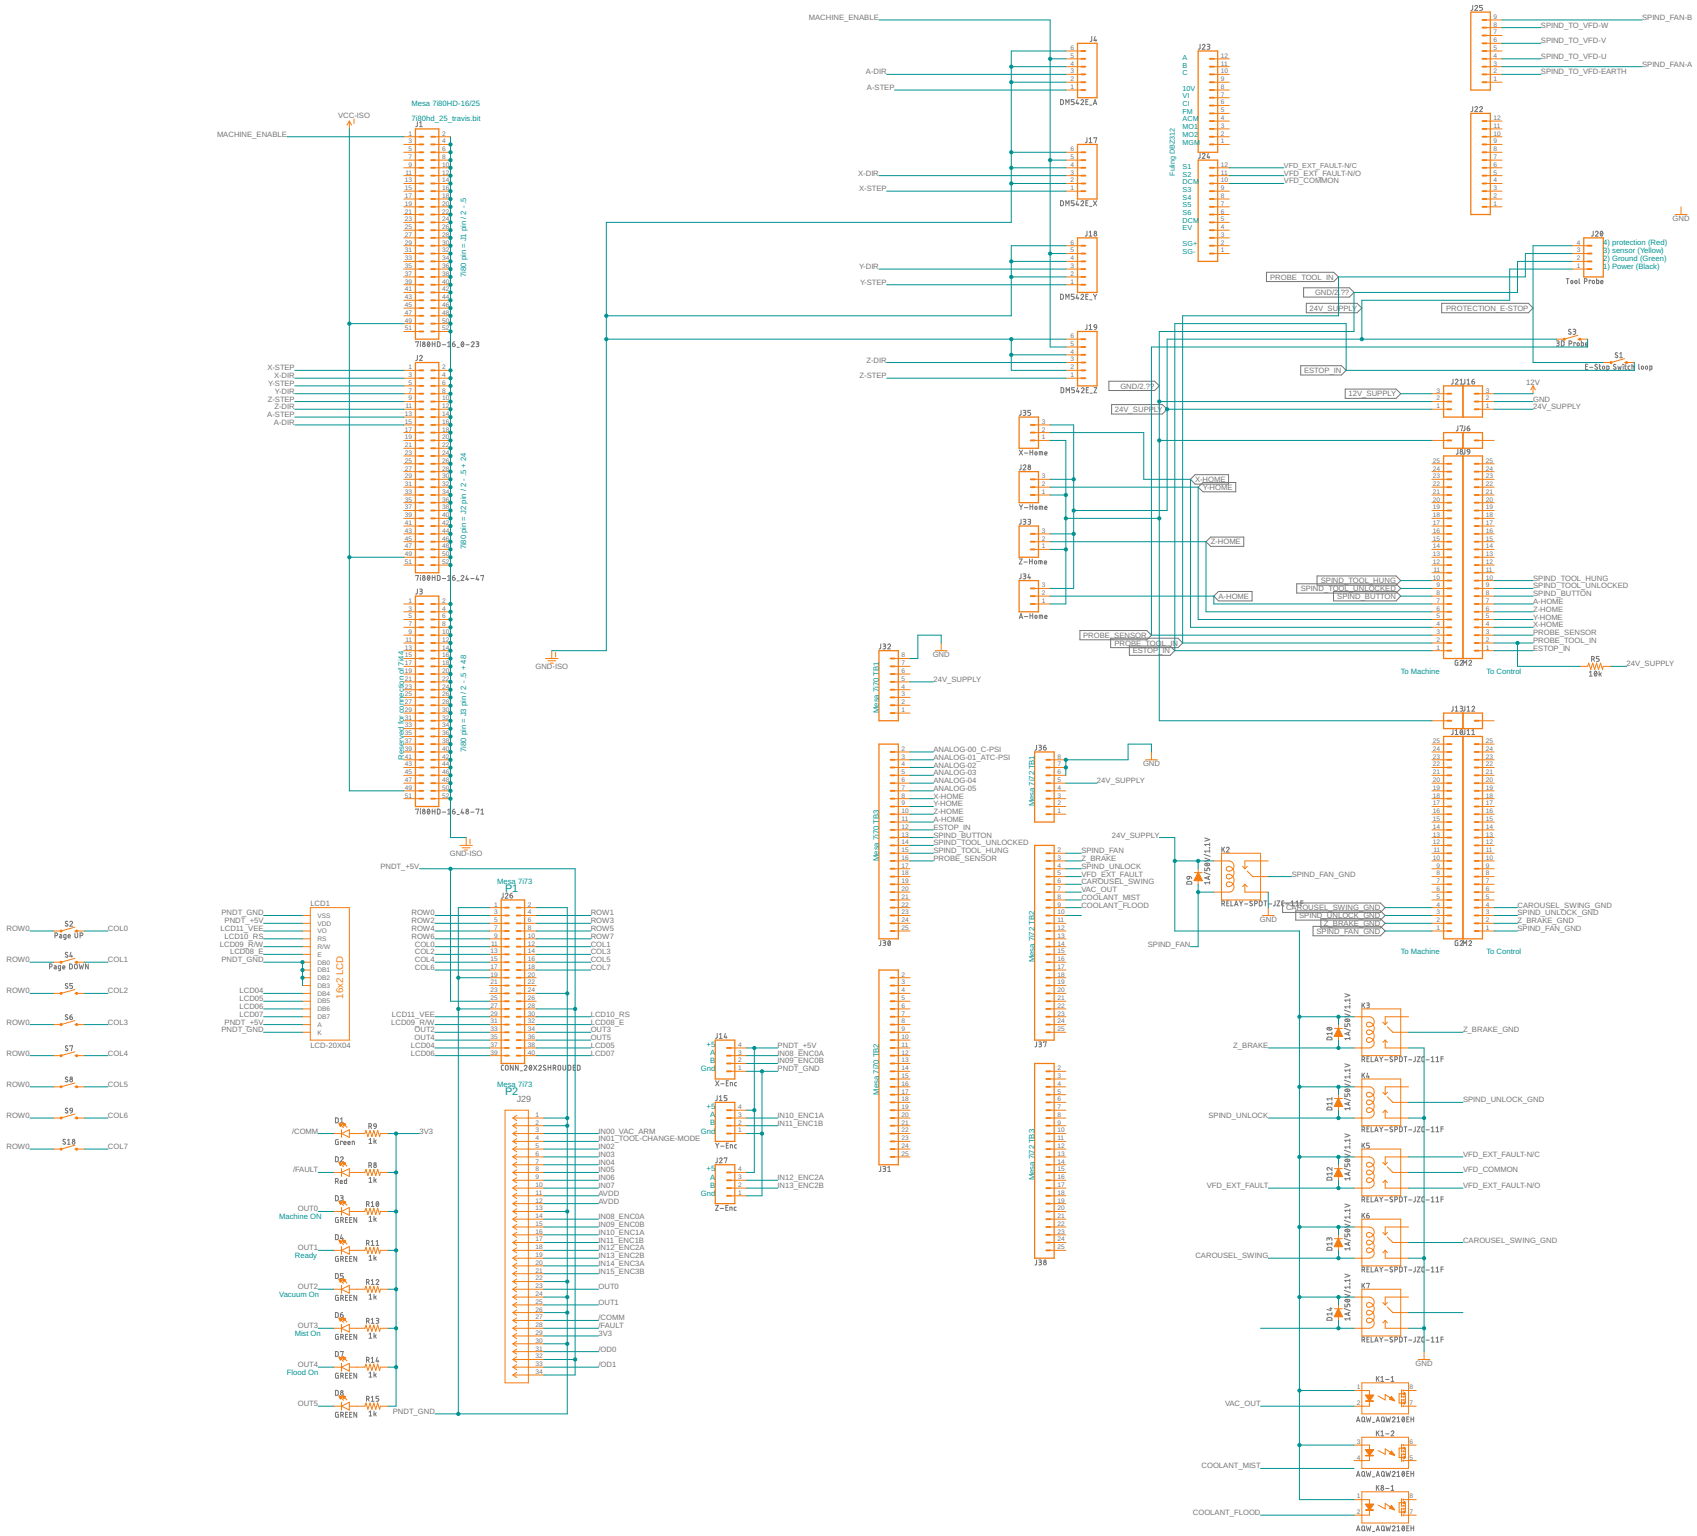
Mesa 7i80HD-16/25
7i80hd_25_travis.bit
MACHINE_ENABLE
VCC-ISO
GND-ISO
7i80HD-36_0-23
7i80HD-36_24-47
7i80HD-36_48-71
DM542E_A
DM542E_X
DM542E_Y
DM542E_Z
Fulling DM2312
VFD_EXT_FAULT-N/C
VFD_EXT_FAULT-N/O
VFD_COMMON
SPIND_TO_VFD-W
SPIND_TO_VFD-V
SPIND_TO_VFD-U
SPIND_TO_VFD-EARTH
SPIND_FAN-B
SPIND_FAN-A
Tool Probe
3D Probe
E-Stop Switch loop
PROBE_TOOL_IN
PROTECTION_E-STOP
ESTOP_IN
12V_SUPPLY
24V_SUPPLY
X-Home
Y-Home
Z-Home
A-Home
X-HOME
Y-HOME
Z-HOME
A-HOME
SPIND_TOOL_HUNG
SPIND_TOOL_UNLOCKED
SPIND_BUTTON
PROBE_SENSOR
To Machine
To Control
Mesa 7i80 TB1
Mesa 7i80 TB3
Mesa 7i72 TB1
Mesa 7i72 TB2
Mesa 7i72 TB3
Mesa 7i80 TB2
ANALOG-00_C-PSI
ANALOG-01_ATC-PSI
ANALOG-02
ANALOG-03
ANALOG-04
ANALOG-05
SPIND_FAN
Z_BRAKE
SPIND_UNLOCK
VFD_EXT_FAULT
CAROUSEL_SWING
VAC_OUT
COOLANT_MIST
COOLANT_FLOOD
SPIND_FAN_GND
CAROUSEL_SWING_GND
SPIND_UNLOCK_GND
Z_BRAKE_GND
RELAY-SPDT-JZC-11F
AQW_AQW210EH
LCD1
16x2 LCD
LCD-20X04
Mesa 7i73
CONN_20X2SHROUDED
X-Enc
Y-Enc
Z-Enc
Page UP
Page DOWN
Green
Red
Machine ON
Ready
Vacuum On
Mist On
Flood On
PNDT_+5V
PNDT_GND
3V3