



SHOP DRAWINGS — ELECTRICAL / AGL SCOPE

RECTIFICATION OF TWY E BETWEEN E4 & E6 (ADIA)
AGL WORKS AT THREE (3) MILLING LOCATIONS — FIELD CONDITION SCOPE

Document No.	[XXX-ELE-SHD-1001 / 1002 / 1003] · Revision P04 — PRINT / SUBMISSION ISSUE
Basis of scope	Field verification sheets: Document_3 (LOC-01) · Second_milling_area rev _1 (LOC-02/03)
Base layer	As-built AGL asset survey assets_20260726120533.xlsx — UTM 40N (EPSG:32640)
Sheets	1 of 4 Cover · 2 of 4 Location 1 · 3 of 4 Location 2 · 4 of 4 Location 3 · Annex A Scope Table
Prepared by	Mohammed — AGL Team Leader, ADB SAFEGATE AGL Team · Issued 28.07.2026

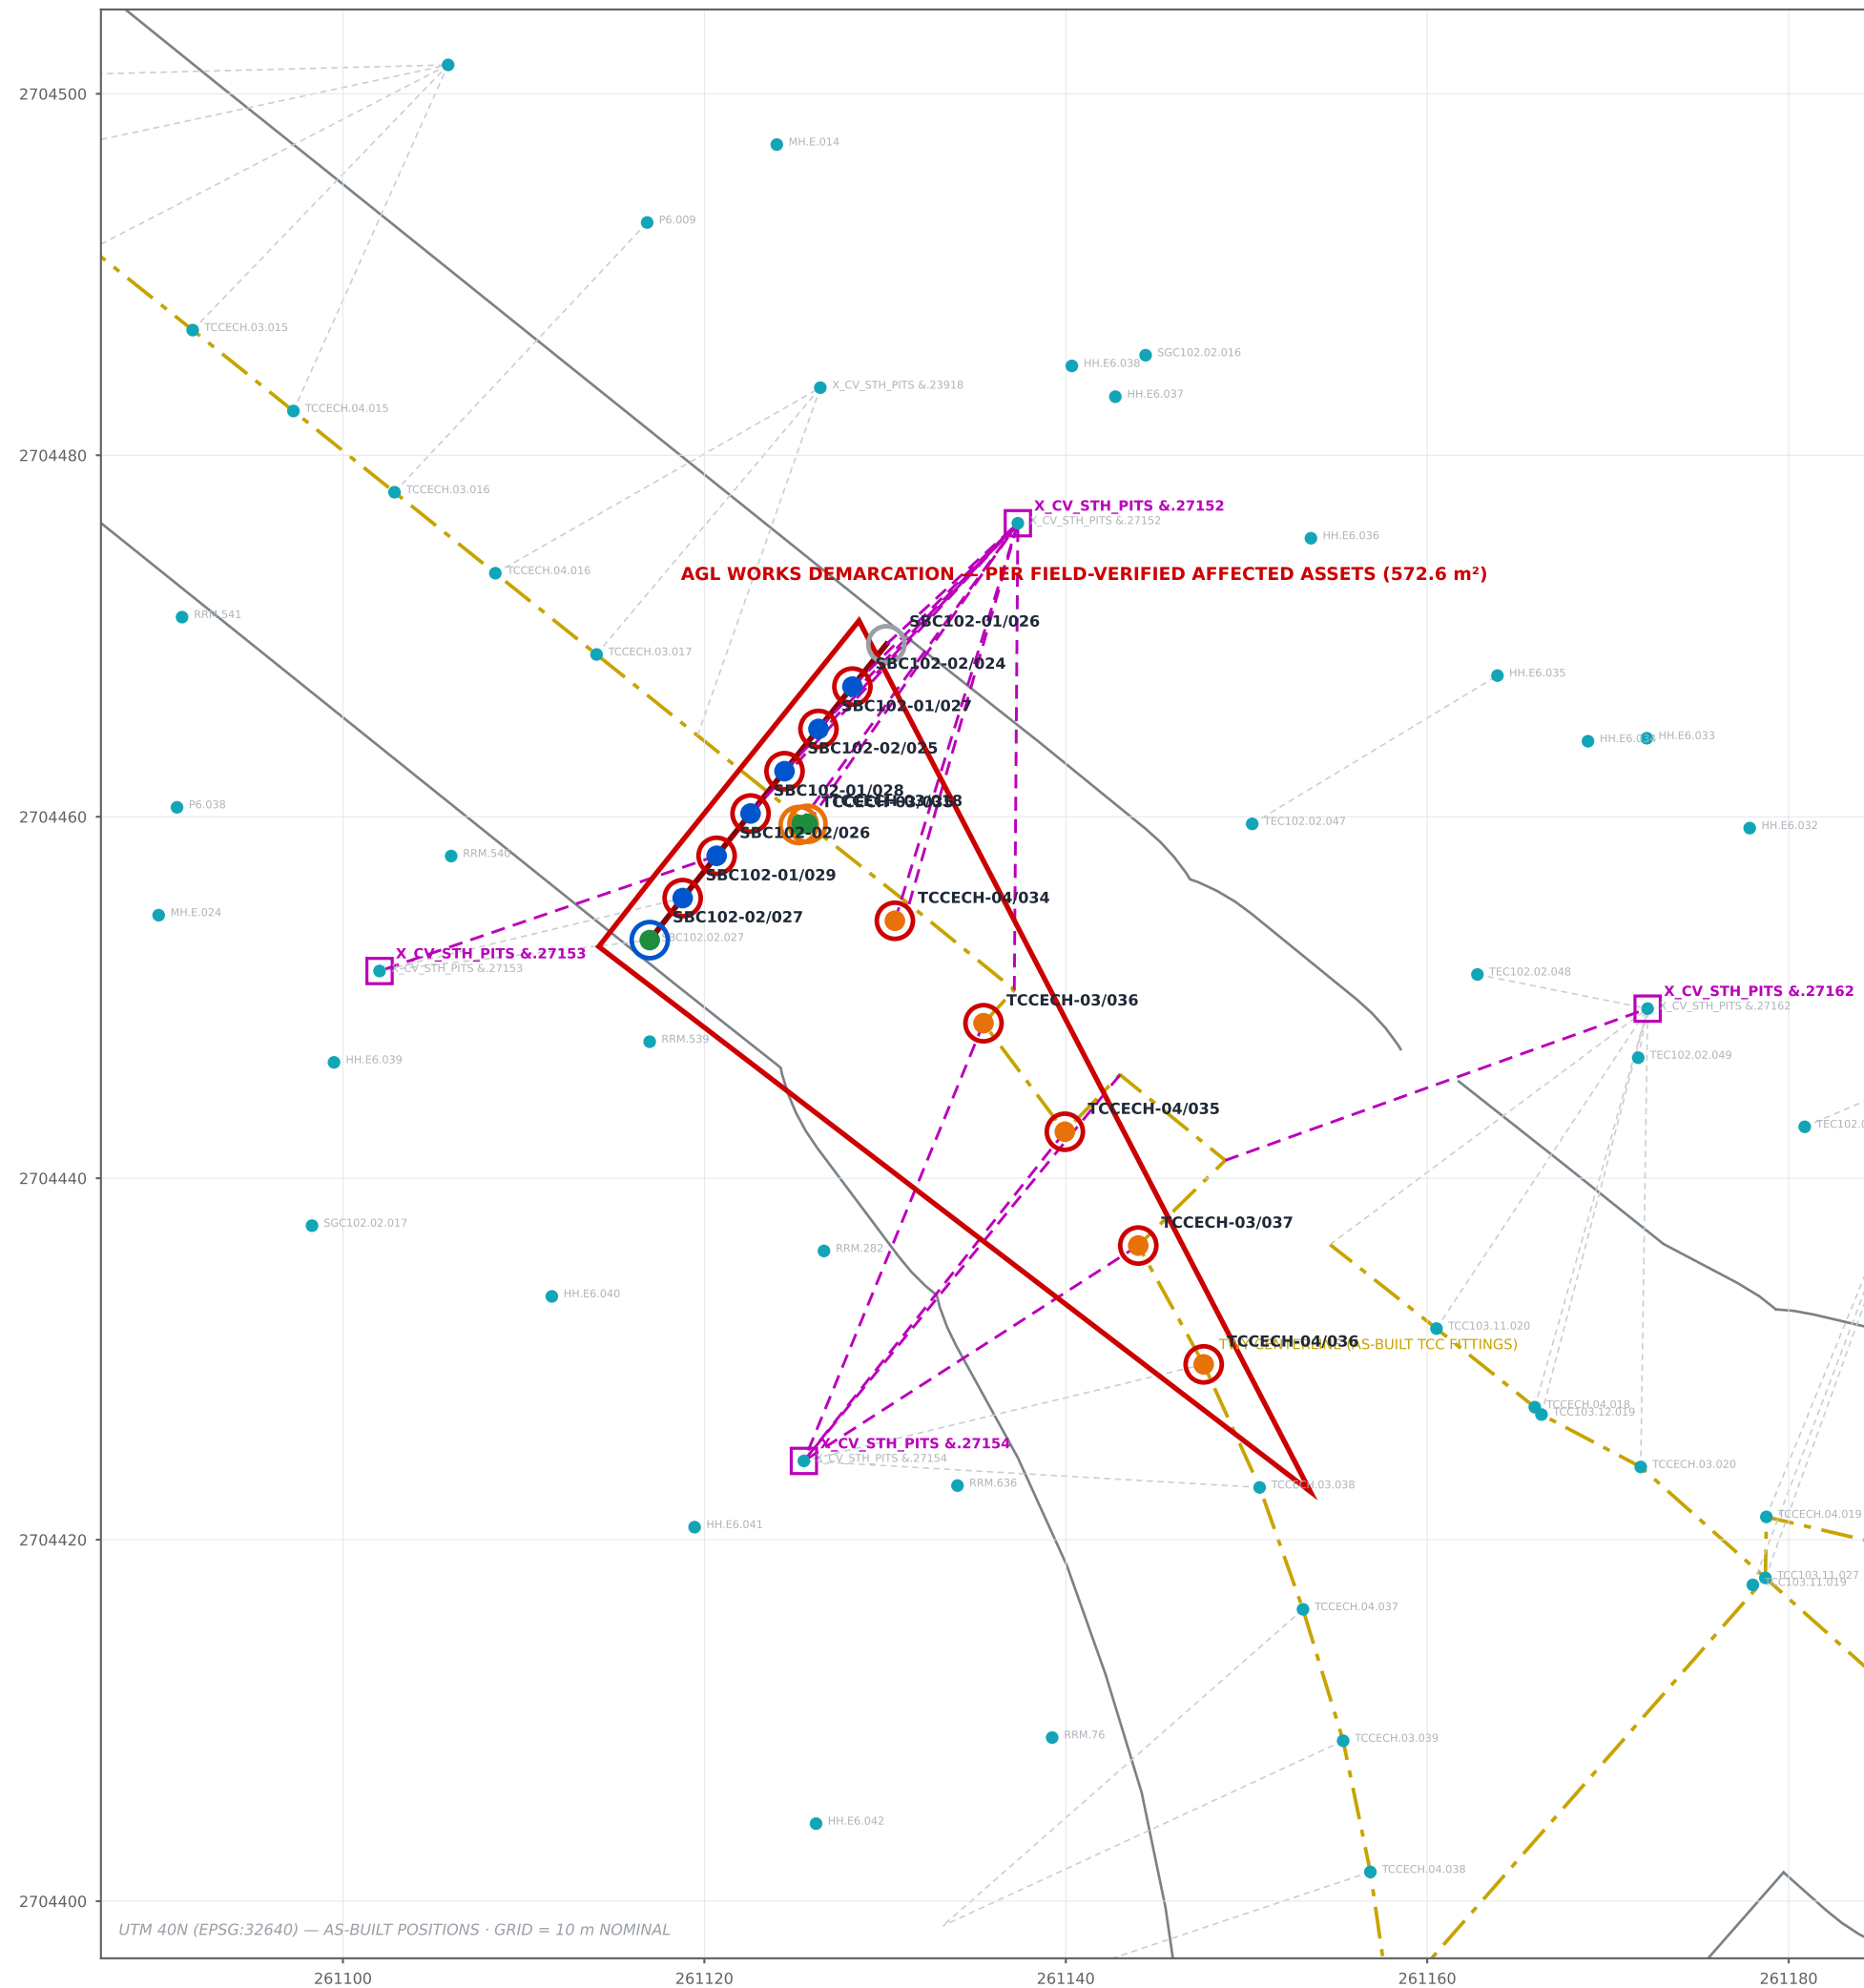

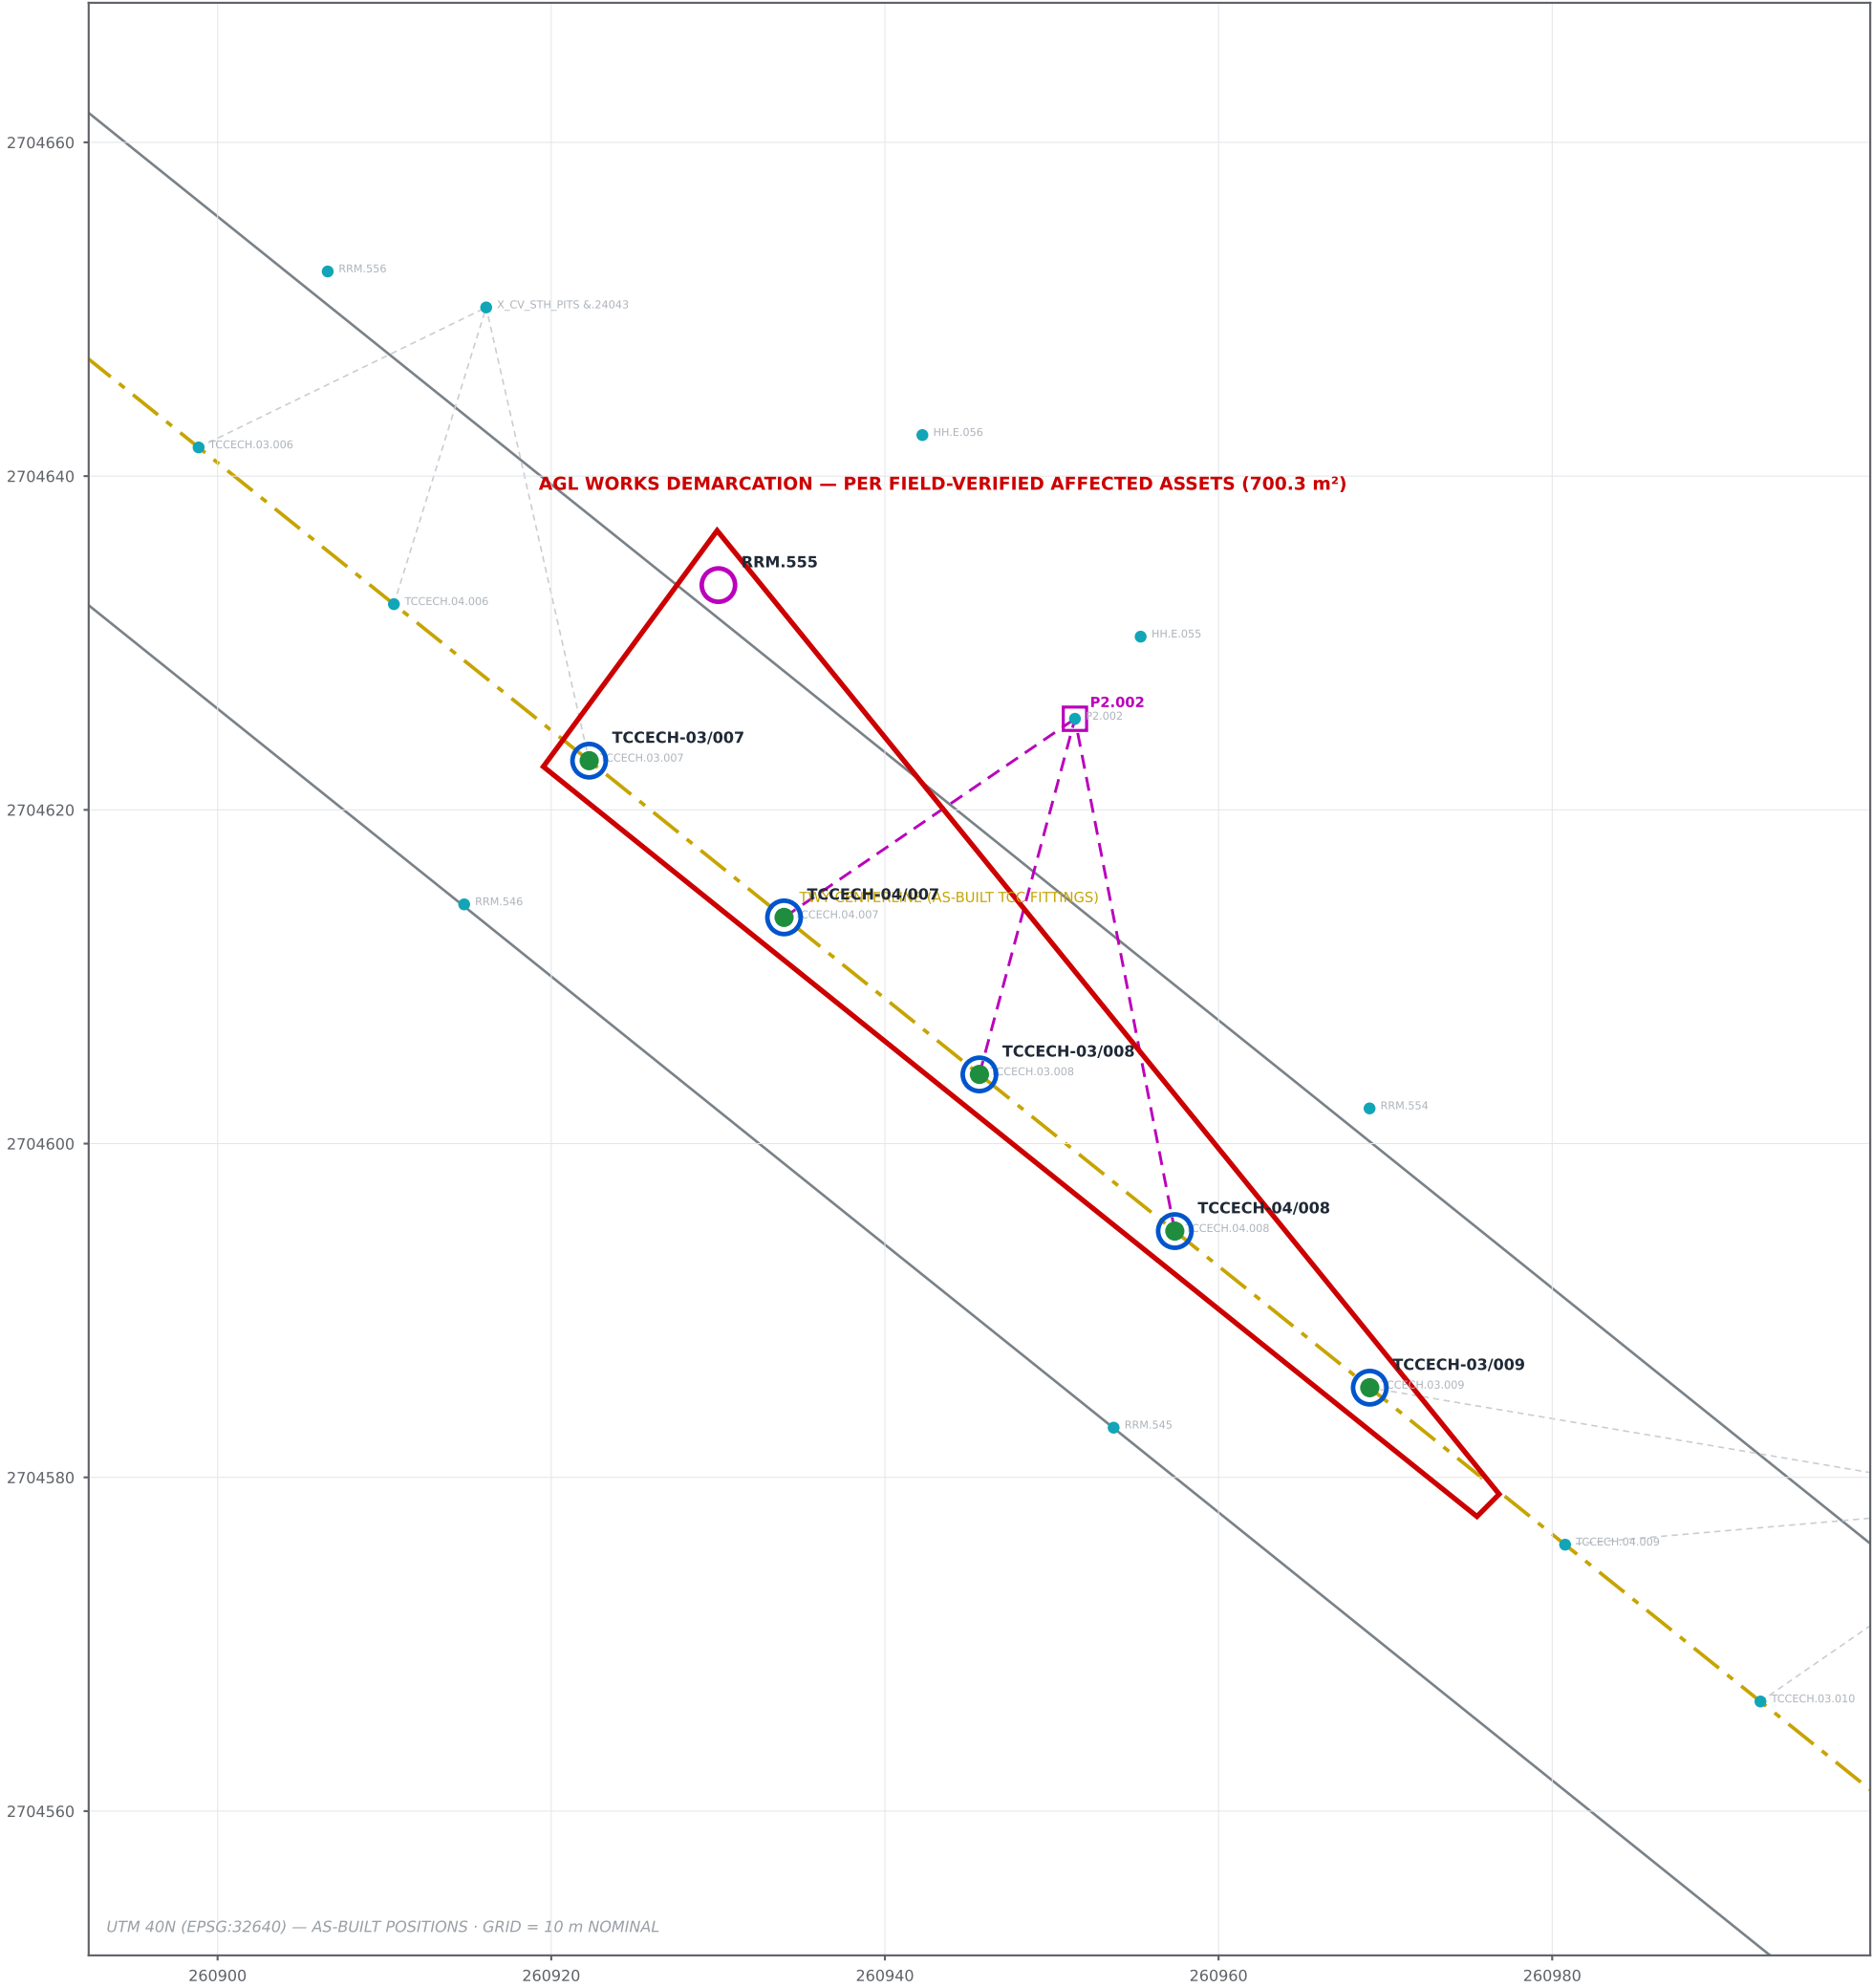

LOCATION 2 — 1002 · REV P04 (PRINT ISSUE)

SCOPE PER FIELD SHEET Second_milling_area rev_1 — FIELD CONDITION GOVERNS

Scale 1:250 @ A1 equiv. · UTM 40N · Issued 28.07.2026 · Prepared: Mohammed, AGL Team Leader — ADB SAFEGATE

SCOPE / QUANTITIES (PER FIELD VERIFICATION)

NEW SECONDARY CABLE ONLY (VIA DUCT): 5 No.

TCCECH-03/007, 04/007, 03/008, 04/008, 03/009

NO SHALLOW BASES AFFECTED AT THIS LOCATION

RRM.555 (0.41 m from cut): REMOVE / PROTECT BEFORE SAWCUT,

RE-FIX AFTER PAVING


ISOLATE CIRCUITS: TCCECH.03, TCCECH.04

GENERAL NOTES

- All asset positions as-built (asset survey assets_20260726120533.xlsx, UTM 40N / EPSG:32640).
- AGL works demarcation (red) drawn around field-verified affected assets (+2.0 m) — field condition governs.
- Secondary cables: no joints — full manhole-to-light replacement. Confirm routes vs AGL duct-layout CAD (Rev B) before works.
- Isolate, lock out & prove dead all listed circuits at CCR under permit before any cutting, coring or excavation.
- Reinstatement setting-out by civil survey from as-built E/N, checked against adjacent undisturbed fittings before coring.
- Taxiway centerline & stop bar alignments derived from as-built AGL fitting positions (TCC / SBC). Edge / pavement boundary indicative at 23 m width from as-built CL — confirm on site.

LEGEND — WORKS ACTIONS (THIS SHEET)

- NEW SEC. CABLE ONLY (DUCT) — outer blue / inner green
- RRM — REMOVE / PROTECT / RE-FIX (magenta / white)
- EXISTING AGL ASSET (AS-BUILT)
- SECONDARY DUCT RUN CROSSING CUT (INDICATIVE)
- AGL WORKS DEMARCATION (GOVERNING)
- AGL FEED MANHOLE / HANDHOLE
- TAXIWAY CENTERLINE (AS-BUILT, THROUGH TCC FITTINGS)
- STOP BAR (AS-BUILT, THROUGH SBC FITTINGS)
- TWY EDGE / PAVEMENT BOUNDARY (INDICATIVE 23 m — CONFIRM ON SITE)

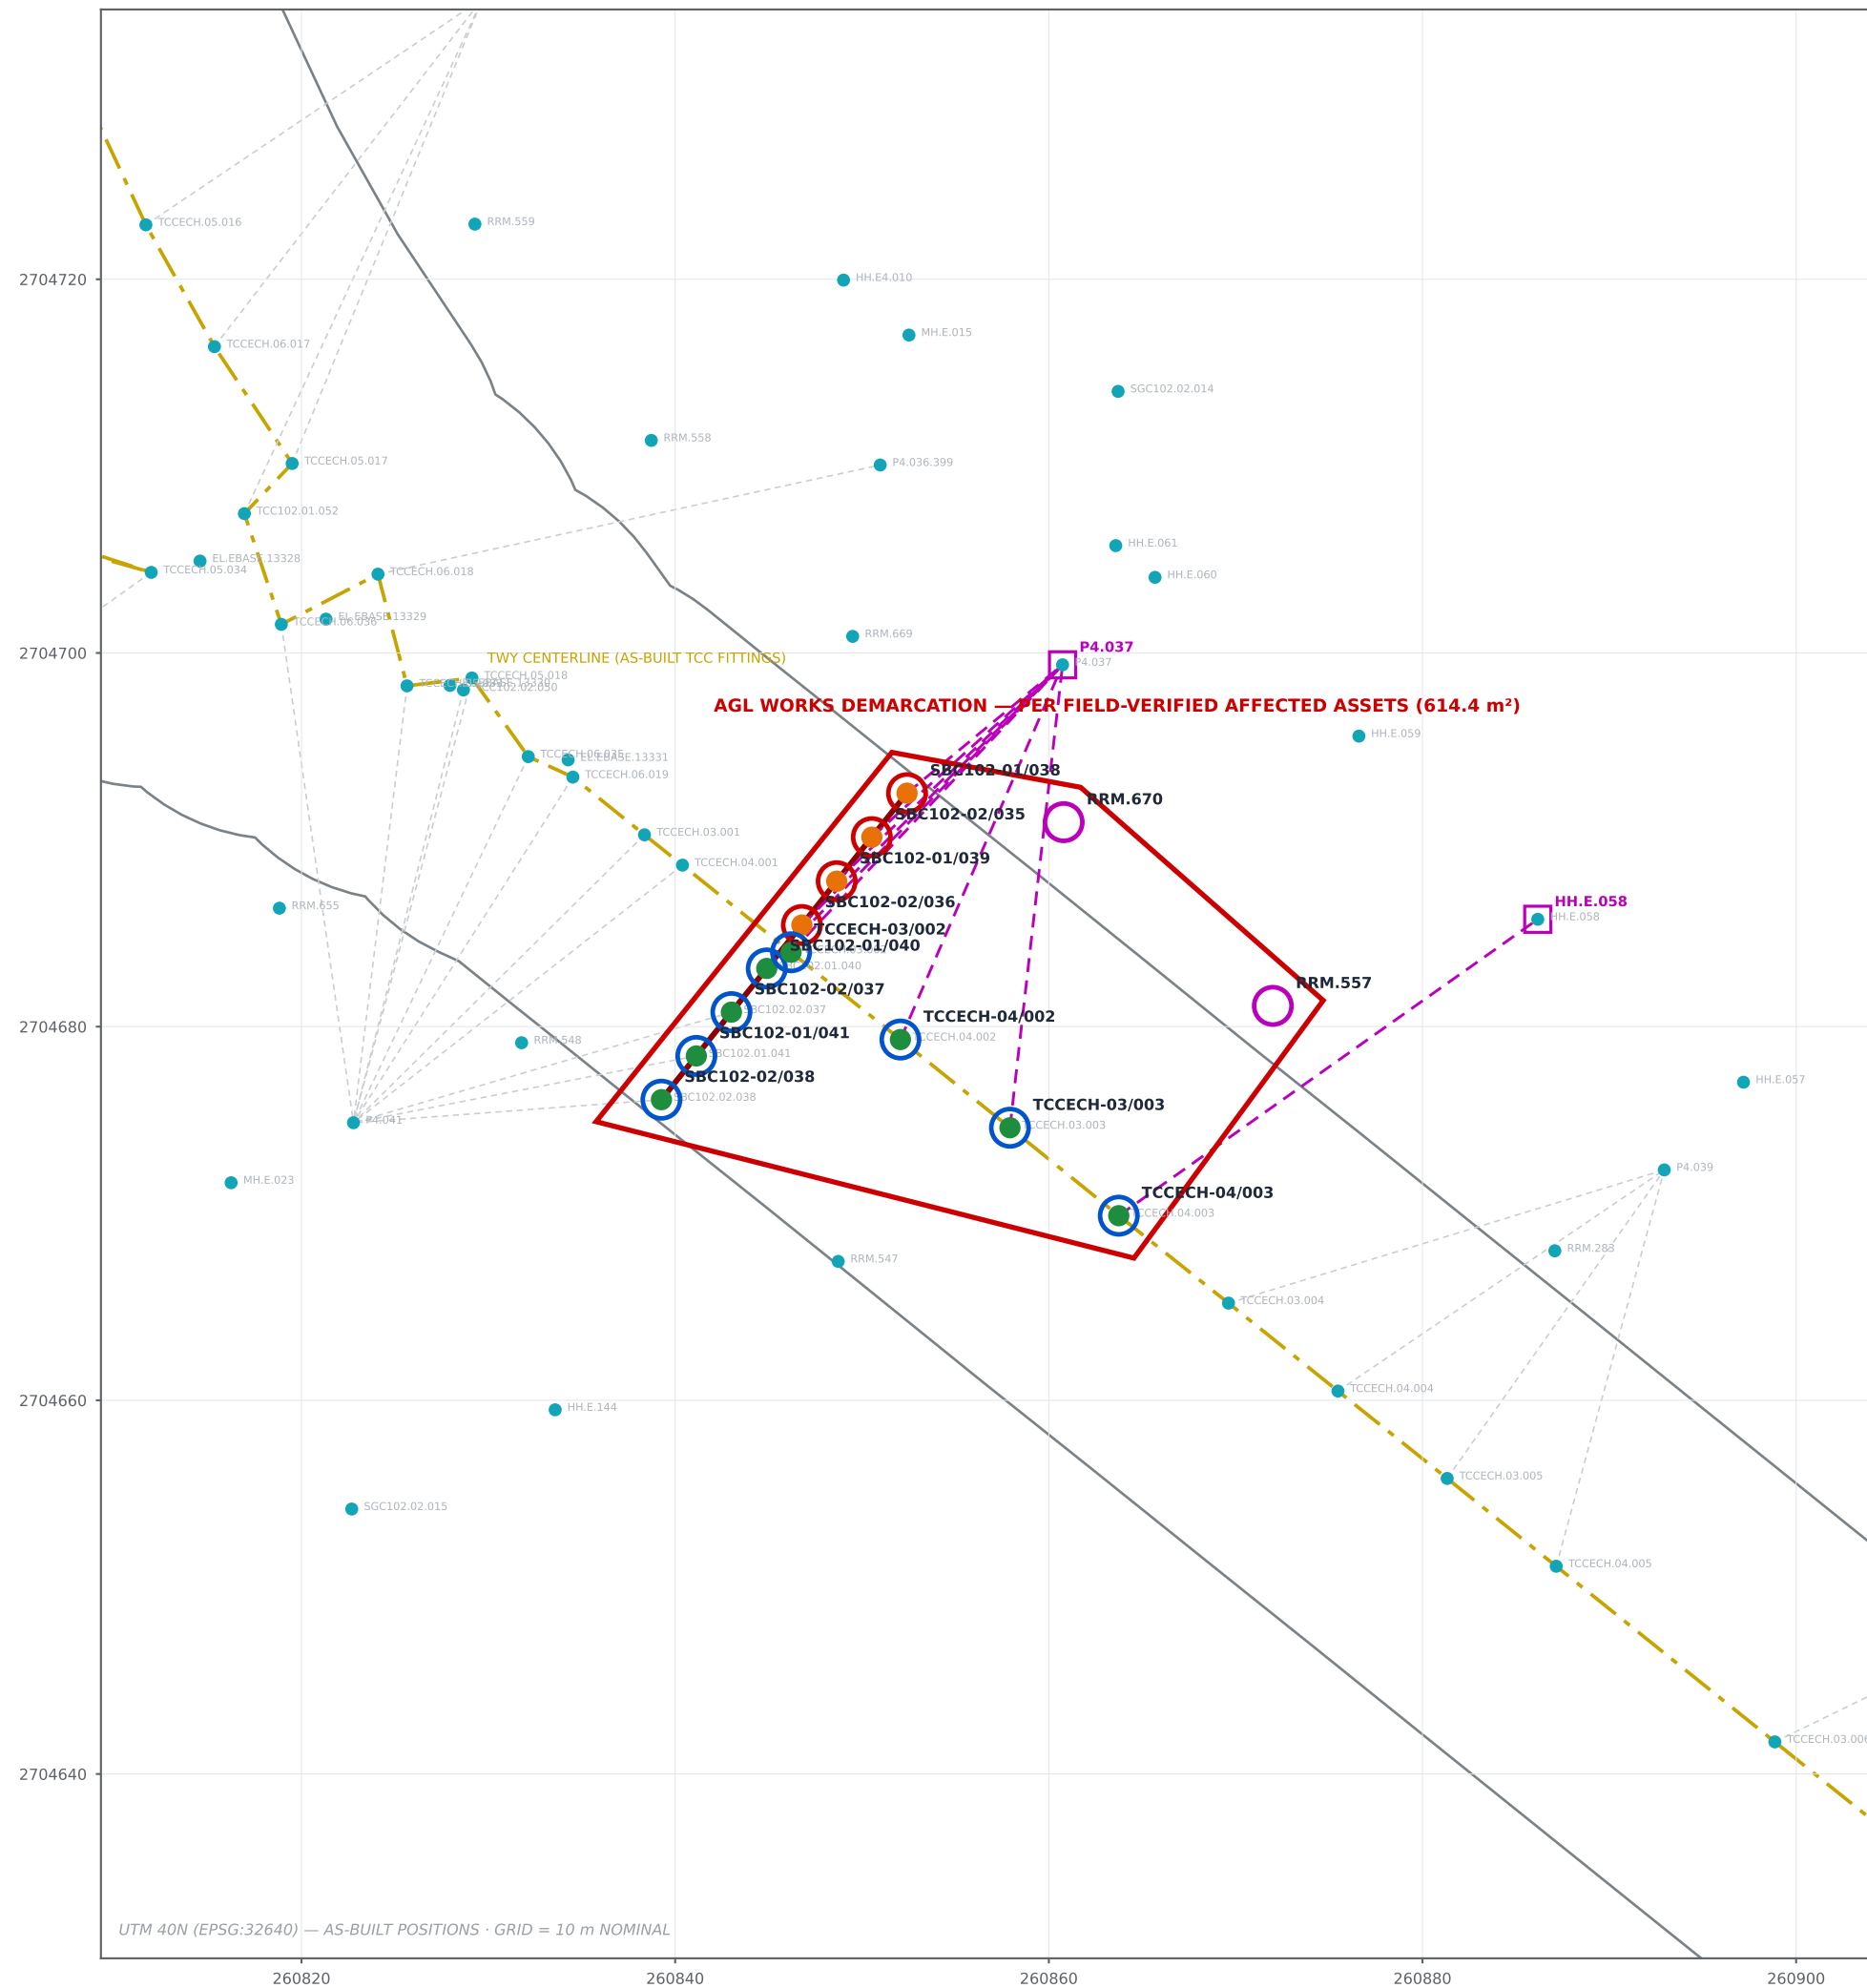

ANNEX A — CONSOLIDATED FIELD-GOVERNED SCOPE · TWY E (E4-E6) · REV P04

Loc	Asset	Works Action	Route	Remarks
LOC-01	SBC102-02/024	CORE OUT + NEW CABLE	Duct	Core out shallow base + full manhole-to-light cable replacement
LOC-01	SBC102-01/027	CORE OUT + NEW CABLE	Duct	Core out shallow base + full manhole-to-light cable replacement
LOC-01	SBC102-02/025	CORE OUT + NEW CABLE	Duct	Core out shallow base + full manhole-to-light cable replacement
LOC-01	SBC102-01/028	CORE OUT + NEW CABLE	Duct	Core out shallow base + full manhole-to-light cable replacement
LOC-01	SBC102-02/026	CORE OUT + NEW CABLE	Duct	Core out shallow base + full manhole-to-light cable replacement
LOC-01	SBC102-01/029	CORE OUT + NEW CABLE	Duct	Core out shallow base + full manhole-to-light cable replacement
LOC-01	TCCECH-04/034	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-01	TCCECH-03/036	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-01	TCCECH-04/035	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-01	TCCECH-03/037	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-01	TCCECH-04/036	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-01	SBC102-02/027	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-01	TCCECH-03/035	NEW CABLE ONLY	Sawcut	Full manhole-to-light cable replacement
LOC-01	TCCECH-03/018	NEW CABLE ONLY	Sawcut	Full manhole-to-light cable replacement
LOC-01	SBC102-01/026	NOT AFFECTED	—	Field verified — no works
LOC-02	TCCECH-03/007	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-02	TCCECH-04/007	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-02	TCCECH-03/008	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-02	TCCECH-04/008	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-02	TCCECH-03/009	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-02	RRM.555	RRM REMOVE / PROTECT	—	Remove / protect before sawcut, re-fix after paving
LOC-03	SBC102-01/038	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-03	SBC102-01/039	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-03	SBC102-02/035	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-03	SBC102-02/036	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-03	SBC102-01/040	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	SBC102-01/041	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	SBC102-02/037	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	SBC102-02/038	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	TCCECH-03/002	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	TCCECH-04/002	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	TCCECH-03/003	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	TCCECH-04/003	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	RRM.557	RRM REMOVE / PROTECT	—	Remove / protect before sawcut, re-fix after paving
LOC-03	RRM.670	RRM REMOVE / PROTECT	—	Remove / protect before sawcut, re-fix after paving

Totals: 15 core-outs / base works · 31 secondary cable runs · 3 RRM's · 1 field-verified not affected.