

Combined profile correction $K_p(M_1, M_2)$

$M_1 = 0$ $M_1 = 0.3$ $M_1 = 0.6$ $M_1 = 0.9$ $M_1 = 1.2$ $M_1 = 1.5$


Without smoothing or limiting

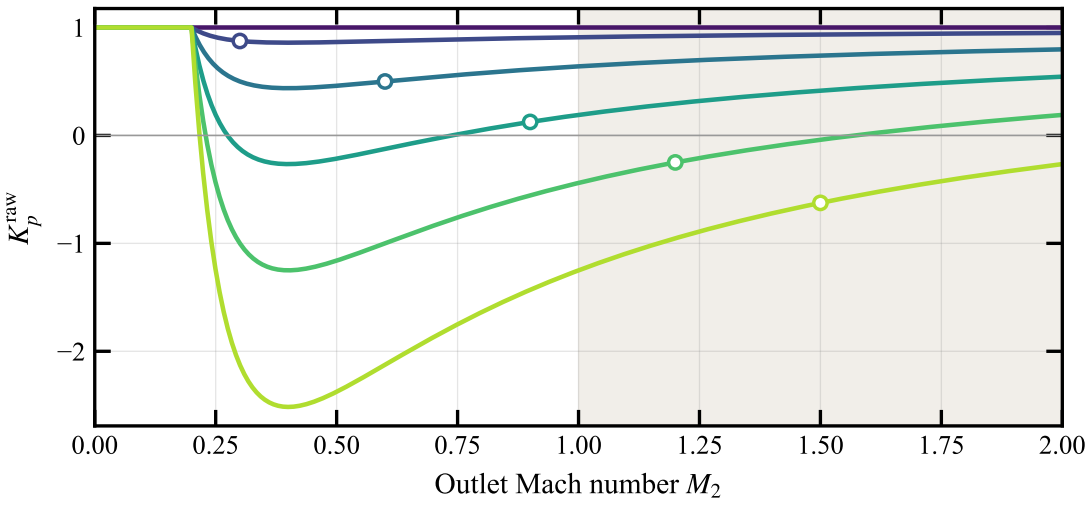


Raw derivative; jump at Mach 0.2

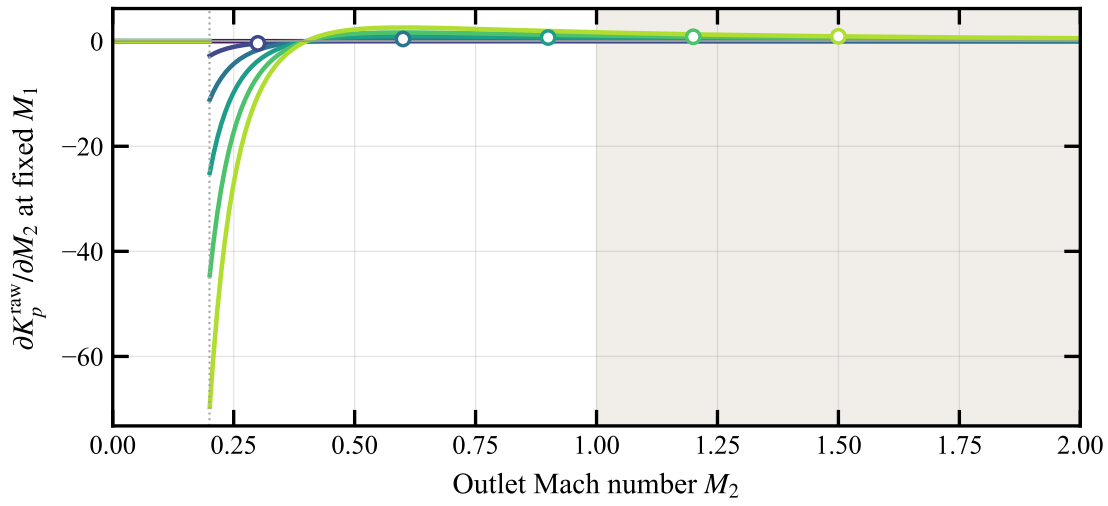


Implemented smooth factors and continuation

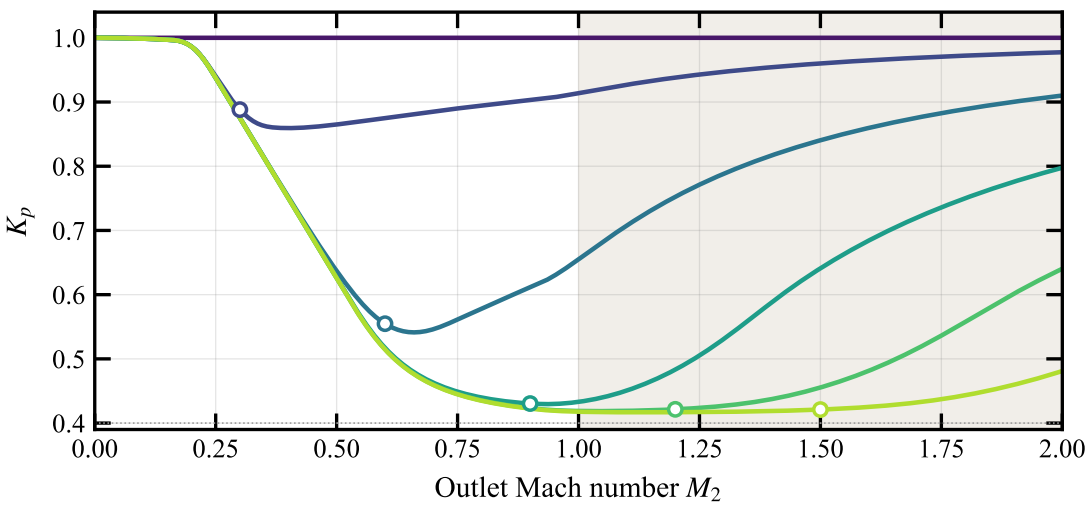


Implemented first derivatives

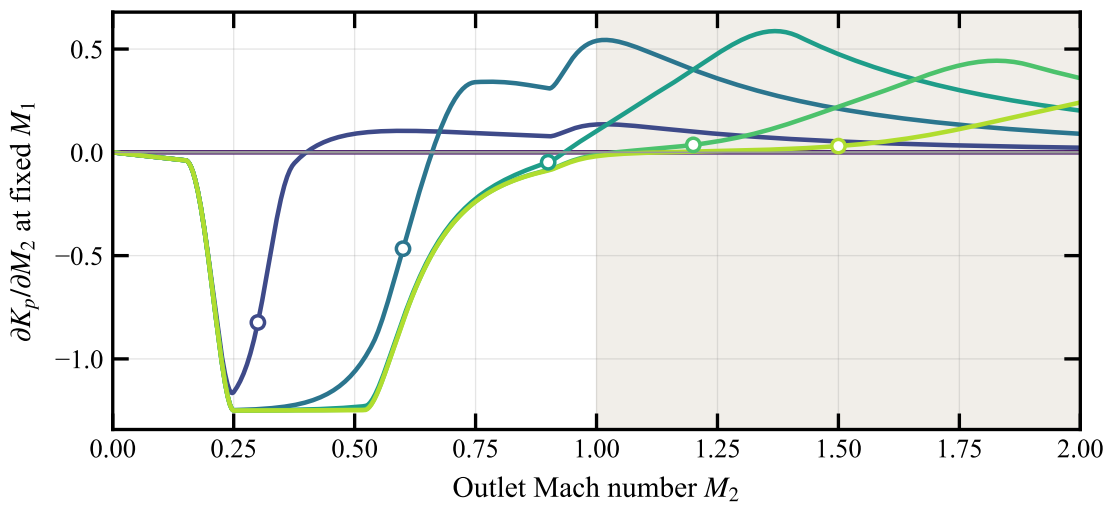

Final continuation below 0.6

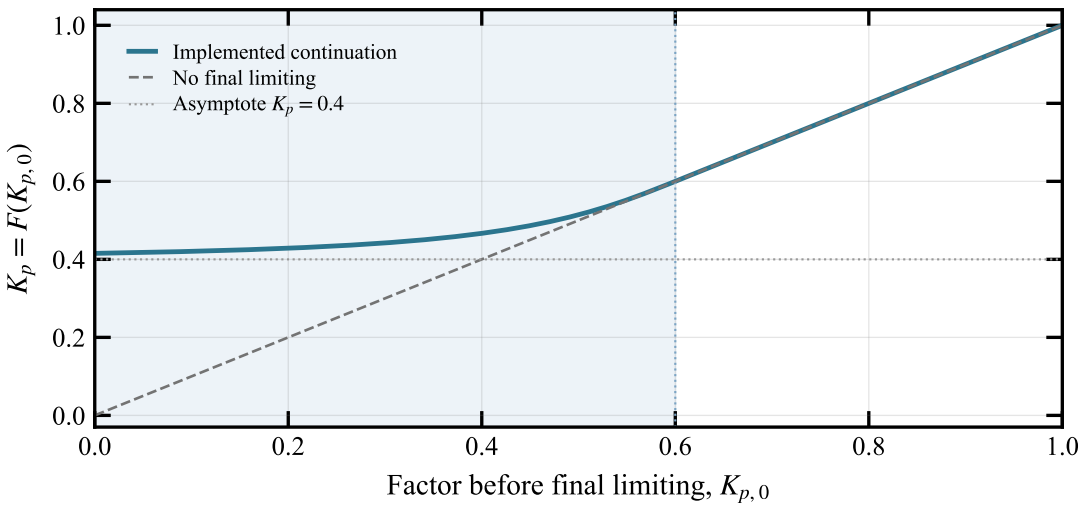

Positive continuation slope

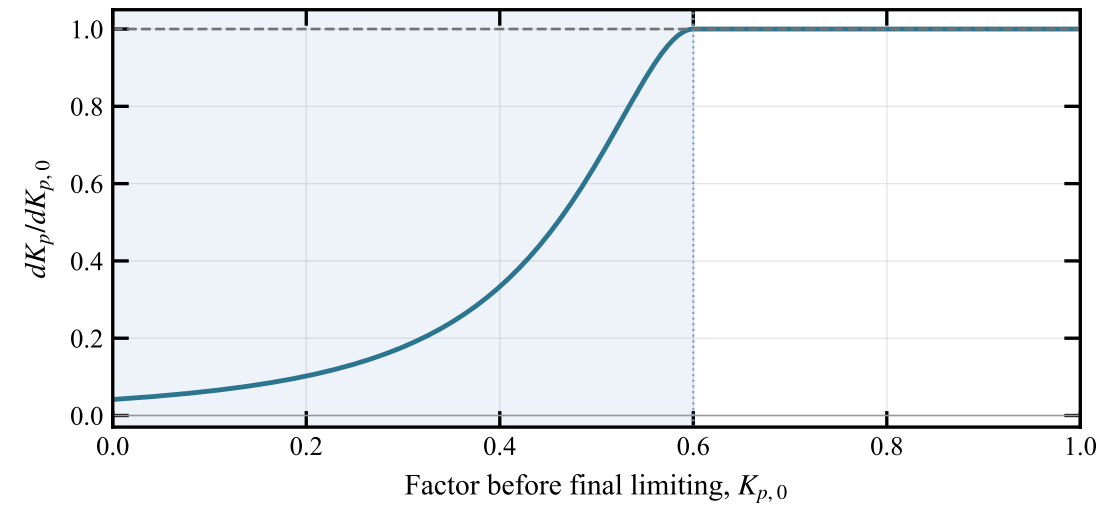

Top: raw algebra, including the unbounded K1 line above Mach 1. Middle: implemented model. Bottom: final continuation.
All Mach pairs shown; open circles mark M1 = M2. Beige: M2 > 1. Blue: final continuation below Kp,0 = 0.6.