



Command following after correcting the frequency assumption

Requested: 0.500000 Hz | Driver predicts: 0.465661 Hz | Fit to measured phase: 0.465742 Hz


First 12 seconds: timing agreement

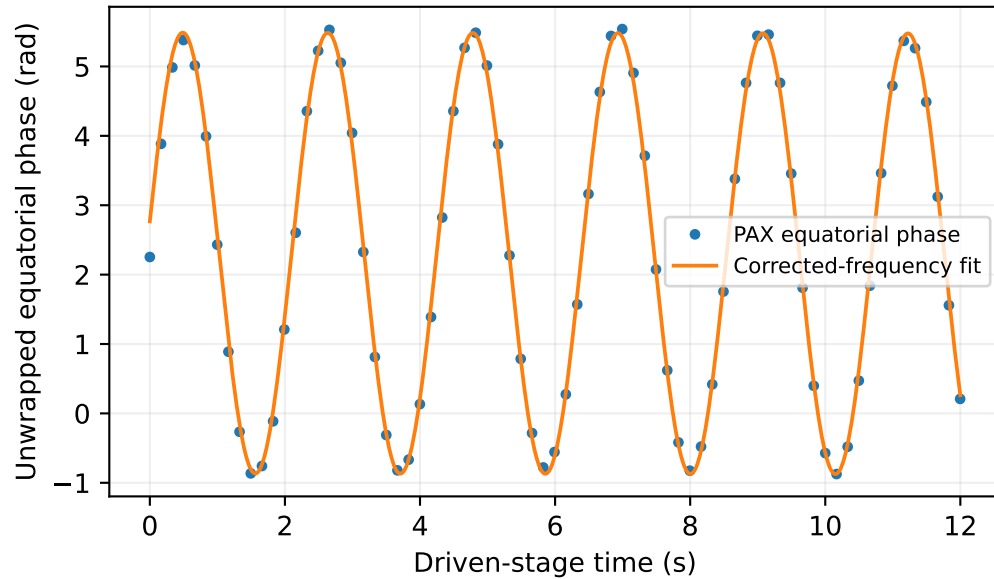


Voltage-to-phase relation (reconstructed command)

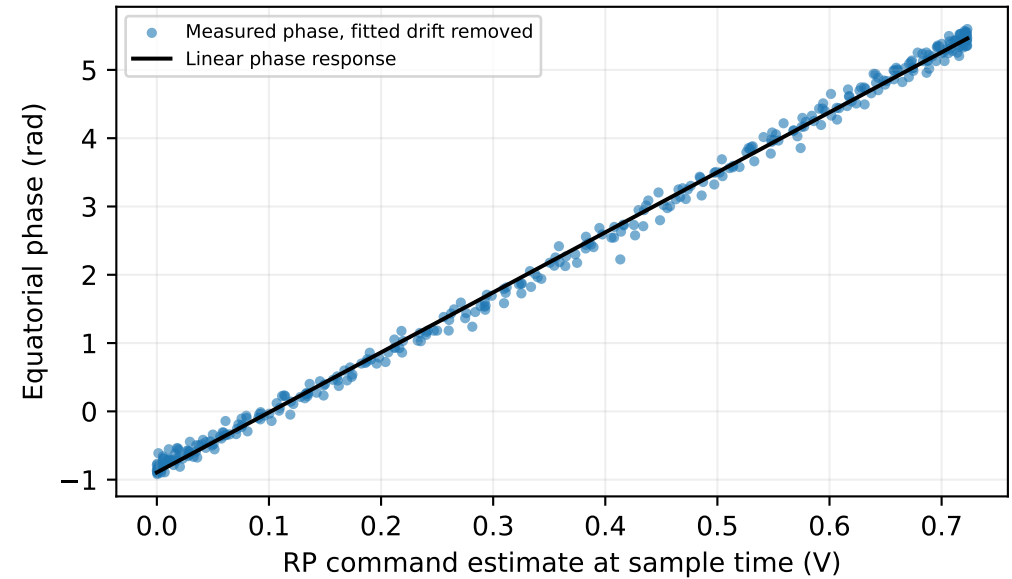

Full-run phase error: RMS 6.1°

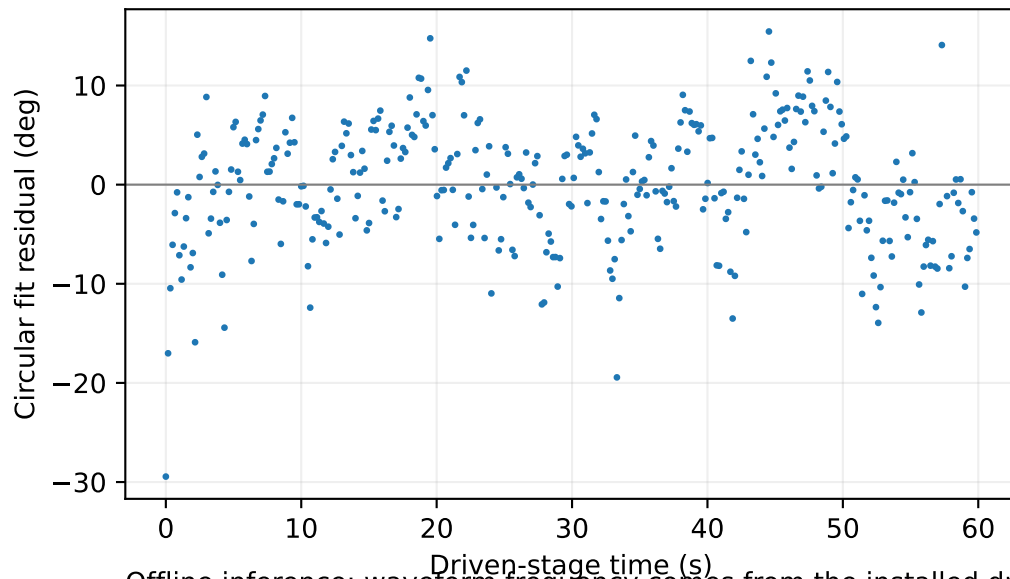

Equator proximity: S1 RMS 0.086

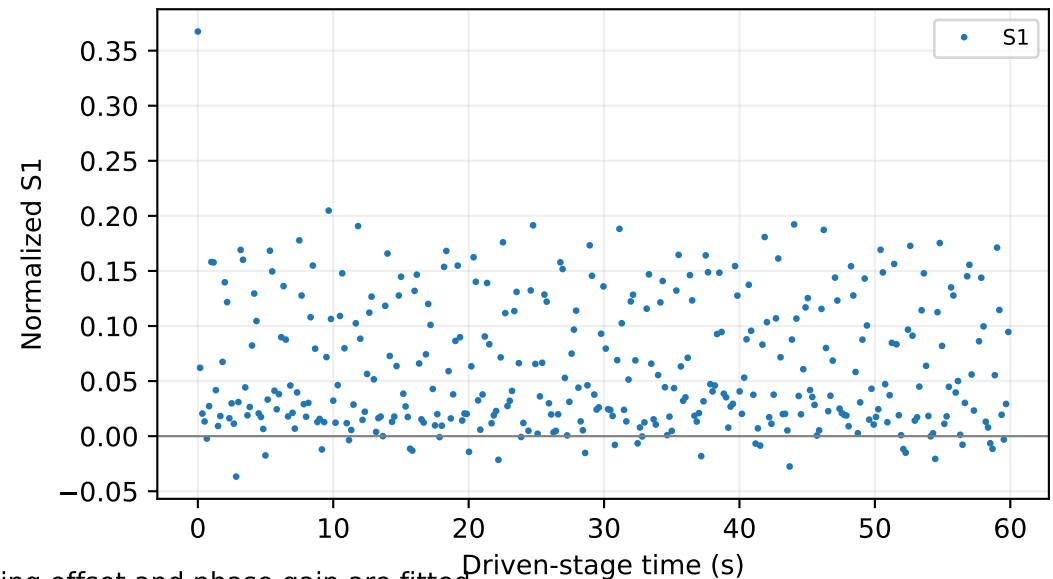

Offline inference: waveform frequency comes from the installed driver; timing offset and phase gain are fitted.
The drive voltage was not measured. This establishes command following, not terminal-voltage V_{π} calibration.