

LEGEND / SYMBOLS	
	Waypoint yyy (yyy for connectors)
	Spot tape
	Tube end taped
	Tube end and wires taped with under wrap
	Wire bundle (or single wire)
	Corrugated tube (slit / non-slit)
	Braided sleeve
	Twist Tube inc. EMC
	Forming wire protection (wire duct, manifold, etc.)
	Taping ends at tube end
	Taping on tube end and wires
	Clip y
	Loop back (connect these points with spot tape)
	Plain of projection (reference for detail views)
	Spiral taping on tube
	Full taping on tube with min. 30% overlap
	Spiral taping on wires (under tube)
	Full taping on wires with min. 30% overlap (under tube)

Connector X02				
Pin No.	Signal Name	To X6 Pin	Wire gauge	Wire color
1	GND	2	6 mm²	BN

Connector X20				
Pin No.	Signal Name	To Pin	Wire gauge	Wire color
1	UB_12V (KL30)	XD4, 8	0,5 mm²	OG
2	GND	XD4, 16	0,5 mm²	GNBN
3	KL30c	XD4, 6	0,5 mm²	BNBU
4	Wake_UP_Input	XD4, 5	0,5 mm²	BN
5	CAN4_L_IN	XD5, 11	0,5 mm²	WHBU
6	CAN4_H_IN	XD5, 10	0,5 mm²	WHBN
7	CAN4_L_OUT	XD4, 2	0,5 mm²	GN
8	CAN4_H_OUT	XD4, 1	0,5 mm²	BUOG

Connector X14				
Pin No.	Signal Name	To X6 Pin	Wire gauge	Wire color
1	M2HRES	61	0,5 mm²	BK/BU
2	M2H2/M2B	30	0,5 mm²	GNBU
3	M2H3/M2I	43	0,5 mm²	GNBU
4	M2H1/M2A	17	0,5 mm²	WHBU
5	Vxs_M2H	49	0,5 mm²	OGBU
6	GND_M2H	56	0,5 mm²	BU
7	ML1	9	2,5 mm²	BU
8	ML2	14	2,5 mm²	GNBU
9	ML3	15	2,5 mm²	WHBU

Connector X04				
Pin No.	Signal Name	To Pin	Wire gauge	Wire color
1	CAN4_H_OUT	X20, 8	0,5 mm²	BUOG
2	CAN4_L_OUT	X20, 7	0,5 mm²	GN
3	CAN1_H_IN	X5, 34	0,5 mm²	YE
4	CAN1_L_IN	X5, 35	0,5 mm²	YE/GY
5	Wake_UP_Input	X20, 4	0,5 mm²	BN
6	KL30c	X20, 3	0,5 mm²	BNBU
7	-	-	-	-
8	UB_12_V (KL30)	X20, 1	0,5 mm²	OG
9	CAN4_H_IN	X5, 23	0,5 mm²	WHOG
10	CAN4_L_IN	X5, 24	0,5 mm²	WH
11	-	-	-	-
12	VBAT_LP	X5, 18	0,5 mm²	WHGN
13	VT15_IN	X5, 31	0,5 mm²	YE/RD
14	-	-	-	-
15	-	-	-	-
16	GND	X20, 2	0,5 mm²	GNBN

Connector X22				
Pin No.	Signal Name	To X6 Pin	Wire gauge	Wire color
1	Vxs_ISS2 +	27	0,5 mm²	PK/BU
2	ISS2	40	0,5 mm²	GY/BU

Connector X01				
Pin No.	Signal Name	To X5 Pin	Wire gauge	Wire color
1	VBAT_LP*	1	6 mm²	RD

Connector X16				
Pin No.	Signal Name	To X6 Pin	Wire gauge	Wire color
1	TTS1	23	0,5 mm²	YE/RD
2	AGND_TTS1	36	0,5 mm²	BK/RD

Connector X21				
Pin No.	Signal Name	To X6 Pin	Wire gauge	Wire color
1	ISS1	41	0,5 mm²	GY/PK
2	Vxs_ISS1 +	28	0,5 mm²	PK

Connector X13				
Pin No.	Signal Name	To X6 Pin	Wire gauge	Wire color
1	M1HRES	46	0,5 mm²	BK/GN
2	M1H2/M1B	31	0,5 mm²	BN/GN
3	M1H3/M1I	44	0,5 mm²	GN
4	M1H1/M1A	18	0,5 mm²	WH/GN
5	Vxs_M1H	47	0,5 mm²	OG/GN
6	GND_M1H	57	0,5 mm²	BU/GN
7	ML1	11	2,5 mm²	BU/GN
8	ML2	12	2,5 mm²	GN
9	ML3	13	2,5 mm²	WH/GN


Connector X12				
Pin No.	Signal Name	To X6 Pin	Wire gauge	Wire color
1	M4HRES	35	0,5 mm²	GN/OG
2	M4H2/M4B	32	0,5 mm²	BN/OG
3	-	-	-	-
4	M4H1/M4A	19	0,5 mm²	WH/OG
5	Vxs_M4H	34	0,5 mm²	OG
6	GND_M4H	58	0,5 mm²	BU/OG
7	ML1	2	2,5 mm²	BU/OG
8	ML2	3	2,5 mm²	GN/OG
9	ML3	1	2,5 mm²	WH/OG

Connector X10				
Pin No.	Signal Name	To X6 Pin	Wire gauge	Wire color
1	M3HRES	62	0,5 mm²	GNBN
2	M3H2/M3B	29	0,5 mm²	BN
3	-	-	-	-
4	M3H1/M3A	16	0,5 mm²	WHBN
5	Vxs_M3H	60	0,5 mm²	OGBN
6	GND_M3H	55	0,5 mm²	BUBN
7	ML1	6	2,5 mm²	BUBN
8	ML2	8	2,5 mm²	GNBN
9	ML3	7	2,5 mm²	WHBN

Connector X17				
Pin No.	Signal Name	To X6 Pin	Wire gauge	Wire color
1	AGND_TPS1	38	0,5 mm²	BK/GY
2	TPS1	25	0,5 mm²	YE/GY
3	Vxs_TPS1	51	0,5 mm²	RD/GY

Connector X18				
Pin No.	Signal Name	To X6 Pin	Wire gauge	Wire color
1	AGND_IPS2	37	0,5 mm²	BK/YE
2	IPS2	24	0,5 mm²	YE
3	Vxs_IPS2	50	0,5 mm²	RD/YE

Connector X11				
Pin No.	Signal Name	To X6 Pin	Wire gauge	Wire color
1	M3HRES	22	0,5 mm²	GN/WH
2	M3H2/M3B	33	0,5 mm²	BN/WH
3	-	-	-	-
4	M3H1/M3A	20	0,5 mm²	WH
5	Vxs_M3H	21	0,5 mm²	OG/WH
6	GND_M3H	59	0,5 mm²	BU/WH
7	ML1	5	2,5 mm²	BU/WH
8	ML2	10	2,5 mm²	GN/WH
9	ML3	4	2,5 mm²	WH

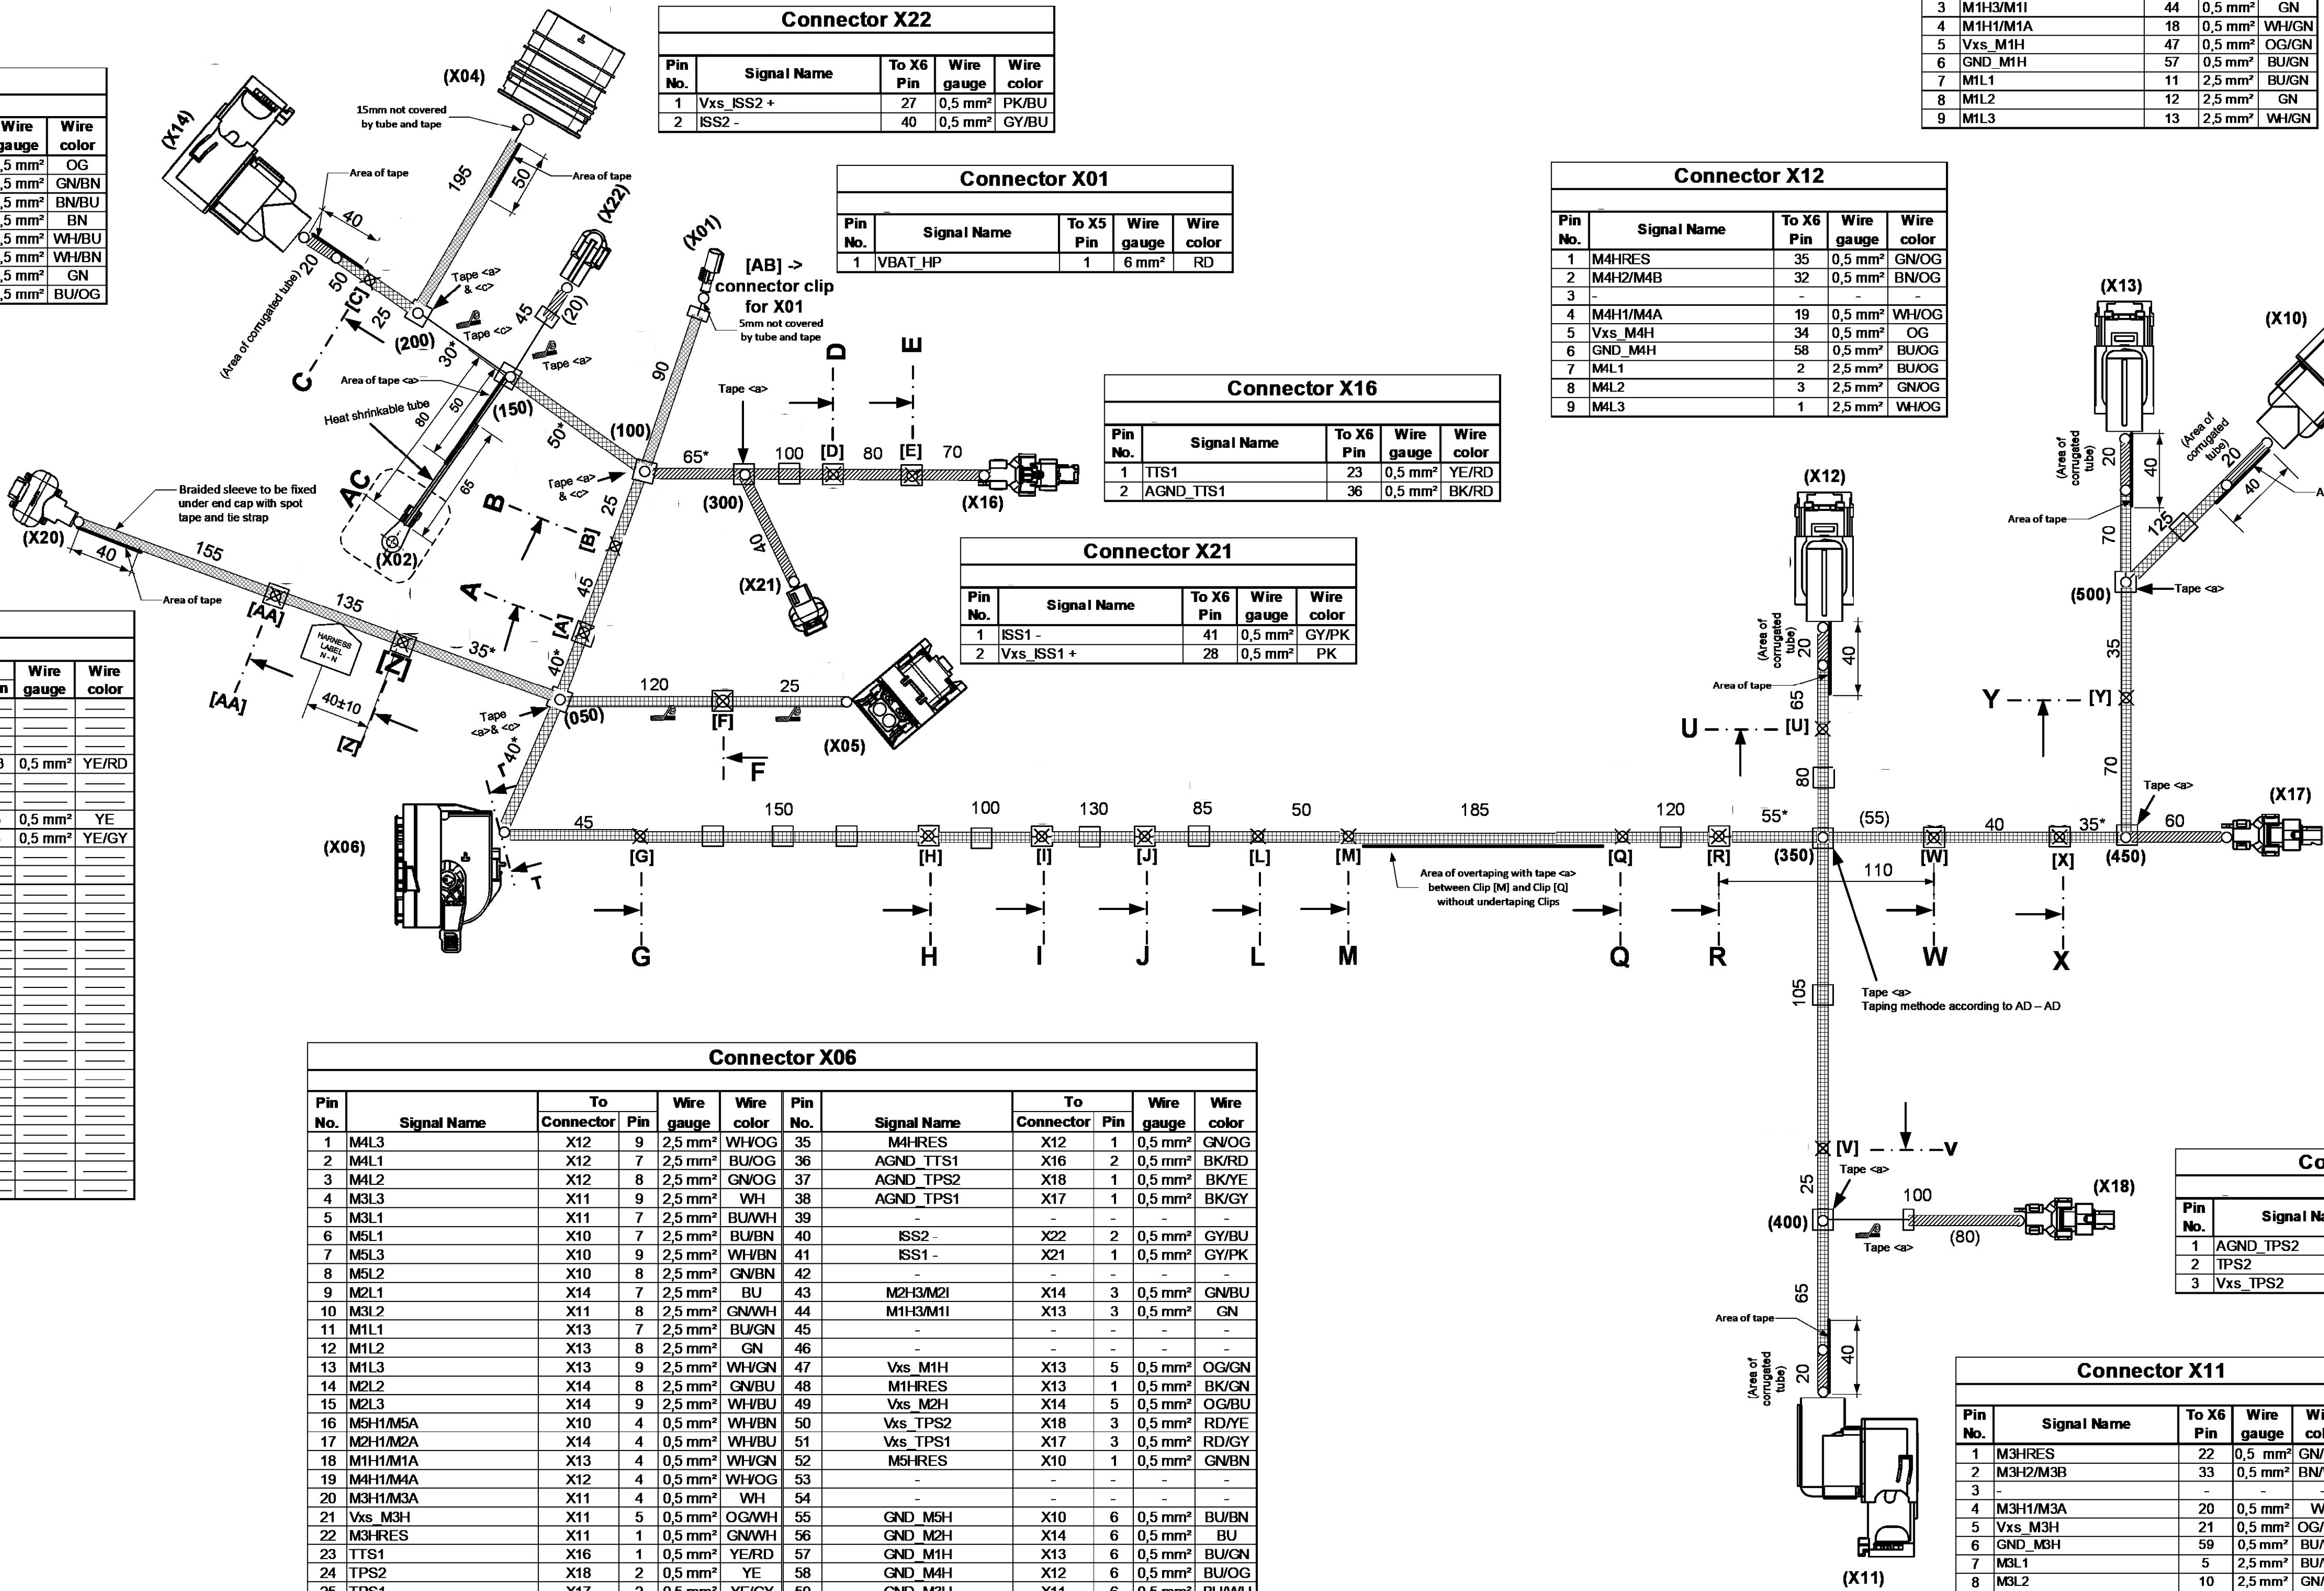

Connector X06									
Pin No.	Signal Name	To Connector	Pin	Wire gauge	Wire color	Pin No.	Signal Name	To Connector	Pin
1	ML3	X12	9	2,5 mm²	WH/OG	35	M1HRES	X12	1
2	ML1	X12	7	2,5 mm²	BU/OG	36	AGND_TTS1	X16	2
3	ML2	X12	8	2,5 mm²	GN/OG	37	AGND_IPS2	X18	1
4	ML3	X11	9	2,5 mm²	WH	38	AGND_TPS1	X17	1
5	ML1	X11	7	2,5 mm²	BU/WH	39	-	-	-
6	ML1	X10	7	2,5 mm²	BU/BN	40	ISS2	X22	2
7	ML3	X10	9	2,5 mm²	WH/BN	41	ISS1	X21	1
8	ML2	X10	8	2,5 mm²	GN/BN	42	-	-	-
9	ML1	X14	7	2,5 mm²	BU	43	M2H2/M2B	X14	3
10	ML2	X11	8	2,5 mm²	GN/WH	44	M1H3/M1I	X13	3
11	ML1	X13	7	2,5 mm²	BU/GN	45	-	-	-
12	ML2	X13	8	2,5 mm²	GN	46	-	-	-
13	ML3	X13	9	2,5 mm²	WH/GN	47	Vxs_M1H	X13	5
14	ML2	X14	8	2,5 mm²	GNBU	48	M1HRES	X13	1
15	ML3	X14	9	2,5 mm²	WHBU	49	Vxs_M2H	X14	5
16	M3H1/M3A	X10	4	0,5 mm²	WH/BN	50	Vxs_IPS2	X18	3
17	M2H1/M2A	X14	4	0,5 mm²	WHBU	51	Vxs_IPS1	X17	3
18	M1H1/M1A	X13	4	0,5 mm²	WH/GN	52	M3HRES	X10	1
19	M4H1/M4A	X12	4	0,5 mm²	WH/OG	53	-	-	-
20	M3H1/M3A	X11	4	0,5 mm²	WH	54	-	-	-
21	Vxs_M3H	X11	5	0,5 mm²	OG/WH	55	GND_M3H	X10	6
22	M3HRES	X11	1	0,5 mm²	GN/WH	56	GND_M2H	X14	6
23	TTS1	X16	1	0,5 mm²	YE/RD	57	GND_M1H	X13	6
24	TPS2	X18	2	0,5 mm²	YE	58	GND_M4H	X12	6
25	TPS1	X17	2	0,5 mm²	YE/GY	59	GND_M3H	X11	6
26	-	-	-	-	-	60	Vxs_M2H	X10	5
27	Vxs_ISS2 +	X22	1	0,5 mm²	PK/BU	61	M2HRES	X14	1
28	Vxs_ISS1 +	X21	2	0,5 mm²	PK	62	-	-	-
29	M3H2/M3B	X10	2	0,5 mm²	BN	63	-	-	-
30	M2H2/M2B	X14	2	0,5 mm²	BNBU	64	-	-	-
31	M1H2/M1B	X13	2	0,5 mm²	BN/GN	65	-	-	-
32	M4H2/M4B	X12	2	0,5 mm²	BN/OG	66	-	-	-
33	M3H2/M3B	X11	2	0,5 mm²	BN/WH	67	-	-	-
34	Vxs_M4H	X12	5	0,5 mm²	OG	-	-	-	-