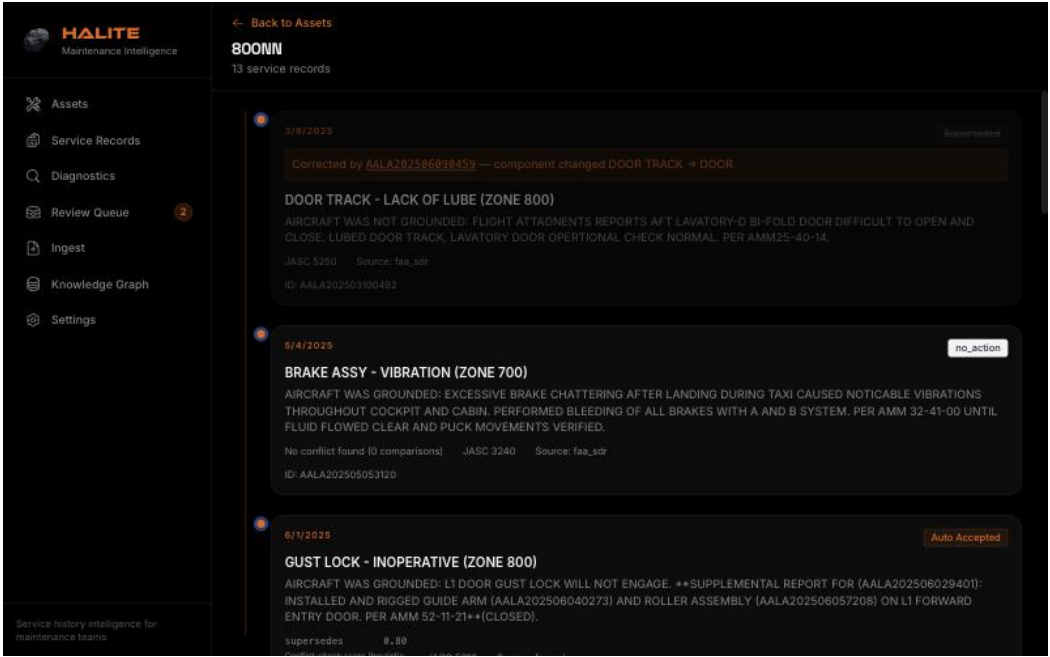

HALITE
Maintenance Intelligence
Assets
Service Records
Diagnostics
Review Queue
2
Ingest
Knowledge Graph
Settings
Service history intelligence for maintenance teams
← Back to Assets
800NN
13 service records
3/8/2025
Superseded
Corrected by AALA202506020459 — component changed DOOR TRACK → DOOR
DOOR TRACK - LACK OF LUBE (ZONE 800)
AIRCRAFT WAS NOT GROUNDED: FLIGHT ATTADNENTS REPORTS AFT LAVATORY-D BI-FOLD DOOR DIFFICULT TO OPEN AND CLOSE. LUBED DOOR TRACK. LAVATORY DOOR OPERTIONAL CHECK NORMAL. PER AMM25-40-14.
JASC 5250 Source: faa_sdr
ID: AALA202503100492
5/4/2025
no_action
BRAKE ASSY - VIBRATION (ZONE 700)
AIRCRAFT WAS GROUNDED: EXCESSIVE BRAKE CHATTERING AFTER LANDING DURING TAXI CAUSED NOTICABLE VIBRATIONS THROUGHOUT COCKPIT AND CABIN. PERFORMED BLEEDING OF ALL BRAKES WITH A AND B SYSTEM. PER AMM 32-41-00 UNTIL FLUID FLOWED CLEAR AND PUCK MOVEMENTS VERIFIED.
No conflict found (0 comparisons) JASC 3240 Source: faa_sdr
ID: AALA202505053120
6/1/2025
Auto Accepted
GUST LOCK - INOPERATIVE (ZONE 800)
AIRCRAFT WAS GROUNDED: L1 DOOR GUST LOCK WILL NOT ENGAGE. **SUPPLEMENTAL REPORT FOR (AALA202506029401): INSTALLED AND RIGGED GUIDE ARM (AALA202506040273) AND ROLLER ASSEMBLY (AALA202506057208) ON L1 FORWARD ENTRY DOOR. PER AMM 52-11-21**(CLOSED).
supersedes 8.80