Gmail

Inquiry Regarding Python SDK Compatibility for EPP2000 Spectrometers

Tue, Mar 18, 2025 at 5:20 PM

Cc: StellarNet Advanced Engineering Support <software@stellarnet.us>


I hear that you have old EPP2000 spectrometers.
These are not supported by our latest drivers, but our old drivers should work just fine. Below are two links to the drivers and software which you need to download, followed by an explanation of how to manually install them.

If you have the new drivers installed, you're going to need to delete them from the C:\Windows\System32\drivers folder. Delete anything with snusb in the beginning of the name. Then you can run through the following installation.


Below is an installation tutorial for Windows 7 64bit followed by 32bit installation instructions; the methods are the same in Win10 but may not look exactly the same as the pictures.

Try these steps:


1. Visit our website www.stellarnet.us
2. Click on the download section of our website
3. Fill out the software registration form
4. Check your email for links to the software files
5. The files you immediately will need are SWDriver64.exe and SWUpdate.exe. Links to these will be in the email and will save to the downloads folder by default.
6. Right click on the SWUpdate.exe file in your downloads folder
7. Choose "**Run as administrator**"
8. A rainbow colored SpectraWiz icon should come up on your desktop along with a Comand Prompt telling you to press any key to continue
9. Now we can install the drivers.
10. Right click on the SWDriver64.exe icon in your downloads folder and choose to "**Run as administrator**"
11. A command prompt will pop up and look like there is an error message but it is normal if it looks like the image below

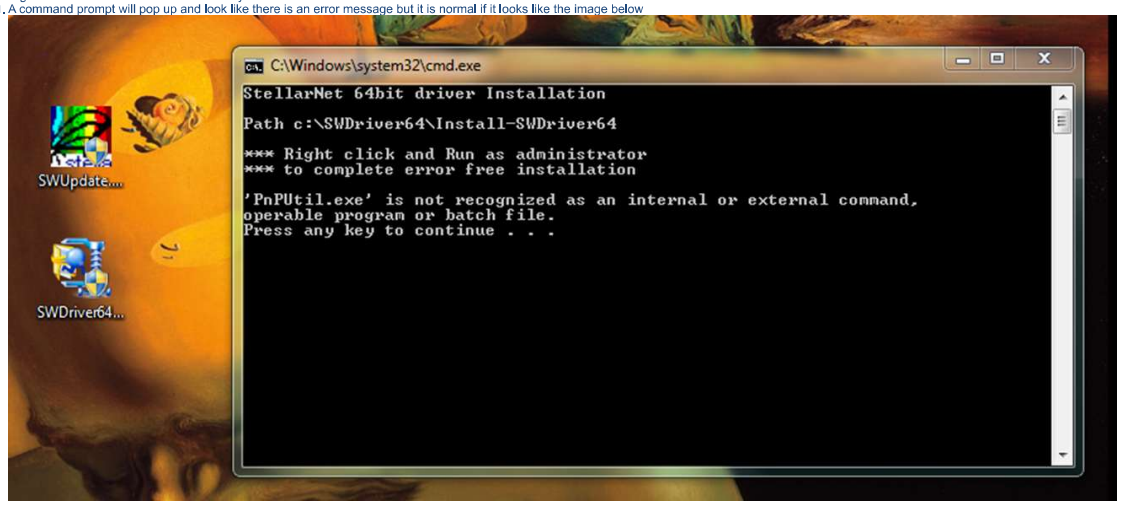

12. Now you need to open windows explorer
13. Right click on the start menu and choose "open windows explorer"
14. In the left hand panel, scroll down to the C: drive and left click on it to display its contents in the right hand panel
15. There should be a folder called SWDriver64
16. Open this folder
17. Right click on Install-SWDriver64.bat
18. Choose "**Run as administrator**"

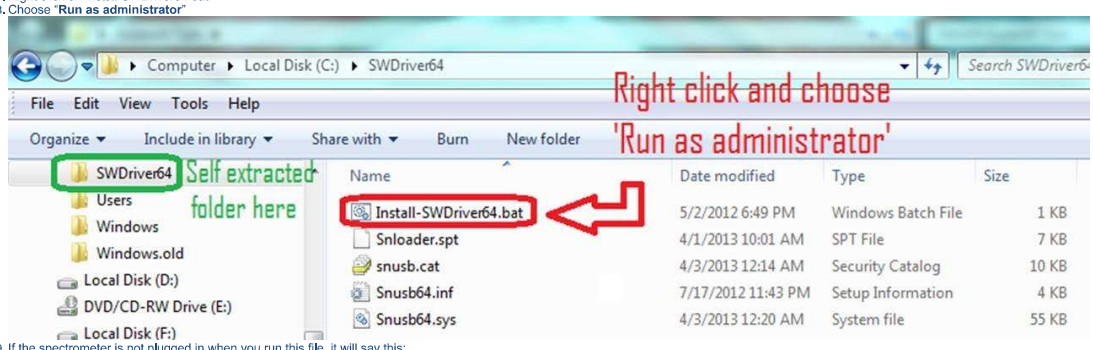

19. If the spectrometer is not plugged in when you run this file, it will say this:

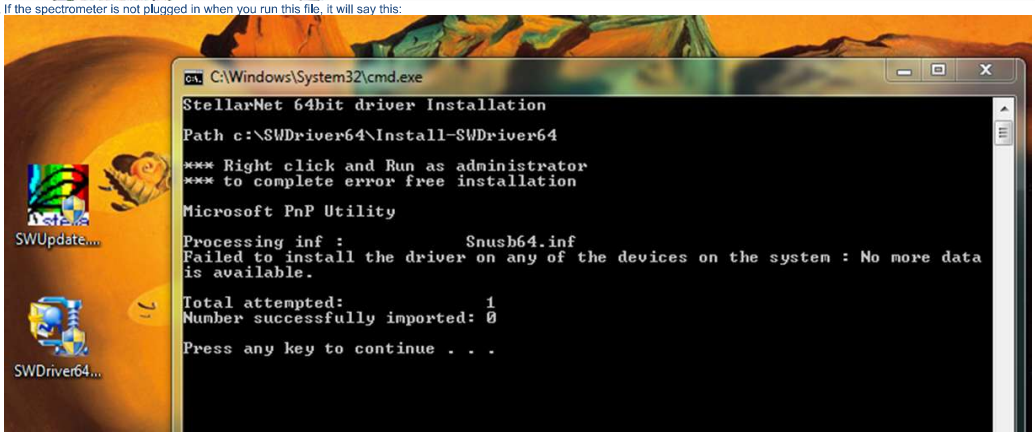

20. If you plug in the USB for the spectrometer into a properly functioning USB port, your instrument's green light should turn on.
21. If your green light doesn't turn on after following the above steps exactly, try following the steps again. If the 2nd attempt doesn't work try installing on a different USB port.
22. Now Run SpectraWiz as administrator, Right click on the SpectraWiz icon and choose "**Run as administrator**"


FOR 32BIT:

-Make sure to download the SWDrivers.zip file from our website and save it to your desktop. To get this file and the SWUpdate file, register on the software download page and we will send you a link to the files.

-Unzip it/extract it to your desktop by right clicking and choosing extract or unzip and specifying that you want it to unzip to a folder on the desktop.


-The procedure will vary for each version of windows but the driver must be installed manually from the Windows Device Manager. To find the device manager you can usually find under the icon view of the Control Panel.


-With the spectrometer plugged in, find the "Unknown" device under the USB section, right click and choose "Update Driver." **Do *not* pick the option which searches automatically.**

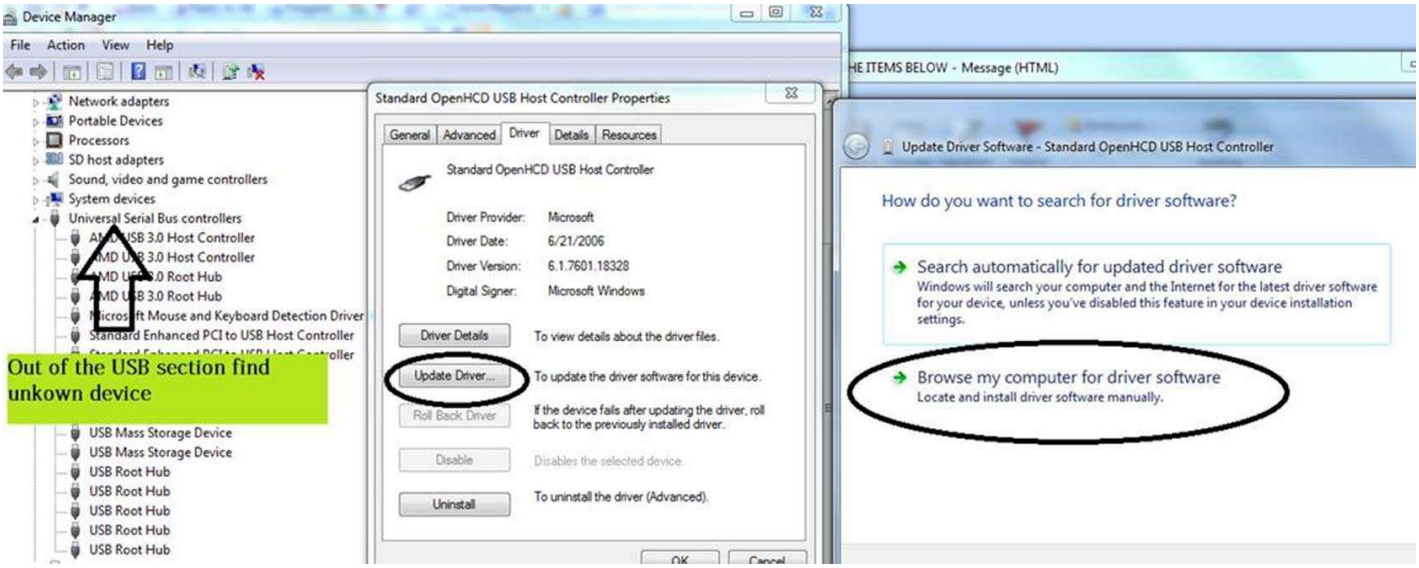

Do pick the option which appears to **manually search in a specific location or a deeper option may appear which says "Have Disk."** For all modern spectrometers, the file is C:\Users\(*YOUR NAME)*\Desktop\SWDrivers13\SWDrivers-USB2-Spectrometers\WinXP-Vista-7\snusb.inf



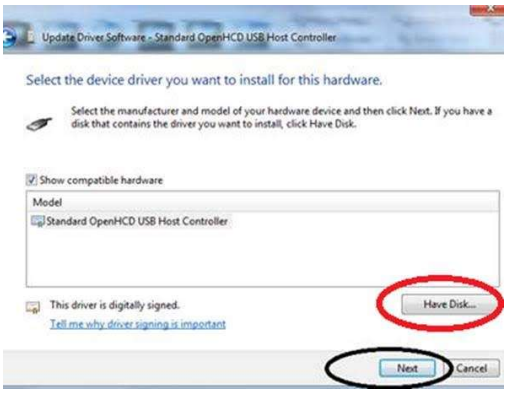

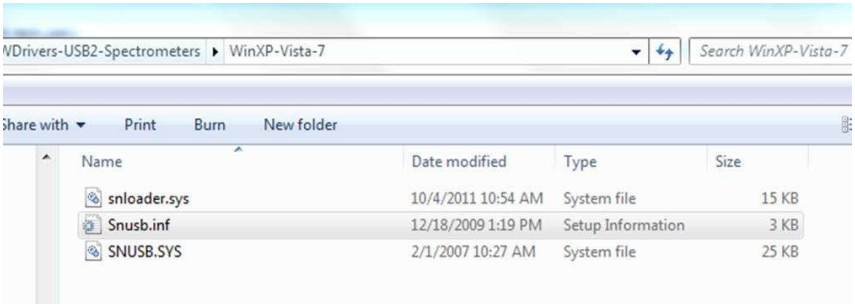

I hope this helps!

Also, check out Spectroscopy Pro-Tools – you might like it.

If you have any questions, reach out to me or email support@stellarnet.us

Cheers,

Applications Scientist

StellarNet Inc.
14390 Carlson Circle
Tampa, FL 33626
Office +1(813)855-8687

Mobile +1(813)815-0551
Fax +1(813)855-0394

www.StellarNet.us