

PT1-T / PT1/M 上面包板

PLAN / mm / 1:1 / Origin lower-left / Z=0 at bottom bearing face


7075 aluminum alloy; black anodize; R1-A7075; geometry R1; physical validation pending.

Threads: TAP-DRILL cylinder in STEP. See PDF thread/depth table. NOT CAM toolpath.

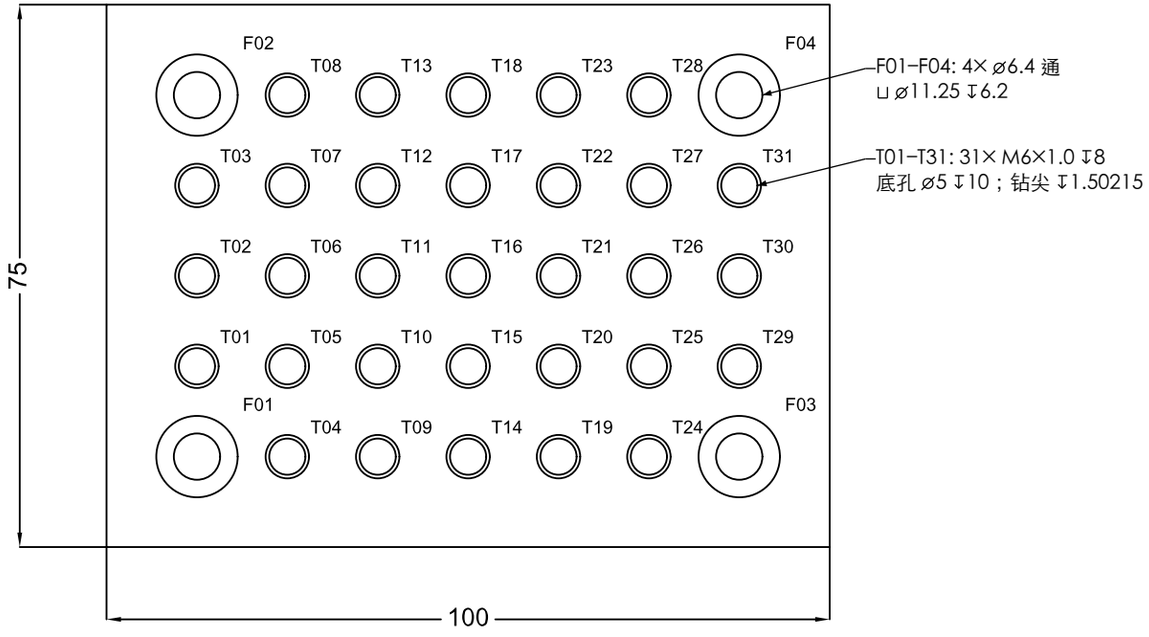

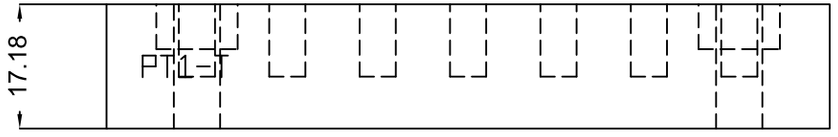

FRONT (-Y)

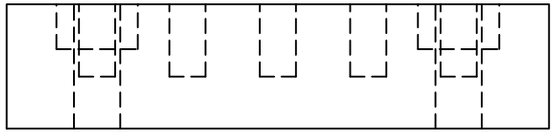

RIGHT (+X)

HOLE TABLE / depths from entry face

T01 X12.5 Y25 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T02 X12.5 Y37.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T03 X12.5 Y50 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T04 X25 Y12.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T05 X25 Y25 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T06 X25 Y37.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T07 X25 Y50 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T08 X25 Y62.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T09 X37.5 Y12.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T10 X37.5 Y25 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T11 X37.5 Y37.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T12 X37.5 Y50 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T13 X37.5 Y62.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T14 X50 Y12.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T15 X50 Y25 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T16 X50 Y37.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T17 X50 Y50 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T18 X50 Y62.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T19 X62.5 Y12.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T20 X62.5 Y25 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T21 X62.5 Y37.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T22 X62.5 Y50 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T23 X62.5 Y62.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T24 X75 Y12.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T25 X75 Y25 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T26 X75 Y37.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T27 X75 Y50 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T28 X75 Y62.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T29 X87.5 Y25 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T30 X87.5 Y37.5 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
T31 X87.5 Y50 TOP M6x1.0 TAP-D5 DRILL=10 THREAD=8 TIP=1.5022
F01 X12.5096 Y12.5064 TOP D6.4 DRILL=THRU CB D11.25 DEPTH6.2
F02 X12.5096 Y62.4936 TOP D6.4 DRILL=THRU CB D11.25 DEPTH6.2
F03 X87.4904 Y12.5064 TOP D6.4 DRILL=THRU CB D11.25 DEPTH6.2
F04 X87.4904 Y62.4936 TOP D6.4 DRILL=THRU CB D11.25 DEPTH6.2