IP-72 Error codes 147, 148 (pg 1 of 3)
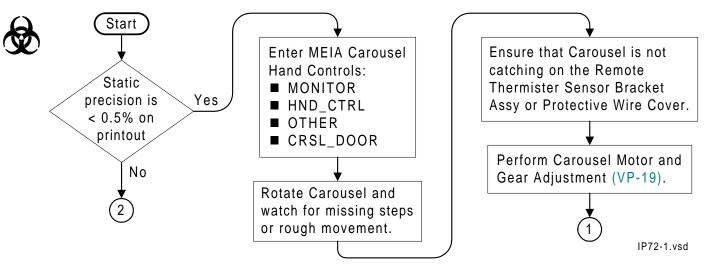
EC-147: Static Precision out of spec   EC-148: Dynamic Precision out of spec
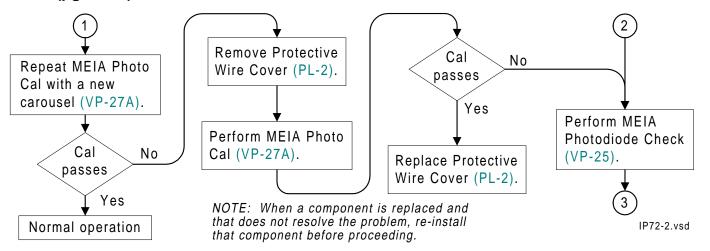

IP72-1.vsd

| Chapter Contents | Manual Contents | CD Main Screen | Index |

Flowchart:

1 →

Repeat MEIA Photo Cal with a new carousel (VP-27A). →

Cal passes — No → Remove Protective Wire Cover (PL-2). → Perform MEIA Photo Cal (VP-27A). → Cal passes — No → Perform MEIA Photodiode Check (VP-25). → 3

Cal passes — Yes → Normal operation

Cal passes — Yes → Replace Protective Wire Cover (PL-2).

2 → Perform MEIA Photodiode Check (VP-25). → 3

NOTE: When a component is replaced and that does not resolve the problem, re-install that component before proceeding.

IP72-2.vsd

| Chapter Contents | Manual Contents | CD Main Screen | Index |

IP72-3.vsd

| Chapter Contents | Manual Contents | CD Main Screen | Index |