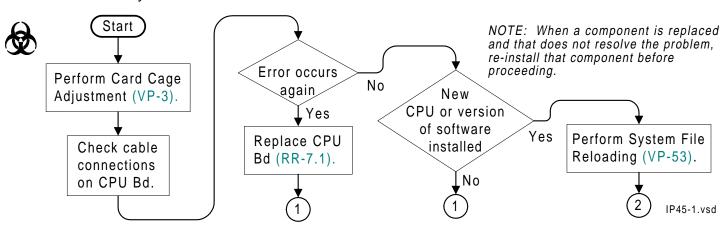## IP-45   Error codes 79, 100, 101, 102 (pg 1 of 2)

EC-79:   File reloaded X Y
EC-100: Directory checksum error

EC-101: File checksum error
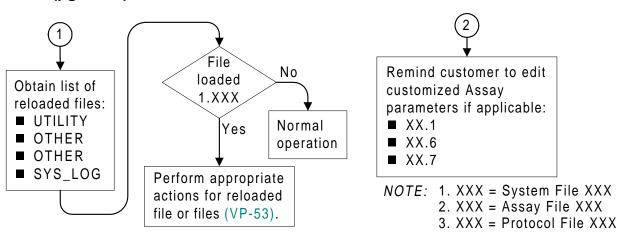EC-102: Initialize database

NOTE: When a component is replaced and that does not resolve the problem, re-install that component before proceeding.

Start

Perform Card Cage Adjustment (VP-3).

Check cable connections on CPU Bd.

Error occurs again

Yes

Replace CPU Bd (RR-7.1).

1

No

New CPU or version of software installed

No

1

Yes

Perform System File Reloading (VP-53).

2

IP45-1.vsd

Chapter Contents | Manual Contents | CD Main Screen | Index

Obtain list of
reloaded files:
- UTILITY
- OTHER
- OTHER
- SYS_LOG

File loaded 1.XXX

Yes → Perform appropriate actions for reloaded file or files (VP-53).

No → Normal operation

Remind customer to edit customized Assay parameters if applicable:
- XX.1
- XX.6
- XX.7

NOTE: 1. XXX = System File XXX
2. XXX = Assay File XXX
3. XXX = Protocol File XXX

IP45-2.vsd