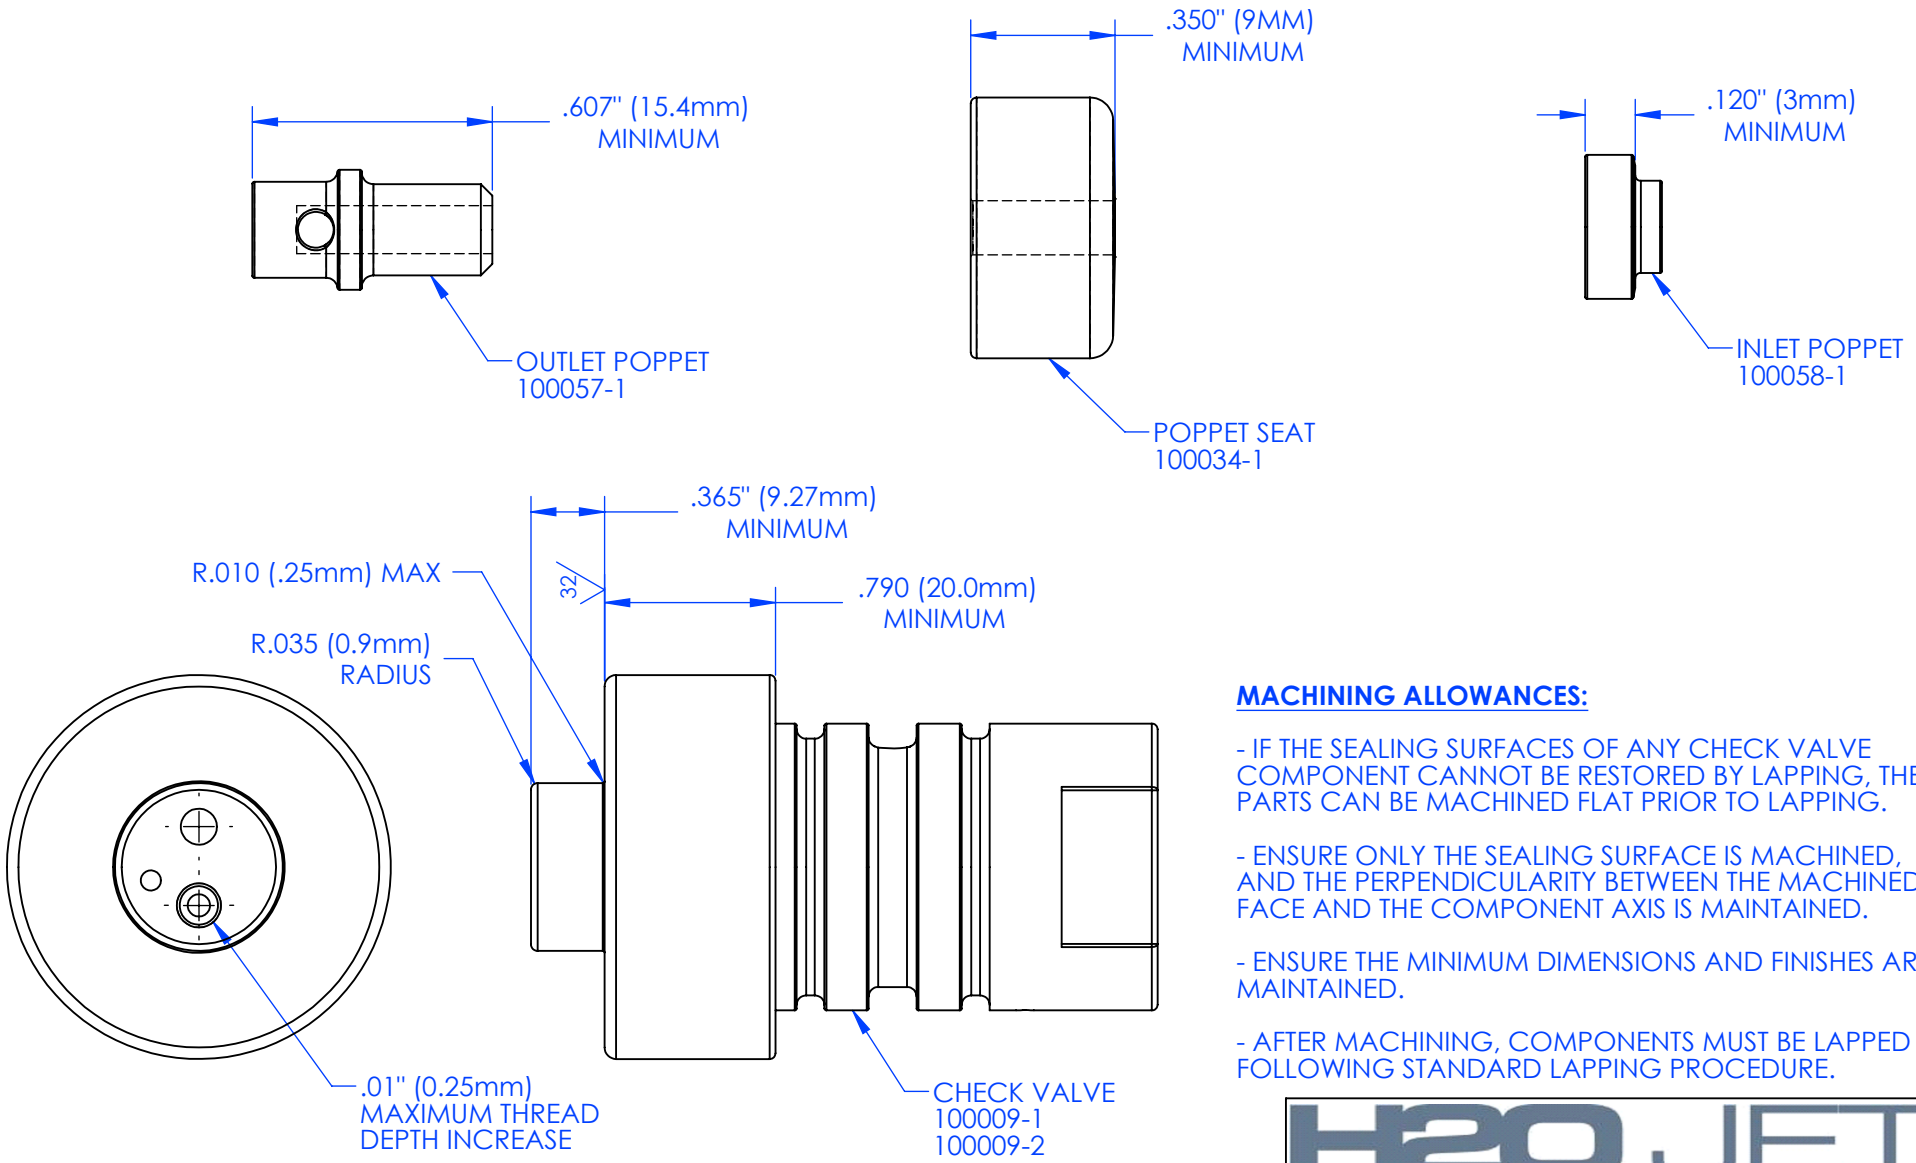


MACHINING ALLOWANCES:

- IF THE SEALING SURFACES OF ANY CHECK VALVE COMPONENT CANNOT BE RESTORED BY LAPPING, THE PARTS CAN BE MACHINED FLAT PRIOR TO LAPPING.

- ENSURE ONLY THE SEALING SURFACE IS MACHINED, AND THE PERPENDICULARITY BETWEEN THE MACHINED FACE AND THE COMPONENT AXIS IS MAINTAINED.

- ENSURE THE MINIMUM DIMENSIONS AND FINISHES ARE MAINTAINED.

- AFTER MACHINING, COMPONENTS MUST BE LAPPED FOLLOWING STANDARD LAPPING PROCEDURE.

H2O JET™

PROPRIETARY AND CONFIDENTIAL:
THE INFORMATION CONTAINED IN THIS DRAWING IS THE SOLE PROPERTY OF H2O JET INC. ANY REPRODUCTION IN PARTOR AS A WHOLE WITHOUT THE WRITTEN PERMISSION OF H2O JET INC. IS PROHIBITED.

UNLESS OTHERWISE SPECIFIED:
DIMENSIONS IN INCHES AND DEGREES. DIAMETERS ON A COMMON CENTERLINE TO BE TRUE POSITION WITHIN .010. REMOVE BURRS AND BREAK SHARP CORNERS AND FILLET RADII .030 MAXIMUM

ALL MACHINED SURFACES TO 63
TOLERANCES PER ANSI Y14.5.
DIMENSIONAL X.XXX ±.005
X.XX ±.010
X.X ±.030
ANGULAR X.X ±.5
X ±1

DRAWN:	M.H.
CHECKED:	
APPRVD:	H.A.
SCALE:	NTS
DATE:	11/12/2009

TITLE:
CHECK VALVE COMPONENT MACHINING ALLOWANCES

REF. NO:

MADE FROM:

SIZE	DWG. NO.	REV.	SHEET
A	301002-X MACHINING	0	1 OF 1

3 2 1