

AN228

A CAN Physical Layer Discussion

Author: Pat Richards

Microchip Technology Inc.

INTRODUCTION

Many network protocols are described using the seven layer Open System Interconnection (OSI) model, as shown in Figure 1. The Controller Area Network (CAN) protocol defines the Data Link Layer and part of the Physical Layer in the OSI model. The remaining physical layer (and all of the higher layers) are not defined by the CAN specification. These other layers can either be defined by the system designer, or they can be implemented using existing non-proprietary Higher Layer Protocols (HLPs) and physical layers.


The Data Link Layer is defined by the CAN specification. The Logical Link Control (LLC) manages the overload control and notification, message filtering and recovery management functions. The Medium Access Control (MAC) performs the data encapsulation/decapsulation, error detection and control, bit stuffing/destuffing and the serialization and deserialization functions.

The Physical Medium Attachment (PMA) and Medium Dependent Interface (MDI) are the two parts of the physical layer which are not defined by CAN. The Physical Signaling (PS) portion of the physical layer is defined by the CAN specification. The system designer can choose any driver/receiver and transport medium as long as the PS requirements are met.

The International Standards Organization (ISO) has defined a standard which incorporates the CAN specification as well as the physical layer. The standard, ISO-11898, was originally created for high-speed invehicle communications using CAN. ISO-11898 specifies the physical layer to ensure compatibility between CAN transceivers.

A CAN controller typically implements the entire CAN specification in hardware, as shown in Figure 1. The PMA is not defined by CAN, however, it is defined by ISO-11898. This document discusses the MCP2551 CAN transceiver and how it fits in with the ISO-11898 specification.

FIGURE 1: CAN AND THE OSI MODEL

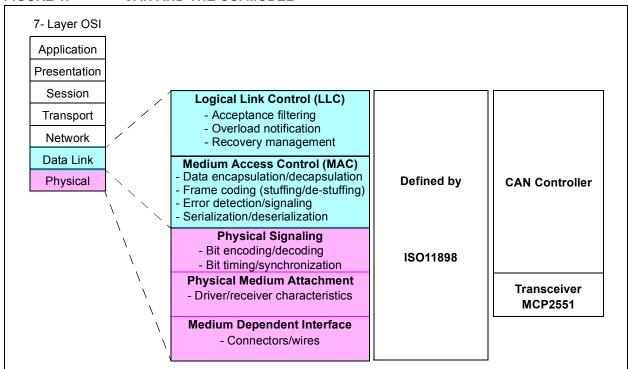

ISO11898-2 OVERVIEW

ISO11898 is the international standard for high-speed CAN communications in road vehicles. ISO-11898-2 specifies the PMA and MDA sublayers of the Physical Layer. See Figure 3 for a representation of a common CAN node/bus as described by ISO-11898.


Bus Levels

CAN specifies two logical states: recessive and dominant. ISO-11898 defines a differential voltage to represent recessive and dominant states (or bits), as shown in Figure 2.

In the recessive state (i.e., logic '1' on the MCP2551 TXD input), the differential voltage on CANH and CANL is less than the minimum threshold (<0.5V receiver input or <1.5V transmitter output)(See Figure 4).

In the dominant state (i.e., logic '0' on the MCP2551 TXD input), the differential voltage on CANH and CANL is greater than the minimum threshold. A dominant bit overdrives a recessive bit on the bus to achieve nondestructive bitwise arbitration.

FIGURE 2: DIFFERENTIAL BUS

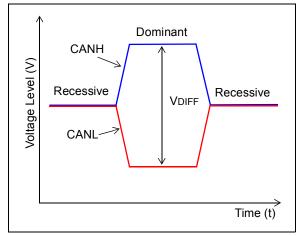


Connectors and Wires

ISO-11898-2 does not specify the mechanical wires and connectors. However, the specification does require that the wires and connectors meet the electrical specification.

The specification also requires 120Ω (nominal) terminating resistors at each end of the bus. Figure 3 shows an example of a CAN bus based on ISO-11898.

FIGURE 3: CAN BUS

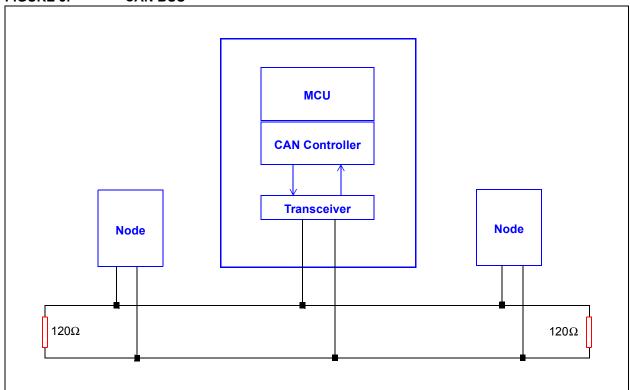

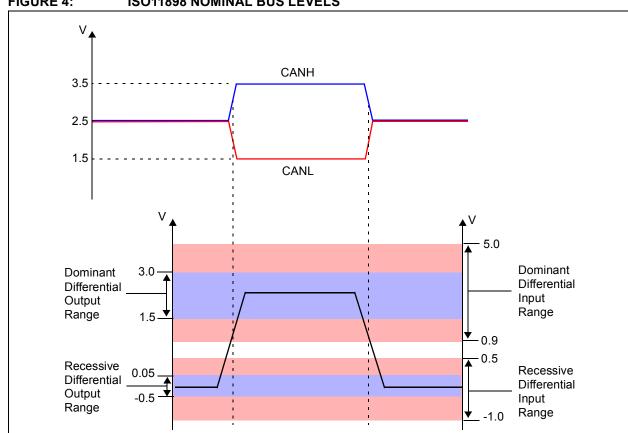


FIGURE 4: ISO11898 NOMINAL BUS LEVELS

Robustness

The ISO11898-2 specification requires that a compliant or compatible transceiver must meet a number of electrical specifications. Some of these specifications are intended to ensure the transceiver can survive harsh electrical conditions, thereby protecting the

communications of the CAN node. The transceiver must survive short circuits on the CAN bus inputs from -3V to +32V and transient voltages from -150V to +100V. Table 1 shows the major ISO11898-2 electrical requirements, as well as MCP2551 specifications.

TABLE 1: COMPARING THE MCP2551 TO ISO11898-2

Parameter	ISO-11898-4		MCP2551		l lmi4	Comments
	min	max	min	max	Unit	Comments
DC Voltage on CANH and CANL	-3	+32	-40	+40	V	Exceeds ISO-11898
Transient voltage on CANH and CANL	-150	+100	-250	+250	V	Exceeds ISO-11898
Common Mode Bus Voltage	-2.0	+7.0	-12	+12	V	Exceeds ISO-11898
Recessive Output Bus Voltage	+2.0	+3.0	+2.0	+3.0	V	Meets ISO-11898
Recessive Differential Output Voltage	-500	+50	-500	+50	mV	Meets ISO-11898
Differential Internal Resistance	10	100	20	100	kΩ	Meets ISO-11898
Common Mode Input Resistance	5.0	50	5.0	50	kΩ	Meets ISO-11898
Differential Dominant Output Voltage	+1.5	+3.0	+1.5	+3.0	V	Meets ISO-11898
Dominant Output Voltage (CANH)	+2.75	+4.50	+2.75	+4.50	V	Meets ISO-11898
Dominant Output Voltage (CANL)	+0.50	+2.25	+0.50	+2.25	V	Meets ISO-11898
Permanent Dominant Detection (Driver)	Not Required		1.25	_	ms	
Power-On Reset and Brown-Out Detection	Not Required		Yes			

Bus Lengths

ISO11898 specifies that a transceiver must be able to drive a 40m bus at 1 Mb/s. A longer bus length can be achieved by slowing the data rate. The biggest limitation to bus length is the transceiver's propagation delay.

PROPAGATION DELAY

The CAN protocol has defined a recessive (logic '1') and dominant (logic '0') state to implement a non-destructive bit-wise arbitration scheme. It is this arbitration methodology that is affected most by propagation delays. Each node involved with arbitration must be able to sample each bit level within the same bit time. For example, if two nodes at opposite ends of the bus start to transmit their messages at the same time, they must arbitrate for control of the bus. This arbitration is only effective if both nodes are able to sample during


the same bit time. Figure 5 shows a one-way propagation delay between two nodes. Extreme propagation delays (beyond the sample point) will result in invalid arbitration. This implies that bus lengths are limited at given CAN data rates.

A CAN system's propagation delay is calculated as being a signal's round-trip time on the physical bus (tbus), the output driver delay (tdrv) and the input comparator delay (tcmp). Assuming all nodes in the system have similar component delays, the propagation delay is explained mathematically:

EQUATION 1:

 $tprop = 2 \cdot (tbus + tcmp + tdrv)$

FIGURE 5: ONE-WAY PROPAGATION DELAY

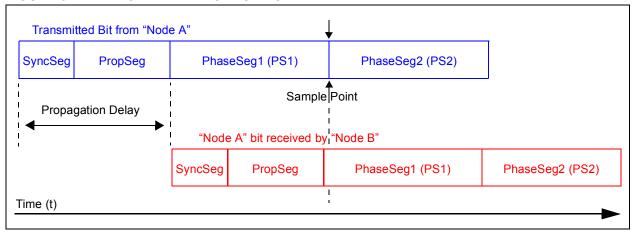

MCP2551 CAN TRANSCEIVER

The MCP2551 is a CAN Transceiver that implements the ISO-11898-2 physical layer specification. It supports a 1 Mb/s data rate and is suitable for 12 V and 24 V systems. The MCP2551 provides short-circuit protection up to ± 40 V and transient protection up to ± 250 V.

In addition to being ISO-11898-2-compatible, the MCP2551 provides power-on reset and brown-out protection, as well as permanent dominant detection to ensure an unpowered or faulty node will not disturb the bus. The device implements configurable slope control on the bus pins to help reduce RFI emissions. Figure 6 shows the block diagram of the MCP2551.

General MCP2551 Operation

TRANSMIT

The CAN protocol controller outputs a serial data stream to the logic TXD input of the MCP2551. The corresponding recessive or dominant state is output on the CANH and CANL pins.

RECEIVE

The MCP2551 receives dominant or recessive states on the same CANH and CANL pins as the transmit occurs. These states are output as logic levels on the RXD pin for the CAN protocol controller to receive CAN frames.


RECESSIVE STATE

A logic '1' on the TXD input turns off the drivers to the CANH and CANL pins and the pins "float" to a nominal 2.5V via biasing resistors.

DOMINANT STATE

A logic '0' on the TXD input turns on the CANH and CANL pin drivers. CANH drives ~1V higher than the nominal 2.5V recessive state to ~3.5V. CANL drives ~1V less than the nominal 2.5V recessive state to ~1.5V.



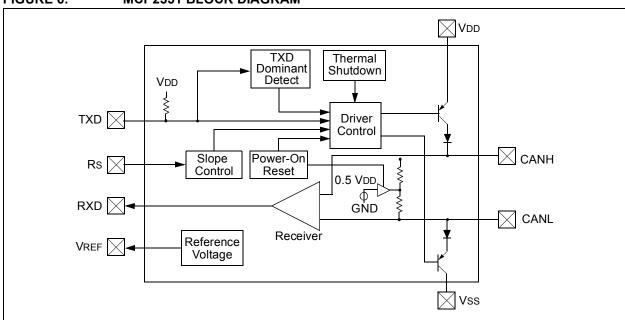

Modes of Operation

There are three modes of operation that are externally controlled via the Rs pin:

- 1. High-Speed
- 2. Slope Control
- Standby

HIGH-SPEED

The high-speed mode is selected by connecting the Rs pin to Vss. In this mode, the output drivers have fast rise and fall times that support the higher bus rates up to 1 Mb/s and/or maximum bus lengths by providing the minimum transceiver loop delays.

SLOPE CONTROL

If reduced EMI is required, the MCP2551 can be placed in slope control mode by connecting a resistor (REXT) from the Rs pin to ground. In slope control mode, the single-ended slew rate (CANH or CANL) is basically proportional to the current out of the Rs pin. The current must be in the range of 10 $\mu A <$ -IRS < 200 μA , which corresponds to a voltage on the pin of 0.4 VDD < VRS < 0.6 VDD respectively (or 0.5 VDD typical).

The decreased slew rate implies a slower CAN data rate at a given bus length, or a reduced bus length at a given CAN data rate.

STANDBY

Standby (or sleep) mode is entered by connecting the Rs pin to VDD. In sleep mode, the transmitter is switched off and the receiver operates in a reduced power mode. While the receive pin (RXD) is still functional, it will operate at a slower rate.

Standby mode can be used to place the device in low power mode and to turn off the transmitter in case the CAN controller malfunctions and sends unexpected data to the bus.


Permanent Dominant Detection on Transmitter

The MCP2551 will turn off the transmitter to CANH and CANL if an extended dominant state is detected on the transmitter. This ability prevents a faulty node (CAN controller or MCP2551) from permanently corrupting the CAN bus.

The drivers are disabled if TXD is low for more than ~1.25 ms (minimum) (See Figure 7).

The drivers will remain disabled as long as TXD remains low. A rising edge on TXD will reset the timer logic and enable the drivers.

FIGURE 7: TXD PERMANENT DOMINANT DETECTION

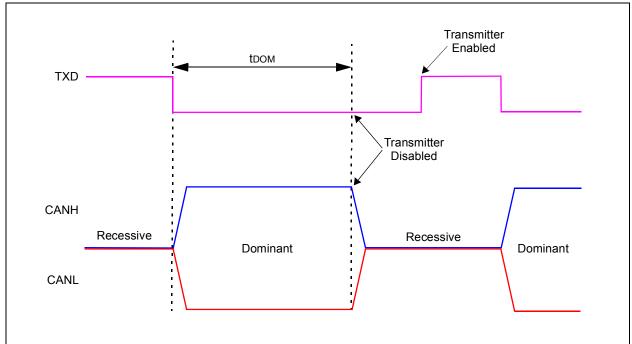

Power-On Reset and Brown-Out

The MCP2551 incorporates both Power-On Reset (POR) and Brown-Out Detection (BOD) (see Figure 8).

POWER-ON RESET (POR)


When the MCP2551 is powered on, the CANH and CANL pins remain in the high impedance state until VDD reaches the POR high voltage (VPORH). Additionally, if the TXD pin is low at power-up, the

CANH and CANL pins will remain in high impedance until TXD goes high. After which, the drivers will function normally.

BROWN-OUT DETECTION (BOD)

BOD occurs when VDD goes below the power-on reset low voltage (VPORL). At this point, the CANH and CANL pins enter a high impedance state and will remain there until VPORH is reached.

FIGURE 8: POWER-ON RESET AND BROWN-OUT DETECTION

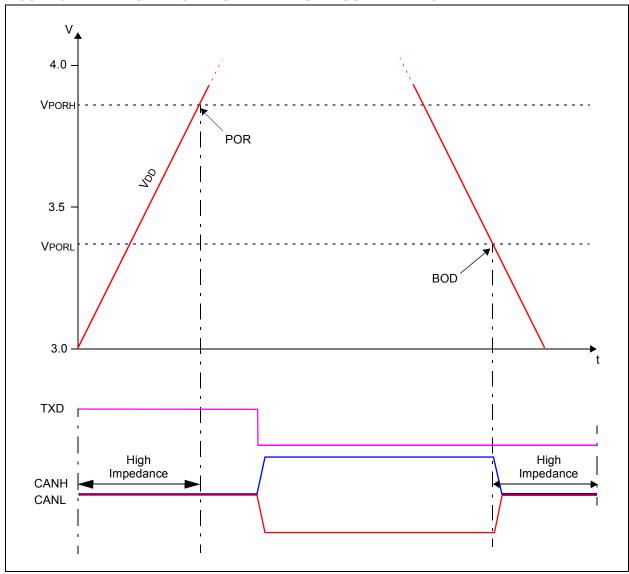

Ground Offsets

Since it is not required to provide a common ground between nodes, it is possible to have ground offsets between nodes. That is, each node may observe different single-ended bus voltages (common mode bus voltages) while maintaining the same differential voltage. While the MCP2551 is specified to handle ground offsets from -12V to +12V, the ISO-11898 specification only requires -2V to +7V. Figure 9 and Figure 10 demonstrate how ground offsets appear between nodes.

Figure 9 shows the transmitting node with a positive ground offset with respect to the receiving node. The MCP2551 receiver can operate with CANH = +12V. The maximum CAN dominant output voltage (VO(CANH)) from the transmitting node is 4.5V. Subtracting this maximum yields an actual ground offset (with respect to the receiving node) of 7.5V for the transmitting node. In the recessive state, each node attempts to pull the CANH and CANL pins to their biasing levels


(2.5V typical). However, the resulting common mode voltage in the recessive state becomes 6.25V for the receiving node and -1.25V for the transmitting node.

Figure 10 shows the transmitting node with a negative ground offset with respect to the receiving node. The MCP2551 receiver can operate with CANL = -12V. The minimum CAN dominant output voltage (VO(CANL)) from the transmitting node is 0.5V. Subtracting this minimum yields an actual ground offset, with respect to the receiving node, of -12.5V. The common mode voltage for the recessive state is -6.25V for the receiving node and 6.25V for the transmitting node.

Since all nodes act as a transmitter for a portion of each message (i.e., each receiver must acknowledge (ACK) valid messages during the ACK slot), the largest ground offset allowed between nodes is 7.5V, as shown in Figure 9.

Operating a CAN system with large ground offsets can lead to increased electromagnetic emissions. Steps must be taken to eliminate ground offsets if the system is sensitive to emissions.

FIGURE 9: RECEIVING (NODE GROUND) BELOW TRANSMITTING (NODE GROUND)

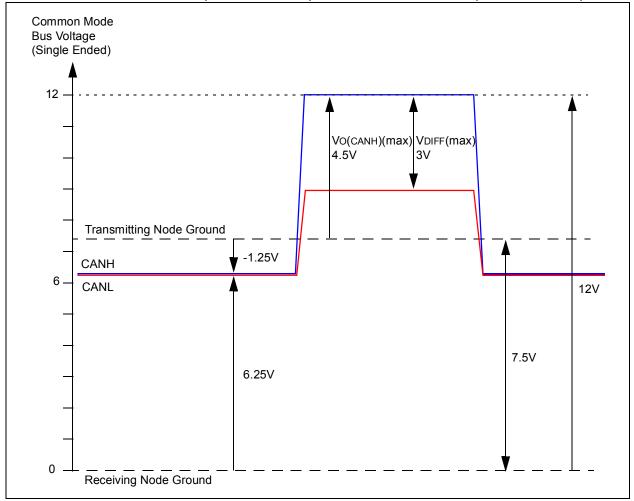

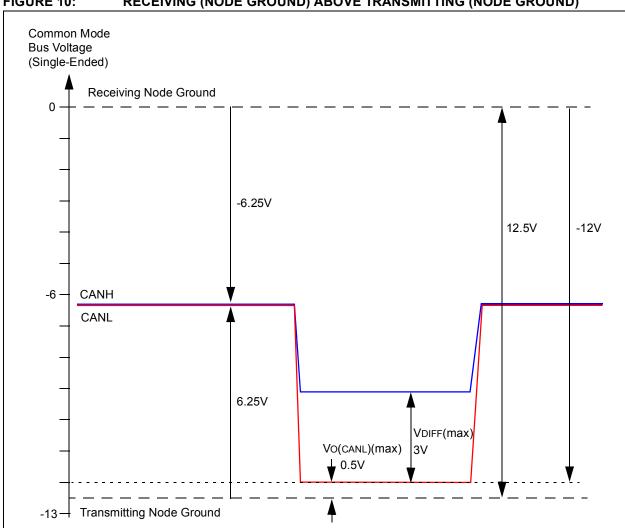


FIGURE 10: RECEIVING (NODE GROUND) ABOVE TRANSMITTING (NODE GROUND)

BUS TERMINATION

Bus termination is used to minimize signal reflection on the bus. ISO-11898 requires that the CAN bus have a nominal characteristic line impedance of 120Ω . Therefore, the typical terminating resistor value for each end of the bus is 120Ω . There are a few different termination methods used to help increase EMC performance (see Figure 11).

- Standard Termination 1.
- **Split Termination**
- 3. Biased Split Termination

Note: EMC performance is not determined solely by the transceiver and termination method, but rather by careful consideration of all components and topology of the system.

Standard Termination

As the name implies, this termination uses a single 120Ω resistor at each end of the bus. This method is acceptable in many CAN systems.

Split Termination


Split termination is a concept that is growing in popularity because emission reduction can be achieved very easily. Split termination is a modified standard termination in which the single 120Ω resistor on each end of the bus is split into two 60Ω resistors, with a bypass capacitor tied between the resistors and to ground. The two resistors should match as close as possible.

Biased Split Termination

This termination method is used to maintain the common mode recessive voltage at a constant value, thereby increasing EMC performance. This circuit is the same as the split termination with the addition of a voltage divider circuit to achieve a voltage of VDD/2 between the two 60 Ω resistors (see Figure 11).

Note: The biasing resistors in Figure 11, as well as the split termination resistors, should match as close as possible.

FIGURE 11: TERMINATION CONCEPTS

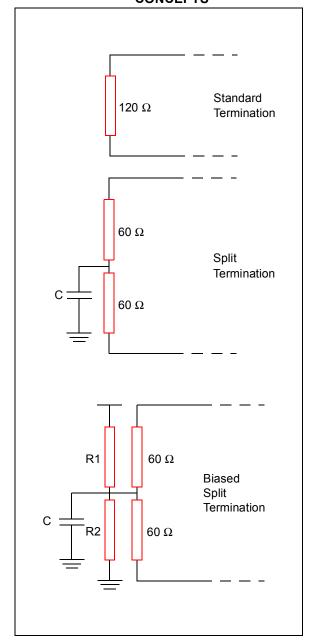

REFERENCES

MCP2551 Data Sheet, "High Speed CAN Transceiver", DS21667, Microchip Technology, Inc.

AN754, "Understanding Microchip's CAN Module Bit Timing", DS00754, Microchip Technology, Inc.

ISO-11898-2, "Road Vehicles - Interchange of Digital Information - Part 2: High Speed Medium Access Unit and Medium Dependent Interface", International Organization for Standardization.

CAN System Engineering, "From Theory to Practical Applications", Wolfhard Lawrenz, Springer.

Note the following details of the code protection feature on Microchip devices:

- · Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- · Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not
 mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products.

Information contained in this publication regarding device applications and the like is intended through suggestion only and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. No representation or warranty is given and no liability is assumed by Microchip Technology Incorporated with respect to the accuracy or use of such information, or infringement of patents or other intellectual property rights arising from such use or otherwise. Use of Microchip's products as critical components in life support systems is not authorized except with express written approval by Microchip. No licenses are conveyed, implicitly or otherwise, under any intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, KEELOQ, MPLAB, PIC, PICmicro, PICSTART and PRO MATE are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.


FilterLab, microID, MXDEV, MXLAB, PICMASTER, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

dsPIC, dsPICDEM.net, ECONOMONITOR, FanSense, FlexROM, fuzzyLAB, In-Circuit Serial Programming, ICSP, ICEPIC, microPort, Migratable Memory, MPASM, MPLIB, MPLINK, MPSIM, PICC, PICDEM, PICDEM.net, rfPIC, Select Mode and Total Endurance are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

Serialized Quick Turn Programming (SQTP) is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2002, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

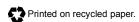



Microchip received QS-9000 quality system certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona in July 1999 and Mountain View, California in March 2002. The Company's quality system processes and procedures are QS-9000 compliant for its PICmicro® 8-bit MCUs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, non-volatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001 certified



WORLDWIDE SALES AND SERVICE

AMERICAS

Corporate Office

2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Fax: 480-792-7277 Technical Support: 480-792-7627 Web Address: http://www.microchip.com

Rocky Mountain

2355 West Chandler Blvd. Chandler, AZ 85224-6199

Tel: 480-792-7966 Fax: 480-792-4338

Atlanta

500 Sugar Mill Road, Suite 200B Atlanta, GA 30350 Tel: 770-640-0034 Fax: 770-640-0307

Boston

2 Lan Drive, Suite 120 Westford, MA 01886

Tel: 978-692-3848 Fax: 978-692-3821

Chicago

333 Pierce Road, Suite 180 Itasca, IL 60143

Tel: 630-285-0071 Fax: 630-285-0075

4570 Westgrove Drive, Suite 160 Addison, TX 75001 Tel: 972-818-7423 Fax: 972-818-2924

Detroit

Tri-Atria Office Building 32255 Northwestern Highway, Suite 190 Farmington Hills, MI 48334 Tel: 248-538-2250 Fax: 248-538-2260

Kokomo

2767 S. Albright Road Kokomo, Indiana 46902 Tel: 765-864-8360 Fax: 765-864-8387

Los Angeles

18201 Von Karman, Suite 1090 Irvine, CA 92612 Tel: 949-263-1888 Fax: 949-263-1338

San Jose

Microchip Technology Inc. 2107 North First Street, Suite 590 San Jose, CA 95131 Tel: 408-436-7950 Fax: 408-436-7955

Toronto

6285 Northam Drive, Suite 108 Mississauga, Ontario L4V 1X5, Canada Tel: 905-673-0699 Fax: 905-673-6509

ASIA/PACIFIC

Australia

Microchip Technology Australia Pty Ltd Suite 22, 41 Rawson Street Epping 2121, NSW Australia

Tel: 61-2-9868-6733 Fax: 61-2-9868-6755

China - Beijing

Microchip Technology Consulting (Shanghai) Co., Ltd., Beijing Liaison Office

Bei Hai Wan Tai Bldg. No. 6 Chaoyangmen Beidajie Beijing, 100027, No. China Tel: 86-10-85282100 Fax: 86-10-85282104

China - Chengdu

Microchip Technology Consulting (Shanghai) Co., Ltd., Chengdu Liaison Office Rm. 2401, 24th Floor, Ming Xing Financial Tower No. 88 TIDU Street Chengdu 610016, China Tel: 86-28-86766200 Fax: 86-28-86766599

China - Fuzhou

Microchip Technology Consulting (Shanghai) Co., Ltd., Fuzhou Liaison Office Unit 28F, World Trade Plaza No. 71 Wusi Road Fuzhou 350001, China Tel: 86-591-7503506 Fax: 86-591-7503521

China - Shanghai

Microchip Technology Consulting (Shanghai) Co., Ltd. Room 701, Bldg. B Far East International Plaza No. 317 Xian Xia Road Shanghai, 200051 Tel: 86-21-6275-5700 Fax: 86-21-6275-5060

China - Shenzhen

Microchip Technology Consulting (Shanghai) Co., Ltd., Shenzhen Liaison Office Rm. 1315, 13/F, Shenzhen Kerry Centre, Renminnan Lu

Shenzhen 518001, China Tel: 86-755-82350361 Fax: 86-755-82366086

China - Hong Kong SAR

Microchip Technology Hongkong Ltd. Unit 901-6, Tower 2, Metroplaza 223 Hing Fong Road Kwai Fong, N.T., Hong Kong Tel: 852-2401-1200 Fax: 852-2401-3431

India

Microchip Technology Inc. India Liaison Office Divvasree Chambers 1 Floor, Wing A (A3/A4) No. 11, O'Shaugnessey Road Bangalore, 560 025, India Tel: 91-80-2290061 Fax: 91-80-2290062

Japan

Microchip Technology Japan K.K. Benex S-1 6F 3-18-20, Shinyokohama Kohoku-Ku, Yokohama-shi Kanagawa, 222-0033, Japan Tel: 81-45-471-6166 Fax: 81-45-471-6122

Korea

Microchip Technology Korea 168-1, Youngbo Bldg. 3 Floor Samsung-Dong, Kangnam-Ku Seoul, Korea 135-882

Tel: 82-2-554-7200 Fax: 82-2-558-5934

Singapore

Microchip Technology Singapore Pte Ltd. 200 Middle Road #07-02 Prime Centre Singapore, 188980 Tel: 65-6334-8870 Fax: 65-6334-8850

Taiwan

Microchip Technology (Barbados) Inc., Taiwan Branch 11F-3, No. 207 Tung Hua North Road Taipei, 105, Taiwan Tel: 886-2-2717-7175 Fax: 886-2-2545-0139

EUROPE

Austria

Microchip Technology Austria GmbH Durisolstrasse 2 A-4600 Wels Tel: 43-7242-2244-399 Fax: 43-7242-2244-393

Denmark

Microchip Technology Nordic ApS Regus Business Centre Lautrup hoj 1-3 Ballerup DK-2750 Denmark Tel: 45 4420 9895 Fax: 45 4420 9910

France

Microchip Technology SARL Parc d'Activite du Moulin de Massy 43 Rue du Saule Trapu Batiment A - ler Etage 91300 Massy, France Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79

Germany

Microchip Technology GmbH Steinheilstrasse 10 D-85737 Ismaning, Germany Tel: 49-89-627-144 0 Fax: 49-89-627-144-44

Microchip Technology SRL Centro Direzionale Colleoni Palazzo Taurus 1 V. Le Colleoni 1 20041 Agrate Brianza Milan, Italy Tel: 39-039-65791-1 Fax: 39-039-6899883

United Kingdom

Microchip Ltd. 505 Eskdale Road Winnersh Triangle Wokingham Berkshire, England RG41 5TU Tel: 44 118 921 5869 Fax: 44-118 921-5820

10/18/02