

Trainings ▾

Preparatory Steps

⚠ WARNING ⚠

This component or assembly weighs greater than 23 kg [50 lb]. To prevent serious personal injury, be sure to have assistance or use appropriate lifting equipment to lift this component or assembly.

Marine Application Only


- Disconnect the batteries. See equipment manufacturer service information.
- Remove the aftercooler heat shield. Refer to Procedure 010-129 in Section A. (</qs3/pubsys2/xml/en/procedures/56/56-010-129-om.html>)
- Remove the turbocharger heat shield. Contact a Cummins® Authorized Repair Location for removal of the turbocharger heat shield.
- Remove the air intake and exhaust piping. Contact a Cummins® Authorized Repair Location for removal of the air intake and exhaust piping.

Maintenance Check

Inspect the turbocharger compressor impeller blades for damage.

Contact a Cummins® Authorized Repair Location if damage is found.


Reference the model number on the turbocharger dataplate.

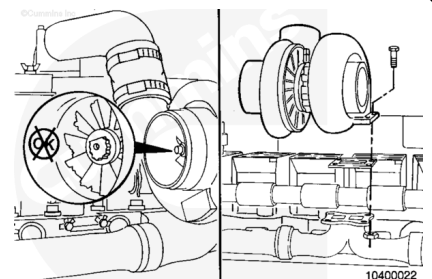

Measure

Use a depth gauge, Part Number ST-537, or a dial indicator to measure the axial motion (end-to-end).

Compressor Impeller Axial Endplay			
	mm		in
Holset® HX82/HX8 3/HE851 Turbocharg er	0.025	MIN	0.001
	0.152	MAX	0.006
Holset® HX60 Turbocharg er	0.051	MIN	0.002
	0.152	MAX	0.006
Holset® HX55 Turbocharg er	0.025	MIN	0.001
	0.127	MAX	0.005
Holset® HE800 HPRC Turbocharg er	0.009	MIN	0.0003
	0.141	MAX	0.0055

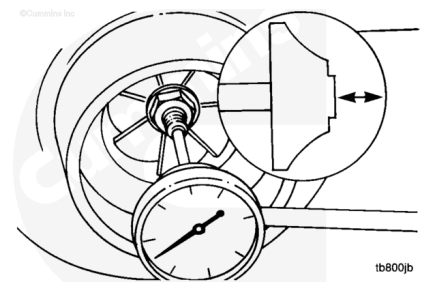


Make sure the movement is within the MIN/MAX TIR values shown above.

Note : If the axial clearance exceeds the specifications, the turbocharger must be replaced or rebuilt. Contact a Cummins® Authorized Repair Location.

Push the compressor impeller end of the shaft toward the housing.

Measure the radial clearance (side-to-side) at the compressor impeller nose using a dial indicator.

Compressor Impeller Radial Clearance			
	mm		in

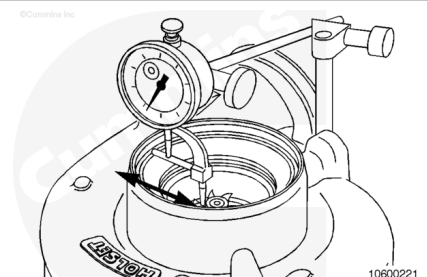


Holset® HX82/HX8 3/HE851 Turbocharg er	0.254	MIN	0.01
	0.787	MAX	0.031
Holset® HX60 Turbocharg er	0.406	MIN	0.016
	0.584	MAX	0.023
Holset® HX55 Turbocharg er	0.406	MIN	0.016
	0.061	MAX	0.024
Holset® HE800 HPRC Turbocharg er	0.0623	MIN	0.002
	0.8425	MAX	0.033

Make sure the movement is within the MIN/MAX TIR values shown above.

Note : If the radial clearance exceeds the specifications, the turbocharger must be replaced or rebuilt. Contact a Cummins® Authorized Repair Location.

Replace

Contact a Cummins® Authorized Repair Location to schedule this repair.

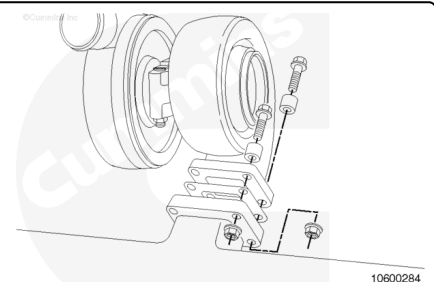

Last Modified: 17-Aug-2022
