


Fault Code: 113

Engine Timing Actuator Driver Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 113 PID(P): S20 SPN: 635 FMI: 3/3 Lamp: Amber SRT:	Open circuit or high voltage detected at the timing actuator driver circuit.	Possible reduced engine performance.

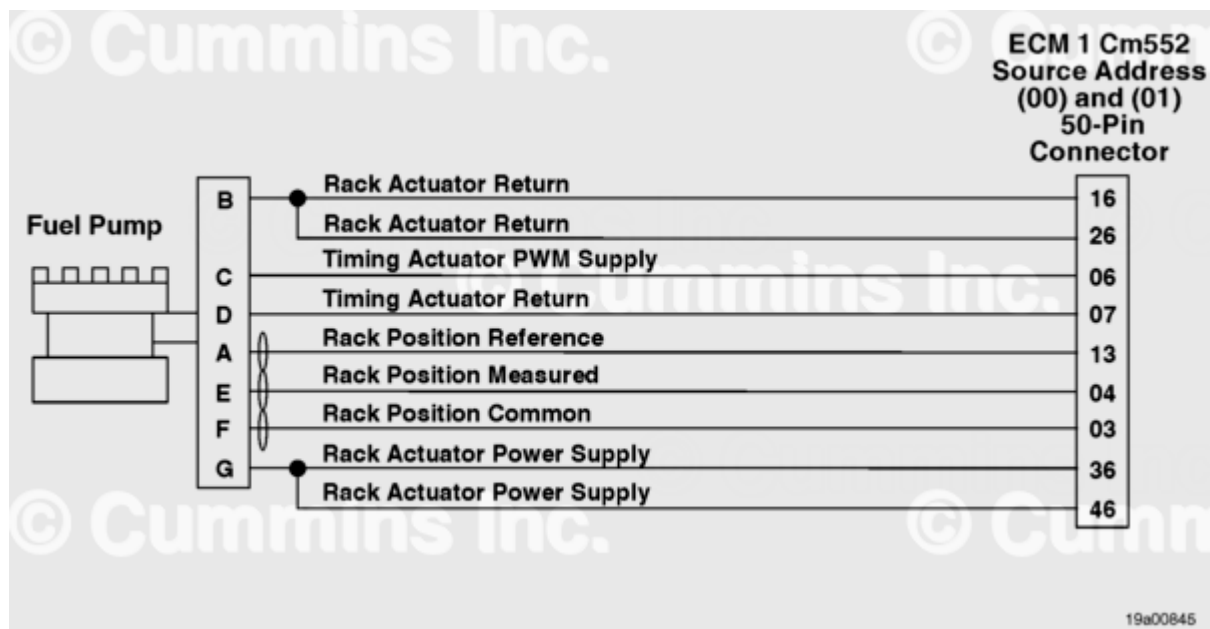

Engine Timing Actuator Driver Circuit

Circuit Description

The timing actuator circuit supplies current to the timing actuator. The ECM commands a varying amount of current to the timing actuator to control the amount of timing pressure to the injectors.

Component Location

The timing actuator is located on the electronic control valve assembly.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the generator set controller is active.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected the timing actuator circuit voltage is out of range high.

Action Taken When The Fault Code Is Active

- The generator set controller displays a warning fault immediately when the diagnostics runs and fails.

Conditions For Clearing The Fault Code

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the warning indicator immediately after the user presses reset.
- The "Reset All Faults" command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

Possible causes of this fault code include:

- Damaged or malfunctioning timing actuator.
- Damaged or loose connections.
- Malfunctioning or damaged engine wiring harness.

Refer to Troubleshooting Fault Code 113 . (</qs3/pubsys2/xml/en/procedures/60/60-t05-113.html>)