


## Fault Code: 1385

### Intake Manifold 2 Pressure Sensor Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version

#### Overview

| Codes                                                                                 | Reason                                                                         | Effect                               |
|---------------------------------------------------------------------------------------|--------------------------------------------------------------------------------|--------------------------------------|
| Fault Code: 1385<br><br>PID(P):<br>SPN: 1128<br>FMI: 3/3<br>Lamp: Maintenance<br>SRT: | High signal voltage detected at the intake manifold 2 pressure sensor circuit. | Possible reduced engine performance. |

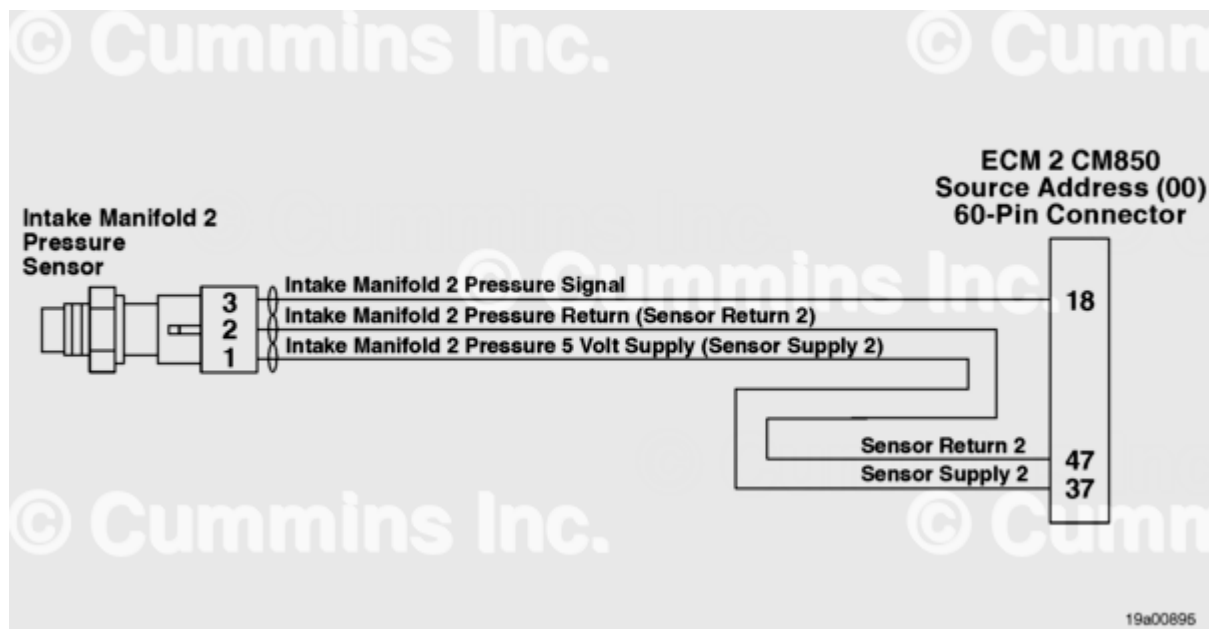

Intake Manifold 2 Pressure Sensor Circuit.

#### Circuit Description

The intake manifold pressure sensor is a variable resistance sensor used by the ECM to monitor the intake manifold pressure. The intake manifold pressure sensor has three circuits: 5 volt supply, return and signal circuits. The signal circuit voltage indicates the charged air pressure in the intake manifold.

## Component Location

The intake manifold 2 pressure sensor is located in the left bank intake manifold.

## Conditions For Running The Diagnostics

This diagnostic runs continuously when the generator set controller is active or when the engine is running.

## Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected the intake manifold 2 temperature sensor signal voltage is out of range high.

## Action Taken When The Fault Code Is Active

- The generator set controller displays a warning fault immediately when the diagnostics runs and fails.
- Intake manifold 1 pressure sensor is used for intake manifold pressure reading.

## Conditions For Clearing The Fault Code

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the warning indicator immediately after the user presses reset.
- The "Reset All Faults" command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

## Shoptalk

There are multiple ECMs for the engine models included in this manual. Each ECM has an individual source address that displays when Cummins® electronic service tool or equivalent is connected. When troubleshooting a fault code, use the source address displayed in Cummins® electronic service tool or equivalent to determine which ECM and circuit is affected.

Possible causes of this fault code include:

- Malfunctioning intake manifold 2 pressure sensor.
- Malfunctioning or damaged engine wiring harness.

Refer to Troubleshooting Fault Code 1385 . (</qs3/pubsys2/xml/en/procedures/60/60-t05-1385.html>)

