


Fault Code: 1412

Droop Adjust Potentiometer Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 1412 PID(P): S151 SPN: 4183 FMI: 3/3 Lamp: Amber SRT:	High signal voltage detected at the droop adjust potentiometer circuit.	None.

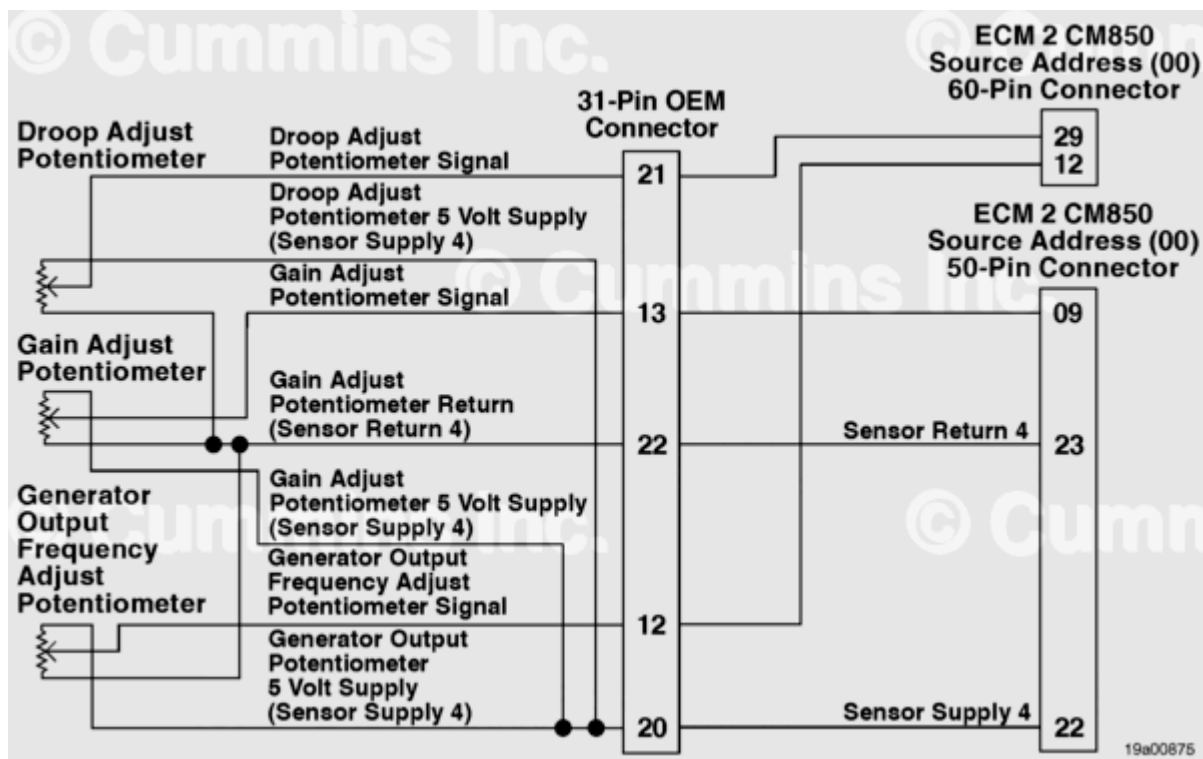

Droop Adjust Potentiometer Circuit

Circuit Description

The droop adjust potentiometer is a potentiometer used by the ECM to regulate the engine droop. The potentiometer has three circuits: 5 volt supply, return, and signal circuits. The signal circuit voltage indicates the droop adjust potentiometer input to the ECM.

Component Location

The droop adjust potentiometer is located on the generator control panel.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the generator set controller is active.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected the droop adjust potentiometer signal voltage was out of range high.

Action Taken When The Fault Code Is Active

- The generator set controller displays a warning fault immediately when the diagnostics runs and fails.
- The droop adjust potentiometer will go to the default value.

Conditions For Clearing The Fault Code

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the warning indicator immediately after the user presses reset.
- The "Reset All Faults" command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

Possible causes of this fault code include:

- A dirty droop adjust potentiometer.
- Malfunctioning droop adjust potentiometer.
- Malfunctioning or damaged engine wiring harness.
- Malfunctioning or damaged OEM wiring harness.

Refer to Troubleshooting Fault Code 1412 . (</qs3/pubsys2/xml/en/procedures/60/60-t05-1412.html>)

