


Fault Code: 223

Engine Oil Burn Valve Solenoid Driver Circuit - Voltage Below Normal or Shorted to Low Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 223 PID(P): S85 SPN: 1265 FMI: 4/4 Lamp: Amber SRT:	Low signal voltage detected at the engine oil burn valve solenoid driver circuit.	Engine control module (ECM) turns off the engine oil burn valve solenoid driver supply voltage and the system is disabled.

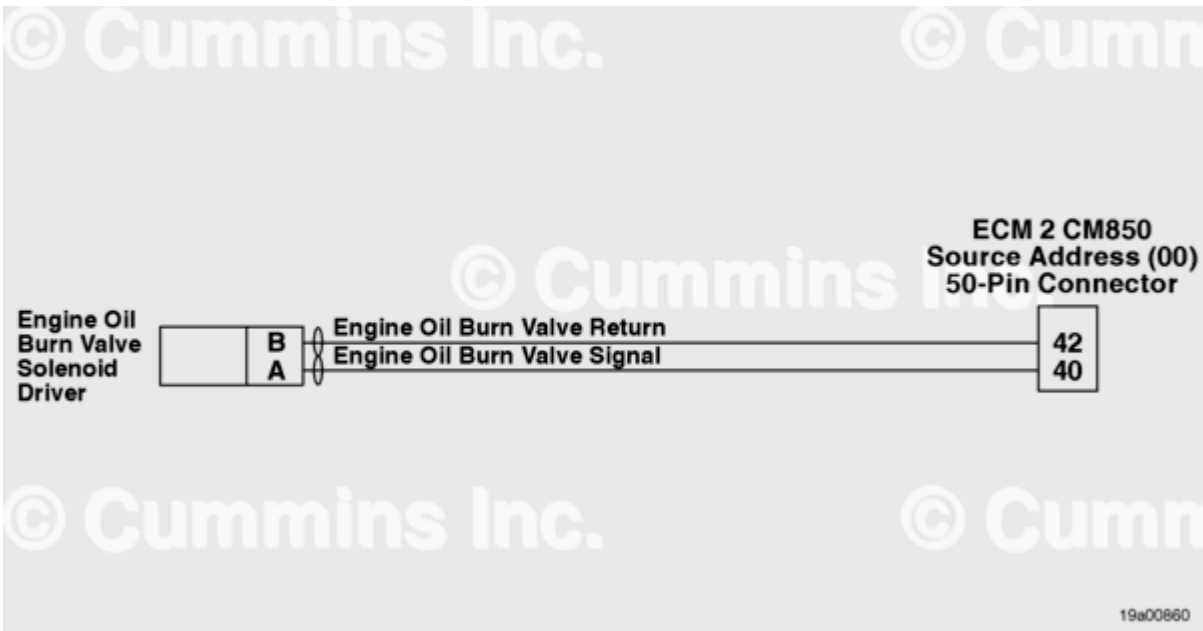

Engine Oil Burn Valve Solenoid Driver Circuit.

Circuit Description

The engine oil burn valve solenoid driver controls the flow of oil in the oil control valve during the burn cycle.

Component Location

The engine oil burn valve solenoid is located in the top of the engine oil burn valve. The location of the burn valve is OEM dependent.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the generator set controller is active.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected the engine oil burn valve solenoid driver circuit was **not** at system voltage when the driver was turned on.

Action Taken When The Fault Code Is Active

- The generator set controller displays a warning fault immediately when the diagnostics runs and fails.

Conditions For Clearing The Fault Code

- To validate the repair, perform a keycycle, start the engine and perform the Centinel™ Operational Test using the recommended Cummins® electronic service tool or equivalent.
- The generator set controller will turn off the warning indicator immediately after the user presses reset.
- The “Reset All Faults” command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

Possible causes of this fault code include:

- A damaged or malfunctioning engine oil burn valve solenoid
- Malfunctioning or damaged engine wiring harness.
- Malfunctioning or damaged OEM wiring harness.

Refer to Troubleshooting Fault Code 223 . (</qs3/pubsys2/xml/en/procedures/60/60-t05-223.html>)