

Fault Code: 2265


Electric Lift Pump for Engine Fuel Supply Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 2265 PID(P): S126 SPN: 1075 FMI: 3/3 Lamp: Amber SRT:	High voltage detected at the fuel lift pump relay signal circuit.	Engine may not start or may be difficult to start.

©Cummins Inc

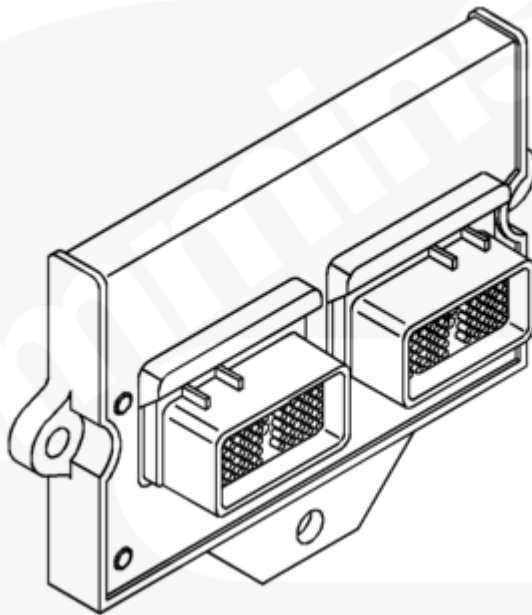

19900397

Electronic Control Module (ECM)

Circuit Description

The fuel pump relay is controlled by the engine control module (ECM), and provides power to the lift pump 1 and lift pump 2. The fuel pump relay has 4 circuits: battery 1 voltage supply, lift pump 1 supply, lift pump relay signal, and battery 1 voltage return. The ECM monitors the lift pump relay signal circuit.

Component Location

The electric lift pump is located on the right bank rear high position or on the left bank front high position.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the generator set controller is active.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected the lift pump relay signal circuit is out of range high.

Action Taken When The Fault Code Is Active

- The generator set controller displays a warning fault immediately when the diagnostics runs and fails.

Conditions For Clearing The Fault Code

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the warning indicator immediately after the user presses reset.
- The generator set controller will turn off the warning indicator immediately after the user presses reset.

Shoptalk

Possible causes of this fault code include:

A malfunctioning fuel lift pump relay.

- Malfunctioning or damaged engine wiring harness.

Refer to Troubleshooting Fault Code 2265 . (</qs3/pubsys2/xml/en/procedures/60/60-t05-2265.html>)