


Fault Code: 231

Coolant Pressure Sensor Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 231 PID(P): P109 SPN: 109 FMI: 3/3 Lamp: Amber SRT:	High signal voltage detected at the coolant pressure sensor circuit.	None on performance.

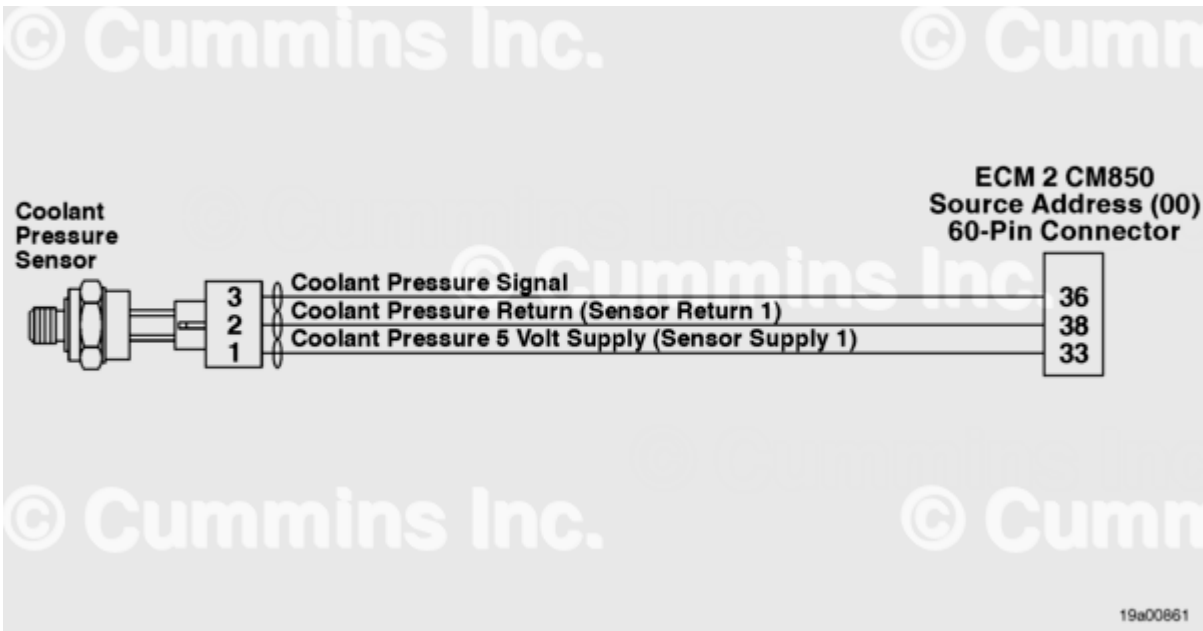

Coolant Pressure Sensor Circuit

Circuit Description

The engine coolant pressure sensor is a variable resistance sensor used by the ECM to monitor the coolant pressure. The engine coolant pressure sensor has three circuits: 5 volt supply, return and signal circuits. The signal circuit voltage indicates the coolant pressure in the engine cooling system.

Component Location

The coolant pressure sensor is located on the water pump connection to the engine block.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the generator set controller is active.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) detected the coolant pressure signal voltage was out of range high.

Action Taken When The Fault Code Is Active

- The generator set controller displays a warning fault immediately when the diagnostics runs and fails.
- The torque output of the engine will be reduced.

Conditions For Clearing The Fault Code

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the warning indicator immediately after the user presses reset.
- The "Reset All Faults" command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

Possible causes of this fault code include:

- A malfunctioning coolant pressure sensor.
- Malfunctioning or damaged engine wiring harness.

Refer to Troubleshooting Fault Code 231 . (</qs3/pubsys2/xml/en/procedures/60/60-t05-231.html>)